

15 October 2015

By Fax (3767 5922) and By Post

ARUP
Level 5, Festival Walk
80 Tat Chee Avenue
Kowloon Tong, Kowloon

Attention: Mr. Colin Meadows / Mr. Michael Chan

Dear Sirs,

**Re: Agreement No. CE 48/2011 (EP)
Environmental Project Office for the
HZMB Hong Kong Link Road, HZMB Hong Kong Boundary Crossing
Facilities, and Tuen Mun-Chek Lap Kok Link – Investigation**

**Contract No. HY/2011/09 HZMB Hong Kong Link Road –
Section between HKSAR Boundary and Scenic Hill
Revised Monthly EM&A Report for September 2015 (EP-352/2009/D)**

Reference is made to the captioned Report (Version 2.0) certified by the Environmental Team Leader (ETL) received on 14 October 2015.

We have no adverse comments on the captioned Report and verify it in accordance with Condition 4.4 of EP-352/2009/D.

Thank you for your kind attention. Please do not hesitate to contact the undersigned or the ENPO Leader, Mr. Y H Hui, should you have any queries.

Yours sincerely,
For and on behalf of
Ramboll Environ Hong Kong Limited



Antony Wong
Independent Environmental Checker
Hong Kong Link Road


c.c.	HyD	Mr. Matthew Fung	(By Fax: 3188 6614)
	HyD	Mr. K Y Yung	(By Fax: 3188 6614)
	ARUP	Mr. Eric Chan	(By Fax: 2268 3970)
	Cinotech	Dr. Priscilla Choy	(By Fax: 3107 1388)
	DCVJV	Mr. Chu Chung Sing	(By Fax: 3121 6688)

Internal: DY, YH, CL, LP, ENPO Site

Q:\Projects\HYDHZMBEEM00\02_Proj_Mgt\02_Corr\HYDHZMBEEM00_0_3472L.15.doc

Dragages -China Harbour-VSL JV

Contract HY/2011/09
Hong Kong-Zhuhai-Macao Bridge
Hong Kong Link Road-Section between
HKSAR Boundary and Scenic Hill
Monthly EM&A Report
September 2015
(Version 2.0)

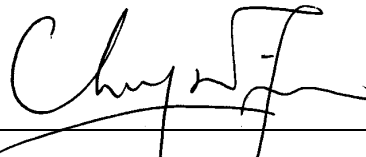Certified By 
Dr. Priscilla Choy
Environmental Team Leader
(Date: 14 October 2015)

REMARKS:

The information supplied and contained within this report is, to the best of our knowledge, correct at the time of printing.

CINOTECH accepts no responsibility for changes made to this report by third parties

CINOTECH CONSULTANTS LTD
Room 1710, Technology Park,
18 On Lai Street,
Shatin, NT, Hong Kong
Tel: (852) 2151 2083 Fax: (852) 3107 1388
Email: info@cinotech.com.hk

TABLE OF CONTENTS

	Page
EXECUTIVE SUMMARY	1
Introduction	1
Environmental Monitoring and Audit Progress	1
Breaches of Action and Limit Levels	2
Future Key Issues	3
1 INTRODUCTION	5
Purpose of the report	5
Structure of the report.....	5
2 CONTRACT INFORMATION	7
Background	7
Contract Organisation.....	8
Construction Programme.....	9
Summary of Construction Works Undertaken During Reporting Month	9
Status of Environmental Licences, Notification and Permits.....	14
3 AIR QUALITY MONITORING	16
Monitoring Requirements.....	16
Monitoring Location.....	16
Monitoring Equipment	16
Monitoring Parameters, Frequency and Duration	16
Monitoring Methodology and QA/QC Procedure.....	17
1-hour and 24-hour TSP Air Quality Monitoring	17
<i>Instrumentation</i>	17
<i>HVS Installation</i>	17
<i>Filters Preparation</i>	17
<i>Operating/Analytical Procedures</i>	17
Results and Observations	18
Event and Action Plan	19
4 NOISE MONITORING	20
Monitoring Requirements.....	20
Monitoring Location.....	20
Monitoring Equipment	20
Monitoring Parameters, Frequency and Duration	20
Monitoring Methodology and QA/QC Procedures	21
<i>Maintenance and Calibration</i>	21
Results and Observations	21
Event and Action Plan.....	22
5 WATER QUALITY MONITORING.....	23
Monitoring Requirements.....	23
Monitoring Locations	23
Monitoring Equipment	24
Monitoring Parameters, Frequency	26
Monitoring Methodology	26
<i>Instrumentation</i>	26
<i>Operating/Analytical Procedures</i>	26
<i>Laboratory Analytical Methods</i>	27

<i>QA/QC Requirements</i>	27
<i>Maintenance and Calibration</i>	28
Results and Observations	28
Event and Action Plan	29
6 DOLPHIN-RELATED MONITORING	30
Monitoring Requirements.....	30
DOLPHIN MONITORING (LINE-TRANSECT VESSEL SURVEY)	30
Monitoring Requirements.....	30
Monitoring Location.....	30
Monitoring Frequency	31
Monitoring Day	31
Monitoring Results	31
ADDITIONAL LAND-BASED DOLPHIN BEHAVIOUR AND MOVEMENT MONITORING	32
7 ENVIRONMENTAL SITE INSPECTION	33
Site Audits	33
Implementation Status of Environmental Mitigation Measures.....	33
Advice on the Solid and Liquid Waste Management Status	36
8 ENVIRONMENTAL NON-CONFORMANCE (EXCEEDANCES)	37
Summary of Exceedances	37
Summary of Notification of Summons and Successful Prosecution.....	37
9 FUTURE KEY ISSUES	38
Key Issues in the Coming Month	38
Monitoring Schedule for the Next Month	39
Construction Programme for the Next Month.....	39
10 CONCLUSIONS AND RECOMMENDATIONS	40
Conclusions	40
Recommendations	41

LIST OF TABLES

Table I	Summary Table for Monitoring Activities in the Reporting Month
Table II	Summary Table for Events Recorded in the Reporting Month
Table 2.1	Key Contacts of the Contract
Table 2.2	Status of Environmental Licences, Notification and Permits
Table 3.1	Location for Air Quality Monitoring Locations
Table 3.2	Air Quality Monitoring Equipment
Table 3.3	Impact Dust Monitoring Parameters, Frequency and Duration
Table 3.4	Summary Table of 1-hour TSP Monitoring Results during the Reporting Month
Table 3.5	Summary Table of 24-hour TSP Monitoring Results during the Reporting Month
Table 3.6	Observation at Dust Monitoring Stations
Table 4.1	Location for Noise Monitoring Locations
Table 4.2	Noise Monitoring Equipment
Table 4.3	Noise Monitoring Parameters, Frequency and Duration
Table 4.4	Summary Table of Noise Monitoring Results during the Reporting Month
Table 4.5	Observation at Noise Monitoring Stations
Table 5.1	Location for Marine Water Quality Monitoring Locations
Table 5.2	Water Quality Monitoring Equipment
Table 5.3	Water Quality Monitoring Parameters and Frequency
Table 5.4	Methods for Laboratory Analysis for Water Samples
Table 5.5	Summary of Water Quality Exceedances
Table 6.1	Co-ordinates of transect lines in WL survey area
Table 6.2	Dolphin encounter rates (sightings per 100 km of survey effort) in September's surveys
Table 6.3	Progress Record of Additional Land-based Dolphin Behaviour and Movement Monitoring in September 2015
Table 7.1	Observations and Recommendations of Site Audit

LIST OF FIGURE

Figure 1a-d	Site Layout Plan
Figure 2	Project Organisation for Environmental Works
Figure 3	Locations of Air Quality, Noise and Wind Monitoring Stations
Figure 4	Locations of Water Quality Monitoring Stations

LIST OF APPENDICES

Appendix A	Construction Programme
Appendix B	Action and Limit Levels
Appendix C	Copies of Calibration Certificates
Appendix D	Environmental Monitoring Schedules
Appendix E	1-hour TSP Monitoring Results
Appendix F	24-hour TSP Monitoring Results
Appendix G	Noise Monitoring Results
Appendix H	Water Quality Monitoring Results
Appendix I	Dolphin Monitoring Report (Line Transect)
Appendix J	Wind Data
Appendix K	Event Action Plans
Appendix L	Summary of Exceedance
Appendix M	Site Audit Summary
Appendix N	Updated Environmental Mitigation Implementation Schedule
Appendix O	Waste Generation in the Reporting Month
Appendix P	Complaint Log
Appendix Q	Summary of Successful Prosecutions

EXECUTIVE SUMMARY**Introduction**

1. This is the 32nd monthly Environmental Monitoring and Audit (EM&A) Report prepared by Cinotech Consultants Limited for the project “Contract No. HY/2011/09 – Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill” (hereinafter called the “Contract”). This report documents the findings of EM&A Works conducted in September 2015.

Environmental Monitoring and Audit Progress

2. A summary of the monitoring activities in this reporting month is listed in **Table I** below:

Table I Summary Table for Monitoring Activities in the Reporting Month

Parameter(s)	Date(s)
1-hr TSP Monitoring	4 th , 10 th , 16 th , 22 nd and 28 th September 2015
24-hr TSP Monitoring	4 th , 10 th , 16 th , 22 nd and 28 th September 2015
Noise Monitoring	1 st , 11 th , 17 th , 23 rd and 29 th September 2015
Water Quality Monitoring	2 nd , 4 th , 7 th , 9 th , 11 th , 14 th , 16 th , 18 th , 21 st , 23 rd , 25 th , 28 th and 30 th September 2015
Dolphin Monitoring (Line-transect Vessel Surveys)	7 th and 10 th September 2015
Additional Land-based Dolphin Behaviour and Movement Monitoring	4 th and 23 rd September 2015
Environmental Site Inspection	1 st , 8 th , 15 th , 22 nd and 30 th September 2015
Archaeological Site Inspection	21 st September 2015

Breaches of Action and Limit Levels

3. Summary of the environmental exceedances of the reporting month is tabulated in **Table II**.

Table II Summary Table for Events Recorded in the Reporting Month

Environmental Monitoring	Parameter	No. of Exceedance		No. of Exceedance related to the Construction Activities of this Contract	
		Action Level	Limit Level	Action Level	Limit Level
Air Quality	1-hr TSP	0	0	0	0
	24-hr TSP	0	0	0	0
Noise	L _{eq} (30min)	0	0	0	0
Water Quality	Dissolved Oxygen (DO) (Surface & Middle)	0	0	0	0
	Dissolved Oxygen (DO) (Bottom)	0	0	0	0
	Turbidity	0	0	0	0
	Suspended Solids (SS)	4	3	0	0

1-hour TSP Monitoring

4. All 1-hour TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

24-hour TSP Monitoring

5. All 24-hour TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Construction Noise

6. All construction noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Water Quality

7. All water quality monitoring was conducted as scheduled in the reporting month. There are four Action Level and three Limit Level exceedances for suspended solids were

recorded. No Action/Limit Level exceedance for dissolved oxygen and turbidity were recorded.

8. According to the investigation, no pollution discharge was observed from the site. In addition, dispersion of sediment plume to the monitoring stations from the area outside the site boundary (i.e. works area not under and related to HY/2011/09) and sediment plume due to natural fluctuation of shallow water were observed. Therefore, the exceedances are considered not due to the Contract.

Complaint Log

9. No environmental complaint was received in the reporting month.

Notification of Summons and Successful Prosecutions

10. No notification of summons and successful prosecution was received in the reporting month.

Reporting Changes

11. This report has been developed in compliance with the reporting requirements for the subsequent monthly EM&A Report as required by the EM&A Manual for Hong Kong Link Road (EM&A Manual).

Future Key Issues

12. Major site activities for the coming reporting month will include:

WA4

- Fabrication of lifting frames
- Deliveries of frame structures

WA7

- Fabrication of cofferdam frame structures
- Maintenance of Reverse Circulation Drill (RCD) equipment

Marine Viaduct (P0 to P80)

- Inter-face coring tests
- Full depth coring test
- Sonic test
- Grouting work
- Casing installation
- Installation of sheetpiles on cofferdam
- RCD excavation

Pile Cap Construction

- Installation of precast cap shells
- Concreting

- Kingpost installation and associated steel welding works
- Concreting trimming
- Rock excavation
- Steel Fixing works of pile cap

Works with Cofferdam

- Installation of waling strut
- Installation of sheet pile
- Installation of temporary working platform
- Installation of shear pin
- Installation of bored pile casing
- Excavation works and casting of concrete plug
- Dewatering works and sealing works
- Additional welding

Column Construction

- Lifting works
- Lift concreting
- Pier head works
- Pier head concreting

Precast Column Erection

- Installation of base units and precast units
- Stressing of vertical nailing tendons

Deck Erection

- Setting up of equipment
- Segment erection

Precast Segment

- Segment casting

Land Viaduct (P81 to Abutment at Scenic Hill Tunnel (SHT))

- ELS excavation
- excavation works and waling installation
- Pile cap work
- Falsework erection
- soffit formwork
- Removal of steel bracket system
- Steel fixing
- Concreting
- Removal of formwork
- Casting of Portal
- Erection of steel bracket system

1 INTRODUCTION

- 1.1 Cinotech Consultants Limited (Cinotech) was appointed by Dragages -China Harbour-VSL JV (hereinafter called “the Contractor”) as the Environmental Team (ET) to undertake the Environmental Monitoring and Audit (EM&A) programme during construction phase of the Contract No. HY/2011/09 – Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill” (hereinafter called the “Contract”) in accordance with EP Conditions 2.1.

Purpose of the report

- 1.2 This is the 32nd EM&A report which summarises the impact monitoring results and audit findings for the EM&A programme in September 2015.

Structure of the report

- 1.3 The structure of the report is as follows:

Section 1: **Introduction** - purpose and structure of the report.

Section 2: **Contract Information** - summarises background and scope of the Contract, site description, project organization and contact details, construction programme, the construction works undertaken and the status of Environmental Permits/Licenses during the reporting month.

Section 3: **Air Quality Monitoring** - summarises the monitoring parameters, monitoring programmes, monitoring methodologies, monitoring frequency, monitoring locations, Action and Limit Levels, monitoring results and Event / Action Plans.

Section 4: **Noise Monitoring** - summarises the monitoring parameters, monitoring programmes, monitoring methodologies, monitoring frequency, monitoring locations, Action and Limit Levels, monitoring results and Event / Action Plans.

Section 5: **Water Quality Monitoring** - summarises the monitoring parameters, monitoring programmes, monitoring methodologies, monitoring frequency, monitoring locations, Action and Limit Levels, monitoring results and Event / Action Plans.

Section 6: **Dolphin-Related Monitoring** - summarises the monitoring parameters, monitoring programmes, monitoring methodologies, monitoring frequency, monitoring locations and monitoring results.

Section 7: **Environmental Site Inspection** - summarises the audit findings of the weekly site inspections undertaken within the reporting month.

Section 8: **Environmental Non-conformance** - summarises any monitoring exceedance, environmental complaints, environmental summons and successful prosecutions within the reporting month.

Section 9: **Future Key Issues** - summarises the impact forecast and monitoring schedule for the next three months.

Section 10: **Conclusions and Recommendation**

2 CONTRACT INFORMATION

Background

- 2.1 The proposed Hong Kong - Zhuhai - Macao Bridge Hong Kong Link Road (HKLR) is 12km long connecting the Hong Kong-Zhuhai-Macao Bridge (HZMB) at the HKSAR Boundary with the Hong Kong Boundary Crossing Facilities (HKBCF) situated at the north eastern waters of the Hong Kong International Airport, opening a new and direct connection route between Hong Kong, Macao and the Western Pearl River Delta.
- 2.2 The HKLR comprises a 9.4km long viaduct section from the HKSAR boundary to Scenic Hill on the Airport Island; a 1km tunnel section to the reclamation formed along the east coast of the Airport Island and a 1.6km long at-grade road section on the reclamation connecting to the HKBCF. The tunnel section of HKLR will pass under Scenic Hill, Airport Road and Airport Railway to minimize the environmental and visual impacts to Tung Chung residents.
- 2.3 An application (No ESB-110/2003) for an Environmental Impact Assessment (EIA) Study Brief under Section 5(1) of the Environmental Impact Assessment Ordinance (EIAO) was submitted by Highways Department (the Project Proponent) on 8 October 2003 with a Project Profile (No. No. PP-201/2003) for the Hong Kong - Zhuhai - Macao Bridge Hong Kong Section and North Lantau Highway Connection. The Hong Kong - Zhuhai - Macao Bridge Hong Kong Section and North Lantau Highway Connection has subsequently been renamed as HKLR. EPD issued an EIA Study Brief (No: ESB-110/2003) in November 2003 to the Project Proponent to carry out an EIA study.
- 2.4 An EIA Study (Reg. No. AEIAR-144/2009) has been undertaken to provide information on nature and extent of environmental impacts arising from the construction and operation of HKLR. The Environmental Permit was issued on 4 November 2009 (Permit No. EP-352/2009). Pursuant to Section 13 of the EIAO, the Director of Environmental Protection amends the Environmental Permit (No. EP-352/2009) based on the Application No. VEP-339/2011 and the environmental Permit (Permit No. EP-352/2009/A) was issued on 9 November 2011 for HKLR to the Highways Department as the Permit Holder. Subsequently, the Director of Environmental Protection amends the Environmental Permits (No. EP-352/2009/A, EP-352/2009/B, EP-352/2009/C) based on the Application No. VEP-409/2013, VEP-411/2013 and VEP-459/2014 respectively. The environmental Permit (Permit No. EP-352/2009/D) was then issued on 22 December 2014.
- 2.5 **Figure 1a-d** shows the layout of the Contract and the scope of the Contract works comprises the following major items:
 - a dual 3-lane carriageway in the form of viaduct from the HKSAR boundary (connecting with the HZMB Main Bridge) to the Scenic Hill (connecting with the tunnel under separate Contract No. HY/2011/03), of approximately 9.4km in length with a hard shoulder for each bound of carriageway and a utilities trough on the outer edge of each bound of viaducts;
 - a grade-separated turnaround facility located near San Shek Wan, composed of sliproads in the form of viaduct with single-lane carriageway bifurcated from the HKLR mainline with an elevated junction above the mainline;

- provision of ancillary facilities including, but not limited to, meteorological enhancement measures including the provisioning of anemometers and modification of the wind profiler station at hillside of Sha Lo Wan, provisioning of a compensatory marine radar, and provisioning of security systems; and
- associated civil, structural, geotechnical, marine, environmental protection, landscaping, drainage and highways electrical and mechanical (E&M) works, street lightings, traffic aids and sign gantries, marine navigational aids, ship impact protection system, water mains and fire hydrants, lightning protection system, structural health monitoring and maintenance management system (SHM&MMS), supervisory control and data acquisition (SCADA) system, as well as operation and maintenance provisions of viaducts, provisioning of facilities for installation of traffic control and surveillance system (TCSS), provisioning of facilities for installation of telecommunication cables/equipments and reprovisioning works of affected existing facilities/utilities.

Contract Organisation

2.6 Different parties with different levels of involvement in the Contract organization include:

- Supervising Officer’s Representative (SOR) – Ove Arup & Partners Hong Kong Limited (ARUP)
- Contractor –Dragages -China Harbour-VSL JV (DCVJV)
- Environmental Team (ET) – Cinotech Consultants Ltd. (Cinotech)

2.7 The proposed project organization and lines of communication with respect to the on-site environmental management structure are shown in **Figure 2**. The key personnel contact names and numbers are summarized in **Table 2.1**.

Table 2.1 Key Contacts of the Contract

Party	Position	Position	Phone No.	Fax No.
SOR (ARUP)	CRE	Mr. Michael Chan	3767 5803	3767 5922
		Mr. Colin Meadows	3767 5801	
ENPO/IEC (Ramboll Environ)	Environmental Project Office Leader	Mr. Y. H Hui	3465 2888	3465 2899
	Independent Environmental Checker	Mr. Antony Wong	3465 2888	3465 2899
Contractor (DCVJV)	Deputy Project Director	Mr. W.K Poon	3121 6638	3121 6688
	Environmental Officer	Mr. CHU Chung Sing	3121 6672	
	24-hour Hotline	--	6898 6161	--
ET (Cinotech)	Environmental Team Leader	Dr. Priscilla Choy	2151 2089	3107 1388

2.8 Ramboll Environ Hong Kong Limited (Ramboll Environ) is employed by the Highways Department as the Independent Environmental Checker (IEC) and Environmental Project Office (ENPO) for the Project.

Construction Programme

2.9 A copy of Contractor's construction programme is provided in **Appendix A**.

Summary of Construction Works Undertaken During Reporting Month

2.10 The major site activities undertaken in the reporting month included:

Land Viaduct (P85 to Abutment at SHT) & Marine Viaduct (P81 - P84)

- (a) P81L- Pier head completed.
- (b) P81R - 5 pours of column were completed, pier head is to be constructed.
- (c) P82L - ELS excavation and concrete plug were completed.
- (d) P82R – 5 pours of column were completed.
- (e) P83L – formwork to pile cap was completed and steel fixing work in progress.
- (f) Portal Works:

Pier Location	Progress
P84	Steel fixing in progress
P85	Concreted on 22 Sep 15
P86	Concreted on 26 August 2015. Formwork and falsework removal is in progress
P89	Removal works to supporting brackets in progress
P90	Removal works to supporting brackets in progress
P91	Removal of steel cross beams and brackets were completed
P92	Removal of falsework is in progress

Marine Viaduct (P0 to P80)

Progress at P68

- (a) Right hand side (RHS): Piles R1 and R2 were cast with total 12 piles were completed.
- (b) Left hand side (LHS): Pile testing is in progress.

Progress at P69

- (a) RHS: Sheetpiling, pre-boring and shear pins works is in progress.
- (b) LHS: 1st layer waling and struts were installed with excavation started.

Progress at P75

- (a) LHS: Box was installed with inner plug concrete casted. 2 RCD's excavation commenced.

Pile Cap Construction

- (a) Precast shells installation - Nil
- (b) Stage 1 concreting was completed at P5, P10 & P56.
- (c) Stage 1 works – Nil
- (d) Stage 2 concreting was completed at P5, P6, P8, P9, P10, P26L & P56.
- (e) Stage 2 works – Nil
- (f) Kingpost installation and associated steel welding works for precast shell installation are in progress at D17R.
- (g) Advanced concrete trimming (inside casing) works were carried out at D20-L, D19-L, concrete trimming (inside cap shell) were carried out at P10.
- (h) Submerged pile cap works with cofferdam:

Pier Location	Side	Progress
P70	L	Backfilling and removal of cofferdam start on 18-Sep-15
	R	Backfilling and removal of cofferdam start on 18-Sep-15
P74	R	Concreting works of pile extension completed on 19-Sep-15 Steel fixing of pile cap is in progress
P75	L	Rock excavation is in progress
	R	Rock excavation is in progress

In-situ Column (Single) Construction

- (a) 1st lift works is in progress at P2, P11, P26, P55-Ramp & P57.
- (b) 1st lift concrete was poured at P2.
- (c) 2nd lift works is in progress: Nil
- (d) 2nd lift concrete was poured at P55, P54-Ramp and P58-Ramp.
- (e) 3rd lift works is in progress at P54-Ramp.
- (f) 3rd lift concrete was poured at P78.
- (g) 4th lift works is in progress at P78.
- (h) Pier head works is in progress: Nil
- (i) Pier head concrete was poured at P54.

Precast Column Erection

Description	Location completed in this reporting period	Number of Units erected/ Number of Columns completed in this reporting period	Cumulative No. of Piers completed (up to 28th of each month)
Commencement (i.e. starting from 1 st)	P13	25 (P13 - P16, P21, P24, P25, P27 - P44)	Commencement (i.e. starting from 1 st)

Description	Location completed in this reporting period	Number of Units erected/ Number of Columns completed in this reporting period	Cumulative No. of Piers completed (up to 28th of each month)
precast unit)			precast unit)
Completion (i.e. completed installation of pier head unit)	P24	20 (P24,P25, P27 - P44)	Completion (i.e. completed installation of pier head unit)
Vertical Tendons Stressed	P32 (50%)	16 (P28 - P30, P32 - P44)	Vertical Tendons Stressed
Grouting Vertical Tendons	P32, P33	16 (P28-P30, P32 - P44)	Grouting Vertical Tendons
Pier Head Concrete	P34, P35	11 (P34 - P44)	Pier Head Concrete

In-situ Double Blade Column Construction

Pier Location	Side	Progress
P17	L	Poured concrete up to 6 th lift and started to construct 7 th lift
	R	Poured concrete up to 6 th lift and started to construct 7 th lift
P76	L	Poured concrete up to 3 rd lift and pierhead in progress
	R	All cast in September 2015, total 4 lifts (including pierhead)
P77	L	All cast in September 2015, total 4 lifts (including pierhead)
	R	All cast in September 2015, total 4 lifts (including pierhead)
P79	L	Poured concrete up to 1 st lift and started to 2 nd lift
	R	Poured concrete up to 1 st lift and started to 2 nd lift
P80	L	Commenced in this reporting period
	R	Commenced in this reporting period

Deck Erection

(a) Setting up of Equipment:

Type of Equipment	Status
Lifting Frames 1 (LF1)	First set of LF1 assembly completed Second set of LF1 assembly almost completed
Lifting Frames 3 (LF3)	Segment erection at P64 completed Segment erection on going at P63 and P65
Launching Gantry 1 (LG1)	Segment erection from P114 to P105 completed
Launching Gantry 2 (LG2)	LG2 pylon jacks repaired Eden portal gantry commissioned Nicolas segment carrier commissioned

(b) Segment erection:

Type	Location of Segments erected in this reporting period	Number of Segments erected in this reporting period	Cumulative No. of Segments erected (up to 28th of each month)
LG1*	P105 & P104	36	366
LG2	P44	40	200
LF3	P63, P64, P65	17	49
Typical Span SOP	P39, P40, P50	12	68
Long Span SOP	P71	6	18

* includes crane erection for P109

Precast Segment

(a) Segment Casting:

- Production affected by inclement weather (3 days).
- L/S segments temporary stored at CCCC4's Machong yard.
- Off yard storage extension is in progress.
- Line 1 modification of L/S storage ground beam for MCH1 segment in progress.
- Additional offyard storage for L/S segments is under processing.

Item	Number in this reporting period	Cumulative No. of Precast Segment Completed (up to 28th of each month)
Segment Cast	202	2657

Precast Concrete Shell Casting

(a) Summary of precast shell cast in the precast yard:

Type of Shell	Number of Precast Shell Cast in this reporting period	Cumulative No. of Precast Shell Completed (up to 28th of each month)
CP1	Completed	94
CP2	Completed	12
CP3	Completed	14
CP4	Completed	8
CP5	Completed	6
CP6	Completed	4
CP11	Completed	1
CP12	Completed	1
F1 & F1A	0	2
F2 & F2A	1	2

Precast Column & Precast Pier Head Casting

- (a) All casting works were completed including recasting of pier head unit no. 2-R-H.

Delivery for Precast Concrete Elements (by barge)

- (a) Precast Deck Segments:

- Number of additional barges engaged in this period: 0
- Cumulative number of barges: 14 (2 barges tied up on L/S storage)
- Number of deck segment deliveries in this period: 34 trips
- Cumulative number of deck segment deliveries: 171 trips

Segment Types	Segment Delivered in this reporting period	Cumulative No. of Precast Segment Delivered (up to 28th of each month)
A	65	334
B	0	0
C	4	22
D	3	12
E	48	426

- (b) Precast column units:

- Number of additional barges engaged in this period: 0
- Cumulative number of barges: 2
- Number of column unit deliveries in this period: 3 trips
- Cumulative number of column unit deliveries: 38 trips

Unit Types	Number of units delivered in this reporting period	Cumulative No. of Precast Column Delivered (up to 28th of month)
3m	0	23
6m	16	110
PH1	2	28
PH2	0	14

- (c) Temporary storage of long span segments:

- 2 barges remain with long span stored with segments for P20. These barges will not unload at CCCC4 and the segments will remain stored on the barges until required for delivery to Hong Kong which is estimated to be mid October 2015.

- (d) General:

- Delivery to LG2 at P47 has been interrupted by mechanical failure of the support jacks to the launching girder during this period.

Status of Environmental Licences, Notification and Permits

2.11 A summary of the relevant permits, licences, and/or notifications on environmental protection for this Contract is presented in **Table 2.2**.

Table 2.2 Status of Environmental Licences, Notification and Permits

Permit / License No.	Valid Period		Status
	From	To	
Environmental Permit (EP)			
EP-352/2009/D	22/12/2014	N/A	Valid
Construction Noise Permit (CNP)			
P53 – P59: GW-RS0314-15	31/03/2015(00:00)	30/09/2015(07:00)	Valid
WA4: GW-RW0207-15	29/04/2015(19:00)	28/10/2015(23:00)	Valid
P100 – P111: GW-RS0487-15	07/05/2015(23:00)	06/11/2015(07:00)	Valid
P69 – P74: GW-RS0584-15	01/06/2015(00:00)	30/11/2015(24:00)	Cancelled on 8 September 2015
P101 – P114: GW-RS0715-15	07/07/2015(19:00)	31/10/2015(05:30)	Valid
P81 – 83: GW-RS0814-15	30/07/2015(19:00)	29/01/2016(24:00)	Valid
P81 – 115: GW-RS0818-15	29 /07/2015(19:00)	28/01/2016(23:00)	Valid
P75 – 80: GW-RS0829-15	30 /07/2015(19:00)	31/12/2015(24:00)	Valid
Portion A: GW-RS0884-15	23/08/2015 (07:00)	22/02/2016 (23:00)	Valid
P86: GW-RS0875-15	01/09/2015(00:00)	30/09/2015(05:30)	Valid
P0 – P68: GW-RS0931-15	24/08/2015(19:00)	23/02/2016(24:00)	Valid
P69 – P74: GW-RS0967-15	08/09/2015(19:00)	07/03/2016(24:00)	Valid
Notification pursuant to Air Pollution Control (Construction Dust) Regulation			
345773	04/06/2012	N/A	Receipt acknowledged by EPD
Billing Account for Construction Waste Disposal			
A/C# 7015341 (Construction Site)	11/06/2012	N/A	Valid
A/C# 7016948 (Vessel Disposal)	26/08/2015	30/11/2015	Valid
Registration of Chemical Waste Producer			
WPN 5213-951-D2499-01	18/07/2012	N/A	Valid
Effluent Discharge License under Water Pollution Control Ordinance			
WA6A(DCVJV site office): WT00014053-2012	12/09/2012	30/09/2017	Valid
WA6B (SOR site office): WT00014447-2012	30/10/2012	31/10/2017	Valid
WA3: WT00015118-2013	30/01/2013	31/01/2018	Valid
Portion C: WT00015356-2013	22/02/2013	28/02/2018	Valid
Portion A: WT00016076-2013	21/05/2013	31/05/2018	Valid

Permit / License No.	Valid Period		Status
	From	To	
WA4B: WT00014750-2012	12/08/2013	31/08/2018	Valid
WA7: WT00015722-2013	16/01/2013	31/01/2019	Valid
P0 – P80: WT00018203-2014	30/01/2013	31/01/2019	Valid
P114: WT00018631-2014	31/03/2014	31/03/2019	Valid
P81-P83: WT00021946-2015	08/07/2015	31/07/2020	Valid
Marine Dumping Permit			
<u>Cross-border dumping of dredged sediment of Category L and Category Mp at Erzhou Island in China</u> EP/MD/16-066	08/09/2015	07/10/2015	Valid

3 AIR QUALITY MONITORING

Monitoring Requirements

- 3.1 In accordance with the EM&A Manual, impact 1-hour TSP and 24-hour TSP monitoring were conducted to monitor the air quality for the Contract. **Appendix B** shows the established Action/Limit Levels for the air quality monitoring works.
- 3.2 Impact 1-hour TSP monitoring was conducted for at least three times every 6 days, while impact 24-hour TSP monitoring was conducted for at least once every 6 days at 2 air quality monitoring stations.

Monitoring Location

- 3.3 Impact air quality monitoring was conducted at the 2 monitoring stations under the Contract, as shown in **Figure 3**. **Table 3.1** describes the locations of the air quality monitoring stations.

Table 3.1 Location for Air Quality Monitoring Locations

Monitoring Stations	Location
AMS1	Sha Lo Wan
AMS4	San Tau

Monitoring Equipment

- 3.4 **Table 3.2** summarizes the equipment used in the impact air monitoring programme. Copies of calibration certificates are attached in **Appendix C**.

Table 3.2 Air Quality Monitoring Equipment

Equipment	Model and Make	Quantity
HVS Sampler	TISCH Model: TE-5170	2
Calibrator	TISCH Model: TE-5025A	1
Wind Anemometer	DAVIS Model: Vantage PRO2 6152CUK	1

Monitoring Parameters, Frequency and Duration

- 3.5 **Table 3.3** summarizes the monitoring parameters and frequencies of impact dust monitoring during the course of the Contract activities. The air quality monitoring schedule for the reporting month is shown in **Appendix D**.

Table 3.3 Impact Dust Monitoring Parameters, Frequency and Duration

Parameters	Frequency
1-hr TSP	Three times / 6 days
24-hr TSP	Once / 6 days

Monitoring Methodology and QA/QC Procedure

1-hour and 24-hour TSP Air Quality Monitoring

Instrumentation

- 3.6 High Volume Samplers (HVS) completed with appropriate sampling inlets were employed for air quality monitoring. Each sampler was composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complies with that required by USEPA Standard Title 40, Code of Federation Regulations Chapter 1 (Part 50).

HVS Installation

- 3.7 The following guidelines were adopted during the installation of HVS:
- Sufficient support was provided to secure the sampler against gusty wind.
 - No two samplers were placed less than 2 meters apart.
 - The distance between the sampler and an obstacle, such as buildings, was at least twice the height that the obstacle protrudes above the sampler.
 - A minimum of 2 meters of separation from walls, parapets and penthouses was required for rooftop samples.
 - A minimum of 2 meters separation from any supporting structure, measured horizontally was required.
 - No furnaces or incineration flues were nearby.
 - Airflow around the sampler was unrestricted.
 - The samplers were more than 20 meters from the drip line.
 - Any wire fence and gate, to protect the sampler, should not cause any obstruction during monitoring.
 - Permission must be obtained to set up the samples and to obtain access to the monitoring stations; and
 - A secured supply of electricity is needed to operate the samplers.

Filters Preparation

- 3.8 Filter paper of size 8” X 10” was used. A HOKLAS accredited laboratory, ETS – Testconsult Limited (ETS), was responsible for the preparation of 24-hr conditioned and pre-weighed filter papers for Cinotech’s monitoring team.
- 3.9 All filters, which were prepared by ETS, were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25 °C and not variable by more than ± 3 °C; the relative humidity (RH) was < 50% and not variable by more than ± 5 %. A convenient working RH was 40%.
- 3.10 ETS has comprehensive quality assurance and quality control programmes.

Operating/Analytical Procedures

- 3.11 Operating/analytical procedures for the air quality monitoring were highlighted as follows:

- Prior to the commencement of the dust sampling, the flow rate of the HVS was properly set (between 1.1 m³/min. and 1.4 m³/min.) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard Title 40, CFR Part 50.
- The power supply was checked to ensure the sampler worked properly.
- On sampling, the sampler was operated for 5 minutes to establish thermal equilibrium before placing any filter media at the designated air quality monitoring station.
- The filter holding frame was then removed by loosening the four nuts and carefully a weighted and conditioned filter was centered with the stamped number upwards, on a supporting screen.
- The filter was aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter. Then the filter holding frame was tightened to the filter holder with swing bolts. The applied pressure should be sufficient to avoid air leakage at the edges.
- The shelter lid was closed and secured with the aluminum strip.
- The timer was then programmed. Information was recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number).
- After sampling, the filter was removed and sent to the ETS for weighing. The elapsed time was also recorded.
- Before weighing, all filters were equilibrated in a conditioning environment for 24 hours. The conditioning environment temperature should be between 25°C and 30°C and not vary by more than ±3°C; the relative humidity (RH) should be < 50% and not vary by more than ±5%. A convenient working RH is 40%. Weighing results were returned to Cinotech for further analysis of TSP concentrations collected by each filter.

Maintenance/Calibration

3.12 The following maintenance/calibration was required for the HVS:

- The high volume motors and their accessories were properly maintained. Appropriate maintenance such as routine motor brushes replacement and electrical wiring checking were made to ensure that the equipment and necessary power supply are in good working condition.
- All HVS were calibrated (five point calibration) using Calibration Kit prior to the commencement of the baseline monitoring and thereafter at bi-monthly intervals.

Results and Observations

3.13 The monitoring results for 1-hour TSP and 24-hour TSP are summarized in **Table 3.4 and 3.5** respectively. Detailed monitoring results and graphical presentations of 1-hour and 24-hour TSP monitoring results are shown in **Appendices E and F** respectively.

Table 3.4 Summary Table of 1-hour TSP Monitoring Results during the Reporting Month

Monitoring Station	Concentration (µg/m ³)		Action Level, µg/m ³	Limit Level, µg/m ³
	Average	Range		
AMS1	32	3 – 101	381	500
AMS4	40	8 – 95	352	

Table 3.5 Summary Table of 24-hour TSP Monitoring Results during the Reporting Month

Monitoring Station	Concentration (µg/m ³)		Action Level, µg/m ³	Limit Level, µg/m ³
	Average	Range		
AMS1	40	21 – 80	170	260
AMS4	42	21 – 89	171	

- 3.14 All 1-hour TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedances were recorded.
- 3.15 All 24-hr TSP monitoring was conducted as scheduled in the reporting month. . No Action/Limit Level exceedances were recorded.
- 3.16 According to our field observations, the major dust source identified at the designated air quality monitoring stations in the reporting month are as follows:

Table 3.6 Observation at Dust Monitoring Stations

Monitoring Station	Major Dust Source
AMS1	Exhaust from marine traffic
AMS4	N/A

- 3.17 The wind speed and wind direction were recorded by the installed Wind Anemometer set at AMS4. The location is shown in **Figure 3**.
- 3.18 The wind data for the reporting month is summarized in **Appendix J**.

Event and Action Plan

- 3.19 Should non-compliance of the criteria occur, action in accordance with the Action Plan in **Appendix K** shall be carried out.

4 NOISE MONITORING

Monitoring Requirements

- 4.1 In accordance with EM&A Manual, two noise monitoring stations, namely NMS1 and NMS4 were selected for impact monitoring for the Contract. Impact noise monitoring was conducted for at least once per week during the construction phase of the Contract. **Appendix B** shows the established Action and Limit Levels for the noise monitoring works.

Monitoring Location

- 4.2 Impact noise monitoring was conducted at the 2 monitoring stations under the Contract, as shown in **Figure 3**. **Table 4.1** describes the locations of the noise monitoring stations.

Table 4.1 Location for Noise Monitoring Stations

Monitoring Stations	Location
NMS1	Sha Lo Wan
NMS4	San Tau

Monitoring Equipment

- 4.3 **Table 4.2** summarizes the noise monitoring equipment. Copies of calibration certificates are provided in **Appendix C**.

Table 4.2 Noise Monitoring Equipment

Equipment	Model and Make	Qty.
Integrating Sound Level Meter	SVAN 957	1
Calibrator	SV 30A	1

Monitoring Parameters, Frequency and Duration

- 4.4 **Table 4.3** summarizes the monitoring parameters, frequency and total duration of monitoring. The noise monitoring schedule is shown in **Appendix D**.

Table 4.3 Noise Monitoring Parameters, Frequency and Duration

Monitoring Stations	Parameter	Period	Frequency
NMS1 NMS4	L ₁₀ (30 min.) dB(A) L ₉₀ (30 min.) dB(A) L _{eq} (30 min.) dB(A) (as six consecutive L _{eq, 5min} readings)	0700-1900 hrs on normal weekdays	Once per week

Monitoring Methodology and QA/QC Procedures

- The microphone head of the sound level meter was positioned 1m exterior of the noise sensitive facade and lowered sufficiently so that the building's external wall acts as a reflecting surface.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
 - frequency weighting : A
 - time weighting : Fast
 - time measurement : $L_{eq}(30 \text{ min.}) \text{ dB(A)}$ (as six consecutive $L_{eq, 5\text{min}}$ readings) during non-restricted hours (i.e. 0700-1900 hrs on normal weekdays)
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94.0 dB at 1000 Hz. If the difference in the calibration level before and after measurement was more than 1.0 dB, the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
- During the monitoring period, the L_{eq} , L_{90} and L_{10} were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- Noise measurement was paused temporarily during periods of high intrusive noise (e.g. dog barking, helicopter noise) if possible and observation was recorded when intrusive noise was not avoided.
- Noise monitoring was cancelled in the presence of fog, rain, and wind with a steady speed exceeding 5 m/s, or wind with gusts exceeding 10 m/s. The wind speed shall be checked with a portable wind speed meter capable of measuring the wind speed in m/s.

Maintenance and Calibration

- 4.5 The microphone head of the sound level meter and calibrator were cleaned with a soft cloth at quarterly intervals.
- 4.6 The sound level meter and calibrator were checked and calibrated at yearly intervals.
- 4.7 Immediately prior to and following each noise measurement the accuracy of the sound level meter shall be checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Measurements may be accepted as valid only if the calibration levels from before and after the noise measurement agree to within 1.0 dB.

Results and Observations

- 4.8 The noise monitoring results are summarized in **Table 4.4**. Detailed monitoring results and graphical presentations of noise monitoring are shown in **Appendices G**.

Table 4.4 Summary Table of Noise Monitoring Results during the Reporting Month

Monitoring Station	Noise Level, $L_{eq(30min)}$ dB(A)		Limit Level
	Average	Range	
NMS1	70	66 – 71	75 dB(A)
NMS4	62	55 – 63	

Remark: +3dB(A) Façade correction included

- 4.9 All noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.
- 4.10 According to our field observations, the major noise source identified at the designated noise monitoring stations in the reporting month are as follows:

Table 4.5 Observation at Noise Monitoring Stations

Monitoring Station	Major Noise Source
NMS1	Air traffic & marine traffic noise
NMS4	Air traffic & marine traffic noise

Event and Action Plan

- 4.11 Should non-compliance of the criteria occur, action in accordance with the Action Plan in **Appendix K** shall be carried out.

5 WATER QUALITY MONITORING

Monitoring Requirements

- 5.1 According to EM&A Manual, impact water quality monitoring shall be carried out three days per week during the construction period. The interval between two sets of monitoring will not be less than 36 hours.
- 5.2 Replicate in-situ measurements and samples collected from each independent sampling event shall be collected to ensure a robust statistically interpretable database.
- 5.3 Impact water quality monitoring was conducted two times per monitoring day during mid ebb (within ± 1.75 hours of the predicted time) and mid flood tides (within ± 1.75 hours of the predicted time) at three depths (i.e. 1m below surface, mid-depth and 1m above seabed, except where the water depth less than 6m, mid-depth station may be omitted. Should the water depth be less than 3m, only the mid-depth station was monitored) Dissolved oxygen, Suspended solids (SS), turbidity, pH, salinity and temperature were monitored in accordance with the requirements set out in the EM&A Manual.
- 5.4 The proposal for changing Action and Limit Levels for water quality monitoring was submitted to EPD on 15 March 2013. No objection was received from EPD according to the letter (ref. (10) in Ax(3) to EP2/G/A/129pt.4) dated 25 March 2013. Therefore, the updated Action and Limit Levels for water quality monitoring was used for comparison starting from 25 March 2013.
- 5.5 **Appendix B** shows the established Action/Limit Levels for the water quality monitoring works.

Monitoring Locations

- 5.6 Impact water quality monitoring was conducted at 14 monitoring stations under the Contract which are summarized in **Table 5.1**. The monitoring station is also shown in **Figure 4**.

Table 5.1 Location for Marine Water Quality Monitoring Locations

Monitoring Stations	Coordinates	
	Easting	Northing
IS1	803474	815060
IS2	804851	815715
IS3	806502	815743
IS4	807008	816986
CS1	801784	812711
CS2	805849	818780
SR1	803126	812379
SR2	807856	816953
SR3	810525	816456
SR6	805837	821818
ST1	802677	816006
ST2	804055	818840

Monitoring Stations	Coordinates	
	Easting	Northing
ST3	800667	810126
SRA	809872	817152

Monitoring Equipment

Instrumentation

- 5.7 A multi-parameter meters (Model YSI 6820-C-M) were used to measure DO, turbidity, salinity, pH and temperature.

Dissolved Oxygen (DO) and Temperature Measuring Equipment

- 5.8 The instrument for measuring dissolved oxygen and temperature was portable and weatherproof complete with cable, sensor, comprehensive operation manuals and use DC power source. It was capable of measuring:

- a dissolved oxygen level in the range of 0-20 mg/L and 0-200% saturation; and
- a temperature of 0-45 degree Celsius.

- 5.9 It has a membrane electrode with automatic temperature compensation complete with a cable.

- 5.10 Sufficient stocks of spare electrodes and cables were available for replacement where necessary.

- 5.11 Salinity compensation was built-in in the DO equipment.

Turbidity

- 5.12 Turbidity was measured in situ by the nephelometric method. The instrument was portable and weatherproof using a DC power source complete with cable, sensor and comprehensive operation manuals. The equipment was capable of measuring turbidity between 0-1000 NTU. The probe cable was not less than 25m in length. The meter was calibrated in order to establish the relationship between NTU units and the levels of suspended solids. The turbidity measurement was carried out on split water sample collected from the same depths of suspended solids samples.

Sampler

- 5.13 A water sampler, consisting of a transparent PVC or glass cylinder of a capacity of not less than two litres which can be effectively sealed with cups at both ends was used. The water sampler has a positive latching system to keep it open and prevent premature closure until released by a messenger when the sampler was at the selected water depth.

Water Depth Detector

- 5.14 A portable, battery-operated echo sounder was used for the determination of water depth

at each designated monitoring station.

pH

- 5.15 The instrument was consisting of a potentiometer, a glass electrode, a reference electrode and a temperature-compensating device. It was readable to 0.1pH in a range of 0 to 14. Standard buffer solutions of at least pH 7 and pH 10 were used for calibration of the instrument before and after use.

Salinity

- 5.16 A portable salinometer capable of recording salinity within the range of 0-40 ppt was used for salinity measurements.

Monitoring Position Equipment

- 5.17 A hand held Differential Global Positioning System (DGPS) was used during water quality monitoring to ensure the monitoring vessel is at the correct location before taking measurements.

Sample Container and Storage

- 5.18 Following collection, water samples for laboratory analysis were stored in high density polythene bottles (250ml/1L) with no preservatives added, packed in ice (cooled to 4°C without being frozen) and kept in dark during both on-site temporary storage and shipment to the testing laboratory. The samples were delivered to the laboratory as soon as possible and the laboratory determination works were started within 24 hours after collection of the water samples. Sufficient volume of samples was collected to achieve the detection limit.

Calibration of In Situ Instruments

- 5.19 All in situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or other international accreditation scheme before use, and subsequently re-calibrated at 3 monthly intervals throughout all stages of the water quality monitoring programme. Responses of sensors and electrodes were checked with certified standard solutions before each use. Wet bulb calibration for a DO meter was carried out before measurement at each monitoring event.
- 5.20 For the on site calibration of field equipment (Multi-parameter Water Quality System), the BS 1427:2009, "Guide to on-site test methods for the analysis of waters" was observed.
- 5.21 Sufficient stocks of spare parts were maintained for replacements when necessary. Backup monitoring equipment was also being made available so that monitoring can proceed uninterrupted even when some equipment was under maintenance, calibration, etc.
- 5.22 The equipment used for impact water quality monitoring is shown in **Table 5.2** and copies of the calibration certificates are shown in **Appendix C**. All the monitoring

equipment complied with the requirements set out in the EM&A Manual.

Table 5.2 Water Quality Monitoring Equipment

Equipment	Model and Make	Qty
Sonar Water Depth Detector	Garmin Fishfinder 140	2
Monitoring Position Equipment	KODEN DGPS (KGP913MKIID, GA-08 & BA-03)	2
Multi-parameter Water Quality System	YSI 6820-C-M and YSI 6920-M	2
Water Sampler	Kahlsico Water-Bottle Model 135DW 150	2

Monitoring Parameters, Frequency

5.23 **Table 5.3** summarizes the monitoring parameters, monitoring period and frequencies of the water quality monitoring. The water quality monitoring schedule for the reporting month is shown in **Appendix D**.

Table 5.3 Water Quality Monitoring Parameters and Frequency

Monitoring Stations	Parameters, unit	Depth	Frequency
IS1, IS2, IS3 IS4, CS1, CS2, SR1, SR2, SR3, SR6, ST1, ST2, ST3, SRA	<ul style="list-style-type: none"> Temperature(°C) pH(pH unit) turbidity (NTU) water depth (m) salinity (ppt) dissolved oxygen (DO) (mg/L and % of saturation) suspended solids (SS) (mg/L) 	<ul style="list-style-type: none"> 3 water depths: 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted. 	<ul style="list-style-type: none"> Impact monitoring: 3 days per week, at mid-flood and mid-ebb tides during the construction period of the Contract

5.24 Monitoring location/position, time, water depth, sampling depth, pH, salinity, DO saturation, water temperature, tidal stages, weather conditions and any special phenomena or work underway nearby were recorded.

Monitoring Methodology

Instrumentation

5.25 A multi-parameter meters (Model YSI 6820-C-M) were used to measure DO, turbidity, salinity, pH and temperature.

Operating/Analytical Procedures

5.26 The monitoring stations were accessed by the guide of a hand-held Differential Global Positioning System (DGPS) during water quality monitoring in accordance with the EM&A Manual. The depth of the monitoring location was measured using depth meter

in order to determine the sampling depths. Afterwards, the probes of the in-situ measurement equipment were lowered to the predetermined depths (1 m below water surface, mid-depth and 1 m above seabed) and the measurements were carried out accordingly.

- 5.27 At each measurement, two consecutive measurements of DO concentration, DO saturation, salinity, turbidity, pH and temperature were taken. The probes were retrieved out of the water after the first measurement and then re-deployed for the second measurement. Where the difference in the value between the first and second readings of each set was more than 25% of the value of the first reading, the reading was discarded and further readings were taken.
- 5.28 Water sampler was lowered into the water to the required depths of sampling. Upon reaching the pre-determined depth, a messenger to activate the sampler was then released to travel down the wire. The water sample was sealed within the sampler before retrieving. At each station, water samples at three depths (1 m below water surface, mid-depth and 1 m above seabed) were collected accordingly. Water samples were stored in a cool box and kept at less than 4°C but without frozen and sent to the laboratory as soon as possible. In addition, field information as described in Section 5.23 was also recorded.

Laboratory Analytical Methods

- 5.29 The testing of all parameters was conducted by CMA Testing and Certification Laboratories (HOKLAS Registration No.004) and comprehensive quality assurance and control procedures in place in order to ensure quality and consistency in results. The testing method, reporting limit and detection limit are provided in **Table 5.4**.

Table 5.4 Methods for Laboratory Analysis for Water Samples

Determinant	Instrumentation	Analytical Method	Detection Limit
Suspended Solid (SS)	Weighing	APHA 21e 2540D	0.5 mg/L

QA/QC Requirements

Decontamination Procedures

- 5.30 Water sampling equipment used during the course of the monitoring programme was decontaminated by manual washing and rinsed clean seawater/distilled water after each sampling event. All disposal equipment was discarded after sampling.

Sampling Management and Supervision

- 5.31 All sampling bottles were labelled with the sample I.D (including the indication of sampling station and tidal stage e.g. IS1_me_a), laboratory number and sampling date. Water samples were dispatched to the testing laboratory for analysis as soon as possible after the sampling. All samples were stored in a cool box and kept at less than 4°C but without frozen. All water samples were handled under chain of custody protocols and relinquished to the laboratory representatives at locations specified by the laboratory.

5.32 The laboratory determination works were started within 24 hours after collection of the water samples.

Quality Control Measures for Sample Testing

5.33 The samples testing were performed by CMA Testing and Certification Laboratories.

5.34 The following quality control programme was performed by the CMA Testing and Certification Laboratories for every batch of 20 samples:

- ✧ One set of quality control (QC) samples.

Maintenance and Calibration

5.35 All in situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or other international accreditation scheme before use, and subsequently re-calibrated at 3 monthly intervals throughout all stages of the water quality monitoring programme.

Results and Observations

5.36 The monitoring results and graphical presentation of water quality at the monitoring stations is shown in **Appendix H**.

5.37 The summary of exceedance record in reporting month is shown in **Appendix L** and summarized in the **Table 5.5**.

Table 5.5 Summary of Water Quality Exceedances

Station	Exceedance Level	DO (Surface & Middle)		DO(Bottom)		Turbidity		SS		Total Number of Exceedances	
		Mid-Ebb	Mid-Flood	Mid-Ebb	Mid-Flood	Mid-Ebb	Mid-Flood	Mid-Ebb	Mid-Flood	Mid-Ebb	Mid-Flood
IS1	Action Level								02/09/2015	0	1
	Limit Level							02/09/2015		1	0
IS2	Action Level								02/09/2015	0	1
	Limit Level									0	0
IS3	Action Level									0	0
	Limit Level									0	0
IS4	Action Level									0	0
	Limit Level									0	0
SR1	Action Level							04/09/2015		1	0
	Limit Level									0	0
SR2	Action Level									0	0
	Limit Level									0	0
SR3	Action Level									0	0
	Limit Level									0	0
SR6	Action Level									0	0
	Limit Level							02/09/2015		0	1
ST1	Action Level								02/09/2015	0	1
	Limit Level									0	0
ST2	Action Level									0	0
	Limit Level							02/09/2015		0	1
ST3	Action Level									0	0
	Limit Level									0	0
SRA	Action Level									0	0
	Limit Level									0	0
Total	Action Level	0	0	0	0	0	0	1	3		
	Limit Level	0	0	0	0	0	0	1	2		

5.38 All water quality monitoring was conducted as scheduled in the reporting month. There are four Action Level and three Limit Level exceedances for suspended solids were recorded. No Action/Limit Level exceedance for dissolved oxygen and turbidity were recorded.

5.39 According to the investigation, no pollution discharge was observed from the site. In addition, dispersion of sediment plume to the monitoring stations from the area outside the site boundary (i.e. works area not under and related to HY/2011/09) and sediment plume due to natural fluctuation of shallow water were observed. Therefore, the exceedances are considered not due to the Contract.

Event and Action Plan

5.40 Should non-compliance of the criteria occur, action in accordance with the Action Plan in **Appendix K** shall be carried out.

6 DOLPHIN-RELATED MONITORING

Monitoring Requirements

- 6.1 According to Section 10 of the EM&A Manual, four kinds of ecological monitoring works are required during the construction phase, namely dolphin monitoring, construction-phase underwater noise monitoring, dolphin behavior monitoring and land-based dolphin behavior and movement monitoring. The 30 days of construction-phase underwater noise monitoring, dolphin behavior monitoring and land-based dolphin behavior and movement monitoring were completed in July 2013.
- 6.2 The monitoring work shall be undertaken by suitably qualified specialist(s), (i.e. dolphin specialist and bio-acoustician), who shall have sufficient (at least 5-10 years) relevant post-graduate experience and publication in the respective aspects. They should be approved by Agriculture, Fisheries and Conservation Department (AFCD) and Environmental Protection Department (EPD).

Dolphin Monitoring (Line-transect Vessel Survey)

Monitoring Requirements

- 6.3 According to EM&A Manual Section 10.3.2, a dolphin monitoring programme should be set up to verify the predictions of impacts and to ensure that there are no unforeseen impacts on the dolphin population during construction phase.
- 6.4 Following the requirement in the EM&A Manual Section 10.4.1, the dolphin monitoring should adopt line-transect vessel survey method, and cover the following line-transect survey areas as in AFCD annual marine mammal monitoring programme.

Monitoring Location

- 6.5 For this contract, dolphin monitoring will be carried out in the West Lantau (WL) along the line transect as depicted in **Figure 1** of **Appendix I**. The co-ordinates of all transect lines are shown in **Table 6.1**.

Table 6.1 Co-ordinates of transect lines in WL survey area

Line No.		Easting	Northing	Line No.		Easting	Northing
1	Start Point	803750	818500	7	Start Point	800200	810450
1	End Point	803750	815500	7	End Point	801400	810450
2	Start Point	803750	815500	8	Start Point	801300	809450
2	End Point	802940	815500	8	End Point	799750	809450
3	Start Point	802550	814500	9	Start Point	799400	808450
3	End Point	803700	814500	9	End Point	801430	808450
4	Start Point	803120	813600	10	Start Point	801500	807450
4	End Point	801640	813600	10	End Point	799600	807450

Line No.		Easting	Northing	Line No.		Easting	Northing
5	Start Point	801100	812450	11	Start Point	800300	806500
5	End Point	802900	812450	11	End Point	801750	806500
6	Start Point	802400	811500	12	Start Point	801760	805450
6	End Point	800660	811500	12	End Point	800700	805450

Monitoring Frequency

6.6 Dolphin transect survey was carried out at least twice a month (i.e. complete all the transect lines of West Lantau survey area twice per month) throughout the construction period.

Monitoring Day

6.7 Dolphin monitoring was carried out on 7th and 10th September 2015. The dolphin monitoring schedule for the reporting period is shown in **Appendix D**.

Monitoring Results

6.8 From these surveys, a total of 65.34 km of survey effort was collected, with 97.7% of the total survey effort being conducted under favorable weather conditions (i.e. Beaufort Sea State 3 or below with good visibility) Out of the 65.34 km of survey effort, the total survey effort conducted on primary lines (the horizontal lines perpendicular to the coastlines) was 44.05 km.

6.9 5 groups of 24 Chinese White Dolphins were sighted from primary lines. Distribution of the 8 dolphin sightings made during September’s surveys is shown in **Figure 4 of Appendix I**. Six of the eight dolphin sightings were concentrated at the southern portion of the survey area (i.e. between Peaked Hill and Fan Lau), while the other two sightings were located to the north of the HKLR09 alignment and near Tai O Peninsula respectively. Notably, a group of five dolphins was sighted just a few kilometres to the north of the HKLR09 alignment (**Figure 4 of Appendix I**).

6.10 Dolphin encounter rates deduced from the survey effort and on-effort sighting data made under favourable conditions (Beaufort 3 or below) are shown in **Table 6.2**.

Table 6.2 Dolphin encounter rates (sightings per 100 km of survey effort) in September’s surveys

		Encounter rate (STG) (no. of on-effort dolphin sightings per 100 km of survey effort)	Encounter rate (ANI) (no. of dolphins from all on-effort sightings per 100 km of survey effort)
		Primary Lines Only	Primary Lines Only
WL	Set 1: September 7 th	4.5	31.4
	Set 2: September 10 th	14.2	47.3

6.11 The average group size of Chinese White Dolphins was 4.0 individuals per group during September’s surveys, which was slightly higher than the ones in previous months of monitoring surveys.

- 6.12 Half of the dolphin groups were composed of only 1-3 animals, while there were three larger groups with 6-7 animals pre group.
- 6.13 During this month of dolphin monitoring, marine construction activities have continued under this contract. However, no adverse impact on Chinese white dolphins was noticeable from general observations.
- 6.14 Evaluation of impacts on dolphins due to construction work will be conducted in the quarterly EM&A report.
- 6.15 Detailed monitoring methodology and results can be found in **Appendix I**.

Additional Land-based Dolphin Behaviour and Movement Monitoring

- 6.16 Additional land-based dolphin behavior and movement monitoring was conducted on 4th and 23rd September 2015 in the reporting month. The progress of the monitoring is summarized in the **Table 6.3**.

Table 6.3 Progress Record of Additional Land-based Dolphin Behaviour and Movement Monitoring in September 2015

Date	Time	Weather		Number of Staff	Number of Dolphin Sighting
		Beaufort	Visibility		
04/09/2015	08:59 - 14:31	2	1.5	3	3
23/09/2015	09:02 - 14:30	2	1.5	3	1

- 6.17 Detailed monitoring methodology and results will be provided in a separate report after the completion of full set of additional land-based dolphin behavior and movement monitoring.

7 ENVIRONMENTAL SITE INSPECTION

Site Audits

- 7.1 Site audits were carried out by ET on weekly basis to monitor the timely implementation of proper environmental management practices and mitigation measures in the Contract site. The summaries of site audits are attached in **Appendix M**.
- 7.2 Site audits were conducted on 1st, 8th, 15th, 22nd and 30th September 2015 by ET after the commencement of construction works for the Contract. A joint site audit with the representative with IEC, SOR, the Contractor and the ET was carried out on 30th September 2015. The details of observations during site audit can refer to **Table 7.1**.
- 7.3 According to EP condition 4.7 and EM&A Manual, periodic monitoring (every three months) of construction works shall be conducted to ensure the avoidance of any impacts on Sha Lo Wan (West) Archaeological Site. Access to Sha Lo Wan (West) Archaeological site for works areas and storage of construction equipment is not allowed. The 11th inspection to the Sha Lo Wan (West) Archaeological Site was conducted on 21st September 2015 and next inspection will be conducted in December 2015.

Implementation Status of Environmental Mitigation Measures

- 7.4 According to the EIA Study Report, Environmental Permit and the EM&A Manual, the mitigation measures detailed in the documents are recommended to be implemented during the construction phase. An updated summary of the EMIS is provided in **Appendix N**.
- 7.5 Regular marine travel route for marine vessels were implemented properly in accordance with the submitted plan and relevant records were kept properly.
- 7.6 Acoustic decoupling measures for the stationary equipment (generators, winch generators and air compressors) mounted on boards were adopted according to EP Condition 3.7 and EM&A Manual, Section 10.2.18.
- 7.7 Dolphin exclusion zone and dolphin watching plan according to EM&A Manual, Section 10.2.12 and EP Condition 3.5 was implemented by DCVJV's trained dolphin watcher.
- 7.8 Spill kits and booms are ready on site for the event of accidental spillage of oil or other hazardous chemicals from construction activities including vessels operating for the Contract.
- 7.9 During site inspections in the reporting month, no non-conformance was identified. The observations and recommendations made during the audit sessions are summarized in **Table 7.1**.

Table 7.1 Observations and Recommendations of Site Audit

Parameters	Date	Observations and Recommendations	Follow-up
<i>Water Quality</i>	01/09/2015	Sedimentation facilities according to the wastewater discharge license at P81 and P82 was not operated. The Contractor was reminded to rectify it as soon as possible.	Rectification/improvement was not observed during the follow-up audit sessions. Further follow-up on this item is required.
	01/09/2015	To check the designated discharging location for treated effluent at Portion C.	Rectification/improvement was observed during the follow-up audit session on 8 September 2015.
	08/09/2015	Properly deploy the silt curtain at P74, P69 and P70.	Rectification/improvement was observed during the follow-up audit session on 15 September 2015.
	08/09/2015	Ensure the wetsep at P81 is functioning properly to treat the muddy water.	Rectification/improvement was not observed during the follow-up audit sessions. Further follow-up on this item is required.
	15/09/2015	Clear the accumulated concrete debris at the platform at P20.	Rectification/improvement was observed during the follow-up audit session on 22 September 2015.
	15/09/2015	Clear the discarded iron bar at the seawall area at P100.	Rectification/improvement was observed during the follow-up audit session on 22 September 2015.
	15/09/2015	Clear the foam box and wooden board at the seawall area at P96.	Rectification/improvement was observed during the follow-up audit session on 22 September 2015.
	30/09/2015	Floating rubbish was observed near P75. The Contractor was reminded to clear it properly.	Rectification/improvement was observed during the follow-up audit session on 6 October 2015.
	30/09/2015	The Contractor was reminded to improve the discharge quality at P82/P83.	Rectification/improvement was not observed during the follow-up audit sessions. Further follow-up on this item is required.
<i>Ecology</i>	01/09/2015	To erect the fencing for protecting tree and clear the construction wastes / materials within the tree protection zone at between P86&P87, P91 and S8 entrance.	Rectification/improvement was not observed during the follow-up audit session on 15 September 2015.
	22/09/2015	To remove the construction materials under the retained trees and provide a proper tree protection zone.	Rectification/improvement was observed during the follow-up audit session on 30 September 2015.
<i>Air Quality</i>	01/09/2015	Provide maintenance of the crane to avoid emitting heavy smoke at P71.	Rectification/improvement was observed during the follow-up audit session on 8 September 2015.
	15/09/2015	Provide water spray for the dry exposed site area at Portion C.	Rectification/improvement was observed during the follow-up audit session on 22 September 2015.

Parameters	Date	Observations and Recommendations	Follow-up
<i>Noise</i>	01/09/2015	To close the door of the crane at P71.	Rectification/improvement was observed during the follow-up audit session on 8 September 2015.
<i>Waste / Chemical Management</i>	01/09/2015	To seal the hole of the drip tray at P71.	Rectification/improvement was observed during the follow-up audit session on 8 September 2015.
	01/09/2015	Provide spill kit for oil leakage at P71.	Rectification/improvement was observed during the follow-up audit session on 8 September 2015.
	01/09/2015	Properly store the chemical containers at between P105 and P106.	Rectification/improvement was observed during the follow-up audit session on 8 September 2015.
	08/09/2015	Provide spill kit at the platform at P74.	Rectification/improvement was observed during the follow-up audit session on 15 September 2015.
	08/09/2015	Clear the construction wastes at P70.	Rectification/improvement was observed during the follow-up audit session on 15 September 2015.
	08/09/2015	Clear the oil spillage and maintenance of equipment are required to avoid oil leakage at P69.	Rectification/improvement was observed during the follow-up audit session on 15 September 2015.
	08/09/2015	Clear the damaged handrail at near the seawall area at P87.	Rectification/improvement was observed during the follow-up audit session on 15 September 2015.
	15/09/2015	Clear the rubbish which was not disposed properly at the platform at P20.	Rectification/improvement was observed during the follow-up audit session on 22 September 2015.
	15/09/2015	Provide drip tray for the chemical containers at the platform at P20.	Rectification/improvement was observed during the follow-up audit session on 22 September 2015.
	22/09/2015	Properly store the chemical containers at Portion C.	Rectification/improvement was observed during the follow-up audit session on 30 September 2015.
	<i>Landscape & Visual Impact</i>	N/A ⁽¹⁾	N/A ⁽¹⁾
<i>Permits/Licences</i>	08/09/2015	Provide valid construction noise permit at P70.	Rectification/improvement was observed during the follow-up audit session on 15 September 2015.
<i>Other</i>	N/A ⁽¹⁾	N/A ⁽¹⁾	N/A ⁽¹⁾
<i>Cultural Heritage (Sha Lo Wan (West) Archaeological Site)</i>	21/09/2015	N/A ⁽¹⁾	N/A ⁽¹⁾

Remark: N/A⁽¹⁾ - No major environmental deficiency was identified during the site inspection in the reporting month.

Advice on the Solid and Liquid Waste Management Status

- 7.10 According to the Contractor, 555m³ inert C&D materials were generated during the reporting month.
- 7.11 The Contractor was advised to minimize the wastes generated through the recycling or reusing. All mitigation measures stipulated in approved waste management plan shall be fully implemented.
- 7.12 The amount of wastes generated by the activities of the Contract during the reporting month is shown in **Appendix O**.

8 ENVIRONMENTAL NON-CONFORMANCE (EXCEEDANCES)

Summary of Exceedances

- 8.1 Summary of exceedance is provided in **Appendix L**.
- 8.2 No Action/Limit Level exceedance was recorded for air quality and construction noise.
- 8.3 There are four Action Level and three Limit Level exceedances for suspended solids were recorded. No Action/Limit Level exceedance for dissolved oxygen and turbidity were recorded.
- 8.4 According to the investigation, no pollution discharge was observed from the site. In addition, dispersion of sediment plume to the monitoring stations from the area outside the site boundary (i.e. works area not under and related to HY/2011/09) and sediment plume due to natural fluctuation of shallow water were observed. Therefore, the exceedances are considered not due to the Contract.

Summary of Environmental Complaint

- 8.5 No environmental related complaint was received in the reporting month. The Complaint Log is attached in **Appendix P**.

Summary of Notification of Summons and Successful Prosecution

- 8.6 There was one prosecution or notification of summons received since the Contract commencement. Summary of successful prosecution as attached in **Appendix Q**.

9 FUTURE KEY ISSUES

Key Issues in the Coming Month

9.1 Major site activities for the coming reporting month will include:

WA4

- Fabrication of lifting frames
- Deliveries of frame structures

WA7

- Fabrication of cofferdam frame structures
- Maintenance of Reverse Circulation Drill (RCD) equipment

Marine Viaduct (P0 to P80)

- Inter-face coring tests
- Full depth coring test
- Sonic test
- Grouting work
- Casing installation
- Installation of sheetpiles on cofferdam
- RCD excavation

Pile Cap Construction

- Installation of precast cap shells
- Concreting
- Kingpost installation and associated steel welding works
- Concreting trimming
- Rock excavation
- Steel Fixing works of pile cap

Works with Cofferdam

- Installation of waling strut
- Installation of sheet pile
- Installation of temporary working platform
- Installation of shear pin
- Installation of bored pile casing
- Excavation works and casting of concrete plug
- Dewatering works and sealing works
- Additional welding

Column Construction

- Lifting works
- Lift concreting
- Pier head works
- Pier head concreting

Precast Column Erection

- Installation of base units and precast units
- Stressing of vertical nailing tendons

Deck Erection

- Setting up of equipment
- Segment erection

Precast Segment

- Segment casting

Land Viaduct (P81 to Abutment at Scenic Hill Tunnel (SHT))

- ELS excavation
- excavation works and waling installation
- Pile cap work
- Falsework erection
- soffit formwork
- Removal of steel bracket system
- Steel fixing
- Concreting
- Removal of formwork
- Casting of Portal
- Erection of steel bracket system

Monitoring Schedule for the Next Month

- 9.2 The tentative environmental monitoring schedule for the next month is shown in **Appendix D**.

Construction Programme for the Next Month

- 9.3 A tentative construction programme is provided in **Appendix A**.

10 CONCLUSIONS AND RECOMMENDATIONS

Conclusions

- 10.1 The Environmental Monitoring and Audit (EM&A) Report presents the EM&A works undertaken in September 2015 in accordance with EM&A Manual.
- 10.2 No Action/Limit Level exceedance was recorded for air quality and construction noise.
- 10.3 There are four Action Level and three Limit Level exceedances for suspended solids were recorded. No Action/Limit Level exceedance for dissolved oxygen and turbidity were recorded.
- 10.4 According to the investigation, no pollution discharge was observed from the site. In addition, dispersion of sediment plume to the monitoring stations from the area outside the site boundary (i.e. works area not under and related to HY/2011/09) and sediment plume due to natural fluctuation of shallow water were observed. Therefore, the exceedances are considered not due to the Contract.
- 10.5 Dolphin transect survey was carried out on 7th and 10th September 2015. No adverse impact on Chinese White Dolphins was noticeable from general observations.
- 10.6 Two days of additional Land-based Dolphin Behaviour and Movement Monitoring were conducted on 4th and 23rd September 2015.
- 10.7 Environmental site inspection was conducted on 1st, 8th, 15th, 22nd and 30th September 2015 by ET in the reporting month. All deficiencies identified during the site inspection have already rectified / improved during the follow-up audit session.
- 10.8 The inspection to the Sha Lo Wan (West) Archaeological Site was conducted on 21st September 2015. No access to Sha Lo Wan (West) Archaeological site for works areas and storage of construction equipment was observed.
- 10.9 There was no environmental complaint, no notification of summons and successful prosecution received in the reporting month.
- 10.10 The ET will keep track on the EM&A programme to ensure compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

Recommendations

10.11 According to the environmental audit performed in the reporting month, the following recommendations were made:

Air Quality Impact

- To regularly maintain the quality of machinery and vehicles on site.
- To implement dust suppression measures on all haul roads, stockpiles, dry surfaces and excavation works.
- To provide hoarding along the entire length of that portion of the site boundary.

Noise Impact

- To inspect the noise sources inside the site.
- To space out noisy equipment and position the equipment as far away as possible from sensitive receivers.
- To provide temporary noise barriers for operations of noisy equipment near the noise sensitive receivers, if necessary.

Water Impact

- To prevent any surface runoff discharge into any stream course and sea.
- To review and implement temporary drainage system.
- To identify any wastewater discharges from site.
- To ensure properly maintenance for de-silting facilities.
- To clear the silt and sediment in the sedimentation tanks.
- To review the capacity of de-silting facilities for discharge.
- To divert all the water generated from construction site to de-silting facilities with enough handling capacity before discharge.
- To avoid accumulation of stagnant and ponding water on site.

Ecology Impact


- To implement Spill Response Plan in the event of accidental spillage of or other hazardous chemicals.
- To implement Dolphin Exclusion Zone during the installation of bored pile casing located in the waters to the west of Airport.
- To implement Dolphin Watching Plan after the bored piling casing is installed.
- To ensure the acoustically-decoupled measures were implemented for air compressors and other noisy equipment mounted on construction vessels according

to acoustic decoupling measures plan.



Waste/Chemical Management

- To check for any accumulation of waste materials or rubbish on site.
- To ensure the performance of sorting of C&D materials at source (during generation);
- To carry out inspection of dump truck at site exit to ensure inert and non-inert C&D materials are properly segregated before removing off site.
- To avoid any discharge or accidental spillage of chemical waste or oil directly from the site.
- To avoid improper handling or storage of oil drum on site.


FIGURE(S)

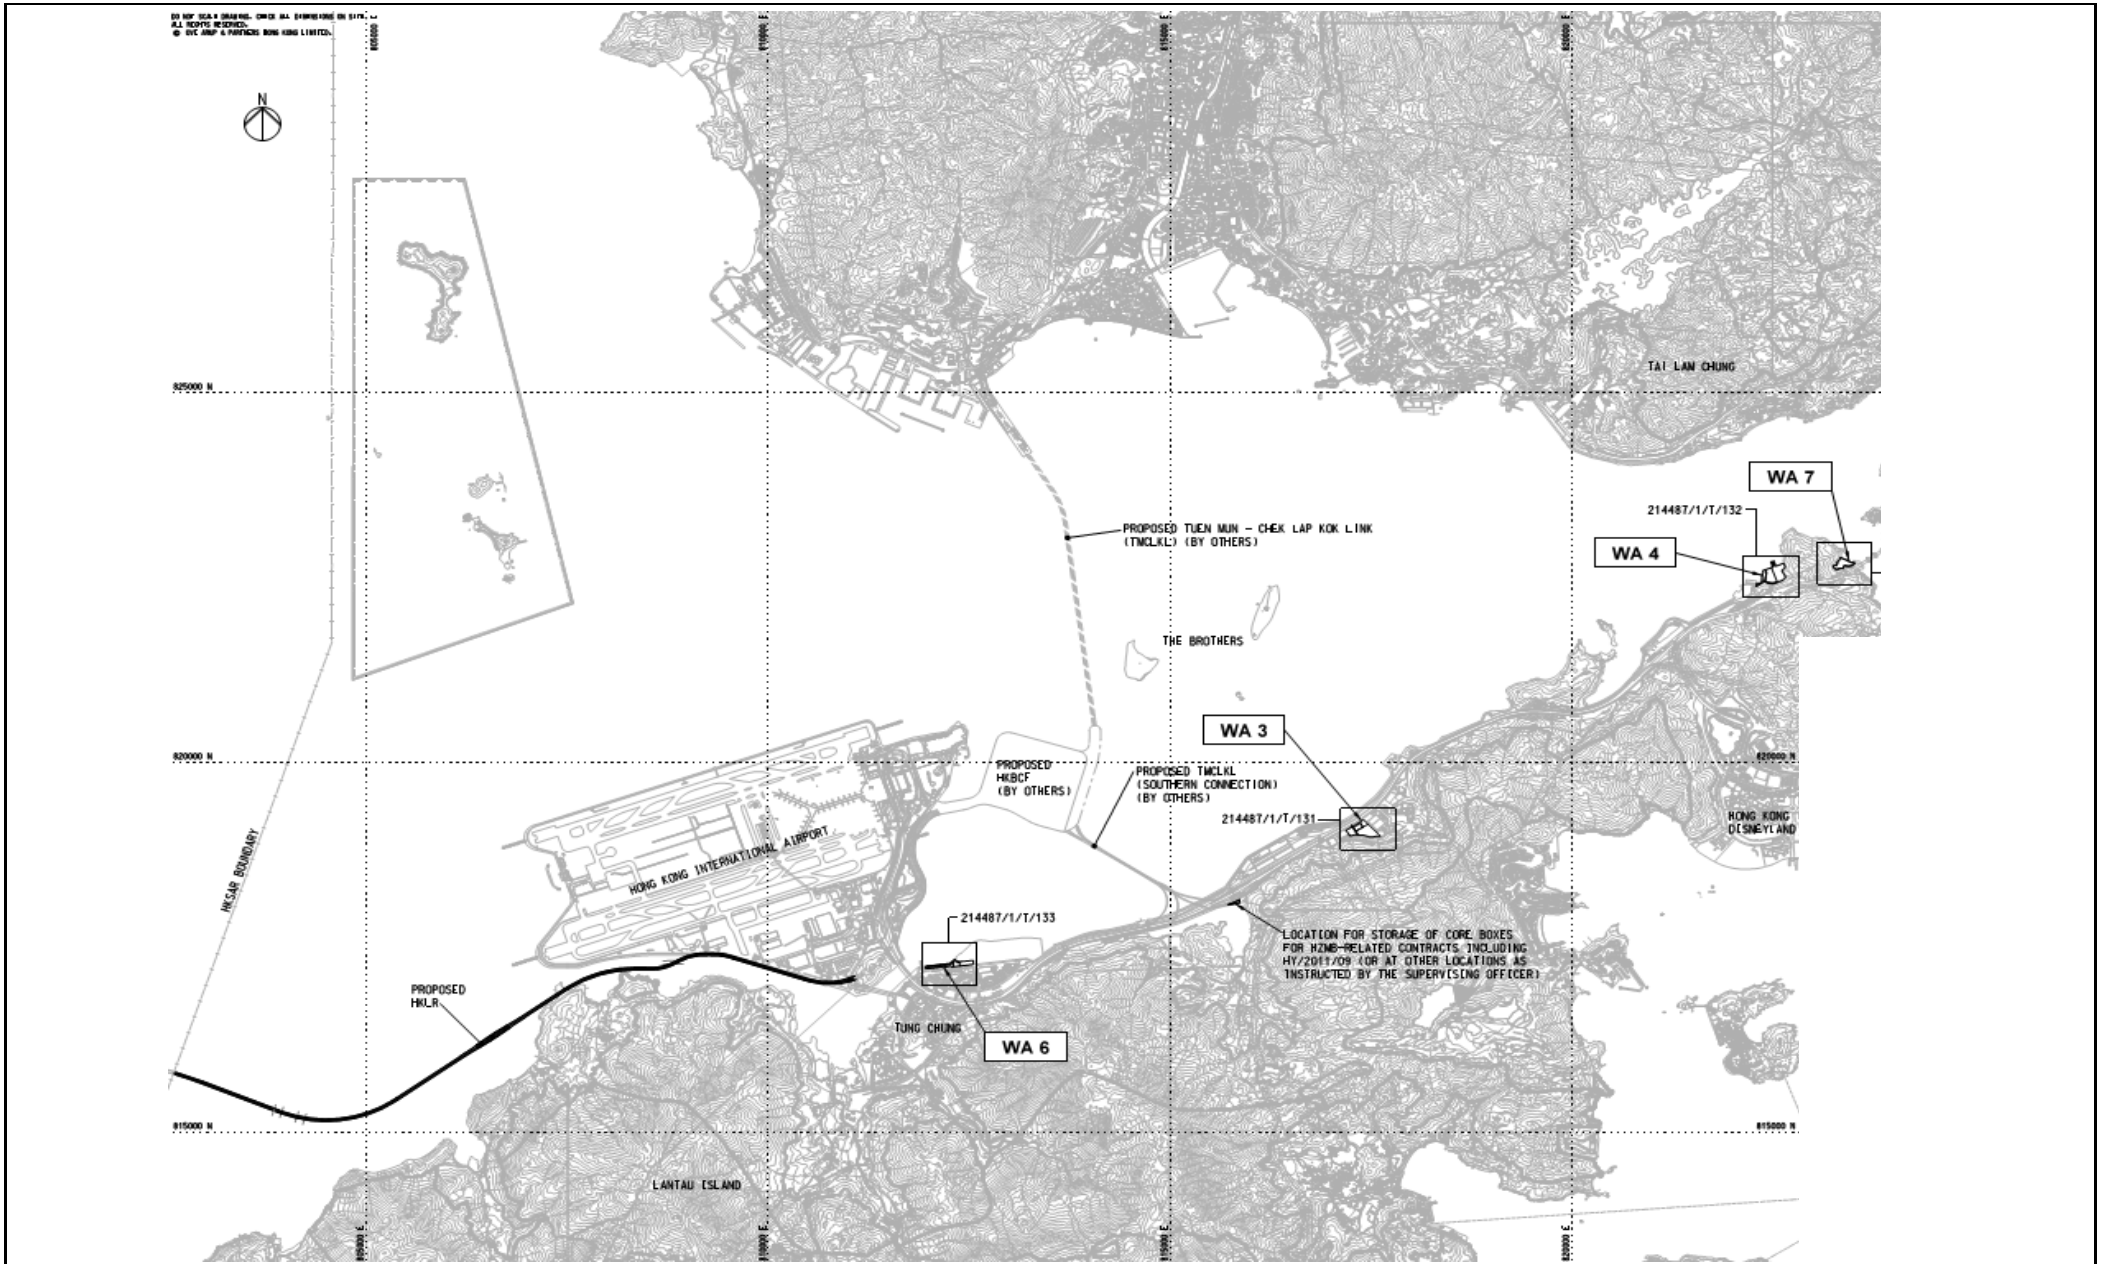

Title	Contract No. HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill Site Layout Plan (WA3, WA4, WA6 and WA7)		Scale	N.T.S	Propose	No. MA12014 Figure 1a	CINOTECH
	Date	Oct-15					

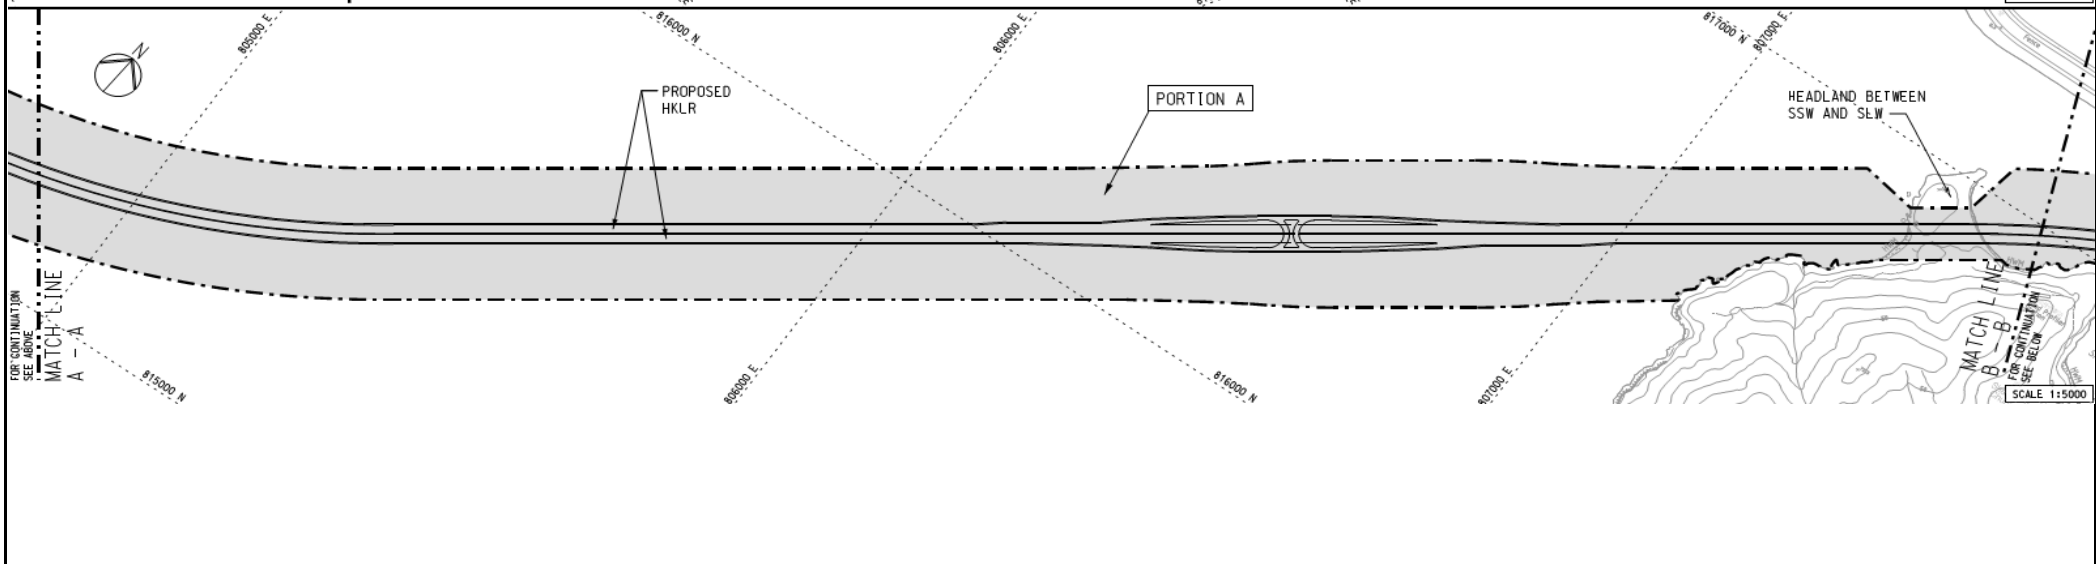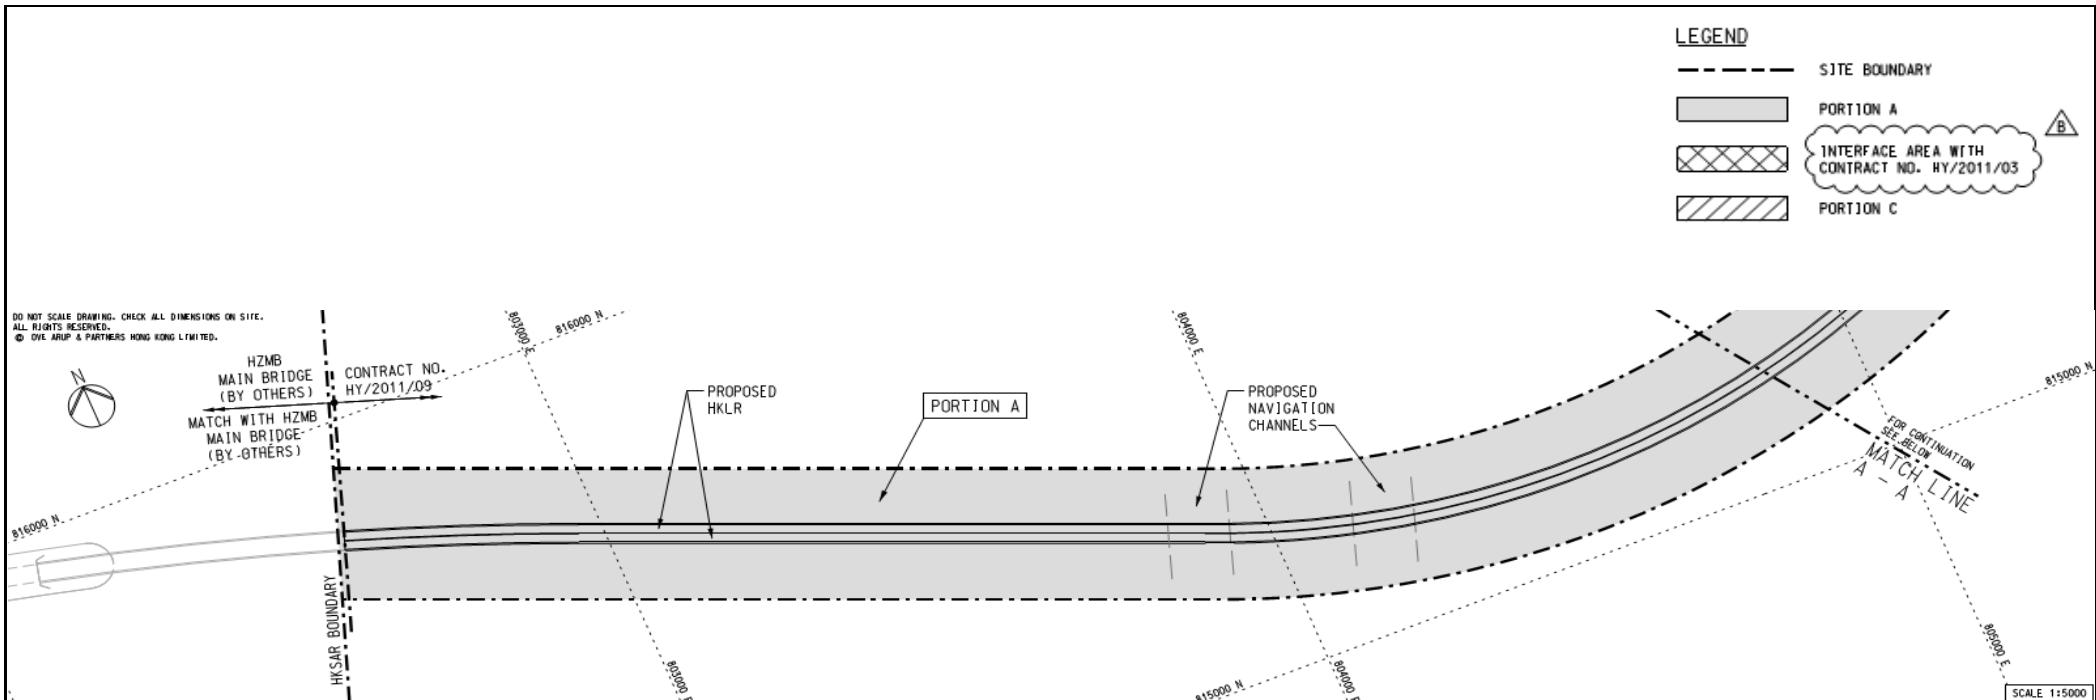


Title	Contract No. HY/2011/09		Scale	Propose
	Hong Kong-Zhuhai-Macao Bridge		N.T.S	No. MA12014
Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill		Date	Figure	CINOTECH
Site Layout Plan (Portion A)		Oct-15	1b	

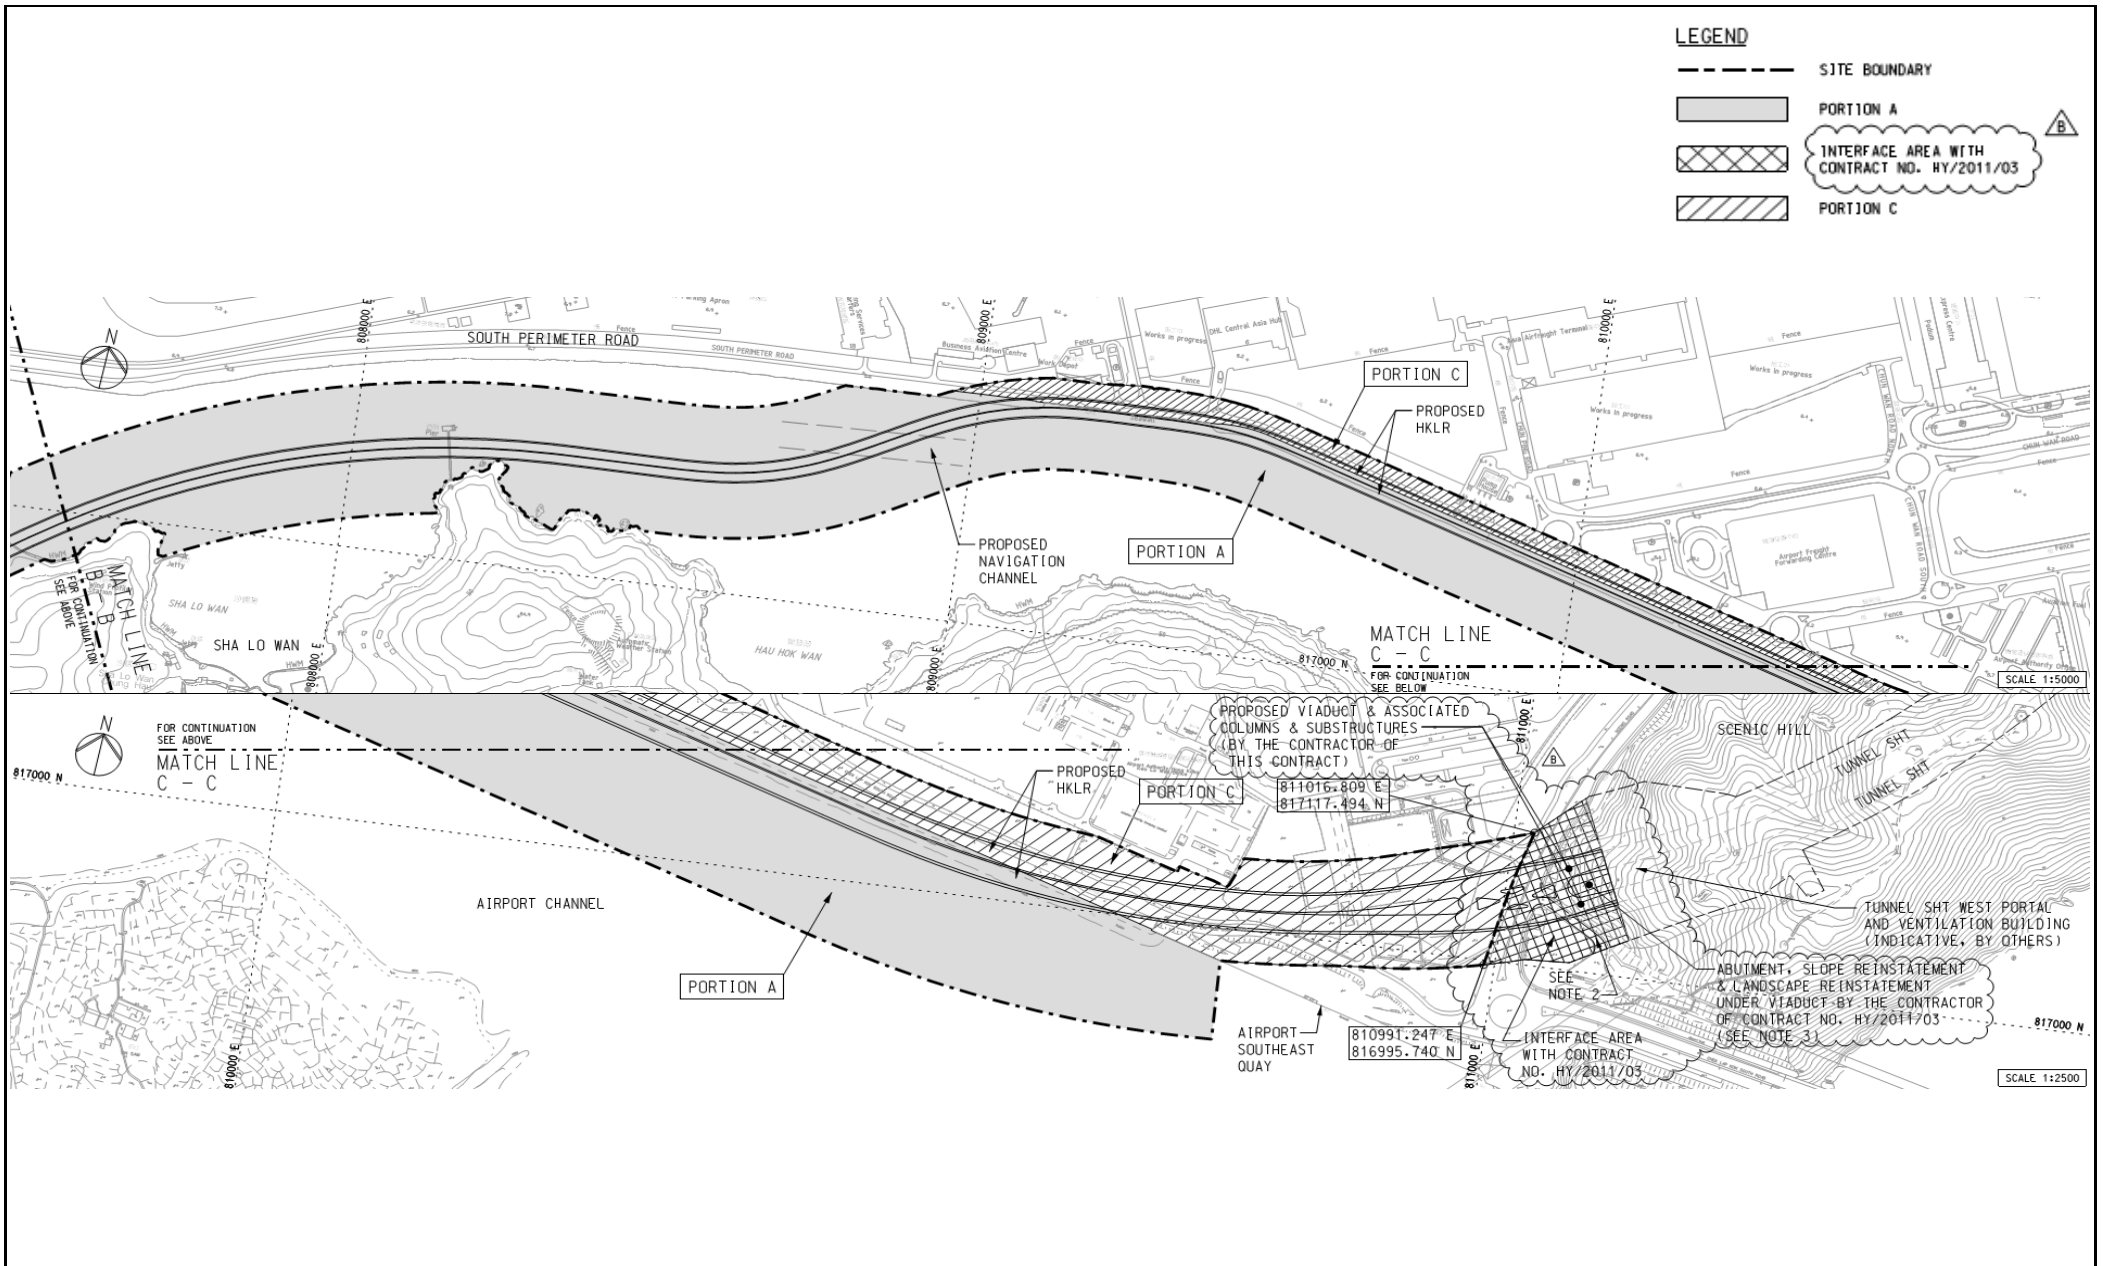


Title	Contract No. HY/2011/09	
	Hong Kong-Zhuhai-Macao Bridge	
	Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill	
	Site Layout Plan (Portion A and C)	

Scale	N.T.S	Propose No.	MA12014
Date	五月-13	Figure	1c



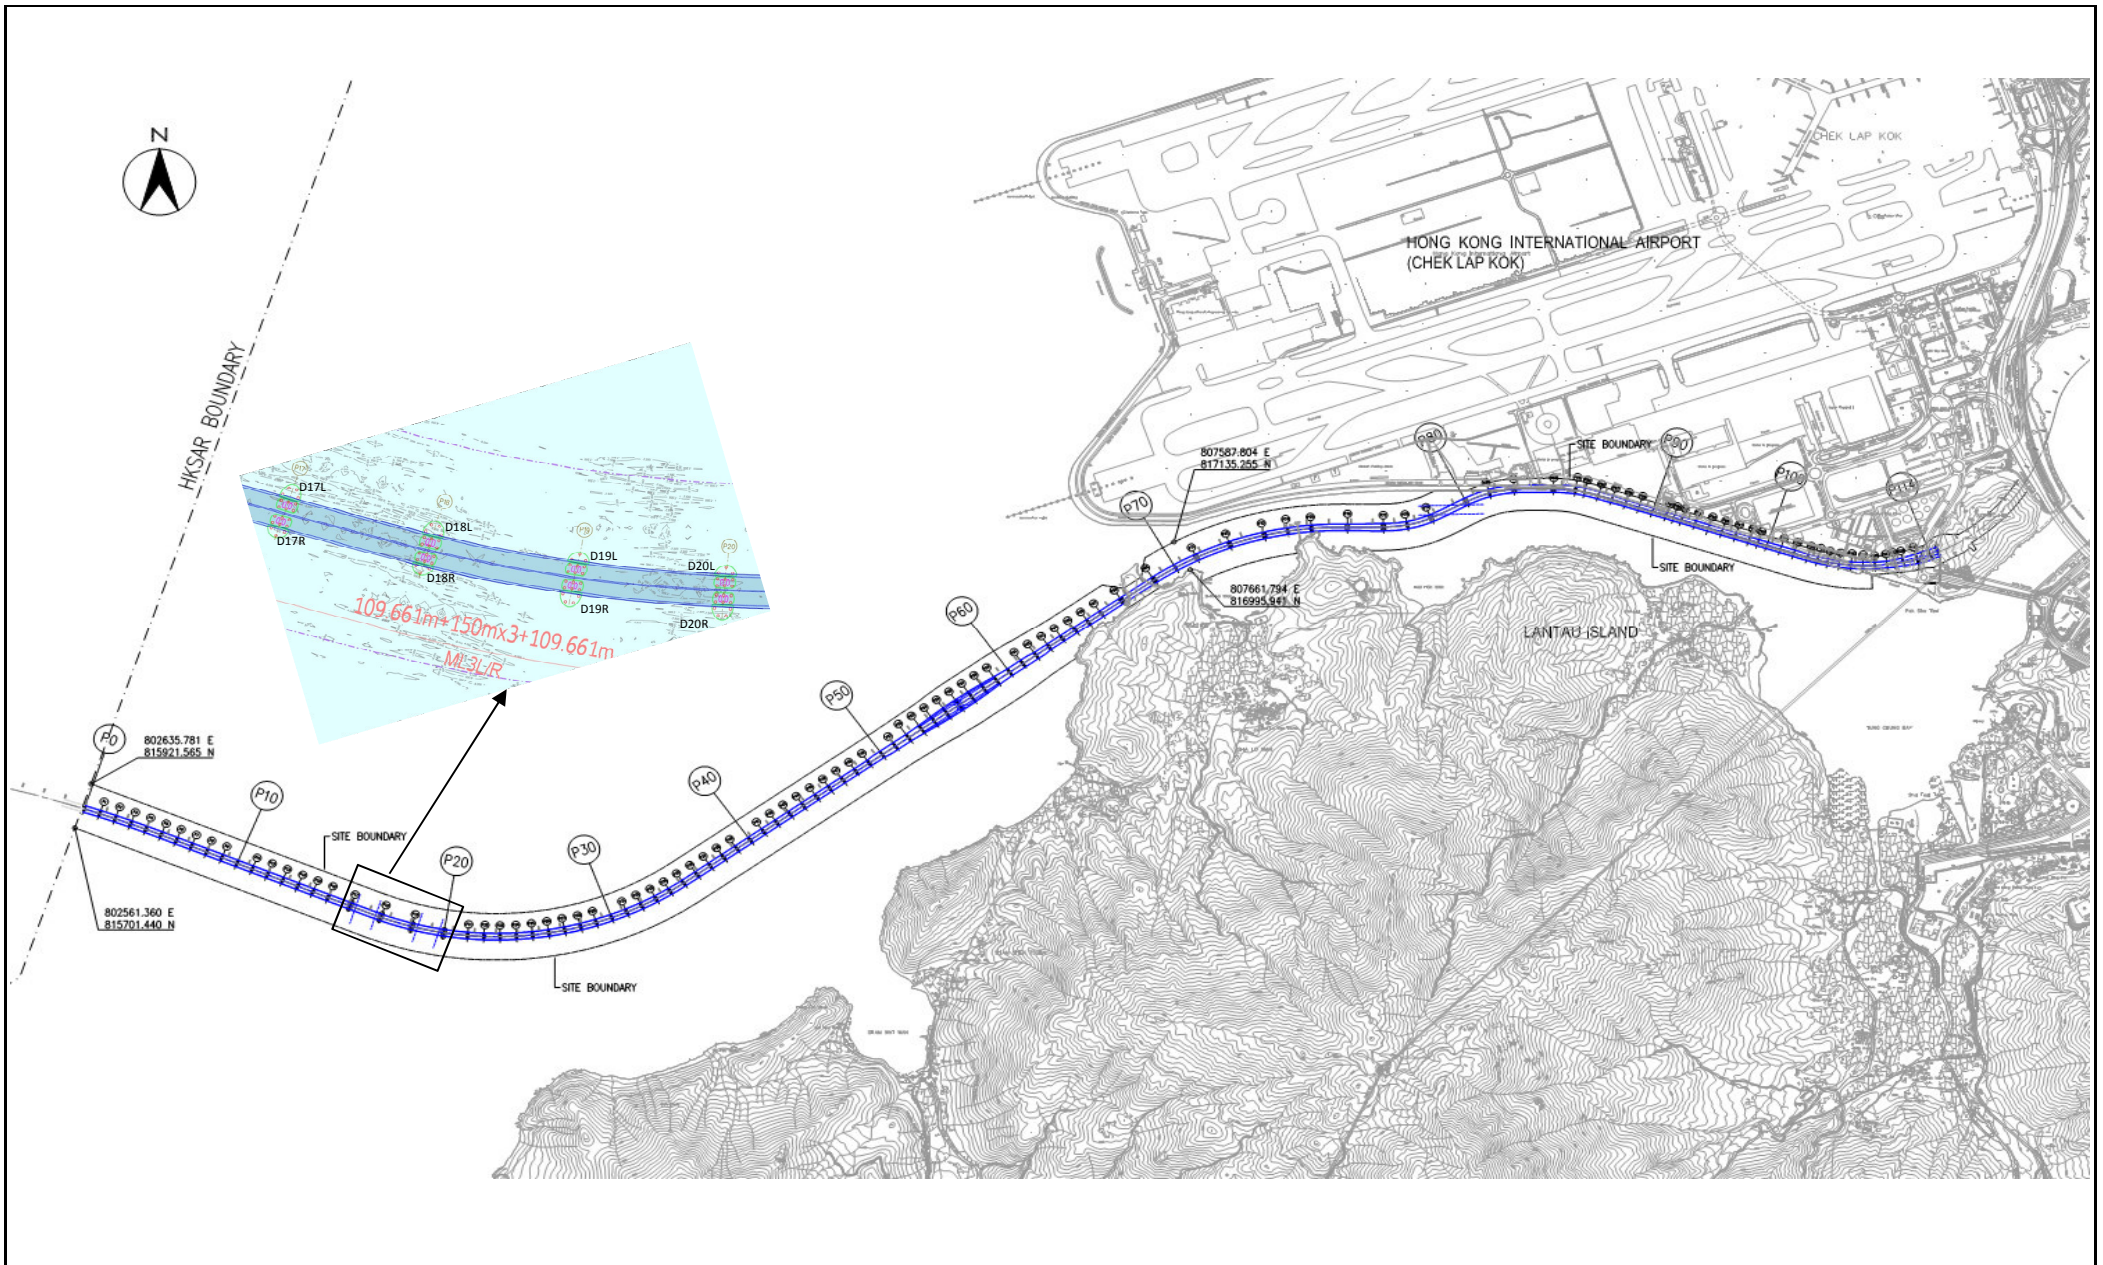

Title	Contract No. HY/2011/09		Scale	Propose No.	MA12014	CINOTECH
	Hong Kong-Zhuhai-Macao Bridge					
	Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill		Date	Figure		
	Site Layout Plan (Pier(s) Site)		Oct-15	1d		

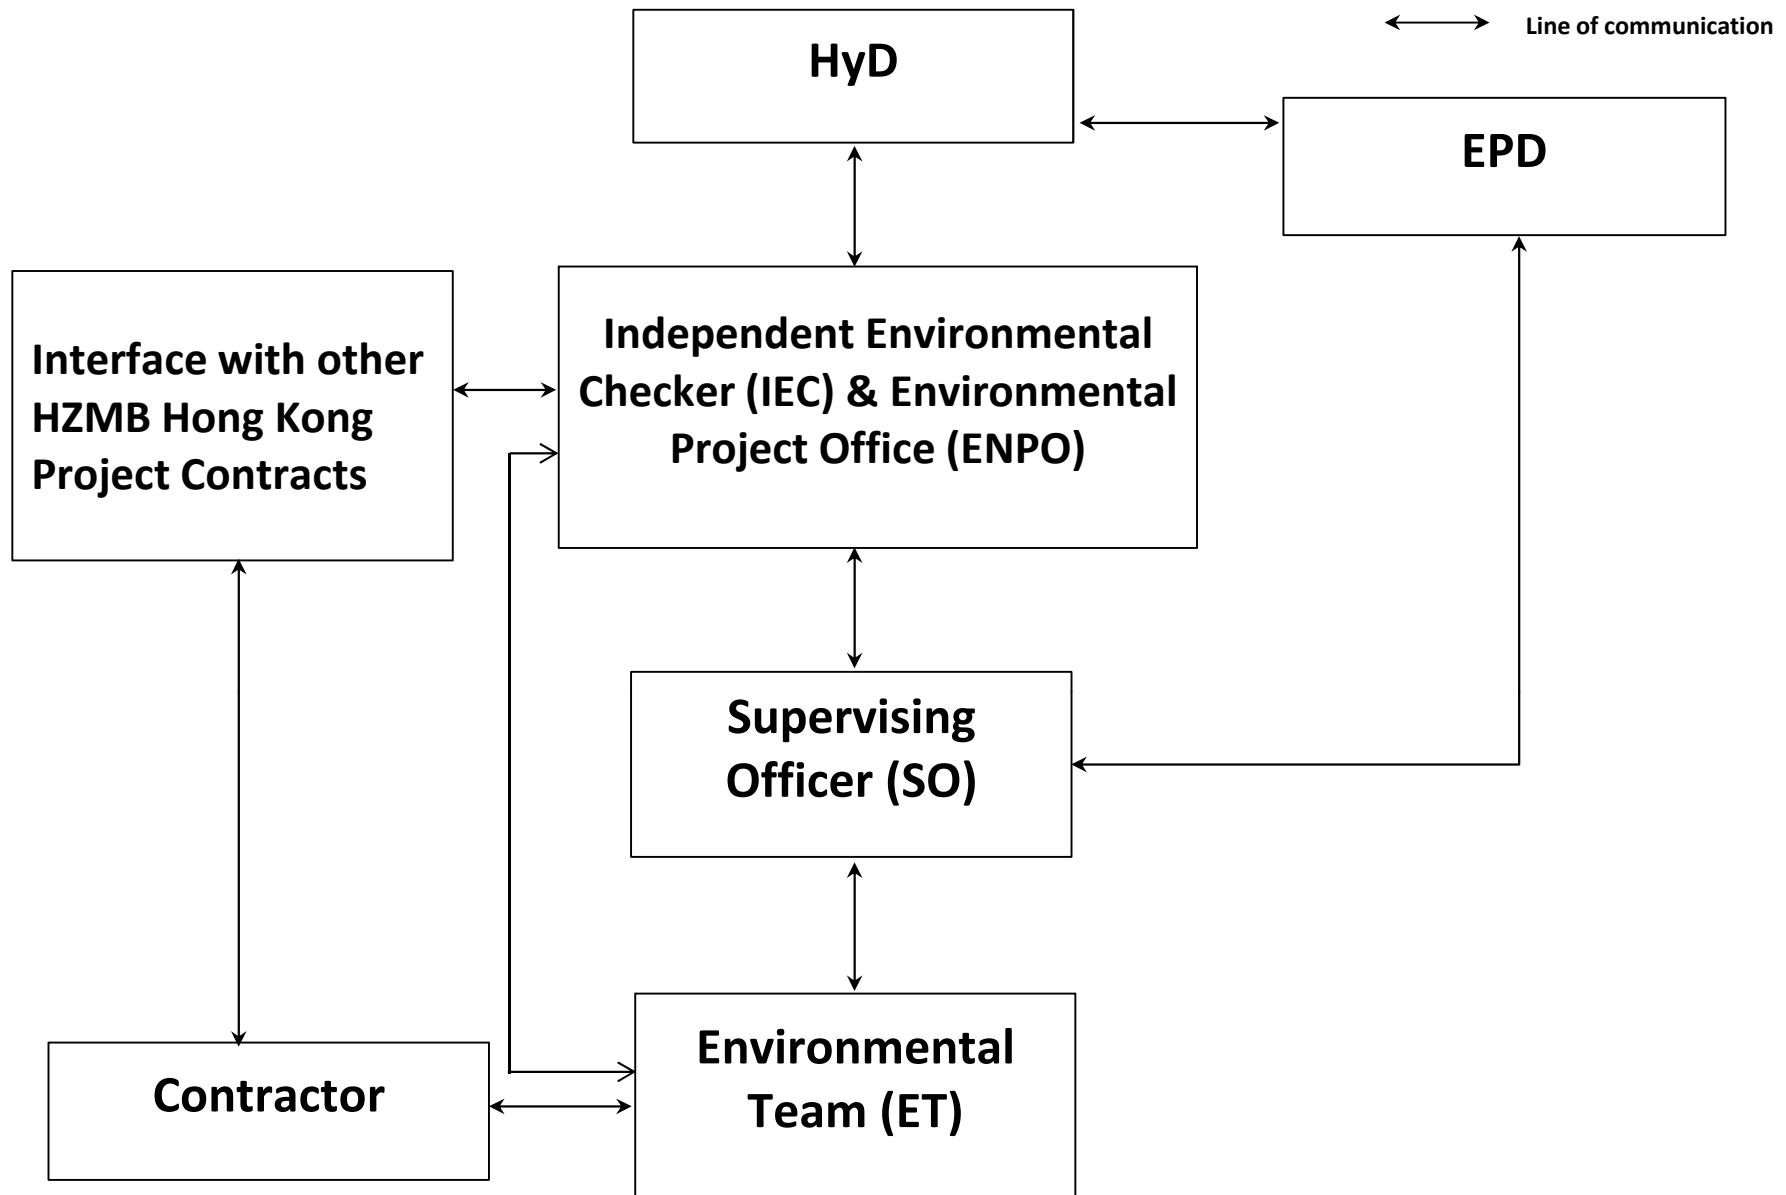


Title Contract No. HY/2011/09
 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between
 HKSAR Boundary and Scenic Hill
 Project Organisation for Environmental Works


Scale N.T.S
 Date Feb-13

Propose No. MA12014
 Figure 2



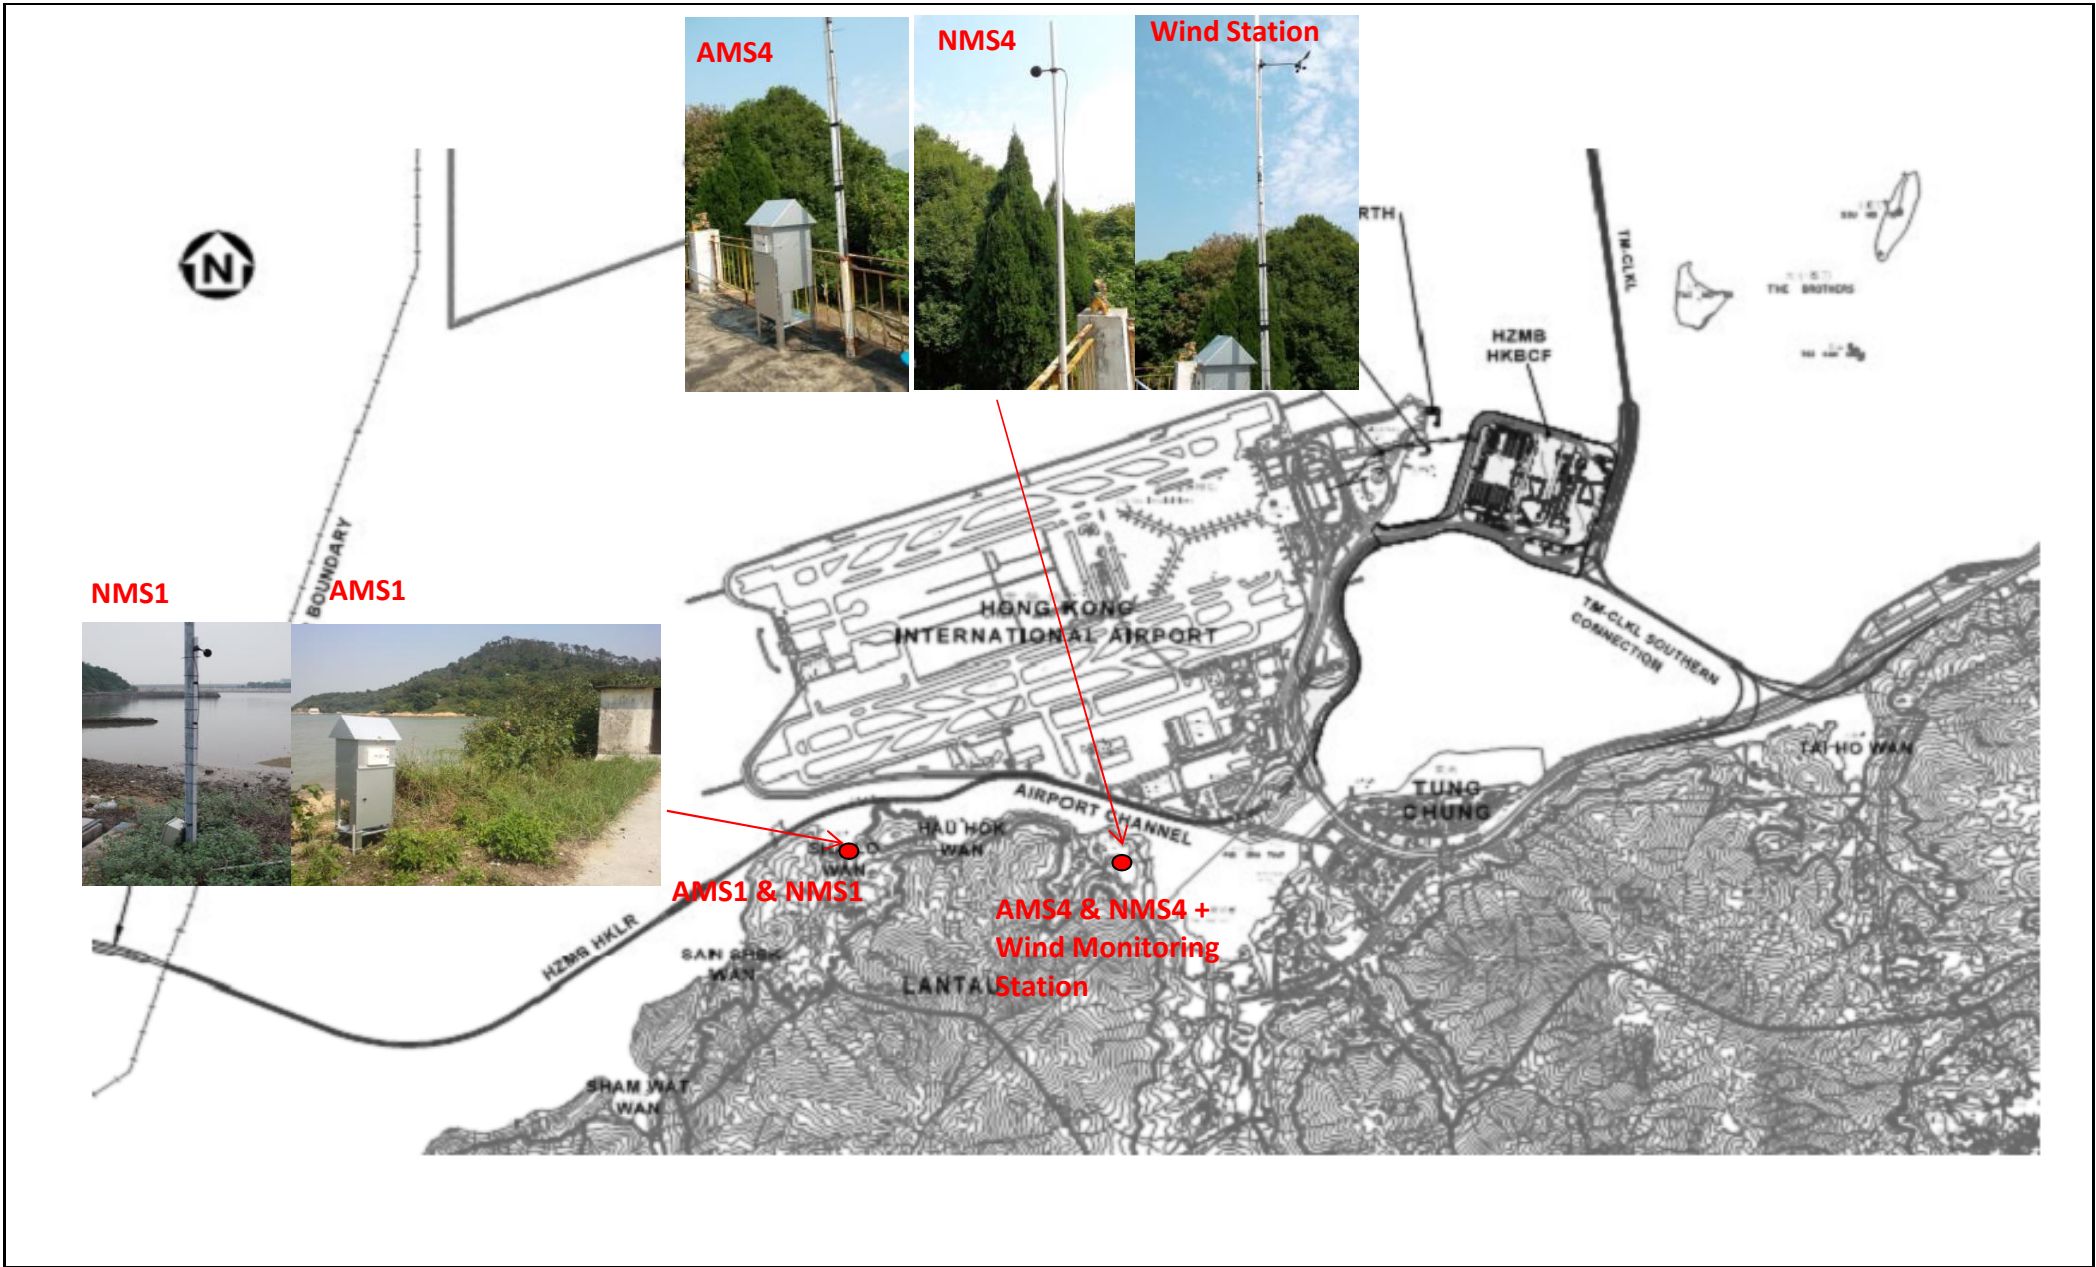

Title	Contract No. HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill	Scale	N.T.S	Propose No.	MA12014	CINOTECH
		Date	Feb-13	Figure	3	
Locations of Air Quality and Noise Monitoring Stations						

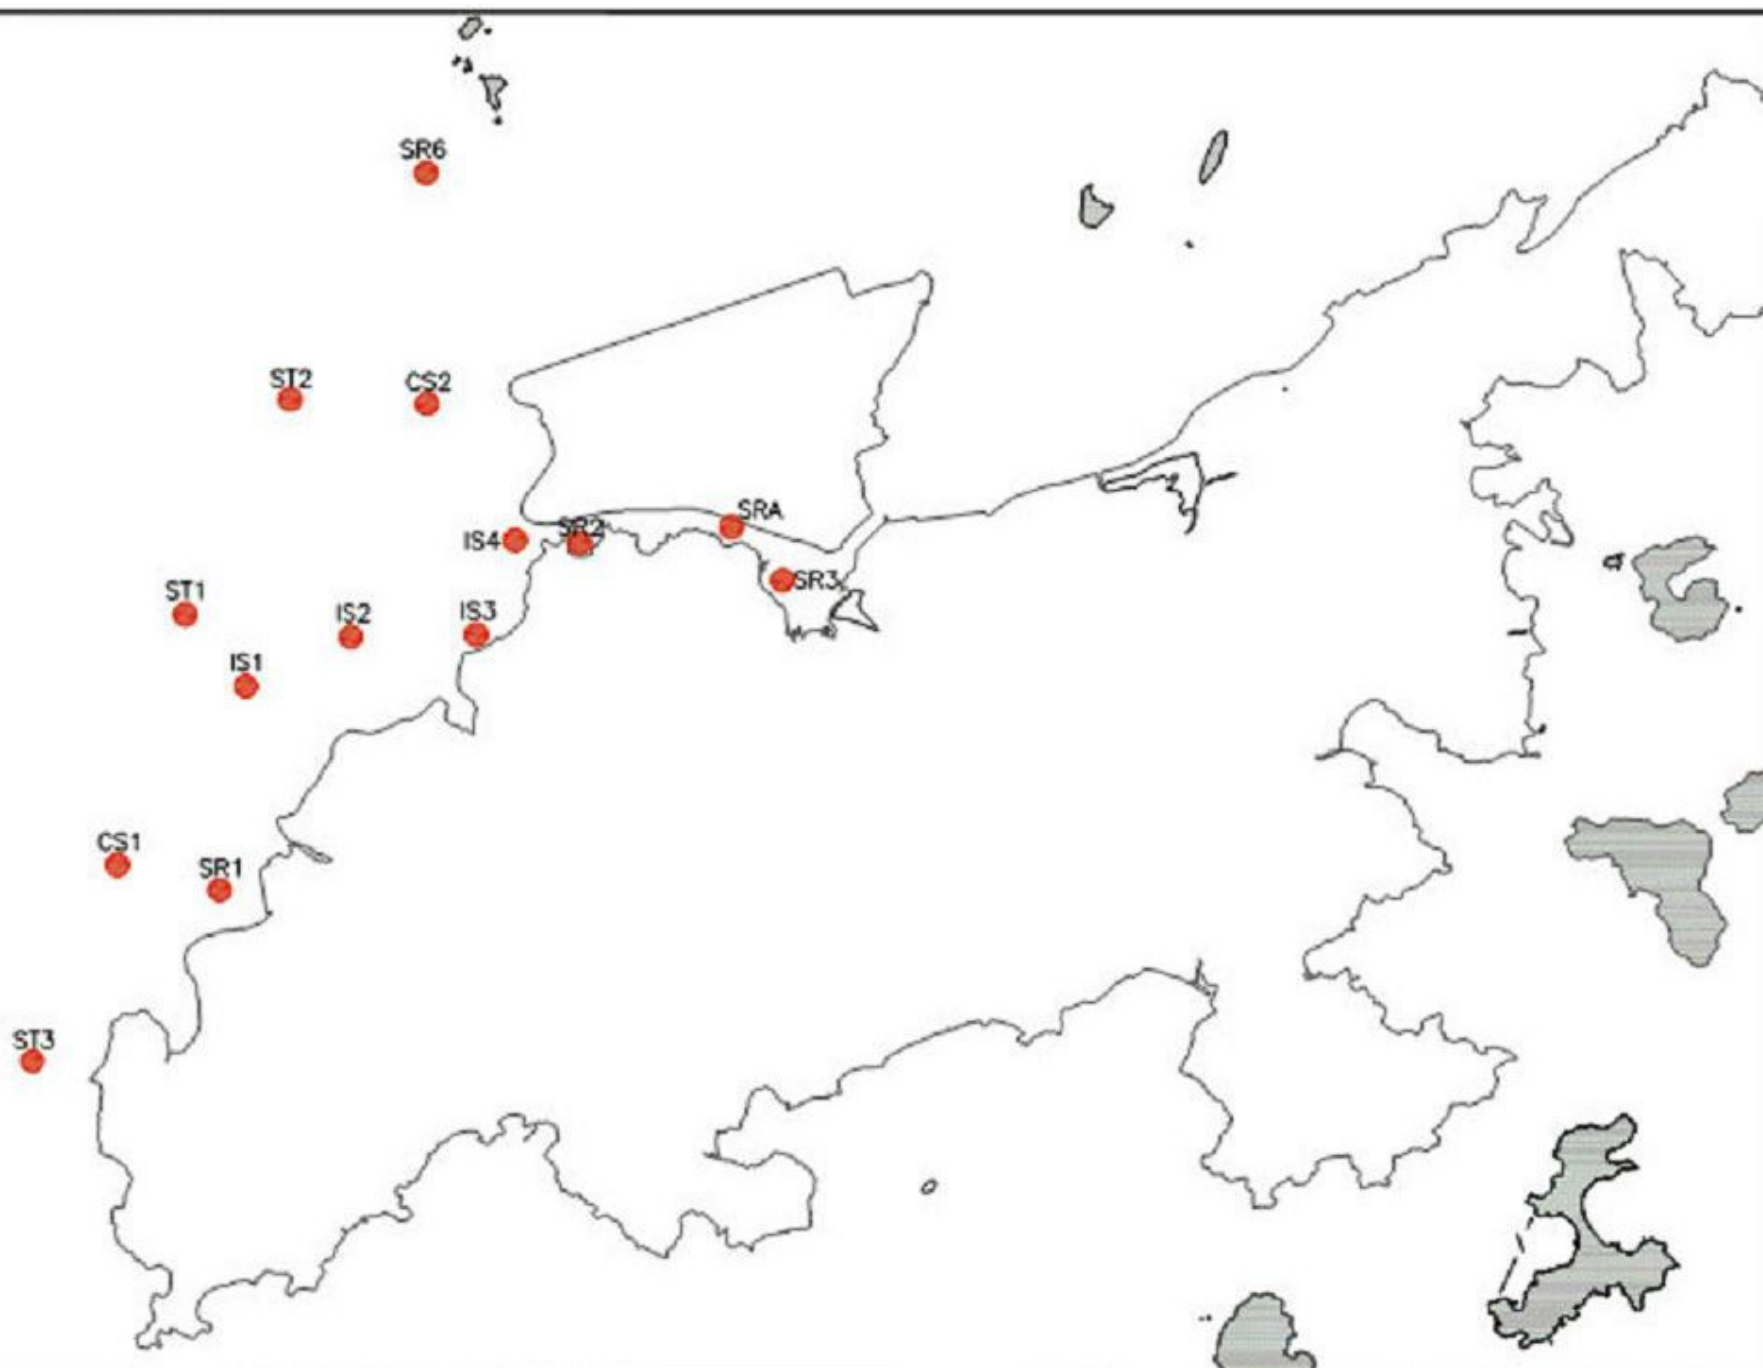

**APPENDIX A
CONSTRUCTION PROGRAMME**

Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015																
									September				October				November				December				
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14	21

HKZB Hong Kong Link Road - 3 Months Rolling Programme 1509 (based on DWP_01_f Final)

Design and Design Checking of the Works

General Design Submission

GDS1150	Seismic Performance Assessment Report of Bridge/Viaduct	0	0	0%		28/9/15*		31/5/15																	
---------	---	---	---	----	--	----------	--	---------	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--	--

Procurement and Fabrication

PGS2485	Fabrication & Deliver Lift Frames LF1_1	90	5	95%	1/1/15 A	2/10/15	31/5/15	28/8/15																			
PGS2488	Fabrication & Deliver Lift Frames LF1_2	90	9	90%	2/3/15 A	6/10/15	31/5/15	28/8/15																			
PGS2505	Fabrication & Deliver Lift Frames LF3_A/C/D	66	0	100%	1/7/15 A	2/9/15 A	31/5/15	4/8/15																			

Pile Cap Shell Casting

PC1710	Pile cap shell casting for P18 dolphin - 2nos.	45	0	100%	20/7/15 A	30/8/15 A	13/10/15	26/11/15																			
PC1720	Pile cap shell casting for P19 dolphin - 2nos.	45	29	35%	23/9/15 A	20/11/15	29/8/15	12/10/15																			
PC1730	Pile cap shell casting for P20 dolphin - 2nos.	45	25	45%	14/9/15 A	22/10/15	15/7/15	28/8/15																			

Segment Casting

Type A Segment (2 set SOP, 8 set Field Seg.)

SC5168	Segment Casting for P24 SOP	14	14	0%	10/12/15	24/12/15	16/9/15	30/9/15																			
SC5178	Segment Casting for P24 field segment	60	60	0%	24/12/15	29/2/16	22/10/15	20/12/15																			
SC5188	Segment Casting for P25 SOP	14	7	50%	8/9/15 A	10/12/15	2/9/15	16/9/15																			
SC5208	Segment Casting for P26 SOP	14	7	50%	8/8/15 A	3/12/15	19/8/15	2/9/15																			
SC5218	Segment Casting for P26 field segment	30	30	0%	7/12/15	6/1/16	3/10/15	2/11/15																			
SC5228	Segment Casting for P27 SOP	14	7	50%	16/7/15 A	12/11/15	19/7/15	1/8/15																			
SC5238	Segment Casting for P27 field segment	30	30	0%	28/11/15	28/12/15	14/9/15	14/10/15																			
SC5248	Segment Casting for P28 SOP	14	7	50%	16/6/15 A	5/11/15	5/7/15	18/7/15																			
SC5258	Segment Casting for P28 field segment	30	24	20%	4/9/15 A	7/12/15	3/9/15	3/10/15																			
SC5268	Segment Casting for P29 SOP	14	14	0%	15/10/15	29/10/15	21/6/15	4/7/15																			
SC5278	Segment Casting for P29 field segment	30	30	0%	29/10/15	28/11/15	15/8/15	14/9/15																			
SC5288	Segment Casting for P30 SOP	14	7	50%	4/5/15 A	15/10/15	13/5/15	26/5/15																			
SC5298	Segment Casting for P30 field segment	30	28	7.5%	23/9/15 A	13/11/15	4/8/15	3/9/15																			
SC5308	Segment Casting for P31 SOP	14	7	50%	21/4/15 A	8/10/15	13/5/15	26/5/15																			
SC5318	Segment Casting for P31 field segment	30	16	47.5%	29/6/15 A	24/10/15	16/7/15	15/8/15																			
SC5328	Segment Casting for P32 SOP	14	4	75%	20/1/15 A	1/10/15	13/5/15	26/5/15																			
SC5338	Segment Casting for P32 field segment	30	15	50%	24/8/15 A	16/10/15	5/7/15	4/8/15																			

DWP_01d Programme
 Remaining Work
 Actual Work
 Critical Remaining Work
 ◆ ◆ Milestone

3MRP DWP_01f 1509

Page 1 of 19

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015															
									September				October				November				December			
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14
SC5358	Segment Casting for P33 field segment	30	3	90%	28/4/15 A	30/9/15	22/5/15	20/6/15	Segment Casting for P33 field segment															
SC5438	Segment Casting for P37 field segment	30	0	100%	21/10/14 A	23/9/15 A	22/5/15	20/6/15	Segment Casting for P37 field segment															
SC5758	Segment Casting for P54 field segment	30	0	100%	15/12/14 A	16/9/15 A	13/5/15	11/6/15	Segment Casting for P54 field segment															
SC5778	Segment Casting for P55 field segment	30	9	69.5%	3/1/15 A	15/1/16	22/5/15	20/6/15	Segment Casting for P55 field segment															
SC5788	Segment Casting for P56 SOP	14	7	50%	18/5/15 A	26/11/15	31/5/15	13/6/15	Segment Casting for P56 SOP															
SC5798	Segment Casting for P56 field segment	30	28	8.33%	19/9/15 A	18/2/16	22/11/15	22/12/15	Segment Casting for P56 field segment															
SC5808	Segment Casting for P57 SOP	14	7	50%	18/5/15 A	19/11/15	31/5/15	13/6/15	Segment Casting for P57 SOP															
SC5828	Segment Casting for P58 SOP	14	7	50%	1/7/15 A	31/12/15	30/9/15	14/10/15	Segment Casting for P58 SOP															
Type B Segment (1 set)																								
SC6149	Segment Casting for P55 field segment	108	54	50%	7/7/14 A	10/2/17	13/5/15	28/8/15	Segment Casting for P55 field segment															
SC6169	Segment Casting for P57 field segment	108	81	25%	29/8/15 A	17/12/15	23/6/15	9/10/15	Segment Casting for P57 field segment															
SC6179	Segment Casting for P58 field segment	108	54	50%	12/5/15 A	14/3/16	13/5/15	28/8/15	Segment Casting for P58 field segment															
SC6189	Segment Casting for P59 field segment	114	57	50%	3/1/15 A	10/5/16	13/5/15	3/9/15	Segment Casting for P59 field segment															
Type C Segment (2 set_Modify by Type D)																								
SC6238	Segment Casting for P70 SOP	20	20	0%	28/9/15*	17/10/15	10/7/15	29/7/15	Segment Casting for P70 SOP															
SC6239	Segment Casting for P70 field segment	40	40	0%	18/10/15	26/11/15	30/7/15	7/9/15	Segment Casting for P70 field segment															
Type CV Segment (1 set)																								
SC6268	Segment Casting for P81 SOP (CV)	40	40	0%	27/11/15	5/1/16	8/9/15	17/10/15	Segment Casting for P81 SOP (CV)															
Type D Segment (2 set)																								
SC6058	Segment Casting for P51 field segment	75	8	90%	6/9/14 A	19/12/15	13/5/15	26/7/15	Segment Casting for P51 field segment															
SC6089	Segment Casting for P61 field segment	75	68	10%	11/5/15 A	11/12/15	13/5/15	26/7/15	Segment Casting for P61 field segment															
SC6099	Segment Casting for P62 field segment	75	8	90%	19/10/14 A	5/10/15	13/5/15	26/7/15	Segment Casting for P62 field segment															
Type DT Segment (1 set)																								
SC6608	Segment Casting for P50 field segment (DT)	120	12	90%	11/1/15 A	9/10/15	13/5/15	9/9/15	Segment Casting for P50 field segment (DT)															
SC6618	Segment Casting for P62 field segment (DT)	120	24	80%	17/1/15 A	21/10/15	13/5/15	9/9/15	Segment Casting for P62 field segment (DT)															
Type E Segment (4 set for E & 2 set for EV)																								
SC6318	Segment Casting for P87 field segment (EV)	54	54	0%	22/12/15	21/2/16	3/11/15	27/12/15	Segment Casting for P87 field segment (EV)															
SC6328	Segment Casting for P88 field segment (EV)	54	54	0%	29/10/15	22/12/15	10/9/15	3/11/15	Segment Casting for P88 field segment (EV)															
SC6378	Segment Casting for P93 field segment	27	27	0%	2/12/15	29/12/15	24/10/15	20/11/15	Segment Casting for P93 field segment															
SC6388	Segment Casting for P94 field segment	27	27	0%	5/11/15	2/12/15	27/9/15	24/10/15	Segment Casting for P94 field segment															
SC6398	Segment Casting for P95 field segment	27	8	70%	30/7/15 A	5/11/15	31/8/15	27/9/15	Segment Casting for P95 field segment															

DWP_01d Programme
 Remaining Work
 ◆ Milestone

Actual Work
 Critical Remaining Work

3MRP DWP_01f 1509

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	

Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015															
									September				October				November				December			
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14
SC6408	Segment Casting for P96 field segment	27	27	0%	30/9/15	27/10/15	4/8/15	31/8/15	Segment Casting for P96 field segment															
SC6418	Segment Casting for P97 field segment	54	31	41.7%	31/8/15 A	29/10/15	18/7/15	10/9/15	Segment Casting for P97 field segment															
SC6428	Segment Casting for P98 field segment	27	3	88.9%	13/7/15 A	30/9/15	8/7/15	4/8/15	Segment Casting for P98 field segment															
SC6458	Segment Casting for P101 field segment	54	0	100%	6/5/15 A	7/9/15 A	31/5/15	23/7/15	Segment Casting for P101 field segment															
Type CH&CHV Segment (2 set SOP & 10 set Field Seg.)																								
ML03 (P17 TO P20)																								
SC1678	Segment Casting for P17L CH14' to CH19' (MCH5)	17	0	100%	31/8/15 A	28/9/15 A	8/6/15	25/6/15	Segment Casting for P17L CH14' to CH19' (MCH5)															
ML11 (P71 TO P73)																								
SC1778	Segment Casting for P71R CH17' to CH22' (MCH5)	17	17	0%	28/9/15	14/10/15	4/7/15	20/7/15	Segment Casting for P71R CH17' to CH22' (MCH5)															
SC1838	Segment Casting for P71R CH17 to CH22 (MCH5)	17	17	0%	28/9/15	14/10/15	25/6/15	12/7/15	Segment Casting for P71R CH17 to CH22 (MCH5)															
SC1878	Segment Casting for P71L CH13' to CH16' (MCH4)	15	0	100%	28/8/15 A	18/9/15 A	27/6/15	12/7/15	Segment Casting for P71L CH13' to CH16' (MCH4)															
SC1888	Segment Casting for P71L CH17' to CH22' (MCH5)	17	17	0%	15/10/15	31/10/15	12/7/15	29/7/15	Segment Casting for P71L CH17' to CH22' (MCH5)															
SC1948	Segment Casting for P72L CH17 to CH22 (MCH5)	17	0	100%	18/8/15 A	16/9/15 A	21/7/15	6/8/15	Segment Casting for P72L CH17 to CH22 (MCH5)															
SC1988	Segment Casting for P72R CH13' to CH16' (MCH4)	15	0	100%	21/8/15 A	11/9/15 A	6/7/15	21/7/15	Segment Casting for P72R CH13' to CH16' (MCH4)															
SC1998	Segment Casting for P72R CH17' to CH22' (MCH5)	17	17	0%	15/10/15	31/10/15	7/8/15	23/8/15	Segment Casting for P72R CH17' to CH22' (MCH5)															
SC2028	Segment Casting for P72R CH4 to CH7 (MCH2)	18	5	75%	14/9/15 A	2/10/15	9/6/15	26/6/15	Segment Casting for P72R CH4 to CH7 (MCH2)															
SC2038	Segment Casting for P72R CH8 to CH12 (MCH3)	17	17	0%	2/10/15	19/10/15	14/7/15	31/7/15	Segment Casting for P72R CH8 to CH12 (MCH3)															
SC2048	Segment Casting for P72R CH13 to CH16 (MCH4)	15	15	0%	19/10/15	3/11/15	31/7/15	15/8/15	Segment Casting for P72R CH13 to CH16 (MCH4)															
SC2058	Segment Casting for P72R CH17 to CH22 (MCH5)	17	17	0%	3/11/15	20/11/15	15/8/15	1/9/15	Segment Casting for P72R CH17 to CH22 (MCH5)															
SC2078	Segment Casting for P72L CH4' to CH7' (MCH2)	18	0	100%	5/6/15 A	6/9/15 A	27/6/15	14/7/15	Segment Casting for P72L CH4' to CH7' (MCH2)															
SC2088	Segment Casting for P72L CH8' to CH12' (MCH3)	17	14	20%	24/9/15 A	2/11/15	31/7/15	17/8/15	Segment Casting for P72L CH8' to CH12' (MCH3)															
SC2098	Segment Casting for P72L CH13' to CH16' (MCH4)	15	15	0%	3/11/15	18/11/15	17/8/15	1/9/15	Segment Casting for P72L CH13' to CH16' (MCH4)															
SC2108	Segment Casting for P72L CH17' to CH22' (MCH5)	17	17	0%	20/11/15	7/12/15	1/9/15	18/9/15	Segment Casting for P72L CH17' to CH22' (MCH5)															
SC2158	Segment Casting for P73L CH13 to CH16 (MCH4)	15	15	0%	28/9/15	12/10/15	21/7/15	5/8/15	Segment Casting for P73L CH13 to CH16 (MCH4)															
SC2168	Segment Casting for P73L CH17 to CH22 (MCH5)	17	17	0%	1/11/15	17/11/15	24/8/15	9/9/15	Segment Casting for P73L CH17 to CH22 (MCH5)															
SC2198	Segment Casting for P73R CH8' to CH12' (MCH3)	17	3	80%	28/8/15 A	1/10/15	27/6/15	14/7/15	Segment Casting for P73R CH8' to CH12' (MCH3)															
SC2208	Segment Casting for P73R CH13' to CH16' (MCH4)	15	15	0%	13/10/15	27/10/15	5/8/15	20/8/15	Segment Casting for P73R CH13' to CH16' (MCH4)															
SC2218	Segment Casting for P73R CH17' to CH22' (MCH5)	17	17	0%	18/11/15	4/12/15	10/9/15	26/9/15	Segment Casting for P73R CH17' to CH22' (MCH5)															
SC2258	Segment Casting for P73R CH8 to CH12 (MCH3)	17	0	100%	26/8/15 A	17/9/15 A	27/6/15	14/7/15	Segment Casting for P73R CH8 to CH12 (MCH3)															
SC2268	Segment Casting for P73R CH13 to CH16 (MCH4)	15	11	25%	24/9/15 A	29/11/15	1/9/15	16/9/15	Segment Casting for P73R CH13 to CH16 (MCH4)															
SC2278	Segment Casting for P73R CH17 to CH22 (MCH5)	17	17	0%	7/12/15	24/12/15	18/9/15	5/10/15	Segment Casting for P73R CH17 to CH22 (MCH5)															

DWP_01d Programme
 Remaining Work
 Actual Work
 Critical Remaining Work
 ◆ Milestone

3MRP DWP_01f 1509

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	

Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015																
									September				October				November				December				
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14	21
SC2298	Segment Casting for P73L CH4' to CH7' (MCH2)	18	18	0%	28/9/15	15/10/15	31/5/15	17/6/15	Segment Casting for P73L CH4' to CH7' (MCH2)																
SC2308	Segment Casting for P73L CH8' to CH12' (MCH3)	17	17	0%	16/10/15	1/11/15	14/7/15	31/7/15	Segment Casting for P73L CH8' to CH12' (MCH3)																
SC2318	Segment Casting for P73L CH13' to CH16' (MCH4)	15	15	0%	29/11/15	14/12/15	16/9/15	1/10/15	Segment Casting for P73L CH13' to CH16' (MCH4)																
SC2328	Segment Casting for P73L CH17' to CH22' (MCH5)	17	17	0%	24/12/15	10/1/16	5/10/15	22/10/15	Segment Casting for P73L CH17' to CH22' (MCH5)																
ML12 (P75 TO P77)																									
SC2838	Segment Casting for P75R CH1' to CH3' (MCH1)	13	13	0%	28/9/15	10/10/15	31/5/15	12/6/15	Segment Casting for P75R CH1' to CH3' (MCH1)																
SC2898	Segment Casting for P75R CH1 to CH3 (MCH1)	13	13	0%	28/9/15	10/10/15	31/5/15	12/6/15	Segment Casting for P75R CH1 to CH3 (MCH1)																
SC2948	Segment Casting for P75L CH1' to CH3' (MCH1)	13	13	0%	11/10/15	23/10/15	13/6/15	25/6/15	Segment Casting for P75L CH1' to CH3' (MCH1)																
SC2998	Segment Casting for P76L SOP (MSOP)	35	0	100%	21/1/15 A	29/8/15 A	13/5/15	16/6/15	Segment Casting for P76L SOP (MSOP)																
SC2999	Modify Seg. mould for widen deck section (MSOP)	45	45	0%	28/9/15	11/11/15	20/6/15	4/8/15	Modify Seg. mould for widen deck section (MSOP)																
SC3018	Segment Casting for P76L CH4 to CH7 (MCH2)	18	18	0%	16/10/15	2/11/15	3/7/15	21/7/15	Segment Casting for P76L CH4 to CH7 (MCH2)																
SC3028	Segment Casting for P76L CH8 to CH12 (MCH3)	17	17	0%	3/11/15	19/11/15	31/7/15	17/8/15	Segment Casting for P76L CH8 to CH12 (MCH3)																
SC3038	Segment Casting for P76L CH13 to CH16 (MCH4)	15	15	0%	20/11/15	4/12/15	20/8/15	4/9/15	Segment Casting for P76L CH13 to CH16 (MCH4)																
SC3048	Segment Casting for P76L CH17 to CH22 (MCH5)	17	17	0%	5/12/15	21/12/15	27/9/15	13/10/15	Segment Casting for P76L CH17 to CH22 (MCH5)																
SC3059	Modify Seg. mould for widen deck section (MCH1)	45	45	0%	11/10/15	24/11/15	16/7/15	30/8/15	Modify Seg. mould for widen deck section (MCH1)																
SC3068	Segment Casting for P76R CH4' to CH7' (MCH2)	18	0	100%	14/8/15 A	1/9/15 A	21/7/15	8/8/15	Segment Casting for P76R CH4' to CH7' (MCH2)																
SC3069	Modify Seg. mould for widen deck section (MCH2)	45	45	0%	3/11/15	17/12/15	8/8/15	22/9/15	Modify Seg. mould for widen deck section (MCH2)																
SC3078	Segment Casting for P76R CH8' to CH12' (MCH3)	17	17	0%	20/11/15	6/12/15	17/8/15	3/9/15	Segment Casting for P76R CH8' to CH12' (MCH3)																
SC3079	Modify Seg. mould for widen deck section (MCH3)	45	45	0%	7/12/15	20/1/16	3/9/15	18/10/15	Modify Seg. mould for widen deck section (MCH3)																
SC3088	Segment Casting for P76R CH13' to CH16' (MCH4)	15	15	0%	7/12/15	21/12/15	4/9/15	19/9/15	Segment Casting for P76R CH13' to CH16' (MCH4)																
SC3089	Modify Seg. mould for widen deck section (MCH4)	45	45	0%	22/12/15	4/2/16	19/9/15	3/11/15	Modify Seg. mould for widen deck section (MCH4)																
SC3098	Segment Casting for P76R CH17' to CH22' (MCH5)	17	17	0%	22/12/15	7/1/16	14/10/15	30/10/15	Segment Casting for P76R CH17' to CH22' (MCH5)																
SC3107	Segment Casting for P76R SOP (MSOP)	35	0	100%	21/1/15 A	25/9/15 A	13/5/15	16/6/15	Segment Casting for P76R SOP (MSOP)																
SC3108	Modify Seg. mould for widen deck section (MSOP)	45	45	0%	28/9/15	11/11/15	30/6/15	14/8/15	Modify Seg. mould for widen deck section (MSOP)																
SC3118	Segment Casting for P76R CH1 to CH3 (MCH1)	13	13	0%	24/10/15	5/11/15	30/6/15	13/7/15	Segment Casting for P76R CH1 to CH3 (MCH1)																
SC3128	Segment Casting for P76R CH4 to CH7 (MCH2)	18	18	0%	6/11/15	23/11/15	15/7/15	1/8/15	Segment Casting for P76R CH4 to CH7 (MCH2)																
SC3138	Segment Casting for P76R CH8 to CH12 (MCH3)	17	17	0%	24/11/15	10/12/15	17/8/15	3/9/15	Segment Casting for P76R CH8 to CH12 (MCH3)																
SC3148	Segment Casting for P76R CH13 to CH16 (MCH4)	15	15	0%	14/12/15	29/12/15	1/10/15	16/10/15	Segment Casting for P76R CH13 to CH16 (MCH4)																
SC3168	Segment Casting for P76L CH1' to CH3' (MCH1)	13	13	0%	6/11/15	18/11/15	13/7/15	26/7/15	Segment Casting for P76L CH1' to CH3' (MCH1)																
SC3169	Modify Seg. mould for widen deck section (MCH1)	45	45	0%	19/11/15	2/1/16	26/7/15	9/9/15	Modify Seg. mould for widen deck section (MCH1)																
SC3178	Segment Casting for P76L CH4' to CH7' (MCH2)	18	18	0%	24/11/15	11/12/15	2/8/15	19/8/15	Segment Casting for P76L CH4' to CH7' (MCH2)																

DWP_01d Programme
 Remaining Work
 ◆ ◆ Milestone

Actual Work
 Critical Remaining Work

3MRP DWP_01f 1509
Page 4 of 19

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	



Designs One Harbour VSL Architecture EE +BBB +BBB

Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015															
									September				October				November				December			
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14
SC3179	Modify Seg. mould for widen deck section (MCH2)	45	45	0%	12/12/15	25/1/16	20/8/15	3/10/15	[Gantt bar: 12/12/15 to 25/1/16]															
SC3188	Segment Casting for P76L CH8' to CH12' (MCH3)	17	17	0%	12/12/15	28/12/15	3/9/15	20/9/15	[Gantt bar: 12/12/15 to 28/12/15]															
SC3218	Segment Casting for P77L SOP (MSOP)	30	15	50%	16/7/15 A	26/11/15	4/8/15	3/9/15	[Gantt bar: 16/7/15 to 26/11/15]															
SC3228	Segment Casting for P77L CH1 to CH3 (MCH1)	13	13	0%	27/11/15	9/12/15	3/9/15	16/9/15	[Gantt bar: 27/11/15 to 9/12/15]															
SC3238	Segment Casting for P77L CH4 to CH7 (MCH2)	18	18	0%	18/12/15	4/1/16	22/9/15	10/10/15	[Gantt bar: 18/12/15 to 4/1/16]															
SC3278	Segment Casting for P77R CH1' to CH3' (MCH1)	13	13	0%	10/12/15	22/12/15	16/9/15	29/9/15	[Gantt bar: 10/12/15 to 22/12/15]															
SC3328	Segment Casting for P77R SOP (MSOP)	30	15	50%	11/8/15 A	26/11/15	14/8/15	13/9/15	[Gantt bar: 11/8/15 to 26/11/15]															
ML13 (P79 TO P80)									[Red shaded area]															
SC3878	Segment Casting for P79L SOP (MSOP)	30	30	0%	27/11/15	26/12/15	3/9/15	3/10/15	[Gantt bar: 27/11/15 to 26/12/15]															
SC3988	Segment Casting for P79R SOP (MSOP)	30	30	0%	27/11/15	26/12/15	13/9/15	13/10/15	[Gantt bar: 27/11/15 to 26/12/15]															
Viaduct between HKSAR Boundary and Landing Point on Airport Island																								
ML01L/R 75mx8 - Stage 4 of Works																								
Pier P2L/R																								
Column Construction																								
WW1220	Construct column P2 - 2 nos. (in-situ section)	12	0	100%	31/8/15 A	16/9/15 A	26/10/15	7/11/15	[Gantt bar: 31/8/15 to 7/11/15]															
Pier P4L/R																								
Column Construction																								
WW8980	Install base precast column segment at P4	1	1	0%	19/12/15	19/12/15	26/11/15	27/11/15	[Gantt bar: 19/12/15 to 27/11/15]															
WW8982	Align & cast stitch for base column segment at P4	12	12	0%	21/12/15	6/1/16	27/11/15	11/12/15	[Gantt bar: 21/12/15 to 6/1/16]															
Pier P5L/R																								
Pile Cap Construction																								
WW1450	Construct pile cap P5 - 2 nos.	30	0	100%	4/8/15 A	19/9/15 A	25/8/15	7/10/15	[Gantt bar: 4/8/15 to 7/10/15]															
Column Construction																								
WW1460	Construct column P5 - 2 nos. (in-situ section)	12	12	0%	3/11/15	16/11/15	8/10/15	24/10/15	[Gantt bar: 3/11/15 to 24/10/15]															
WW9000	Install base precast column segment at P5	1	1	0%	9/12/15	9/12/15	16/11/15	17/11/15	[Gantt bar: 9/12/15 to 17/11/15]															
WW9002	Align & cast stitch for base column segment at P5	8	8	0%	10/12/15	18/12/15	17/11/15	26/11/15	[Gantt bar: 10/12/15 to 18/12/15]															
Pier P6L/R																								
Column Construction																								
WW1540	Construct column P6 - 2 nos. (in-situ section)	12	12	0%	3/11/15	16/11/15	18/9/15	7/10/15	[Gantt bar: 3/11/15 to 7/10/15]															
WW9020	Install base precast column segment at P6	1	1	0%	9/12/15	9/12/15	16/11/15	17/11/15	[Gantt bar: 9/12/15 to 17/11/15]															
WW9022	Align & cast stitch for base column segment at P6	8	8	0%	10/12/15	18/12/15	17/11/15	26/11/15	[Gantt bar: 10/12/15 to 18/12/15]															

DWP_01d Programme
 Remaining Work
 ◆ Milestone
 Actual Work
 Critical Remaining Work

3MRP DWP_01f 1509

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015															
									September				October				November				December			
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14
Pier P7L/R																								
Column Construction																								
WW9040	Install base precast column segment at P7	1	1	0%	18/11/15	18/11/15	26/10/15	27/10/15																
WW9042	Align & cast stitch for base column segment at P7	8	8	0%	19/11/15	27/11/15	27/10/15	5/11/15																
ML02L/R 75mx8 - Stage 4 of Works																								
Pier P8L/R (M.J.)																								
Pile Cap Construction																								
WW1690	Construct pile cap P8 - 2 nos.	30	0	100%	28/6/15 A	9/9/15 A	22/7/15	1/9/15																
Column Construction																								
WW1700	Construct column P8 - 2 nos. (in-situ section)	12	12	0%	17/10/15	2/11/15	2/9/15	17/9/15																
WW9060	Install base precast column segment at P8	1	1	0%	28/11/15	28/11/15	5/11/15	6/11/15																
WW9062	Align & cast stitch for base column segment at P8	8	8	0%	30/11/15	8/12/15	6/11/15	16/11/15																
WW9064	Install remain precast column & column head segment at P8	3	3	0%	24/12/15	30/12/15	30/11/15	2/12/15																
Pier P9L/R																								
Pile Cap Construction																								
WW1770	Construct pile cap P9 - 2 nos.	30	0	100%	30/7/15 A	6/9/15 A	22/7/15	1/9/15																
Column Construction																								
WW1780	Construct column P9 - 2 nos. (in-situ section)	12	12	0%	17/10/15	2/11/15	2/9/15	17/9/15																
WW9080	Install base precast column segment at P9	1	1	0%	28/11/15	28/11/15	5/11/15	6/11/15																
WW9082	Align & cast stitch for base column segment at P9	8	8	0%	30/11/15	8/12/15	6/11/15	16/11/15																
WW9084	Install remain precast column & column head segment at P9	3	3	0%	14/12/15	17/12/15	20/11/15	24/11/15																
WW9090	Prestress works & infill concrete at P9	40	40	0%	17/12/15	5/2/16	24/11/15	13/1/16																
Pier P10L/R																								
Pile Cap Construction																								
WW1850	Construct pile cap P10 - 2 nos.	30	0	100%	27/8/15 A	26/9/15 A	4/7/15	14/8/15																
Column Construction																								
WW1860	Construct column P10 - 2 nos. (in-situ section)	12	12	0%	30/9/15	16/10/15	15/8/15	1/9/15																
WW9100	Install base precast column segment at P10	1	1	0%	18/11/15	18/11/15	26/10/15	27/10/15																
WW9102	Align & cast stitch for base column segment at P10	8	8	0%	19/11/15	27/11/15	27/10/15	5/11/15																
WW9104	Install remain precast column & column head segment at P10	3	3	0%	17/12/15	21/12/15	19/11/15	21/11/15																
WW9110	Prestress works & infill concrete at P10	34	34	0%	21/12/15	2/2/16	23/11/15	4/1/16																

DWP_01d Programme
 Remaining Work
 Milestone

Actual Work
 Critical Remaining Work

3MRP DWP_01f 1509

Page 6 of 19

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	

Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015															
									September				October				November				December			
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14
Pier P11/L/R																								
Column Construction																								
WW9120	Install base precast column segment at P11	1	1	0%	7/11/15	7/11/15	13/10/15	14/10/15																
WW9122	Align & cast stitch for base column segment at P11	8	8	0%	9/11/15	17/11/15	14/10/15	26/10/15																
WW9124	Install remain precast column & column head segment at P11	3	3	0%	16/12/15	18/12/15	9/11/15	11/11/15																
WW9130	Prestress works & infill concrete at P11	34	34	0%	19/12/15	30/1/16	12/11/15	21/12/15																
Pier P12/L/R																								
Column Construction																								
WW9140	Install base precast column segment at P12	1	1	0%	7/11/15	7/11/15	13/10/15	14/10/15																
WW9142	Align & cast stitch for base column segment at P12	8	8	0%	9/11/15	17/11/15	14/10/15	26/10/15																
WW9144	Install remain precast column & column head segment at P12	3	3	0%	5/12/15	8/12/15	12/11/15	14/11/15																
WW9150	Prestress works & infill concrete at P12	34	34	0%	9/12/15	20/1/16	16/11/15	24/12/15																
Pier P13/L/R																								
Column Construction																								
WW9160	Install base precast column segment at P13	1	0	100%	4/9/15 A	4/9/15 A	15/9/15	16/9/15																
WW9162	Align & cast stitch for base column segment at P13	8	0	100%	4/9/15 A	10/9/15 A	16/9/15	26/9/15																
WW9164	Install remain precast column & column head segment at P13	3	2	25%	21/9/15 A	29/10/15	7/10/15	10/10/15																
WW9170	Prestress works & infill concrete at P13	34	34	0%	20/11/15	2/1/16	10/10/15	23/11/15																
Pier P14/L/R																								
Column Construction																								
WW9184	Install remain precast column & column head segment at P14	3	1	60%	5/9/15 A	28/10/15	24/9/15	26/9/15																
WW9190	Prestress works & infill concrete at P14	34	34	0%	7/11/15	17/12/15	30/9/15	13/11/15																
Pier P15/L/R																								
Column Construction																								
WW9204	Install remain precast column & column head segment at P15	3	2	40%	21/8/15 A	28/10/15	22/9/15	24/9/15																
WW9210	Prestress works & infill concrete at P15	52	52	0%	28/10/15	30/12/15	25/9/15	2/12/15																
ML03L/R 109.661m+150mx3+109.661m Navigation Channel - Stage 4 of Works																								
Pier P16/L/R (M.J.)																								
Column Construction																								
NC1104	Install remain precast column & column head segment at P16	3	1	60%	10/9/15 A	15/10/15	10/9/15	15/9/15																
NC1106	Prestress works & infill concrete at P16	52	52	0%	15/10/15	17/12/15	15/9/15	24/11/15																

DWP_01d Programme
 Remaining Work
 Milestone

Actual Work
 Critical Remaining Work

3MRP DWP_01f 1509

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015																
									September				October				November				December				
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14	21
Pier P17L/R																									
Column Construction																									
NC1220	Construct column P17 - 4 nos.	101	14	86%	29/6/15 A	22/10/15	1/6/15	23/10/15	Construct column P17 - 4 nos.																
Pier P18L/R																									
Pier Segment Construction																									
NC1348	Prepare works for precast SOP P18 - 6 nos.	6	6	0%	9/11/15	16/11/15	5/9/15	12/9/15	Prepare works for precast																
NC1350	Install precast SOP P18 - 6 nos.	6	6	0%	16/11/15	23/11/15	15/9/15	22/9/15	Install precast SOP P																
NC1352	Insitu works for SOP P18 - 6 nos.	44	44	0%	23/11/15	16/1/16	23/9/15	20/11/15																	
Pier P19L/R																									
Pier Segment Construction																									
NC1472	Insitu works for SOP P19 - 6 nos.	54	43	20%	24/8/15 A	25/11/15	9/7/15	22/9/15	Insitu works for SOP																
Pier P20L/R																									
Pile Cap Construction																									
NC1565	Construct dolphin P20 - 1 nos. (Upstream Dolphin)	45	45	0%	30/11/15	25/1/16	3/10/15	28/11/15																	
Pier Segment Construction																									
NC1592	Insitu works for SOP P20 - 6 nos.	54	35	35%	27/7/15 A	16/11/15	30/6/15	12/9/15	Insitu works for SOP P20																
ML04L/R 74.5mx8 - Stage 4 of Works																									
Pier P21L/R (M.J.)																									
Column Construction																									
WW9244	Install remain precast column & column head segment at P21	3	3	0%	15/10/15	20/10/15	9/9/15	11/9/15	Install remain precast column & column head																
WW9250	Prestress works & infill concrete at P21	52	52	0%	20/10/15	21/12/15	12/9/15	21/11/15	Pr																
Pier P22L/R																									
Column Construction																									
WW9260	Install base precast column segment at P22	1	1	0%	30/9/15	30/9/15	16/6/15	17/6/15	Install base precast column segment at P22																
WW9262	Align & cast stitch for base column segment at P22	8	8	0%	2/10/15	13/10/15	17/6/15	30/6/15	Align & cast stitch for base column segment at P22																
WW9264	Install remain precast column & column head segment at P22	3	3	0%	14/10/15	16/10/15	27/8/15	29/8/15	Install remain precast column & column head se																
WW9270	Prestress works & infill concrete at P22	52	52	0%	17/10/15	18/12/15	1/9/15	11/11/15	Pres																
Pier P23L/R																									
Column Construction																									
WW9280	Install base precast column segment at P23	1	1	0%	14/10/15	14/10/15	7/8/15	8/8/15	Install base precast column segment at P23																
WW9282	Align & cast stitch for base column segment at P23	8	8	0%	15/10/15	26/10/15	8/8/15	20/8/15	Align & cast stitch for base column segm																

DWP_01d Programme
 Remaining Work
 ◆ Milestone

Actual Work
 Critical Remaining Work

3MRP DWP_01f 1509

Page 8 of 19

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015															
									September				October				November				December			
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14
WW9284	Install remain precast column & column head segment at P23	3	3	0%	27/10/15	29/10/15	25/9/15	30/9/15	[Gantt bar: 25/9/15 to 29/10/15]															
WW9290	Prestress works & infill concrete at P23	34	34	0%	30/10/15	8/12/15	2/10/15	14/11/15	[Gantt bar: 2/10/15 to 8/12/15]															
Pier P24L/R																								
Column Construction																								
WW9304	Install remain precast column & column head segment at P24	3	0	100%	16/7/15 A	1/9/15 A	17/9/15	19/9/15	[Gantt bar: 16/7/15 A to 1/9/15 A]															
WW9310	Prestress works & infill concrete at P24	34	31	10%	3/9/15 A	5/12/15	22/9/15	7/11/15	[Gantt bar: 3/9/15 A to 5/12/15]															
Pier P25L/R																								
Column Construction																								
WW9330	Prestress works & infill concrete at P25	34	32	5%	31/8/15 A	20/11/15	21/8/15	10/10/15	[Gantt bar: 21/8/15 to 20/11/15]															
Pier P26L/R																								
Pile Cap Construction																								
WW5370	Construct pile cap P26 - 2 nos.	30	0	100%	17/4/15 A	31/8/15 A	10/6/15	23/7/15	[Gantt bar: 17/4/15 A to 31/8/15 A]															
Column Construction																								
WW5380	Construct column P26 - 2 nos. (in-situ section)	12	12	0%	30/9/15	16/10/15	15/8/15	1/9/15	[Gantt bar: 15/8/15 to 16/10/15]															
WW9340	Install base precast column segment at P26	1	1	0%	28/10/15	28/10/15	26/9/15	30/9/15	[Gantt bar: 26/9/15 to 28/10/15]															
WW9342	Align & cast stitch for base column segment at P26	8	8	0%	29/10/15	6/11/15	30/9/15	13/10/15	[Gantt bar: 30/9/15 to 6/11/15]															
WW9344	Install remain precast column & column head segment at P26	3	3	0%	2/12/15	5/12/15	5/11/15	7/11/15	[Gantt bar: 5/11/15 to 5/12/15]															
WW9350	Prestress works & infill concrete at P26	34	34	0%	5/12/15	18/1/16	9/11/15	17/12/15	[Gantt bar: 9/11/15 to 18/1/16]															
Pier P27L/R																								
Column Construction																								
WW9370	Prestress works & infill concrete at P27	34	29	15%	21/8/15 A	7/11/15	12/8/15	26/9/15	[Gantt bar: 12/8/15 to 7/11/15]															
Pier P28L/R																								
Column Construction																								
WW9390	Prestress works & infill concrete at P28	40	10	75%	9/6/15 A	14/10/15	31/7/15	24/9/15	[Gantt bar: 31/7/15 to 14/10/15]															
ML05L/R 74.5mx8 - Stage 4 of Works																								
Pier P29L/R (M.J.)																								
Column Construction																								
WW9410	Prestress works & infill concrete at P29	40	10	75%	16/6/15 A	14/10/15	21/7/15	15/9/15	[Gantt bar: 21/7/15 to 14/10/15]															
Pier P30L/R																								
Column Construction																								
WW9430	Prestress works & infill concrete at P30	40	10	75%	29/4/15 A	14/10/15	4/5/15	25/6/15	[Gantt bar: 4/5/15 to 14/10/15]															

DWP_01d Programme
 Remaining Work
 ◆ Milestone

Actual Work
 Critical Remaining Work

3MRP DWP_01f 1509

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015															
									September				October				November				December			
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14
WW9432	Bearing Installation - P30	5	5	0%	12/12/15	18/12/15	30/10/15	5/11/15	Bea															
Pier Segment Construction																								
WW5708	Prepare works for precast SOP P30 - 4 nos.	6	6	0%	18/12/15	28/12/15	5/11/15	12/11/15																
Pier P31L/R																								
Column Construction																								
WW9450	Prestress works & infill concrete at P31	34	22	35%	25/4/15 A	31/10/15	4/5/15	16/6/15	Prestress works & infill concrete at P31															
Pier P32L/R																								
Column Construction																								
WW9470	Prestress works & infill concrete at P32	34	14	60%	26/3/15 A	20/10/15	4/5/15	16/6/15	Prestress works & infill concrete at P32															
Pier P33L/R																								
Column Construction																								
WW9490	Prestress works & infill concrete at P33	34	9	75%	21/3/15 A	13/10/15	4/5/15	16/6/15	Prestress works & infill concrete at P33															
Pier Segment Construction																								
WW5948	Prepare works for precast SOP P33 - 4 nos.	11	11	0%	30/11/15	12/12/15	15/10/15	30/10/15	Prepare															
WW5950	Install precast SOP P33 - 4 nos.	3	3	0%	12/12/15	16/12/15	30/10/15	3/11/15	Instal															
WW5952	Insitu works for SOP P33 - 4 nos.	8	8	0%	16/12/15	28/12/15	3/11/15	12/11/15																
Pier P34L/R																								
Column Construction																								
WW9510	Prestress works & infill concrete at P34	34	7	80%	13/3/15 A	9/10/15	4/5/15	16/6/15	Prestress works & infill concrete at P34															
Pier Segment Construction																								
WW6028	Prepare works for precast SOP P34 - 4 nos.	11	11	0%	14/12/15	28/12/15	30/9/15	16/10/15																
Pier P35L/R																								
Column Construction																								
WW9530	Prestress works & infill concrete at P35	34	0	100%	10/3/15 A	22/9/15 A	4/5/15	16/6/15	Prestress works & infill concrete at P35															
Pier Segment Construction																								
WW6108	Prepare works for precast SOP P35 - 4 nos.	11	11	0%	1/12/15	12/12/15	12/9/15	30/9/15	Prepare															
WW6110	Install precast SOP P35 - 4 nos.	3	3	0%	14/12/15	16/12/15	30/9/15	6/10/15	Instal															
WW6112	Insitu works for SOP P35 - 4 nos.	8	8	0%	17/12/15	28/12/15	6/10/15	16/10/15																
Pier P36L/R																								
Column Construction																								
WW9550	Prestress works & infill concrete at P36	40	0	100%	4/3/15 A	1/9/15 A	4/5/15	25/6/15	Prestress works & infill concrete at P36															

DWP_01d Programme
 Remaining Work
 ◆ Milestone
 Actual Work
 Critical Remaining Work

3MRP DWP_01f 1509

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	



Designs One Harbour VSL Australia Pty Ltd 08 9439 4000

Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015															
									September				October				November				December			
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14
WW9552	Bearing Installation - P36	5	5	0%	11/11/15	16/11/15	20/8/15	27/8/15	Bearing Installation - P36															
Pier Segment Construction																								
WW6187	Prepare works for precast SOP P36 - 4 nos.	6	6	0%	17/11/15	23/11/15	27/8/15	4/9/15	Prepare works for precast SOP P36 - 4 nos.															
WW6190	Install precast SOP P36 - 4 nos.	3	3	0%	24/11/15	26/11/15	4/9/15	9/9/15	Install precast SOP P36 - 4 nos.															
WW6192	Insitu works for SOP P36 - 4 nos.	14	14	0%	27/11/15	12/12/15	9/9/15	30/9/15	Insitu works for SOP P36 - 4 nos.															
ML06L/R 74.5mx8 - Stage 4 of Works																								
Pier P37L/R (M.J.)																								
Column Construction																								
WW9572	Bearing Installation - P37	5	5	0%	2/10/15	9/10/15	7/8/15	13/8/15	Bearing Installation - P37															
Pier Segment Construction																								
WW6268	Prepare works for precast SOP P37 - 4 nos.	6	6	0%	9/10/15	17/10/15	14/8/15	21/8/15	Prepare works for precast SOP P37 - 4 nos.															
WW6270	Install precast SOP P37 - 4 nos.	3	3	0%	17/10/15	23/10/15	22/8/15	26/8/15	Install precast SOP P37 - 4 nos.															
WW6273	Insitu works for SOP P37 - 4 nos.	14	14	0%	23/10/15	9/11/15	27/8/15	15/9/15	Insitu works for SOP P37 - 4 nos.															
Pier 38L/R																								
Column Construction																								
WW9592	Bearing Installation - P38	5	5	0%	22/10/15	27/10/15	28/7/15	4/8/15	Bearing Installation - P38															
Pier Segment Construction																								
WW6348	Prepare works for precast SOP P38 - 4 nos.	6	6	0%	28/10/15	3/11/15	4/8/15	12/8/15	Prepare works for precast SOP P38 - 4 nos.															
WW6350	Install precast SOP P38 - 4 nos.	3	3	0%	4/11/15	6/11/15	12/8/15	15/8/15	Install precast SOP P38 - 4 nos.															
WW6352	Insitu works for SOP P38 - 4 nos.	14	14	0%	7/11/15	23/11/15	15/8/15	4/9/15	Insitu works for SOP P38 - 4 nos.															
Pier 39L/R																								
Pier Segment Construction																								
WW6428	Prepare works for precast SOP P39 - 4 nos.	11	0	100%	17/8/15 A	9/9/15 A	8/7/15	22/7/15	Prepare works for precast SOP P39 - 4 nos.															
WW6430	Install precast SOP P39 - 4 nos.	3	0	100%	11/9/15 A	11/9/15 A	23/7/15	25/7/15	Install precast SOP P39 - 4 nos.															
WW6432	Insitu works for SOP P39 - 4 nos.	8	7	15%	14/9/15 A	14/10/15	28/7/15	6/8/15	Insitu works for SOP P39 - 4 nos.															
Pier 40L/R																								
Pier Segment Construction																								
WW6510	Install precast SOP P40 - 4 nos.	3	0	100%	29/8/15 A	31/8/15 A	8/7/15	11/7/15	Install precast SOP P40 - 4 nos.															
WW6512	Insitu works for SOP P40 - 4 nos.	8	5	35%	2/9/15 A	10/10/15	11/7/15	23/7/15	Insitu works for SOP P40 - 4 nos.															
Pier 41L/R																								
Pier Segment Construction																								

DWP_01d Programme
 Remaining Work
 ◆ Milestone
 Critical Remaining Work

3MRP DWP_01f 1509

Page 11 of 19

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	



Designs On-Harbour VSL Australia Pty Ltd 1999-2015

Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015															
									September				October				November				December			
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14
WW6592	Insitu works for SOP P41 - 4 nos.	8	3	60%	14/8/15 A	6/10/15	11/7/15	22/7/15	Insitu works for SOP P41 - 4 nos.															
Pier 42L/R																								
Pier Segment Construction																								
WW6672	Insitu works for SOP P42 - 4 nos.	11	3	75%	3/8/15 A	3/10/15	22/6/15	8/7/15	Insitu works for SOP P42 - 4 nos.															
Pier 43L/R																								
Pier Segment Construction																								
WW6752	Insitu works for SOP P43 - 4 nos.	11	0	100%	7/7/15 A	2/9/15 A	22/6/15	7/7/15	Insitu works for SOP P43 - 4 nos.															
ML07L/R 73.396mx8 - Stage 4 of Works																								
Pier P49L/R																								
Pier Segment Construction																								
WW8692	Insitu works for SOP P49 - 4 nos.	7	3	60%	4/8/15 A	17/10/15	13/8/15	21/8/15	Insitu works for SOP P49 - 4 nos.															
Pier P50L/R																								
Pier Segment Construction																								
WW8698	Prepare works for precast SOP P50 - 4 nos.	11	0	100%	28/8/15 A	14/9/15 A	21/7/15	4/8/15	Prepare works for precast SOP P50 - 4 nos.															
WW8700	Install precast SOP P50 - 4 nos..	4	0	100%	16/9/15 A	19/9/15 A	5/8/15	8/8/15	Install precast SOP P50 - 4 nos..															
WW8702	Insitu works for SOP P50 - 4 nos.	26	23	10%	22/9/15 A	21/11/15	11/8/15	15/9/15	Insitu works for SOP P50 - 4 nos.															
Pier P51L/R																								
Pier Segment Construction																								
WW8708	Prepare works for precast SOP P51 - 4 nos.	11	11	0%	17/11/15	30/11/15	26/9/15	15/10/15	Prepare works for precast SOP P51 - 4 nos.															
WW8710	Install precast SOP P51 - 4 nos.	4	4	0%	30/11/15	4/12/15	15/10/15	22/10/15	Install precast SOP P51 - 4 nos.															
WW8712	Insitu works for SOP P51 - 4 nos.	7	7	0%	4/12/15	12/12/15	22/10/15	30/10/15	Insitu works for SOP P51 - 4 nos.															
ML08L/R 70mx6 - Stage 4 of Works																								
Pier P53L/R (M.J.)																								
Column Construction																								
WW7515	Bearing Installation - P53	5	5	0%	9/11/15	14/11/15	1/9/15	5/9/15	Bearing Installation - P53															
WW8725	Bearing Installation - P53N/S	5	5	0%	1/12/15	7/12/15	26/9/15	6/10/15	Bearing Installation - P53N/S															
Pier Segment Construction																								
WW7518	Prepare works for precast SOP P53 - 4 nos.	6	6	0%	14/11/15	21/11/15	8/9/15	15/9/15	Prepare works for precast SOP P53 - 4 nos.															
WW7520	Install precast SOP P53 - 4 nos.	4	4	0%	21/11/15	26/11/15	16/9/15	19/9/15	Install precast SOP P53 - 4 nos.															
WW7522	Insitu works for SOP P53 - 4 nos.	20	20	0%	26/11/15	19/12/15	22/9/15	22/10/15	Insitu works for SOP P53 - 4 nos.															
WW8808	Prepare works for precast SOP P53N/S (Turnaround Facility) - 4 nos.	11	11	0%	7/12/15	19/12/15	7/10/15	22/10/15	Prepare works for precast SOP P53N/S (Turnaround Facility) - 4 nos.															

DWP_01d Programme
 Remaining Work
 ◆ Milestone
 Critical Remaining Work

3MRP DWP_01f 1509

Page 12 of 19

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	

Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015															
									September				October				November				December			
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14
WW8810	Install precast SOP P53N/S (Turnaround Facility) - 4 nos.	3	3	0%	19/12/15	23/12/15	23/10/15	26/10/15																
WW8812	Insitu works for SOP P53N/S (Turnaround Facility) - 4 nos.	14	14	0%	23/12/15	12/1/16	27/10/15	11/11/15																
Pier P54L/R																								
Column Construction																								
WW10177	Construct column head P54 - 2 nos. (insitu)	21	0	100%	14/8/15 A	11/9/15 A	11/6/15	14/7/15																
WW9912	Construct column P54N/S (Turnaround Facility) - 2 nos.	36	4	90%	1/8/15 A	6/10/15	14/7/15	2/9/15																
Pier Segment Construction																								
WW7598	Prepare works for precast SOP P54 - 4 nos.	11	11	0%	27/10/15	9/11/15	2/9/15	17/9/15																
WW7600	Install precast SOP P54 - 4 nos.	4	4	0%	9/11/15	13/11/15	17/9/15	23/9/15																
WW7602	Insitu works for SOP P54 - 4 nos.	14	14	0%	13/11/15	30/11/15	23/9/15	15/10/15																
Pier P55L/R																								
Column Construction																								
WW10187	Construct column P55 - 2 nos. (insitu)	12	1	95%	1/8/15 A	30/9/15	21/7/15	5/8/15																
WW10197	Construct column head P55 - 2 nos. (insitu)	21	21	0%	30/9/15	30/10/15	6/8/15	3/9/15																
WW9932	Construct column P55N/S (Turnaround Facility) - 2 nos.	35	35	0%	30/10/15	10/12/15	4/9/15	26/10/15																
Pier P56L/R																								
Pile Cap Construction																								
WW7740	Construct pile cap P56 - 2 nos.	35	0	100%	1/8/15 A	28/9/15 A	8/8/15	25/9/15																
Column Construction																								
WW10207	Construct column P56 - 2 nos. (insitu)	12	12	0%	10/12/15	24/12/15	27/10/15	9/11/15																
WW10217	Construct column head P56 - 2 nos. (insitu)	21	21	0%	24/12/15	21/1/16	10/11/15	3/12/15																
Pier P57L/R																								
Column Construction																								
WW10227	Construct column P57 - 2 nos. (insitu)	12	12	0%	30/9/15	16/10/15	1/9/15	16/9/15																
WW10237	Construct column head P57 - 2 nos. (insitu)	21	21	0%	17/10/15	12/11/15	17/9/15	17/10/15																
WW9972	Construct column P57N/S (Turnaround Facility) - 2 nos.	36	36	0%	13/11/15	24/12/15	20/10/15	1/12/15																
Pier P58L/R																								
Column Construction																								
WW9992	Construct column P58N/S (Turnaround Facility) - 2 nos.	32	0	100%	12/8/15 A	22/9/15 A	17/7/15	29/8/15																
ML09L/R 73.396Mx8 - Stage 4 of Works																								
Pier P61L/R																								

DWP_01d Programme
 Remaining Work
 Critical Remaining Work
 Milestone

3MRP DWP_01f 1509

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	

Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015																
									September				October				November				December				
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14	21
Pier Segment Construction																									
WW8228	Prepare works for precast SOP P61 - 4 nos.	11	11	0%	30/9/15	15/10/15	8/7/15	23/7/15	Prepare works for precast SOP P61 - 4 nos.																
WW8230	Install precast SOP P61 - 4 nos.	4	4	0%	16/10/15	22/10/15	23/7/15	29/7/15	Install precast SOP P61 - 4 nos.																
WW8232	Insitu works for SOP P61 - 4 nos.	10	10	0%	23/10/15	3/11/15	29/7/15	12/8/15	Insitu works for SOP P61 - 4 nos.																
Pier P62L/R																									
Pier Segment Construction																									
WW8242	Insitu works for SOP P62 - 4 nos.	27	18	35%	29/7/15 A	26/10/15	27/6/15	4/8/15	Insitu works for SOP P62 - 4 nos.																
Pier P66L/R																									
Pier Segment Construction																									
WW8562	Insitu works for SOP P66 - 4 nos.	22	1	96%	12/2/15 A	30/9/15	17/3/16	16/4/16																	
ML10L/R 115m+180m+115m - Stage 4 of Works																									
Pier P67L/R (M.J.)																									
Column Construction																									
AC1052	Construct column P67 - 2 nos. (insitu)	24	24	0%	11/12/15	12/1/16	19/11/15	16/12/15																	
Pier P68L/R																									
Temporary Works																									
AC2796	Install cofferdem for pile cap construction - P68L - 1 nos.	60	60	0%	9/10/15	22/12/15	22/9/15	8/12/15																	
AC2797	Install cofferdem for pile cap construction - P68R - 1 nos.	60	60	0%	22/12/15	8/3/16	14/12/15	27/2/16																	
Foundation - Bored Pile																									
AC1090	Pile testing P68L	28	11	60%	30/7/15 A	9/10/15	23/8/15	19/9/15	Pile testing P68L																
AC2836	Construct bored piles P68R - 6 nos.	60	0	100%	1/4/15 A	9/9/15 A	25/8/15	14/11/15	Construct bored piles P68R																
AC2846	Pile testing P68R	28	15	45%	19/9/15 A	13/10/15	15/11/15	12/12/15	Pile test																
Pile Cap Construction																									
AC1100	Construct pile cap P68L - 1 nos.	40	40	0%	22/12/15	13/2/16	9/12/15	27/1/16																	
Pier P69L/R																									
Temporary Works																									
AC1135	Install cofferdem for pile cap construction - P69 - 2 nos.	90	50	45%	2/7/15 A	2/12/15	1/6/15	7/10/15	Install cofferdem																
Pile Cap Construction																									
AC1140	Construct pile cap P69 - 2 nos.	45	45	0%	2/12/15	27/1/16	8/10/15	2/12/15																	
ML11L/R 109m+165mx2+109m - Stage 4 of Works																									
Pier P70L/R (M.J.)																									

DWP_01d Programme
 Remaining Work
 ◆ ◆ Milestone
 Actual Work
 Critical Remaining Work

3MRP DWP_01f 1509

Page 14 of 19

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	



Designs One Harbour VSL Australia Pty Ltd - 0800 000000

Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015																								
									September				October				November				December												
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14	21								
Temporary Works																																	
AC1180	Remove cofferdem for pier P70	18	18	0%	30/9/15	26/10/15	9/7/15	4/8/15	Remove cofferdem for pier P70																								
Pier P71L/R																																	
Pier Segment Construction																																	
AC1310	Install precast SOP P71 - 6 nos.	6	0	100%	28/8/15 A	7/9/15 A	9/7/15	16/7/15	Install precast SOP P71 - 6 nos.																								
AC1312	Insitu works for SOP P71 - 6 nos.	54	49	10%	9/9/15 A	1/12/15	17/7/15	2/10/15	Insitu works for																								
Pier P72L/R																																	
Pier Segment Construction																																	
AC1398	Prepare works for precast SOP P72 - 6 nos.	6	6	0%	18/11/15	25/11/15	15/9/15	22/9/15	Prepare works for p																								
AC1400	Install precast SOP P72 - 6 nos.	6	6	0%	25/11/15	2/12/15	23/9/15	2/10/15	Install precast S																								
AC1402	Insitu works for SOP P72 - 6 nos.	44	44	0%	2/12/15	26/1/16	3/10/15	27/11/15	Insitu works for																								
Pier P73L/R																																	
Pier Segment Construction																																	
AC1488	Prepare works for precast SOP P73 - 6 nos.	6	6	0%	30/9/15	8/10/15	9/7/15	16/7/15	Prepare works for precast SOP P73 - 6 nos.																								
AC1490	Install precast SOP P73 - 6 nos.	6	6	0%	9/10/15	16/10/15	17/7/15	24/7/15	Install precast SOP P73 - 6 nos.																								
AC1493	Insitu works for SOP P73 - 6 nos.	54	54	0%	17/10/15	21/12/15	25/7/15	10/10/15	In																								
ML12L/R 109m+165mx2+109m - Stage 4 of Works																																	
Pier P74L/R (M.J.)																																	
Temporary Works																																	
AC1520	Remove cofferdem for pier P74	18	18	0%	11/12/15	5/1/16	19/11/15	9/12/15	Remove cofferdem for pier P74																								
Pile Cap Construction																																	
AC1560	Construct pile cap P74 - 2 nos.	60	1	99%	18/7/15 A	30/9/15	8/6/15	1/9/15	Construct pile cap P74 - 2 nos.																								
Column Construction																																	
AC2676	Construct column P74 - 2 nos. (insitu)	36	36	0%	30/9/15	17/11/15	2/9/15	24/10/15	Construct column P74 - 2																								
AC2686	Construct column head P74 - 2 nos. (insitu)	21	21	0%	17/11/15	11/12/15	26/10/15	18/11/15	Construct																								
Pier P75L/R																																	
Temporary Works																																	
AC1590	Install cofferdem for pile cap construction - P75 - 1 nos.	120	30	75%	15/7/14 A	9/11/15	9/9/14	7/2/15	Install cofferdem for pile cap co																								
Foundation - Bored Pile																																	
AC2736	Construct bored piles P75 - 8 nos.	90	36	60%	18/6/15 A	28/12/15	24/6/15	30/10/15	Construct bored piles P75 - 8 nos.																								
Pier P76L/R																																	

DWP_01d Programme
 Remaining Work
 ◆ Milestone
 Actual Work
 Critical Remaining Work

3MRP DWP_01f 1509

Page 15 of 19

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	



Designs On-Harbour VSL Australia EE-1000-00000

Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015																									
									September				October				November				December													
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14	21									
Temporary Works																																		
AC1710	Remove cofferdem for pier P76	18	18	0%	14/10/15	6/11/15	2/10/15	27/10/15																										
Column Construction																																		
AC1750	Construct column P76 - 4 nos.	74	9	87.5%	4/7/15 A	14/10/15	16/6/15	30/9/15																										
Pier Segment Construction																																		
AC1758	Prepare works for precast SOP P76 - 6 nos.	6	6	0%	24/11/15	1/12/15	28/10/15	3/11/15																										
AC1760	Install precast SOP P76 - 6 nos.	6	6	0%	1/12/15	8/12/15	4/11/15	10/11/15																										
AC1762	Insitu works for SOP P76 - 6 nos.	44	44	0%	8/12/15	1/2/16	11/11/15	4/1/16																										
Pier P77L/R																																		
Temporary Works																																		
AC2410	Remove cofferdem for pier P77	18	18	0%	30/9/15	26/10/15	16/9/15	13/10/15																										
Column Construction																																		
AC1830	Construct column P77 - 4 nos.	76	0	100%	19/6/15 A	16/9/15 A	1/6/15	15/9/15																										
Pier Segment Construction																																		
AC1838	Prepare works for precast SOP P77 - 6 nos.	6	6	0%	15/12/15	21/12/15	14/10/15	22/10/15																										
AC1840	Install precast SOP P77 - 6 nos.	6	6	0%	22/12/15	30/12/15	23/10/15	29/10/15																										
ML13L/R 115m+180m+115m - Stage 4 of Works																																		
Pier P78L/R (M.J.)																																		
Temporary Works																																		
AC1880	Remove cofferdem for pier P78	18	18	0%	25/11/15	16/12/15	29/1/16	23/2/16																										
Column Construction																																		
AC2696	Construct column P78 - 2 nos. (insitu)	48	12	75%	5/6/15 A	31/10/15	6/11/15	5/1/16																										
AC2706	Construct column head P78 - 2 nos. (insitu)	21	21	0%	31/10/15	25/11/15	5/1/16	29/1/16																										
Pier P79L/R																																		
Column Construction																																		
AC2000	Construct column P79 - 4 nos.	80	53	33.3%	5/9/15 A	7/12/15	25/8/15	8/12/15																										
Pier P80L/R																																		
Column Construction																																		
AC2080	Construct column P80 - 4 nos.	80	80	0%	20/11/15	27/2/16	10/11/15	17/2/16																										
ML14L/R 115m+180m+100.561m - Stage 4 of Works																																		
Pier P81L/R (M.J.)																																		

DWP_01d Programme
 Remaining Work
 ◆ Milestone

Actual Work
 Critical Remaining Work

3MRP DWP_01f 1509

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015																								
									September				October				November				December												
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14									
Temporary Works																																	
AC2130	Remove cofferdem and rockfill platform for pier P81	25	25	0%	15/10/15	16/11/15	6/11/15	5/12/15																									
Column Construction																																	
AC2726	Construct column head P81 - 2 nos. (insitu)	21	11	50%	26/8/15 A	15/10/15	9/10/15	6/11/15																									
Pier P82L/R																																	
Temporary Works																																	
AC2227	Install cofferdem for pile cap construction - P82 - Land side	60	0	100%	24/3/15 A	26/9/15 A	1/6/15	22/8/15																									
Pile Cap Construction																																	
AC2816	Construct pile cap P82 - Land side	35	30	15%	24/9/15 A	9/11/15	25/8/15	14/10/15																									
Column Construction																																	
AC2270	Construct column P82 - 4 nos.	74	59	20%	10/8/15 A	20/1/16	23/11/15	24/2/16																									
Pier P83L/R																																	
Temporary Works																																	
AC2298	Install cofferdem for pile cap construction - P83 - Land side	60	0	100%	20/4/15 A	12/9/15 A	1/6/15	22/8/15																									
AC2330	Remove cofferdem and rockfill platform for pier P83	25	25	0%	23/11/15	22/12/15	22/12/15	23/1/16																									
AC2332	Reinstate seawall for pier P83	90	90	0%	23/11/15	14/3/16	22/12/15	16/4/16																									
Pile Cap Construction																																	
AC2826	Construct pile cap P83 - Land side	35	5	87%	5/9/15 A	7/10/15	30/7/15	17/9/15																									
Column Construction																																	
AC2370	Construct column P83 - 4 nos.	74	37	50%	4/6/15 A	23/11/15	17/9/15	22/12/15																									
Deck Construction between HKSAR Boundary and Landing Point on Airport Channel																																	
Segment Erection - Launching Girder																																	
Launching Girder No.2																																	
DC1120	Segment erection P44	16	0	100%	31/8/15 A	19/9/15 A	15/7/15	5/8/15																									
DC1130	Segment erection P43	10	10	0%	30/9/15	14/10/15	6/8/15	19/8/15																									
DC1140	Segment erection P42	10	10	0%	15/10/15	28/10/15	20/8/15	2/9/15																									
DC1150	Segment erection P41	10	10	0%	29/10/15	9/11/15	3/9/15	16/9/15																									
DC1160	Segment erection P40	10	10	0%	10/11/15	20/11/15	17/9/15	2/10/15																									
DC1170	Segment erection P39	10	10	0%	21/11/15	2/12/15	3/10/15	16/10/15																									
DC1180	Segment erection P38	12	12	0%	3/12/15	16/12/15	17/10/15	2/11/15																									
DC1190	Segment erection P37 MJ	12	12	0%	17/12/15	2/1/16	3/11/15	16/11/15																									

DWP_01d Programme
 Remaining Work
 ◆ Milestone
 Actual Work
 Critical Remaining Work

3MRP DWP_01f 1509

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015															
									September				October				November				December			
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14
Segment Erection - Lifting Frame																								
Lifting Frame Type 1_1																								
DC1515	Segment erection P20 (Learning)	60	60	0%	16/11/15	28/1/16	15/9/15	2/12/15																
Lifting Frame Type 1_2																								
DC1520	Segment erection P19 (Learning)	60	60	0%	25/11/15	6/2/16	23/9/15	9/12/15																
Lifting Frame Type 3_A/C																								
DC1660	Segment erection P54	20	20	0%	1/12/15	24/12/15	11/11/15	3/12/15																
DC1860	Segment erection P64 (Learning)	36	0	100%	16/7/15 A	12/9/15 A	14/7/15	1/9/15																
DC1880	Segment erection P65 (Learning)	30	29	5%	18/9/15 A	7/11/15	2/9/15	15/10/15																
DC1900	Segment erection P66	20	20	0%	7/11/15	1/12/15	16/10/15	10/11/15																
Lifting Frame Type 3_A/C/D																								
DC1030	Segment erection P50 (Learning)	30	30	0%	7/12/15	14/1/16	24/9/15	5/11/15																
DC1820	Segment erection P62 (Learning)	36	36	0%	26/10/15	7/12/15	5/8/15	23/9/15																
DC1840	Segment erection P63R	20	18	10%	23/9/15 A	16/4/16	19/1/16	13/2/16																
DC1842	Segment erection P63L	20	15	25%	18/9/15 A	27/2/16	30/11/15	22/12/15																
Segment Erection - Crane																								
Crane Erection (Marine Plant)																								
DC1035	+1 & +2 erection by crane for P52	24	24	0%	9/12/15*	11/1/16	9/12/15	11/1/16																
Viaduct between Landing Point on Airport Island and Scenic Hill																								
ML15L/R 43m+65mx6+37m - Stage 5 of Works																								
Pier P84L/R (M.J.)																								
In-situ Portal/T-pier Construction																								
AI3590	In-situ portal P84 - 1 nos.	60	30	50%	22/3/15 A	9/11/15	4/5/15	24/7/15																
Pier P85L/R																								
In-situ Portal/T-pier Construction																								
AI1150	In-situ portal P85 - 1 nos.	60	0	100%	22/7/15 A	22/9/15 A	30/7/15	26/10/15																
Deck Construction between Landing Point on Airport Island and Scenic Hill																								
Segment Erection																								
Segment Erection - Launching Girder																								
Launching Girder No.1																								
DC5080	Segment erection P105	8	0	100%	31/8/15 A	23/9/15 A	31/7/15	11/8/15																

DWP_01d Programme
 Remaining Work
 ◆ Milestone

Actual Work
 Critical Remaining Work

3MRP DWP_01f 1509

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	
29/9/15	1509 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1509 Start	1509 Finish	DWP01f Start	DWP01f Finish	2015																
									September				October				November				December				
									31	07	14	21	28	05	12	19	26	02	09	16	23	30	07	14	21
DC5090	Segment erection P104 M.J	7	5	22.23%	19/9/15 A	8/10/15	12/8/15	20/8/15	Segment erection P104 M.J																
DC5100	Segment erection P103	12	12	0%	8/10/15	26/10/15	21/8/15	5/9/15	Segment erection P103																
DC5110	Segment erection P102	12	12	0%	26/10/15	9/11/15	8/9/15	23/9/15	Segment erection P102																
DC5120	Segment erection P101	12	12	0%	9/11/15	23/11/15	24/9/15	13/10/15	Segment erection P101																
DC5130	Segment erection P100	12	12	0%	23/11/15	7/12/15	14/10/15	29/10/15	Segment erection P100																
DC5140	Segment erection P99 M.J	10	10	0%	7/12/15	18/12/15	30/10/15	10/11/15	Segment erection P99 M.J																
DC5150	Segment erection P98	12	12	0%	18/12/15	5/1/16	11/11/15	24/11/15	Segment erection P98																
Segment Erection - Crane Erection for Interface Span P115																									
DC5460	Handover P115 Abutment [by HY/2011/03]	0	0	0%	30/9/15*		15/6/15		Handover P115 Abutment [by HY/2011/03]																
DC5465	Bearing Installation - P115	10	10	0%	30/9/15	14/10/15	12/8/15	25/8/15	Bearing Installation - P115																
DC5470	Plant mobilization for P114 & P115 end span erection	14	14	0%	15/10/15	2/11/15	26/8/15	12/9/15	Plant mobilization for P114 & P115 end span erection																
DC5480	In-situ Deck between Eastern Abutment and P114 +10 Segment	75	75	0%	3/11/15	1/2/16	15/9/15	19/12/15	In-situ Deck between Eastern Abutment and P114 +10 Segment																
External PT																									
DC5370	External PT for ML18/LR (Learning)	50	50	0%	9/11/15	9/1/16	24/9/15	28/11/15	External PT for ML18/LR (Learning)																
E&M Works																									
Re-provisioning Radar at P20																									
EM1000	Re-provisioning the Platform & Radar at Pier P20	90	90	0%	16/11/15	7/3/16	15/9/15	9/1/16	Re-provisioning the Platform & Radar at Pier P20																

DWP_01d Programme
 Remaining Work
 ◆ Milestone

Actual Work
 Critical Remaining Work

3MRP DWP_01f 1509

Date	Revision	Check...	Approved
1/9/15	1508 rolling based on DWP01f	Tim	Approved
29/9/15	1509 rolling based on DWP01f	Tim	

**APPENDIX B
ACTION AND LIMIT LEVELS**

Appendix B - Action and Limit Levels

Table B-1 Action and Limit Levels for 1-Hour TSP

Location	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
AMS1	381	500
AMS4	352	

Table B-2 Action and Limit Levels for 24-Hour TSP

Location	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
AMS1	170	260
AMS4	171	

Table B-3 Action and Limit Levels for Construction Noise

Time Period	Action Level	Limit Level
0700-1900 hrs on normal weekdays	When one documented complaint is received	75 dB(A) *

Noted: If works are to be carried during restricted hours, the conditions stipulated in the construction noise permit issued by the Noise Control Authority have to be followed.

(*) reduce to 70 dB(A) for schools and 65 dB(A) during school examination periods.

Table B-4 Action and Limit Levels for Water Quality

Parameter (unit)	Water Depth	Action Level	Limit Level
Dissolved Oxygen (mg/L) (surface, middle, bottom)	Surface and Middle	<u>5.0</u>	4.2 except 5 for FCZ
	Bottom	<u>4.7</u>	3.6
Turbidity (NTU)	Depth average	<u>27.5</u> and 120% of upstream control station's turbidity at the same tide of the same day	<u>47.0</u> and 130% of turbidity at the upstream control station at the same tide of same day
Suspended Solids (mg/L)	Depth average	<u>23.5</u> and 120% of upstream control station's SS at the same tide of the same day	<u>34.4</u> and 130% of SS at the upstream control station at the same tide of same day and 10mg/L for WSD Seawater Intakes

Note:

- (1) Depth-averaged is calculated by taking the arithmetic means of reading of all three depths
- (2) For DO, non-compliance of the water quality limit occurs when monitoring result is lower than the limit.
- (3) For SS & turbidity non-compliance of the water quality limits occur when monitoring result is higher than the limits.
- (4) All the figures given in the table are used for reference only and the EPD may amend the figures whenever it is considered as necessary.
- (5) The 1%-ile of baseline data for dissolved oxygen (surface and middle) and dissolved oxygen (bottom) are 4.2mg/L and 3.6mg/L respectively.

**APPENDIX C
COPIES OF CALIBRATION
CERTIFICATES**

High-Volume TSP Sampler

5-POINT CALIBRATION DATA SHEET

CINOTECH

File No. MA12014/67/0016

Project No. AMS 1 - Sha Lo Wan Operator: WK
 Date: 7-Jul-15 Next Due Date: 6-Sep-15
 Equipment No.: A-01-67 Serial No. 3218

Ambient Condition			
Temperature, Ta (K)	301.2	Pressure, Pa (mmHg)	753.1

Orifice Transfer Standard Information					
Equipment No.:	A-04-06	Slope, mc	0.0593	Intercept, bc	-0.02195
Last Calibration Date:	4-Feb-15	$mc \times Qstd + bc = [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	3-Feb-16	$Qstd = \{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$			

Calibration of TSP Sampler					
Calibration Point	Orifice			HVS	
	ΔH (orifice), in. of water	$[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$	Qstd (CFM) X-axis	ΔW (HVS), in. of water	$[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$ Y-axis
1	11.6	3.37	57.27	6.7	2.56
2	9.8	3.10	52.67	5.6	2.34
3	7.7	2.75	46.73	4.7	2.15
4	5.2	2.26	38.47	3.1	1.74
5	3.2	1.77	30.26	2.0	1.40

By Linear Regression of Y on X

Slope, mw = 0.0430 Intercept, bw : 0.1026
 Correlation coefficient* = 0.9989

*If Correlation Coefficient < 0.990, check and recalibrate.

Set Point Calculation	
From the TSP Field Calibration Curve, take Qstd = 43 CFM	
From the Regression Equation, the "Y" value according to	
$mw \times Qstd + bw = [\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$	
Therefore, Set Point; W = $(mw \times Qstd + bw)^2 \times (760 / Pa) \times (Ta / 298) =$ <u>3.88</u>	

Remarks: _____

Conducted by: Wk Tang Signature: [Signature] Date: 7/7/15
 Checked by: [Signature] Signature: [Signature] Date: 7 July 2015

High-Volume TSP Sampler

5-POINT CALIBRATION DATA SHEET

CINOTECH

File No. MA12014/74/0016

Project No. AMS 4 - San Tau Operator: WK
 Date: 7-Jul-15 Next Due Date: 6-Sep-15
 Equipment No.: A-01-74 Serial No. 2202

Ambient Condition			
Temperature, Ta (K)	303.9	Pressure, Pa (mmHg)	752

Orifice Transfer Standard Information					
Equipment No.:	A-04-06	Slope, mc	0.0593	Intercept, bc	-0.02195
Last Calibration Date:	4-Feb-15	$mc \times Qstd + bc = [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	3-Feb-16	$Qstd = \{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$			

Calibration of TSP Sampler					
Calibration Point	Orifice			HVS	
	ΔH (orifice), in. of water	[ΔH x (Pa/760) x (298/Ta)] ^{1/2}	Qstd (CFM) X - axis	ΔW (HVS), in. of water	[ΔW x (Pa/760) x (298/Ta)] ^{1/2} Y-axis
1	11.3	3.31	56.24	7.9	2.77
2	9.8	3.08	52.40	6.6	2.53
3	7.4	2.68	45.58	5.2	2.25
4	5.2	2.25	38.27	3.4	1.82
5	3.3	1.79	30.56	2.1	1.43

By Linear Regression of Y on X

Slope, mw = 0.0518 Intercept, bw : -0.1547

Correlation coefficient* = 0.9989

*If Correlation Coefficient < 0.990, check and recalibrate.

Set Point Calculation	
From the TSP Field Calibration Curve, take Qstd = 43 CFM	
From the Regression Equation, the "Y" value according to	
$mw \times Qstd + bw = [\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$	
Therefore, Set Point; W = (mw x Qstd + bw) ² x (760 / Pa) x (Ta / 298) =	<u>4.43</u>

Remarks: _____

Conducted by: Wk Tang Signature: [Signature]
 Checked by: [Signature] Signature: _____

Date: 7/7/15
 Date: 7 July 2015

High-Volume TSP Sampler

5-POINT CALIBRATION DATA SHEET

CINOTECH

File No. MA12014/67/0017

Project No. AMS 1 - Sha Lo Wan Operator: WK
 Date: 7-Sep-15 Next Due Date: 6-Nov-15
 Equipment No.: A-01-67 Serial No. 3218

Ambient Condition			
Temperature, Ta (K)	300.8	Pressure, Pa (mmHg)	757.1

Orifice Transfer Standard Information					
Equipment No.:	A-04-06	Slope, mc	0.0593	Intercept, bc	-0.02195
Last Calibration Date:	4-Feb-15	$mc \times Qstd + bc = [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	3-Feb-16	$Qstd = \{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$			

Calibration of TSP Sampler					
Calibration Point	Orifice			HVS	
	ΔH (orifice), in. of water	[ΔH x (Pa/760) x (298/Ta)] ^{1/2}	Qstd (CFM) X - axis	ΔW (HVS), in. of water	[ΔW x (Pa/760) x (298/Ta)] ^{1/2} Y-axis
1	11.4	3.35	56.97	6.7	2.57
2	9.7	3.09	52.58	5.5	2.33
3	7.8	2.77	47.19	4.6	2.13
4	5.2	2.27	38.60	3.1	1.75
5	3.3	1.80	30.82	2.0	1.40

By Linear Regression of Y on X

Slope, mw = 0.0439 Intercept, bw : 0.0524
 Correlation coefficient* = 0.9992

*If Correlation Coefficient < 0.990, check and recalibrate.

Set Point Calculation

From the TSP Field Calibration Curve, take Qstd = 43 CFM

From the Regression Equation, the "Y" value according to

$$mw \times Qstd + bw = [\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point; $W = (mw \times Qstd + bw)^2 \times (760 / Pa) \times (Ta / 298) =$ 3.81

Remarks: _____

Conducted by: Wk Tang Signature: [Signature]
 Checked by: LA Signature: [Signature]

Date: 7/9/15
 Date: 7 September 2015

High-Volume TSP Sampler 5-POINT CALIBRATION DATA SHEET

CINOTECH

File No. MA12014/74/0017

Project No. AMS 4 - San Tau Operator: WK
 Date: 7-Sep-15 Next Due Date: 6-Nov-15
 Equipment No.: A-01-74 Serial No. 2202

Ambient Condition			
Temperature, Ta (K)	301.5	Pressure, Pa (mmHg)	757.2

Orifice Transfer Standard Information					
Equipment No.:	A-04-06	Slope, mc	0.0593	Intercept, bc	-0.02195
Last Calibration Date:	4-Feb-15	$mc \times Qstd + bc = [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	3-Feb-16	$Qstd = \{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$			

Calibration of TSP Sampler					
Calibration Point	Orifice			HVS	
	ΔH (orifice), in. of water	$[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$	Qstd (CFM) X - axis	ΔW (HVS), in. of water	$[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$ Y-axis
1	11.4	3.35	56.91	7.8	2.77
2	9.8	3.11	52.79	6.7	2.57
3	7.6	2.74	46.53	5.2	2.26
4	5.3	2.28	38.92	3.4	1.83
5	3.4	1.83	31.25	2.1	1.44

By Linear Regression of Y on X

Slope, mw = 0.0523 Intercept, bw = -0.1961

Correlation coefficient* = 0.9997

*If Correlation Coefficient < 0.990, check and recalibrate.

Set Point Calculation

From the TSP Field Calibration Curve, take Qstd = 43 CFM

From the Regression Equation, the "Y" value according to

$$mw \times Qstd + bw = [\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point; $W = (mw \times Qstd + bw)^2 \times (760 / Pa) \times (Ta / 298) =$ 4.29

Remarks: _____

Conducted by: Wk Tang Signature: 
 Checked by: ATV Signature: 

Date: 7/9/15
 Date: 7 September 2015



Equipment No A-04-06

TISCH ENVIRONMENTAL, INC.
 145 SOUTH MIAMI AVE
 VILLAGE OF CLEVELAND, OH
 45002
 513.467.9000
 877.263.7610 TOLL FREE
 513.467.9009 FAX

ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

Date - Feb 04, 2015 Rootmeter S/N 0438320 Ta (K) - 293
 Operator Tisch Orifice I.D. - 2896 Pa (mm) - 756.92

PLATE OR Run #	VOLUME START (m3)	VOLUME STOP (m3)	DIFF VOLUME (m3)	DIFF TIME (min)	METER	ORFICE
					DIFF Hg (mm)	DIFF H2O (in.)
1	NA	NA	1.00	1.4590	3.2	2.00
2	NA	NA	1.00	1.0330	6.4	4.00
3	NA	NA	1.00	0.9250	7.9	5.00
4	NA	NA	1.00	0.8800	8.8	5.50
5	NA	NA	1.00	0.7260	12.7	8.00

DATA TABULATION

Vstd	(x axis) Qstd	(y axis)	Va	(x axis) Qa	(y axis)
1.0086	0.6913	1.4233	0.9958	0.6825	0.8799
1.0044	0.9723	2.0129	0.9916	0.9599	1.2443
1.0023	1.0835	2.2505	0.9895	1.0697	1.3912
1.0011	1.1377	2.3603	0.9884	1.1231	1.4591
0.9959	1.3718	2.8467	0.9832	1.3542	1.7598
Qstd slope (m) = 2.09317			Qa slope (m) = 1.31071		
intercept (b) = -0.02195			intercept (b) = -0.01357		
coefficient (r) = 0.99997			coefficient (r) = 0.99997		
y axis = SQRT[H2O(Pa/760)(298/Ta)]			y axis = SQRT[H2O(Ta/Pa)]		

CALCULATIONS

Vstd = Diff. Vol [(Pa-Diff. Hg)/760] (298/Ta)
 Qstd = Vstd/Time

Va = Diff Vol [(Pa-Diff Hg)/Pa]
 Qa = Va/Time

For subsequent flow rate calculations:

Qstd = 1/m{ [SQRT(H2O(Pa/760)(298/Ta))] - b }
 Qa = 1/m{ [SQRT H2O(Ta/Pa)] - b }



Calibration Certificate

Certificate No. **506584**

Page 1 of 2 Pages

Customer : Dragages - China Harbour - VSL Joint Venture

Address : 3/F., Island Place Tower, 510 King's Road, North Point, H. K.

Order No. : Q52586

Date of receipt : 31-Jul-15

Item Tested

Description : Weather Stations,Vantage Pro2

Manufacturer : Davis

Model : 6152 CUK

Serial No. : AK130520006

Test Conditions

Date of Test : 3-Aug-15

Supply Voltage : --

Ambient Temperature : (23 ± 3)°C

Relative Humidity : (50 ± 25) %

Test Specifications

Calibration check.

Ref. Document/Procedure : Z04.

Test Results


The results are shown in the attached page(s).


Main Test equipment used:

<u>Equipment No.</u>	<u>Description</u>	<u>Cert. No.</u>	<u>Traceable to</u>
S155	Std. Anemometer	NSC201431181	NIM-PRC

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI).
The test results apply to the above Unit-Under-Test only

Calibrated by : 
Dorothy Cheuk

Approved by : 
Steve Kwan

Date: 4-Aug-15

This Certificate is issued by
Hong Kong Calibration Ltd
Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong
Tel 2425 8801 Fax 2425 6646



Calibration Certificate

Certificate No. 506584

Page 2 of 2 Pages

Results :

1. Wind Speed

Applied Value (m/s)	UUT Reading (m/s)
0.0	0.0
2.5	2.2
5.0	4.9
7.5	7.6
10.0	9.8
15.0	14.8
19.0	18.8


Uncertainty : $\pm (2 \% + 0.2 \text{ m/s})$

2. Wind Direction

Reference Value	UUT Indication
N (0°)	N (0°)
NE (45°)	NE (45°)
E (90°)	E (90°)
SE (135°)	SE (135°)
S (180°)	S (180°)
SW (225°)	SW (225°)
W (270°)	W (270°)
NW (315°)	NW (315°)

- Remark : 1. UUT: Unit-Under-Test
2. Atmospheric Pressure : 998 hPa
3. Before the calibration of the Wind Direction function, the Arrow Head was adjusted to the magnetic NORTH direction while the monitor indicated N. The customer is reminded to do the alignment again after installation.

----- END -----

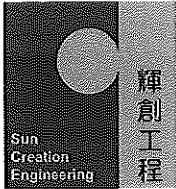

Certificate of Calibration 校正證書

Certificate No. : C150005
證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號 : IC14-3254) Date of Receipt / 收件日期 : 29 December 2014
Description / 儀器名稱 : Sound & Vibration Analyser
Manufacturer / 製造商 : Svantek
Model No. / 型號 : SVAN957
Serial No. / 編號 : 23853
Supplied By / 委託者 : Dragages - China Harbour - VSL Joint Venture
3/F, Island Place Tower, 510 King's Road,
North Point, Hong Kong

TEST CONDITIONS / 測試條件

Temperature / 溫度 : (23 ± 2)°C Relative Humidity / 相對濕度 : (55 ± 20)%
Line Voltage / 電壓 : ---

TEST SPECIFICATIONS / 測試規範

Calibration check


DATE OF TEST / 測試日期 : 2 January 2015


TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.
All results are within manufacturer's specification.
The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via :

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By : 
測試 : K C Lee
Project Engineer

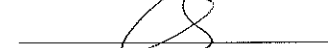Certified By : 
核證 : K M Wu
Engineer

Date of Issue : 6 January 2015
簽發日期

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.
本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Certificate of Calibration

校正證書

Certificate No. : C150005
證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- Self-calibration using the Svantek acoustic calibrator SV30A, S/N : 24803 was performed before the test from 6.1.1 to 6.3.2
- The results presented are the mean of 3 measurements at each calibration point.
- Test equipment :

Equipment ID	Description	Certificate No.
CL280	40 MHz Arbitrary Waveform Generator	C140016
CL281	Multifunction Acoustic Calibrator	DC130171

- Test procedure : MA101N.

- Results :

6.1 Sound Pressure Level

6.1.1 Reference Sound Pressure Level

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)		
HIGH	SPL	A	Fast	114.00	1	113.8	± 1.1

6.1.2 Linearity

UUT Setting				Applied Value		UUT Reading (dB)
Range	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	
HIGH	SPL	A	Fast	114.00	1	113.8 (Ref.)
				104.00		103.8
				94.00		93.8

IEC 61672 Class 1 Spec. : ± 0.6 dB per 10 dB step and ± 1.1 dB for overall different.

6.2 Time Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)		
HIGH	SPL	A	Fast	114.00	1	113.8	Ref.
			Slow				

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室所書面批准。

Sun Creation Engineering Limited – Calibration & Testing Laboratory

c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 – 校正及檢測實驗室

c/o 香港新界屯門興安里一號青山灣機樓四樓

Tel/電話: 2927 2606 Fax/傳真: 2744 8986 E-mail/電郵: callab@suncreation.com Website/網址: www.suncreation.com

Certificate of Calibration

校正證書

Certificate No. : C150005
證書編號

6.3 Frequency Weighting

6.3.1 A-Weighting


UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq.		
HIGH	SPL	A	Fast	114.00	63 Hz	87.6	-26.2 ± 1.5
					125 Hz	97.6	-16.1 ± 1.5
					250 Hz	105.1	-8.6 ± 1.4
					500 Hz	110.5	-3.2 ± 1.4
					1 kHz	113.8	Ref.
					2 kHz	115.0	+1.2 ± 1.6
					4 kHz	114.8	+1.0 ± 1.6
					8 kHz	112.8	-1.1 (+2.1 ; -3.1)
					12.5 kHz	109.5	-4.3 (+3.0 ; -6.0)

6.3.2 C-Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq.		
HIGH	SPL	C	Fast	114.00	63 Hz	113.0	-0.8 ± 1.5
					125 Hz	113.6	-0.2 ± 1.5
					250 Hz	113.8	0.0 ± 1.4
					500 Hz	113.8	0.0 ± 1.4
					1 kHz	113.8	Ref.
					2 kHz	113.6	-0.2 ± 1.6
					4 kHz	113.0	-0.8 ± 1.6
					8 kHz	110.9	-3.0 (+2.1 ; -3.1)
					12.5 kHz	107.6	-6.2 (+6.0 ; -∞)

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準，局部複印本證書需先獲本實驗室書面批准。

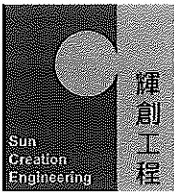

Certificate of Calibration 校正證書

Certificate No. : C150005
證書編號

Remarks : - UUT Microphone Model No. : ACO 7052S & S/N : 35989

- Mfr's Spec. : IEC 61672 Class 1

- Uncertainties of Applied Value :

114 dB : 63 Hz - 125 Hz	: ± 0.45 dB
250 Hz - 500 Hz	: ± 0.40 dB
1 kHz	: ± 0.30 dB
2 kHz - 4 kHz	: ± 0.45 dB
8 kHz	: ± 0.55 dB
12.5 kHz	: ± 0.80 dB
104 dB : 1 kHz	: ± 0.10 dB (Ref. 94 dB)
94 dB : 1 kHz	: ± 0.10 dB (Ref. 94 dB)
94 dB : 1 kHz	: ± 0.20 dB

- The uncertainties are for a confidence probability of not less than 95 %.

Note :

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室所書面批准。

Sun Creation Engineering Limited – Calibration & Testing Laboratory

c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 – 校正及檢測實驗室

c/o 香港新界屯門興安里一號青山灣機樓四樓

Tel/電話: 2927 2606

Fax/傳真: 2744 8986

E-mail/電郵: callab@suncreation.com

Website/網址: www.suncreation.com



輝創工程有限公司

Sun Creation Engineering Limited
Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No. : C150004
證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號 : IC14-3254) Date of Receipt / 收件日期 : 29 December 2014

Description / 儀器名稱 : Acoustic Calibrator
Manufacturer / 製造商 : Svantek
Model No. / 型號 : SV30A
Serial No. / 編號 : 24803
Supplied By / 委託者 : Dragages - China Harbour - VSL Joint Venture
3/F, Island Place Tower, 510 King's Road,
North Point, Hong Kong

TEST CONDITIONS / 測試條件

Temperature / 溫度 : (23 ± 2)°C Relative Humidity / 相對濕度 : (55 ± 20)%
Line Voltage / 電壓 : ---

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 2 January 2015


TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.
All results are within manufacturer's specification.
The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via :


- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By : 
測試 : K O Lee
Project Engineer

Certified By : 
核證 : K M Wu
Engineer

Date of Issue : 6 January 2015
簽發日期

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.
本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

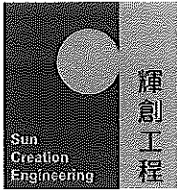

Certificate of Calibration

校正證書

Certificate No. : C150004
證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.
- Test equipment :

<u>Equipment ID</u>	<u>Description</u>	<u>Certificate No.</u>
CL130	Universal Counter	C143868
CL281	Multifunction Acoustic Calibrator	DC130171
TST150A	Measuring Amplifier	C141558

- Test procedure : MA100N.

- Results :

5.1 Sound Level Accuracy

UUT Nominal Value	Measured Value (dB)	Mfr's Spec. (dB)	Uncertainty of Measured Value (dB)
94 dB, 1 kHz	94.2	± 0.3	± 0.2
114 dB, 1 kHz	114.2		

5.2 Frequency Accuracy

UUT Nominal Value (kHz)	Measured Value (kHz)	Mfr's Spec.	Uncertainty of Measured Value (Hz)
1	0.999 98	1 kHz ± 0.02 %	± 0.01

Remark : - The uncertainties are for a confidence probability of not less than 95 %.

Note :

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

Sun Creation Engineering Limited – Calibration & Testing Laboratory

c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 – 校正及檢測實驗室

c/o 香港新界屯門興安里一號青山灣機樓四樓

Tel/電話: 2927 2606

Fax/傳真: 2744 8986

E-mail/電郵: callab@suncreation.com

Website/網址: www.suncreation.com



佳力高試驗中心有限公司
CASTCO TESTING CENTRE LTD.

COPY

TEST REPORT
Chemical Analysis of Water
Accuracy check of YSI Sondes Environmental Monitoring System

Date of issue: 22-08-2015

Page 1 of 1 pages

Castco LRN: EN0150811-50

Sample details as supplied by customer

Customer : Dragages-China Harbour-VSL Joint Venture

Customer Ref. No. : --

Address: Tung Chung Waterfront Road, adjacent to Tung Chung New Development Pier

Job Title : Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road - Section between HKSAR Boundary and Scenic Hill

Contract No.: HY/2011/09

Laboratory Test Result

Instrument Name: Sonde Environmental Monitoring System

Manufacturer : YSI

Instrument No. : W.03.13

Model No. : YSI 6820

Date of Calibration : 11-08-2015

Serial No. : 12B100804

Date of Next Calibration : 11-11-2015

pH Value Check (pH Probe : Model: 6589, L/N: 14M)

Expected Reading (pH Unit)	Sonde Reading (pH Unit)	Tolerance (pH Unit)	Tolerance Limit (pH Unit)	Method Reference
4.00	4.02	+0.02	± 0.2	APHA 21e, 4500-H ⁺ B
7.02	7.04	+0.02		
10.06	10.01	-0.05		

Turbidity Check (Turbidity Sensor : Model: 6136, S/N: 11J100476)

Expected Reading (NTU)	Sonde Reading (NTU)	Tolerance (%)	Tolerance Limit (%)	Method Reference
4.00	4.1	+2.5	± 10	APHA 21e, 2130B
10.00	9.8	-2		
20.00	18.4	-8		
50.00	50.5	+1		
100.00	99.7	-0.3		

Conductivity Performance Check (Conductivity Sensor : Model: 6560, L/N : 14M100013)

Expected Reading (µS/cm)	Sonde Reading (µS/cm)	Tolerance (%)	Tolerance Limit (%)	Method Reference
1412 at 25 °C	1403 at 25 °C	-0.6	± 10	APHA 21e, 2510B

Salinity Performance Check (Salinity Sensor : Model: 6560, L/N: 14M100013)

Expected Reading (ppt)	Sonde Reading (ppt)	Tolerance (%)	Tolerance Limit (%)	Method Reference
33	32.26	-2.2	± 10	APHA 19e, 2520B

Dissolved Oxygen Check (Dissolved Oxygen Sensor : Model: 6562, L/N: 07E100029)

DO from Winkler Titration (mg/L)	Sonde Reading (mg/L)	Tolerance (mg/L)	Tolerance Limit (mg/L)	Method Reference
8.22	8.30	+0.08	± 0.20	APHA 21e, 4500-O C&G
4.93	4.92	-0.01		

Water Level Meter Check

Expected Reading (m)	Sonde Reading (m)	Tolerance (m)	Tolerance Limit (m)	Method Reference
1.00	0.98	-0.02	± 0.05	YSI Sondes Procedure Manual

Temperature Check

Expected Reading (°C)	Sonde Reading (°C)	Tolerance (°C)	Tolerance Limit (°C)	Method Reference
24.6	24.71	+0.11	± 2.0	Telarc Technical Guide No.3 1986

Checked by: AU KWOK KIN
Senior Chemist

Certified by: CHEN YU CHAI
Senior Manager

End of Report

Form No. ENV SONDE_T1 d422/02/2013



佳力高試驗中心有限公司
CASTCO TESTING CENTRE LTD.

COPY

TEST REPORT
Chemical Analysis of Water

Accuracy check of YSI Sondes Environmental Monitoring System

Date of issue: 22-08-2015

Page 1 of 1 pages

Castco LRN: EN0150811-51

Sample details as supplied by customer

Customer: Dragages-China Harbour-VSL Joint Venture

Customer Ref. No.: --

Address: Tung Chung Waterfront Road, adjacent to Tung Chung New Development Pier

Job Title: Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road - Section between HKSAR Boundary and Scenic Hill

Contract No.: HY/2011/09

Laboratory Test Result

Instrument Name: Sonde Environmental Monitoring System

Manufacturer: YSI

Model No.: YSI 6920

Serial No.: 11J101088

Instrument No.: W.03.11

Date of Calibration: 11-08-2015

Date of Next Calibration: 11-11-2015

pH Value Check (pH Probe: Model: 6589, L/N: 1.5B)

Expected Reading (pH Unit)	Sonde Reading (pH Unit)	Tolerance (pH Unit)	Tolerance Limit (pH Unit)	Method Reference
4.00	4.07	+0.07	± 0.2	APHA 21e, 4500-H ⁺ B
7.02	7.03	+0.01		
10.06	9.97	-0.09		

Turbidity Check (Turbidity Sensor: Model: 6136, S/N: 13K103053)

Expected Reading (NTU)	Sonde Reading (NTU)	Tolerance (%)	Tolerance Limit (%)	Method Reference
4.00	4.1	+2.5	± 10	APHA 21e, 2130B
10.00	9.8	-2		
20.00	18.0	-10		
50.00	48.3	-3.4		
100.00	97.0	-3		

Conductivity Performance Check (Conductivity Sensor: Model: 6560, L/N: 15B100399)

Expected Reading (µS/cm)	Sonde Reading (µS/cm)	Tolerance (%)	Tolerance Limit (%)	Method Reference
1412 at 25 °C	1382 at 25 °C	-2.1	± 10	APHA 21e, 2510B

Salinity Performance Check (Salinity Sensor: Model: 6560, L/N: 15B100399)

Expected Reading (ppt)	Sonde Reading (ppt)	Tolerance (%)	Tolerance Limit (%)	Method Reference
33	31.87	-3.4	± 10	APHA 19e, 2520B

Dissolved Oxygen Check (Dissolved Oxygen Sensor: Model: 6562, L/N: 15A100700)

DO from Winkler Titration (mg/L)	Sonde Reading (mg/L)	Tolerance (mg/L)	Tolerance Limit (mg/L)	Method Reference
8.20	8.35	+0.15	± 0.20	APHA 21e, 4500-O C&G
4.82	4.90	+0.08		

Water Level Meter Check

Expected Reading (m)	Sonde Reading (m)	Tolerance (m)	Tolerance Limit (m)	Method Reference
1.02	0.99	-0.03	± 0.05	YSI Sondes Procedure Manual

Temperature Check

Expected Reading (°C)	Sonde Reading (°C)	Tolerance (°C)	Tolerance Limit (°C)	Method Reference
24.6	24.52	-0.08	± 2.0	Telarc Technical Guide No.3 1986

Checked by: _____

AU KWOK KIN
Senior Chemist

Certified by: _____

CHENG CHI FAI
Senior Manager

End of Report

Form No. ENV SONDE_T1 6d 22/02/2013

香港粉嶺安居街33號
香港粉嶺安全街29A號

33, On Kui Street, Fanling, Hong Kong.
29A, On Chuen Street, Fanling, Hong Kong.

Tel: 2677 2138
Fax: 2677 0351

E-mail: castco@netigator.com Website: www.castco.com.hk

**APPENDIX D
ENVIRONMENTAL MONITORING
SCHEDULES**

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Impact Air Quality and Noise Monitoring Schedule in September 2015**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1-Sep	2-Sep	3-Sep	4-Sep	5-Sep
		Noise			24 hr TSP 1 hr TSP X 3	
6-Sep	7-Sep	8-Sep	9-Sep	10-Sep	11-Sep	12-Sep
				24 hr TSP 1 hr TSP X 3	Noise	
13-Sep	14-Sep	15-Sep	16-Sep	17-Sep	18-Sep	19-Sep
			24 hr TSP 1 hr TSP X 3	Noise		
20-Sep	21-Sep	22-Sep	23-Sep	24-Sep	25-Sep	26-Sep
		24 hr TSP 1 hr TSP X 3	Noise			
27-Sep	28-Sep	29-Sep	30-Sep			
	24 hr TSP 1 hr TSP X 3	Noise				

Air Quality Monitoring Stations

AMS1 - Sha Lo Wan
AMS4 - San Tau

Noise Monitoring Stations

NMS1 - Sha Lo Wan
NMS4 - San Tau

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Tentative Impact Air Quality and Noise Monitoring Schedule in October 2015**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
				1-Oct	2-Oct	3-Oct
					24 hr TSP 1 hr TSP X 3	
4-Oct	5-Oct	6-Oct	7-Oct	8-Oct	9-Oct	10-Oct
				24 hr TSP 1 hr TSP X 3	Noise	
11-Oct	12-Oct	13-Oct	14-Oct	15-Oct	16-Oct	17-Oct
			24 hr TSP 1 hr TSP X 3	Noise		
18-Oct	19-Oct	20-Oct	21-Oct	22-Oct	23-Oct	24-Oct
		24 hr TSP 1 hr TSP X 3		Noise		
25-Oct	26-Oct	27-Oct	28-Oct	29-Oct	30-Oct	31-Oct
	24 hr TSP 1 hr TSP X 3	Noise				

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

Air Quality Monitoring Stations

AMS1 - Sha Lo Wan
AMS4 - San Tau

Noise Monitoring Stations

NMS1 - Sha Lo Wan
NMS4 - San Tau

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Impact Water Quality Monitoring Schedule in September 2015**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1-Sep	2-Sep	3-Sep	4-Sep	5-Sep
			<u>Water Quality Monitoring</u> Mid-Flood 9:13 Mid-Ebb 15:22		<u>Water Quality Monitoring</u> Mid-Flood 11:08 Mid-Ebb 17:00	
6-Sep	7-Sep	8-Sep	9-Sep	10-Sep	11-Sep	12-Sep
	<u>Water Quality Monitoring</u> Mid-Ebb 8:19 Mid-Flood 15:52		<u>Water Quality Monitoring</u> Mid-Ebb 10:22 Mid-Flood 17:30		<u>Water Quality Monitoring</u> Mid-Ebb 11:49 Mid-Flood 18:24	
13-Sep	14-Sep	15-Sep	16-Sep	17-Sep	18-Sep	19-Sep
	<u>Water Quality Monitoring</u> Mid-Ebb 13:33 Mid-Flood 19:42		<u>Water Quality Monitoring</u> Mid-Flood 8:24 Mid-Ebb 14:34		<u>Water Quality Monitoring</u> Mid-Flood 9:38 Mid-Ebb 15:35	
20-Sep	21-Sep	22-Sep	23-Sep	24-Sep	25-Sep	26-Sep
	<u>Water Quality Monitoring</u> Mid-Flood 13:04 Mid-Ebb 18:25		<u>Water Quality Monitoring</u> Mid-Ebb 8:12 Mid-Flood 15:57		<u>Water Quality Monitoring</u> Mid-Ebb 10:17 Mid-Flood 17:19	
27-Sep	28-Sep	29-Sep	30-Sep			
	<u>Water Quality Monitoring</u> Mid-Ebb 12:49 Mid-Flood 19:07		<u>Water Quality Monitoring</u> Mid-Flood 8:16 Mid-Ebb 14:21			

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Tentative Impact Water Quality Monitoring Schedule in October 2015**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
				1-Oct	2-Oct	3-Oct
					<u>Water Quality Monitoring</u> Mid-Flood 10:00 Mid-Ebb 15:52	
4-Oct	5-Oct	6-Oct	7-Oct	8-Oct	9-Oct	10-Oct
	<u>Water Quality Monitoring</u> Mid-Ebb 6:03 Mid-Flood 14:00		<u>Water Quality Monitoring</u> Mid-Ebb 8:48 Mid-Flood 16:17		<u>Water Quality Monitoring</u> Mid-Ebb 10:41 Mid-Flood 17:18	
11-Oct	12-Oct	13-Oct	14-Oct	15-Oct	16-Oct	17-Oct
	<u>Water Quality Monitoring</u> Mid-Ebb 12:35 Mid-Flood 18:34		<u>Water Quality Monitoring</u> Mid-Ebb 13:39 Mid-Flood 19:24		<u>Water Quality Monitoring</u> Mid-Flood 8:52 Mid-Ebb 14:44	
18-Oct	19-Oct	20-Oct	21-Oct	22-Oct	23-Oct	24-Oct
		<u>Water Quality Monitoring</u> Mid-Flood 12:48 Mid-Ebb 18:15		<u>Water Quality Monitoring</u> Mid-Ebb 7:21 Mid-Flood 15:13		<u>Water Quality Monitoring</u> Mid-Ebb 9:48 Mid-Flood 16:40
25-Oct	26-Oct	27-Oct	28-Oct	29-Oct	30-Oct	31-Oct
	<u>Water Quality Monitoring</u> Mid-Ebb 11:40 Mid-Flood 17:54		<u>Water Quality Monitoring</u> Mid-Ebb 13:17 Mid-Flood 19:05		<u>Water Quality Monitoring</u> Mid-Flood 9:00 Mid-Ebb 14:49	

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Construction-Phase Dolphin Monitoring in West Lantau (Line Transect Vessel Survey) in September 2015**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1-Sep	2-Sep	3-Sep	4-Sep	5-Sep
6-Sep	7-Sep	8-Sep	9-Sep	10-Sep	11-Sep	12-Sep
	Line Transect Vessel Survey			Line Transect Vessel Survey		
13-Sep	14-Sep	15-Sep	16-Sep	17-Sep	18-Sep	19-Sep
20-Sep	21-Sep	22-Sep	23-Sep	24-Sep	25-Sep	26-Sep
27-Sep	28-Sep	29-Sep	30-Sep			

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Tentative Construction-Phase Dolphin Monitoring in West Lantau (Line Transect Vessel Survey) in October 2015**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
				1-Oct	2-Oct	3-Oct
4-Oct	5-Oct	6-Oct	7-Oct	8-Oct	9-Oct	10-Oct
				Line Transect Vessel Survey		
11-Oct	12-Oct	13-Oct	14-Oct	15-Oct	16-Oct	17-Oct
				Line Transect Vessel Survey		
18-Oct	19-Oct	20-Oct	21-Oct	22-Oct	23-Oct	24-Oct
25-Oct	26-Oct	27-Oct	28-Oct	29-Oct	30-Oct	31-Oct

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Additional Land-based Dolphin Behaviour and Movement Monitoring in September 2015**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1-Sep	2-Sep	3-Sep	4-Sep	5-Sep
					Additional Land-based Dolphin Behaviour and Movement Monitoring	
6-Sep	7-Sep	8-Sep	9-Sep	10-Sep	11-Sep	12-Sep
13-Sep	14-Sep	15-Sep	16-Sep	17-Sep	18-Sep	19-Sep
20-Sep	21-Sep	22-Sep	23-Sep	24-Sep	25-Sep	26-Sep
			Additional Land-based Dolphin Behaviour and Movement Monitoring			
27-Sep	28-Sep	29-Sep	30-Sep			

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Tentative Additional Land-based Dolphin Behaviour and Movement Monitoring in October 2015**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
				1-Oct	2-Oct	3-Oct
					Additional Land-based Dolphin Behaviour and Movement Monitoring	
4-Oct	5-Oct	6-Oct	7-Oct	8-Oct	9-Oct	10-Oct
11-Oct	12-Oct	13-Oct	14-Oct	15-Oct	16-Oct	17-Oct
					Additional Land-based Dolphin Behaviour and Movement Monitoring	
18-Oct	19-Oct	20-Oct	21-Oct	22-Oct	23-Oct	24-Oct
25-Oct	26-Oct	27-Oct	28-Oct	29-Oct	30-Oct	31-Oct

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

**APPENDIX E
1-HOUR TSP MONITORING RESULTS
AND GRAPHICAL PRESENTATION**

Appendix E - 1-hour TSP Monitoring Results



Location AMS1 - Sha Lo Wan

Sampling Date	Start Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure, Pa (mmHg)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
					Initial	Final		Initial	Final		Initial	Final			
4-Sep-15	8:35	Cloudy	303.1	762.6	2.8347	2.8361	0.0014	5988.8	5989.8	1.0	1.22	1.22	1.22	73.4	19
4-Sep-15	9:40	Cloudy	303.3	762.4	2.8216	2.8226	0.0010	5989.8	5990.8	1.0	1.22	1.22	1.22	73.4	14
4-Sep-15	10:50	Cloudy	303.5	762.2	2.8324	2.8334	0.0010	5990.8	5991.8	1.0	1.22	1.22	1.22	73.3	14
10-Sep-15	9:00	Sunny	299.9	753.1	2.7463	2.7484	0.0021	6015.8	6016.8	1.0	1.21	1.21	1.21	72.8	29
10-Sep-15	10:00	Sunny	300.1	752.9	2.7377	2.7410	0.0033	6016.8	6017.8	1.0	1.21	1.21	1.21	72.8	45
10-Sep-15	11:00	Sunny	300.3	752.7	2.8846	2.8866	0.0020	6017.8	6018.8	1.0	1.21	1.21	1.21	72.7	28
16-Sep-15	9:45	Sunny	300.4	761.5	2.8337	2.8352	0.0015	6042.8	6043.8	1.0	1.22	1.22	1.22	73.1	21
16-Sep-15	10:50	Sunny	300.6	761.3	2.8269	2.8284	0.0015	6043.8	6044.8	1.0	1.22	1.22	1.22	73.1	21
16-Sep-15	13:00	Sunny	300.8	761.1	2.8338	2.8353	0.0015	6044.8	6045.8	1.0	1.22	1.22	1.22	73.1	21
22-Sep-15	9:00	Sunny	301.7	760.7	2.6323	2.6361	0.0038	6069.8	6070.8	1.0	1.22	1.22	1.22	72.9	52
22-Sep-15	10:00	Sunny	301.9	760.5	2.6318	2.6320	0.0002	6070.8	6071.8	1.0	1.22	1.21	1.22	72.9	3
22-Sep-15	11:00	Sunny	302.1	760.3	2.6578	2.6586	0.0008	6071.8	6072.8	1.0	1.21	1.21	1.21	72.9	11
28-Sep-15	13:00	Sunny	304.1	755.8	2.6588	2.6661	0.0073	6096.9	6097.9	1.0	1.21	1.21	1.21	72.4	101
28-Sep-15	14:00	Sunny	304.3	755.6	2.6548	2.6586	0.0038	6097.9	6098.9	1.0	1.21	1.21	1.21	72.4	53
28-Sep-15	15:00	Sunny	304.5	755.4	2.6510	2.6551	0.0041	6098.9	6099.9	1.0	1.21	1.21	1.21	72.3	57
														Min	3
														Max	101
														Average	32

Location AMS4 - San Tau

Sampling Date	Start Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure, Pa (mmHg)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
					Initial	Final		Initial	Final		Initial	Final			
4-Sep-15	13:00	Cloudy	303.2	761.6	2.8422	2.8428	0.0006	5638.0	5639.0	1.0	1.22	1.22	1.22	73.3	8
4-Sep-15	14:00	Cloudy	303.4	761.4	2.8322	2.8332	0.0010	5639.0	5640.0	1.0	1.22	1.22	1.22	73.3	14
4-Sep-15	15:00	Cloudy	303.6	761.2	2.8636	2.8642	0.0006	5640.0	5641.0	1.0	1.22	1.22	1.22	73.2	8
10-Sep-15	13:00	Sunny	302.4	760.5	2.8621	2.8642	0.0021	5665.0	5666.0	1.0	1.22	1.22	1.22	74.7	28
10-Sep-15	14:00	Sunny	302.6	760.3	2.8692	2.8712	0.0020	5666.0	5667.0	1.0	1.22	1.22	1.22	73.2	27
10-Sep-15	15:00	Sunny	302.8	760.1	2.8805	2.8825	0.0020	5667.0	5668.0	1.0	1.22	1.22	1.22	73.2	27
16-Sep-15	10:00	Sunny	300.8	761.5	2.8289	2.8321	0.0032	5692.0	5693.0	1.0	1.22	1.22	1.22	73.4	44
16-Sep-15	11:00	Sunny	301.0	761.2	2.8202	2.8231	0.0029	5693.0	5694.0	1.0	1.22	1.22	1.22	73.4	40
16-Sep-15	13:00	Sunny	302.6	761.4	2.8313	2.8337	0.0024	5694.0	5695.0	1.0	1.22	1.22	1.22	73.2	33
22-Sep-15	9:00	Sunny	301.8	760.7	2.6235	2.6280	0.0045	5719.0	5720.0	1.0	1.22	1.22	1.22	73.3	61
22-Sep-15	10:00	Sunny	302.0	760.5	2.6053	2.6064	0.0011	5720.0	5721.0	1.0	1.22	1.22	1.22	73.3	15
22-Sep-15	11:00	Sunny	302.2	760.3	2.6293	2.6309	0.0016	5721.0	5722.0	1.0	1.22	1.22	1.22	73.2	22
28-Sep-15	15:00	Sunny	303.7	755.5	2.6693	2.6758	0.0065	5746.0	5747.0	1.0	1.21	1.21	1.21	72.9	89
28-Sep-15	16:00	Sunny	303.9	755.3	2.6306	2.6367	0.0061	5747.0	5748.0	1.0	1.21	1.21	1.21	72.8	84
28-Sep-15	17:00	Sunny	304.1	755.1	2.6689	2.6758	0.0069	5748.0	5749.0	1.0	1.21	1.21	1.21	72.8	95
														Min	8
														Max	95
														Average	40

1-hour TSP Concentration Levels

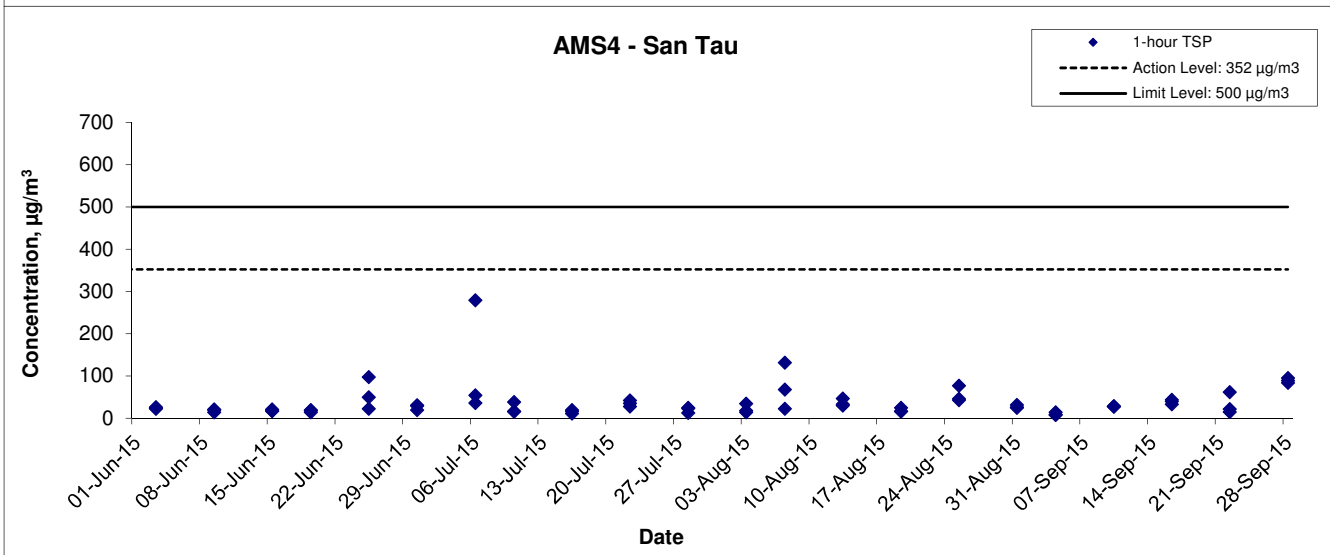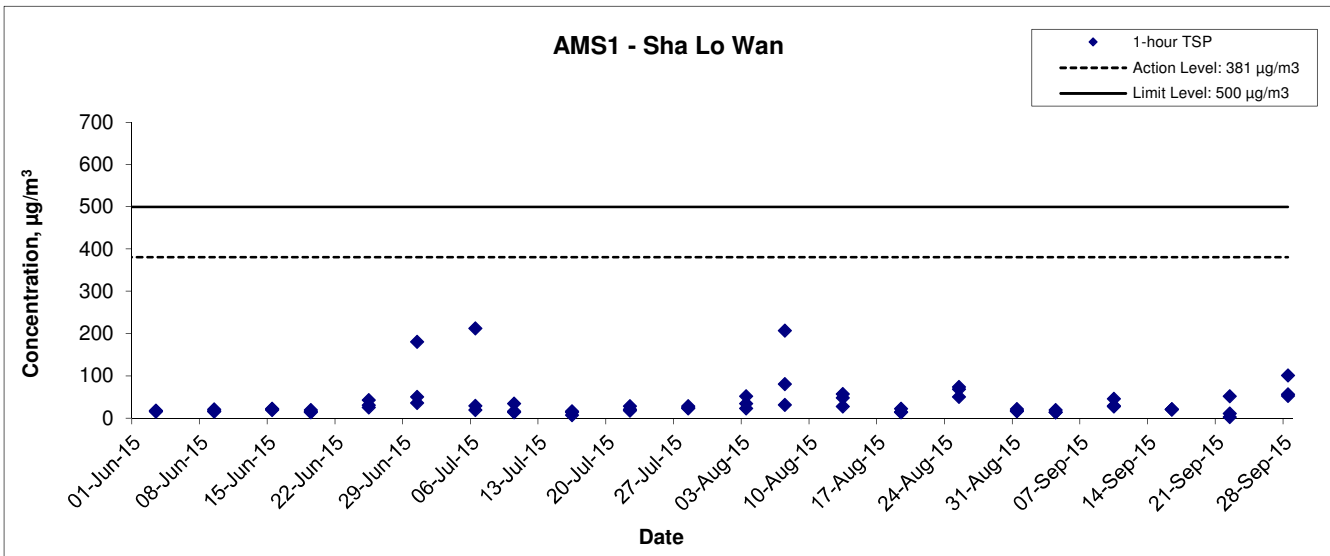

Title Contract No. 11/2011/03 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill Graphical Presentation of 1-hour TSP Monitoring Results	Scale N.T.S	Project No. MA12014	
	Date Sep 15	Appendix E	

**APPENDIX F
24-HOUR TSP MONITORING RESULTS
AND GRAPHICAL PRESENTATION**

Appendix F - 24-hour TSP Monitoring Results



Location AMS1 - Sha Lo Wan

Sampling Date	Start Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure, Pa (mmHg)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
					Initial	Final		Initial	Final		Initial	Final			
4-Sep-15	12:35	Cloudy	304.0	761.9	2.8381	2.8836	0.0455	5991.8	6015.8	24.0	1.22	1.22	1.22	1758.3	26
10-Sep-15	12:05	Sunny	300.5	752.5	2.8740	2.9389	0.0649	6018.8	6042.8	24.0	1.21	1.21	1.21	1744.5	37
16-Sep-15	14:00	Cloudy	301.1	760.9	2.8161	2.8804	0.0643	6045.8	6069.8	24.0	1.22	1.22	1.22	1752.8	37
22-Sep-15	13:00	Sunny	302.5	760.1	2.6580	2.6940	0.0360	6072.8	6096.8	24.0	1.21	1.21	1.21	1747.5	21
28-Sep-15	13:00	Sunny	304.7	755.2	2.6797	2.8188	0.1391	6099.9	6123.9	24.0	1.21	1.20	1.21	1735.3	80
														Min	21
														Max	80
														Average	40

Location AMS4 - San Tau

Sampling Date	Start Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure, Pa (mmHg)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
					Initial	Final		Initial	Final		Initial	Final			
4-Sep-15	16:10	Cloudy	303.8	761.1	2.8605	2.8966	0.0361	5641.0	5665.0	24.0	1.22	1.22	1.22	1757.2	21
10-Sep-15	16:05	Sunny	303.0	759.9	2.8669	2.9328	0.0659	5668.0	5692.0	24.0	1.22	1.22	1.22	1755.1	38
16-Sep-15	14:00	Cloudy	302.8	761.2	2.8107	2.8781	0.0674	5695.0	5719.0	24.0	1.22	1.22	1.22	1757.0	38
22-Sep-15	13:00	Sunny	302.8	760.1	2.6465	2.6875	0.0410	5722.0	5746.0	24.0	1.22	1.22	1.22	1755.8	23
28-Sep-15	18:00	Sunny	304.3	755.0	2.6489	2.8049	0.1560	5749.0	5773.0	24.0	1.21	1.21	1.21	1746.6	89
														Min	21
														Max	89
														Average	42

24-hour TSP Concentration Levels

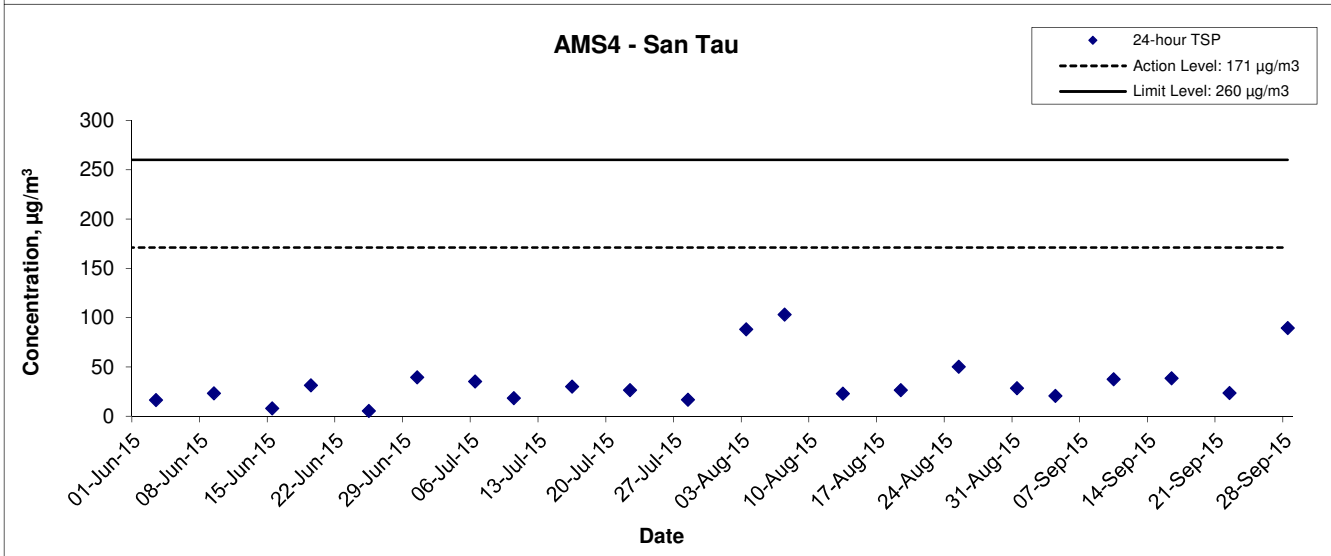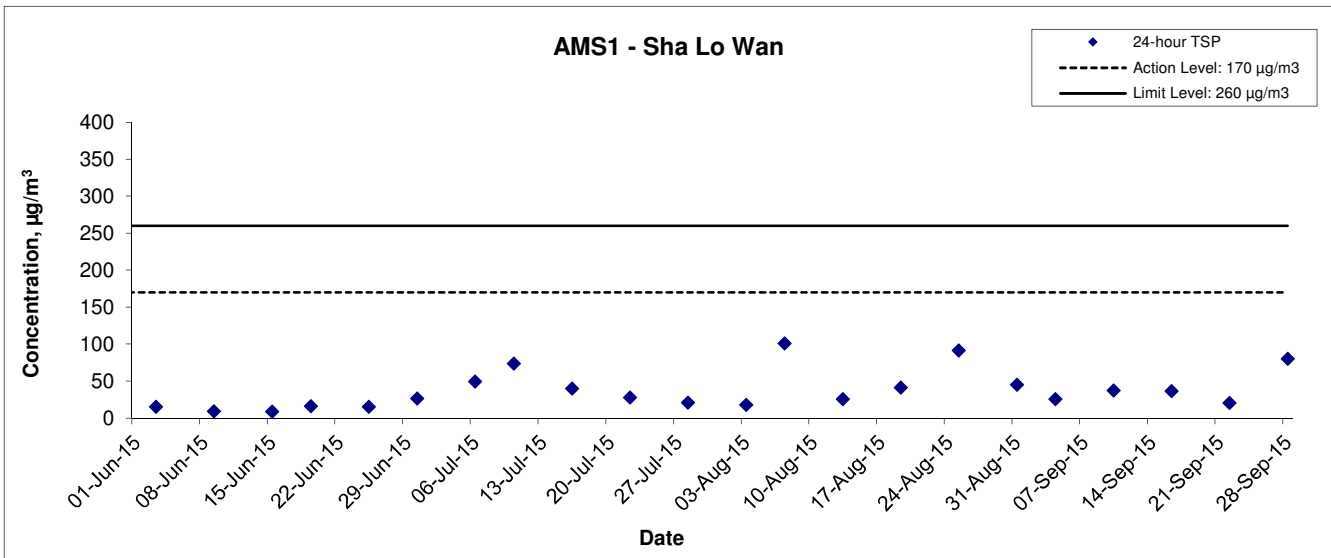

Title Contract No.: 11/2011/03 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill Graphical Presentation of 24-hour TSP Monitoring Results	Scale N.T.S	Project No. MA12014	CINOTECH
	Date Sep 15	Appendix F	

**APPENDIX G
NOISE MONITORING RESULTS AND
GRAPHICAL PRESENTATION**

Appendix G - Noise Monitoring Results



Location NMS 1 - Sha Lo Wan								
Date	Weather	Time	Unit: dB (A) (5-min)			Average	Baseline Level	Construction Noise Level
			L _{eq}	L ₁₀	L ₉₀	L _{eq}	L _{eq}	L _{eq}
1-Sep-15	Cloudy	13:40	70.7	73.8	66.4	71	66.9	71 Measured ≤ Limit Level
		13:45	70.2	73.6	65.9			
		13:50	70.6	73.8	66.3			
		13:55	71.3	74.1	66.8			
		14:00	71.3	73.9	66.9			
		14:05	70.9	73.5	65.4			
11-Sep-15	Sunny	14:00	70.5	71.3	65.1	71	66.9	71 Measured ≤ Limit Level
		14:05	71.1	72.3	66.5			
		14:10	70.9	72.1	66.3			
		14:15	70.8	71.7	65.9			
		14:20	70.6	71.6	66.2			
		14:25	70.9	72.3	66.5			
17-Sep-15	Cloudy	11:30	66.2	69.9	58.0	66	66.9	66 Measured ≤ Limit Level
		11:35	65.4	68.4	60.5			
		11:40	63.9	68.0	54.2			
		11:45	68.3	72.3	52.5			
		11:50	65.9	70.3	56.2			
		11:55	66.4	70.3	56.9			
23-Sep-15	Sunny	10:30	69.5	71.3	65.8	69	66.9	69 Measured ≤ Limit Level
		10:35	69.3	70.9	65.4			
		10:40	68.3	69.8	65.3			
		10:45	69.5	70.9	65.6			
		10:50	69.1	71.1	65.5			
		10:55	69.8	71.5	65.3			
30-Sep-15	Sunny	10:30	71.9	73.5	65.3	71	66.9	71 Measured ≤ Limit Level
		10:35	71.5	73.1	64.9			
		10:40	71.1	73.3	65.7			
		10:45	71.8	73.6	65.6			
		10:50	71.3	73.0	65.3			
		10:55	71.2	72.9	64.8			

Remark: * +3dB(A) Façade correction included

Location NMS 4 - San Tau								
Date	Weather	Time	Unit: dB (A) (5-min)			Average	Baseline Level	Construction Noise Level
			L _{eq}	L ₁₀	L ₉₀	L _{eq}	L _{eq}	L _{eq}
1-Sep-15	Cloudy	15:45	60.6	64.7	48.2	60	56.0	60 Measured ≤ Limit Level
		15:50	60.2	64.5	48.0			
		15:55	60.7	64.8	49.1			
		16:00	59.8	63.6	48.0			
		16:05	59.7	63.5	49.3			
		16:10	59.4	63.4	49.1			
11-Sep-15	Sunny	15:15	63.1	64.7	58.3	63	56.0	63 Measured ≤ Limit Level
		15:20	62.9	64.9	58.2			
		15:25	62.9	64.8	58.0			
		15:30	63.1	64.2	58.5			
		15:35	62.7	64.5	58.7			
		15:40	62.9	65.0	58.0			
17-Sep-15	Cloudy	15:00	55.3	58.1	48.2	55	56.0	55 Measured ≤ Limit Level
		15:05	52.7	55.8	47.2			
		15:10	56.5	59.9	48.0			
		15:15	54.9	57.6	48.0			
		15:20	54.5	57.5	47.7			
		15:25	54.7	58.0	48.8			
23-Sep-15	Sunny	13:00	62.8	64.2	58.0	63	56.0	63 Measured ≤ Limit Level
		13:05	63.0	64.4	58.2			
		13:10	62.9	65.0	58.4			
		13:15	62.7	64.8	58.1			
		13:20	62.5	65.1	58.4			
		13:25	62.6	64.6	58.0			
30-Sep-15	Sunny	15:30	62.6	64.7	58.0	63	56.0	63 Measured ≤ Limit Level
		15:35	62.9	64.8	58.0			
		15:40	62.7	64.5	58.4			
		15:45	63.0	64.7	58.6			
		15:50	62.9	64.7	58.3			
		15:55	62.8	64.8	58.1			

Remark: * +3dB(A) Façade correction included

Noise Levels

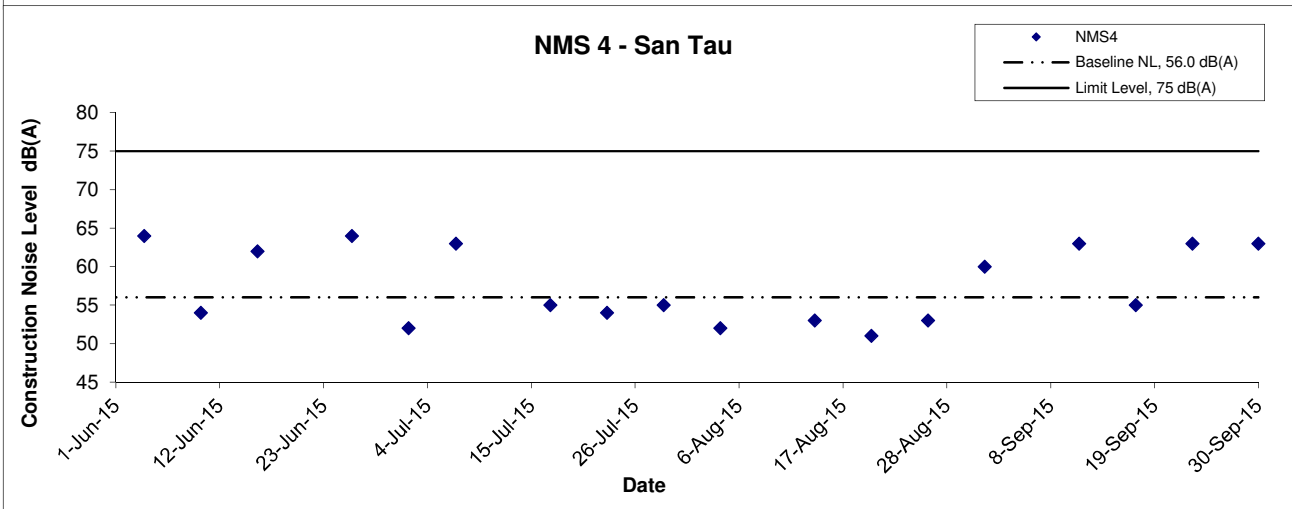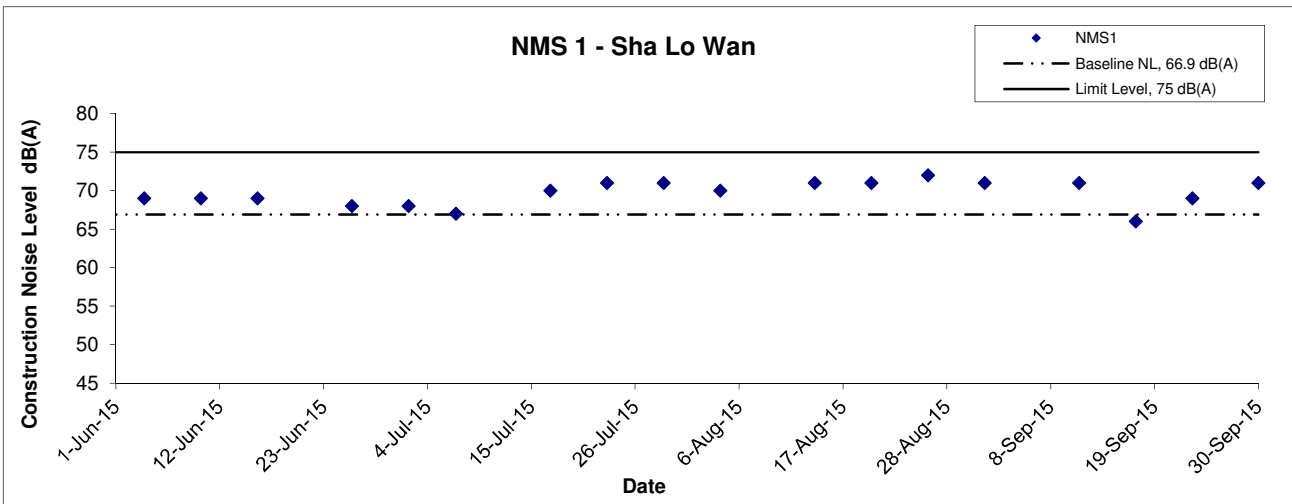

Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill Graphical Presentation of Construction Noise Monitoring Results	Scale N.T.S	Project No. MA12014	
	Date Sep 15	Appendix G	

**APPENDIX H
WATER QUALITY MONITORING
RESULTS AND GRAPHICAL
PRESENTATION**

Water Quality Monitoring Results at CS1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Sep-15	Rainy	Moderate	14:57	Surface	1	27.1 27.2	27.2	7.9 7.9	7.9	30.2 30.3	30.3	101.0 100.7	100.9	6.8 6.8	6.8	6.1	2.4 2.3	2.4	5.7	11.6 10.8	11.2	13.9
				Middle	6	24.5 24.6	24.6	7.8 7.9	7.9	29.7 30.2	30.0	75.7 75.1	75.4	5.3 5.3	5.3		4.3 4.3	4.3		15.6 16.8	16.2	
				Bottom	11	23.9 23.9	23.9	7.8 7.9	7.9	29.9 30.0	30.0	70.8 71.6	71.2	5.0 5.1	5.1		10.9 10.0	10.5		13.4 15.2	14.3	
4-Sep-15	Sunny	Moderate	16:50	Surface	1	26.0 26.2	26.1	7.7 7.7	7.7	21.4 21.5	21.5	95.2 94.2	94.7	6.9 6.8	6.9	6.8	8.9 9.8	9.4	5.8	14.1 20.5	17.3	15.2
				Middle	6	24.9 24.9	24.9	8.0 8.0	8.0	28.1 28.6	28.4	93.3 93.0	93.2	6.6 6.5	6.6		4.2 4.0	4.1		12.6 13.4	13.0	
				Bottom	11	24.7 24.6	24.7	8.0 8.0	8.0	30.8 30.7	30.8	82.4 80.4	81.4	5.8 5.6	5.7		3.9 4.0	4.0		16.4 14.0	15.2	
7-Sep-15	Cloudy	Moderate	08:16	Surface	1	26.7 26.2	26.5	8.0 8.0	8.0	24.3 24.2	24.3	86.5 85.4	86.0	6.1 6.0	6.1	5.9	2.5 2.5	2.5	4.9	7.8 4.8	6.3	6.7
				Middle	6	26.0 25.9	26.0	8.1 8.1	8.1	26.9 26.8	26.9	81.6 79.7	80.7	5.7 5.6	5.7		4.7 5.4	5.1		4.6 9.3	7.0	
				Bottom	11	24.4 24.5	24.5	8.1 8.1	8.1	28.4 28.3	28.4	73.8 73.9	73.9	5.2 5.3	5.3		7.4 6.9	7.2		6.0 7.6	6.8	
9-Sep-15	Sunny	Moderate	09:53	Surface	1	28.1 28.2	28.2	7.8 7.8	7.8	18.7 18.5	18.6	79.0 74.4	76.7	5.6 5.2	5.4	5.3	3.5 4.0	3.8	5.9	7.6 10.7	9.2	9.1
				Middle	6.5	27.0 27.0	27.0	7.8 7.8	7.8	27.2 28.0	27.6	76.1 73.3	74.7	5.2 5.0	5.1		7.4 7.6	7.5		9.4 15.1	12.3	
				Bottom	12	26.5 26.5	26.5	7.8 7.8	7.8	31.1 31.1	31.1	73.8 72.0	72.9	5.0 4.9	5.0		6.3 6.5	6.4		6.0 5.3	5.7	
11-Sep-15	Sunny	Moderate	11:37	Surface	1	27.4 27.5	27.5	7.8 7.8	7.8	21.2 21.1	21.2	75.0 74.7	74.9	5.3 5.2	5.3	5.6	7.1 7.0	7.1	7.5	6.6 9.0	7.8	10.5
				Middle	6	26.2 26.3	26.3	7.8 7.8	7.8	28.5 29.6	29.1	86.1 86.1	86.1	5.9 5.9	5.9		6.8 7.1	7.0		10.7 10.9	10.8	
				Bottom	11	25.9 26.0	26.0	7.8 7.8	7.8	30.8 30.6	30.7	85.6 86.5	86.1	5.9 5.9	5.9		8.6 8.3	8.5		14.8 11.0	12.9	
14-Sep-15	Sunny	Moderate	12:55	Surface	1	26.7 26.6	26.7	7.8 7.8	7.8	19.3 19.4	19.4	98.9 99.9	99.4	7.1 7.2	7.2	6.1	6.8 7.0	6.9	8.0	9.5 6.6	8.1	7.2
				Middle	6	26.3 26.3	26.3	7.8 7.9	7.9	27.0 27.0	27.0	72.2 71.8	72.0	5.0 5.0	5.0		8.7 8.6	8.7		6.8 6.6	6.7	
				Bottom	11	26.2 26.2	26.2	8.0 8.0	8.0	29.2 29.5	29.4	70.8 71.2	71.0	4.9 4.9	4.9		8.2 8.6	8.4		6.1 7.6	6.9	
16-Sep-15	Fine	Moderate	14:13	Surface	1	27.7 27.4	27.6	7.9 7.9	7.9	24.3 24.4	24.4	100.2 100.4	100.3	6.9 6.9	6.9	6.7	3.9 3.4	3.7	5.4	9.0 11.0	10.0	12.3
				Middle	4	27.3 27.2	27.3	8.0 8.0	8.0	27.2 27.0	27.1	94.3 94.1	94.2	6.4 6.4	6.4		4.9 5.4	5.2		17.8 10.8	14.3	
				Bottom	7	26.4 26.6	26.5	7.9 8.0	8.0	30.8 31.0	30.9	81.9 82.0	82.0	5.6 5.5	5.6		7.6 7.1	7.4		15.8 9.2	12.5	
18-Sep-15	Fine	Moderate	14:48	Surface	1	28.1 28.1	28.1	7.9 7.9	7.9	15.5 15.5	15.5	102.5 101.6	102.1	7.4 7.3	7.4	6.5	6.5 6.1	6.3	6.3	7.5 6.5	7.0	8.0
				Middle	6.5	26.8 26.8	26.8	7.8 7.8	7.8	19.3 19.4	19.4	76.1 76.0	76.1	5.5 5.5	5.5		6.5 6.2	6.4		10.1 7.9	9.0	
				Bottom	12	25.5 25.5	25.5	7.8 7.8	7.8	26.1 25.2	25.7	70.3 67.8	69.1	5.0 4.8	4.9		6.5 5.9	6.2		10.2 5.6	7.9	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)						
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*				
21-Sep-15	Rainy	Moderate	17:57	Surface	1	28.5	28.5	7.9	7.9	13.1	13.1	101.6	101.4	7.3	7.3	7.1	3.6	3.7	6.7	5.8	5.3	5.9				
						28.4		7.9		13.1		101.2		7.3			3.8			5.2	5.1		5.8	6.1		
				Middle	4	28.2	28.3	7.9	7.9	20.8	21.0	97.9	97.6	6.9	6.9		6.9	5.0		5.1	5.0		5.1	6.3	6.1	
				28.3		7.9		21.1		97.2		97.6		6.9		6.9		6.9		6.9						
				Bottom	7	27.9	27.9	7.9	7.9	30.2	30.2	81.5	81.7	5.4	5.4	5.4	11.2	11.3		5.8	6.4					
						27.8		7.9		30.2		81.8		5.4		5.4	11.3	11.3		6.9	6.4					
23-Sep-15	Fine	Moderate	08:06	Surface	1	27.1	27.0	7.7	7.8	15.2	15.1	88.0	87.6	6.3	6.3	5.9	5.8	5.8	6.7	6.3	7.7	7.1				
						26.9		7.8		14.9		87.1		6.3			5.8			5.8			9.1			
				Middle	5.5	26.4	26.4	7.8	7.8	19.2	19.2	78.0	76.9	5.5	5.5		6.4	6.4		6.4	6.4		4.4	6.1		
						26.3		7.8		19.1		75.7		5.4		5.5		6.4		7.8	6.1					
				Bottom	10	25.6	25.6	7.8	7.8	26.1	26.0	75.6	73.8	5.3	5.2	5.2	7.8	7.9		7.0	7.4					
						25.6		7.8		25.9		72.0		5.1		5.2	7.9	7.9		7.7	7.4					
25-Sep-15	Sunny	Moderate	09:46	Surface	1	26.9	27.0	8.0	8.0	16.0	16.0	81.0	81.4	5.9	6.0	5.7	5.5	5.8	5.7	5.3	5.9	7.5				
						27.1		8.0		15.9		81.7		6.0			6.0			6.0			5.8			
				Middle	5.5	26.7	26.8	7.8	7.8	26.3	26.1	75.8	76.2	5.2	5.3		5.2	4.9		4.9	4.7		4.9	6.8	7.8	
						26.9		7.8		25.9		76.6		5.3		5.3		5.0		8.8	7.8					
				Bottom	10	26.5	26.5	7.7	7.7	29.9	29.9	74.3	74.5	5.1	5.1	5.1	6.1	6.3		10.4	8.7					
						26.4		7.7		29.8		74.6		5.1		5.1	6.4	6.3		7.0	8.7					
28-Sep-15	Sunny	Moderate	12:16	Surface	1	28.2	28.2	7.8	7.8	17.7	17.7	99.2	98.5	7.0	7.0	6.6	4.4	4.3	5.6	15.4	12.8	15.6				
						28.1		7.8		17.7		97.7		6.9			7.0			4.2			4.3	10.2	12.8	
				Middle	4	27.6	27.7	7.8	7.8	22.2	22.3	87.9	88.8	6.1	6.2		6.2	5.5		5.5	5.4		5.5	16.6	16.0	
						27.8		7.8		22.3		89.6		6.2		6.2		5.5		15.4	16.0					
				Bottom	7	26.9	26.9	7.8	7.8	29.9	29.8	85.6	85.7	5.8	5.8	5.8	7.0	6.9		19.4	17.9					
						26.8		7.8		29.7		85.8		5.8		5.8	6.8	6.9		16.4	17.9					
30-Sep-15	Sunny	Moderate	14:41	Surface	1	27.8	27.8	7.7	7.7	15.3	15.3	101.0	100.5	7.3	7.3	6.4	6.4	6.2	6.2	12.1	14.9	15.0				
						27.8		7.7		15.3		100.0		7.2			7.3			6.2			6.2		17.7	14.9
				Middle	6.5	26.5	26.5	7.7	7.7	19.1	19.2	75.0	74.9	5.4	5.4		5.4	6.1		6.3	6.4		6.3	14.5	12.1	
						26.5		7.7		19.2		74.8		5.4		5.4		6.1		9.6	12.1					
				Bottom	12	25.2	25.3	7.6	7.6	25.8	25.4	68.2	68.3	4.9	4.9	4.9	6.4	6.1		15.6	17.9					
						25.3		7.6		25.0		68.3		4.9		4.9	5.8	6.1		20.2	17.9					

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Sep-15	Rainy	Moderate	09:03	Surface	1	26.6 26.1	26.4	7.9 7.8	7.9	17.3 17.2	17.3	96.8 95.5	96.2	7.1 7.0	7.1	6.2	2.5 2.5	2.5	5.9	16.8 17.8	17.3	17.8
				Middle	6	25.9 25.5	25.7	7.9 7.8	7.9	20.0 19.9	20.0	72.1 69.7	70.9	5.2 5.1	5.2		4.8 5.3	5.1		18.6 15.6	17.1	
				Bottom	11	24.5 24.6	24.6	7.9 7.9	7.9	21.4 21.3	21.4	67.0 67.2	67.1	5.0 5.0	5.0		10.2 9.8	10.0		21.4 16.4	18.9	
4-Sep-15	Sunny	Moderate	10:52	Surface	1	26.0 25.9	26.0	7.7 7.7	7.7	21.7 22.2	22.0	93.5 92.4	93.0	6.7 6.6	6.7	6.0	8.0 8.8	8.4	8.2	9.7 12.0	10.9	12.1
				Middle	5.5	25.2 25.2	25.2	7.9 8.0	8.0	27.6 27.5	27.6	75.3 72.9	74.1	5.3 5.1	5.2		7.5 7.3	7.4		13.5 15.3	14.4	
				Bottom	10	24.6 24.6	24.6	8.0 8.0	8.0	29.7 30.1	29.9	81.3 81.1	81.2	5.7 5.7	5.7		8.8 8.7	8.8		9.8 12.1	11.0	
7-Sep-15	Cloudy	Moderate	15:43	Surface	1	27.3 27.3	27.3	8.0 8.0	8.0	30.2 30.4	30.3	86.4 86.0	86.2	5.8 5.8	5.8	5.6	2.4 2.2	2.3	5.8	7.0 6.5	6.8	5.6
				Middle	6	24.5 24.7	24.6	8.1 8.1	8.1	29.9 30.3	30.1	75.2 74.6	74.9	5.3 5.2	5.3		4.3 4.5	4.4		5.0 4.8	4.9	
				Bottom	11	23.7 23.9	23.8	8.1 8.1	8.1	29.9 30.0	30.0	71.6 71.7	71.7	5.1 5.1	5.1		11.1 10.0	10.6		4.7 5.7	5.2	
9-Sep-15	Sunny	Moderate	17:00	Surface	1	29.6 29.6	29.6	7.9 7.9	7.9	21.8 21.8	21.8	77.0 82.8	79.9	5.2 5.6	5.4	5.3	4.9 4.9	4.9	4.9	8.0 10.5	9.3	8.6
				Middle	6.5	28.7 28.7	28.7	7.8 7.8	7.8	23.9 24.6	24.3	75.4 74.6	75.0	5.1 5.0	5.1		4.9 5.0	5.0		6.3 6.7	6.5	
				Bottom	12	27.5 27.5	27.5	7.8 7.8	7.8	30.2 30.3	30.3	73.9 74.6	74.3	4.9 5.0	5.0		4.9 4.7	4.8		10.0 9.7	9.9	
11-Sep-15	Sunny	Moderate	18:17	Surface	1	27.1 26.9	27.0	7.8 7.8	7.8	24.4 24.3	24.4	73.7 73.4	73.6	5.1 5.1	5.1	5.1	4.1 4.2	4.2	4.0	13.2 14.4	13.8	11.6
				Middle	6	26.7 26.7	26.7	7.7 7.7	7.7	26.5 26.2	26.4	73.9 73.5	73.7	5.1 5.1	5.1		3.8 3.7	3.8		10.8 9.4	10.1	
				Bottom	11	26.1 26.0	26.1	7.6 7.6	7.6	30.1 30.1	30.1	72.9 71.7	72.3	5.0 4.9	5.0		3.8 3.9	3.9		9.4 12.2	10.8	
14-Sep-15	Fine	Moderate	19:05	Surface	1	26.8 26.9	26.9	7.9 7.9	7.9	20.0 20.1	20.1	102.0 102.5	102.3	7.3 7.3	7.3	6.2	4.8 4.7	4.8	5.5	10.7 11.0	10.9	11.3
				Middle	5.5	26.2 26.2	26.2	7.9 7.9	7.9	27.6 27.6	27.6	73.6 73.8	73.7	5.1 5.1	5.1		4.9 4.6	4.8		10.4 11.4	10.9	
				Bottom	10	26.2 26.2	26.2	8.1 8.0	8.1	29.2 29.1	29.2	74.2 74.4	74.3	5.1 5.1	5.1		6.7 6.9	6.8		12.4 11.5	12.0	
16-Sep-15	Fine	Moderate	09:07	Surface	1	27.1 27.2	27.2	7.9 7.9	7.9	20.8 20.7	20.8	99.9 99.3	99.6	7.1 7.0	7.1	6.9	7.7 7.4	7.6	10.3	13.5 14.0	13.8	13.3
				Middle	4	27.2 26.9	27.1	7.9 7.8	7.9	20.1 20.1	20.1	93.2 92.4	92.8	6.6 6.6	6.6		9.9 9.7	9.8		10.8 16.1	13.5	
				Bottom	7	26.7 26.8	26.8	7.9 7.9	7.9	21.6 21.5	21.6	88.7 88.3	88.5	6.3 6.3	6.3		13.5 13.4	13.5		12.0 12.9	12.5	
18-Sep-15	Fine	Moderate	09:32	Surface	1	28.0 28.0	28.0	7.8 7.8	7.8	14.4 14.4	14.4	88.2 86.9	87.6	6.4 6.3	6.4	5.9	3.7 3.7	3.7	5.9	7.5 9.6	8.6	9.0
				Middle	6.5	26.8 26.8	26.8	7.8 7.8	7.8	23.3 23.4	23.4	75.7 75.3	75.5	5.3 5.3	5.3		7.3 7.6	7.5		9.3 11.3	10.3	
				Bottom	12	26.2 26.2	26.2	7.8 7.8	7.8	26.4 26.4	26.4	69.7 70.6	70.2	4.9 4.9	4.9		6.4 6.7	6.6		7.9 8.1	8.0	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Sep-15	Rainy	Moderate	12:50	Surface	1	28.3	28.3	7.6	7.6	13.9	13.9	106.1	106.3	7.7	7.7	6.7	4.4	4.6	7.4	4.9	4.9	5.3
						28.2		7.6		13.9		106.4		7.7			4.7			4.9		
				Middle	4	28.5	28.4	7.7	7.7	16.9	16.9	85.0	84.9	5.7	5.7		5.3	5.4		7.0	6.3	
		28.3		7.7		16.9		84.7		5.7		5.5		5.5		5.5		4.3	4.8			
		27.8	27.9	7.8	7.8	29.7	29.7	84.3	84.3	5.6	5.6	5.6	5.6	12.0	12.2	4.3	4.8					
		27.9		7.8		29.6		84.3		5.6		5.6	12.3	12.2	5.2	4.8						
23-Sep-15	Fine	Moderate	15:51	Surface	1	27.2	27.2	7.7	7.7	15.3	15.4	84.8	85.1	6.0	6.1	5.9	5.3	5.4	7.9	5.2	6.4	6.3
						27.2		7.7		15.4		85.3		6.1			5.4			7.5		
				Middle	6	25.6	25.7	7.7	7.8	23.7	23.7	80.2	80.5	5.6	5.7		7.6	7.6		5.2	6.3	
		25.8		7.8		23.7		80.8		5.7		7.6		7.4		6.4	6.3					
		25.0	25.0	7.8	7.8	28.1	28.2	72.5	73.4	5.1	5.2	5.2	5.2	10.7	10.7	6.4	6.3					
		25.0		7.8		28.2		74.3		5.2		5.2	10.7	10.7	6.1	6.3						
25-Sep-15	Sunny	Moderate	16:41	Surface	1	27.2	27.2	7.9	7.9	16.2	16.3	84.0	83.9	6.1	6.1	5.8	5.8	5.7	5.8	5.8	5.7	5.8
						27.1		7.9		16.3		83.8		6.1			5.6			5.6		
				Middle	5.5	26.6	26.7	7.9	7.9	26.1	26.3	78.9	78.8	5.5	5.5		4.6	4.8		5.9	4.6	
		26.8		7.8		26.4		78.6		5.4		4.9		3.3		3.3	4.6					
		26.4	26.3	7.7	7.8	30.0	29.7	73.0	73.2	5.0	5.0	5.0	5.0	7.2	7.0	6.2	7.1					
		26.2		7.8		29.4		73.3		5.0		5.0	6.8	7.0	7.9	7.1						
28-Sep-15	Fine	Moderate	18:20	Surface	1	27.8	28.0	7.9	7.9	17.6	17.9	100.6	101.2	7.2	7.2	6.8	4.4	4.3	5.9	9.5	9.6	10.5
						28.2		7.8		18.2		101.8		7.2			4.2			9.7		
				Middle	4	27.6	27.7	7.8	7.8	21.3	21.3	91.9	91.2	6.4	6.4		5.4	5.4		8.3	10.0	
		27.7		7.8		21.3		90.5		6.3		6.4		5.4		11.6		11.0	12.0			
		27.0	27.0	7.8	7.8	30.6	30.4	85.1	85.6	5.7	5.8	5.8	5.8	8.0	8.0	11.0	12.0					
		27.0		7.8		30.2		86.1		5.8		5.8	8.0	8.0	12.9	12.0						
30-Sep-15	Sunny	Moderate	08:42	Surface	1	27.8	27.8	7.7	7.7	14.3	14.3	87.6	86.9	6.4	6.4	5.7	3.7	3.7	5.9	15.9	16.7	14.6
						27.8		7.7		14.3		86.2		6.3			3.7			17.5		
				Middle	6.5	26.7	26.7	7.7	7.7	23.2	23.3	72.5	70.4	5.1	5.0		7.3	7.5		14.2	12.8	
		26.7		7.7		23.3		68.2		4.8		7.6		11.3		13.7	14.4					
		26.1	26.1	7.7	7.7	26.3	26.3	69.1	69.0	4.8	4.8	4.8	4.8	6.4	6.6	13.7	14.4					
		26.0		7.7		26.3		68.9		4.8		4.8	6.7	6.6	15.1	14.4						

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
2-Sep-15	Rainy	Moderate	14:22	Surface	1	26.9 26.9	26.9	8.0 8.0	8.0	18.4 18.4	18.4	101.9 101.8	101.9	7.3 7.3	7.3	6.4	1.9 2.1	2.0	3.5	31.0 39.3	35.2	29.3		
				Middle	4	25.6 25.6	25.6	7.9 7.9	7.9	24.4 24.3	24.4	77.6 77.2	77.4	5.5 5.5	5.5		2.6 2.4			2.5			22.6 21.6	22.1
				Bottom	7	22.2 22.2	22.2	7.8 7.8	7.8	31.4 31.4	31.4	69.0 69.4	69.2	5.0 5.0	5.0		5.8 6.1			6.0			31.4 29.6	30.5
4-Sep-15	Sunny	Moderate	15:44	Surface	1	27.0 26.9	27.0	8.0 8.1	8.1	23.6 23.7	23.7	94.7 93.9	94.3	6.6 6.6	6.6	6.6	2.4 2.2	2.3	4.6	10.6 8.3	9.5	9.5		
				Middle	3.5	26.5 26.3	26.4	8.1 8.1	8.1	29.0 27.8	28.4	95.8 94.6	95.2	6.5 6.5	6.5		3.0 3.2			3.1			9.0 10.1	9.6
				Bottom	6	26.4 26.2	26.3	8.2 8.2	8.2	31.8 31.8	31.8	94.9 94.3	94.6	6.4 6.4	6.4		8.4 8.6			8.5			10.2 8.5	9.4
7-Sep-15	Cloudy	Moderate	07:23	Surface	1	26.5 26.5	26.5	8.0 8.0	8.0	24.7 24.6	24.7	91.3 90.9	91.1	6.4 6.4	6.4	6.3	3.4 3.3	3.4	6.6	5.8 5.2	5.5	4.7		
				Middle	4	26.6 26.6	26.6	8.1 8.1	8.1	30.1 30.1	30.1	90.7 90.6	90.7	6.2 6.1	6.2		6.8 7.1			7.0			4.6 4.0	4.3
				Bottom	7	26.5 26.5	26.5	8.1 8.1	8.1	30.8 30.8	30.8	90.7 90.6	90.7	6.1 6.1	6.1		9.3 9.6			9.5			4.2 4.4	4.3
9-Sep-15	Sunny	Moderate	09:15	Surface	1	29.0 29.0	29.0	7.8 7.8	7.8	22.5 22.5	22.5	82.1 81.2	81.7	5.6 5.5	5.6	5.6	4.3 4.4	4.4	7.5	7.5 7.0	7.3	8.7		
				Middle	4	27.0 27.0	27.0	7.8 7.8	7.8	28.8 28.8	28.8	81.8 80.3	81.1	5.6 5.5	5.6		6.7 7.0			6.9			9.6 10.4	10.0
				Bottom	7	26.7 26.7	26.7	7.8 7.8	7.8	29.6 29.6	29.6	75.2 74.7	75.0	5.1 5.1	5.1		11.2 11.0			11.1			8.2 9.6	8.9
11-Sep-15	Sunny	Moderate	10:44	Surface	1	27.4 27.4	27.4	7.8 7.9	7.9	21.1 21.2	21.2	77.9 77.7	77.8	5.5 5.5	5.5	5.7	7.0 6.8	6.9	7.5	7.2 7.1	7.2	7.2		
				Middle	4	26.3 26.2	26.3	7.8 7.8	7.8	28.4 29.8	29.1	85.8 86.4	86.1	5.9 5.9	5.9		6.8 7.0			6.9			6.6 6.7	6.7
				Bottom	7	26.0 26.0	26.0	7.8 7.8	7.8	30.7 30.6	30.7	90.1 92.2	91.2	6.2 6.3	6.3		8.6 8.5			8.6			6.0 9.2	7.6
14-Sep-15	Sunny	Moderate	12:17	Surface	1	26.9 26.9	26.9	7.9 7.9	7.9	19.2 19.3	19.3	88.2 87.9	88.1	6.3 6.3	6.3	6.2	6.0 5.9	6.0	7.6	7.6 9.0	8.3	9.7		
				Middle	4	27.0 27.0	27.0	8.0 8.0	8.0	22.5 22.4	22.5	85.9 85.8	85.9	6.0 6.0	6.0		4.9 5.3			5.1			8.9 10.8	9.9
				Bottom	7	26.2 26.2	26.2	7.9 7.9	7.9	29.0 29.0	29.0	72.3 71.3	71.8	5.0 4.9	5.0		11.7 11.7			11.7			11.6 10.1	10.9
16-Sep-15	Fine	Moderate	13:35	Surface	1	27.5 27.5	27.5	8.0 8.0	8.0	24.3 24.4	24.4	86.0 86.6	86.3	5.9 6.0	6.0	6.1	3.9 3.4	3.7	5.4	15.8 15.3	15.6	13.7		
				Middle	4	27.1 27.1	27.1	8.0 8.0	8.0	27.0 27.0	27.0	89.2 90.1	89.7	6.1 6.2	6.2		5.0 5.3			5.2			12.2 10.1	11.2
				Bottom	7	26.4 26.5	26.5	8.0 8.0	8.0	31.0 31.0	31.0	79.7 78.2	79.0	5.4 5.3	5.4		7.6 7.1			7.4			14.8 13.6	14.2
18-Sep-15	Fine	Moderate	14:23	Surface	1	27.0 26.1	26.6	7.8 7.8	7.8	18.6 22.1	20.4	89.6 87.1	88.4	6.4 6.2	6.3	5.9	12.0 12.1	12.1	11.9	6.8 7.8	7.3	5.9		
				Middle	4	26.1 27.1	26.6	7.8 7.8	7.8	22.1 19.5	20.8	75.4 74.9	75.2	5.4 5.3	5.4		14.0 11.3			12.7			6.2 7.6	6.9
				Bottom	7	26.9 27.1	27.0	7.8 7.8	7.8	19.1 18.8	19.0	74.9 74.7	74.8	5.4 5.4	5.4		10.2 11.8			11.0			3.6 3.6	3.6

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Sep-15	Rainy	Moderate	17:17	Surface	1	28.5	28.5	7.9	7.9	13.0	13.1	109.9	109.8	7.9	7.9	7.3	3.7	3.8	6.7	4.9	5.6	7.7
						28.5		7.9		13.1		109.6		7.9			3.8			6.2		
				Middle	4	28.2	28.2	7.9	7.9	20.8	21.0	94.2	94.0	6.6	6.6		5.2	5.2		8.8	8.2	
		28.2		7.9		21.1		93.8		6.5		6.6		5.1		7.6						
		27.9	27.9	8.0	8.0	30.2	30.2	86.9	86.7	5.8	5.8	5.8	5.8	11.1	11.2	9.0	9.2					
		27.9		8.0		30.2		86.5		5.7		5.8		11.2		9.4						
23-Sep-15	Fine	Moderate	07:14	Surface	1	28.0	28.0	7.9	7.9	13.5	13.5	86.4	85.2	6.3	6.2	6.0	6.1	6.1	5.3	6.8	7.1	7.6
						28.0		7.9		13.4		84.0		6.1			6.0			7.4		
				Middle	4	26.1	26.1	7.8	7.8	24.1	24.0	82.6	81.5	5.8	5.8		5.6	5.5		9.8	9.0	
		26.1		7.8		23.9		80.3		5.7		5.8		5.4		8.1						
		25.2	25.2	7.8	7.8	31.3	31.2	73.5	72.9	5.1	5.1	5.1	5.1	4.3	4.3	8.5	6.8					
		25.2		7.8		31.0		72.2		5.0		5.1		4.2		5.0						
25-Sep-15	Sunny	Moderate	08:59	Surface	1	27.2	27.2	8.0	8.0	15.9	15.9	84.7	83.8	6.2	6.1	5.8	5.6	5.8	5.7	6.2	5.7	5.9
						27.2		8.0		15.9		82.8		6.0			5.9			5.2		
				Middle	3.5	26.7	26.8	7.8	7.8	26.2	26.2	78.9	78.6	5.5	5.5		4.8	4.9		7.8	7.0	
		26.8		7.8		26.1		78.2		5.4		5.5		5.0		6.1						
		26.3	26.4	7.8	7.8	29.9	29.9	73.0	72.7	5.0	5.0	5.0	5.0	6.2	6.3	4.2	5.0					
		26.4		7.8		29.8		72.4		4.9		5.0		6.4		5.7						
28-Sep-15	Sunny	Moderate	11:31	Surface	1	28.0	28.0	7.9	7.9	17.7	17.7	98.3	97.2	7.0	6.9	6.6	4.3	4.3	5.5	13.4	12.4	11.9
						28.0		7.8		17.7		96.1		6.8			4.3			11.3		
				Middle	4	27.6	27.6	7.8	7.8	22.1	22.3	90.1	89.7	6.3	6.3		5.4	5.4		12.0	12.4	
		27.6		7.8		22.4		89.3		6.2		6.3		5.4		12.8						
		26.9	26.9	7.8	7.8	30.0	29.9	83.6	84.2	5.6	5.7	5.7	5.7	6.8	6.9	9.2	10.8					
		26.9		7.8		29.8		84.8		5.7		5.7		6.9		12.4						
30-Sep-15	Sunny	Moderate	13:30	Surface	1	27.2	27.2	7.5	7.5	17.5	17.5	102.3	102.1	7.4	7.4	7.1	6.5	6.6	6.8	14.4	13.4	14.2
						27.2		7.5		17.5		101.8		7.3			6.7			12.4		
				Middle	4	26.5	26.5	7.6	7.6	21.7	21.7	94.8	94.2	6.8	6.8		6.5	6.6		16.6	14.5	
		26.5		7.6		21.6		93.6		6.7		6.8		6.6		12.3						
		26.0	26.0	7.5	7.5	24.8	24.8	94.3	93.8	6.7	6.7	6.7	6.7	6.6	7.2	21.4	14.8					
		26.0		7.5		24.8		93.3		6.6		6.7		7.8		8.1						

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Sep-15	Rainy	Moderate	08:13	Surface	1	26.6 26.6	26.6	8.0 8.0	8.0	18.9 18.9	18.9	100.2 100.2	100.2	7.2 7.2	7.2	6.9	3.9 4.1	4.0	6.4	47.5 38.5	43.0	38.5
				Middle	4	24.6 24.6	24.6	8.0 7.9	8.0	24.3 24.3	24.3	89.6 89.4	89.5	6.5 6.5	6.5		5.5 5.1	5.3		23.5 27.0	25.3	
				Bottom	7	23.8 23.9	23.9	7.8 7.8	7.8	28.8 28.8	28.8	70.7 71.1	70.9	5.1 5.1	5.1		9.8 10.1	10.0		56.5 37.7	47.1	
4-Sep-15	Sunny	Moderate	10:09	Surface	1	26.7 26.6	26.7	8.0 8.1	8.1	24.8 24.7	24.8	91.6 91.1	91.4	6.4 6.4	6.4	6.3	3.4 3.3	3.4	6.7	6.9 8.0	7.5	8.7
				Middle	4	26.5 26.7	26.6	8.1 8.1	8.1	30.3 30.1	30.2	90.7 90.7	90.7	6.2 6.1	6.2		6.9 7.2	7.1		7.0 8.9	8.0	
				Bottom	7	26.6 26.6	26.6	8.1 8.1	8.1	30.8 30.8	30.8	90.9 90.6	90.8	6.1 6.1	6.1		9.3 9.6	9.5		14.3 6.7	10.5	
7-Sep-15	Cloudy	Moderate	15:03	Surface	1	27.1 27.1	27.1	8.0 8.0	8.0	23.6 23.7	23.7	95.0 94.1	94.6	6.6 6.6	6.6	6.6	2.4 2.2	2.3	4.6	5.7 4.5	5.1	6.5
				Middle	3.5	26.4 26.4	26.4	8.1 8.1	8.1	29.0 27.7	28.4	95.5 94.8	95.2	6.5 6.5	6.5		2.9 3.3	3.1		7.0 5.2	6.1	
				Bottom	6	26.3 26.3	26.3	8.2 8.2	8.2	31.7 31.7	31.7	94.6 94.4	94.5	6.4 6.4	6.4		8.4 8.5	8.5		5.6 11.1	8.4	
9-Sep-15	Sunny	Moderate	17:08	Surface	1	29.2 29.2	29.2	7.8 7.8	7.8	21.8 21.7	21.8	84.4 84.4	84.4	5.7 5.7	5.7	5.6	3.6 3.2	3.4	5.0	6.1 6.4	6.3	5.7
				Middle	4	28.2 28.0	28.1	7.9 7.9	7.9	24.3 24.9	24.6	80.7 81.2	81.0	5.5 5.5	5.5		3.8 3.8	3.8		3.5 7.2	5.4	
				Bottom	7	26.2 26.2	26.2	7.8 7.8	7.8	29.4 29.5	29.5	74.8 74.2	74.5	5.1 5.1	5.1		7.4 8.4	7.9		4.2 6.3	5.3	
11-Sep-15	Sunny	Moderate	17:36	Surface	1	27.0 27.0	27.0	7.8 7.8	7.8	24.3 24.3	24.3	79.5 80.1	79.8	5.5 5.6	5.6	5.6	4.1 4.2	4.2	4.0	9.2 13.2	11.2	9.6
				Middle	4	26.8 26.8	26.8	7.8 7.8	7.8	26.4 26.2	26.3	81.3 81.0	81.2	5.6 5.6	5.6		3.9 3.8	3.9		8.0 12.3	10.2	
				Bottom	7	26.0 26.0	26.0	7.6 7.6	7.6	30.1 30.1	30.1	78.1 78.4	78.3	5.4 5.4	5.4		3.9 3.9	3.9		8.8 5.8	7.3	
14-Sep-15	Fine	Moderate	18:27	Surface	1	26.9 26.9	26.9	7.9 7.9	7.9	20.8 20.8	20.8	86.9 86.9	86.9	6.2 6.2	6.2	6.1	7.8 7.9	7.9	9.5	7.6 10.3	9.0	8.6
				Middle	4	26.9 26.9	26.9	7.9 7.9	7.9	21.5 21.5	21.5	83.8 83.9	83.9	5.9 5.9	5.9		9.6 9.6	9.6		11.3 6.6	9.0	
				Bottom	7	26.8 26.8	26.8	7.9 7.9	7.9	23.2 23.1	23.2	72.6 72.3	72.5	5.1 5.1	5.1		10.9 11.0	11.0		9.9 5.5	7.7	
16-Sep-15	Fine	Moderate	08:19	Surface	1	27.3 27.3	27.3	7.9 7.9	7.9	20.7 20.6	20.7	101.5 101.3	101.4	7.2 7.2	7.2	7.2	7.5 7.4	7.5	10.3	11.8 11.4	11.6	14.8
				Middle	4	27.1 27.0	27.1	7.9 7.9	7.9	20.1 20.2	20.2	100.2 100.5	100.4	7.1 7.2	7.2		9.9 9.7	9.8		19.3 14.1	16.7	
				Bottom	7	26.7 26.7	26.7	7.9 7.9	7.9	21.5 21.5	21.5	97.2 97.0	97.1	6.9 6.9	6.9		13.5 13.4	13.5		16.2 15.9	16.1	
18-Sep-15	Fine	Moderate	09:01	Surface	1	28.0 28.2	28.1	7.8 7.8	7.8	14.3 14.3	14.3	87.0 85.9	86.5	6.3 6.2	6.3	5.8	3.8 3.7	3.8	5.9	6.9 6.3	6.6	8.0
				Middle	4	27.0 26.7	26.9	7.8 7.8	7.8	23.4 23.4	23.4	75.0 75.3	75.2	5.3 5.3	5.3		7.3 7.7	7.5		8.7 8.0	8.4	
				Bottom	7	26.3 26.1	26.2	7.8 7.8	7.8	26.6 26.4	26.5	72.4 72.9	72.7	5.0 5.1	5.1		6.4 6.6	6.5		7.3 10.6	9.0	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Sep-15	Rainy	Moderate	12:04	Surface	1	28.3	28.3	7.6	7.6	13.9	13.9	101.2	101.2	7.3	7.3	7.2	4.5	4.6	7.5	6.4	7.5	6.4
						28.3		7.6		13.9		101.2		7.3			4.6			7.5	6.2	
				Middle	4	28.4	28.4	7.8	7.8	16.9	16.9	98.7	98.6	7.0	7.0		5.4	5.5		5.6	6.2	
		28.4		7.8		16.9		98.4		7.0		5.6		5.6	12.1	12.3	4.5	5.5	6.4			
		27.8	27.8	7.8	7.8	29.6	29.7	84.5	84.2	5.6	5.6	5.6	5.6	12.4	12.3	4.5	5.5	6.4				
23-Sep-15	Fine	Moderate	14:56	Surface	1	27.5	27.5	7.9	7.9	14.4	14.5	98.4	97.6	7.2	7.1	6.8	5.2	5.7	7.6	5.6	7.4	7.1
						27.5		7.9		14.5		96.7		7.0			6.1			7.4	6.1	
				Middle	4	26.7	26.8	7.9	7.9	19.2	19.2	89.7	89.3	6.5	6.5		7.4	7.4		5.2	6.1	
		26.8		7.9		19.1		88.9		6.4		7.3		5.2	6.1	7.4	7.8					
		26.1	26.1	7.9	7.9	25.0	24.9	78.9	78.7	5.6	5.6	5.6	5.6	9.3	9.6	7.4	8.1	7.8				
		26.1		7.9		24.8		78.4		5.5		5.6		9.8	9.6	8.1	7.8					
25-Sep-15	Sunny	Moderate	15:55	Surface	1	27.1	27.1	7.9	8.0	16.2	16.2	85.5	85.9	6.2	6.3	5.8	5.6	5.6	5.8	5.4	6.0	4.8
						27.1		8.0		16.2		86.2		6.3			5.6			6.0	3.9	
				Middle	3.5	26.6	26.7	7.9	7.9	26.3	26.3	76.3	75.8	5.3	5.3		4.8	4.9		3.1	3.9	
		26.7		7.8		26.3		75.3		5.2		4.9		5.2	3.7	4.5						
		26.3	26.4	7.8	7.8	29.9	29.8	72.6	72.5	5.0	5.0	5.0	5.0	7.1	7.0	5.2	4.5					
		26.4		7.8		29.7		72.4		4.9		5.0		6.9	7.0	3.7	4.5					
28-Sep-15	Fine	Moderate	17:40	Surface	1	28.0	28.1	7.9	7.9	17.7	18.0	99.6	100.0	7.1	7.1	6.6	4.4	4.4	6.0	13.6	13.2	13.6
						28.1		7.8		18.2		100.3		7.1			4.3			13.2	13.9	
				Middle	4	27.6	27.6	7.8	7.8	21.3	21.3	84.6	85.8	5.9	6.0		5.5	5.5		14.3	13.4	
		27.6		7.8		21.2		86.9		6.1		5.4		5.4	13.4	13.7						
		27.0	27.1	7.8	7.8	30.5	30.4	80.6	80.8	5.4	5.4	5.4	5.4	8.0	8.0	14.0	13.4					
		27.1		7.8		30.3		81.0		5.4		5.4		7.9	8.0	13.4	13.7					
30-Sep-15	Sunny	Moderate	07:42	Surface	1	28.1	28.1	7.7	7.7	11.9	12.2	102.4	102.6	7.5	7.5	6.7	4.0	3.8	7.4	16.2	20.2	18.4
						28.1		7.7		12.4		102.7		7.5			3.5			20.2	17.0	
				Middle	3.5	27.0	27.0	7.8	7.8	26.5	26.7	86.4	86.0	5.9	5.9		7.7	7.9		15.9	17.0	
		26.9		7.8		26.9		85.6		5.9		8.1		18.0	17.0	18.2	18.1					
		26.6	26.6	7.8	7.8	28.1	28.1	73.1	72.1	5.0	5.0	5.0	5.0	10.5	10.5	18.2	18.1					
		26.6		7.8		28.1		71.0		4.9		5.0		10.4	10.5	17.9	18.1					

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Sep-15	Rainy	Moderate	15:21	Surface	1	26.6 26.6	26.6	8.0 8.0	8.0	19.1 19.1	19.1	96.0 95.8	95.9	6.9 6.9	6.9	6.7	3.4 3.5	3.5	5.9	32.8 41.0	36.9	40.8
				Middle	5	24.9 24.8	24.9	7.9 7.9	7.9	28.3 28.3	28.3	91.6 90.7	91.2	6.5 6.4	6.5		4.9 4.8	4.9		37.0 34.0	35.5	
				Bottom	9	21.2 21.2	21.2	7.8 7.7	7.8	32.6 32.6	32.6	77.1 77.7	77.4	5.7 5.7	5.7		9.2 9.6	9.4		52.0 47.7	49.9	
4-Sep-15	Sunny	Moderate	17:03	Surface	1	26.8 27.1	27.0	8.1 8.0	8.1	24.4 23.9	24.2	93.5 92.9	93.2	6.5 6.5	6.5	6.5	3.2 2.9	3.1	6.6	6.6 5.3	6.0	6.6
				Middle	3.5	26.3 26.3	26.3	8.2 8.1	8.2	30.2 30.8	30.5	93.3 92.7	93.0	6.4 6.3	6.4		4.6 5.3	5.0		6.6 7.0	6.8	
				Bottom	6	26.0 26.5	26.3	8.2 8.2	8.2	32.1 32.5	32.3	91.5 92.1	91.8	6.2 6.2	6.2		11.6 11.8	11.7		7.2 6.5	6.9	
7-Sep-15	Cloudy	Moderate	08:27	Surface	1	26.7 26.7	26.7	8.1 8.1	8.1	26.3 25.7	26.0	90.6 89.8	90.2	6.3 6.2	6.3	6.3	7.4 7.0	7.2	10.1	4.8 4.1	4.5	4.8
				Middle	4.5	26.6 26.6	26.6	8.1 8.1	8.1	29.7 30.0	29.9	90.7 89.6	90.2	6.2 6.1	6.2		10.8 10.7	10.8		4.7 5.0	4.9	
				Bottom	8	26.6 26.6	26.6	8.1 8.1	8.1	30.0 30.0	30.0	89.2 89.2	89.2	6.1 6.1	6.1		12.5 12.1	12.3		4.8 5.3	5.1	
9-Sep-15	Sunny	Moderate	10:24	Surface	1	29.6 29.6	29.6	7.9 7.9	7.9	21.2 21.2	21.2	89.0 89.1	89.1	6.0 6.0	6.0	5.8	3.6 3.0	3.3	7.8	12.9 8.5	10.7	7.7
				Middle	4.5	26.1 26.0	26.1	7.8 7.8	7.8	31.4 31.6	31.5	80.3 79.7	80.0	5.5 5.4	5.5		6.1 5.6	5.9		6.3 5.5	5.9	
				Bottom	8	25.6 25.6	25.6	7.8 7.8	7.8	32.3 32.3	32.3	76.3 76.0	76.2	5.2 5.2	5.2		14.1 14.3	14.2		7.1 5.8	6.5	
11-Sep-15	Sunny	Moderate	11:56	Surface	1	27.5 27.5	27.5	8.0 8.0	8.0	22.0 22.1	22.1	87.5 86.5	87.0	6.1 6.0	6.1	6.1	5.0 4.8	4.9	6.6	15.3 9.9	12.6	10.2
				Middle	5	26.1 26.1	26.1	8.0 8.0	8.0	30.3 30.3	30.3	87.4 86.8	87.1	6.0 5.9	6.0		6.6 6.9	6.8		7.4 7.7	7.6	
				Bottom	9	25.9 25.9	25.9	8.0 8.0	8.0	31.3 31.3	31.3	86.4 86.5	86.5	5.9 5.9	5.9		8.2 8.2	8.2		10.8 9.7	10.3	
14-Sep-15	Sunny	Moderate	13:21	Surface	1	26.9 26.9	26.9	7.9 7.9	7.9	19.2 19.2	19.2	95.1 95.4	95.3	6.8 6.8	6.8	6.2	5.5 5.4	5.5	7.4	12.2 10.9	11.6	11.1
				Middle	5	27.0 27.0	27.0	8.0 8.0	8.0	22.1 22.1	22.1	79.6 79.6	79.6	5.6 5.6	5.6		5.6 5.6	5.6		10.3 10.5	10.4	
				Bottom	9	26.3 26.3	26.3	7.9 7.9	7.9	28.1 27.9	28.0	73.4 72.7	73.1	5.1 5.0	5.1		10.8 11.2	11.0		12.9 9.6	11.3	
16-Sep-15	Fine	Moderate	14:49	Surface	1	27.6 27.6	27.6	8.0 8.0	8.0	23.8 23.9	23.9	90.3 90.9	90.6	6.2 6.3	6.3	6.5	3.6 4.2	3.9	6.5	17.6 11.8	14.7	15.2
				Middle	5	27.0 27.0	27.0	8.0 8.1	8.1	26.9 26.8	26.9	96.2 96.2	96.2	6.6 6.6	6.6		4.8 5.3	5.1		18.0 13.5	15.8	
				Bottom	9	25.7 25.7	25.7	8.0 8.0	8.0	28.6 28.6	28.6	86.1 86.2	86.2	6.0 6.0	6.0		10.5 10.3	10.4		14.0 16.2	15.1	
18-Sep-15	Fine	Moderate	15:34	Surface	1	25.8 26.8	26.3	7.8 7.9	7.9	22.3 22.4	22.4	93.7 90.3	92.0	6.7 6.4	6.6	6.1	6.5 6.2	6.4	6.0	8.3 6.7	7.5	7.0
				Middle	3	28.0 25.6	26.8	7.9 7.8	7.9	20.5 20.5	20.5	78.0 76.2	77.1	5.5 5.6	5.6		6.1 5.8	6.0		8.1 6.5	7.3	
				Bottom	5	25.9 26.0	26.0	7.7 7.7	7.7	23.8 23.7	23.8	70.2 69.4	69.8	5.0 4.9	5.0		5.7 5.7	5.7		7.0 5.2	6.1	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Sep-15	Rainy	Moderate	18:13	Surface	1	28.4	28.4	8.0	8.0	14.1	14.1	102.6	102.5	7.4	7.4	6.5	3.9	3.9	9.3	5.7	6.8	9.3
						28.4		8.0		14.1		102.3		7.4			3.8			7.8		
				Middle	5	27.9	27.9	8.0	8.0	29.1	29.1	83.4	83.1	82.8	83.1	5.6	5.6	9.3		9.3	7.8	
				27.9		8.0		29.1		82.8		5.5		5.4		13.9	14.8	13.0	13.3			
				Bottom	9	27.8	27.8	8.0	8.0	30.9	30.9	82.0	82.0	5.4	5.4	5.4	13.9	14.8	13.6	13.3		
23-Sep-15	Fine	Moderate	08:18	Surface	1	28.0	28.1	7.8	7.9	14.3	14.2	97.8	97.7	7.1	7.1	7.2	7.4	7.4	9.3	10.2	8.1	8.5
						28.1		7.9		14.0		97.6		7.1			7.3			6.0		
				Middle	5	26.4	26.4	7.8	7.8	21.8	21.8	92.1	91.6	111.0	101.6	6.6	7.3	7.8		7.8	8.4	
				26.4		7.8		21.7		111.0		7.9		7.8		12.9	12.6	7.8	8.9			
				Bottom	9	25.2	25.2	7.8	7.8	31.0	30.9	74.3	74.4	5.1	5.1	5.1	12.9	12.6	9.9	8.9		
						25.2		7.8		30.8		74.4		5.1								
25-Sep-15	Sunny	Moderate	10:09	Surface	1	27.0	27.1	7.8	7.9	16.1	16.1	82.3	82.7	6.0	6.1	5.7	5.0	5.0	5.1	7.8	7.7	6.8
						27.1		7.9		16.0		83.1		6.1			4.9			7.5		
				Middle	4.5	26.6	26.6	7.8	7.8	27.1	27.1	75.4	75.6	75.8	75.6	5.2	5.2	5.1		5.2	6.6	
				26.6		7.8		27.1		75.8		5.2		5.2		5.2		6.0	6.3			
				Bottom	8	26.3	26.4	7.8	7.8	30.1	30.2	70.9	70.8	4.8	4.8	4.8	5.2	5.1	6.5	6.3		
						26.4		7.8		30.2		70.6		4.8		5.0	5.1	6.0	6.3			
28-Sep-15	Sunny	Moderate	12:41	Surface	1	28.0	28.0	7.8	7.8	17.3	17.8	97.9	98.2	7.0	7.0	6.6	5.5	5.5	6.3	13.4	12.7	12.6
						28.0		7.8		18.2		98.5		7.0			5.4			12.0		
				Middle	4.5	27.5	27.5	7.9	7.9	23.9	23.8	88.4	87.3	86.2	87.3	6.1	6.1	5.5		5.6	11.4	
				27.5		7.9		23.7		86.2		6.0		5.6		15.3		15.3	13.4			
				Bottom	8	26.9	26.9	7.9	7.9	28.4	28.5	78.8	79.3	5.4	5.4	5.4	7.7	7.7	9.2	11.8		
						26.9		7.9		28.6		79.8		5.4		5.4		7.7		14.4	11.8	
30-Sep-15	Sunny	Moderate	14:24	Surface	1	27.8	27.8	7.6	7.6	15.7	15.7	89.3	88.6	6.4	6.4	6.6	4.6	4.9	7.3	19.2	18.0	15.9
						27.8		7.6		15.7		87.8		6.3			5.1			16.7		
				Middle	5	27.0	27.0	7.7	7.7	18.2	18.2	93.2	93.5	93.8	93.5	6.7	6.8	7.5		7.3	19.6	
				27.0		7.7		18.2		93.8		6.8		7.1		14.1		14.1	16.9			
				Bottom	9	25.4	25.4	7.7	7.7	32.4	32.4	73.4	73.0	5.0	5.0	5.0	9.8	9.6	16.1	12.8		
						25.4		7.7		32.3		72.6		5.0		9.4		9.5	12.8			

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Sep-15	Rainy	Moderate	09:04	Surface	1	26.8 26.8	26.8	8.0 8.0	8.0	20.1 20.1	20.1	97.6 97.4	97.5	7.0 7.0	7.0	6.2	3.8 3.7	3.8	6.2	29.4 25.2	27.3	27.0
				Middle	5	25.7 25.6	25.7	7.9 7.9	7.9	27.1 27.1	27.1	74.8 75.1	75.0	5.2 5.3	5.3		4.8 4.9	4.9		29.6 28.4	29.0	
				Bottom	9	23.8 23.8	23.8	7.9 7.8	7.9	32.6 32.6	32.6	73.0 72.8	72.9	5.1 5.1	5.1		9.8 10.1	10.0		26.6 23.0	24.8	
4-Sep-15	Sunny	Moderate	11:15	Surface	1	26.8 26.9	26.9	8.1 8.1	8.1	26.1 25.6	25.9	90.6 90.1	90.4	6.3 6.2	6.3	6.3	7.5 6.9	7.2	10.0	6.4 8.1	7.3	8.5
				Middle	4.5	26.7 26.6	26.7	8.1 8.1	8.1	29.9 29.9	29.9	90.9 89.6	90.3	6.2 6.1	6.2		10.7 10.7	10.7		9.3 9.0	9.2	
				Bottom	8	26.6 26.8	26.7	8.1 8.1	8.1	29.9 29.9	29.9	89.3 89.5	89.4	6.1 6.1	6.1		12.3 12.0	12.2		8.1 10.0	9.1	
7-Sep-15	Cloudy	Moderate	16:13	Surface	1	27.0 27.1	27.1	8.0 8.1	8.1	24.1 23.9	24.0	93.6 92.8	93.2	6.5 6.5	6.5	6.5	3.2 2.9	3.1	6.7	4.9 5.2	5.1	6.3
				Middle	3.5	26.4 26.3	26.4	8.1 8.2	8.2	30.2 30.8	30.5	93.3 92.8	93.1	6.4 6.3	6.4		4.6 5.5	5.1		5.1 4.5	4.8	
				Bottom	6	26.3 26.2	26.3	8.2 8.2	8.2	32.2 32.3	32.3	91.9 91.6	91.8	6.2 6.2	6.2		11.7 11.8	11.8		12.4 5.4	8.9	
9-Sep-15	Sunny	Moderate	18:11	Surface	1	28.7 28.7	28.7	7.9 7.9	7.9	22.7 22.7	22.7	84.0 83.4	83.7	5.7 5.7	5.7	5.5	6.3 6.2	6.3	8.5	6.8 9.7	8.3	7.2
				Middle	5	27.4 27.4	27.4	7.8 7.8	7.8	26.4 26.4	26.4	78.1 77.7	77.9	5.3 5.3	5.3		9.1 9.2	9.2		6.8 4.4	5.6	
				Bottom	9	26.2 26.3	26.3	7.8 7.8	7.8	29.3 29.2	29.3	75.3 74.9	75.1	5.2 5.1	5.2		10.0 9.9	10.0		7.1 8.3	7.7	
11-Sep-15	Sunny	Moderate	18:47	Surface	1	26.8 26.7	26.8	7.9 7.9	7.9	27.7 28.1	27.9	76.1 76.3	76.2	5.2 5.2	5.2	5.2	12.0 11.5	11.8	10.6	7.8 8.6	8.2	10.2
				Middle	5	26.3 26.3	26.3	7.7 7.7	7.7	30.5 30.5	30.5	74.8 73.8	74.3	5.1 5.0	5.1		9.6 9.6	9.6		13.0 11.4	12.2	
				Bottom	9	26.2 26.2	26.2	7.7 7.7	7.7	30.7 30.7	30.7	73.9 74.0	74.0	5.0 5.0	5.0		10.5 10.1	10.3		12.0 8.1	10.1	
14-Sep-15	Fine	Moderate	19:31	Surface	1	26.9 26.9	26.9	7.9 7.9	7.9	20.9 20.9	20.9	87.1 86.7	86.9	6.2 6.2	6.2	6.1	7.7 7.7	7.7	8.7	11.5 10.9	11.2	10.5
				Middle	5.5	26.9 26.9	26.9	7.9 7.9	7.9	21.7 21.8	21.8	83.6 83.5	83.6	5.9 5.9	5.9		7.6 7.6	7.6		9.3 10.1	9.7	
				Bottom	10	26.8 26.8	26.8	7.9 7.9	7.9	23.0 23.0	23.0	75.5 74.3	74.9	5.3 5.2	5.3		10.7 10.6	10.7		9.8 11.5	10.7	
16-Sep-15	Fine	Moderate	09:19	Surface	1	26.3 26.3	26.3	7.9 7.9	7.9	27.2 26.9	27.1	87.5 88.5	88.0	6.1 6.1	6.1	6.1	7.9 8.0	8.0	11.6	14.5 14.3	14.4	13.2
				Middle	5	26.0 26.0	26.0	7.9 7.9	7.9	29.0 29.2	29.1	88.7 89.1	88.9	6.1 6.1	6.1		11.4 11.6	11.5		12.8 13.7	13.3	
				Bottom	9	25.4 25.4	25.4	8.0 8.0	8.0	32.1 32.1	32.1	84.9 84.1	84.5	5.8 5.8	5.8		15.3 15.3	15.3		8.3 15.3	11.8	
18-Sep-15	Fine	Moderate	10:06	Surface	1	28.4 28.2	28.3	7.8 7.8	7.8	14.5 14.5	14.5	101.6 99.8	100.7	7.3 7.2	7.3	6.7	3.2 3.2	3.2	9.8	9.7 7.6	8.7	9.3
				Middle	5	27.5 27.7	27.6	7.8 7.8	7.8	16.0 16.0	16.0	83.7 82.3	83.0	6.1 5.9	6.0		11.8 12.7	12.3		10.8 9.8	10.3	
				Bottom	9	27.7 27.7	27.7	7.8 7.8	7.8	19.6 19.6	19.6	80.6 77.8	79.2	5.7 5.5	5.6		13.9 13.6	13.8		7.9 9.9	8.9	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Sep-15	Rainy	Moderate	13:06	Surface	1	28.2	28.2	7.9	7.9	12.7	12.8	110.3	110.2	8.0	8.0	7.5	3.9	4.0	8.4	7.5	7.5	9.9
						28.2	28.2	7.9	7.9	12.8	12.8	110.1	110.1	8.0	8.0		6.6	6.6		6.2	6.0	
				Middle	5	28.2	28.2	7.9	7.9	17.0	17.0	99.0	99.0	7.0	7.0		6.6	6.6		5.8	6.0	
				Bottom	9	27.9	27.9	7.9	7.9	28.0	28.1	84.1	83.7	5.6	5.6	5.6	14.7	14.7	15.1	16.2		
						27.9	27.9	7.9	7.9	28.1	28.1	83.3	83.3	5.6	5.6	5.6	14.7	14.7	17.2	16.2		
23-Sep-15	Fine	Moderate	15:59	Surface	1	27.7	27.7	8.0	8.0	12.5	12.6	79.6	79.1	5.9	5.9	5.6	4.8	4.9	6.0	6.2	5.0	7.3
						27.7	27.7	8.0	8.0	12.6	12.6	78.6	78.6	5.8	5.8		5.0	5.0		3.7	5.0	
				Middle	5.5	26.4	26.4	8.0	8.0	22.0	22.0	71.9	72.7	5.1	5.2		6.6	6.5		10.8	10.3	
						26.4	26.4	8.0	8.0	22.0	22.0	73.4	72.7	5.2	5.2	6.4	6.5	9.7	10.3			
				Bottom	10	26.3	26.3	8.0	8.0	22.9	23.3	70.1	68.1	5.0	4.9	4.9	6.5	6.5	7.2	6.7		
						26.3	26.3	8.0	8.0	23.6	23.3	66.1	66.1	4.7	4.9	4.9	6.4	6.5	6.2	6.7		
25-Sep-15	Sunny	Moderate	16:53	Surface	1	26.9	26.9	7.9	7.9	16.4	16.5	80.5	81.2	5.9	6.0	5.7	4.9	5.0	5.3	4.8	4.9	5.1
						26.9	26.9	7.9	7.9	16.6	16.5	81.8	81.2	6.0	6.0		5.0	5.0		5.0	4.9	
				Middle	4.5	26.6	26.7	7.8	7.8	27.3	27.4	76.5	76.7	5.3	5.3		5.6	5.6		7.4	5.5	
						26.7	26.7	7.8	7.8	27.5	27.4	76.8	76.7	5.3	5.3	5.5	5.6	3.6	5.5			
				Bottom	8	26.4	26.4	7.8	7.8	31.0	30.9	71.7	71.8	4.9	4.9	4.9	5.2	5.2	4.3	5.0		
						26.4	26.4	7.8	7.8	30.8	30.9	71.8	71.8	4.9	4.9	4.9	5.1	5.2	5.7	5.0		
28-Sep-15	Fine	Moderate	18:38	Surface	1	27.9	28.0	7.9	7.9	14.1	14.4	94.7	94.7	6.9	6.9	6.5	5.4	5.4	6.4	11.9	11.1	15.6
						28.0	28.0	7.9	7.9	14.7	14.4	94.7	94.7	6.8	6.9		5.4	5.4		10.3	11.1	
				Middle	5	27.5	27.6	7.9	7.9	29.0	29.2	90.3	89.4	6.1	6.0		6.0	6.1		29.8	23.6	
						27.6	27.6	7.9	7.9	29.4	29.2	88.5	89.4	5.9	6.0	6.1	6.1	17.4	23.6			
				Bottom	9	26.9	27.0	7.8	7.8	31.8	31.8	84.2	83.8	5.6	5.6	5.6	7.6	7.7	11.4	12.0		
						27.0	27.0	7.8	7.8	31.7	31.8	83.3	83.8	5.6	5.6	5.6	7.7	7.7	12.6	12.0		
30-Sep-15	Sunny	Moderate	08:38	Surface	1	28.0	28.0	7.7	7.7	15.0	15.1	102.3	101.8	7.4	7.4	6.9	2.6	2.8	4.2	16.1	16.5	15.4
						28.0	28.0	7.7	7.7	15.1	15.1	101.3	101.8	7.3	7.4		3.0	2.8		16.9	16.5	
				Middle	4.5	27.4	27.5	7.8	7.8	20.6	20.5	89.8	89.5	6.3	6.3		2.2	2.4		15.6	12.7	
						27.5	27.5	7.8	7.8	20.4	20.5	89.2	89.5	6.3	6.3	2.6	2.4	9.8	12.7			
				Bottom	8	26.7	26.7	7.8	7.8	25.5	25.2	69.7	69.3	4.8	4.8	4.8	7.7	7.3	10.5	17.0		
						26.7	26.7	7.8	7.8	24.9	25.2	68.8	69.3	4.8	4.8	4.8	6.9	7.3	23.5	17.0		

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
21-Sep-15	Rainy	Moderate	18:24	Surface	1	28.4	28.4	8.0	8.0	13.6	13.6	103.2	103.1	7.4	7.4	6.9	5.7	5.7	7.5	6.8	7.1	10.1			
						28.4		8.0		13.6		103.0		7.4			5.7			7.4			7.4		9.8
				Middle	3	28.2	28.2	8.0	8.0	20.1	20.1	91.7	91.5	6.4	6.4		5.7	5.6		5.4	5.6		5.4	5.6	10.2
		27.9	27.9	8.0	8.0	29.9	29.9	83.8	83.5	5.6	5.6	5.6	5.6	5.6	5.6	11.1	11.3	11.3	12.2	13.3					
		27.9		8.0		29.9		83.2		5.5		5.6		5.6		11.5		11.3		14.3	13.3				
23-Sep-15	Fine	Moderate	08:29	Surface	1	28.2	28.2	7.9	7.9	16.0	16.0	95.2	95.0	6.8	6.8	6.4	4.8	4.8	6.3	6.3	6.7	7.0			
						28.2		7.9		16.0		94.7		6.8			4.7			4.8			7.1		6.7
				Middle	3	26.6	26.6	7.9	7.9	22.8	22.9	84.0	83.0	5.9	5.9		5.9	5.9		5.9	5.9		5.9	5.9	8.8
		25.6	25.6	7.9	7.9	29.7	29.7	75.9	75.6	5.3	5.3	5.3	5.3	5.3	5.3	8.3	8.3	8.3	6.6	6.5					
		25.6		7.9		29.6		75.3		5.2		5.3		5.3		8.3		8.3		6.4	6.5				
25-Sep-15	Sunny	Moderate	10:27	Surface	1	27.1	27.1	7.8	7.8	15.6	15.8	86.5	87.0	6.3	6.4	5.8	3.9	3.9	5.2	6.0	5.7	6.1			
						27.0		7.8		15.9		87.4		6.4			3.9			3.9			5.3		5.7
				Middle	3.5	26.7	26.8	7.8	7.8	26.4	26.4	74.7	75.3	5.2	5.2		5.3	5.3		5.3	5.3		5.3	3.6	5.2
		26.8		7.8		26.3		75.8		5.2		5.2		5.3		5.3		6.8		5.2					
		26.5	26.5	7.8	7.8	29.5	29.4	70.4	70.7	4.8	4.9	4.9	4.9	4.9	4.9	6.3	6.3	6.3	6.8	7.5					
		26.4		7.8		29.3		71.0		4.9		4.9		4.9		6.3		6.3		8.2	7.5				
28-Sep-15	Sunny	Moderate	12:59	Surface	1	28.0	28.0	7.9	7.9	17.9	17.9	100.9	101.3	7.2	7.2	6.8	4.3	4.3	6.1	13.0	12.6	14.3			
						28.0		7.9		17.9		101.6		7.2			4.2			4.3			12.1		12.6
				Middle	3.5	27.7	27.7	7.8	7.8	22.6	22.7	90.2	90.2	6.3	6.3		6.0	6.0		6.0	6.0		6.0	6.0	16.9
		27.6		7.8		22.7		90.1		6.3		6.3		6.0		6.0		13.3		15.1					
		26.9	26.9	7.8	7.8	27.5	27.5	78.8	79.3	5.4	5.5	5.5	5.5	5.5	5.5	8.1	8.1	8.1	14.2	15.3					
		26.9		7.8		27.5		79.7		5.5		5.5		5.5		8.1		8.1		16.4	15.3				
30-Sep-15	Sunny	Moderate	14:35	Surface	1	27.3	27.3	7.7	7.7	17.4	17.4	93.7	93.5	6.7	6.7	6.7	7.9	7.3	7.0	13.4	14.7	15.3			
						27.3		7.7		17.4		93.2		6.7			6.7			7.3			7.3		14.7
				Middle	3	27.1	27.1	7.6	7.6	18.0	18.0	92.5	92.5	6.7	6.7		7.0	7.3		7.3	7.3		7.3	7.3	16.2
		27.1		7.6		18.0		92.4		6.7		6.7		7.3		7.3		15.1		15.7					
		26.6	26.6	7.6	7.6	21.8	21.9	90.5	90.0	6.4	6.4	6.4	6.4	6.4	6.4	6.6	6.5	6.5	6.6	18.9	15.4				
		26.5		7.6		22.0		89.5		6.4		6.4		6.4		6.4		6.5		11.9	15.4				

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Sep-15	Rainy	Moderate	09:19	Surface	1	27.0 27.0	27.0	8.0 8.0	8.0	18.7 18.7	18.7	100.6 100.5	100.6	7.2 7.2	7.2	7.0	4.9 4.8	4.9	6.9	22.2 21.2	21.7	23.6
				Middle	3	25.1 25.1	25.1	7.8 7.9	7.9	21.5 21.5	21.5	91.9 91.6	91.8	6.7 6.7	6.7		8.6 8.4	8.5		24.0 23.0	23.5	
				Bottom	5	24.4 24.4	24.4	7.8 7.8	7.8	23.3 23.4	23.4	71.8 70.9	71.4	5.3 5.2	5.3		7.2 7.6	7.4		25.6 25.6	25.6	
4-Sep-15	Sunny	Moderate	11:29	Surface	1	26.3 26.5	26.4	8.1 8.1	8.1	25.3 24.3	24.8	90.7 90.9	90.8	6.4 6.4	6.4	6.3	4.3 3.5	3.9	8.2	8.1 10.1	9.1	8.2
				Middle	3.5	26.6 26.7	26.7	8.1 8.1	8.1	30.2 30.1	30.2	90.6 90.6	90.6	6.1 6.1	6.1		7.9 7.4	7.7		7.5 6.0	6.8	
				Bottom	6	26.3 26.5	26.4	8.1 8.1	8.1	30.9 31.1	31.0	89.9 90.2	90.1	6.1 6.1	6.1		12.7 13.2	13.0		9.2 8.1	8.7	
7-Sep-15	Cloudy	Moderate	15:49	Surface	1	27.0 27.1	27.1	8.0 8.1	8.1	24.1 24.0	24.1	94.8 93.3	94.1	6.6 6.5	6.6	6.5	2.4 2.5	2.5	6.0	4.0 5.0	4.5	5.6
				Middle	4.5	26.3 26.3	26.3	8.1 8.2	8.2	31.6 31.9	31.8	92.8 92.0	92.4	6.3 6.2	6.3		7.0 7.1	7.1		6.8 5.8	6.3	
				Bottom	8	26.3 26.3	26.3	8.2 8.2	8.2	32.1 32.1	32.1	90.8 90.7	90.8	6.1 6.1	6.1		8.3 8.3	8.3		6.2 5.5	5.9	
9-Sep-15	Sunny	Moderate	18:22	Surface	1	28.6 28.7	28.7	7.8 7.8	7.8	23.2 23.1	23.2	82.1 81.7	81.9	5.6 5.6	5.6	5.3	7.4 7.8	7.6	8.6	7.9 6.8	7.4	7.2
				Middle	3	27.3 27.3	27.3	7.8 7.8	7.8	26.5 26.5	26.5	73.5 73.0	73.3	5.0 5.0	5.0		5.5 5.4	5.5		5.3 8.3	6.8	
				Bottom	5	26.1 26.1	26.1	7.8 7.8	7.8	29.8 29.7	29.8	72.0 76.9	74.5	4.9 5.3	5.1		12.8 12.6	12.7		8.1 6.9	7.5	
11-Sep-15	Sunny	Moderate	19:01	Surface	1	27.2 27.2	27.2	7.9 7.9	7.9	25.8 25.8	25.8	77.2 77.9	77.6	5.3 5.4	5.4	5.4	6.7 6.8	6.8	8.9	7.8 7.3	7.6	8.4
				Middle	3.5	26.1 26.1	26.1	7.9 7.9	7.9	30.2 30.2	30.2	79.5 78.3	78.9	5.4 5.4	5.4		9.1 9.0	9.1		5.5 9.4	7.5	
				Bottom	6	25.6 25.6	25.6	7.9 7.9	7.9	32.2 32.2	32.2	78.9 76.4	77.7	5.4 5.2	5.3		10.1 11.6	10.9		9.4 10.8	10.1	
14-Sep-15	Fine	Moderate	19:44	Surface	1	26.9 26.9	26.9	7.9 7.9	7.9	20.8 20.8	20.8	86.5 86.3	86.4	6.1 6.1	6.1	5.8	8.0 8.1	8.1	9.7	10.0 12.2	11.1	10.5
				Middle	3	26.9 26.9	26.9	7.9 7.9	7.9	22.0 22.1	22.1	76.7 76.4	76.6	5.4 5.4	5.4		9.6 9.8	9.7		11.7 8.5	10.1	
				Bottom	5	26.8 26.8	26.8	7.9 7.9	7.9	23.4 23.4	23.4	73.1 73.0	73.1	5.1 5.1	5.1		11.0 11.6	11.3		8.5 11.8	10.2	
16-Sep-15	Fine	Moderate	09:29	Surface	1	26.6 26.7	26.7	7.8 7.8	7.8	23.1 22.5	22.8	98.5 99.2	98.9	6.9 7.0	7.0	6.6	5.1 4.8	5.0	8.1	14.8 14.2	14.5	13.9
				Middle	3.5	25.7 25.7	25.7	7.8 7.8	7.8	30.1 30.1	30.1	88.0 87.7	87.9	6.1 6.0	6.1		9.1 8.7	8.9		10.7 17.5	14.1	
				Bottom	6	25.6 25.6	25.6	7.9 7.9	7.9	31.0 31.0	31.0	84.7 84.7	84.7	5.8 5.8	5.8		10.6 10.4	10.5		12.4 13.9	13.2	
18-Sep-15	Fine	Moderate	10:20	Surface	1	28.3 28.2	28.3	7.8 7.8	7.8	14.4 14.5	14.5	101.4 99.9	100.7	7.3 7.2	7.3	6.7	2.8 3.4	3.1	9.7	9.9 6.0	8.0	7.1
				Middle	3.5	27.7 27.8	27.8	7.8 7.8	7.8	16.2 16.2	16.2	84.2 82.6	83.4	6.1 5.9	6.0		11.8 12.7	12.3		5.8 5.9	5.9	
				Bottom	6	27.5 27.4	27.5	7.8 7.8	7.8	19.5 19.6	19.6	80.2 77.4	78.8	5.7 5.5	5.6		13.9 13.7	13.8		6.9 7.9	7.4	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Sep-15	Rainy	Moderate	13:19	Surface	1	28.3	28.3	7.9	7.9	13.1	13.2	104.8	104.5	7.6	7.6	7.5	3.9	4.1	8.1	6.6	5.8	5.4
						28.3		7.9		13.2		104.1		7.5			4.2			5.0		
				Middle	3	28.4	28.4	7.9	7.9	13.5	13.5	102.6	102.3	7.4	7.4		4.3	4.3		4.6	5.5	
		28.4		7.9		13.5		102.3		7.4		7.4	4.3		6.3		5.5					
		28.0	28.0	7.9	7.9	25.6	25.7	85.9	85.3	85.6	5.8	5.8	5.8	15.4	15.9	4.6	5.0					
		28.0		7.9		25.7		85.3		25.7		85.6	5.8	5.8	5.8	16.4	15.9	5.3	5.0			
23-Sep-15	Fine	Moderate	16:09	Surface	1	27.7	27.7	8.0	8.0	12.5	12.6	79.6	79.1	5.9	5.9	5.6	5.7	5.6	6.5	5.5	6.7	7.1
						27.7		8.0		12.6		78.6		5.8			5.5			7.9		
				Middle	3	26.4	26.4	8.0	8.0	22.0	22.0	73.6	74.3	74.0	5.2		5.3	6.9		7.1	6.8	
		26.4		8.0		22.0		74.3		74.0		5.3	5.3	7.2		8.7		7.8				
		26.3	26.3	8.1	8.1	22.9	23.6	70.1	70.3	70.2	5.0	5.0	5.0	6.7	6.9	7.0	6.9					
		26.3		8.1		23.6		70.3		70.2		5.0	5.0	5.0	7.1	6.9	6.8	6.9				
25-Sep-15	Sunny	Moderate	17:12	Surface	1	26.9	27.0	7.8	7.8	15.9	15.9	83.1	83.7	6.1	6.1	5.7	4.6	4.6	5.7	4.9	6.0	5.5
						27.0		7.8		15.8		84.2		6.1			4.5			7.0		
				Middle	3.5	26.7	26.7	7.8	7.8	26.0	26.0	75.9	75.8	75.9	5.3		5.3	5.3		5.4	5.4	
		26.7		7.8		25.9		75.8		75.9		5.3	5.3	5.4		4.6		4.9				
		26.5	26.5	7.7	7.8	29.7	29.8	73.2	72.5	72.9	5.0	5.0	5.0	6.9	7.0	6.9	5.5					
		26.4		7.8		29.8		72.5		72.9		5.0	5.0	5.0	7.1	7.0	7.1	7.0				
28-Sep-15	Fine	Moderate	18:57	Surface	1	28.0	28.0	7.9	7.9	16.6	16.8	97.3	97.8	7.0	7.0	6.5	5.1	5.1	6.2	12.4	12.2	13.0
						28.0		7.9		17.0		98.2		7.0			5.0			5.1		
				Middle	3.5	27.6	27.6	7.8	7.8	22.8	22.8	86.7	86.4	86.6	6.0		6.0	5.9		5.9	5.9	
		27.5		7.8		22.7		86.4		86.6		6.0	6.0	5.8		14.4		15.0				
		27.0	27.1	7.8	7.8	29.9	29.9	81.8	80.7	81.3	5.5	5.5	5.5	7.7	7.7	10.2	11.8					
		27.1		7.8		29.9		80.7		81.3		5.5	5.5	5.5	7.7	7.7	13.4		11.8			
30-Sep-15	Sunny	Moderate	08:49	Surface	1	28.0	28.0	7.7	7.7	15.0	15.1	102.3	101.8	7.4	7.4	6.9	2.6	2.8	4.2	14.6	18.2	15.4
						28.0		7.7		15.1		101.3		7.3			3.0			21.8		
				Middle	3	27.4	27.5	7.8	7.8	20.6	20.5	89.8	89.2	89.5	6.3		6.3	2.2		2.4	16.4	
		27.5		7.8		20.4		89.2		89.5		6.3	6.3	2.6		15.7		16.1				
		26.7	26.7	7.8	7.8	25.5	25.2	69.7	68.8	69.3	4.8	4.8	4.8	7.7	7.3	9.0	12.0					
		26.7		7.8		24.9		68.8		69.3		4.8	4.8	4.8	6.9	7.3	15.0		12.0			

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
2-Sep-15	Rainy	Moderate	14:46	Surface	1	26.9 27.3	27.1	7.9 7.9	7.9	30.0 30.0	30.0	81.3 81.3	81.3	5.5 5.5	5.5	5.5	2.6 2.7	2.7	6.1	16.8 12.4	14.6	13.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.4	24.2 24.0	24.1	7.8 7.8	7.8	29.6 29.9	29.8	69.1 68.2	68.7	4.9 4.8	4.9		4.9	9.3 9.4		9.4	11.4 12.2		11.8		
4-Sep-15	Sunny	Moderate	16:38	Surface	1	26.1 26.1	26.1	7.7 7.6	7.7	21.9 22.0	22.0	90.3 88.8	89.6	6.5 6.4	6.5	6.5	5.6 5.3	5.5	7.2	14.2 15.4	14.8	13.5			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.6	25.1 25.3	25.2	7.9 8.0	8.0	27.3 27.4	27.4	86.0 82.7	84.4	6.1 5.8	6.0		6.0	9.1 8.7		8.9	11.2 13.2		12.2		
7-Sep-15	Cloudy	Moderate	08:04	Surface	1	26.2 25.8	26.0	8.0 8.0	8.0	24.2 24.3	24.3	90.5 89.4	90.0	6.4 6.4	6.4	6.4	3.5 3.6	3.6	7.2	5.2 5.9	5.6	7.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.5	25.9 26.3	26.1	8.0 8.1	8.1	27.3 27.5	27.4	72.3 73.8	73.1	5.0 5.1	5.1		5.1	10.5 10.8		10.7	5.5 11.9		8.7		
9-Sep-15	Sunny	Moderate	09:37	Surface	1	28.4 28.4	28.4	7.9 7.9	7.9	19.2 19.2	19.2	84.1 81.7	82.9	5.9 5.7	5.8	5.8	4.2 4.1	4.2	8.8	10.6 10.0	10.3	9.5			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.5	27.9 27.9	27.9	7.8 7.8	7.8	20.9 20.9	20.9	75.5 74.3	74.9	5.3 5.2	5.3		5.3	13.1 13.4		13.3	9.2 7.9		8.6		
11-Sep-15	Sunny	Moderate	11:24	Surface	1	26.5 26.6	26.6	8.0 8.0	8.0	29.2 29.1	29.2	77.6 78.5	78.1	5.3 5.4	5.4	5.4	7.9 8.0	8.0	8.1	8.2 8.3	8.3	9.0			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.5	25.8 26.1	26.0	8.0 7.9	8.0	30.4 30.6	30.5	79.2 78.5	78.9	5.4 5.4	5.4		5.4	8.0 8.1		8.1	8.1 11.2		9.7		
14-Sep-15	Sunny	Moderate	12:44	Surface	1	27.0 26.8	26.9	7.7 7.6	7.7	19.5 19.5	19.5	98.1 97.4	97.8	7.0 7.0	7.0	7.0	5.6 5.8	5.7	6.5	14.5 7.8	11.2	9.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.5	26.4 26.4	26.4	7.9 7.9	7.9	23.7 23.9	23.8	76.4 75.2	75.8	5.4 5.3	5.4		5.4	7.3 7.1		7.2	6.8 7.5		7.2		
16-Sep-15	Fine	Moderate	14:02	Surface	1	27.6 27.4	27.5	7.9 8.0	8.0	24.0 23.8	23.9	88.1 89.0	88.6	6.1 6.2	6.2	6.2	3.6 4.1	3.9	4.6	23.6 18.7	21.2	16.3			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.5	26.9 27.0	27.0	8.0 8.0	8.0	26.8 26.5	26.7	89.2 89.7	89.5	6.1 6.2	6.2		6.2	4.9 5.4		5.2	14.5 8.2		11.4		
18-Sep-15	Fine	Moderate	15:06	Surface	1	27.0 27.0	27.0	7.8 7.8	7.8	18.5 19.0	18.8	90.9 90.3	90.6	6.5 6.5	6.5	6.5	10.4 10.3	10.4	12.3	7.2 5.9	6.6	6.8			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.6	26.3 26.3	26.3	7.8 7.8	7.8	22.1 22.0	22.1	76.8 74.5	75.7	5.5 5.3	5.4		5.4	14.0 14.1		14.1	7.0 6.9		7.0		

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
21-Sep-15	Rainy	Moderate	17:47	Surface	1	28.5 28.4	28.5	8.0 7.9	8.0	14.1 14.1	14.1	109.8 109.6	109.7	8.0 8.0	8.0	8.0	4.0 3.7	3.9	6.6	5.4 4.7	5.1	5.6			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.5	27.9 27.9	27.9	8.0 8.0	8.0	29.0 29.0	29.0	98.6 98.6	98.6	98.6	98.6		7.0 7.0	7.0		7.0	9.2 9.4		9.3	5.2 6.9	6.1
23-Sep-15	Fine	Moderate	07:49	Surface	1	26.6 26.7	26.7	7.7 7.7	7.7	17.8 17.8	17.8	83.7 81.4	82.6	6.0 5.8	5.9	5.9	8.2 8.4	8.3	10.2	13.0 6.3	9.7	8.4			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.4	26.4 26.3	26.4	7.7 7.8	7.8	22.0 22.3	22.2	78.9 78.9	78.9	78.9	78.9		5.6 5.6	5.6		5.6	12.0 12.2		12.1	7.6 6.4	7.0
25-Sep-15	Sunny	Moderate	09:33	Surface	1	26.9 27.2	27.1	7.8 7.8	7.8	16.2 16.0	16.1	78.7 80.2	79.5	5.7 5.8	5.8	5.8	7.9 7.9	7.9	7.9	8.0 6.9	7.5	6.9			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.5	26.7 26.4	26.6	7.8 7.8	7.8	27.2 27.0	27.1	74.9 74.5	74.7	74.7	74.7		5.2 5.2	5.2		5.2	7.8 7.9		7.9	6.8 5.5	6.2
28-Sep-15	Sunny	Moderate	12:03	Surface	1	28.0 28.0	28.0	7.8 7.8	7.8	17.3 18.3	17.8	96.9 97.1	97.0	6.9 6.9	6.9	6.9	7.8 8.0	7.9	7.9	17.6 13.1	15.4	15.6			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.5	27.6 27.5	27.6	7.9 7.9	7.9	24.1 23.6	23.9	88.3 86.2	87.3	87.3	87.3		6.1 6.0	6.1		6.1	7.9 7.9		7.9	16.0 15.4	15.7
30-Sep-15	Sunny	Moderate	14:30	Surface	1	26.7 26.7	26.7	7.7 7.7	7.7	18.3 18.8	18.6	89.4 88.9	89.2	6.5 6.4	6.5	6.5	10.3 10.2	10.3	12.2	14.0 17.3	15.7	16.0			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.5	26.0 26.0	26.0	7.6 7.6	7.6	21.9 21.8	21.9	75.6 73.3	74.5	74.5	74.5		5.4 5.3	5.4		5.4	13.9 14.0		14.0	20.6 11.7	16.2

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
2-Sep-15	Rainy	Moderate	08:50	Surface	1	26.3 25.9	26.1	7.9 7.8	7.9	17.2 17.3	17.3	81.9 80.8	81.4	6.0 6.0	6.0	6.0	3.6 3.6	3.6	7.2	17.2 20.6	18.9	18.7			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.3	26.0 26.3	26.2	7.9 7.8	7.9	20.3 20.5	20.4	71.1 72.6	71.9	5.2 5.2	5.2		5.2	10.5 10.9		10.7	18.8 18.2		18.5		
4-Sep-15	Sunny	Moderate	10:40	Surface	1	26.3 26.3	26.3	7.6 7.7	7.7	22.0 21.8	21.9	91.0 90.6	90.8	6.5 6.5	6.5	6.5	5.5 5.9	5.7	7.6	13.3 13.2	13.3	11.9			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.4	25.0 25.0	25.0	7.9 7.9	7.9	28.3 29.6	29.0	85.6 85.1	85.4	6.0 5.9	6.0		6.0	9.4 9.4		9.4	10.2 10.7		10.5		
7-Sep-15	Cloudy	Moderate	15:32	Surface	1	26.9 27.2	27.1	8.0 8.0	8.0	30.1 30.2	30.2	87.1 87.4	87.3	5.9 5.9	5.9	5.9	2.8 2.7	2.8	6.2	4.8 4.6	4.7	5.5			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.5	24.1 24.0	24.1	8.0 8.1	8.1	29.5 29.7	29.6	74.9 74.1	74.5	5.3 5.3	5.3		5.3	9.4 9.6		9.5	7.1 5.4		6.3		
9-Sep-15	Sunny	Moderate	17:18	Surface	1	28.5 28.5	28.5	7.8 7.8	7.8	24.9 25.4	25.2	83.2 84.0	83.6	5.6 5.7	5.7	5.7	9.8 9.7	9.8	11.7	6.7 7.9	7.3	6.3			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.6	27.8 27.8	27.8	7.8 7.8	7.8	28.6 28.5	28.6	76.6 74.4	75.5	5.1 5.0	5.1		5.1	13.4 13.5		13.5	4.7 5.9		5.3		
11-Sep-15	Sunny	Moderate	18:06	Surface	1	27.3 27.3	27.3	7.9 7.9	7.9	25.8 25.9	25.9	79.3 82.7	81.0	5.4 5.7	5.6	5.6	6.7 6.7	6.7	8.0	8.4 8.4	8.4	11.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.6	25.9 26.1	26.0	7.9 7.9	7.9	30.2 30.2	30.2	70.8 81.9	76.4	4.9 5.6	5.3		5.3	9.2 9.1		9.2	13.0 15.0		14.0		
14-Sep-15	Fine	Moderate	18:53	Surface	1	26.8 26.9	26.9	7.9 7.9	7.9	19.4 19.5	19.5	98.8 98.0	98.4	7.1 7.0	7.1	7.1	6.6 6.4	6.5	7.3	8.9 9.2	9.1	10.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.5	26.4 26.4	26.4	8.0 8.0	8.0	24.8 24.8	24.8	74.6 75.5	75.1	5.2 5.3	5.3		5.3	8.0 8.1		8.1	9.6 12.9		11.3		
16-Sep-15	Fine	Moderate	08:54	Surface	1	26.4 26.2	26.3	7.8 7.8	7.8	27.2 27.0	27.1	90.4 90.5	90.5	6.3 6.3	6.3	6.3	7.9 7.8	7.9	7.9	14.8 11.5	13.2	15.5			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.5	26.0 25.9	26.0	7.9 7.9	7.9	29.0 29.3	29.2	96.0 96.1	96.1	6.6 6.6	6.6		6.6	7.9 7.9		7.9	20.6 15.0		17.8		
18-Sep-15	Fine	Moderate	09:16	Surface	1	28.2 28.2	28.2	7.8 7.8	7.8	14.5 14.5	14.5	102.9 101.5	102.2	7.4 7.3	7.4	7.4	2.8 3.4	3.1	7.7	11.9 6.1	9.0	9.0			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.6	27.7 27.7	27.7	7.8 7.8	7.8	16.1 16.1	16.1	85.4 83.7	84.6	6.1 6.0	6.1		6.1	11.7 12.7		12.2	8.7 9.3		9.0		

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
21-Sep-15	Rainy	Moderate	12:37	Surface	1	28.2 28.3	28.3	7.9 7.9	7.9	12.8 12.8	12.8	102.2 101.9	102.1	7.4 7.3	7.4	7.4	8.0 7.8	7.9	8.0	5.0 4.7	4.9	5.1			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.5	28.2 28.3	28.3	7.9 7.9	7.9	17.0 17.0	17.0	83.1 82.5	82.8	5.5 5.5	5.5		5.5	5.5		7.9 8.0	8.0		5.0 5.5	5.3	
23-Sep-15	Fine	Moderate	15:30	Surface	1	27.3 27.2	27.3	7.8 7.7	7.8	17.0 16.8	16.9	89.2 93.1	91.2	6.4 6.6	6.5	6.5	6.3 7.5	6.9	9.6	4.2 8.5	6.4	6.1			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.4	25.7 25.9	25.8	7.8 7.8	7.8	23.6 23.6	23.6	79.6 77.9	78.8	5.6 5.5	5.6		5.6	12.4 12.1		12.3	6.0 5.6		5.8		
25-Sep-15	Sunny	Moderate	16:29	Surface	1	27.0 26.9	27.0	7.9 7.9	7.9	16.4 16.5	16.5	80.7 81.5	81.1	5.9 5.9	5.9	5.9	5.0 5.0	5.0	5.3	3.7 5.9	4.8	4.6			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.5	26.7 26.6	26.7	7.8 7.8	7.8	27.5 27.3	27.4	74.3 74.3	74.3	5.1 5.1	5.1		5.1	5.6 5.5		5.6	5.0 3.5		4.3		
28-Sep-15	Fine	Moderate	18:09	Surface	1	27.8 27.9	27.9	7.9 7.8	7.9	14.1 14.8	14.5	96.2 96.9	96.6	7.0 7.0	7.0	7.0	5.5 5.3	5.4	5.8	13.0 8.7	10.9	13.7			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.6	27.6 27.6	27.6	7.8 7.8	7.8	28.9 29.2	29.1	91.5 89.4	90.5	6.1 6.0	6.1		6.1	6.2 6.0		6.1	19.8 13.1		16.5		
30-Sep-15	Sunny	Moderate	08:29	Surface	1	28.1 28.1	28.1	7.7 7.7	7.7	14.4 14.4	14.4	102.0 100.6	101.3	7.4 7.3	7.4	7.4	2.8 3.4	3.1	7.6	18.4 8.7	13.6	17.9			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.6	27.6 27.6	27.6	7.6 7.6	7.6	16.0 16.1	16.1	84.7 83.1	83.9	6.1 6.0	6.1		6.1	11.6 12.6		12.1	16.8 27.6		22.2		

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS4 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Sep-15	Rainy	Moderate	15:42	Surface	1	26.0 26.1	26.1	7.9 7.9	7.9	18.8 18.8	18.8	100.3 100.8	100.6	7.3 7.4	7.4	7.0	2.9 3.1	3.0	5.0	34.2 29.2	31.7	25.5
				Middle	3.5	25.1 25.1	25.1	7.9 7.9	7.9	22.2 22.2	22.2	91.8 87.5	89.7	6.7 6.4	6.6		4.2 4.3	4.3		11.4 13.0	12.2	
				Bottom	6	23.7 23.7	23.7	7.8 7.8	7.8	24.7 24.7	24.7	68.6 70.1	69.4	5.0 5.2	5.1		7.6 7.5	7.6		29.0 36.2	32.6	
4-Sep-15	Sunny	Moderate	16:51	Surface	1	26.8 27.1	27.0	8.1 8.1	8.1	26.1 26.5	26.3	96.3 96.3	96.3	6.7 6.6	6.7	6.7	4.0 3.9	4.0	6.4	9.2 9.8	9.5	9.9
				Middle	4.5	26.8 26.8	26.8	8.1 8.1	8.1	27.1 26.6	26.9	96.3 95.7	96.0	6.6 6.6	6.6		6.0 6.1	6.1		8.3 11.3	9.8	
				Bottom	8	26.4 26.8	26.6	8.1 8.1	8.1	28.3 28.4	28.4	95.0 94.8	94.9	6.5 6.5	6.5		9.2 9.0	9.1		10.9 9.8	10.4	
7-Sep-15	Cloudy	Moderate	08:55	Surface	1	26.5 26.5	26.5	8.0 8.1	8.1	25.0 24.7	24.9	90.1 90.6	90.4	6.3 6.3	6.3	6.2	4.2 3.8	4.0	7.4	5.5 5.5	5.5	4.7
				Middle	3.5	26.6 26.6	26.6	8.1 8.1	8.1	30.2 30.2	30.2	90.3 90.3	90.3	6.1 6.1	6.1		9.2 8.6	8.9		4.2 4.2	4.2	
				Bottom	6	26.5 26.5	26.5	8.1 8.1	8.1	30.9 30.9	30.9	90.2 90.2	90.2	6.1 6.1	6.1		9.3 9.5	9.4		3.7 4.8	4.3	
9-Sep-15	Sunny	Moderate	10:46	Surface	1	29.4 29.4	29.4	7.8 7.8	7.8	20.3 20.3	20.3	83.1 82.5	82.8	5.7 5.6	5.7	5.6	10.6 10.5	10.6	10.7	6.3 5.4	5.9	6.9
				Middle	3.5	29.3 29.3	29.3	7.8 7.8	7.8	20.4 20.4	20.4	80.9 80.7	80.8	5.5 5.5	5.5		10.7 11.2	11.0		6.7 8.0	7.4	
				Bottom	6	29.2 29.2	29.2	7.8 7.8	7.8	20.6 20.7	20.7	77.7 78.1	77.9	5.3 5.3	5.3		10.7 10.3	10.5		7.4 7.2	7.3	
11-Sep-15	Sunny	Moderate	12:22	Surface	1	27.4 27.4	27.4	8.0 8.0	8.0	23.3 23.3	23.3	78.8 77.9	78.4	5.5 5.4	5.5	5.4	4.0 4.2	4.1	5.4	7.9 6.4	7.2	7.9
				Middle	3	26.0 26.0	26.0	8.0 7.9	8.0	31.3 31.2	31.3	77.7 76.5	77.1	5.3 5.2	5.3		4.8 5.3	5.1		8.0 7.1	7.6	
				Bottom	5	25.8 25.8	25.8	7.9 7.9	7.9	32.4 32.4	32.4	76.1 75.9	76.0	5.2 5.2	5.2		6.9 7.1	7.0		9.0 8.7	8.9	
14-Sep-15	Sunny	Moderate	13:43	Surface	1	26.9 26.9	26.9	7.9 7.9	7.9	19.2 19.1	19.2	94.2 95.7	95.0	6.8 6.9	6.9	6.4	5.9 5.7	5.8	6.1	10.3 8.3	9.3	9.4
				Middle	3	27.0 27.0	27.0	8.0 8.0	8.0	21.6 21.8	21.7	81.1 82.5	81.8	5.7 5.8	5.8		5.4 6.4	5.9		11.3 7.5	9.4	
				Bottom	5	26.6 26.6	26.6	7.9 7.9	7.9	25.6 25.6	25.6	74.1 73.6	73.9	5.2 5.1	5.2		6.5 6.6	6.6		8.2 11.0	9.6	
16-Sep-15	Fine	Moderate	15:12	Surface	1	27.1 27.1	27.1	7.9 7.9	7.9	24.4 24.4	24.4	81.8 81.7	81.8	5.7 5.7	5.7	5.6	5.0 5.2	5.1	6.0	14.3 9.7	12.0	12.2
				Middle	3.5	25.8 25.8	25.8	7.9 7.9	7.9	29.8 29.8	29.8	79.7 78.9	79.3	5.5 5.4	5.5		5.7 5.6	5.7		17.0 10.2	13.6	
				Bottom	6	25.7 25.7	25.7	8.0 7.9	8.0	30.5 30.5	30.5	77.0 77.3	77.2	5.3 5.3	5.3		7.3 7.0	7.2		11.4 10.7	11.1	
18-Sep-15	Fine	Moderate	15:22	Surface	1	25.6 26.7	26.2	7.8 7.9	7.9	26.1 26.4	26.3	80.0 84.6	82.3	5.6 5.9	5.8	5.6	6.6 6.1	6.4	6.1	6.2 6.3	6.3	6.6
				Middle	5	28.2 25.6	26.9	7.9 7.8	7.9	25.4 25.4	25.4	77.0 74.3	75.7	5.2 5.3	5.3		6.2 5.9	6.1		7.3 5.6	6.5	
				Bottom	9	26.0 26.0	26.0	7.7 7.7	7.7	23.7 23.9	23.8	69.8 69.2	69.5	5.0 4.9	5.0		5.7 5.8	5.8		9.4 4.6	7.0	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS4 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Sep-15	Rainy	Moderate	18:35	Surface	1	28.4	28.4	8.0	8.0	14.3	14.4	100.6	100.5	7.2	7.2	6.5	6.4	6.4	10.4	9.1	8.6	12.8
						28.4		8.0		14.4		100.3		7.2			6.3					
				Middle	3	28.2	28.2	7.9	7.9	22.5	22.5	82.3	82.1	5.7	5.7	11.8	11.8	9.6		13.6		
		28.2		7.9		22.5		81.9		5.6		5.1	5.1	13.0	13.1	16.3	16.3					
		28.0	28.0	7.9	7.9	26.0	26.0	75.7	75.5	5.1	5.1	5.1	5.1	13.1	13.1	16.3	16.3					
23-Sep-15	Fine	Moderate	08:42	Surface	1	27.1	27.1	7.9	7.9	18.0	18.0	96.7	96.3	7.0	7.0	6.6	4.5	4.5	6.9	8.2	6.4	7.0
						27.1		7.9		17.9		95.9		6.9			4.4					
				Middle	3	26.3	26.3	7.9	7.9	24.0	23.9	86.9	86.4	6.1	6.1	6.8	6.8	8.6		8.2		
		26.3		7.9		23.7		85.8		6.1		6.8	6.8	7.7	8.2							
		25.6	25.6	7.9	7.9	29.4	29.5	73.9	72.8	5.1	5.1	5.1	5.1	9.7	9.5	7.5	6.3					
		25.6		7.9		29.6		71.6		5.0		5.1	5.1	9.3	9.5	5.0	6.3					
25-Sep-15	Sunny	Moderate	10:40	Surface	1	26.9	26.9	7.8	7.8	15.7	15.8	84.5	84.1	6.2	6.2	5.8	5.2	5.2	5.9	4.8	4.9	6.6
						26.9		7.8		15.8		83.7		6.1			5.1					
				Middle	3.5	26.7	26.7	7.8	7.8	27.2	27.2	77.6	77.8	5.3	5.4	5.9	5.9	11.8		9.9		
		26.7		7.8		27.2		77.9		5.4		5.9	5.9	8.0	9.9							
		26.4	26.4	7.7	7.8	29.7	29.8	74.1	74.2	5.1	5.1	5.1	5.1	6.6	6.7	4.5	5.1					
		26.4		7.8		29.9		74.3		5.1		5.1	5.1	6.7	6.7	5.7	5.1					
28-Sep-15	Sunny	Moderate	13:12	Surface	1	28.0	28.1	7.8	7.9	16.7	16.7	97.3	97.3	6.9	6.9	6.6	5.2	5.3	6.5	16.1	15.0	14.5
						28.1		7.9		16.6		97.2		6.9			5.3					
				Middle	3.5	27.6	27.5	7.8	7.8	21.7	21.7	90.2	89.4	6.3	6.3	6.6	6.6	19.8		15.8		
		27.3		7.8		21.6		88.6		6.2		6.6	6.5	11.7	15.8							
		27.0	27.0	7.9	7.9	26.7	26.7	82.4	82.5	5.7	5.7	5.7	5.7	7.7	7.7	15.6	12.7					
		27.0		7.9		26.7		82.5		5.7		5.7	5.7	7.6	7.7	9.8	12.7					
30-Sep-15	Sunny	Moderate	14:46	Surface	1	27.2	27.2	7.8	7.8	19.1	19.1	97.0	96.7	6.9	6.9	6.8	8.6	8.0	7.4	18.8	18.4	21.1
						27.2		7.8		19.1		96.3		6.9			7.4					
				Middle	3	27.0	27.0	7.7	7.7	20.6	20.5	93.8	93.4	6.7	6.7	7.0	7.5	29.2		25.0		
		27.0		7.7		20.4		93.0		6.6		7.9	7.5	20.8	25.0							
		26.8	26.8	7.7	7.7	22.5	22.6	90.4	90.2	6.4	6.4	6.4	6.4	6.5	6.8	21.4	20.0					
		26.8		7.7		22.7		89.9		6.3		6.4	6.4	7.0	6.8	18.5	20.0					

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS4 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Sep-15	Rainy	Moderate	09:34	Surface	1	26.4 26.4	26.4	8.0 8.0	8.0	17.9 17.9	17.9	101.6 101.8	101.7	7.4 7.4	7.4	6.7	4.8 4.9	4.9	7.0	21.2 22.6	21.9	20.8
				Middle	3	26.0 25.9	26.0	7.8 7.8	7.8	18.6 18.6	18.6	81.8 81.5	81.7	6.0 6.0	6.0		6.1 6.2	6.2		18.8 23.0	20.9	
				Bottom	5	24.7 24.6	24.7	7.8 7.8	7.8	21.5 21.5	21.5	69.3 70.4	69.9	5.1 5.2	5.2		10.1 9.8	10.0		19.6 19.6	19.6	
4-Sep-15	Sunny	Moderate	11:42	Surface	1	26.7 26.4	26.6	8.1 8.1	8.1	24.9 24.9	24.9	90.3 90.6	90.5	6.3 6.3	6.3	6.2	4.1 3.8	4.0	7.5	9.3 9.2	9.3	10.8
				Middle	3.5	26.5 26.4	26.5	8.1 8.1	8.1	30.0 30.2	30.1	90.1 90.1	90.1	6.1 6.1	6.1		9.2 8.7	9.0		11.2 11.2	11.2	
				Bottom	6	26.4 26.4	26.4	8.1 8.1	8.1	30.7 30.8	30.8	89.8 89.9	89.9	6.1 6.1	6.1		9.4 9.4	9.4		13.0 10.6	11.8	
7-Sep-15	Cloudy	Moderate	16:01	Surface	1	26.9 27.1	27.0	8.1 8.1	8.1	26.2 26.3	26.3	96.6 96.2	96.4	6.7 6.6	6.7	6.7	3.9 4.0	4.0	6.4	5.7 7.7	6.7	5.7
				Middle	4.5	26.9 26.9	26.9	8.1 8.1	8.1	26.9 26.7	26.8	96.2 95.8	96.0	6.6 6.6	6.6		6.0 6.1	6.1		5.0 3.6	4.3	
				Bottom	8	26.5 26.5	26.5	8.1 8.1	8.1	28.3 28.6	28.5	95.1 94.5	94.8	6.5 6.5	6.5		9.2 9.0	9.1		7.1 5.3	6.2	
9-Sep-15	Sunny	Moderate	18:34	Surface	1	28.6 28.5	28.6	7.8 7.8	7.8	23.9 24.2	24.1	89.1 88.7	88.9	6.0 6.0	6.0	5.7	6.4 6.6	6.5	9.8	8.5 10.5	9.5	7.2
				Middle	3	26.5 26.4	26.5	7.8 7.8	7.8	29.0 29.1	29.1	78.7 77.3	78.0	5.4 5.3	5.4		9.9 10.3	10.1		5.0 6.8	5.9	
				Bottom	5	26.1 26.1	26.1	7.8 7.8	7.8	30.0 30.0	30.0	72.8 72.4	72.6	5.0 5.0	5.0		13.0 12.5	12.8		5.8 6.5	6.2	
11-Sep-15	Sunny	Moderate	19:13	Surface	1	26.9 26.9	26.9	7.9 7.9	7.9	24.4 24.4	24.4	87.3 87.2	87.3	6.1 6.1	6.1	5.9	6.1 6.0	6.1	7.0	11.2 9.4	10.3	12.6
				Middle	3.5	26.5 26.5	26.5	7.9 7.9	7.9	25.0 25.0	25.0	81.4 80.6	81.0	5.7 5.6	5.7		7.7 8.4	8.1		18.8 12.2	15.5	
				Bottom	6	25.7 25.7	25.7	7.9 7.9	7.9	31.2 31.5	31.4	80.7 80.2	80.5	5.5 5.5	5.5		7.1 6.7	6.9		12.0 12.0	12.0	
14-Sep-15	Fine	Moderate	19:54	Surface	1	26.9 26.9	26.9	7.9 7.9	7.9	21.0 21.1	21.1	82.7 82.7	82.7	5.9 5.9	5.9	5.8	8.8 8.9	8.9	9.1	9.0 9.6	9.3	9.9
				Middle	3.5	26.9 26.9	26.9	7.9 7.9	7.9	21.4 21.4	21.4	80.5 80.0	80.3	5.7 5.7	5.7		8.8 9.3	9.1		8.1 9.8	9.0	
				Bottom	6	26.9 26.9	26.9	7.9 7.9	7.9	22.2 22.1	22.2	73.9 73.7	73.8	5.2 5.2	5.2		9.5 9.3	9.4		11.3 11.5	11.4	
16-Sep-15	Fine	Moderate	09:41	Surface	1	27.1 27.1	27.1	7.8 7.8	7.8	21.3 21.3	21.3	89.5 88.6	89.1	6.3 6.3	6.3	6.2	7.6 7.5	7.6	8.4	13.9 16.8	15.4	17.3
				Middle	3.5	26.8 26.8	26.8	7.8 7.8	7.8	21.3 21.3	21.3	83.3 83.8	83.6	5.9 6.0	6.0		7.9 8.0	8.0		13.3 16.1	14.7	
				Bottom	6	26.1 26.1	26.1	7.8 7.8	7.8	28.0 28.0	28.0	78.2 77.1	77.7	5.4 5.3	5.4		9.6 9.6	9.6		23.2 20.2	21.7	
18-Sep-15	Fine	Moderate	10:33	Surface	1	28.3 28.1	28.2	7.8 7.8	7.8	14.5 14.5	14.5	101.5 99.7	100.6	7.3 7.2	7.3	6.7	2.8 3.3	3.1	9.7	7.9 6.9	7.4	6.7
				Middle	3.5	27.9 27.7	27.8	7.8 7.8	7.8	16.1 16.2	16.2	84.4 82.4	83.4	6.1 5.9	6.0		11.6 12.7	12.2		5.6 5.5	5.6	
				Bottom	6	27.6 27.5	27.6	7.8 7.8	7.8	19.7 19.5	19.6	80.3 77.5	78.9	5.7 5.5	5.6		13.8 13.7	13.8		8.0 6.4	7.2	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS4 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
21-Sep-15	Rainy	Moderate	13:30	Surface	1	28.3	28.3	8.0	8.0	13.0	13.1	111.0	110.9	8.1	8.1	8.0	8.0	7.9	8.6	11.8	11.8	12.0		
						28.3	28.3	8.0	8.0	13.1	13.1	110.8	110.8	8.0	8.0		7.8	7.9		9.1	9.0		10.4	10.7
				Middle	3	28.3	28.3	8.0	8.0	13.5	13.6	107.6	107.5	7.8	7.8	7.8	7.8	8.8		8.8	8.8		8.8	11.0
				Bottom	5	28.4	28.4	7.9	7.9	17.3	17.2	104.0	103.5	7.4	7.4	7.4	7.4	7.4	7.4	8.9	8.8	13.2	13.8	13.5
						28.4	28.4	7.9	7.9	17.1	17.2	103.0	103.0	7.3	7.4	7.4	7.4	7.4	7.4	8.6	8.8	13.8	13.8	13.5
23-Sep-15	Fine	Moderate	16:22	Surface	1	28.1	28.1	8.1	8.1	12.1	12.2	87.8	87.7	6.4	6.4	5.9	7.8	7.5	8.5	8.4	8.4	7.9		
						28.1	28.1	8.1	8.1	12.3	12.2	87.5	87.5	6.4	6.4		7.1	7.5		8.3	8.4			
				Middle	3.5	26.7	26.8	8.1	8.1	20.2	19.2	73.9	72.8	5.3	5.3	8.7	8.5	8.3		8.5	8.1		7.0	
						26.9	26.8	8.1	8.1	18.2	19.2	71.6	72.8	5.2	5.3	5.2	5.3	8.3	8.5	5.8	7.0			
				Bottom	6	26.8	26.8	8.0	8.0	21.1	21.1	71.7	71.8	5.1	5.1	5.1	5.1	9.8	9.6	10.0	6.7	8.4		
						26.8	26.8	7.9	8.0	21.1	21.1	71.9	71.8	5.1	5.1	5.1	5.1	9.3	9.6	6.7	8.4			
25-Sep-15	Sunny	Moderate	17:28	Surface	1	27.0	27.0	7.7	7.8	15.6	15.6	83.5	83.2	6.1	6.1	5.7	5.2	5.3	6.1	5.2	6.7	6.2		
						26.9	27.0	7.8	7.8	15.6	15.6	82.9	83.2	6.1	6.1		5.3	5.3		5.3	5.3		8.1	6.7
				Middle	3.5	26.8	26.8	7.9	7.9	27.1	27.2	76.8	76.4	5.3	5.3	5.7	5.8	5.9		5.8	5.0		5.3	
						26.7	26.8	7.9	7.9	27.2	27.2	75.9	76.4	5.2	5.3	5.2	5.3	5.9	5.8	5.5	5.3			
				Bottom	6	26.4	26.4	7.8	7.8	29.9	30.0	74.7	74.5	5.1	5.1	5.1	5.1	7.0	7.1	6.6	6.6			
						26.4	26.4	7.8	7.8	30.0	30.0	74.2	74.5	5.1	5.1	5.1	5.1	7.2	7.1	6.5	6.6			
28-Sep-15	Fine	Moderate	19:13	Surface	1	28.0	28.0	7.9	7.9	18.0	18.0	99.5	99.1	7.1	7.1	6.7	5.8	5.8	6.6	13.2	12.9	15.5		
						28.0	28.0	7.9	7.9	17.9	18.0	98.7	99.1	7.0	7.1		5.8	5.8		5.8	5.8		12.5	12.9
				Middle	3.5	27.7	27.7	7.8	7.9	22.4	22.4	88.7	89.1	6.2	6.2	6.1	6.2	6.2		6.2	6.1		6.2	14.4
						27.7	27.7	7.8	7.9	22.4	22.4	89.4	89.1	6.2	6.2	6.2	6.2	6.2	6.2	10.3	12.4			
				Bottom	6	27.0	27.0	7.8	7.8	26.5	26.5	85.6	85.5	5.9	5.9	5.9	5.9	7.8	7.7	27.6	21.3			
						27.0	27.0	7.8	7.8	26.4	26.5	85.4	85.5	5.9	5.9	5.9	5.9	7.6	7.7	14.9	21.3			
30-Sep-15	Sunny	Moderate	08:57	Surface	1	28.1	28.1	7.7	7.7	11.9	12.2	102.4	102.6	7.5	7.5	6.7	4.0	3.8	5.8	13.1	14.8	14.8		
						28.1	28.1	7.7	7.7	12.4	12.2	102.7	102.6	7.5	7.5		3.5	3.8		16.5	14.8			
				Middle	3.5	27.0	27.0	7.8	7.8	26.5	26.7	86.4	86.0	5.9	5.9	3.0	3.1	3.1		3.1	18.0		17.7	
						26.9	27.0	7.8	7.8	26.9	26.7	85.6	86.0	5.9	5.9	5.9	5.9	3.1	3.1	17.3	17.7			
				Bottom	6	26.6	26.6	7.8	7.8	28.1	28.1	73.1	72.1	5.0	5.0	5.0	5.0	10.5	10.5	8.2	11.8			
						26.6	26.6	7.8	7.8	28.1	28.1	71.0	72.1	4.9	5.0	5.0	5.0	10.4	10.5	15.4	11.8			

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
2-Sep-15	Rainy	Moderate	15:22	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	26.4 26.1	26.3	7.9 7.8	7.9	30.2 30.0	30.1	75.7 74.6	75.2	5.2 5.1	5.2	5.2	5.2	2.0 2.1	2.1	2.1	2.1	15.0 12.6	13.8	13.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
4-Sep-15	Sunny	Moderate	17:24	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.9	25.9 25.9	25.9	8.0 8.0	8.0	22.6 22.6	22.6	85.2 83.1	84.2	6.1 5.9	6.0	6.0	8.7 9.1	8.9	8.9	8.9	27.6 27.8	27.7	27.7	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
7-Sep-15	Cloudy	Moderate	08:41	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	27.1 27.2	27.2	8.0 8.0	8.0	24.5 24.6	24.6	94.9 94.4	94.7	6.6 6.5	6.6	6.6	2.6 2.7	2.7	2.7	2.7	13.1 5.9	9.5	9.5	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
9-Sep-15	Sunny	Moderate	10:20	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	28.1 28.1	28.1	7.8 7.9	7.9	19.6 19.7	19.7	71.9 73.8	72.9	5.0 5.2	5.1	5.1	4.9 5.2	5.1	5.1	5.1	11.0 11.2	11.1	11.1	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
11-Sep-15	Sunny	Moderate	12:01	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	27.4 27.4	27.4	8.0 8.0	8.0	21.1 21.3	21.2	87.5 86.9	87.2	6.2 6.1	6.2	6.2	5.2 4.9	5.1	5.1	5.1	11.1 11.9	11.5	11.5	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
14-Sep-15	Sunny	Moderate	13:25	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.9	26.9 26.9	26.9	8.0 8.0	8.0	20.1 20.1	20.1	90.9 90.4	90.7	6.5 6.5	6.5	6.5	7.6 7.6	7.6	7.6	7.6	7.6	6.4 6.4	7.0	7.0
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
16-Sep-15	Fine	Moderate	14:39	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	27.1 27.3	27.2	7.7 7.7	7.7	20.1 20.1	20.1	90.5 92.9	91.7	6.4 6.6	6.5	6.5	3.6 3.5	3.6	3.6	3.6	5.6 5.3	5.5	5.5	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
18-Sep-15	Fine	Moderate	14:21	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	28.0 28.0	28.0	7.8 7.9	7.9	18.4 18.4	18.4	108.9 106.4	107.7	7.7 7.5	7.6	7.6	5.6 5.7	5.7	5.7	5.7	6.9 6.4	6.7	6.7	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
21-Sep-15	Rainy	Moderate	18:23	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	28.5 28.5	28.5	7.9 7.9	7.9	13.2 13.2	13.2	99.9 100.1	100.0	7.2 7.2	7.2	7.2	7.2	3.3 3.3	3.3	3.3	5.9 6.0	6.0	6.0	6.0
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
23-Sep-15	Fine	Moderate	07:58	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	26.9 26.9	26.9	7.7 7.7	7.7	16.8 17.0	16.9	87.9 91.6	89.8	6.2 6.5	6.4	6.4	6.4	7.8 7.7	7.8	7.8	10.5 7.0	8.8	8.8	8.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
25-Sep-15	Sunny	Moderate	10:10	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	27.3 26.9	27.1	7.9 7.9	7.9	16.7 16.6	16.7	83.4 83.5	83.5	6.0 6.1	6.1	6.1	6.1	5.4 5.4	5.4	5.4	6.0 5.5	5.8	5.8	5.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
28-Sep-15	Sunny	Moderate	12:40	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	27.9 27.9	27.9	7.8 7.8	7.8	18.9 18.4	18.7	99.2 98.7	99.0	7.0 7.0	7.0	7.0	7.0	5.9 5.9	5.9	5.9	15.7 8.9	12.3	12.3	12.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
30-Sep-15	Sunny	Moderate	15:06	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	27.8 27.8	27.8	7.7 7.7	7.7	18.2 18.2	18.2	107.2 104.8	106.0	7.6 7.4	7.5	7.5	7.5	5.5 5.6	5.6	5.6	12.1 7.7	9.9	9.9	9.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
2-Sep-15	Rainy	Moderate	09:28	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
				Middle	1.1	27.0 27.3	27.2	7.9 7.9	7.9	17.5 17.4	17.5	72.7 73.3	73.0	5.3 5.3	5.3	5.3	5.3	5.3	2.5 2.6	2.6	2.6	2.6	15.8 14.6	15.2	15.2
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
4-Sep-15	Sunny	Moderate	11:21	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	26.1 26.1	26.1	8.0 8.0	8.0	22.5 22.6	22.6	85.1 85.1	85.1	6.1 6.1	6.1	6.1	6.1	6.4 6.6	6.5	6.5	6.5	11.3 12.6	12.0	12.0	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
7-Sep-15	Cloudy	Moderate	16:09	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	26.4 26.1	26.3	8.0 8.0	8.0	30.2 30.0	30.1	90.5 89.4	90.0	6.2 6.1	6.2	6.2	6.2	2.0 2.5	2.3	2.3	2.3	5.1 5.5	5.3	5.3	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
9-Sep-15	Sunny	Moderate	16:32	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	29.6 29.5	29.6	7.8 7.8	7.8	21.9 22.0	22.0	83.7 83.9	83.8	5.7 5.7	5.7	5.7	5.7	4.8 4.9	4.9	4.9	4.9	7.0 5.3	6.2	6.2	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
11-Sep-15	Sunny	Moderate	18:42	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	26.5 26.6	26.6	7.5 7.6	7.6	26.2 26.3	26.3	85.6 85.1	85.4	5.9 5.9	5.9	5.9	5.9	3.6 3.7	3.7	3.7	3.7	11.0 13.6	12.3	12.3	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
14-Sep-15	Fine	Moderate	19:40	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	26.8 26.8	26.8	8.0 8.0	8.0	19.9 19.9	19.9	86.5 85.8	86.2	6.2 6.1	6.2	6.2	6.2	6.4 6.4	6.4	6.4	6.4	12.1 8.8	10.5	10.5	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
16-Sep-15	Fine	Moderate	09:31	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	27.2 27.1	27.2	7.8 7.8	7.8	20.4 20.4	20.4	87.6 87.2	87.4	6.2 6.2	6.2	6.2	6.2	7.3 7.2	7.3	7.3	7.3	15.4 11.7	13.6	13.6	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
18-Sep-15	Fine	Moderate	09:58	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	27.9 27.9	27.9	7.8 7.8	7.8	14.9 15.0	15.0	89.4 89.5	89.5	6.5 6.5	6.5	6.5	6.5	6.0 5.9	6.0	6.0	6.0	7.1 5.6	6.4	6.4	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged
 **Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
21-Sep-15	Rainy	Moderate	13:14	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	28.3 28.2	28.3	7.8 7.8	7.8	13.7 13.7	13.7	107.4 107.6	107.5	7.8 7.8	7.8	7.8	7.8	4.2 3.9	4.1	4.1	4.6 4.7	4.7	4.7	4.7
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
23-Sep-15	Fine	Moderate	15:39	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	26.8 26.9	26.9	7.7 7.8	7.8	16.8 16.9	16.9	83.4 82.2	82.8	5.9 5.8	5.9	5.9	5.9	6.4 6.2	6.3	6.3	6.0 6.0	6.0	6.0	6.0
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
25-Sep-15	Sunny	Moderate	17:06	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	27.1 27.1	27.1	7.8 7.8	7.8	16.3 16.3	16.3	80.9 79.5	80.2	5.9 5.8	5.9	5.9	5.9	5.6 5.6	5.6	5.6	4.6 4.7	4.7	4.7	4.7
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
28-Sep-15	Fine	Moderate	18:46	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	27.9 27.9	27.9	7.8 7.8	7.8	18.8 17.9	18.4	96.9 97.3	97.1	6.9 6.9	6.9	6.9	6.9	5.2 5.2	5.2	5.2	13.3 12.0	12.7	12.7	12.7
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
30-Sep-15	Sunny	Moderate	09:06	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	27.6 27.6	27.6	7.6 7.6	7.6	14.7 14.8	14.8	88.0 88.2	88.1	6.4 6.4	6.4	6.4	6.4	5.8 5.8	5.8	5.8	20.4 13.4	16.9	16.9	16.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
2-Sep-15	Rainy	Moderate	14:40	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.7	25.7	25.7	7.9	7.9	30.1	30.1	78.0	77.7	5.4	5.4	5.4	5.4	5.4	4.5	4.5	4.5	13.6	12.2	12.2
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
4-Sep-15	Sunny	Moderate	16:30	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	26.1	26.2	7.9	7.9	21.1	21.2	87.4	88.0	6.3	6.3	6.3	6.3	6.3	6.1	6.4	6.3	12.6	12.3	12.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
7-Sep-15	Cloudy	Moderate	07:55	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.7	26.0	26.2	8.0	8.0	24.5	24.4	84.0	84.0	5.9	5.9	5.9	5.9	5.9	6.1	6.2	6.2	5.0	5.1	5.1
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
9-Sep-15	Sunny	Moderate	09:30	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.9	28.0	28.0	7.8	7.8	22.1	22.0	74.7	70.9	5.2	5.2	5.2	5.2	5.2	11.7	11.5	11.6	8.9	9.3	9.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
11-Sep-15	Sunny	Moderate	11:15	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.6	27.5	27.4	8.0	8.0	21.1	21.2	84.7	84.0	6.0	6.0	6.0	6.0	6.0	5.3	5.1	5.2	10.0	10.6	10.6
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
14-Sep-15	Sunny	Moderate	12:36	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	26.5	26.4	8.0	7.9	19.4	19.4	89.7	89.2	6.5	6.5	6.5	6.5	6.5	4.8	4.7	4.8	8.2	7.8	7.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
16-Sep-15	Fine	Moderate	13:57	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.7	27.4	27.3	7.7	7.7	21.1	21.1	91.4	93.4	6.4	6.5	6.5	6.5	6.5	3.5	3.6	3.6	10.0	10.9	10.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
18-Sep-15	Fine	Moderate	15:19	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	27.1	27.0	7.8	7.8	19.5	18.7	95.7	94.1	6.8	6.8	6.8	6.8	6.8	11.2	11.7	11.5	8.5	7.0	7.0
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
21-Sep-15	Rainy	Moderate	17:41	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.7	28.5	28.5	8.0	8.0	13.2	13.2	99.9	100.0	7.2	7.2	7.2	7.2	7.2	3.5	3.5	3.5	6.1	5.9	5.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
23-Sep-15	Fine	Moderate	07:39	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	26.6	26.7	7.8	7.8	19.3	19.2	86.6	85.4	6.1	6.0	6.0	6.0	6.0	10.2	10.3	10.3	8.2	7.4	7.4
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
25-Sep-15	Sunny	Moderate	09:25	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.7	27.1	27.1	7.9	7.9	16.7	16.7	83.0	83.8	6.0	6.1	6.1	6.1	6.1	5.3	5.5	5.5	7.7	7.1	7.1
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
28-Sep-15	Sunny	Moderate	11:55	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.7	27.7	27.8	7.8	7.8	19.0	18.8	98.9	98.7	7.0	7.0	7.0	7.0	7.0	5.8	5.9	5.9	13.2	13.9	13.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
30-Sep-15	Sunny	Moderate	14:24	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	26.8	26.8	7.7	7.7	19.3	18.9	94.2	92.6	6.8	6.8	6.8	6.8	6.8	11.1	11.4	11.4	11.9	13.0	13.0
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
2-Sep-15	Rainy	Moderate	08:42	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
				Middle	0.7	26.0 26.2	26.1	7.9 7.9	7.9	17.5 17.4	17.5	75.4 75.3	75.4	5.5 5.5	5.5	5.5	5.5	5.5	5.5	6.2 6.1	6.2	6.2	8.8 15.2	12.0	12.0
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
4-Sep-15	Sunny	Moderate	10:33	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
				Middle	1	25.8 25.9	25.9	7.9 7.9	7.9	20.8 20.5	20.7	84.1 83.6	83.9	6.1 6.1	6.1	6.1	6.1	6.1	6.1	6.4 6.4	6.4	6.4	11.6 10.9	11.3	11.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
7-Sep-15	Cloudy	Moderate	15:26	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
				Middle	0.7	25.7 25.7	25.7	8.0 8.0	8.0	30.0 30.1	30.1	83.7 83.5	83.6	5.8 5.8	5.8	5.8	5.8	5.8	5.8	4.0 4.9	4.5	4.5	4.0 4.2	4.1	4.1
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
9-Sep-15	Sunny	Moderate	17:30	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
				Middle	1.1	28.6 28.6	28.6	7.8 7.8	7.8	25.9 25.1	25.5	82.8 81.0	81.9	5.6 5.5	5.6	5.6	5.6	5.6	11.5 12.0	11.8	11.8	6.5 8.1	7.3	7.3	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
11-Sep-15	Sunny	Moderate	17:59	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
				Middle	0.7	26.7 26.5	26.6	7.5 7.6	7.6	26.2 26.3	26.3	80.1 79.1	79.6	5.5 5.5	5.5	5.5	5.5	5.5	3.9 3.7	3.8	3.8	7.4 5.6	6.5	6.5	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
14-Sep-15	Fine	Moderate	18:46	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
				Middle	1	26.9 26.9	26.9	8.0 8.0	8.0	19.7 19.8	19.8	94.0 93.9	94.0	6.7 6.7	6.7	6.7	6.7	6.7	6.2 6.5	6.4	6.4	9.9 7.5	8.7	8.7	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
16-Sep-15	Fine	Moderate	08:45	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
				Middle	0.7	27.0 26.9	27.0	7.8 7.8	7.8	20.5 20.4	20.5	87.3 86.9	87.1	6.2 6.2	6.2	6.2	6.2	6.2	7.2 7.2	7.2	7.2	13.5 12.8	13.2	13.2	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
18-Sep-15	Fine	Moderate	09:10	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
				Middle	0.8	28.0 28.1	28.1	7.8 7.8	7.8	17.9 17.8	17.9	114.3 116.3	115.3	8.1 8.2	8.2	8.2	8.2	8.2	10.3 10.1	10.2	10.2	9.5 6.9	8.2	8.2	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
21-Sep-15	Rainy	Moderate	12:28	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.7	28.2 28.3	28.3	7.8 7.8	7.8	13.6 13.7	13.7	107.4 107.6	107.5	7.8 7.8	7.8	7.8	7.8	4.3 4.1	4.2	4.2	4.2	4.3 3.7	4.0	4.0
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
23-Sep-15	Fine	Moderate	15:23	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	26.9 26.8	26.9	7.8 7.8	7.8	19.0 18.8	18.9	93.4 93.9	93.7	6.6 6.6	6.6	6.6	6.6	9.6 8.7	9.2	9.2	9.2	5.2 7.0	6.1	6.1
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
25-Sep-15	Sunny	Moderate	16:23	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.7	27.0 27.2	27.1	7.8 7.8	7.8	16.3 16.2	16.3	80.8 79.7	80.3	5.9 5.8	5.9	5.9	5.9	5.5 5.5	5.5	5.5	5.5	5.5 4.1	4.8	4.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
28-Sep-15	Fine	Moderate	18:03	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.7	28.0 28.1	28.1	7.8 7.8	7.8	18.8 18.1	18.5	97.2 97.8	97.5	6.9 6.9	6.9	6.9	6.9	5.2 5.0	5.1	5.1	5.1	7.8 11.0	9.4	9.4
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
30-Sep-15	Sunny	Moderate	08:20	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.8	27.9 27.9	27.9	7.6 7.6	7.6	17.8 17.7	17.8	113.4 115.4	114.4	8.1 8.2	8.2	8.2	8.2	10.2 10.0	10.1	10.1	10.1	23.4 19.6	21.5	21.5
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
2-Sep-15	Rainy	Moderate	14:23	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.9	26.9 27.4	27.2	7.9 7.9	7.9	30.3 30.0	30.2	98.3 98.6	98.5	6.6 6.6	6.6	6.6	6.6	6.6	3.9 3.7	3.8	3.8	14.6 12.0	13.3	13.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
4-Sep-15	Sunny	Moderate	16:05	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	26.6 26.6	26.6	7.9 7.9	7.9	20.9 20.9	20.9	91.9 89.6	90.8	6.6 6.4	6.5	6.5	6.5	4.4 4.7	4.6	4.6	4.6	19.2 15.2	17.2	17.2
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
7-Sep-15	Cloudy	Moderate	07:35	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.8	26.8 26.9	26.9	8.0 8.0	8.0	24.5 24.5	24.5	88.9 89.9	89.4	6.2 6.3	6.3	6.3	6.3	5.6 4.8	5.2	5.2	5.2	6.8 5.9	6.4	6.4
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
9-Sep-15	Sunny	Moderate	09:11	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	28.2 28.2	28.2	7.8 7.9	7.9	22.8 22.7	22.8	86.2 86.1	86.2	5.9 5.9	5.9	5.9	5.9	8.2 8.3	8.3	8.3	8.3	11.7 8.2	10.0	10.0
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
11-Sep-15	Sunny	Moderate	10:55	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.8	27.5 27.3	27.4	8.0 8.0	8.0	21.1 21.3	21.2	84.8 83.9	84.4	6.0 5.9	6.0	6.0	6.0	5.0 5.1	5.1	5.1	5.1	7.7 12.1	9.9	9.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
14-Sep-15	Sunny	Moderate	12:10	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	26.9 26.9	26.9	7.9 7.9	7.9	19.0 19.1	19.1	94.9 95.1	95.0	6.8 6.8	6.8	6.8	6.8	5.8 5.8	5.8	5.8	5.8	6.7 7.0	6.9	6.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
16-Sep-15	Fine	Moderate	13:40	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.8	27.2 27.3	27.3	7.7 7.7	7.7	21.9 21.1	21.5	91.5 93.4	92.5	6.4 6.6	6.5	6.5	6.5	3.5 3.6	3.6	3.6	3.6	12.2 12.3	12.3	12.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
18-Sep-15	Fine	Moderate	15:37	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.8	28.0 28.0	28.0	8.0 8.0	8.0	15.5 15.5	15.5	105.0 103.0	104.0	7.5 7.4	7.5	7.5	7.5	5.3 5.6	5.5	5.5	5.5	7.2 6.2	6.7	6.7
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
21-Sep-15	Rainy	Moderate	17:24	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.8	28.5 28.5	28.5	8.0 7.9	8.0	13.2 13.2	13.2	99.9 100.1	100.0	7.2 7.2	7.2	7.2	7.2	7.2	3.5 3.3	3.4	3.4	6.0 5.9	6.0	6.0
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
23-Sep-15	Fine	Moderate	07:20	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.9	27.1 27.2	27.2	7.9 7.9	7.9	17.5 17.3	17.4	95.2 94.2	94.7	6.8 6.7	6.8	6.8	6.8	5.8 5.7	5.8	5.8	15.0 14.4	14.7	14.7	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
25-Sep-15	Sunny	Moderate	09:05	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.8	27.1 26.7	26.9	7.9 7.9	7.9	16.5 16.6	16.6	83.0 83.2	83.1	6.0 6.1	6.1	6.1	6.1	5.5 5.3	5.4	5.4	7.0 4.1	5.6	5.6	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
28-Sep-15	Sunny	Moderate	11:35	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.9	28.0 27.9	28.0	7.8 7.8	7.8	18.8 18.5	18.7	99.3 98.8	99.1	7.0 7.0	7.0	7.0	7.0	5.9 5.9	5.9	5.9	18.0 12.2	15.1	15.1	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
30-Sep-15	Sunny	Moderate	14:07	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.8	27.7 27.7	27.7	7.9 7.9	7.9	15.3 15.4	15.4	103.3 101.5	102.4	7.5 7.3	7.4	7.4	7.4	5.2 5.5	5.4	5.4	14.0 17.5	15.8	15.8	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
2-Sep-15	Rainy	Moderate	08:22	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	0.8	26.8 26.8	26.8	7.9 8.0	8.0	17.3 17.4	17.4	88.6 89.7	89.2	6.4 6.5	6.5	6.5	5.6 4.9	5.3	5.3	11.8 12.4	12.1	12.1	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
4-Sep-15	Sunny	Moderate	10:07	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	26.3 26.5	26.4	7.8 7.8	7.8	19.4 19.7	19.6	93.0 94.1	93.6	6.7 6.8	6.8	6.8	4.0 4.1	4.1	4.1	17.7 12.2	15.0	15.0	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
7-Sep-15	Cloudy	Moderate	15:09	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.9	26.9 27.4	27.2	8.0 8.0	8.0	30.3 30.1	30.2	94.7 95.1	94.9	6.4 6.4	6.4	6.4	3.7 3.9	3.8	3.8	4.3 3.8	4.1	4.1	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
9-Sep-15	Sunny	Moderate	17:48	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.8	29.6 29.6	29.6	8.1 8.1	8.1	24.8 24.8	24.8	90.3 89.4	89.9	6.0 5.9	6.0	6.0	7.0 8.5	7.8	7.8	8.1 7.3	7.7	7.7	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
11-Sep-15	Sunny	Moderate	17:42	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.8	26.5 26.7	26.6	7.5 7.6	7.6	26.2 26.2	26.2	79.8 79.4	79.6	5.5 5.5	5.5	5.5	3.6 3.7	3.7	3.7	4.9 6.6	5.8	5.8	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
14-Sep-15	Fine	Moderate	18:20	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	26.7 26.8	26.8	7.8 7.8	7.8	19.5 19.5	19.5	91.5 91.1	91.3	6.6 6.5	6.6	6.6	5.4 5.6	5.5	5.5	16.9 12.1	14.5	14.5	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
16-Sep-15	Fine	Moderate	08:25	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.8	27.1 27.0	27.1	7.8 7.8	7.8	20.3 20.4	20.4	87.4 87.1	87.3	6.2 6.2	6.2	6.2	7.2 7.2	7.2	7.2	14.1 13.9	14.0	14.0	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
18-Sep-15	Fine	Moderate	08:54	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	27.8 27.8	27.8	7.9 7.9	7.9	17.2 17.2	17.2	84.5 83.3	83.9	6.0 5.9	6.0	6.0	7.5 7.6	7.6	7.6	7.8 7.5	7.7	7.7	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
21-Sep-15	Rainy	Moderate	12:08	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	0.8	28.2 28.3	28.3	7.8 7.8	7.8	13.7 13.7	13.7	107.4 107.6	107.5	7.8 7.8	7.8	7.8	7.8	4.0 4.3	4.2	4.2	6.9 4.8	5.9	5.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
23-Sep-15	Fine	Moderate	15:02	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1	27.1 27.2	27.2	7.9 7.8	7.9	17.9 17.9	17.9	88.4 91.6	90.0	6.3 6.5	6.4	6.4	6.7 7.0	6.9	6.9	7.1 6.5	6.8	6.8	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
25-Sep-15	Sunny	Moderate	16:06	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	0.8	27.3 27.1	27.2	7.8 7.8	7.8	16.3 16.2	16.3	81.3 79.6	80.5	5.9 5.8	5.9	5.9	5.6 5.5	5.6	5.6	3.5 5.9	4.7	4.7	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
28-Sep-15	Fine	Moderate	17:46	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	0.9	27.8 28.0	27.9	7.8 7.8	7.8	19.0 18.0	18.5	96.9 97.5	97.2	6.9 6.9	6.9	6.9	5.2 5.1	5.2	5.2	12.4 13.1	12.8	12.8	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
30-Sep-15	Sunny	Moderate	08:01	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.1	27.7 27.7	27.7	7.7 7.8	7.8	17.1 17.1	17.1	83.9 82.6	83.3	6.0 5.9	6.0	6.0	7.5 7.6	7.6	7.6	17.8 20.7	19.3	19.3	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR6 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
2-Sep-15	Rainy	Moderate	14:41	Surface	1	26.2 26.1	26.2	7.9 7.9	7.9	19.1 19.1	19.1	101.4 101.5	101.5	7.4 7.4	7.4	7.4	2.5 2.6	2.6	3.8	32.0 26.6	29.3	29.8			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.2	24.5 24.5	24.5	7.9 7.9	7.9	21.9 21.9	21.9	77.9 77.5	77.7	5.7 5.7	5.7		5.7	4.8 4.9		4.9	5.7		4.8 4.9	4.9	31.0 29.6
4-Sep-15	Sunny	Moderate	16:12	Surface	1	27.2 27.1	27.2	8.0 8.1	8.1	23.7 23.8	23.8	97.5 96.1	96.8	6.8 6.7	6.8	6.8	3.1 3.0	3.1	3.1	8.9 11.0	10.0	10.5			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.1	26.2 26.4	26.3	8.2 8.1	8.2	29.5 29.6	29.6	96.9 96.2	96.6	6.6 6.6	6.6		6.6	3.1 3.0		3.1	6.6		3.1 3.0	3.1	10.3 11.5
7-Sep-15	Cloudy	Moderate	07:43	Surface	1	26.5 26.5	26.5	8.0 8.0	8.0	24.3 24.3	24.3	91.1 91.1	91.1	6.4 6.4	6.4	6.4	3.4 3.5	3.5	5.6	4.5 4.3	4.4	6.0			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.7	26.5 26.5	26.5	8.1 8.1	8.1	30.4 30.4	30.4	91.0 90.8	90.9	6.2 6.2	6.2		6.2	7.9 7.5		7.7	6.2		7.9 7.5	7.7	4.1 11.0
9-Sep-15	Sunny	Moderate	09:38	Surface	1	28.9 28.8	28.9	7.8 7.8	7.8	22.7 23.1	22.9	76.8 76.4	76.6	5.2 5.2	5.2	5.2	3.9 4.2	4.1	8.3	8.6 8.8	8.7	9.7			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.3	26.8 26.8	26.8	7.8 7.8	7.8	29.2 29.3	29.3	76.8 75.6	76.2	5.2 5.1	5.2		5.2	11.6 13.3		12.5	5.2		11.6 13.3	12.5	9.9 11.3
11-Sep-15	Sunny	Moderate	11:02	Surface	1	27.4 27.4	27.4	8.0 8.0	8.0	21.0 21.2	21.1	78.7 78.1	78.4	5.5 5.5	5.5	5.5	5.1 4.9	5.0	5.9	8.2 6.5	7.4	7.4			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4	26.1 26.0	26.1	7.9 7.9	7.9	30.6 30.7	30.7	89.1 90.6	89.9	6.1 6.2	6.2		6.2	6.6 6.8		6.7	6.2		6.6 6.8	6.7	5.1 9.7
14-Sep-15	Sunny	Moderate	12:37	Surface	1	26.9 26.9	26.9	7.9 7.9	7.9	19.2 19.2	19.2	99.9 99.5	99.7	7.2 7.1	7.2	7.2	6.0 5.5	5.8	5.7	11.8 9.5	10.7	10.5			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.1	27.0 27.0	27.0	8.0 8.0	8.0	22.2 22.2	22.2	80.3 80.4	80.4	5.7 5.7	5.7		5.7	5.5 5.6		5.6	5.7		5.5 5.6	5.6	8.8 11.5
16-Sep-15	Fine	Moderate	13:52	Surface	1	27.2 27.2	27.2	7.7 7.7	7.7	21.0 21.0	21.0	87.7 87.4	87.6	6.2 6.2	6.2	6.2	3.6 3.6	3.6	5.2	13.0 17.3	15.2	13.8			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.4	25.9 25.9	25.9	7.9 7.9	7.9	27.5 27.5	27.5	83.1 83.1	83.1	5.8 5.8	5.8		5.8	6.9 6.6		6.8	5.8		6.9 6.6	6.8	14.6 9.9
18-Sep-15	Fine	Moderate	14:43	Surface	1	28.0 28.0	28.0	8.0 8.1	8.1	15.5 15.5	15.5	103.5 101.4	102.5	7.4 7.3	7.4	7.4	5.2 5.4	5.3	5.5	9.3 6.2	7.8	7.8			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.4	28.0 28.2	28.1	7.8 7.8	7.8	18.4 18.4	18.4	107.3 105.1	106.2	7.6 7.4	7.5		7.5	5.5 5.6		5.6	7.5		5.5 5.6	5.6	7.4 8.0

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR6 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
21-Sep-15	Rainy	Moderate	17:35	Surface	1	28.5 28.5	28.5	8.0 8.0	8.0	13.2 13.2	13.2	107.8 108.0	107.9	7.8 7.8	7.8	7.8	3.5 3.4	3.5	4.2	5.1 5.1	5.1	5.6			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.4	28.1 28.1	28.1	8.0 8.0	8.0	23.2 23.4	23.3	93.0 91.9	92.5	6.4 6.3	6.4		6.4	4.9 4.8		4.9	6.0 5.9		6.0		
23-Sep-15	Fine	Moderate	07:32	Surface	1	28.2 28.1	28.2	7.9 7.9	7.9	14.0 14.2	14.1	101.8 102.1	102.0	7.4 7.4	7.4	7.4	7.4 7.2	7.3	6.0	5.9 7.9	6.9	7.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4	25.2 25.2	25.2	7.8 7.8	7.8	31.4 31.4	31.4	79.3 77.5	78.4	5.5 5.3	5.4		5.4	4.6 4.6		4.6	7.3 7.4		7.4		
25-Sep-15	Sunny	Moderate	09:17	Surface	1	27.0 26.9	27.0	7.9 7.9	7.9	16.7 16.6	16.7	82.6 81.1	81.9	6.0 5.9	6.0	6.0	5.4 5.4	5.4	5.3	4.3 6.3	5.3	5.6			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	3.6	26.7 26.7	26.7	7.7 7.7	7.7	27.5 27.4	27.5	78.2 78.3	78.3	5.4 5.4	5.4		5.4	5.2 5.1		5.2	5.2 6.5		5.9		
28-Sep-15	Sunny	Moderate	11:50	Surface	1	27.9 27.9	27.9	7.8 7.8	7.8	18.9 18.5	18.7	96.6 97.3	97.0	6.8 6.9	6.9	6.9	5.8 5.9	5.9	6.7	16.9 9.3	13.1	13.5			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.1	27.6 27.6	27.6	7.9 7.9	7.9	23.2 23.3	23.3	90.5 91.2	90.9	6.3 6.3	6.3		6.3	7.5 7.5		7.5	13.4 14.2		13.8		
30-Sep-15	Sunny	Moderate	13:45	Surface	1	27.3 27.3	27.3	7.6 7.6	7.6	17.5 17.5	17.5	93.6 94.2	93.9	6.7 6.8	6.8	6.8	6.6 7.0	6.8	7.6	17.9 15.1	16.5	15.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.1	26.3 26.3	26.3	7.6 7.6	7.6	22.8 22.8	22.8	86.1 85.4	85.8	6.1 6.1	6.1		6.1	8.6 8.2		8.4	15.3 12.2		13.8		

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR6 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
2-Sep-15	Rainy	Moderate	08:32	Surface	1	26.1 26.1	26.1	8.0 8.0	8.0	21.3 21.3	21.3	93.1 93.3	93.2	6.7 6.7	6.7	6.7	3.8 4.1	4.0	5.0	37.0 47.5	42.3	44.8			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.1	24.7 24.7	24.7	7.8 7.8	7.8	24.7 24.7	24.7	83.6 84.0	83.8	6.0 6.1	6.1		6.1	6.1		6.1	6.1		6.0	46.5 47.8	47.2
4-Sep-15	Sunny	Moderate	10:30	Surface	1	26.4 26.5	26.5	8.0 8.1	8.1	24.4 24.2	24.3	91.0 91.1	91.1	6.4 6.4	6.4	6.4	3.4 3.6	3.5	5.6	6.5 6.3	6.4	7.3			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.7	26.6 26.6	26.6	8.1 8.1	8.1	30.7 30.2	30.5	91.1 90.8	91.0	6.2 6.2	6.2		6.2	6.2		6.2	7.9 7.5		7.7	7.6 8.5	8.1
7-Sep-15	Cloudy	Moderate	15:22	Surface	1	27.0 27.0	27.0	8.0 8.0	8.0	23.8 23.8	23.8	97.3 95.9	96.6	6.8 6.7	6.8	6.8	3.0 2.9	3.0	3.1	6.3 4.8	5.6	6.0			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.1	26.4 26.4	26.4	8.1 8.1	8.1	29.5 29.6	29.6	97.2 96.1	96.7	6.6 6.6	6.6		6.6	6.6		3.2 3.1	3.2		6.6 6.0	6.3	
9-Sep-15	Sunny	Moderate	17:29	Surface	1	29.1 29.1	29.1	7.8 7.8	7.8	22.1 22.1	22.1	80.8 80.8	80.8	5.5 5.5	5.5	5.5	3.6 3.7	3.7	4.4	5.4 5.5	5.5	5.8			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.2	27.5 27.4	27.5	7.9 7.8	7.9	26.2 26.5	26.4	74.4 74.5	74.5	5.1 5.1	5.1		5.1	5.1		5.0 5.0	5.0		5.6 6.3	6.0	
11-Sep-15	Sunny	Moderate	18:01	Surface	1	26.6 26.6	26.6	7.8 7.8	7.8	26.3 26.2	26.3	85.9 85.1	85.5	6.0 5.9	6.0	6.0	7.5 7.6	7.6	8.0	8.7 5.4	7.1	7.4			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.3	26.0 26.0	26.0	7.8 7.8	7.8	28.5 28.4	28.5	83.0 81.9	82.5	5.7 5.7	5.7		5.7	5.7		8.5 8.3	8.4		7.8 7.5	7.7	
14-Sep-15	Fine	Moderate	18:46	Surface	1	26.9 26.9	26.9	7.9 7.9	7.9	20.7 20.7	20.7	91.0 90.9	91.0	6.5 6.5	6.5	6.5	4.8 5.5	5.2	7.1	8.5 9.2	8.9	10.1			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.2	26.9 26.9	26.9	7.9 7.9	7.9	21.5 21.5	21.5	85.2 85.0	85.1	6.0 6.0	6.0		6.0	6.0		8.6 9.1	8.9		12.1 10.5	11.3	
16-Sep-15	Fine	Moderate	08:40	Surface	1	27.1 27.0	27.1	7.8 7.8	7.8	20.4 20.5	20.5	90.2 92.4	91.3	6.4 6.6	6.5	6.5	7.1 7.2	7.2	7.6	15.5 13.1	14.3	13.3			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.2	26.6 26.6	26.6	7.8 7.8	7.8	24.0 24.0	24.0	93.1 92.9	93.0	6.5 6.5	6.5		6.5	6.5		7.8 7.9	7.9		15.5 8.8	12.2	
18-Sep-15	Fine	Moderate	09:20	Surface	1	27.9 28.0	28.0	7.8 7.8	7.8	14.9 15.0	15.0	88.0 88.3	88.2	6.4 6.4	6.4	6.4	6.1 6.2	6.2	7.0	9.8 9.1	9.5	9.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.3	27.8 27.9	27.9	7.9 7.9	7.9	17.3 17.2	17.3	83.2 82.1	82.7	5.9 5.9	5.9		5.9	5.9		7.7 7.7	7.7		9.6 7.9	8.8	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR6 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Sep-15	Rainy	Moderate	12:22	Surface	1	28.3	28.3	7.8	7.8	13.7	13.7	100.3	100.4	7.2	7.3	7.3	4.3	4.2	4.9	8.6	8.2	7.4
						28.3		7.8		13.7		100.5		7.3			4.0			7.7		
				Middle	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-	
				Bottom	4.3	28.4	28.4	7.8	7.8	17.3	17.3	98.3	98.2	7.0	7.0	7.0	5.4	5.6		6.4	6.5	
						28.4		7.8		17.3		98.0		6.9		7.0	5.7		6.6			
23-Sep-15	Fine	Moderate	15:11	Surface	1	27.6	27.6	8.0	8.0	14.9	14.9	99.2	99.3	7.2	7.2	7.2	5.8	5.8	7.2	7.0	5.9	5.1
						27.6		8.0		14.9		99.4		7.2			5.8			4.7		
				Middle	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-	
				Bottom	4.2	26.6	26.6	7.9	7.9	20.8	21.7	81.5	81.0	5.8	5.8	5.8	8.6	8.6		5.9	4.3	
						26.5		7.9		22.5		80.4		5.7		5.8	8.6		2.6			
25-Sep-15	Sunny	Moderate	16:10	Surface	1	27.1	27.1	7.8	7.9	16.2	16.2	84.5	84.9	6.1	6.2	6.2	5.6	5.6	5.6	5.4	6.2	5.3
						27.1		7.9		16.2		85.3		6.2			5.5			6.9		
				Middle	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-	
				Bottom	3.3	26.7	26.7	7.8	7.8	28.3	28.4	76.8	76.3	5.3	5.3	5.3	5.5	5.5		5.0	4.3	
						26.7		7.8		28.4		75.7		5.2		5.3	5.4		3.6			
28-Sep-15	Fine	Moderate	17:55	Surface	1	27.9	28.0	7.8	7.9	18.9	18.5	98.7	98.5	7.0	7.0	7.0	5.2	5.2	5.6	10.5	10.5	8.5
						28.0		7.9		18.0		98.3		7.0			5.1			10.4		
				Middle	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-	
				Bottom	4.1	27.6	27.7	7.8	7.8	23.3	23.3	83.5	83.5	5.8	5.8	5.8	6.0	6.0		4.9	6.4	
						27.7		7.8		23.2		83.4		5.8		5.8	5.9		7.9			
30-Sep-15	Sunny	Moderate	08:01	Surface	1	27.9	27.9	7.7	7.7	13.0	12.9	99.0	99.5	7.2	7.3	7.3	2.7	2.6	5.2	20.4	19.9	19.9
						27.9		7.7		12.7		100.0		7.3			2.5			19.4		
				Middle	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-	
				Bottom	4.1	26.6	26.7	7.6	7.6	23.5	23.5	73.2	71.8	5.2	5.1	5.1	7.9	7.8		18.9	19.8	
						26.7		7.6		23.4		70.4		5.0		5.1	7.6		20.7			

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SRA - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Sep-15	Rainy	Moderate	14:30	Surface	1	27.0 26.6	26.8	7.9 7.9	7.9	30.1 30.1	30.1	96.9 96.2	96.6	6.5 6.5	6.5	6.4	3.0 2.9	3.0	6.8	11.2 11.0	11.1	10.2
				Middle	3.5	25.8 25.4	25.6	7.9 7.8	7.9	29.9 30.0	30.0	91.2 90.5	90.9	6.3 6.3	6.3		7.9 7.0	7.5		9.6 9.4	9.5	
				Bottom	6	24.6 24.4	24.5	7.9 7.9	7.9	29.8 29.9	29.9	70.0 69.4	69.7	4.9 4.9	4.9		10.1 9.4	9.8		10.4 9.4	9.9	
4-Sep-15	Sunny	Moderate	16:14	Surface	1	26.8 26.7	26.8	8.0 8.0	8.0	21.6 21.6	21.6	93.2 93.5	93.4	6.6 6.6	6.6	6.5	5.5 5.6	5.6	6.7	18.0 13.4	15.7	12.9
				Middle	3.5	25.0 25.0	25.0	8.1 8.0	8.1	25.2 25.6	25.4	89.2 88.5	88.9	6.4 6.3	6.4		6.5 6.1	6.3		8.9 11.8	10.4	
				Bottom	6	24.6 24.6	24.6	8.1 8.1	8.1	28.3 28.8	28.6	83.6 83.7	83.7	5.9 5.9	5.9		8.2 8.3	8.3		12.4 12.8	12.6	
7-Sep-15	Cloudy	Moderate	07:43	Surface	1	26.6 26.6	26.6	8.0 8.0	8.0	24.3 24.4	24.4	89.8 89.5	89.7	6.3 6.3	6.3	6.2	6.9 7.5	7.2	8.6	5.3 6.3	5.8	4.8
				Middle	3.5	26.8 26.4	26.6	8.1 8.1	8.1	26.6 26.7	26.7	87.4 86.2	86.8	6.0 6.0	6.0		8.1 8.5	8.3		4.8 3.8	4.3	
				Bottom	6	26.1 26.1	26.1	8.1 8.1	8.1	32.0 31.8	31.9	78.1 77.4	77.8	5.3 5.2	5.3		10.5 10.1	10.3		4.8 4.0	4.4	
9-Sep-15	Sunny	Moderate	09:18	Surface	1	28.5 28.5	28.5	7.8 7.8	7.8	22.6 22.6	22.6	83.1 83.6	83.4	5.7 5.7	5.7	5.6	8.2 8.1	8.2	10.3	8.7 7.7	8.2	8.3
				Middle	3.5	28.2 28.1	28.2	7.8 7.8	7.8	23.1 23.1	23.1	78.2 79.6	78.9	5.4 5.5	5.5		10.0 10.1	10.1		7.7 8.2	8.0	
				Bottom	6	27.7 27.7	27.7	7.7 7.7	7.7	24.7 24.6	24.7	73.4 72.3	72.9	5.0 5.2	5.1		12.6 12.6	12.6		8.4 8.9	8.7	
11-Sep-15	Sunny	Moderate	11:03	Surface	1	26.5 26.5	26.5	7.9 7.9	7.9	29.3 28.9	29.1	81.1 81.5	81.3	5.5 5.6	5.6	5.6	7.8 7.3	7.6	7.2	8.2 8.8	8.5	9.4
				Middle	3.5	26.1 26.1	26.1	7.9 7.9	7.9	30.4 30.4	30.4	82.1 81.9	82.0	5.6 5.6	5.6		7.0 6.9	7.0		10.5 12.0	11.3	
				Bottom	6	26.1 26.0	26.1	7.9 7.9	7.9	31.1 31.0	31.1	78.7 78.9	78.8	5.4 5.4	5.4		7.0 7.2	7.1		7.9 9.1	8.5	
14-Sep-15	Sunny	Moderate	12:20	Surface	1	27.0 27.0	27.0	8.0 8.1	8.1	19.3 19.4	19.4	98.2 97.4	97.8	7.0 7.0	7.0	6.4	6.0 6.4	6.2	8.0	9.6 11.2	10.4	8.9
				Middle	3.5	26.4 26.4	26.4	8.0 8.0	8.0	22.7 22.7	22.7	79.3 81.6	80.5	5.6 5.8	5.7		7.9 7.9	7.9		8.0 9.1	8.6	
				Bottom	6	26.0 26.0	26.0	8.1 8.1	8.1	28.7 28.8	28.8	71.0 70.8	70.9	4.9 4.9	4.9		10.0 9.7	9.9		7.1 8.0	7.6	
16-Sep-15	Fine	Moderate	13:46	Surface	1	26.8 26.9	26.9	7.9 7.8	7.9	24.2 24.2	24.2	110.1 111.8	111.0	7.7 7.8	7.8	6.8	6.3 6.6	6.5	7.7	10.1 5.7	7.9	9.1
				Middle	3.5	25.8 26.1	26.0	7.9 7.9	7.9	30.1 30.2	30.2	83.8 82.6	83.2	5.8 5.6	5.7		7.5 7.3	7.4		8.0 8.0	8.0	
				Bottom	6	25.8 25.8	25.8	7.9 7.9	7.9	30.8 30.5	30.7	74.9 73.9	74.4	5.1 5.1	5.1		8.7 9.9	9.3		8.8 13.7	11.3	
18-Sep-15	Fine	Moderate	15:28	Surface	1	27.4 27.5	27.5	7.8 7.8	7.8	17.5 17.5	17.5	93.9 92.5	93.2	6.7 6.6	6.7	6.1	6.7 6.8	6.8	8.9	6.9 6.8	6.9	7.4
				Middle	4	26.6 26.6	26.6	7.8 7.8	7.8	20.6 20.7	20.7	75.7 76.8	76.3	5.4 5.5	5.5		8.6 8.7	8.7		11.6 6.7	9.2	
				Bottom	7	26.1 26.1	26.1	7.8 7.8	7.8	23.0 23.1	23.1	71.4 71.3	71.4	5.1 5.1	5.1		11.2 11.2	11.2		5.9 6.2	6.1	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SRA - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)						
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*				
21-Sep-15	Rainy	Moderate	17:30	Surface	1	28.5	28.4	7.9	7.9	13.4	13.4	105.6	105.6	7.8	7.8	7.1	3.4	3.6	7.4	5.2	5.1	5.4				
						28.3		7.9		13.4		105.5		7.8						3.7				5.0		
				Middle	3.5	27.9	27.9	7.9	8.0	29.2	29.2	90.7	90.7	6.3	6.3			8.5		8.7			5.4	5.4		
				27.9	27.9	8.0	8.0	30.4	30.5	86.4	86.3	5.8	5.8		10.0	9.9		5.3	5.8							
				27.9		8.0		30.5		86.1		5.8				9.8			6.3							
23-Sep-15	Fine	Moderate	07:30	Surface	1	27.0	26.9	7.8	7.8	17.6	17.7	85.9	84.3	6.1	6.0	5.8	7.4	7.5	8.1	7.9	8.0	7.4				
						26.8		7.8		17.7		82.7		5.9							7.5				8.0	
				Middle	3.5	26.5	26.5	7.8	7.8	20.1	20.2	77.4	77.1	5.5	5.5			6.9		7.1			8.1	7.8		
				26.5		7.8		20.2		76.7		5.4				7.2			7.5	7.8						
				26.2	26.2	7.7	7.8	24.4	24.3	75.9	73.8	5.3	5.2		9.6	9.6		6.4	6.5							
				26.1		7.8		24.2		71.7		5.0	5.2		9.5			6.5	6.5							
25-Sep-15	Sunny	Moderate	09:13	Surface	1	26.9	27.0	7.8	7.8	15.2	15.4	83.1	83.6	6.1	6.1	5.7	7.4	7.4	6.5	5.3	5.6	6.4				
						27.0		7.8		15.5		84.1		6.1							7.4				5.9	5.6
				Middle	3.5	26.9	26.8	7.8	7.8	27.1	27.4	75.4	75.0	5.2	5.2			6.2		6.4			5.3	6.3		
				26.7		7.8		27.6		74.5		5.1				6.6			7.3	6.3						
				26.3	26.4	7.9	7.9	31.1	31.2	71.6	71.6	4.9	4.9		5.8	5.8		6.6	7.2							
				26.4		7.9		31.2		71.6		4.8				5.8			7.7							
28-Sep-15	Sunny	Moderate	11:43	Surface	1	27.9	27.9	7.8	7.8	16.6	16.5	99.1	99.2	7.1	7.1	6.6	6.1	6.2	6.6	17.6	16.9	15.3				
						27.8		7.8		16.3		99.3		7.1							6.2				16.1	16.9
				Middle	3.5	27.5	27.6	7.8	7.8	25.4	25.7	86.8	88.3	6.0	6.1			6.8		7.0			12.0	14.6		
				27.6		7.8		25.9		89.7		6.1				7.1			17.1	14.6						
				26.7	26.7	7.8	7.8	30.6	30.5	80.5	80.6	5.4	5.5		6.6	6.6		12.3	14.5							
				26.6		7.8		30.4		80.7		5.5				6.5			16.7							
30-Sep-15	Sunny	Moderate	14:14	Surface	1	27.1	27.2	7.7	7.7	17.3	17.3	92.4	91.7	6.7	6.7	6.0	6.7	6.8	8.8	14.5	13.5	13.6				
						27.2		7.7		17.3		91.0		6.6							6.8				12.5	13.5
				Middle	4	26.3	26.3	7.6	7.6	20.4	20.5	71.6	71.9	5.2	5.2			8.5		8.6			14.6	12.5		
				26.3		7.6		20.5		72.1		5.2				8.6			10.4	12.5						
				25.9	25.9	7.6	7.6	22.8	22.8	69.0	68.8	4.9	4.9		11.1	11.1		14.8	14.9							
				25.9		7.6		22.8		68.5		4.9				11.1			15.0							

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SRA - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Sep-15	Rainy	Moderate	08:30	Surface	1	26.4 26.6	26.5	8.0 7.9	8.0	17.4 17.4	17.4	100.0 99.9	100.0	7.3 7.3	7.3	6.5	6.9 7.4	7.2	8.6	14.2 16.8	15.5	14.8
				Middle	3.5	26.8 26.5	26.7	8.0 7.9	8.0	19.6 19.7	19.7	77.7 76.6	77.2	5.6 5.5	5.6		8.0 8.6	8.3		13.6 13.2	13.4	
				Bottom	6	25.3 26.2	25.8	7.9 7.9	7.9	25.0 24.8	24.9	71.3 73.4	72.4	5.1 5.2	5.2		10.4 10.1	10.3		14.4 16.6	15.5	
4-Sep-15	Sunny	Moderate	10:16	Surface	1	26.4 26.4	26.4	8.0 8.1	8.1	20.7 20.8	20.8	96.3 94.3	95.3	6.9 6.8	6.9	6.7	5.2 5.4	5.3	6.7	11.3 14.5	12.9	12.2
				Middle	4	25.5 25.5	25.5	8.1 8.1	8.1	26.2 26.1	26.2	91.4 90.3	90.9	6.5 6.4	6.5		6.5 6.3	6.4		12.0 9.5	10.8	
				Bottom	7	24.6 24.8	24.7	8.2 8.1	8.2	28.2 28.5	28.4	82.5 79.6	81.1	5.9 5.6	5.8		8.5 8.3	8.4		12.1 13.5	12.8	
7-Sep-15	Cloudy	Moderate	15:16	Surface	1	27.0 26.6	26.8	8.0 8.0	8.0	29.9 30.1	30.0	102.2 101.5	101.9	6.9 6.9	6.9	6.8	2.9 3.0	3.0	6.8	4.6 4.2	4.4	4.9
				Middle	3.5	25.9 25.4	25.7	8.1 8.1	8.1	29.9 29.9	29.9	96.6 95.9	96.3	6.6 6.6	6.6		7.9 7.1	7.5		4.6 5.2	4.9	
				Bottom	6	24.7 24.4	24.6	8.1 8.1	8.1	29.8 29.9	29.9	76.1 75.3	75.7	5.3 5.3	5.3		10.0 9.5	9.8		4.8 6.1	5.5	
9-Sep-15	Sunny	Moderate	17:38	Surface	1	28.9 29.0	29.0	7.8 7.8	7.8	23.9 23.9	23.9	80.2 78.8	79.5	5.4 5.3	5.4	5.4	7.8 8.0	7.9	10.1	7.8 8.2	8.0	6.6
				Middle	4	28.1 28.1	28.1	7.8 7.8	7.8	27.0 27.1	27.1	78.3 77.1	77.7	5.3 5.2	5.3		11.0 11.0	11.0		7.2 6.0	6.6	
				Bottom	7	27.6 27.6	27.6	7.8 7.8	7.8	29.4 29.5	29.5	74.2 74.1	74.2	5.0 5.0	5.0		11.2 11.4	11.3		5.0 5.3	5.2	
11-Sep-15	Sunny	Moderate	17:49	Surface	1	26.6 26.6	26.6	7.8 7.8	7.8	27.4 27.6	27.5	82.6 82.5	82.6	5.7 5.7	5.7	5.7	6.9 7.1	7.0	8.2	7.8 8.0	7.9	7.0
				Middle	3.5	26.6 26.3	26.5	7.7 7.7	7.7	28.7 28.9	28.8	82.0 81.5	81.8	5.6 5.6	5.6		8.7 8.0	8.4		6.6 6.8	6.7	
				Bottom	6	25.8 25.9	25.9	7.6 7.6	7.6	31.4 31.3	31.4	81.4 81.5	81.5	5.6 5.6	5.6		9.1 9.3	9.2		6.4 6.4	6.4	
14-Sep-15	Fine	Moderate	18:29	Surface	1	26.9 27.0	27.0	8.0 7.9	8.0	19.2 19.1	19.2	93.6 94.3	94.0	6.7 6.8	6.8	6.3	6.7 6.6	6.7	7.9	11.4 9.5	10.5	9.9
				Middle	4	26.5 26.5	26.5	8.1 8.0	8.1	22.7 22.9	22.8	82.1 80.8	81.5	5.8 5.7	5.8		7.6 7.3	7.5		11.9 7.5	9.7	
				Bottom	7	26.2 26.2	26.2	8.1 8.1	8.1	28.7 28.8	28.8	74.9 72.8	73.9	5.2 5.0	5.1		9.4 9.7	9.6		8.3 10.4	9.4	
16-Sep-15	Fine	Moderate	08:34	Surface	1	27.5 27.6	27.6	7.8 7.9	7.9	20.8 20.8	20.8	84.4 85.1	84.8	5.9 6.0	6.0	6.1	7.5 7.4	7.5	9.7	20.6 25.0	22.8	16.1
				Middle	3.5	25.1 25.2	25.2	7.9 7.9	7.9	33.4 33.4	33.4	89.7 90.7	90.2	6.1 6.2	6.2		8.5 8.2	8.4		14.6 12.9	13.8	
				Bottom	6	24.6 24.8	24.7	7.9 7.9	7.9	34.9 34.8	34.9	79.3 77.7	78.5	5.4 5.3	5.4		12.8 13.7	13.3		11.5 12.0	11.8	
18-Sep-15	Fine	Moderate	09:00	Surface	1	28.3 28.4	28.4	7.9 7.9	7.9	17.7 17.7	17.7	107.7 105.8	106.8	7.6 7.5	7.6	7.4	6.8 7.0	6.9	10.8	8.3 7.9	8.1	7.2
				Middle	3.5	28.0 28.0	28.0	7.9 7.9	7.9	18.2 18.2	18.2	101.9 100.9	101.4	7.2 7.1	7.2		11.7 11.7	11.7		6.7 6.3	6.5	
				Bottom	6	27.6 27.6	27.6	7.8 7.8	7.8	19.7 19.6	19.7	81.6 78.8	80.2	5.8 5.6	5.7		13.9 13.7	13.8		7.7 6.1	6.9	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SRA - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Sep-15	Rainy	Moderate	12:16	Surface	1	28.0 27.9	28.0	7.8 7.8	7.8	11.4 11.5	11.5	109.4 109.1	109.3	7.9 7.9	7.9	7.2	4.3 4.2	4.3	8.9	4.1 4.7	4.4	4.8
				Middle	3.5	28.1 28.1	28.1	7.9 7.9	7.9	20.6 20.6	20.6	93.8 93.4	93.6	6.5 6.5	6.5		6.6 6.8	6.7		5.5 4.7	5.1	
				Bottom	6	28.0 27.9	28.0	7.9 7.9	7.9	28.3 28.2	28.3	86.5 86.1	86.3	5.7 5.7	5.7		15.5 16.0	15.8		5.4 4.6	5.0	
23-Sep-15	Fine	Moderate	15:11	Surface	1	27.4 27.3	27.4	7.8 7.8	7.8	17.2 17.2	17.2	94.6 95.1	94.9	6.7 6.7	6.7	6.5	7.0 7.0	7.0	9.1	7.4 7.4	7.4	8.8
				Middle	3	26.7 26.7	26.7	7.8 7.8	7.8	20.0 20.4	20.2	90.6 88.1	89.4	6.4 6.2	6.3		9.7 9.5	9.6		8.7 7.6	8.2	
				Bottom	5	25.9 26.0	26.0	7.8 7.7	7.8	24.2 24.0	24.1	78.0 78.8	78.4	5.5 5.5	5.5		10.4 11.0	10.7		12.5 9.2	10.9	
25-Sep-15	Sunny	Moderate	16:13	Surface	1	27.1 27.0	27.1	7.8 7.8	7.8	16.1 16.1	16.1	85.1 84.7	84.9	6.2 6.2	6.2	5.6	7.8 7.4	7.6	6.7	8.8 4.9	6.9	6.5
				Middle	3.5	26.7 26.7	26.7	7.8 7.8	7.8	27.2 27.2	27.2	71.8 72.6	72.2	4.9 5.0	5.0		6.7 6.5	6.6		5.7 6.6	6.2	
				Bottom	6	26.4 26.4	26.4	7.8 7.8	7.8	30.4 30.5	30.5	71.3 73.5	72.4	4.8 5.0	4.9		6.0 5.7	5.9		5.7 7.0	6.4	
28-Sep-15	Fine	Moderate	17:53	Surface	1	27.9 28.0	28.0	7.9 7.8	7.9	17.7 17.9	17.8	100.2 100.0	100.1	7.1 7.1	7.1	6.6	6.2 6.3	6.3	6.7	16.6 11.3	14.0	13.1
				Middle	3.5	27.6 27.7	27.7	7.8 7.8	7.8	26.2 26.7	26.5	89.8 90.4	90.1	6.1 6.1	6.1		7.4 7.3	7.4		13.6 13.7	13.7	
				Bottom	6	26.7 26.9	26.8	7.8 7.8	7.8	31.0 31.0	31.0	85.8 85.4	85.6	5.8 5.7	5.8		6.4 6.6	6.5		13.8 9.2	11.5	
30-Sep-15	Sunny	Moderate	08:09	Surface	1	28.2 28.2	28.2	7.7 7.7	7.7	17.6 17.6	17.6	106.9 104.9	105.9	7.6 7.4	7.5	7.4	6.8 7.0	6.9	10.7	16.2 10.9	13.6	14.6
				Middle	3.5	27.9 27.9	27.9	7.7 7.7	7.7	18.1 18.1	18.1	101.1 100.0	100.6	7.2 7.1	7.2		11.6 11.6	11.6		12.3 16.5	14.4	
				Bottom	6	27.4 27.4	27.4	7.6 7.6	7.6	19.6 19.5	19.6	80.9 78.1	79.5	5.7 5.5	5.6		13.8 13.6	13.7		16.0 15.3	15.7	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
21-Sep-15	Rainy	Moderate	18:02	Surface	1	28.4	28.4	8.0	8.0	13.4	13.4	104.1	104.0	7.5	7.5	6.6	3.4	3.5	7.4	5.2	5.6	9.3		
						28.4		8.0		13.4		103.8		7.5			3.6			6.0				
				Middle	5	27.9	27.9	8.0	8.0	29.1	29.2	83.8	83.2	5.6	5.6		8.5	8.6		7.8	8.3			
		27.9		8.0		29.2		82.6		5.5		5.6		8.7		8.7								
		27.8	27.8	8.0	8.0	30.4	30.4	81.5	81.6	5.4	5.4	5.4	5.4	10.1	10.0	14.2	14.1							
		27.8		8.0		30.4		81.6		5.4		5.4		9.9		13.9		14.1						
23-Sep-15	Fine	Moderate	08:04	Surface	1	28.2	28.2	8.0	8.0	14.0	14.1	97.7	98.0	7.1	7.1	7.1	8.7	8.6	7.0	5.4	7.4	7.6		
						28.2		8.0		14.1		98.3		7.1			8.5			9.3				
				Middle	5	26.4	26.4	7.9	7.9	22.6	22.1	98.8	97.8	7.0	7.0		5.8	5.8		6.9	6.4			
		26.3		7.9		21.5		96.8		6.9		7.0		5.8		5.9		6.4						
		25.2	25.2	7.9	7.9	31.5	31.5	76.3	75.7	5.3	5.3	5.3	5.3	6.7	6.7	9.2	8.9							
		25.2		7.8		31.5		75.0		5.2		5.3		6.7		8.6		8.9						
25-Sep-15	Sunny	Moderate	09:53	Surface	1	27.0	27.0	7.9	7.9	15.3	15.4	86.3	86.3	6.3	6.3	5.7	7.4	7.5	6.6	7.0	7.4	7.0		
						27.0		7.8		15.4		86.2		6.3			6.3			7.6			7.8	
				Middle	5	26.7	26.7	7.8	7.8	27.2	27.4	73.3	73.8	5.0	5.1		6.5	6.4		7.0	6.7			
		26.7		7.8		27.5		74.2		5.1		5.1		6.3		6.4		6.7						
		26.3	26.3	7.9	7.9	30.9	31.0	72.9	72.2	4.9	4.9	4.9	4.9	5.9	5.9	8.2	6.8							
		26.3		7.9		31.0		72.2		4.9		4.9		5.8		5.3		6.8						
28-Sep-15	Sunny	Moderate	12:25	Surface	1	28.1	28.1	7.8	7.8	16.7	16.5	99.5	99.2	7.1	7.1	6.6	6.2	6.2	6.6	11.5	12.7	12.5		
						28.1		7.8		16.3		98.9		7.1			6.1	6.2		13.9	12.7			
				Middle	4.5	27.5	27.6	7.8	7.8	25.5	25.7	88.8	89.1	6.1	6.1		7.1	7.1		14.6	13.0			
		27.6		7.8		25.9		89.4		6.1		6.1		7.0		11.3		13.0						
		26.8	26.8	7.8	7.8	30.5	30.5	85.4	85.0	5.8	5.8	5.8	5.8	6.6	6.6	11.6	11.7							
		26.7		7.8		30.4		84.6		5.7		5.8		6.5		11.8		11.7						
30-Sep-15	Sunny	Moderate	14:12	Surface	1	27.3	27.3	7.6	7.6	16.5	16.5	91.5	91.4	6.6	6.6	6.9	4.9	5.0	7.5	19.6	16.2	16.5		
						27.3		7.5		16.5		91.3		6.6			6.6			5.1			12.7	16.2
				Middle	5	27.1	27.1	7.7	7.7	17.2	17.2	98.4	98.6	7.1	7.1		5.6	5.7		12.7	14.1			
		27.1		7.7		17.2		98.7		7.1		7.1		5.8		15.4		14.1						
		25.4	25.4	7.7	7.7	30.7	30.7	71.2	71.5	4.9	5.0	5.0	5.0	12.0	11.9	22.6	19.2							
		25.4		7.7		30.7		71.8		5.0		5.0		11.8		15.7		19.2						

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)						
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*				
21-Sep-15	Rainy	Moderate	12:54	Surface	1	27.9	27.9	7.9	7.9	11.4	11.5	106.0	106.0	7.8	7.8	7.1	4.3	4.4	9.0	5.0	5.1	8.6				
						27.9		7.9		11.5		105.9		7.8			4.4			4.4			5.2			
				Middle	5	28.2	28.2	7.9	7.9	20.6	20.6	91.1	91.1	6.3	6.3		6.9	6.9		6.8	6.9		4.9	6.1		
				28.2		7.9		20.6		91.0		6.3		6.3		6.8		7.3		6.1						
				Bottom	9	27.9	27.9	7.9	7.9	28.2	28.2	86.8	86.7	5.8	5.8	5.8	15.5	15.7		15.1	14.5					
						27.9		7.9		28.2		86.5		5.8		5.8	15.9		13.8		14.5					
23-Sep-15	Fine	Moderate	15:42	Surface	1	27.6	27.6	7.8	7.8	14.8	14.8	95.1	95.5	6.9	7.0	6.6	4.4	4.4	6.0	6.4	7.5	7.7				
						27.6		7.8		14.8		95.8		7.0			4.4			4.4			8.5			
				Middle	5.5	26.8	26.9	8.0	8.0	19.0	18.6	84.3	83.6	6.1	6.1		5.4	5.3		5.2	5.3		8.3	8.0		
				26.9		8.0		18.1		82.9		6.0		6.1		5.2		7.6		8.0						
				Bottom	10	26.2	26.2	8.0	8.0	23.7	23.8	76.9	76.3	5.4	5.4	5.4	8.2	8.4		6.9	7.5					
						26.2		8.0		23.8		75.6		5.4		5.4	8.6		8.0		7.5					
25-Sep-15	Sunny	Moderate	16:37	Surface	1	27.0	27.1	7.8	7.8	16.1	16.1	83.7	83.3	6.1	6.1	5.6	7.7	7.6	6.7	7.6	7.3	6.1				
						27.1		7.8		16.1		82.8		6.0			6.1			7.5			7.0		7.3	
				Middle	4.5	26.7	26.8	7.9	7.9	27.4	27.4	74.1	73.8	5.1	5.1		6.7	6.6		6.5	6.6		4.0	4.8		
				26.8		7.9		27.3		73.4		5.0		5.1		6.5		5.6		4.8						
				Bottom	8	26.3	26.4	7.8	7.8	30.4	30.4	71.2	71.2	4.8	4.8	4.8	5.8	5.8		6.2	6.3					
						26.4		7.8		30.3		71.2		4.8		4.8	5.8		6.4		6.3					
28-Sep-15	Fine	Moderate	18:23	Surface	1	28.1	28.1	7.9	7.9	17.6	17.7	99.2	98.5	7.0	7.0	6.5	6.2	6.3	6.7	15.1	15.6	14.3				
						28.0		7.8		17.8		97.7		6.9			7.0			6.3			6.3		16.1	
				Middle	5	27.6	27.6	7.8	7.8	26.3	26.5	86.8	86.9	5.9	5.9		7.3	7.4		7.4	7.4		13.9	12.0		
				27.6		7.8		26.6		86.9		5.9		5.9		7.4		7.4		10.0		12.0				
				Bottom	9	26.8	26.8	7.8	7.8	31.0	31.1	81.6	82.2	5.5	5.6	5.6	6.4	6.5		13.6	15.3					
						26.8		7.8		31.1		82.8		5.6		5.6	6.5		17.0		15.3					
30-Sep-15	Sunny	Moderate	08:26	Surface	1	28.0	28.0	7.7	7.7	14.0	14.0	101.2	101.1	7.3	7.3	7.2	4.4	4.5	5.7	11.2	13.7	15.0				
						28.0		7.7		13.9		100.9		7.3			7.3			4.5			4.5		16.1	
				Middle	5	27.7	27.7	7.8	7.8	17.7	17.2	99.4	98.7	7.1	7.1		3.8	3.7		3.7	3.7		13.7	15.2		
				27.7		7.8		16.7		98.0		7.0		7.1		3.6		3.7		16.6		15.2				
				Bottom	9	27.1	27.1	7.8	7.8	23.4	21.7	81.0	81.1	5.7	5.8	5.8	8.8	9.0		15.2	16.2					
						27.1		7.8		20.0		81.2		5.8		5.8	9.2		17.1		16.2					

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Sep-15	Rainy	Moderate	15:01	Surface	1	26.1 26.0	26.1	8.0 8.0	8.0	18.2 18.2	18.2	105.6 105.4	105.5	7.7 7.7	7.7	7.6	3.2 3.6	3.4	4.5	28.3 35.7	32.0	31.0
				Middle	4	24.8 24.8	24.8	7.8 7.8	7.8	21.6 21.6	21.6	101.2 100.7	101.0	7.4 7.4	7.4		2.8 2.9	2.9		33.3 29.0	31.2	
				Bottom	7	22.7 22.7	22.7	7.8 7.8	7.8	30.1 30.1	30.1	77.9 78.3	78.1	5.7 5.7	5.7		7.1 7.3	7.2		30.3 29.3	29.8	
4-Sep-15	Sunny	Moderate	16:26	Surface	1	26.9 27.2	27.1	8.0 8.0	8.0	23.2 23.5	23.4	99.1 98.5	98.8	6.9 6.9	6.9	6.9	2.9 3.1	3.0	6.1	8.2 5.8	7.0	6.3
				Middle	4	26.6 26.5	26.6	8.1 8.1	8.1	29.2 28.2	28.7	99.5 98.2	98.9	6.8 6.7	6.8		3.3 3.7	3.5		5.4 4.6	5.0	
				Bottom	7	26.4 26.4	26.4	8.1 8.1	8.1	31.0 30.9	31.0	98.2 97.0	97.6	6.7 6.6	6.7		11.8 12.0	11.9		6.0 7.6	6.8	
7-Sep-15	Cloudy	Moderate	07:59	Surface	1	26.5 26.5	26.5	8.0 8.0	8.0	24.2 24.3	24.3	92.9 91.6	92.3	6.5 6.4	6.5	6.4	4.5 3.6	4.1	7.1	5.1 5.0	5.1	5.4
				Middle	4	26.6 26.6	26.6	8.1 8.1	8.1	30.0 30.0	30.0	92.5 91.5	92.0	6.3 6.2	6.3		7.0 6.2	6.6		4.9 5.4	5.2	
				Bottom	7	26.5 26.5	26.5	8.1 8.1	8.1	30.5 30.5	30.5	92.0 91.5	91.8	6.2 6.2	6.2		10.8 10.4	10.6		6.6 5.1	5.9	
9-Sep-15	Sunny	Moderate	09:53	Surface	1	29.0 28.9	29.0	7.9 7.8	7.9	22.4 22.5	22.5	78.2 78.0	78.1	5.3 5.3	5.3	5.2	4.1 3.8	4.0	8.6	8.6 9.2	8.9	8.4
				Middle	4	26.8 26.9	26.9	7.8 7.8	7.8	29.2 28.9	29.1	75.6 74.4	75.0	5.1 5.1	5.1		8.6 8.5	8.6		8.8 8.6	8.7	
				Bottom	7	26.8 26.7	26.8	7.8 7.8	7.8	29.5 29.6	29.6	74.8 74.0	74.4	5.1 5.0	5.1		13.2 13.3	13.3		7.6 7.7	7.7	
11-Sep-15	Sunny	Moderate	11:23	Surface	1	27.5 27.4	27.5	8.0 8.0	8.0	23.4 23.4	23.4	73.8 73.7	73.8	5.1 5.1	5.1	5.2	4.7 4.8	4.8	5.6	7.9 7.5	7.7	8.6
				Middle	4	25.9 25.9	25.9	7.9 7.9	7.9	32.1 32.0	32.1	75.2 76.3	75.8	5.1 5.2	5.2		6.8 6.4	6.6		9.9 9.1	9.5	
				Bottom	7	25.8 25.8	25.8	7.9 7.9	7.9	32.4 32.4	32.4	73.6 72.4	73.0	5.0 4.9	5.0		5.4 5.2	5.3		8.6 8.4	8.5	
14-Sep-15	Sunny	Moderate	12:53	Surface	1	26.9 26.9	26.9	7.9 7.9	7.9	19.3 19.1	19.2	93.3 93.7	93.5	6.7 6.7	6.7	6.3	5.9 5.3	5.6	8.5	8.9 11.8	10.4	9.9
				Middle	4	27.0 27.0	27.0	8.0 8.0	8.0	21.2 21.3	21.3	81.3 81.7	81.5	5.8 5.8	5.8		5.7 5.5	5.6		11.2 9.2	10.2	
				Bottom	7	26.2 26.3	26.3	8.0 8.0	8.0	28.6 28.5	28.6	69.9 69.2	69.6	5.0 5.1	5.1		15.5 13.3	14.4		8.2 9.7	9.0	
16-Sep-15	Fine	Moderate	14:10	Surface	1	27.3 27.3	27.3	8.0 8.0	8.0	22.0 22.0	22.0	100.5 100.0	100.3	7.1 7.0	7.1	6.9	4.6 4.9	4.8	6.6	15.4 13.8	14.6	14.4
				Middle	4	26.7 26.6	26.7	8.1 8.1	8.1	24.1 24.3	24.2	94.3 93.9	94.1	6.6 6.6	6.6		6.4 7.1	6.8		14.5 11.5	13.0	
				Bottom	7	25.6 25.6	25.6	8.1 8.1	8.1	30.3 30.3	30.3	91.3 90.7	91.0	6.3 6.2	6.3		8.1 8.4	8.3		14.8 16.4	15.6	
18-Sep-15	Fine	Moderate	14:56	Surface	1	27.2 27.5	27.4	7.8 7.9	7.9	17.6 17.6	17.6	92.3 91.2	91.8	6.6 6.5	6.6	6.0	7.0 6.9	7.0	9.0	8.3 7.1	7.7	7.6
				Middle	4	26.7 26.7	26.7	7.8 7.8	7.8	20.6 20.8	20.7	74.8 74.5	74.7	5.3 5.3	5.3		8.5 8.6	8.6		9.4 6.4	7.9	
				Bottom	7	26.1 26.1	26.1	7.8 7.8	7.8	23.2 23.0	23.1	70.7 70.4	70.6	5.0 5.0	5.0		11.3 11.3	11.3		8.7 5.7	7.2	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Sep-15	Rainy	Moderate	17:50	Surface	1	28.5	28.5	8.0	8.0	13.2	13.2	106.5	106.7	7.7	7.7	6.8	3.8	3.8	6.7	5.0	5.0	7.2
						28.5		8.0		13.2		106.8		7.7			3.7			5.0		
				Middle	4	27.9	28.0	8.0	8.0	26.9	26.6	85.4	85.3	5.8	5.8		5.2	5.2		5.7	6.1	
		28.0		8.0		26.2		85.1		5.8		5.8		5.2		6.5						
		27.9	27.9	8.0	8.0	30.3	30.3	84.7	84.7	5.6	5.6	5.6	5.6	10.6	11.0	10.7	10.5					
		27.9		8.0		30.3		84.7		5.6		5.6		11.4		10.3						
23-Sep-15	Fine	Moderate	07:48	Surface	1	28.4	28.4	7.9	7.9	16.7	16.7	93.6	93.4	6.6	6.6	5.9	7.5	7.5	7.4	7.4	7.2	7.8
						28.4		7.9		16.7		93.1		6.6			7.5			6.9		
				Middle	3.5	25.8	25.9	7.9	7.9	27.9	28.3	72.8	73.1	5.1	5.1		6.7	6.8		8.9	7.5	
		25.9		7.9		28.6		73.3		5.1		5.1		6.9		6.0						
		25.4	25.4	7.9	7.9	30.6	30.6	71.0	71.2	4.9	4.9	4.9	4.9	8.0	8.0	9.4	8.8					
		25.4		7.9		30.6		71.4		4.9		4.9		8.0		8.2						
25-Sep-15	Sunny	Moderate	09:34	Surface	1	26.9	26.9	7.8	7.9	15.5	15.5	84.8	84.7	6.2	6.2	5.9	5.8	5.7	5.9	6.6	6.2	6.9
						26.9		7.9		15.4		84.6		6.2			5.6			5.7		
				Middle	3.5	26.8	26.8	7.9	7.9	25.6	25.7	80.5	80.2	5.6	5.6		5.0	5.1		8.0	7.0	
		26.8		7.9		25.8		79.9		5.5		5.6		5.2		5.9						
		26.5	26.5	7.8	7.8	29.5	29.5	74.4	74.8	5.1	5.1	5.1	5.1	6.7	6.8	7.5	7.6					
		26.4		7.8		29.5		75.1		5.1		5.1		6.8		7.7						
28-Sep-15	Sunny	Moderate	12:06	Surface	1	27.9	27.9	7.8	7.8	17.6	17.5	100.2	100.3	7.1	7.2	6.8	4.7	4.7	5.9	11.7	10.7	11.3
						27.9		7.8		17.3		100.4		7.2			4.6			9.7		
				Middle	4	27.7	27.7	7.8	7.9	23.0	23.2	92.4	91.8	6.4	6.4		5.5	5.6		11.3	11.2	
		27.7		7.9		23.3		91.2		6.3		6.4		5.6		11.0						
		27.0	27.0	7.8	7.8	29.4	29.6	84.4	85.0	5.7	5.8	5.8	5.8	7.3	7.4	11.4	12.1					
		27.0		7.8		29.7		85.5		5.8		5.8		7.4		12.7						
30-Sep-15	Sunny	Moderate	13:58	Surface	1	27.3	27.3	7.6	7.6	17.5	17.5	95.1	95.2	6.8	6.9	6.6	6.0	6.1	6.0	13.2	13.7	15.0
						27.3		7.6		17.5		95.3		6.9			6.1			14.2		
				Middle	4	26.4	26.4	7.6	7.6	22.2	22.3	88.0	87.7	6.3	6.3		6.3	6.3		16.3	16.4	
		26.4		7.6		22.3		87.3		6.2		6.3		6.3		16.4						
		26.2	26.2	7.6	7.6	23.7	23.7	83.9	83.8	5.9	5.9	5.9	5.9	5.9	5.5	12.3	15.0					
		26.2		7.6		23.7		83.6		5.9		5.9		5.0		17.6						

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Sep-15	Rainy	Moderate	12:37	Surface	1	28.3	28.3	7.8	7.8	13.8	13.8	102.0	101.8	7.4	7.4	7.2	3.9	4.0	7.9	7.3	7.8	8.9
						28.3	28.3	7.8	7.8	13.8	13.8	101.6	101.6	7.3	7.3		4.0	4.0		8.3	8.3	
				Middle	4	28.4	28.4	7.8	7.8	17.0	17.0	98.3	98.0	7.0	7.0		5.4	5.7		12.0	12.6	
				28.4	28.4	7.8	7.8	16.9	17.0	97.6	97.6	6.9	7.0	5.9	5.9	13.2	13.2	6.5	6.3			
				Bottom	7	27.8	27.8	7.9	7.9	29.7	29.7	81.8	82.0	5.4	5.5	5.5	13.6	14.1	6.0	6.0	6.3	
						27.8	27.8	7.9	7.9	29.7	29.7	82.1	82.0	5.5	5.5	5.5	14.6	14.1	6.0	6.0	6.3	
23-Sep-15	Fine	Moderate	15:28	Surface	1	27.6	27.6	8.0	8.0	14.8	14.8	95.1	95.5	6.9	7.0	6.6	5.5	5.5	6.5	12.4	9.6	7.8
						27.6	27.6	8.0	8.0	14.8	14.8	95.8	95.8	7.0	7.0		5.4	5.5		6.8	6.8	
				Middle	4	26.8	26.9	8.0	8.0	19.0	18.6	84.3	83.6	6.1	6.1		6.4	6.4		7.3	7.3	
				26.9	26.9	8.0	8.0	18.1	18.6	82.9	83.6	6.0	6.1	6.4	6.4	7.3	7.3	5.0	5.0			
				Bottom	7	26.2	26.2	8.0	8.0	23.7	23.8	76.9	76.3	5.4	5.4	5.4	7.8	7.6	7.8	7.8	6.4	
						26.2	26.2	8.0	8.0	23.8	23.8	75.6	76.3	5.3	5.4	5.4	7.3	7.6	7.8	7.8	6.4	
25-Sep-15	Sunny	Moderate	16:21	Surface	1	26.9	27.0	7.8	7.8	16.0	16.1	82.6	83.0	6.0	6.1	5.8	5.7	5.8	6.0	5.0	4.8	5.2
						27.0	27.0	7.8	7.8	16.1	16.1	83.3	83.0	6.1	6.1		5.9	5.8		4.5	4.8	
				Middle	3.5	26.8	26.8	7.8	7.8	25.8	25.8	77.3	77.7	5.4	5.4		5.0	5.0		5.2	6.3	
				26.8	26.8	7.8	7.8	25.8	25.8	78.0	78.0	5.4	5.4	4.9	5.0	7.4	6.3					
				Bottom	6	26.5	26.6	7.8	7.8	29.5	29.6	75.6	75.9	5.2	5.2	5.2	7.3	7.3	3.7	4.6		
						26.6	26.6	7.8	7.8	29.7	29.6	76.2	75.9	5.2	5.2	5.2	7.3	7.3	5.4	4.6		
28-Sep-15	Fine	Moderate	18:06	Surface	1	27.9	27.9	7.9	7.9	16.4	16.3	97.6	96.9	7.0	7.0	6.6	6.1	6.2	6.5	16.6	14.1	14.4
						27.9	27.9	7.9	7.9	16.2	16.3	96.1	96.9	6.9	7.0		6.2	6.2		11.5	14.1	
				Middle	4	27.6	27.7	7.8	7.8	24.4	24.5	88.7	89.5	6.1	6.2		5.5	5.5		12.6	14.3	
				27.7	27.7	7.8	7.8	24.6	24.5	90.2	89.5	6.2	6.2	5.4	5.5	15.9	14.3					
				Bottom	7	27.0	27.0	7.8	7.8	30.2	30.0	85.7	85.8	5.8	5.8	5.8	7.9	7.9	13.7	14.9		
						27.0	27.0	7.8	7.8	29.8	30.0	85.9	85.8	5.8	5.8	5.8	7.9	7.9	16.1	14.9		
30-Sep-15	Sunny	Moderate	08:15	Surface	1	27.9	27.9	7.7	7.7	13.0	12.9	96.6	97.1	7.1	7.1	6.4	3.3	3.1	5.7	19.2	17.1	18.2
						27.9	27.9	7.7	7.7	12.8	12.9	97.6	97.1	7.1	7.1		2.8	3.1		14.9	17.1	
				Middle	4	27.0	27.0	7.7	7.7	22.3	21.5	79.1	78.3	5.6	5.6		6.0	6.1		21.5	18.7	
				27.0	27.0	7.7	7.7	20.7	21.5	77.5	78.3	5.5	5.6	6.2	6.1	15.9	18.7					
				Bottom	7	26.4	26.4	7.8	7.8	27.1	27.1	70.3	70.0	4.9	4.9	4.9	7.7	7.8	21.9	18.7		
						26.4	26.4	7.8	7.8	27.0	27.1	69.6	70.0	4.8	4.9	4.9	7.8	7.8	15.5	18.7		

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
21-Sep-15	Rainy	Moderate	18:09	Surface	1	28.5	28.5	7.9	7.9	13.3	13.3	100.8	100.8	7.3	7.3	7.2	3.8	3.7	6.7	5.7	5.1	5.4	
						28.5		7.9		13.2		100.8		7.3			3.6			4.4			
				Middle	6	27.9	28.0	7.9	7.9	26.9	26.6	98.3	98.2	98.0	98.2	7.0	7.0	5.3		5.3	5.7		5.7
				28.1		7.9		26.2		98.0		6.9		7.0		5.3		5.7		5.4			
				Bottom	11	27.8	27.9	8.0	8.0	30.3	30.3	84.1	83.9	5.6	5.6	5.6	10.6	11.1	5.1	5.6	5.4		
						27.9		8.0		30.3		83.6		5.6		5.6	11.6		5.6		5.4		
23-Sep-15	Fine	Moderate	08:21	Surface	1	27.0	26.9	7.7	7.7	15.2	15.7	94.3	93.6	6.8	6.8	6.6	6.9	7.0	7.9	7.9	8.6	7.6	
						26.8		7.7		16.2		92.9		6.7			7.0			9.3			
				Middle	6	26.1	26.1	7.7	7.8	22.2	22.1	87.1	89.3	91.4	89.3	6.2	6.3	7.8		8.1	7.1		7.0
				26.0		7.8		21.9		91.4		6.4		6.3		8.3		6.9	7.0				
				Bottom	11	25.4	25.4	7.7	7.7	26.9	27.1	78.4	78.7	5.5	5.5	5.5	8.7	8.7	6.6	7.8	7.2		
						25.4		7.7		27.3		79.0		5.5		5.5	8.7		7.8		7.2		
25-Sep-15	Sunny	Moderate	09:56	Surface	1	26.8	26.9	7.8	7.9	15.6	15.5	81.4	81.0	6.0	6.0	5.6	5.8	5.7	5.8	4.9	5.8	5.8	
						26.9		7.9		15.3		80.5		5.9			6.0			5.6			6.6
				Middle	6	27.0	27.1	7.9	7.9	25.4	25.6	75.1	74.9	74.6	74.9	5.2	5.2	4.9		5.0	4.6		5.7
				27.1		7.9		25.8		74.6		5.1		5.2		5.1		6.7	5.7				
				Bottom	11	26.4	26.6	7.8	7.8	29.2	29.4	73.8	74.3	5.0	5.1	5.1	6.8	6.8	6.6	6.0			
						26.8		7.8		29.5		74.7		5.1		5.1	6.8		5.4	6.0			
28-Sep-15	Sunny	Moderate	12:27	Surface	1	27.8	28.0	7.8	7.8	17.5	17.4	99.0	98.5	7.1	7.1	6.5	4.7	4.6	5.9	17.1	15.5	14.1	
						28.1		7.8		17.3		97.9		7.0			7.1			4.5			13.9
				Middle	6	27.7	27.8	7.8	7.8	23.1	23.2	85.7	85.8	85.9	85.8	5.9	5.9	5.6		5.6	14.9		14.7
				27.9		7.8		23.2		85.9		5.9		5.9		5.5		14.5	14.7				
				Bottom	11	27.2	27.1	7.8	7.8	29.4	29.6	81.6	82.2	5.5	5.6	5.6	7.3	7.4	12.2	12.0			
						27.0		7.8		29.7		82.7		5.6		5.6	7.4		11.7		12.0		
30-Sep-15	Sunny	Moderate	14:53	Surface	1	27.8	27.8	7.7	7.7	15.3	15.3	102.8	103.8	7.4	7.5	7.0	5.7	5.8	6.0	18.2	18.7	19.4	
						27.8		7.7		15.3		104.7		7.6			7.5			5.8			19.1
				Middle	7	26.9	26.9	7.6	7.6	17.4	17.7	87.8	87.7	87.5	87.7	6.4	6.4	6.5		6.5	21.5		20.2
				26.9		7.6		18.0		87.5		6.3		6.4		6.4		18.9	20.2				
				Bottom	13	25.7	25.7	7.5	7.5	23.5	23.6	69.7	69.2	5.0	5.0	5.0	5.7	5.7	23.0	19.4			
						25.7		7.5		23.7		68.7		4.9		5.0	5.6		15.8		19.4		

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Sep-15	Rainy	Moderate	09:14	Surface	1	26.9 27.2	27.1	7.9 7.9	7.9	14.9 14.8	14.9	96.6 97.0	96.8	7.1 7.1	7.1	6.5	5.2 4.9	5.1	7.9	15.8 12.8	14.3	19.6
				Middle	6	25.3 25.0	25.2	7.9 7.9	7.9	22.5 21.3	21.9	82.1 80.0	81.1	5.9 5.9	5.9		7.8 7.9	7.9		20.2 21.6	20.9	
				Bottom	11	24.2 24.3	24.3	7.9 8.0	8.0	29.6 29.1	29.4	69.6 70.4	70.0	4.9 5.0	5.0		10.3 10.8	10.6		32.2 15.2	23.7	
4-Sep-15	Sunny	Moderate	11:08	Surface	1	26.3 26.2	26.3	7.7 7.7	7.7	22.0 22.2	22.1	90.8 91.7	91.3	6.5 6.6	6.6	6.4	8.1 7.2	7.7	7.8	14.3 11.7	13.0	13.6
				Middle	6	25.1 25.1	25.1	7.8 7.8	7.8	29.2 29.3	29.3	88.3 86.6	87.5	6.2 6.1	6.2		6.1 5.7	5.9		11.1 11.1	11.1	
				Bottom	11	24.7 24.7	24.7	7.9 8.0	8.0	31.0 30.6	30.8	80.6 81.5	81.1	5.6 5.7	5.7		9.7 9.6	9.7		20.0 13.4	16.7	
7-Sep-15	Cloudy	Moderate	15:55	Surface	1	26.8 26.9	26.9	8.0 8.0	8.0	30.3 30.1	30.2	103.2 102.0	102.6	7.0 6.9	7.0	6.7	2.7 2.7	2.7	5.8	4.6 4.5	4.6	5.5
				Middle	6	24.9 25.0	25.0	8.1 8.1	8.1	30.1 29.7	29.9	92.2 90.2	91.2	6.4 6.3	6.4		5.6 5.9	5.8		6.7 6.7	6.7	
				Bottom	11	24.7 24.8	24.8	8.1 8.1	8.1	30.3 29.9	30.1	86.0 85.8	85.9	6.0 6.0	6.0		8.5 9.1	8.8		5.5 4.9	5.2	
9-Sep-15	Sunny	Moderate	16:44	Surface	1	29.6 29.6	29.6	7.9 7.9	7.9	21.9 21.9	21.9	85.6 83.8	84.7	5.8 5.7	5.8	5.7	5.0 5.1	5.1	5.3	8.7 10.5	9.6	9.1
				Middle	7	28.3 28.3	28.3	7.8 7.8	7.8	25.7 25.8	25.8	81.2 80.2	80.7	5.5 5.4	5.5		5.8 5.7	5.8		8.4 10.6	9.5	
				Bottom	13	27.0 27.1	27.1	7.7 7.7	7.7	32.5 31.7	32.1	78.2 77.3	77.8	5.2 5.2	5.2		5.0 4.9	5.0		9.6 6.7	8.2	
11-Sep-15	Sunny	Moderate	18:28	Surface	1	26.5 26.6	26.6	7.7 7.8	7.8	26.3 26.2	26.3	84.8 84.6	84.7	5.9 5.9	5.9	6.1	7.6 7.4	7.5	8.4	12.0 9.4	10.7	10.9
				Middle	6	26.1 26.0	26.1	7.8 7.8	7.8	28.0 28.1	28.1	91.0 91.0	91.0	6.3 6.3	6.3		8.7 8.8	8.8		12.4 10.0	11.2	
				Bottom	11	25.8 25.9	25.9	7.7 7.7	7.7	30.1 30.3	30.2	95.3 97.7	96.5	6.6 6.7	6.7		8.8 8.7	8.8		9.4 12.2	10.8	
14-Sep-15	Fine	Moderate	19:22	Surface	1	27.1 27.0	27.1	7.7 7.7	7.7	19.9 19.9	19.9	96.7 96.1	96.4	6.9 6.9	6.9	6.1	5.0 4.6	4.8	5.6	12.9 10.2	11.6	10.3
				Middle	6	26.4 26.4	26.4	7.8 7.8	7.8	27.3 27.3	27.3	74.4 75.0	74.7	5.1 5.2	5.2		7.0 7.0	7.0		7.9 9.2	8.6	
				Bottom	11	26.0 26.0	26.0	8.0 8.1	8.1	29.4 29.3	29.4	73.5 73.6	73.6	5.1 5.1	5.1		5.1 5.1	5.1		11.1 10.4	10.8	
16-Sep-15	Fine	Moderate	09:17	Surface	1	27.0 27.1	27.1	7.8 7.8	7.8	20.4 20.1	20.3	79.3 79.1	79.2	5.6 5.6	5.6	5.5	5.2 5.9	5.6	8.4	22.4 11.5	17.0	14.1
				Middle	6	26.4 26.4	26.4	7.8 7.8	7.8	25.1 25.1	25.1	76.5 76.5	76.5	5.4 5.4	5.4		8.3 8.2	8.3		10.4 13.4	11.9	
				Bottom	11	25.3 25.6	25.5	7.8 7.8	7.8	31.3 31.3	31.3	77.0 77.7	77.4	5.3 5.3	5.3		10.8 11.6	11.2		10.7 16.1	13.4	
18-Sep-15	Fine	Moderate	09:47	Surface	1	28.0 28.0	28.0	7.8 7.8	7.8	14.1 13.8	14.0	93.4 91.6	92.5	6.8 6.6	6.7	6.0	3.3 3.2	3.3	5.4	10.4 7.4	8.9	9.1
				Middle	6.5	26.9 26.9	26.9	7.8 7.8	7.8	22.0 22.7	22.4	74.4 74.5	74.5	5.3 5.2	5.3		6.7 7.3	7.0		13.4 7.6	10.5	
				Bottom	12	26.3 26.3	26.3	7.8 7.8	7.8	25.7 25.7	25.7	71.8 72.5	72.2	5.0 5.1	5.1		5.6 6.2	5.9		8.6 7.4	8.0	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.


Water Quality Monitoring Results at ST3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Sep-15	Rainy	Moderate	13:00	Surface	1	28.2	28.3	7.8	7.8	13.8	13.8	103.7	103.6	7.5	7.5	6.6	3.8	4.0	7.9	4.7	4.7	4.4
						28.3		7.8		13.8		103.4		7.5			4.1			4.6		
				Middle	6	28.4	28.4	7.8	7.8	17.0	17.0	83.5	82.9	5.6	5.6		5.4	5.7		5.1	4.2	
		28.3		7.8		16.9		82.3		5.5		5.4		5.9		3.3		4.0	4.3			
		27.8	27.8	7.9	7.9	29.7	29.7	81.2	81.3	5.4	5.4	5.4	5.4	13.7	14.1	4.0	4.5					
		27.8		7.9		29.7		81.3		5.4		5.4		14.5		4.5						
23-Sep-15	Fine	Moderate	16:00	Surface	1	27.2	27.3	7.8	7.8	15.7	15.6	87.9	88.2	6.3	6.3	5.9	7.3	7.0	9.0	9.0	8.1	6.2
						27.3		7.7		15.5		88.5		6.3			6.6			7.2		
				Middle	6	25.7	25.8	7.8	7.8	23.8	23.9	78.2	78.5	5.5	5.5		10.0	10.5		7.7	7.7	
		25.8		7.8		24.0		78.8		5.5		10.9		7.6		7.6		1.0	2.7			
		24.9	25.0	7.8	7.8	27.8	28.0	74.6	73.8	5.2	5.2	5.2	5.2	9.2	9.4	1.0	4.3					
		25.0		7.7		28.1		73.0		5.1		5.2		9.6		4.3						
25-Sep-15	Sunny	Moderate	16:52	Surface	1	26.9	26.8	7.8	7.8	16.0	16.1	82.5	81.5	6.0	6.0	5.7	5.7	5.8	6.1	11.2	8.7	7.3
						26.7		7.8		16.1		80.4		5.9			5.8			6.2		
				Middle	6	27.0	26.9	7.8	7.8	25.9	26.0	77.5	77.0	5.3	5.3		5.1	5.0		9.8	7.3	
		26.8		7.8		26.0		76.5		5.3		4.9		4.8		4.8		6.1	5.8			
		26.6	26.6	7.8	7.8	29.5	29.7	73.2	73.0	5.0	5.0	5.0	5.0	7.4	7.5	6.1	5.4					
		26.6		7.7		29.8		72.7		4.9		5.0		7.5		5.4						
28-Sep-15	Fine	Moderate	18:32	Surface	1	27.9	27.8	7.8	7.8	16.4	16.3	97.7	96.4	7.0	6.9	6.6	6.0	6.1	6.5	15.6	15.6	14.5
						27.7		7.8		16.2		95.1		6.8			6.1			15.6		
				Middle	6	27.7	27.8	7.8	7.8	24.5	24.6	91.9	91.5	6.3	6.3		5.5	5.5		16.0	14.6	
		27.8		7.8		24.6		91.1		6.2		5.4		13.1		13.1		13.8	13.4			
		26.9	27.0	7.8	7.8	30.3	30.1	84.1	84.8	5.7	5.8	5.8	5.8	8.0	8.0	13.8	13.4					
		27.1		7.8		29.8		85.4		5.8		5.8		8.0		12.9						
30-Sep-15	Sunny	Moderate	08:52	Surface	1	27.9	27.9	7.7	7.7	14.0	13.9	92.7	91.8	6.7	6.7	5.8	3.2	3.3	5.4	16.8	17.0	18.2
						27.9		7.7		13.8		90.9		6.6			3.3			17.1		
				Middle	6.5	26.8	26.8	7.7	7.7	21.9	22.3	70.9	68.9	5.0	4.9		6.7	7.0		16.7	18.2	
		26.8		7.7		22.6		66.9		4.7		7.3		19.6		19.6		17.4	19.3			
		26.2	26.2	7.7	7.7	25.6	25.5	70.3	69.4	4.9	4.9	4.9	4.9	5.6	5.9	17.4	19.3					
		26.1		7.6		25.4		68.5		4.8		4.9		6.1		21.1						

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

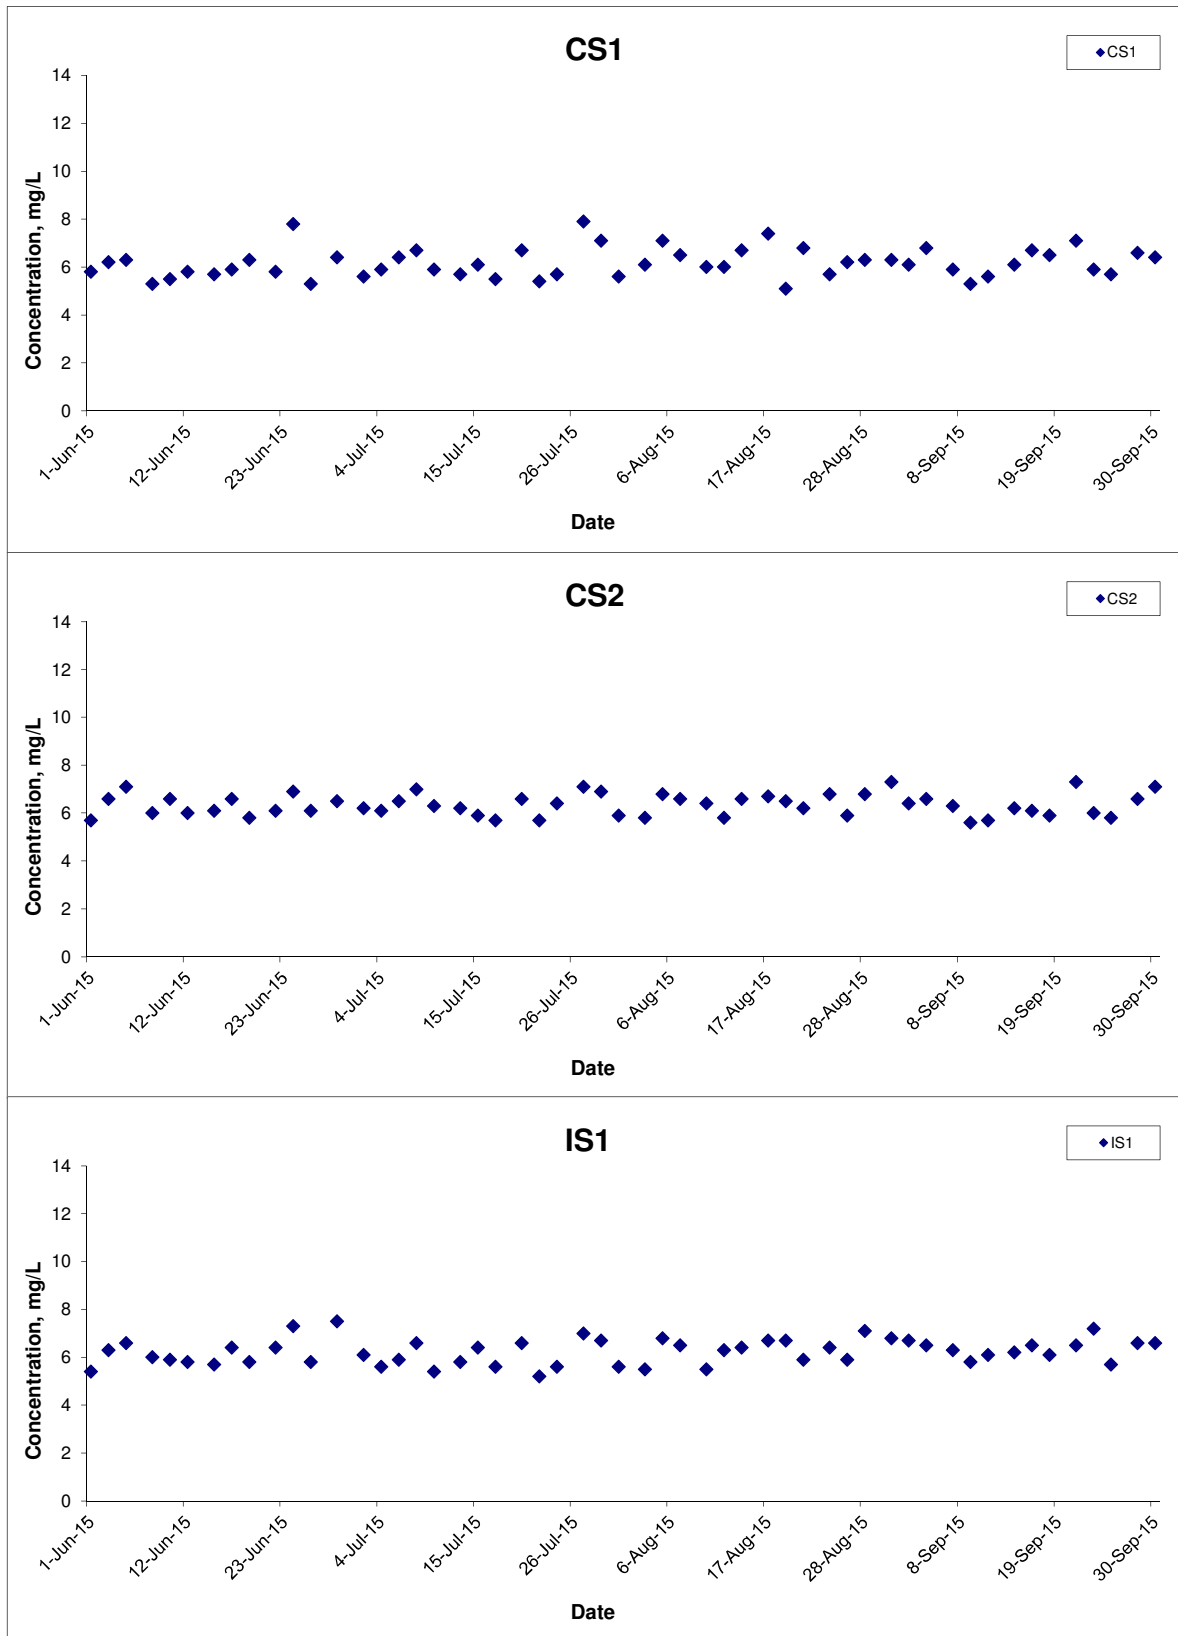


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

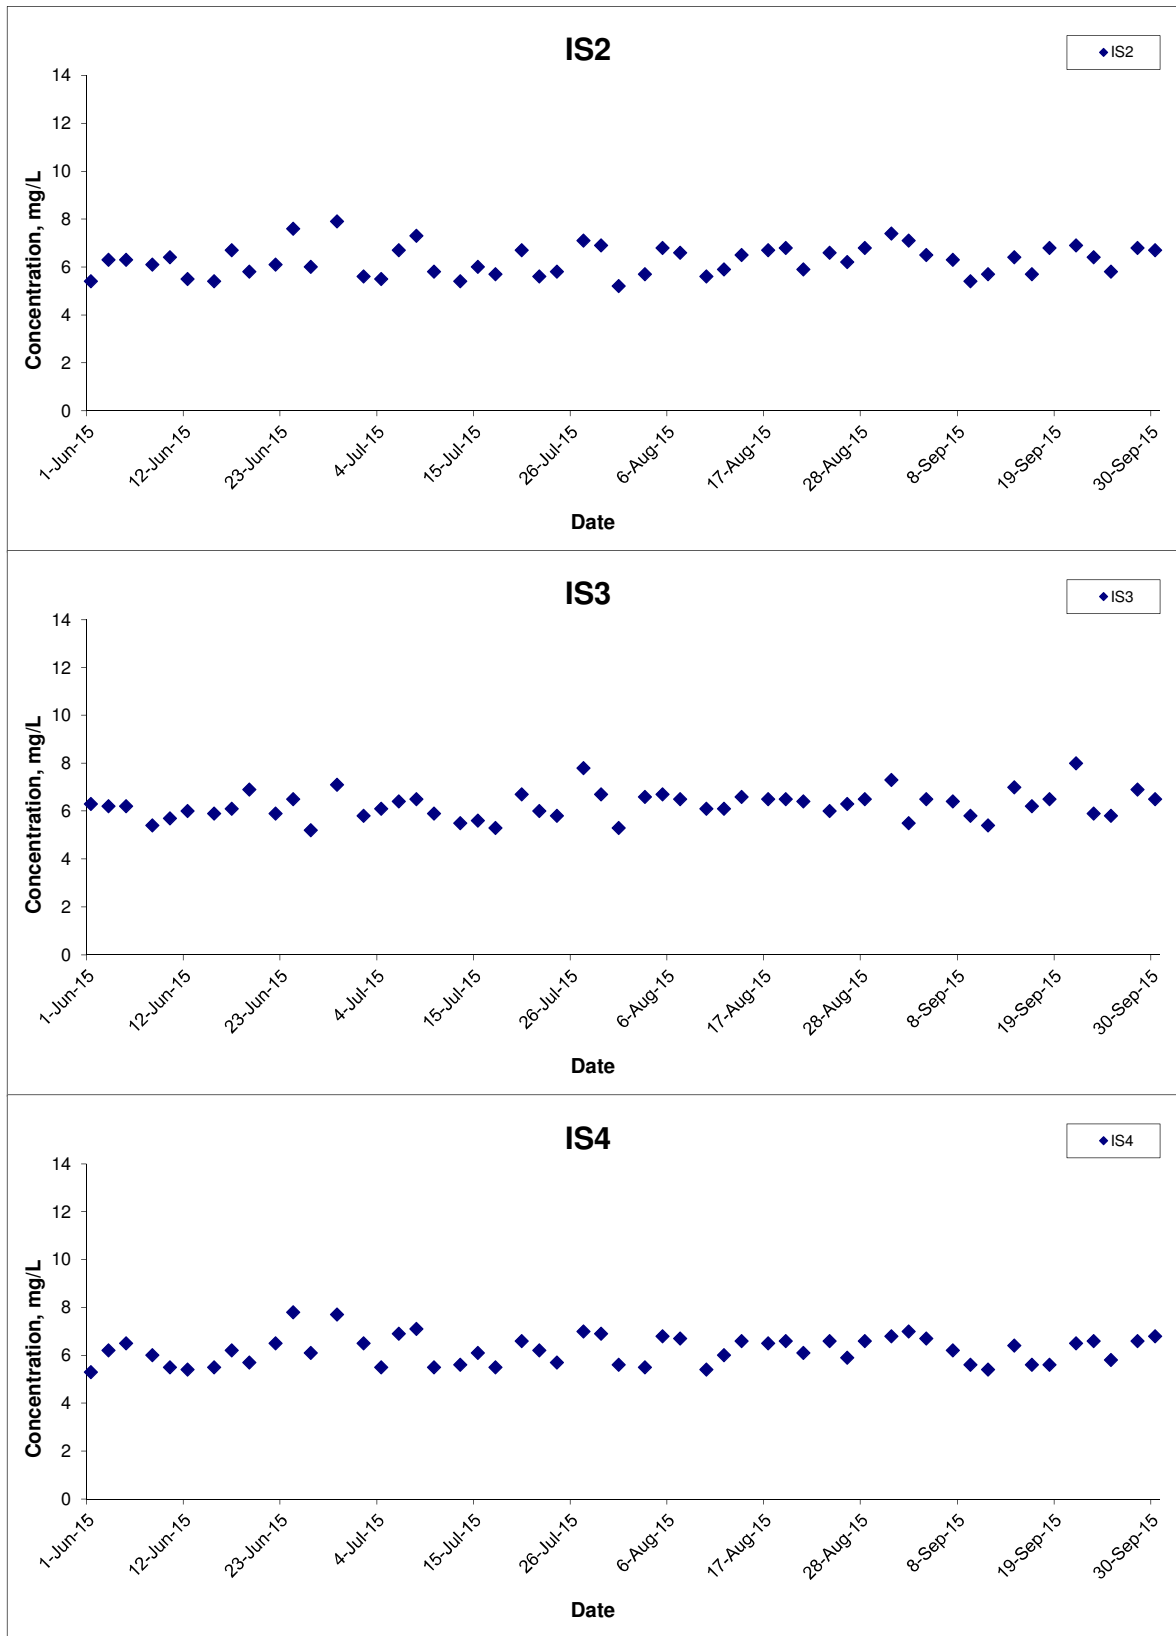


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

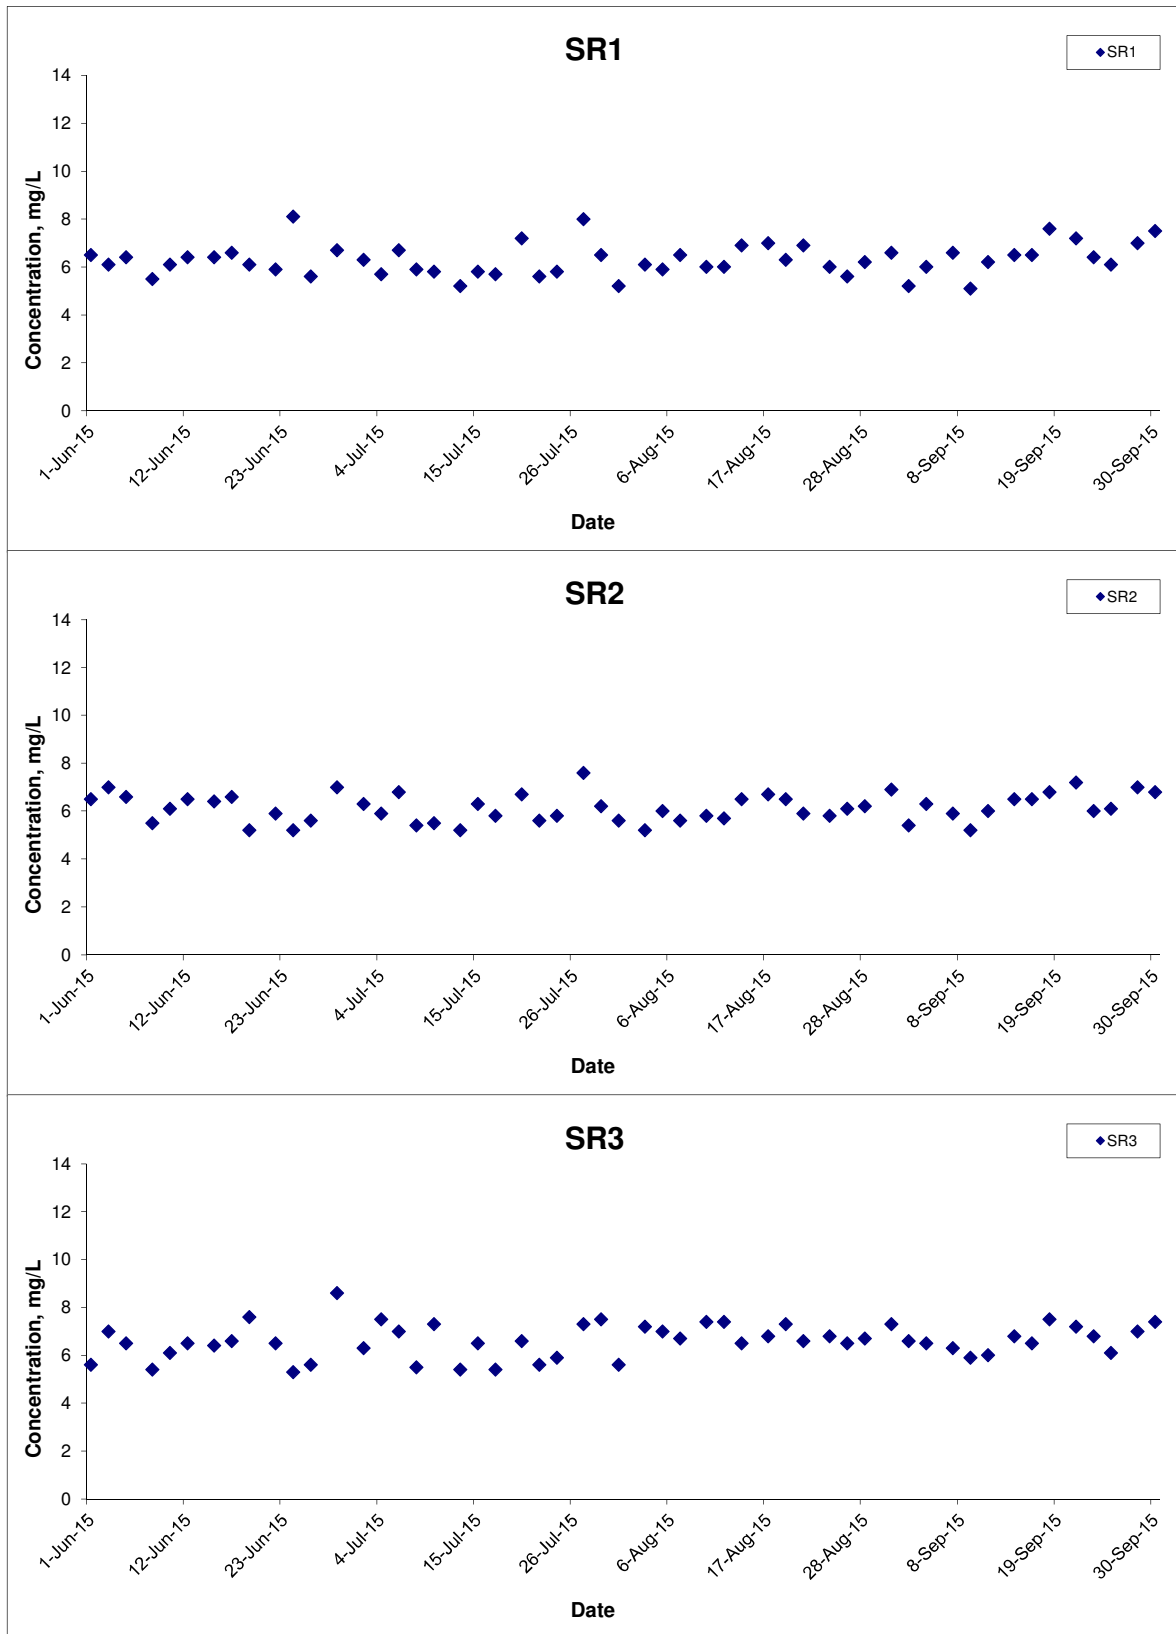


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

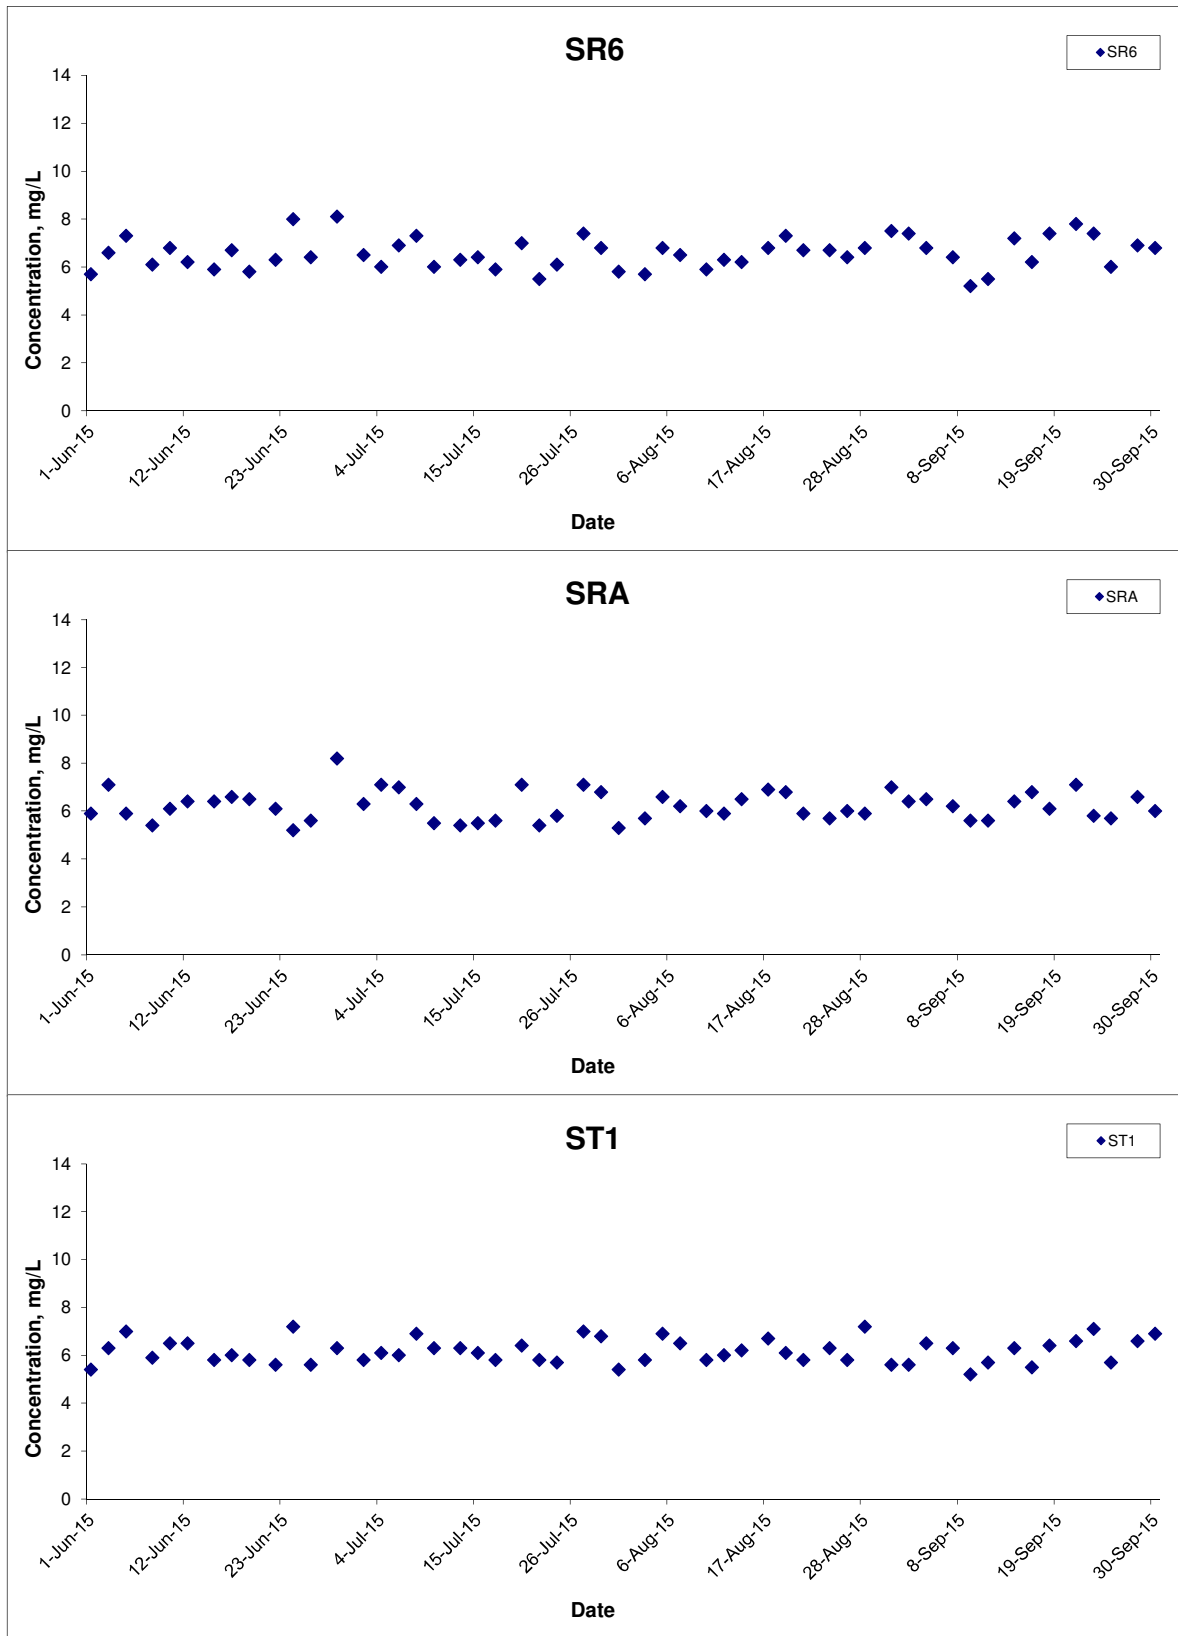


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H




Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

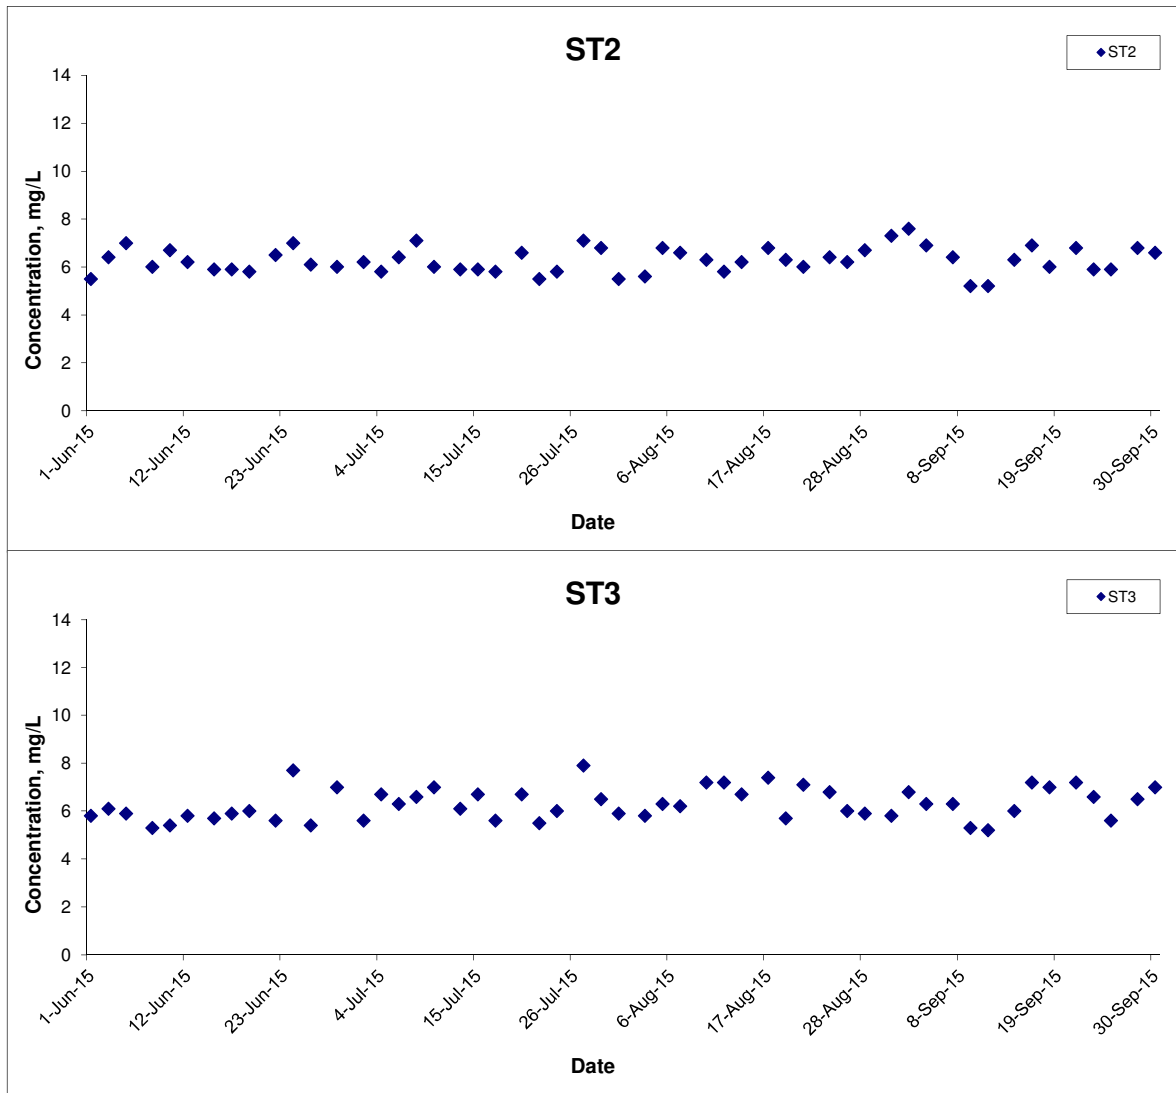

Title	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill	Scale	N.T.S	Project No.	MA12014	CINOTECH
	Graphical Presentation of Water Quality Monitoring Results	Date	Sep 15	Appendix	H	

Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

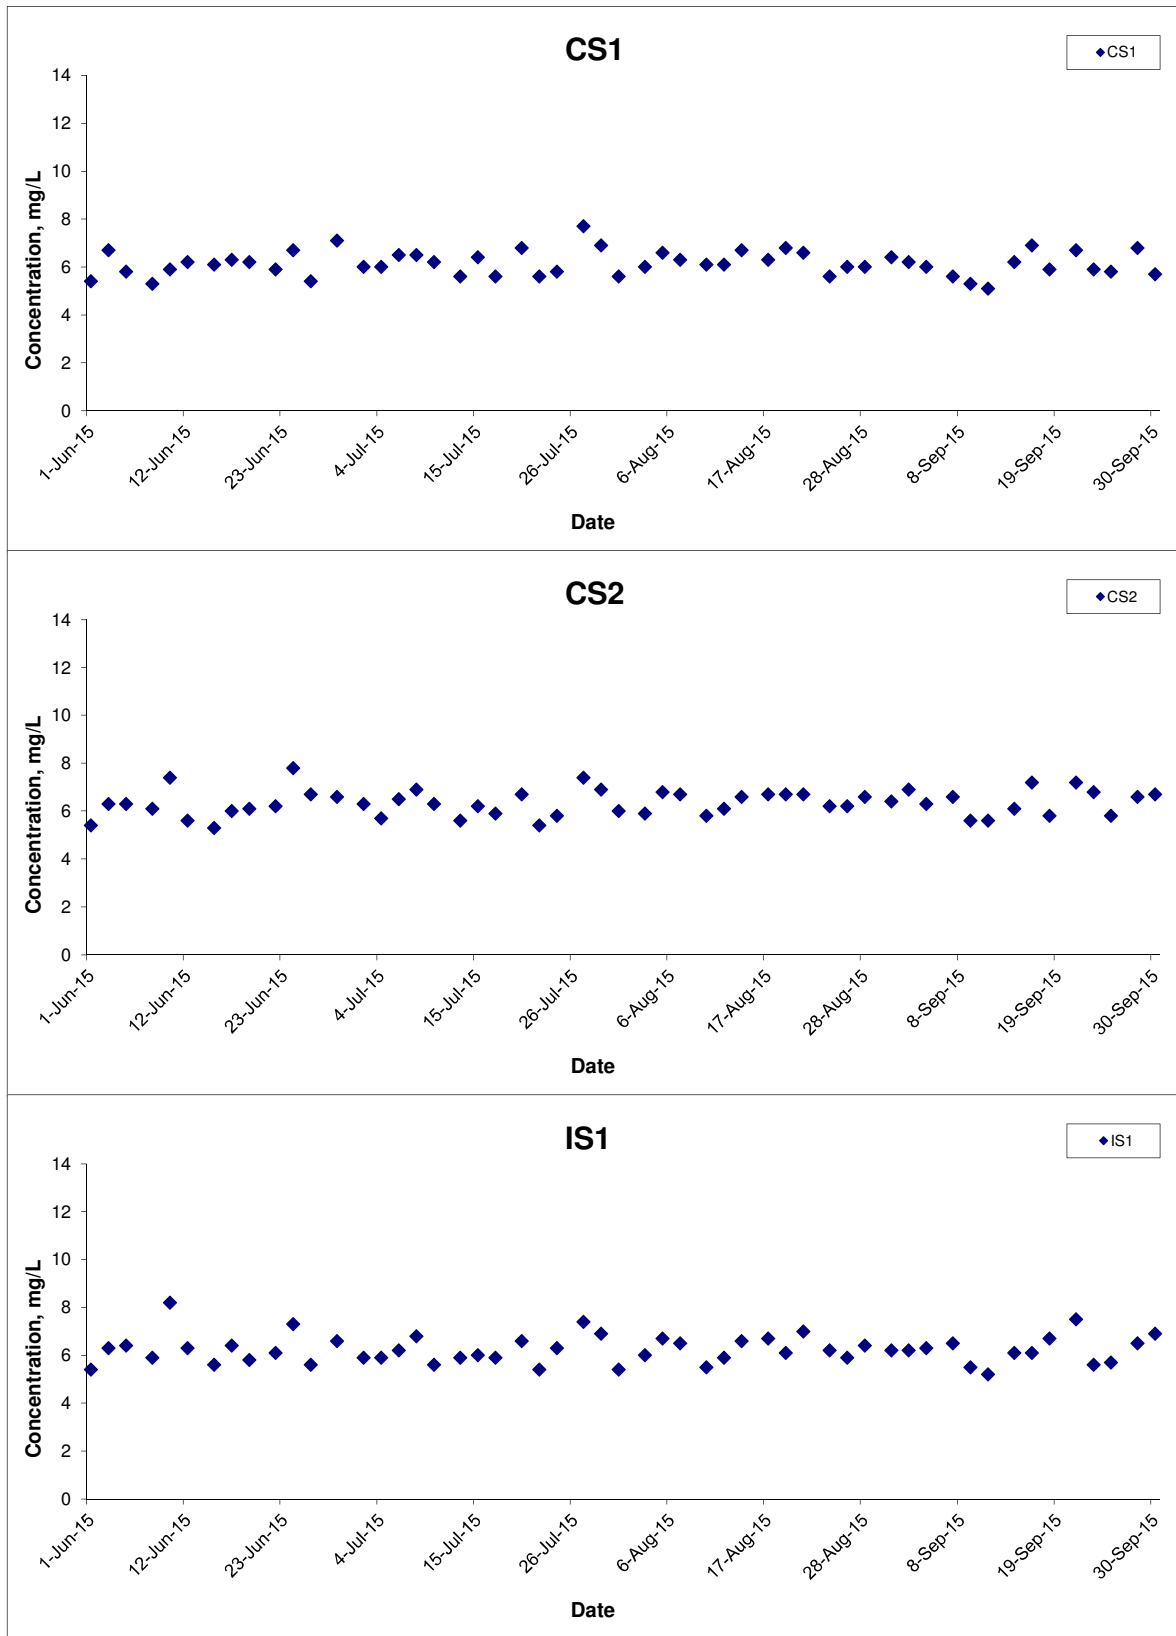


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

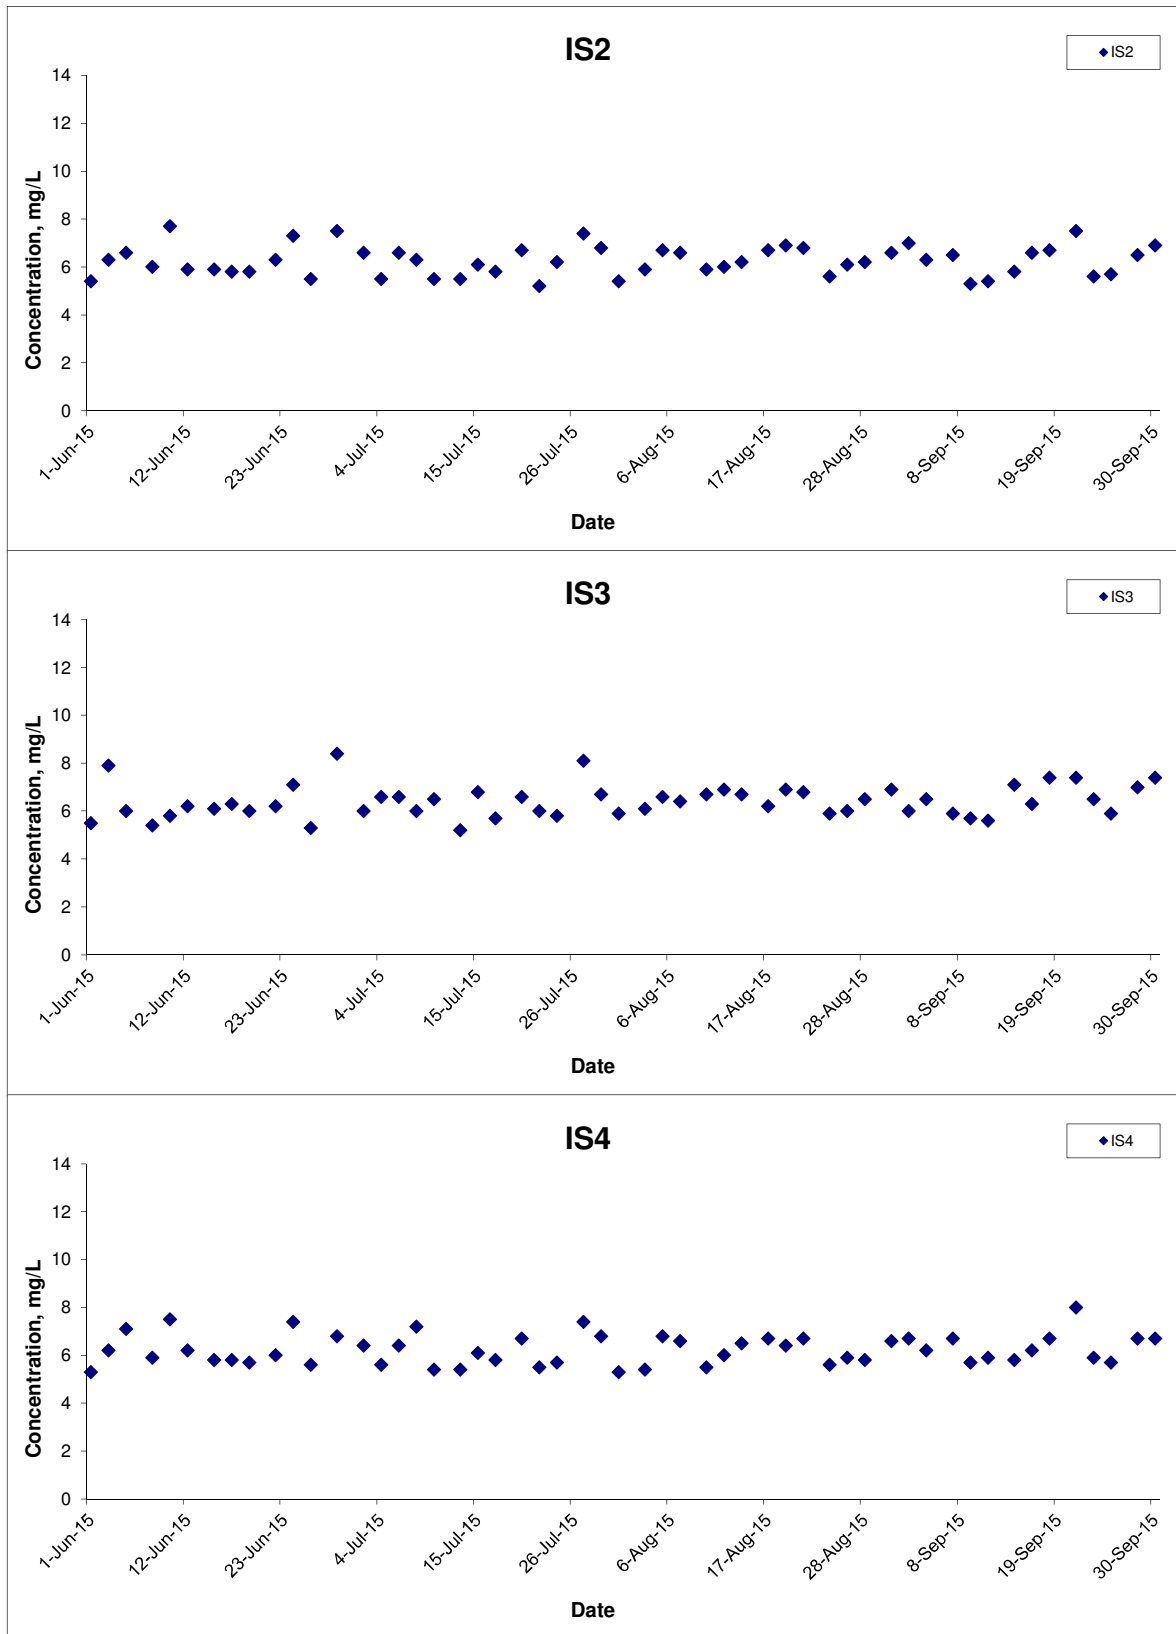


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

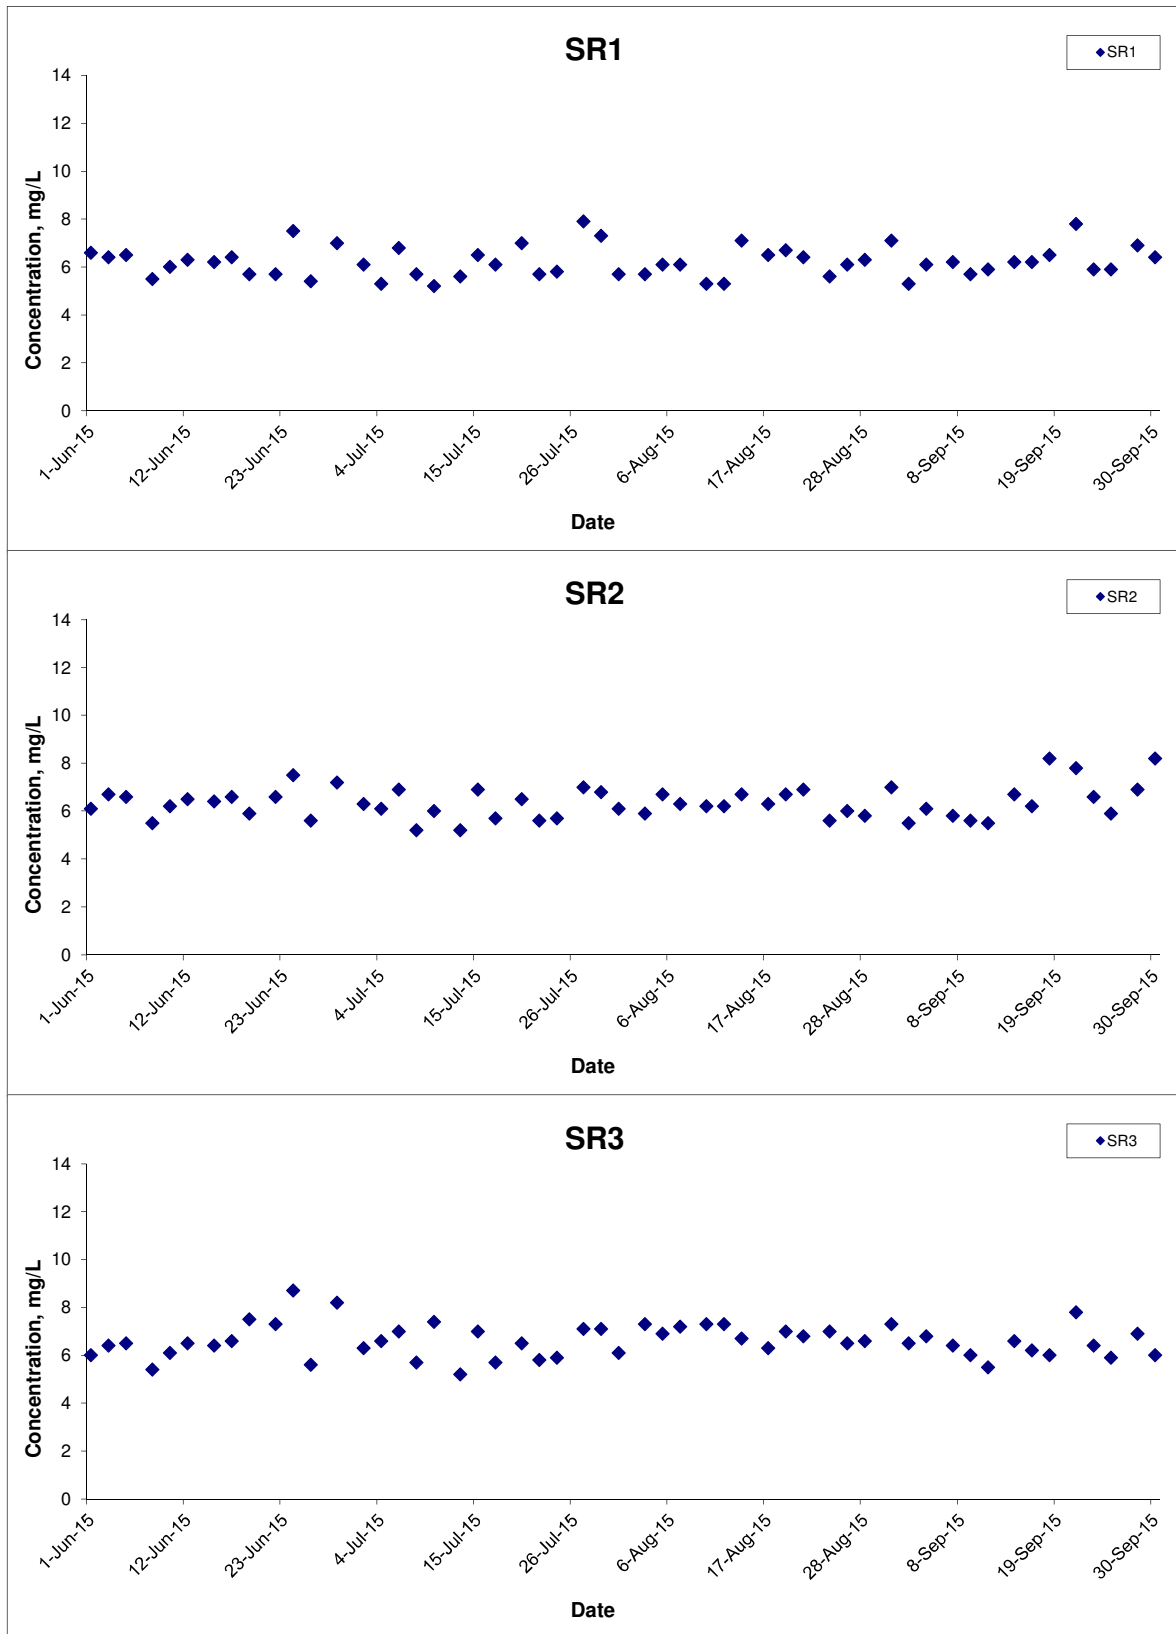


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

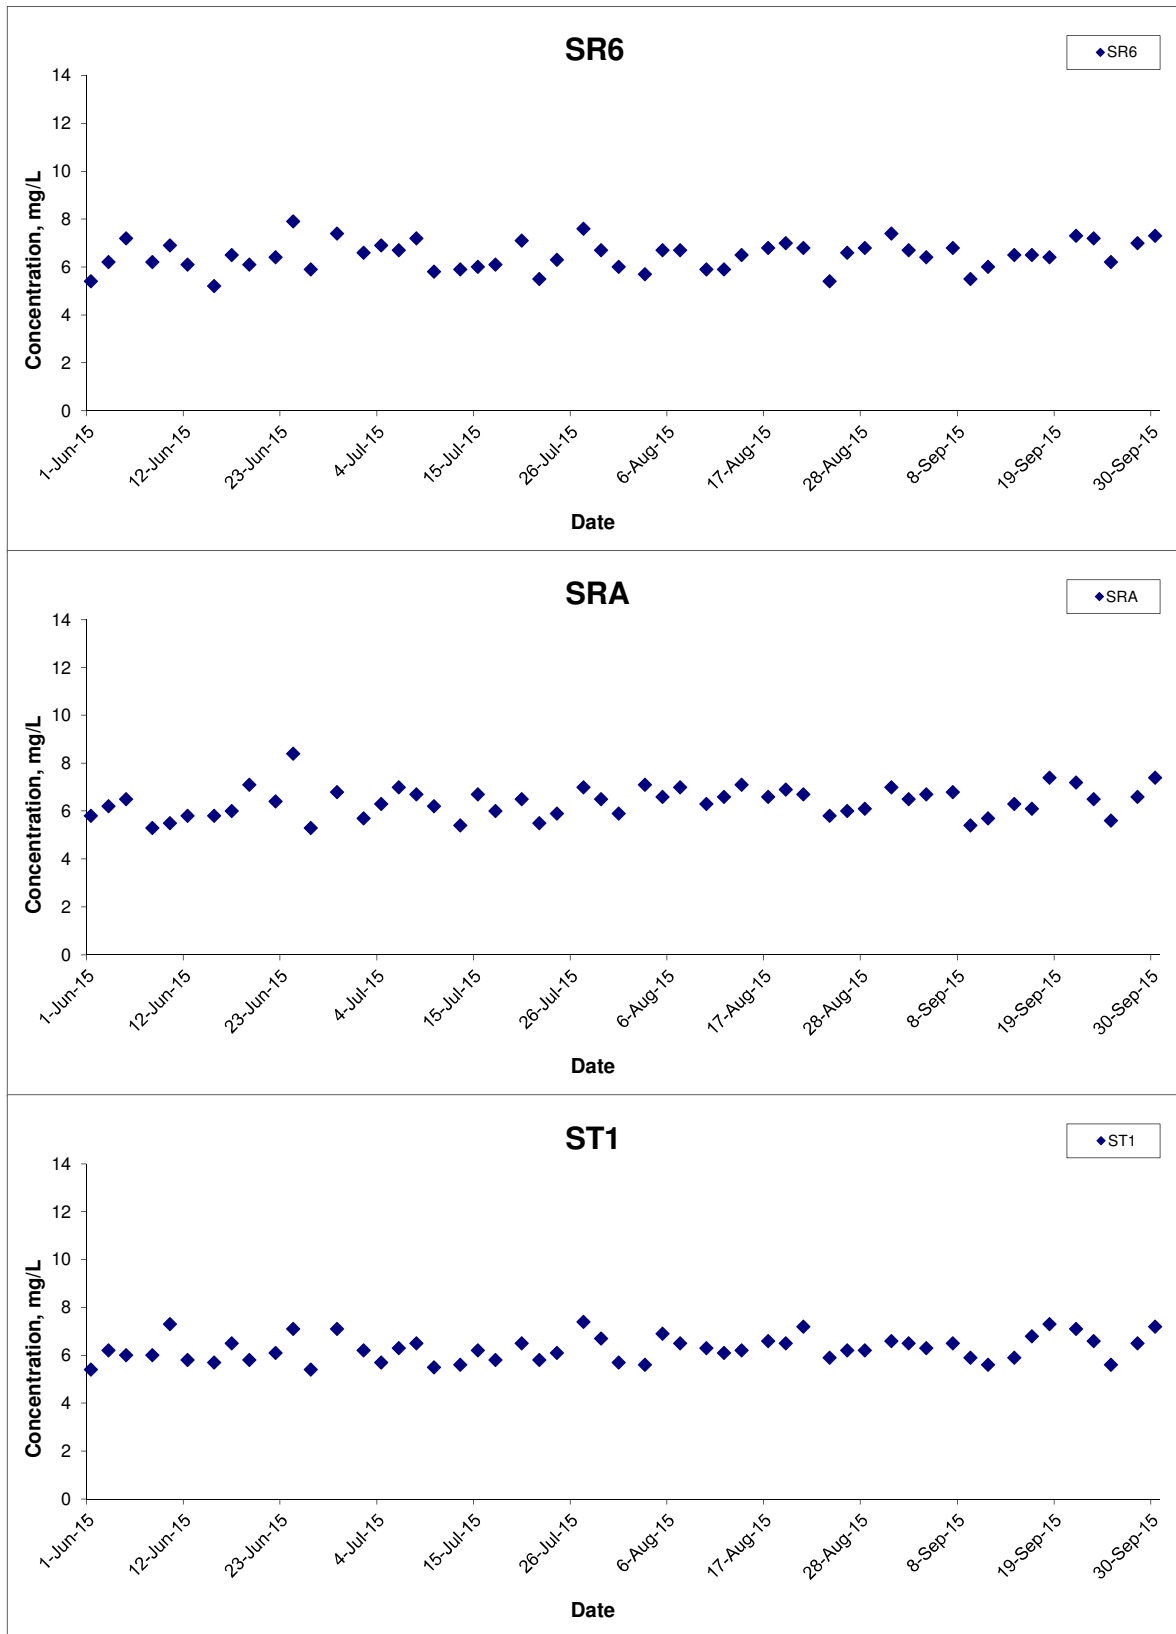


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H




Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

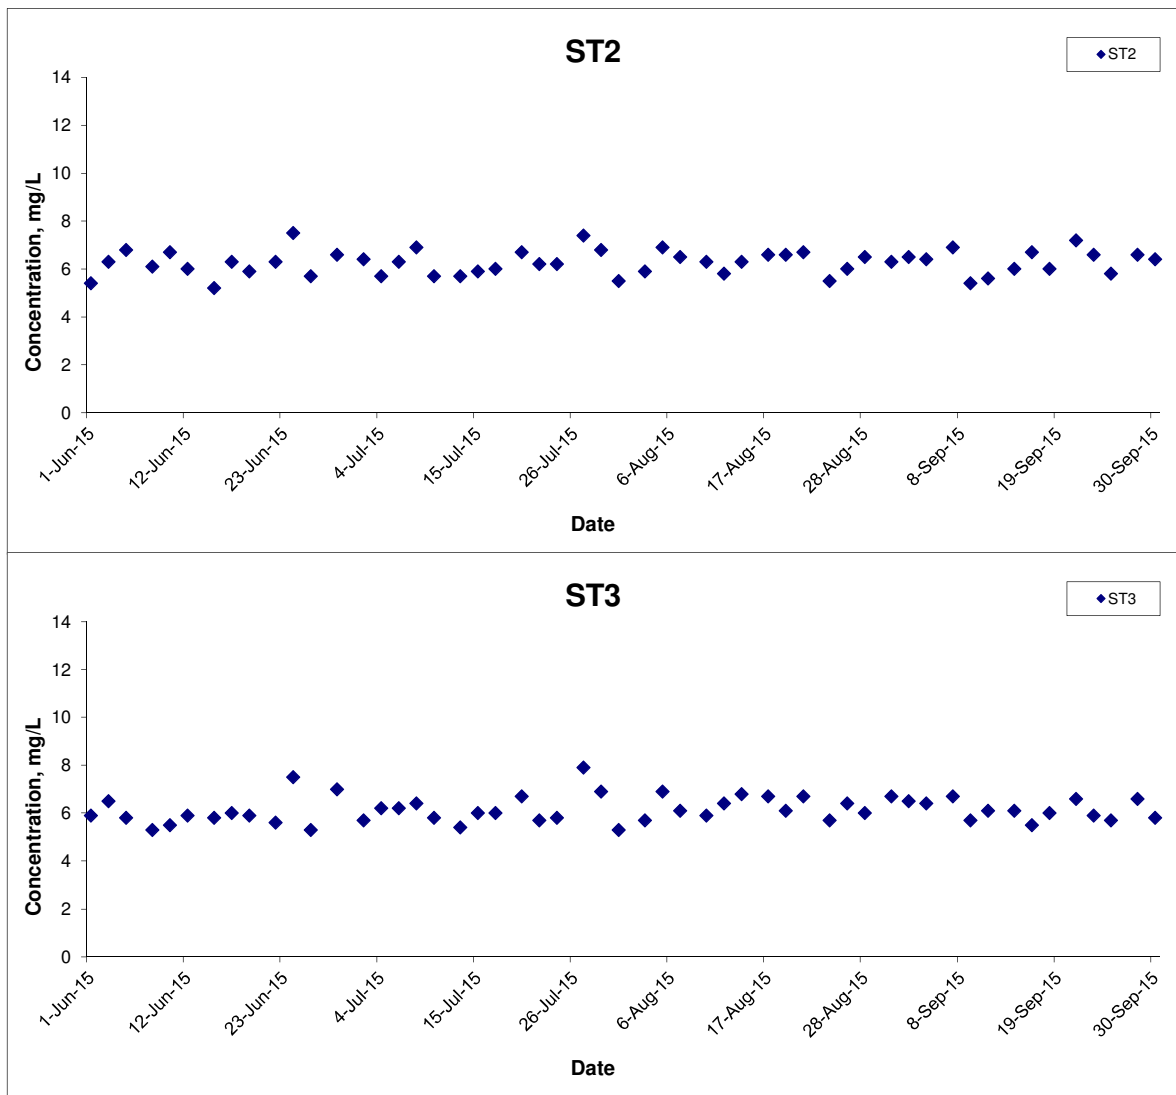

Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill Graphical Presentation of Water Quality Monitoring Results	Scale N.T.S	Project No. MA12014	
	Date Sep 15	Appendix H	

Dissolved Oxygen (Bottom) at Mid-Ebb Tide

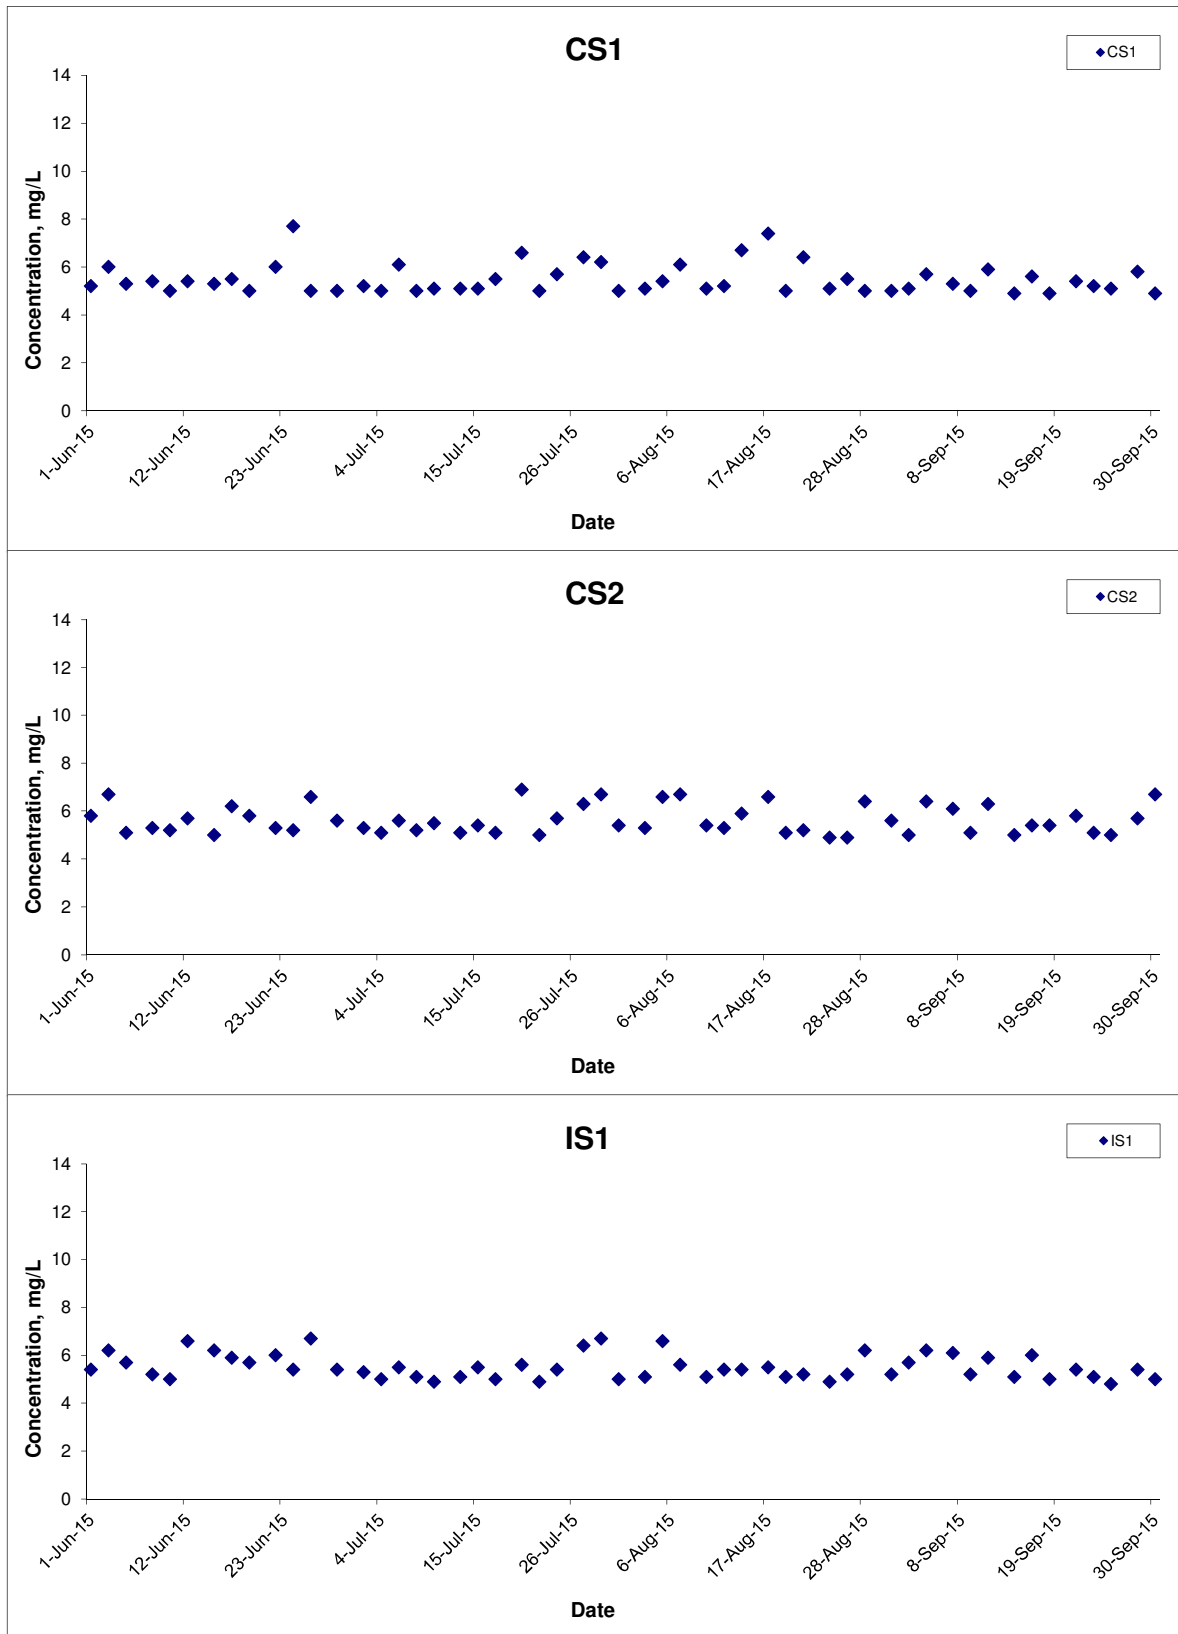


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Ebb Tide

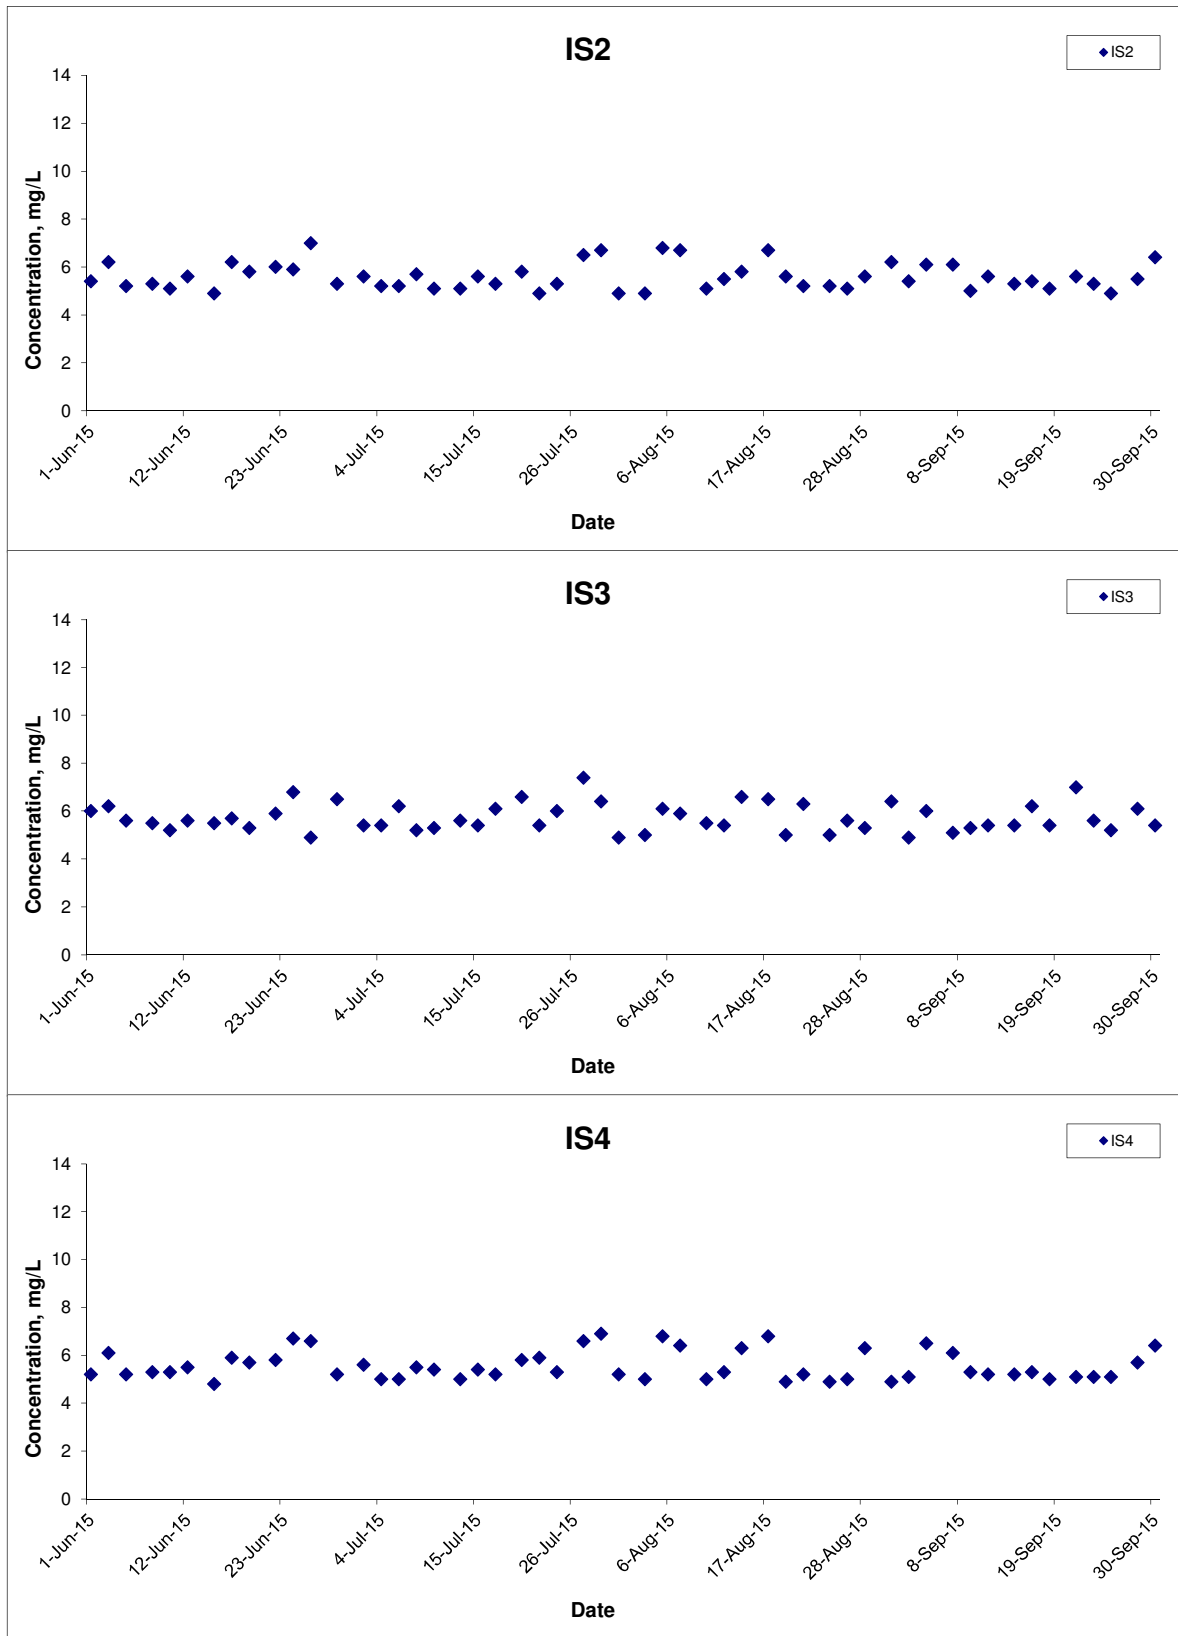


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Ebb Tide

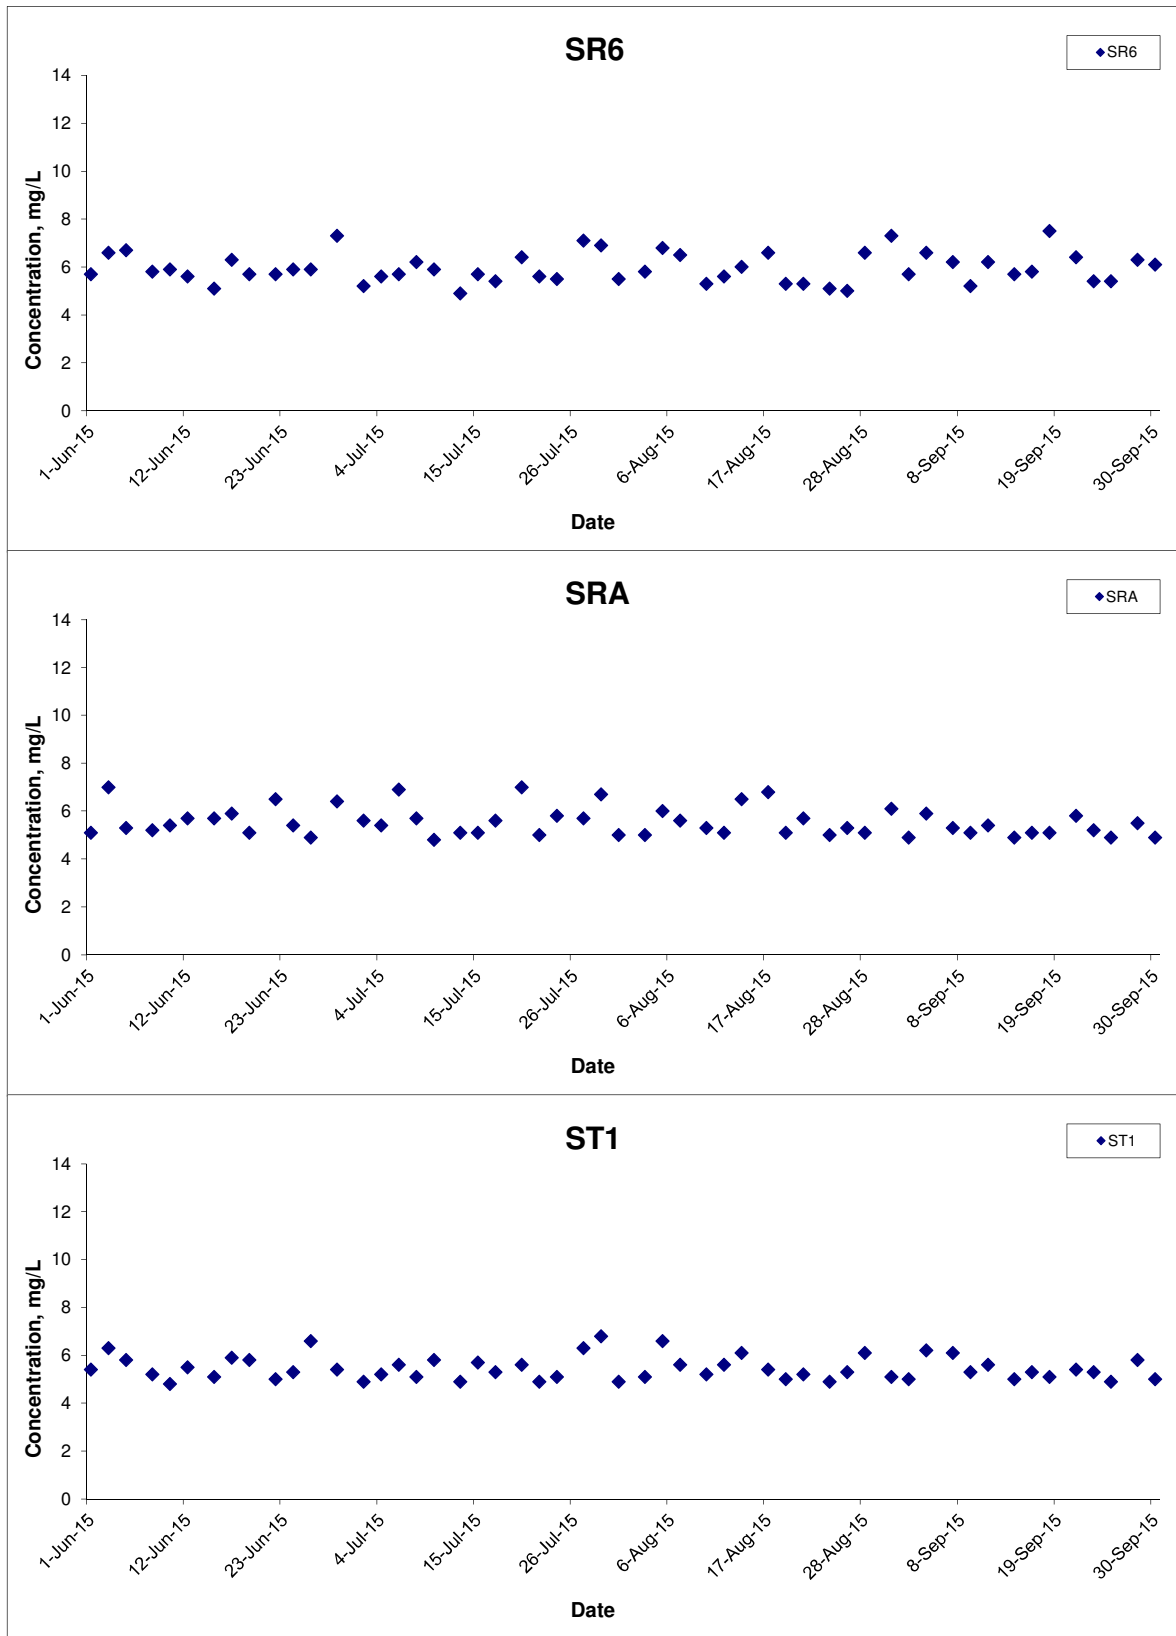


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Ebb Tide

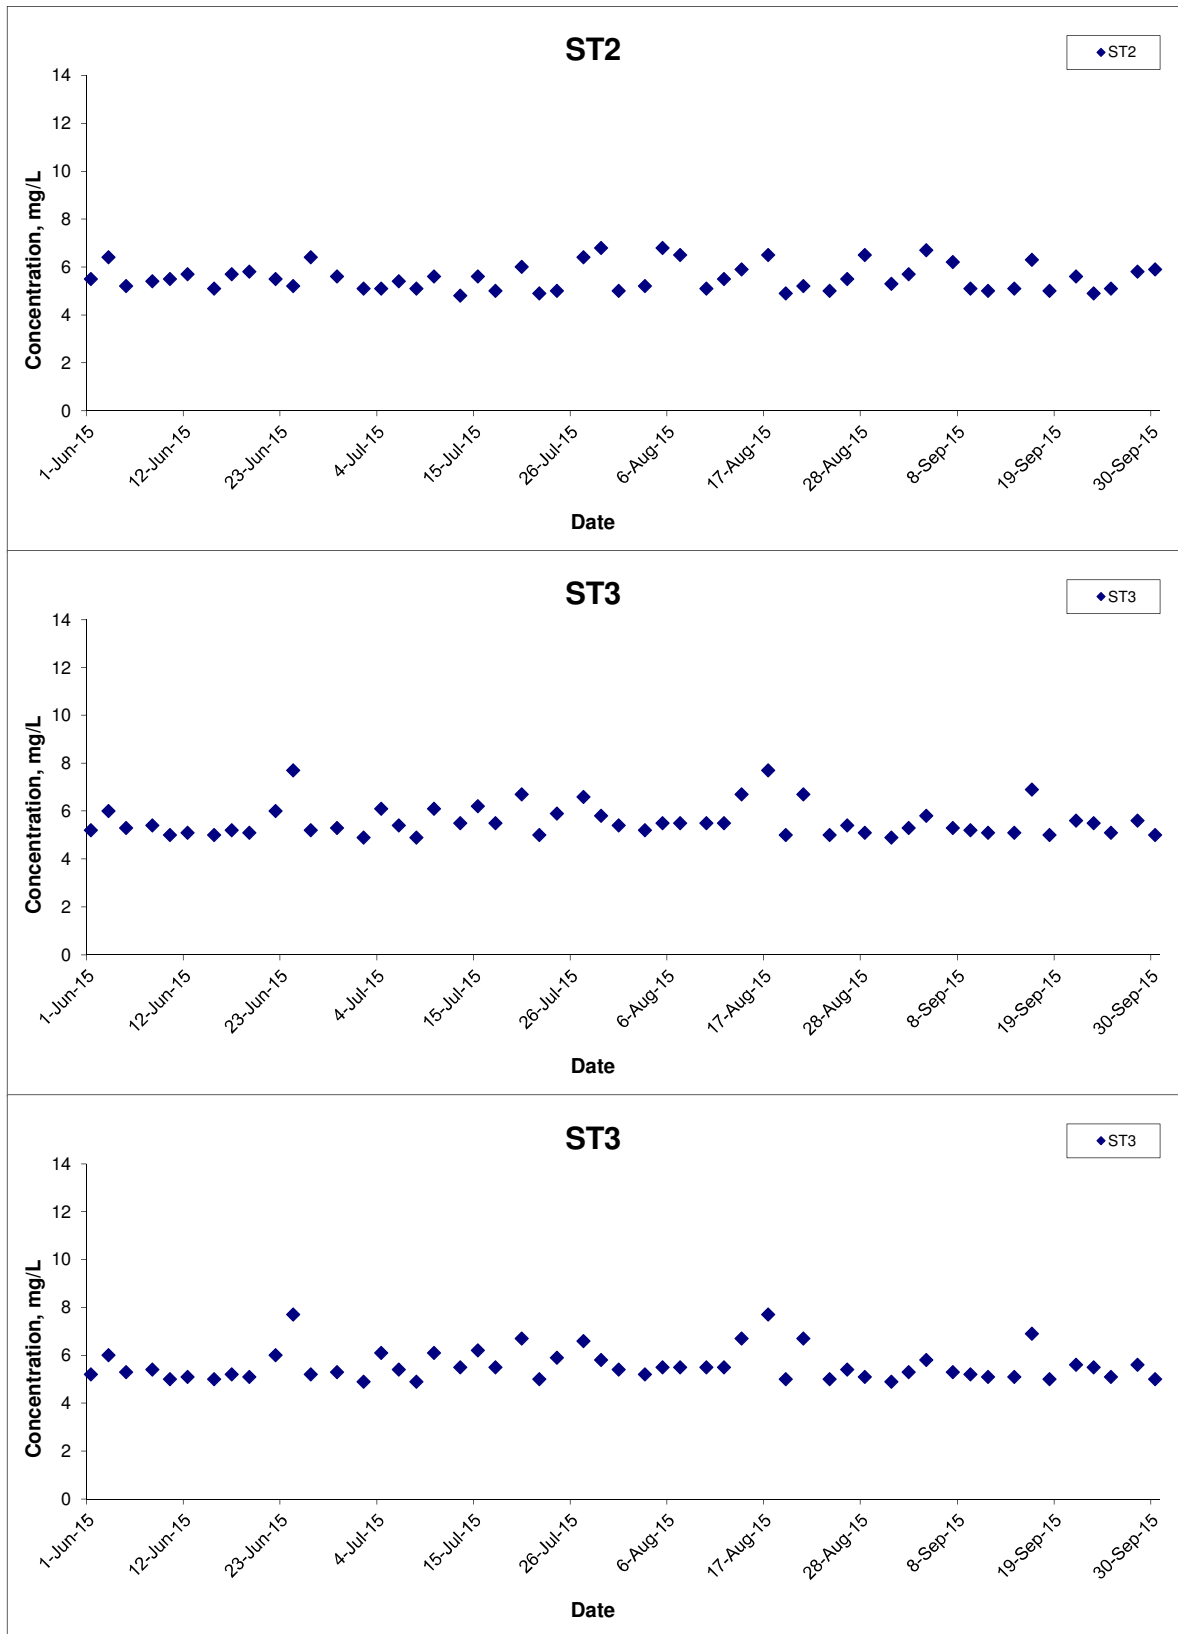


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Flood Tide

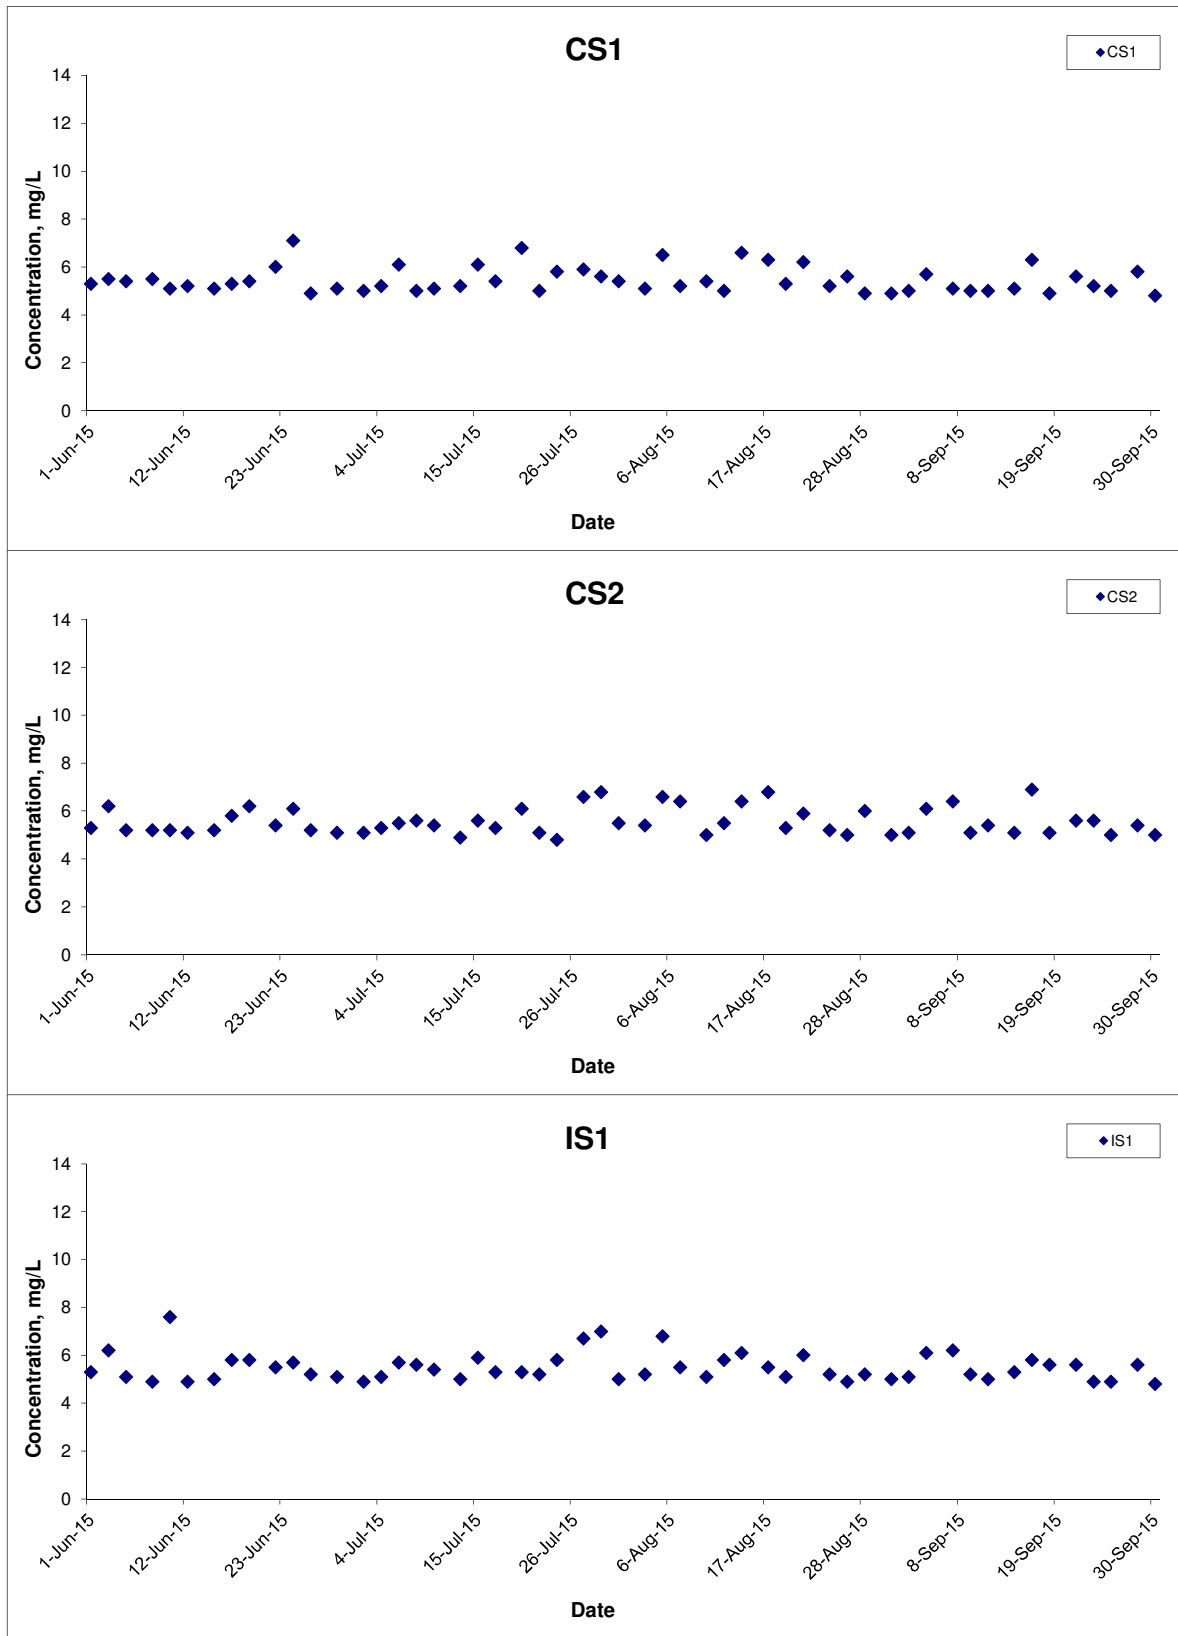


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Flood Tide

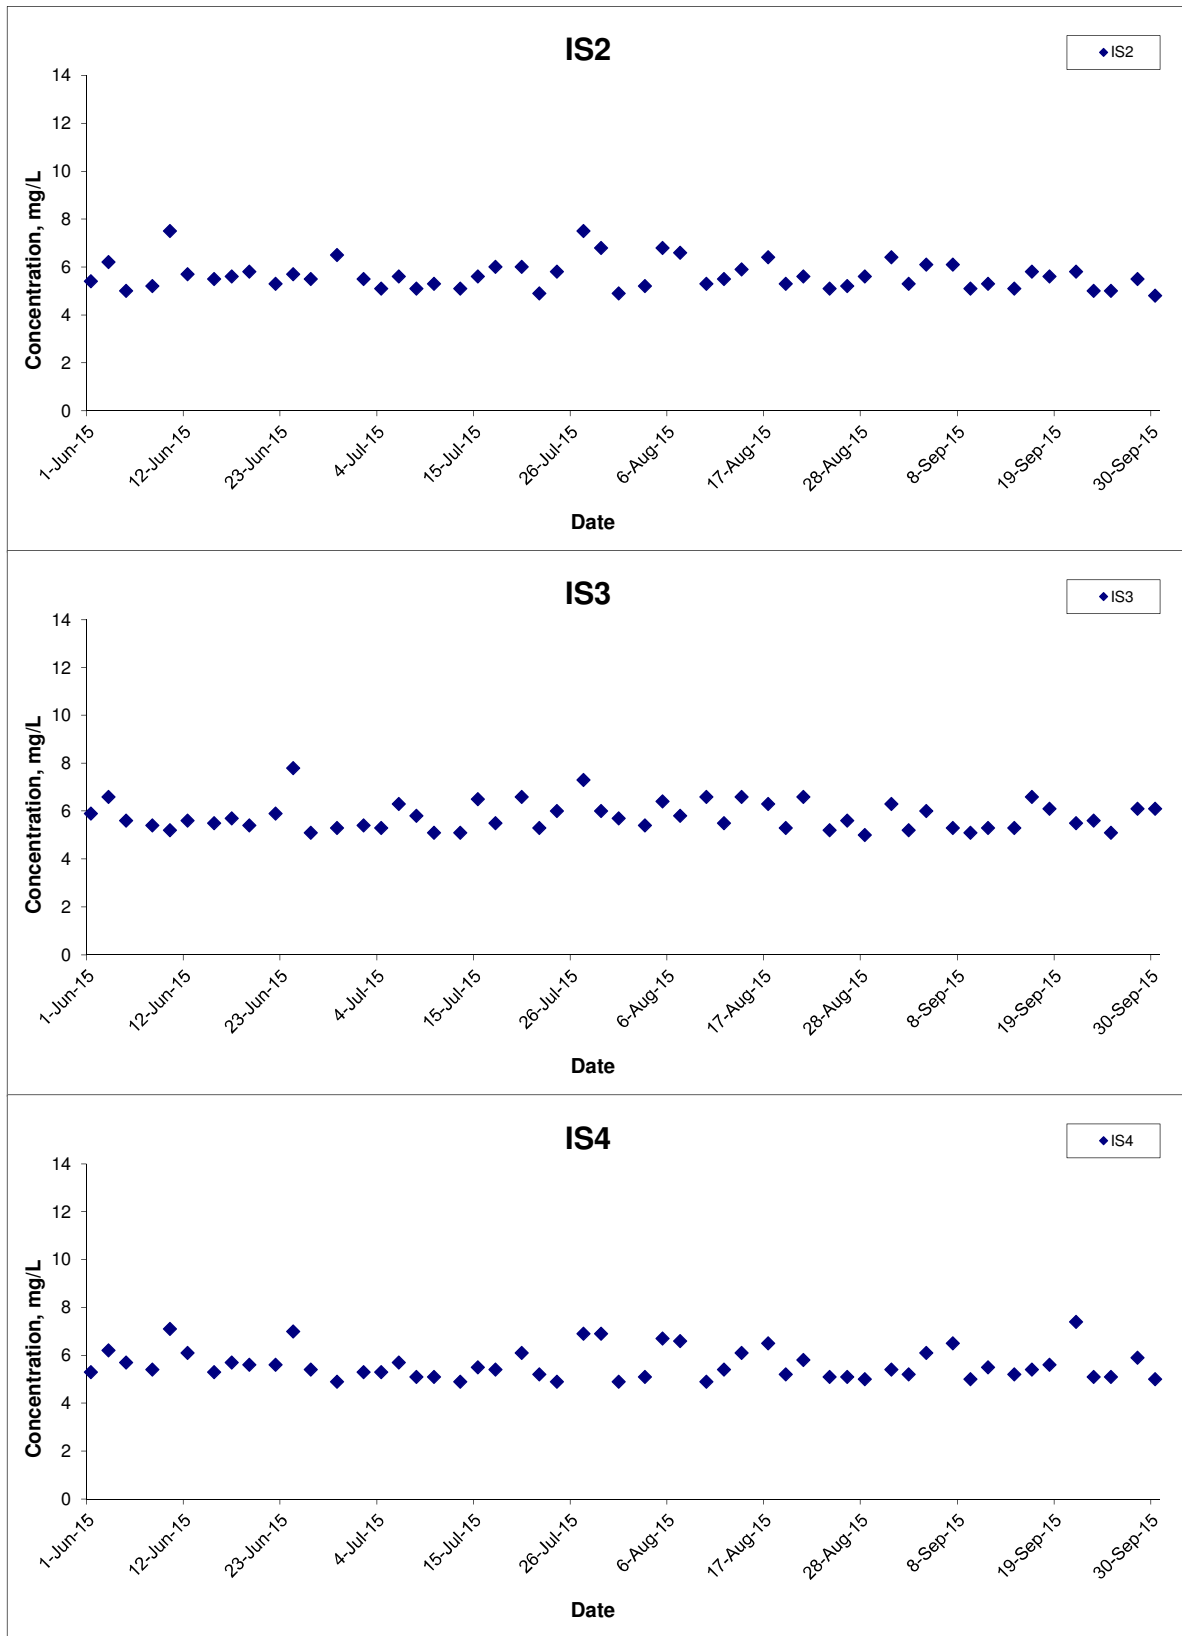


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Flood Tide

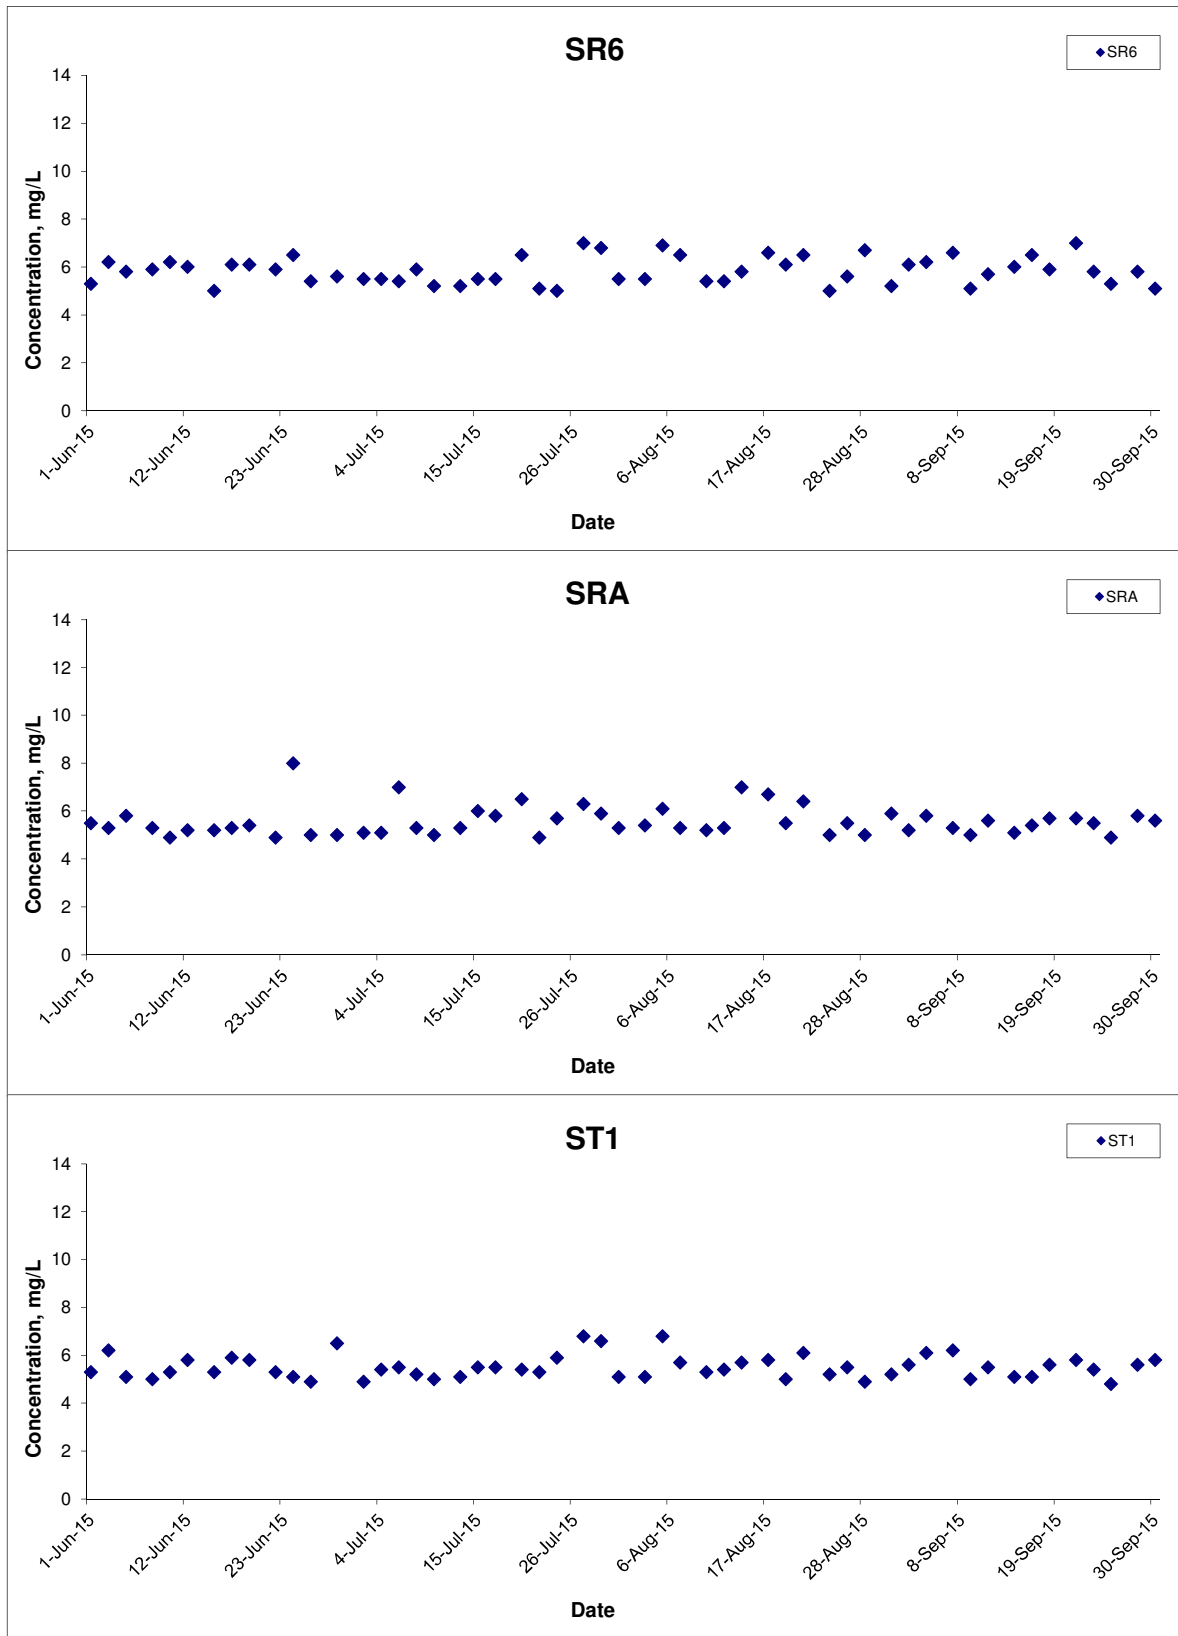


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H




Dissolved Oxygen (Bottom) at Mid-Flood Tide

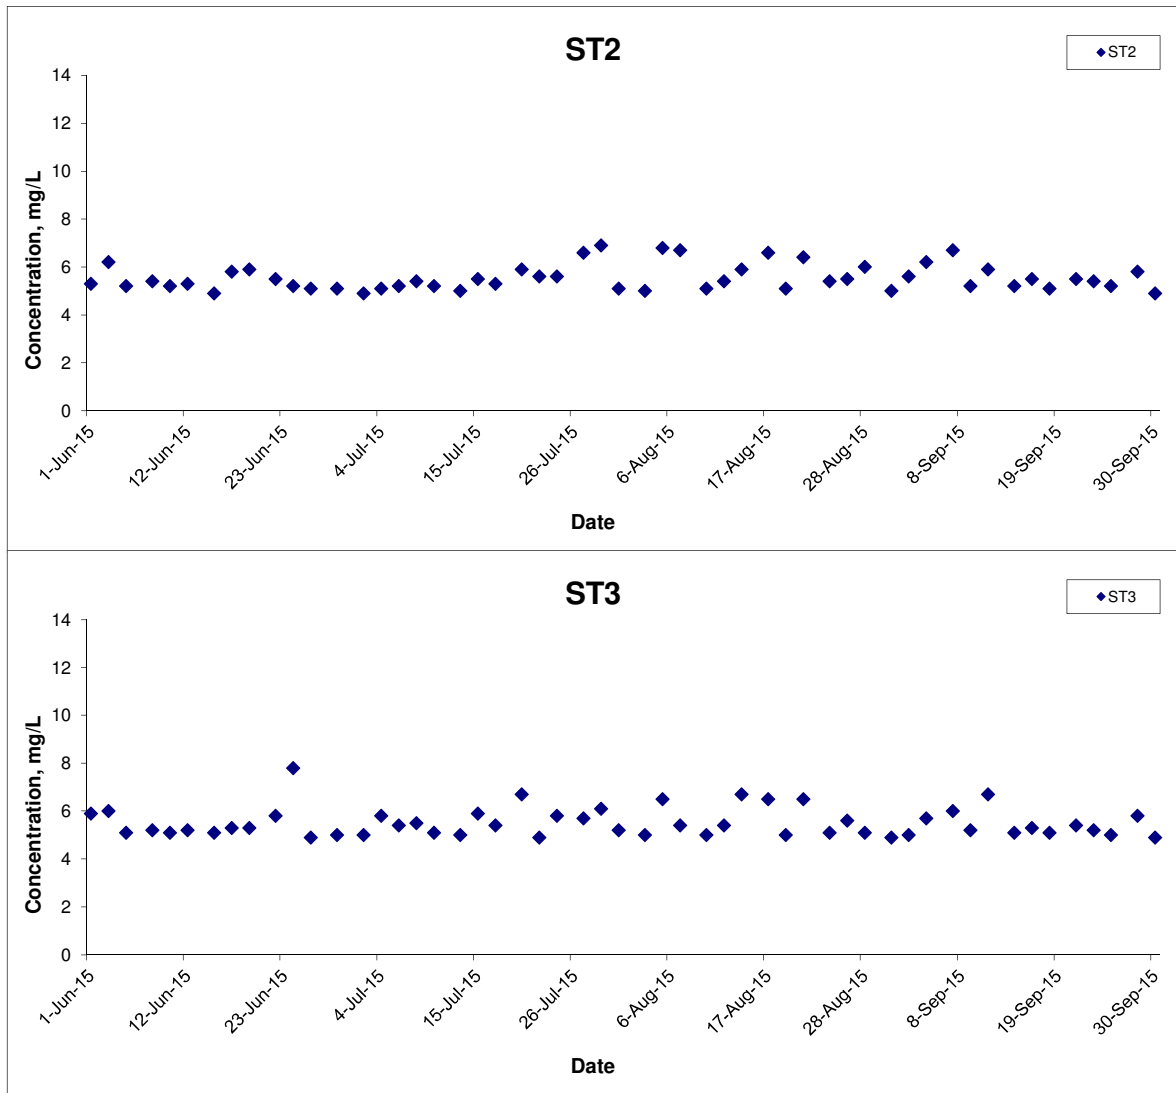

Title	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill	Scale	N.T.S	Project No.	MA12014	CINOTECH
	Graphical Presentation of Water Quality Monitoring Results	Date	Sep 15	Appendix	H	

Turbidity (Depth-averaged) at Mid-Ebb Tide

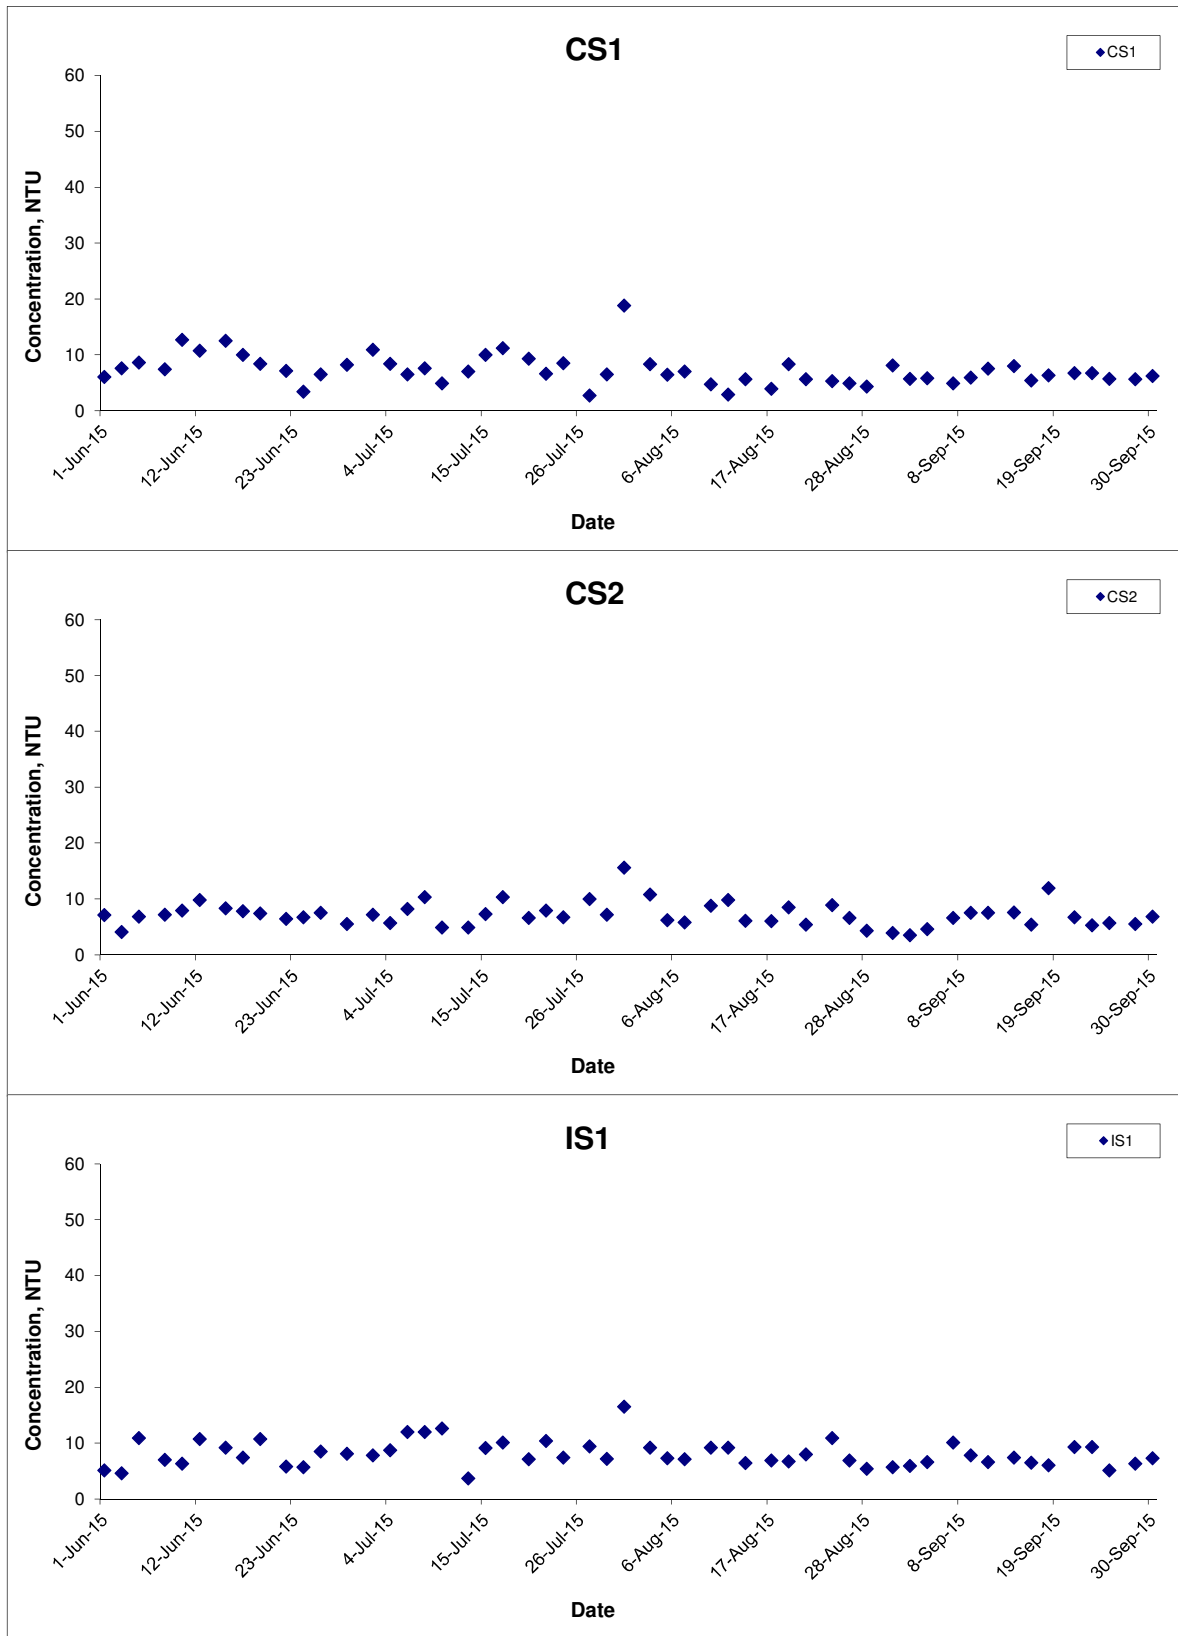


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Ebb Tide

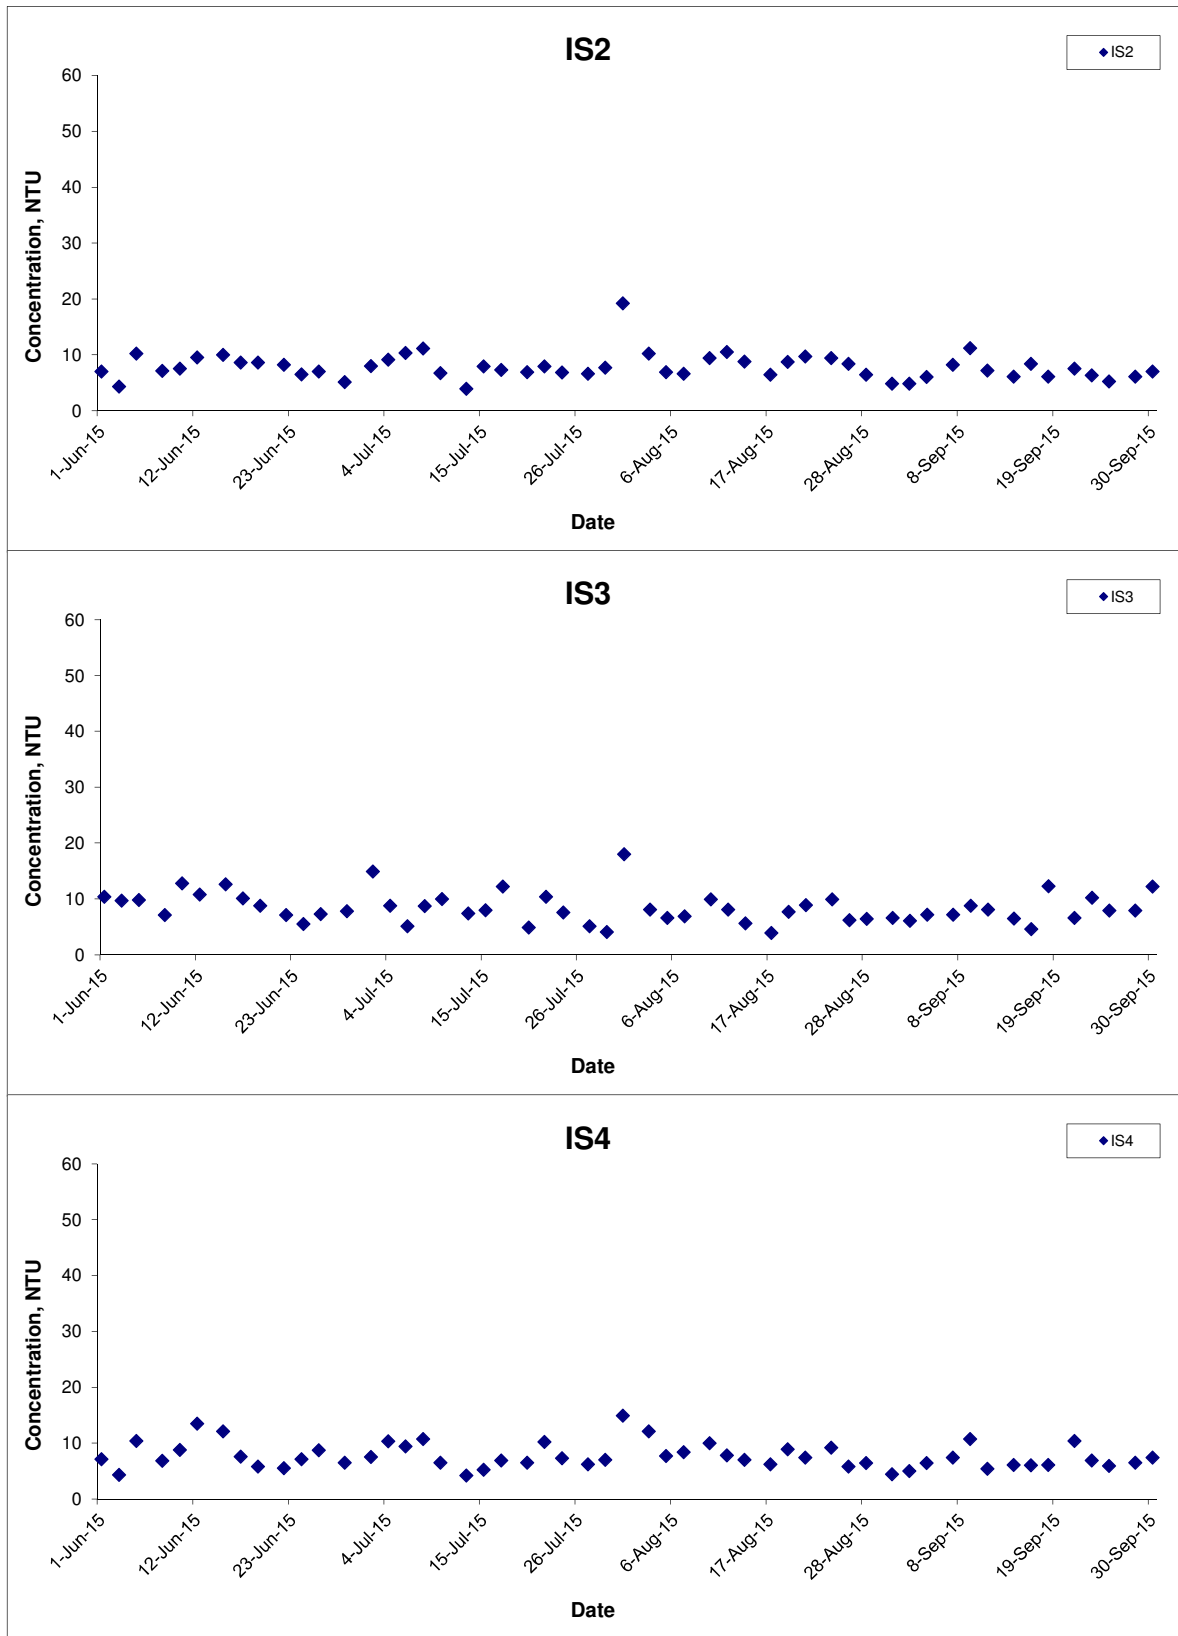


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Ebb Tide

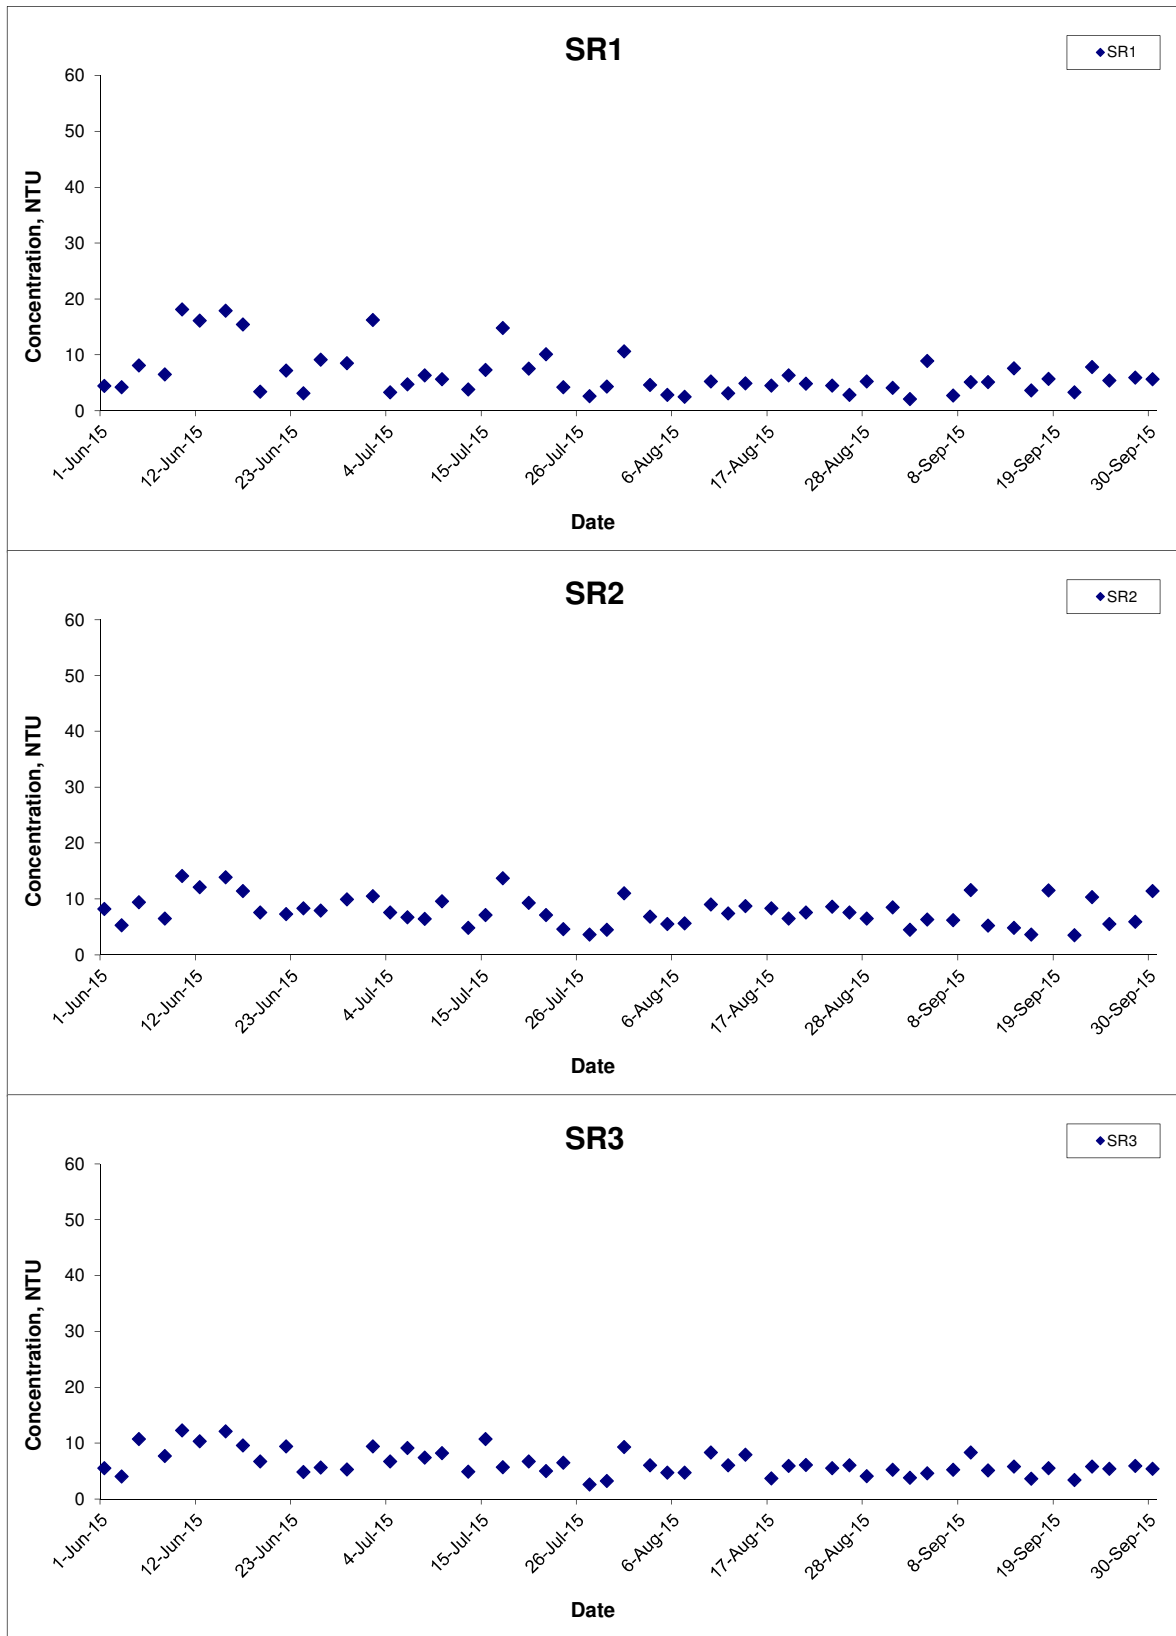


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Ebb Tide

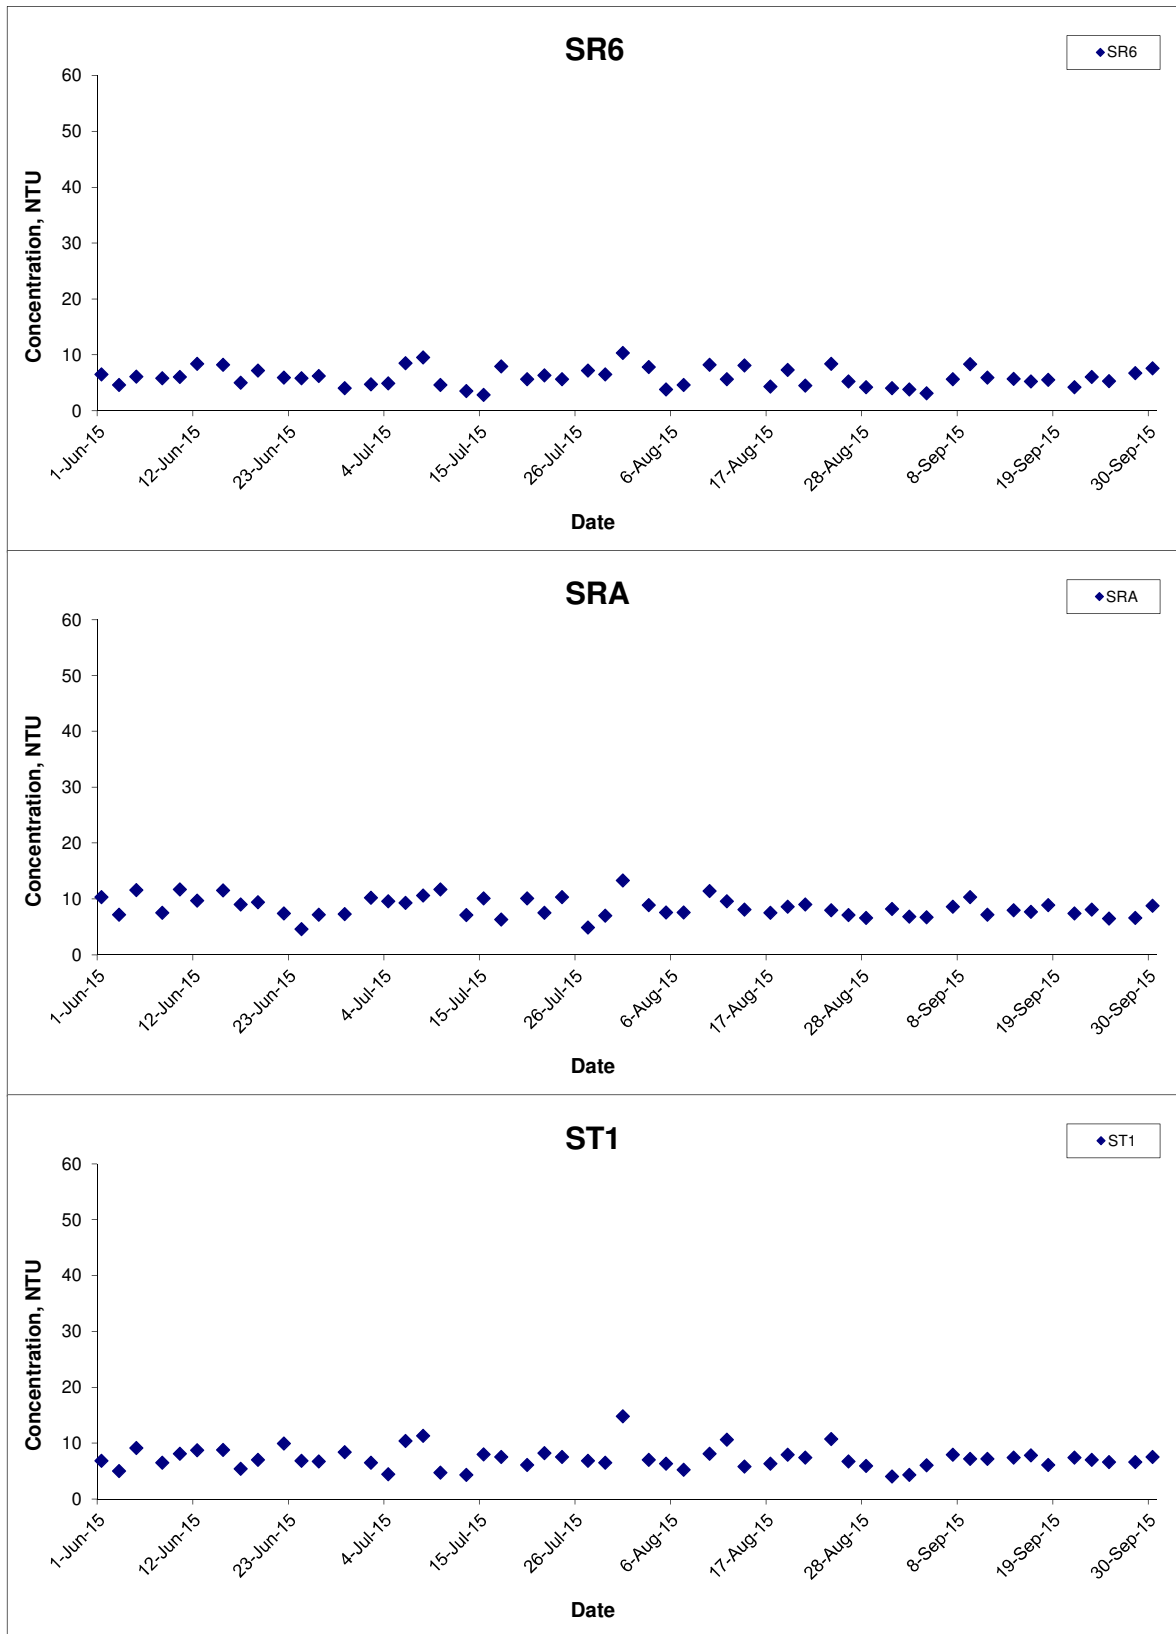


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Ebb Tide

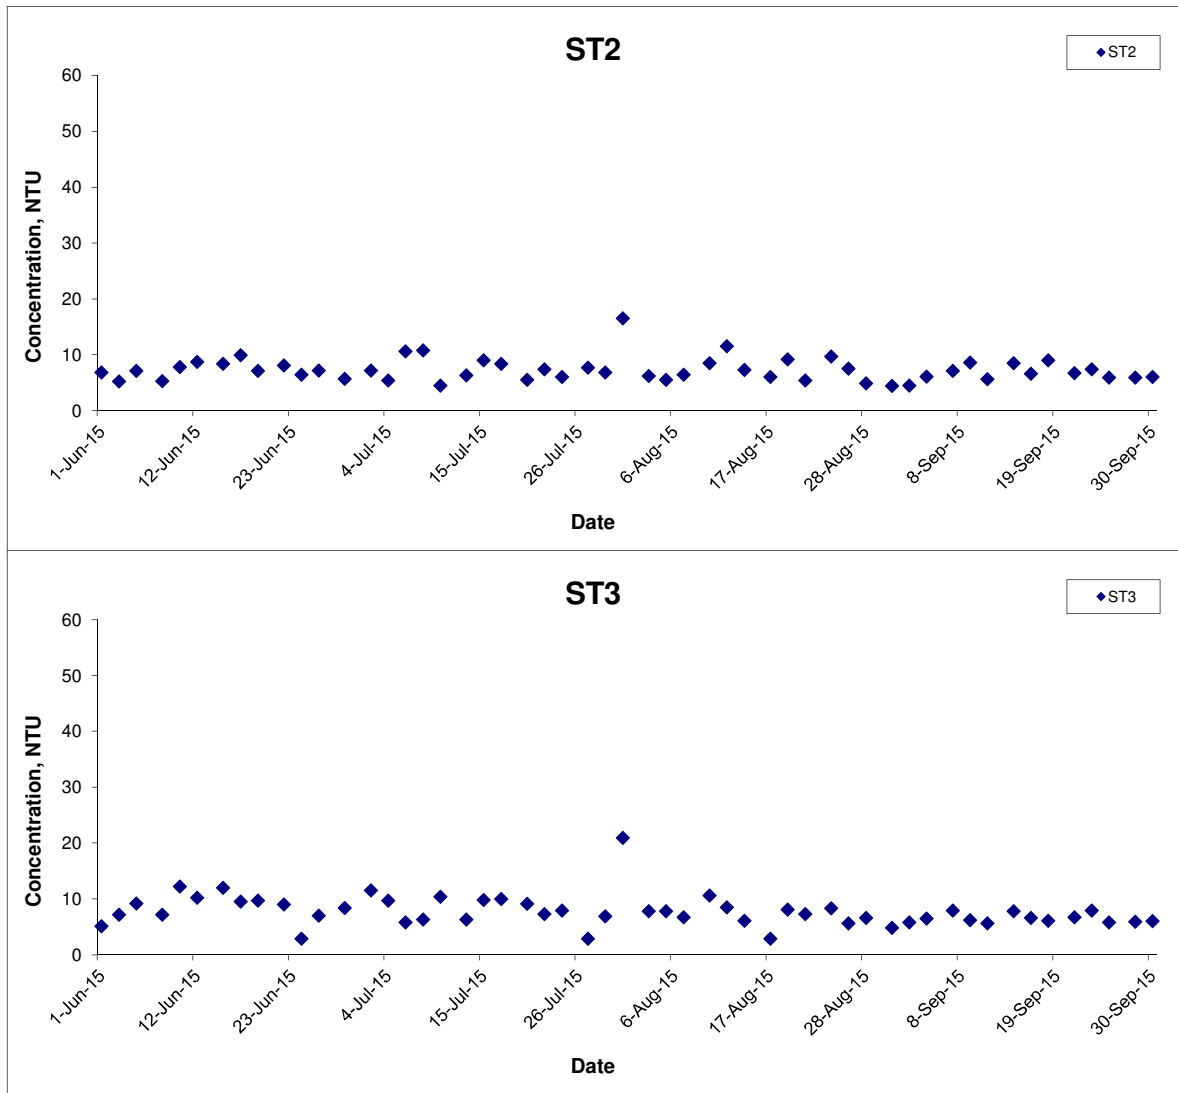


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Flood Tide

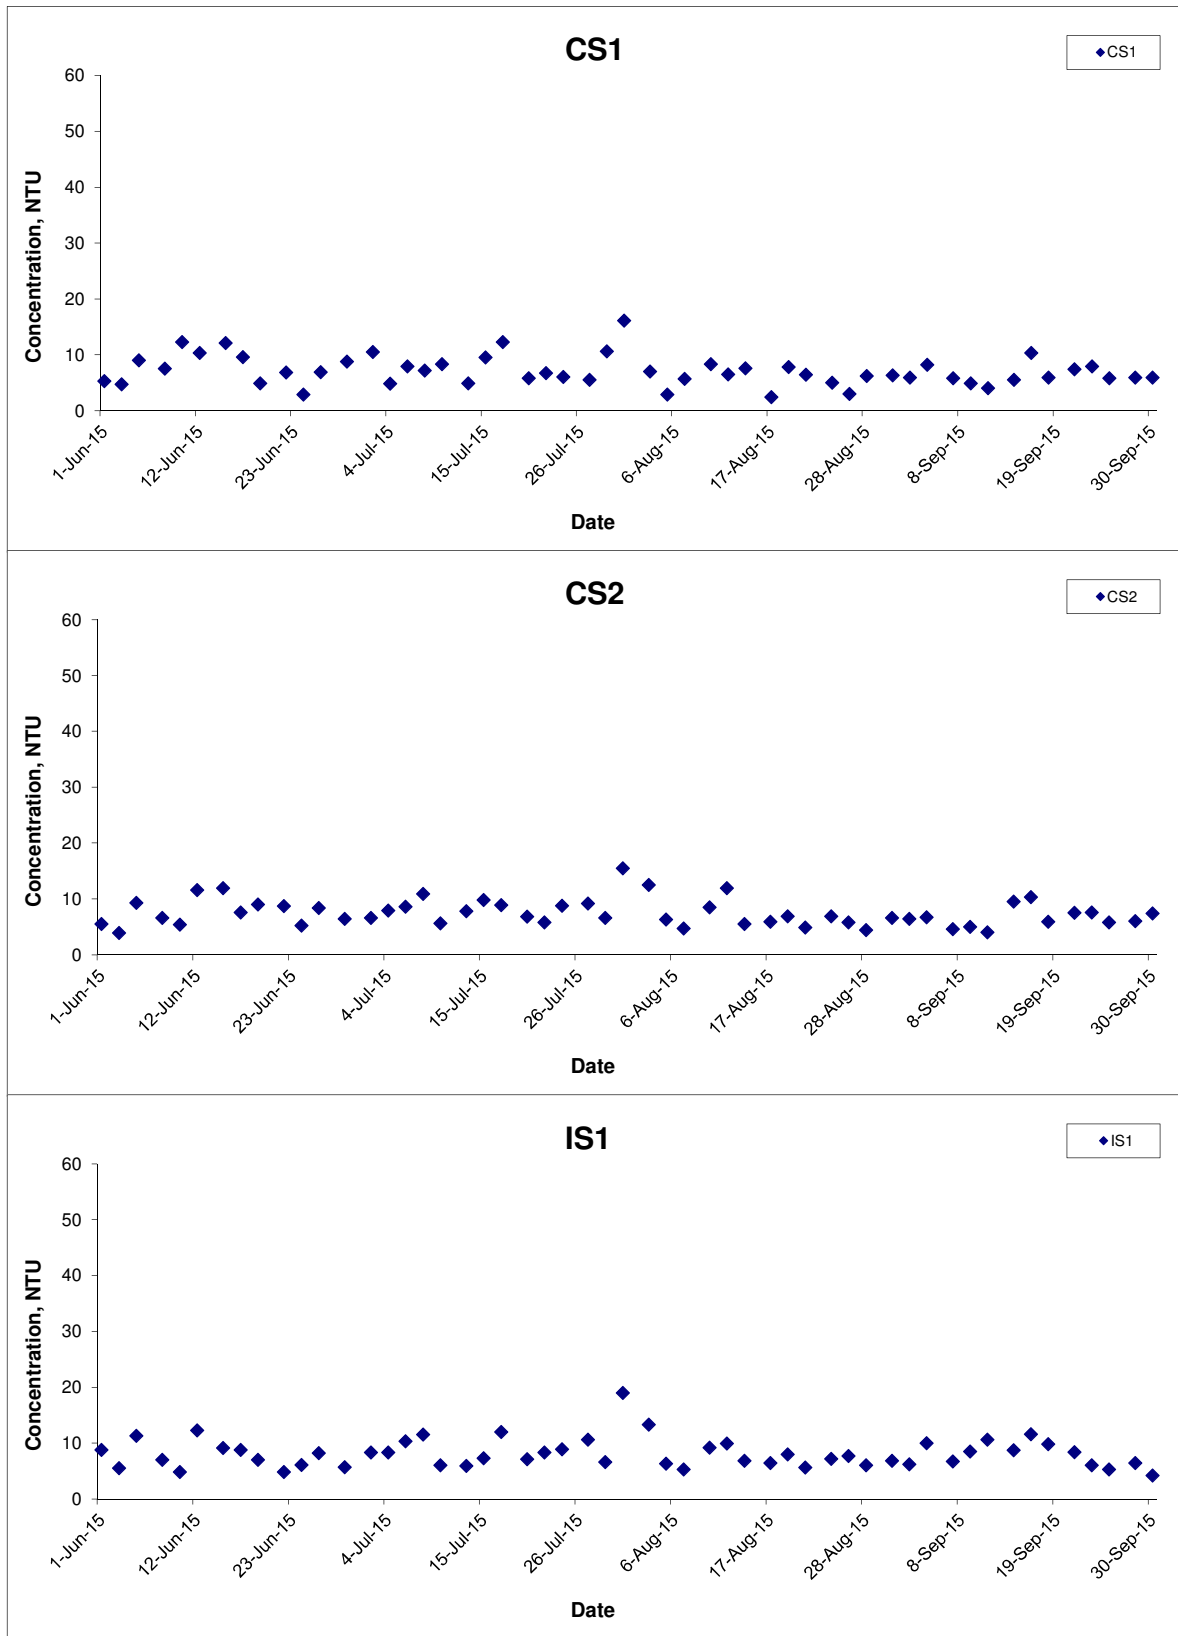


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Flood Tide

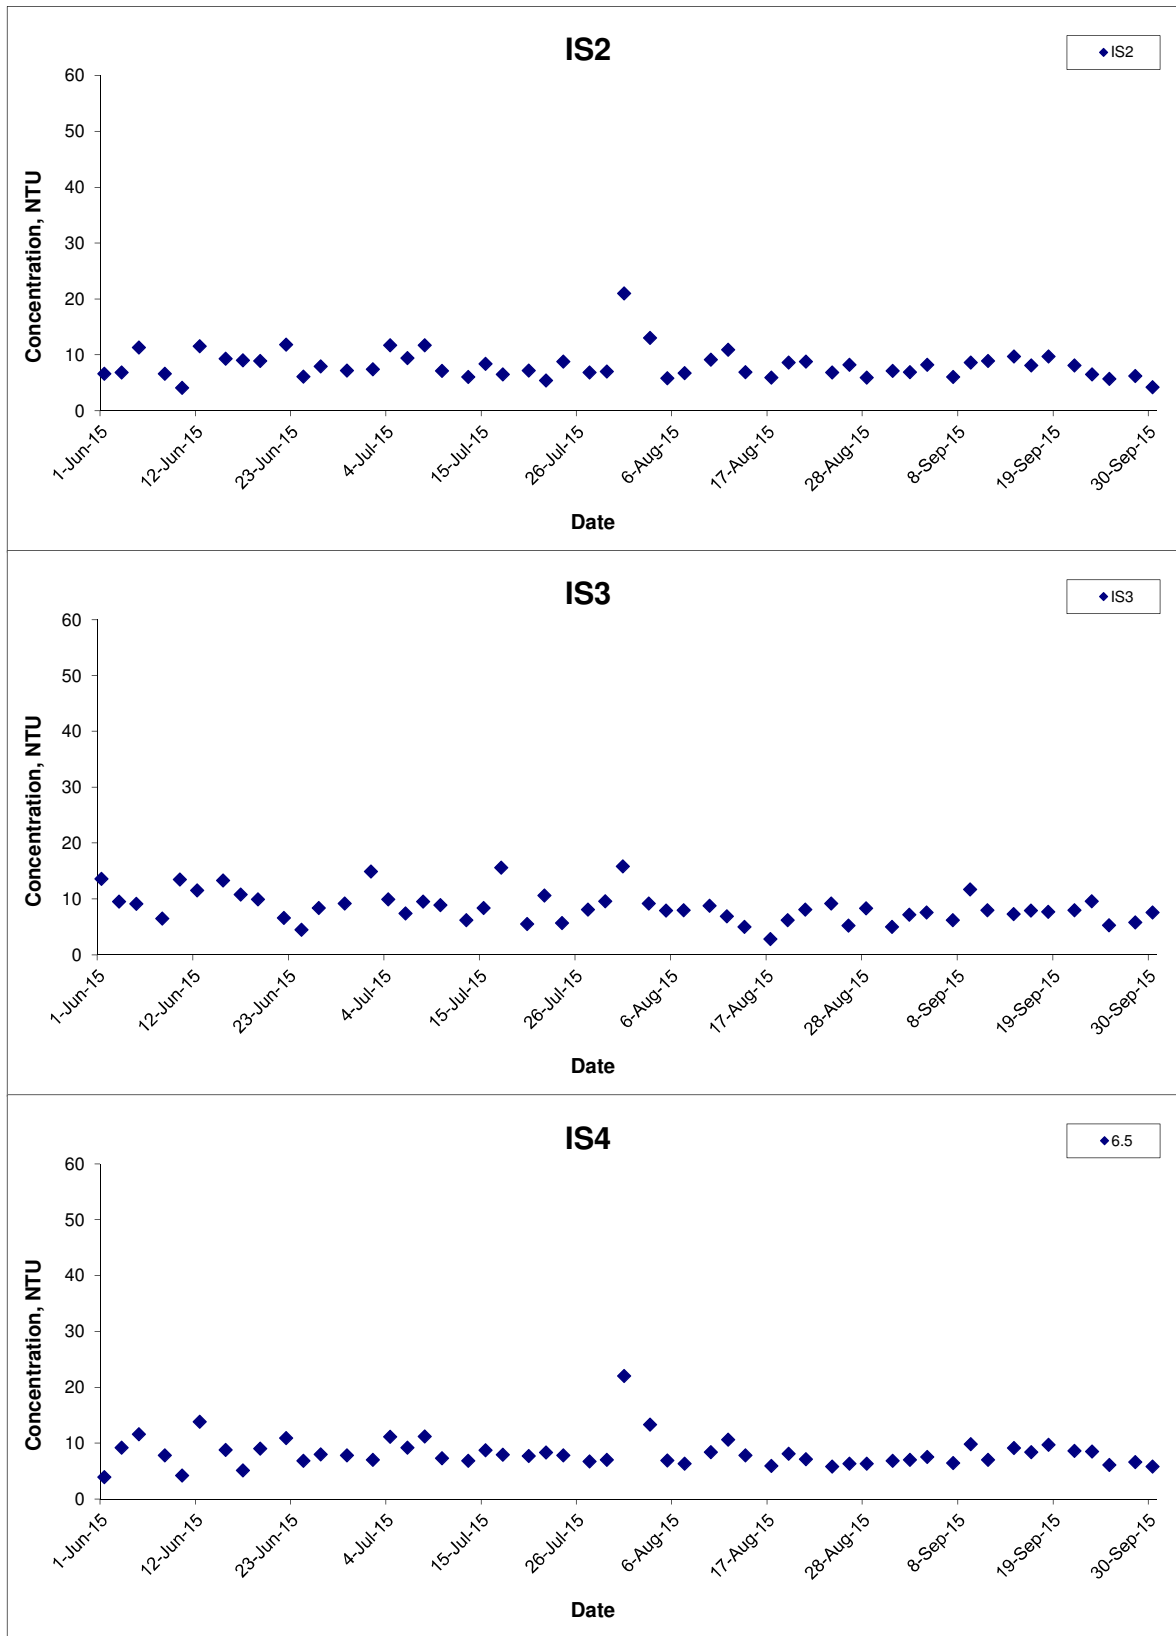


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Flood Tide

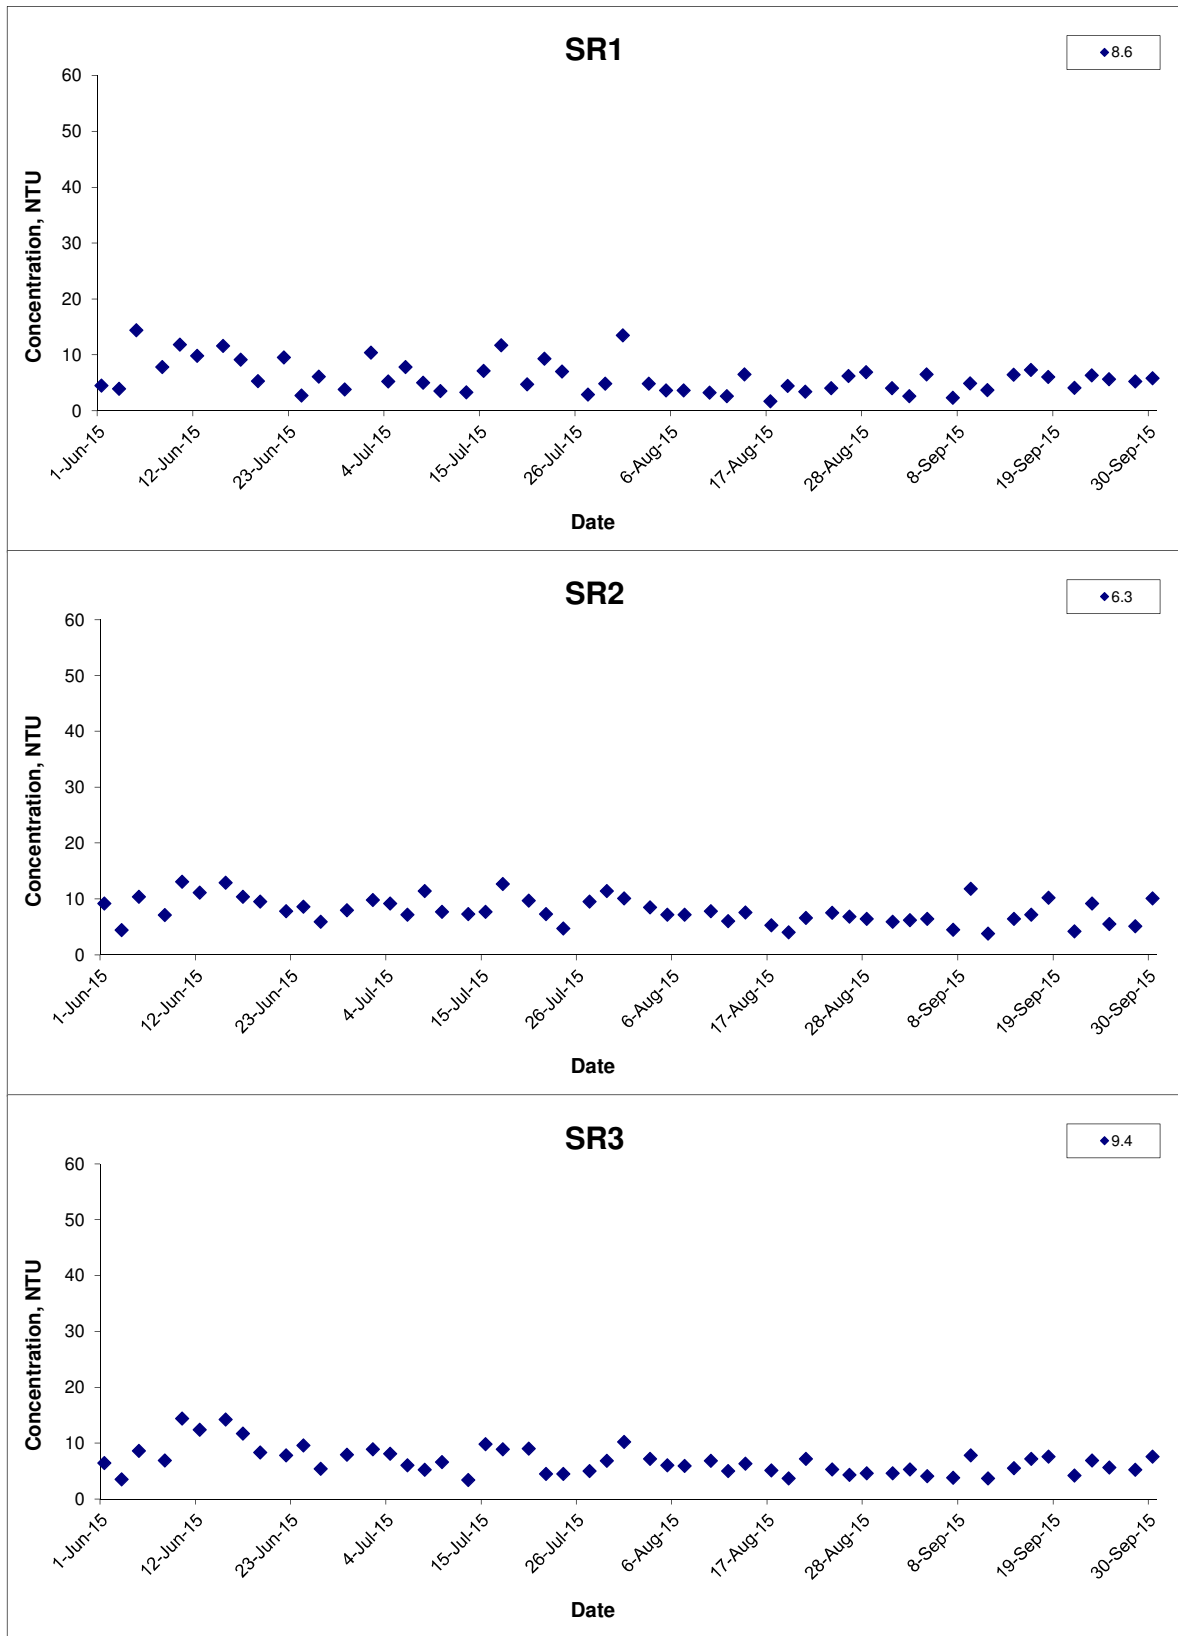


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Flood Tide

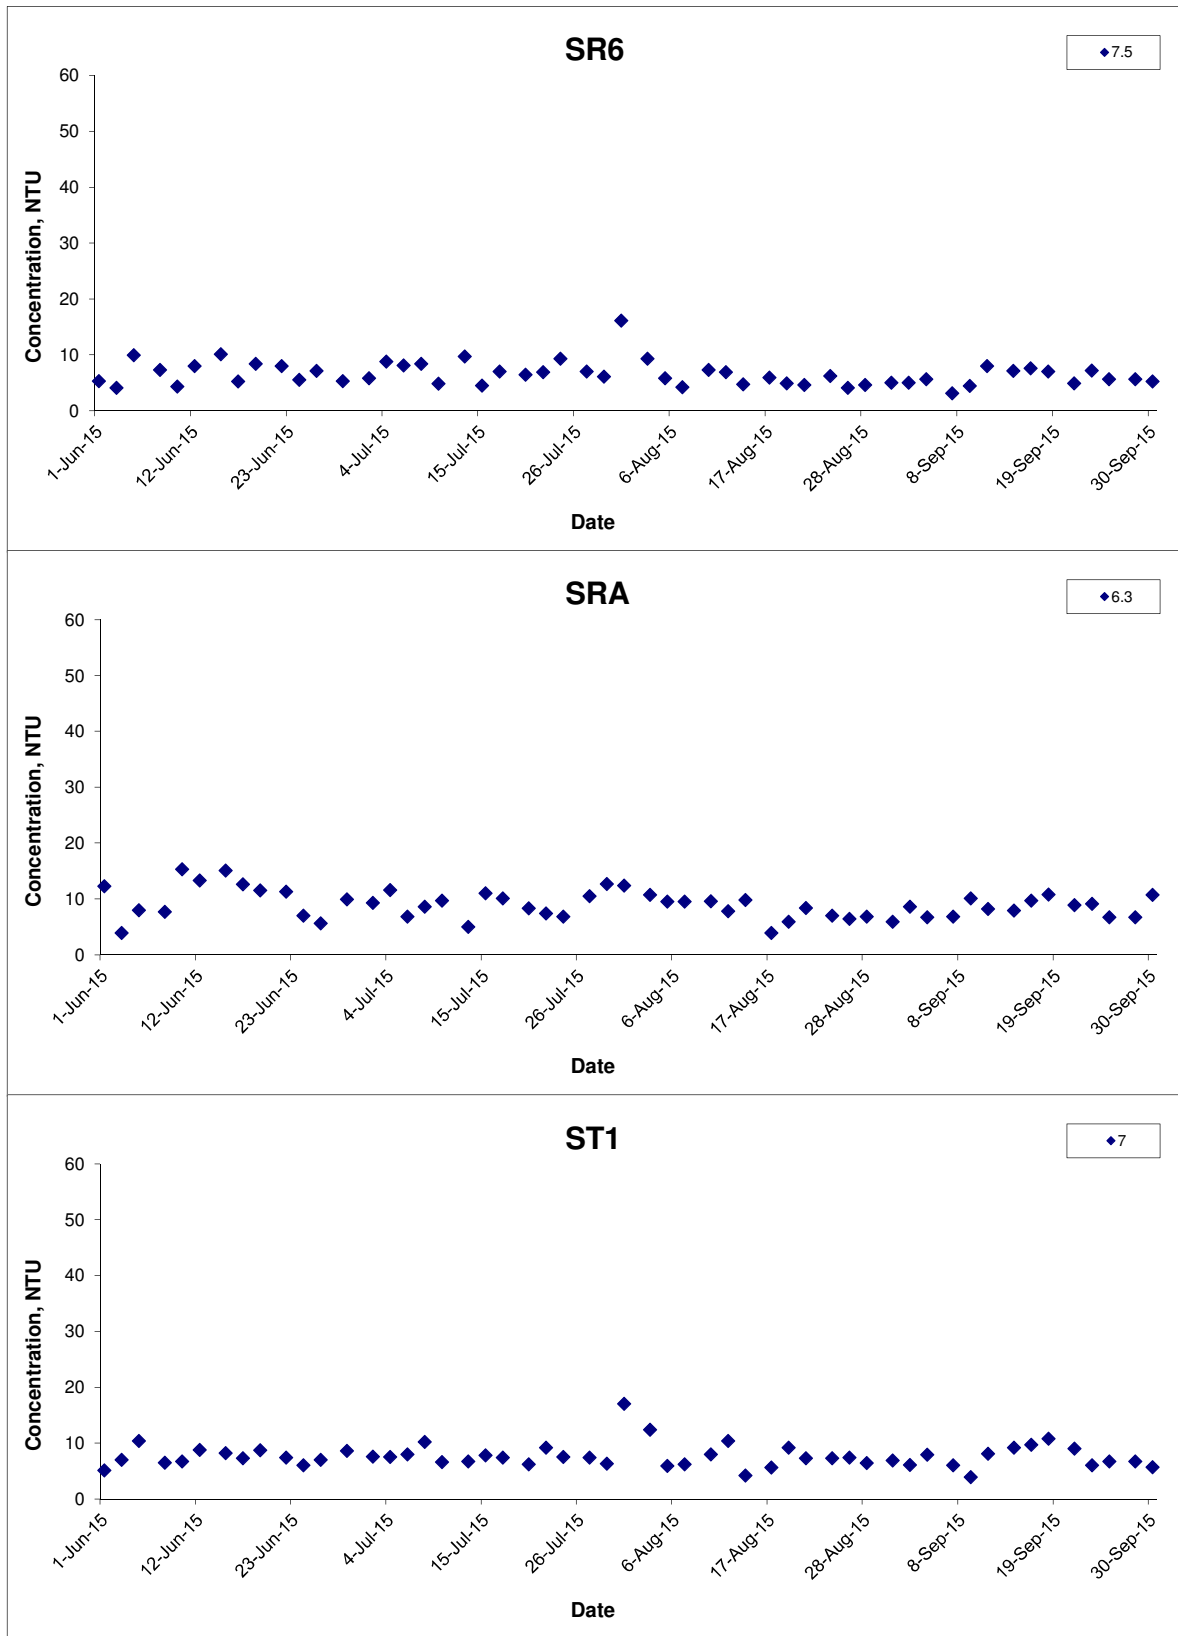


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H




Turbidity (Depth-averaged) at Mid-Flood Tide

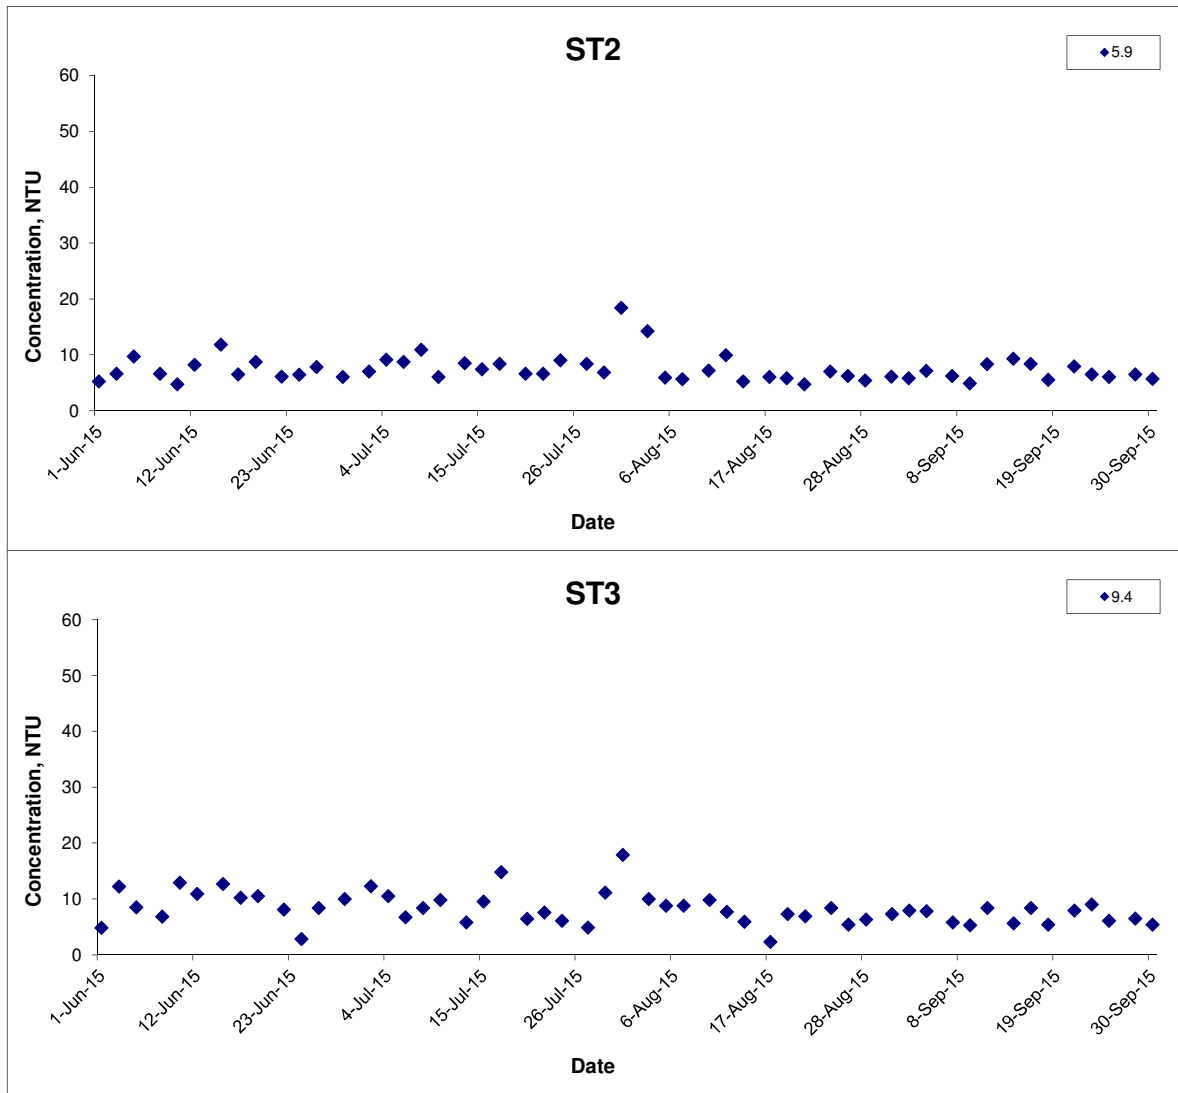

Title	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill	Scale	Project No.	CINOTECH
	Graphical Presentation of Water Quality Monitoring Results	N.T.S	MA12014	
		Date	Appendix	
		Sep 15	H	

Suspended Solids (Depth-averaged) at Mid-Ebb Tide

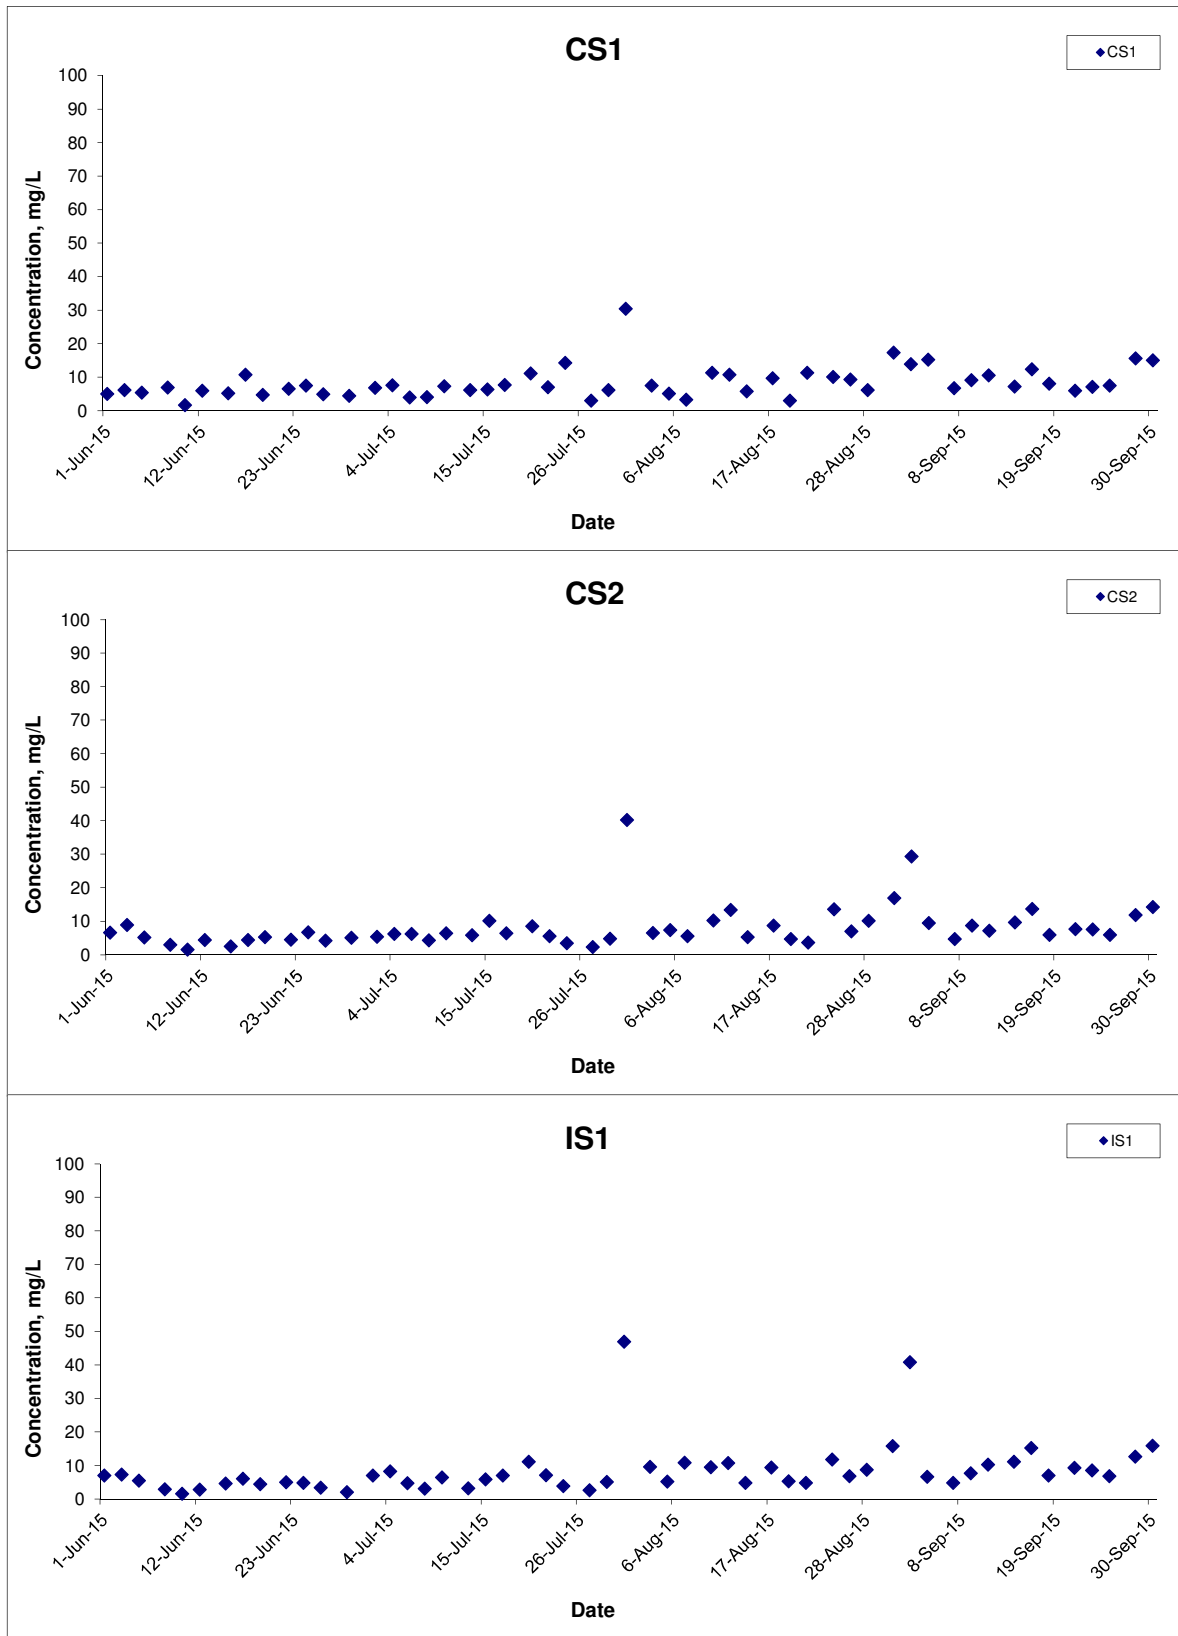


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Ebb Tide

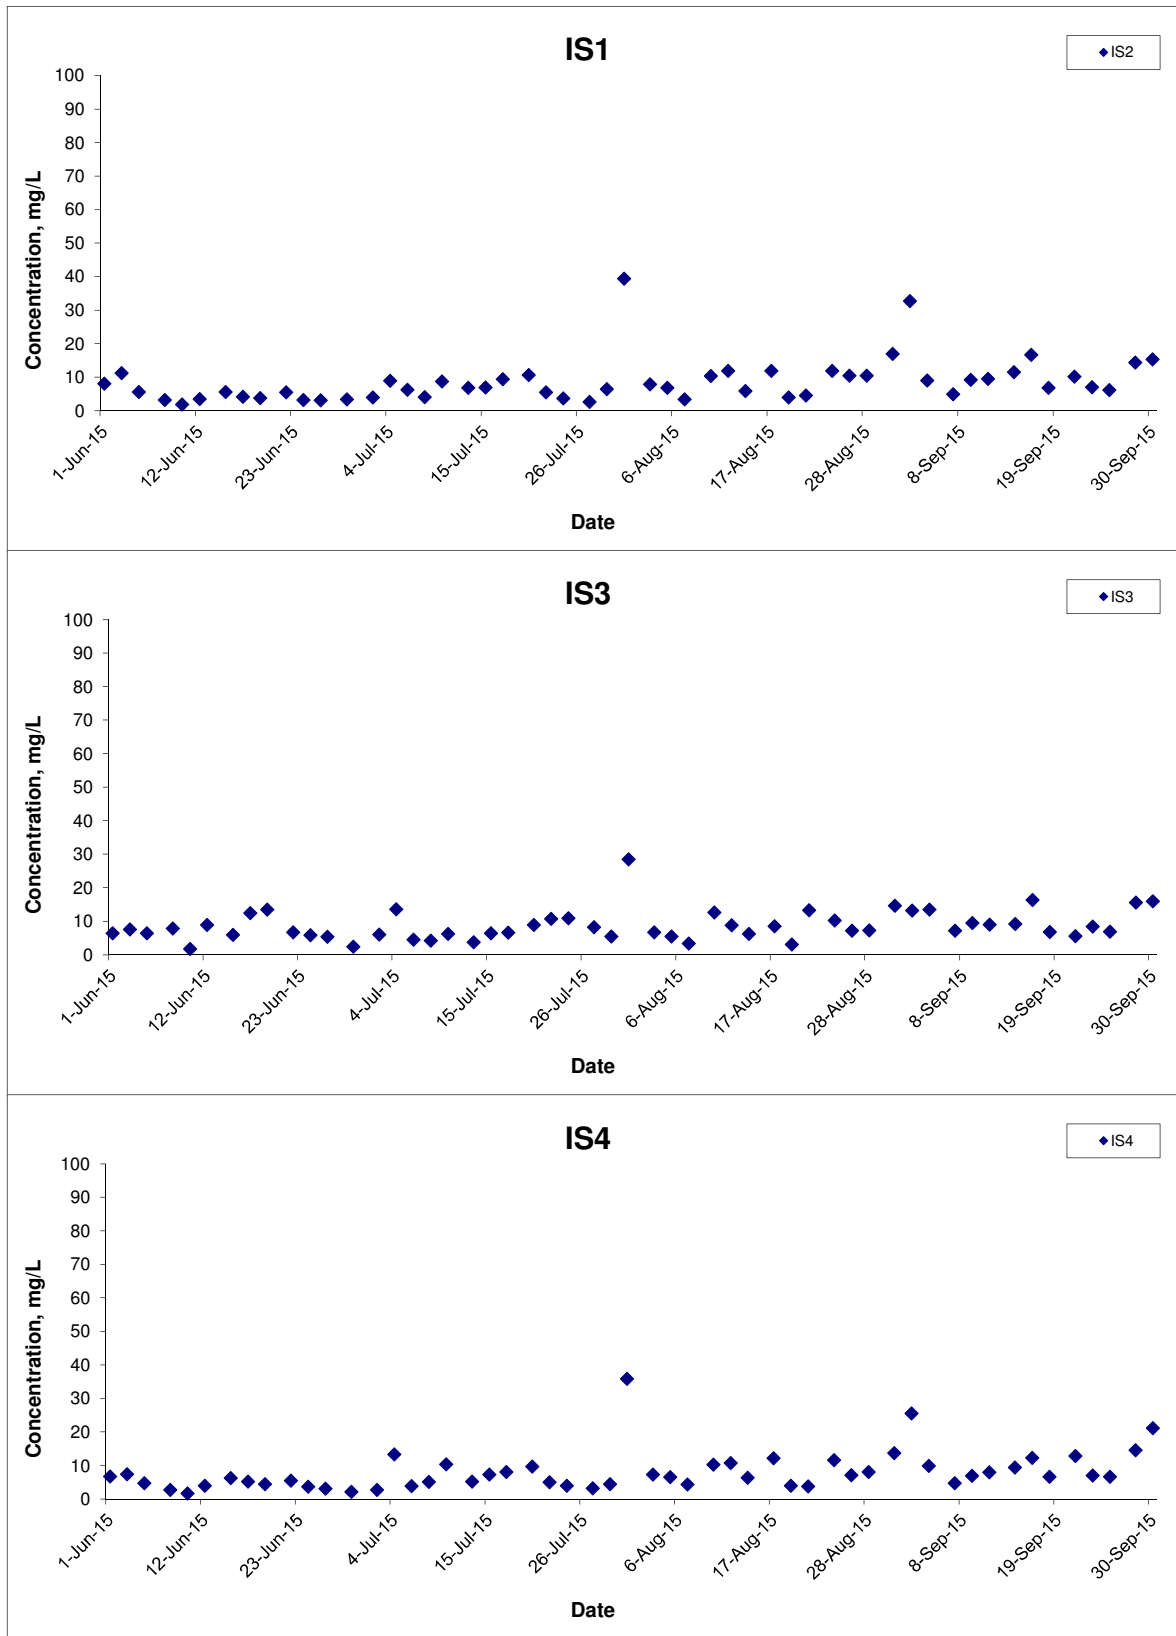


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Ebb Tide

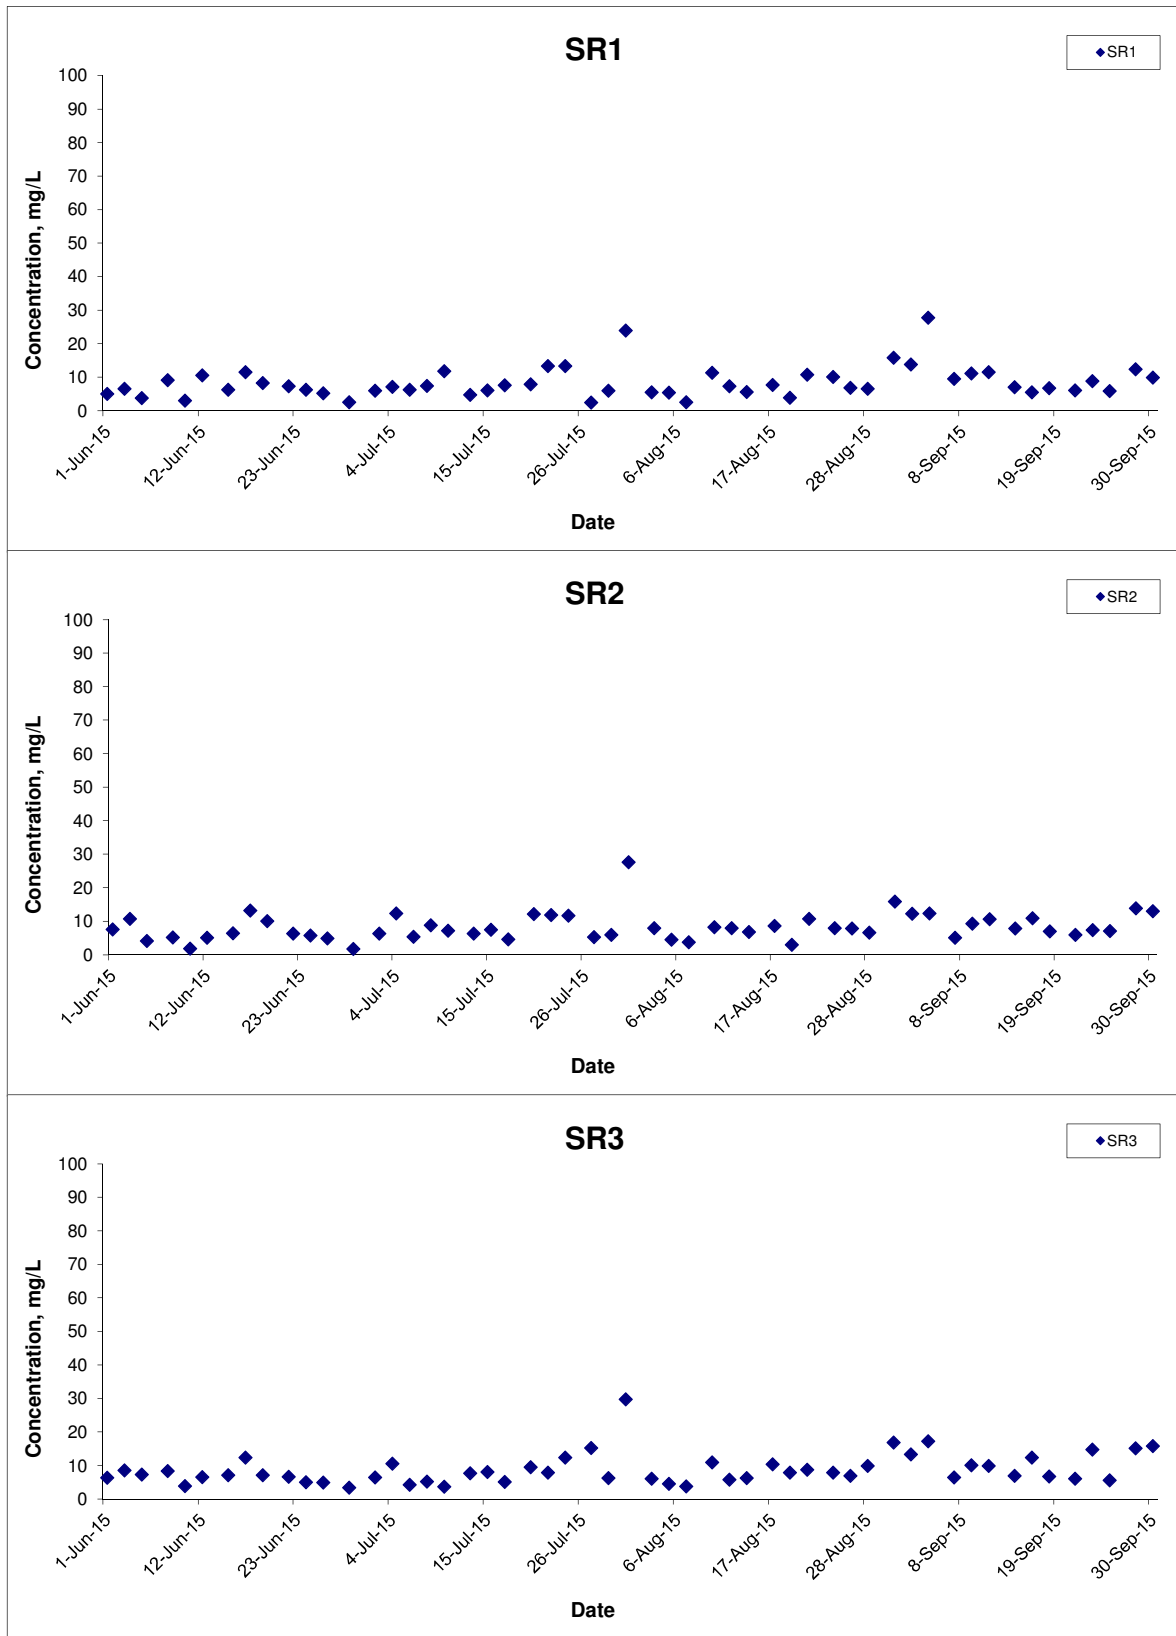


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Ebb Tide

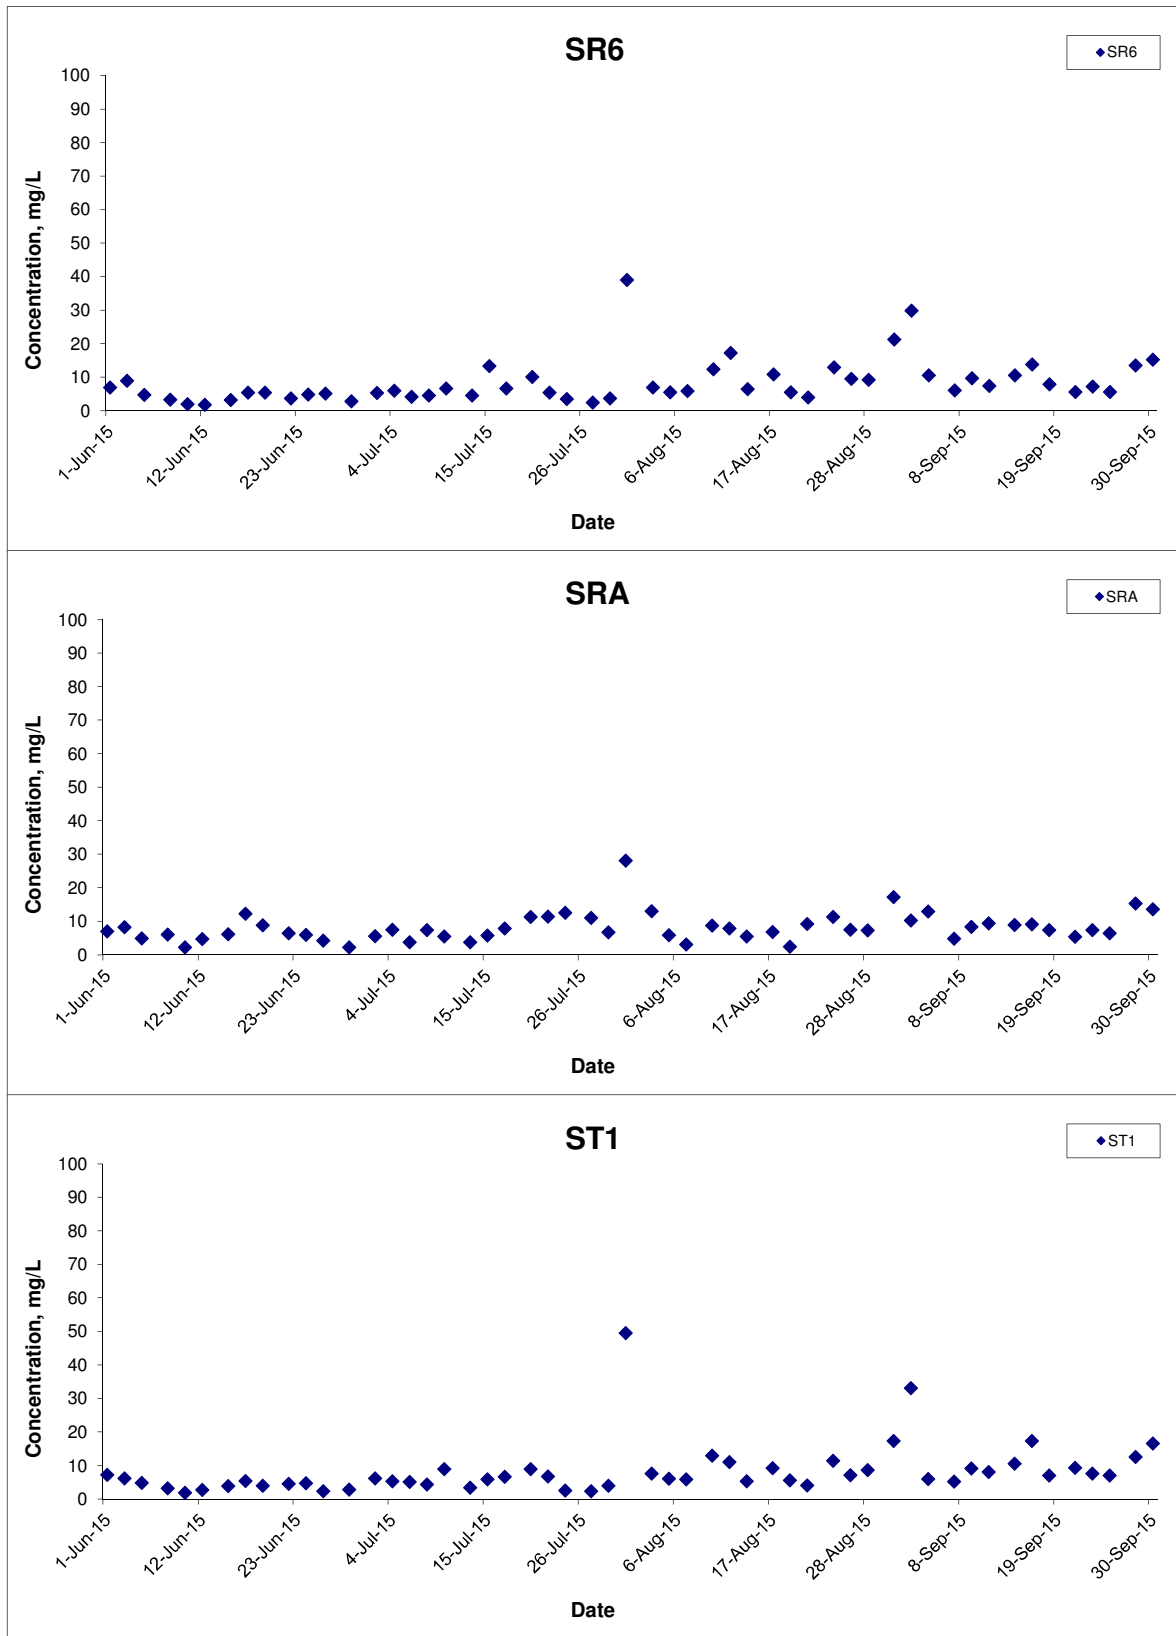


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H




Suspended Solids (Depth-averaged) at Mid-Ebb Tide

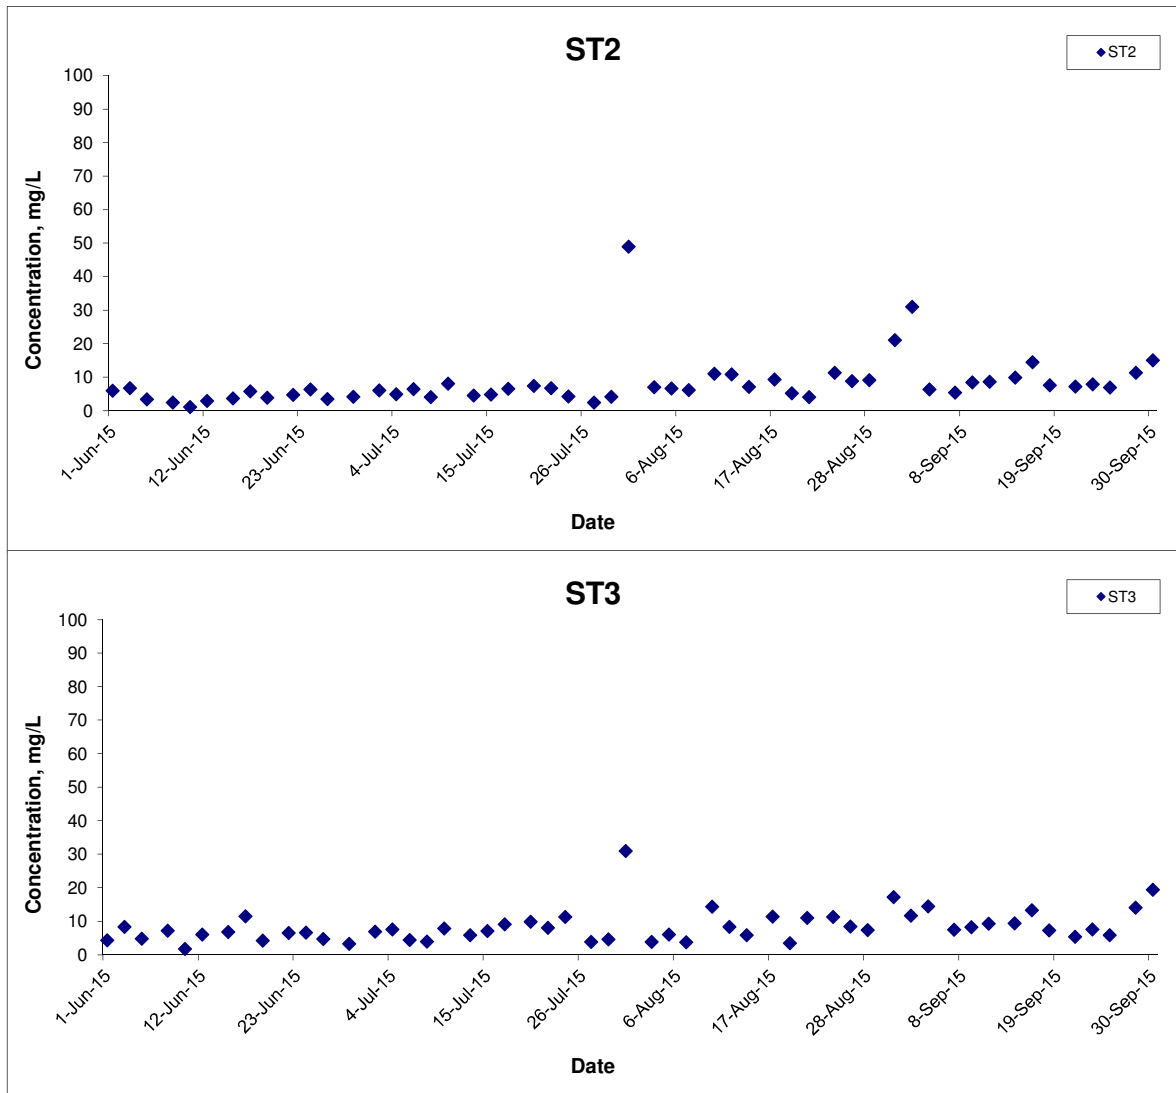

Title	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill	Scale	N.T.S	Project No.	MA12014	CINOTECH
	Graphical Presentation of Water Quality Monitoring Results	Date	Sep 15	Appendix	H	

Suspended Solids (Depth-averaged) at Mid-Flood Tide

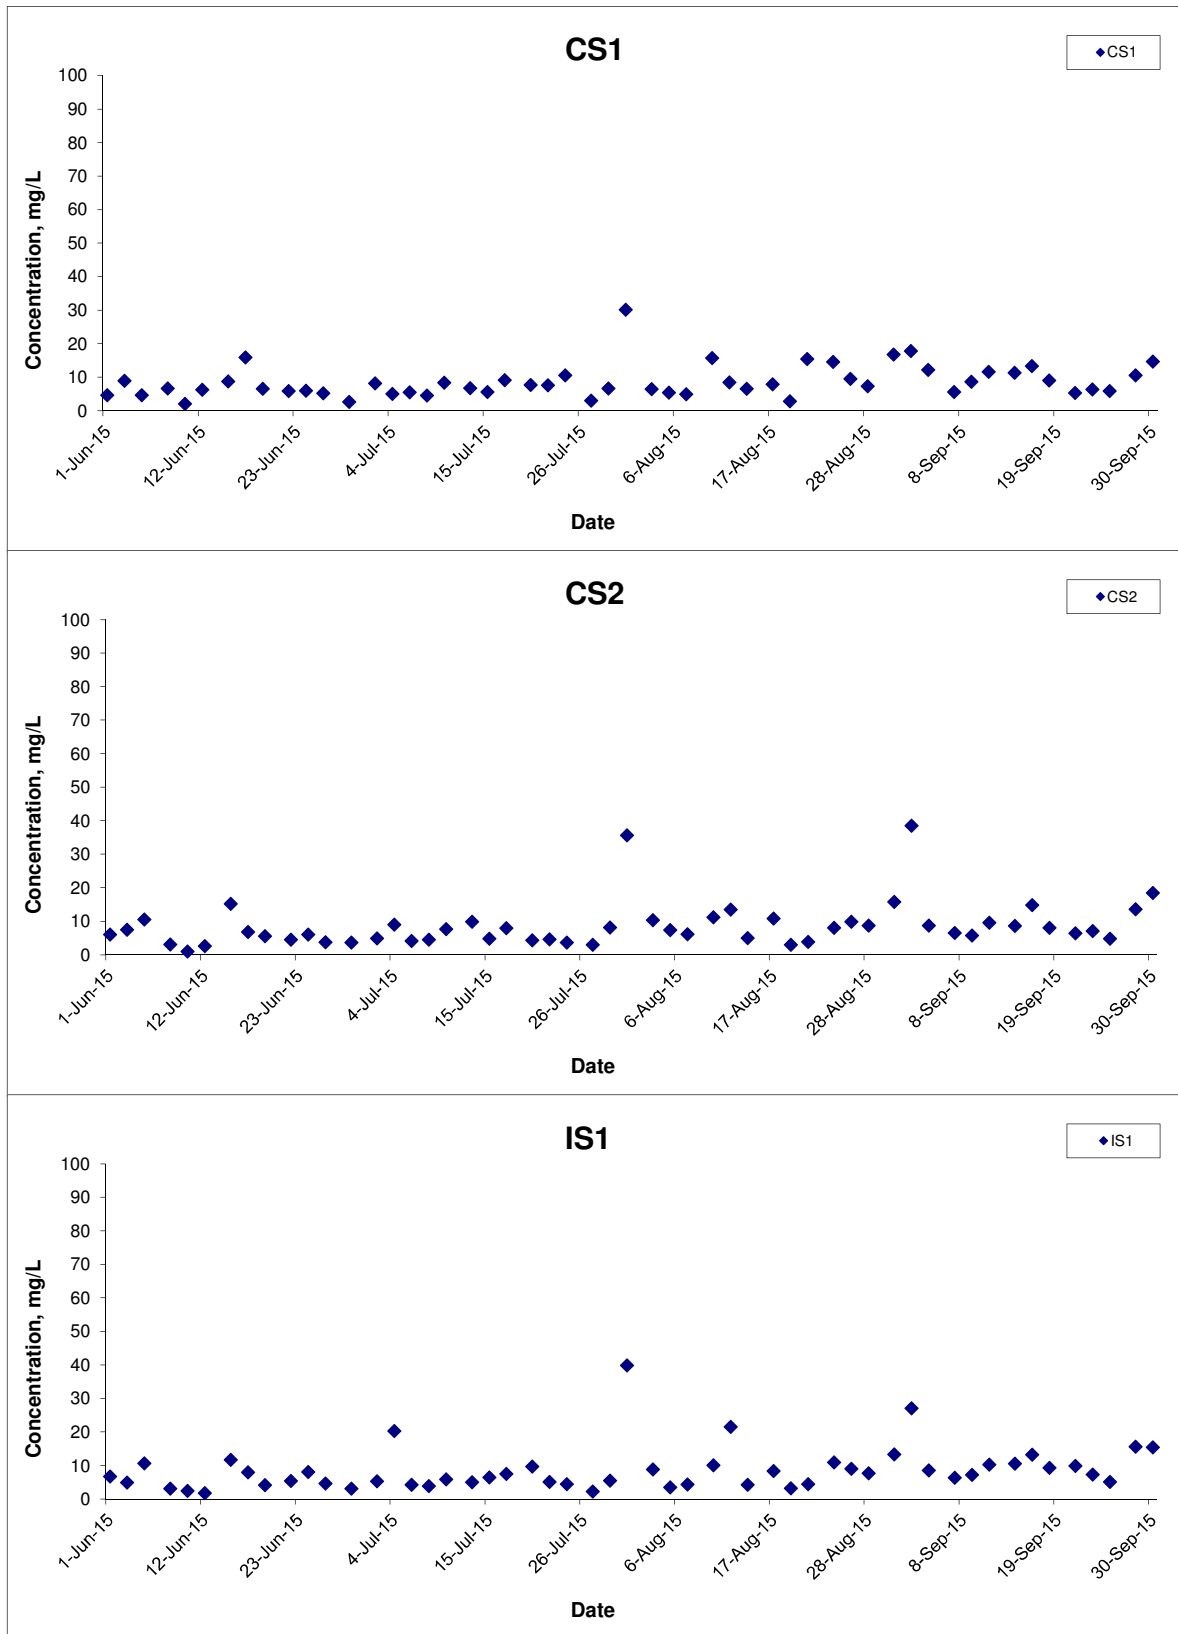


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Flood Tide

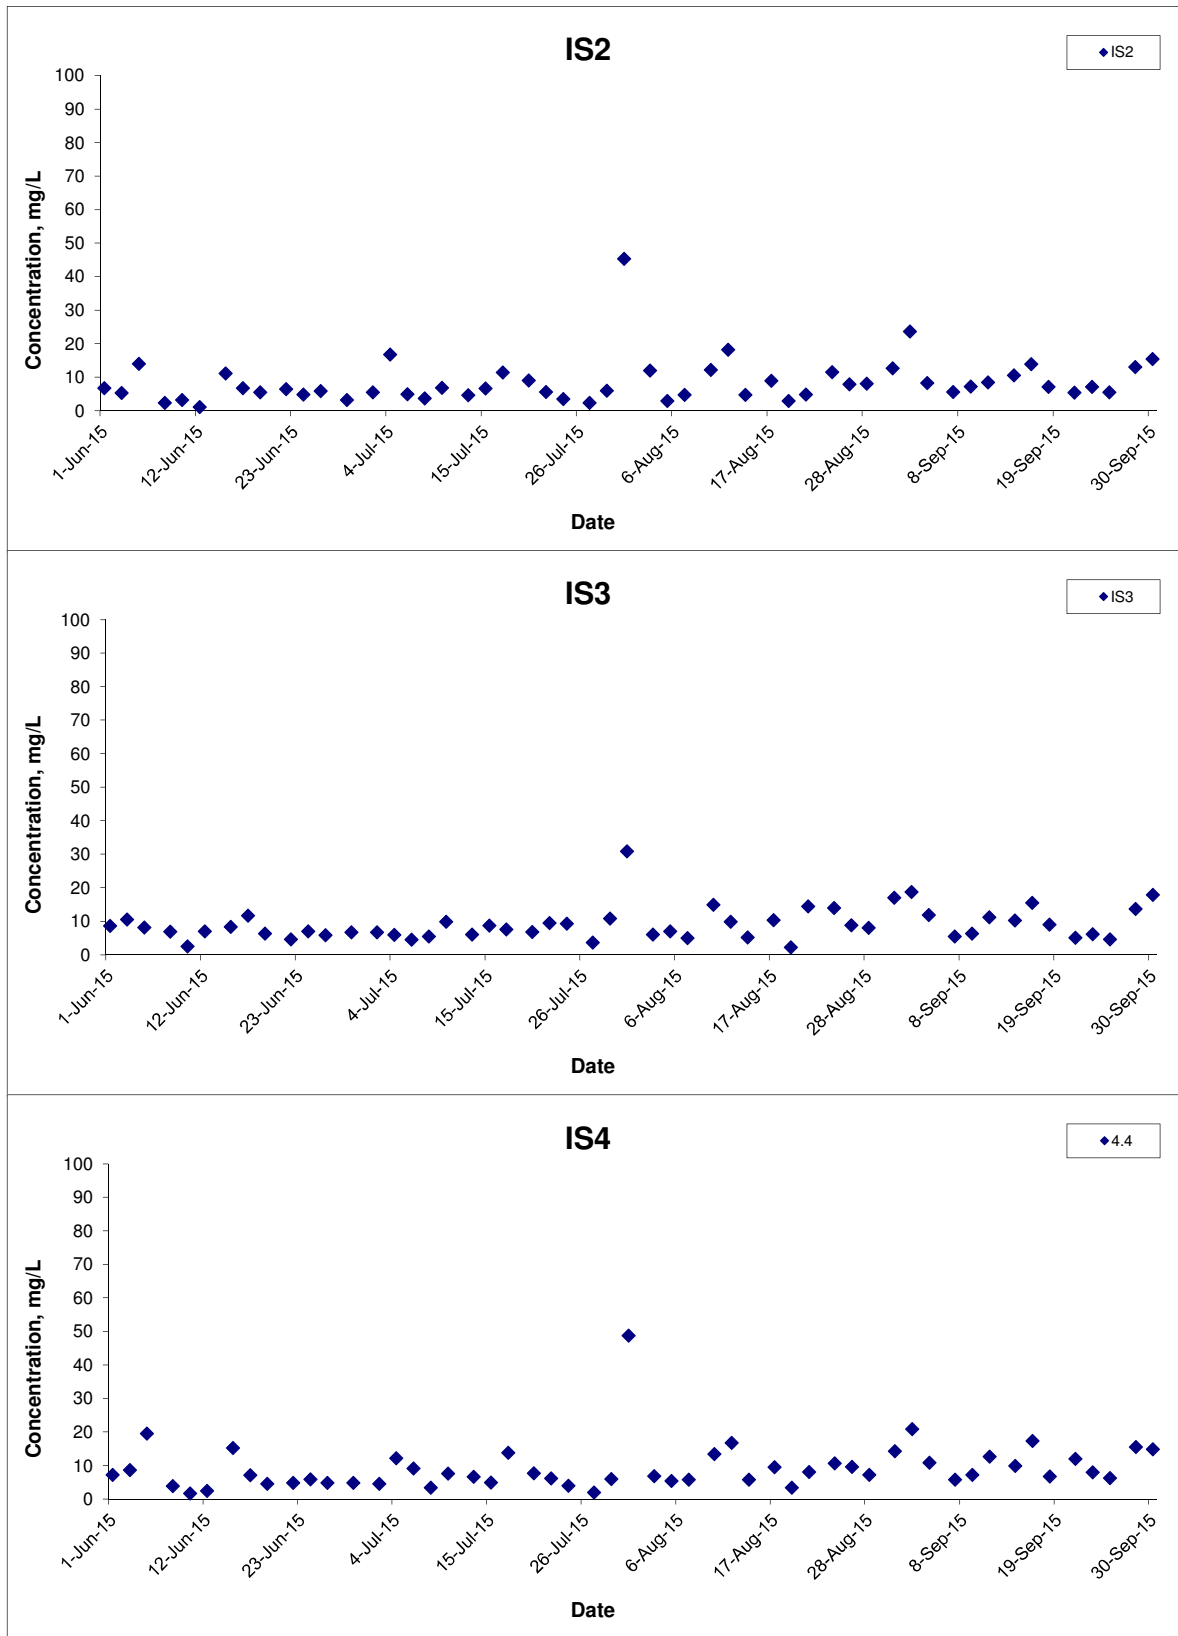


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Flood Tide

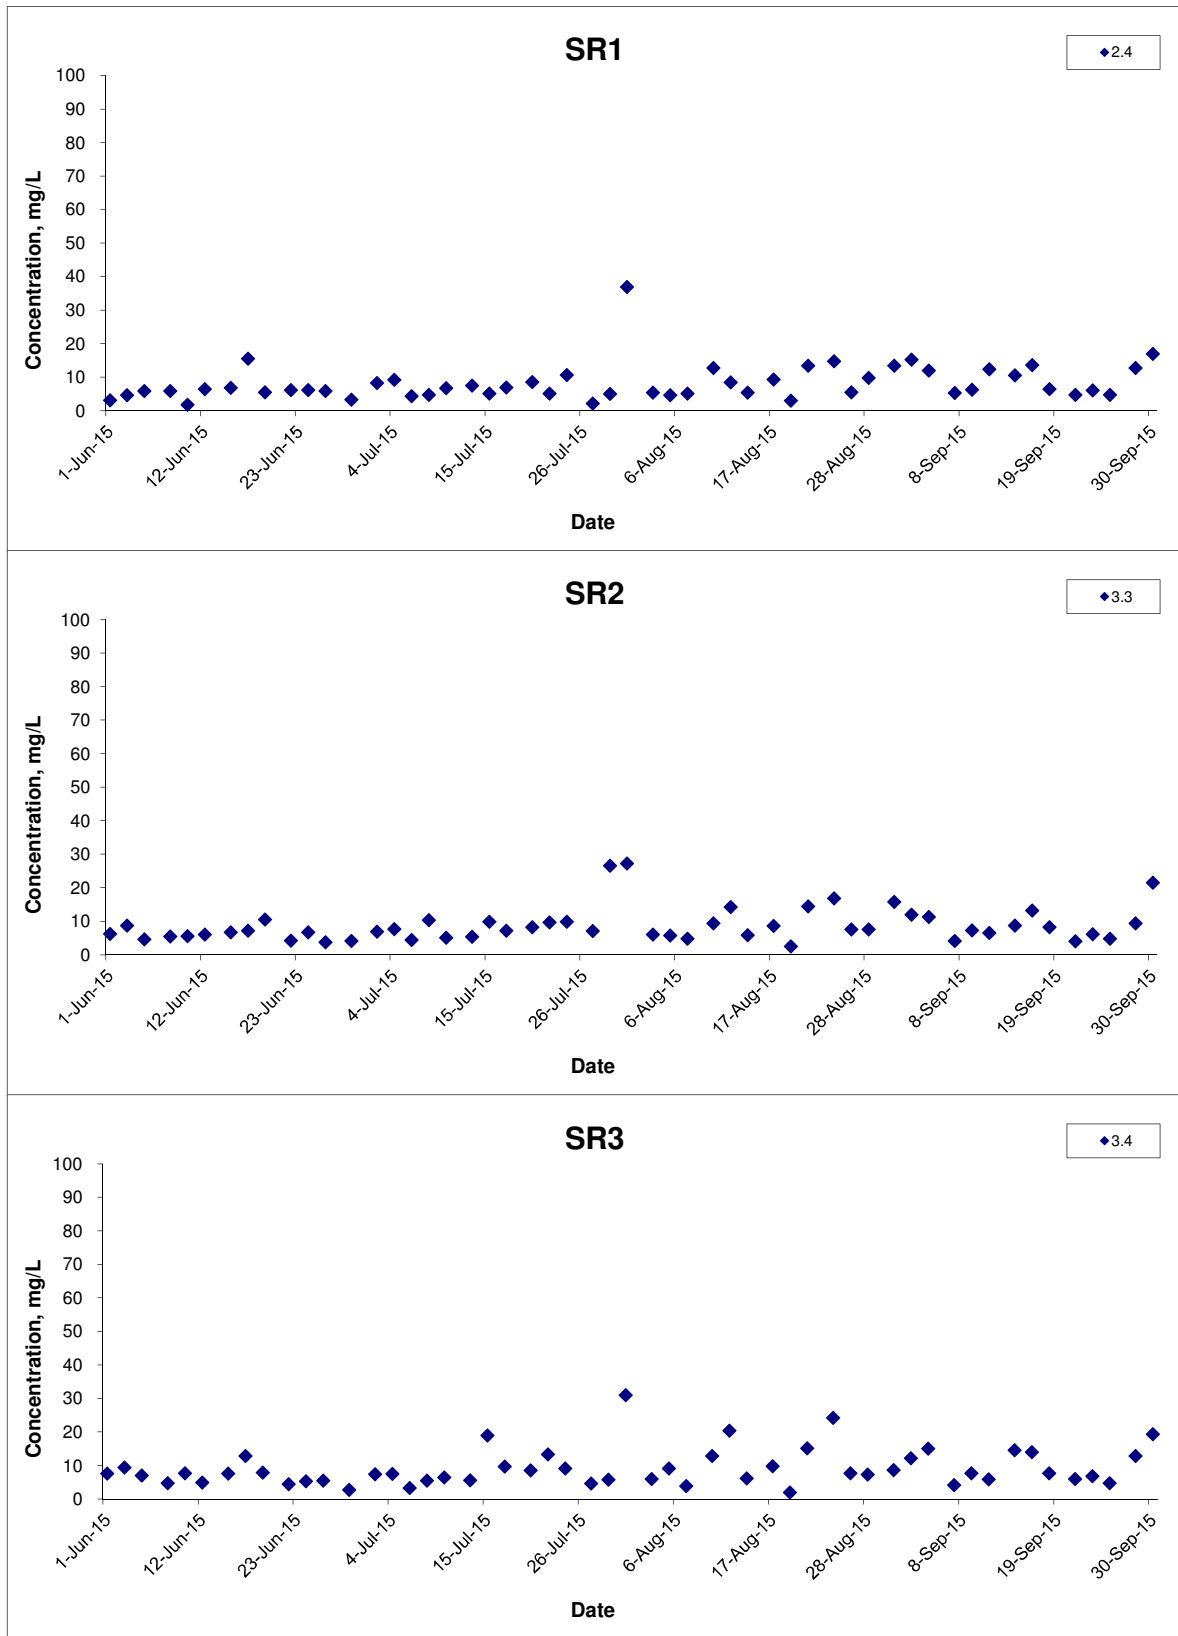


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Flood Tide

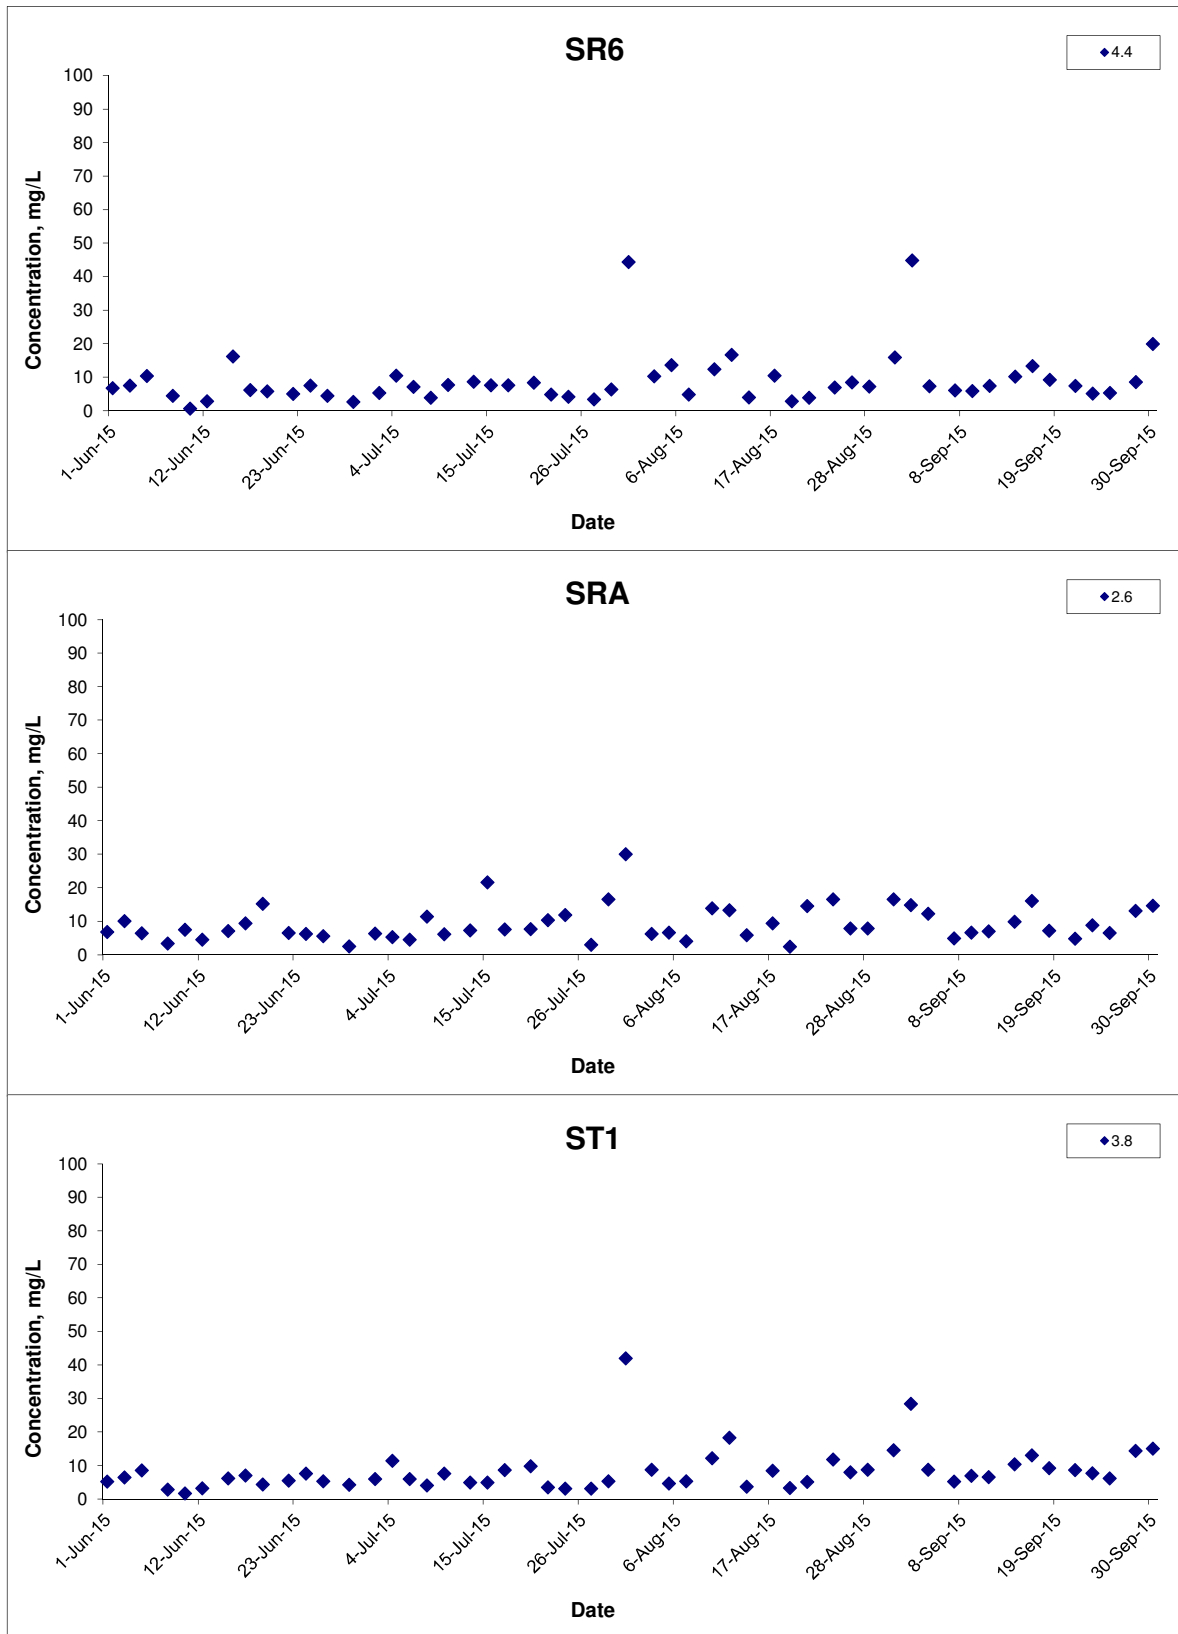


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Sep 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Flood Tide

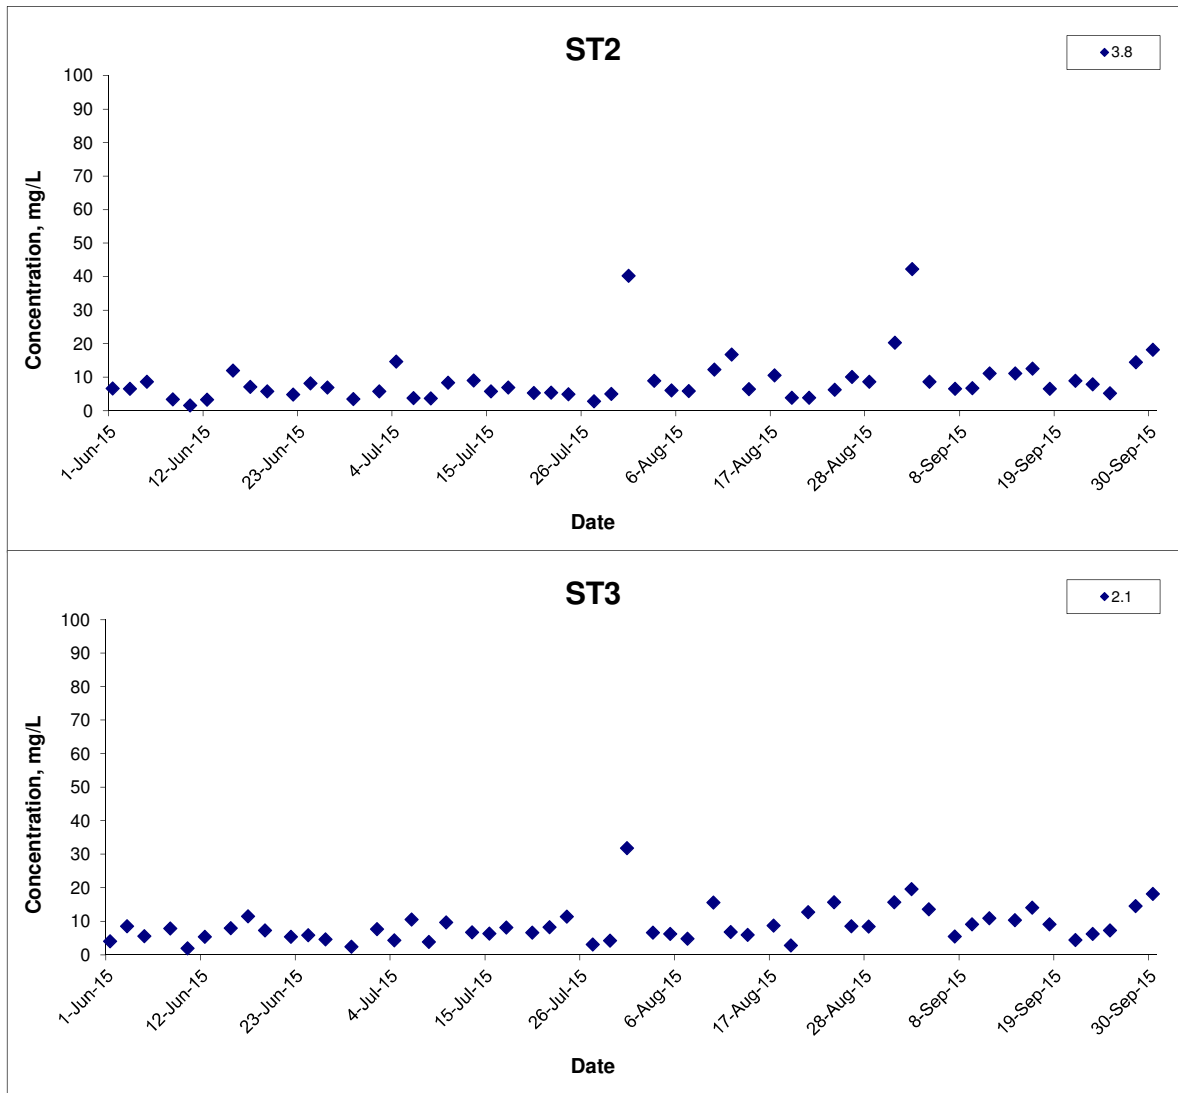

Title	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill	Scale	Project No.	CINOTECH
	Graphical Presentation of Water Quality Monitoring Results	N.T.S	MA12014	
		Date	Appendix	
		Sep 15	H	

**APPENDIX I
DOLPHIN MONITORING REPORT
(LINE TRANSECT)**

Contract No. HY/2011/09
Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road –
Section between HKSAR Boundary and Scenic Hill Dolphin
Monthly Monitoring

32nd Monthly Progress Report (September 2015)

Submitted by

Samuel K.Y. Hung, Ph.D., Hong Kong Cetacean Research Project

29 September 2015

1. Introduction

- 1.1. The Hong Kong Link Road (HKLR) serves to connect the Hong Kong-Zhuhai-Macao Bridge (HZMB) Main Bridge at the Hong Kong Special Administrative Region (HKSAR) Boundary and the HZMB Hong Kong Boundary Crossing Facilities (HKBCF) located at the northeastern waters of the Hong Kong International Airport.
- 1.2. According to the updated Environmental Monitoring and Audit (EM&A) Manual (for HKLR), monthly line-transect vessel surveys for Chinese White Dolphin should be conducted to cover the West Lantau survey area as in AFCD annual marine mammal monitoring programme.
- 1.3. Since November 2012, Hong Kong Cetacean Research Project (HKCRP) has been commissioned by Dragages – China Harbour – VSL JV to conduct this 34-month dolphin monitoring study in order to collect data on Chinese White Dolphins during the construction phase (i.e. impact period) of the HKLR09 project in West Lantau (WL) survey area, and to analyze the collected survey data to monitor distribution, encounter rate, abundance, activities and occurrence of dolphin calves. Photo-identification will also be collected from individual Chinese White Dolphins to examine their individual range patterns and core area use.
- 1.4. From the monitoring results, any changes in dolphin occurrence within the study area will be examined for possible causes, and appropriate actions and additional mitigation measures will be recommended as necessary.

1.5. This report is the 32nd monthly progress report under the HKLR09 construction phase dolphin monitoring programme, summarizing the results of the survey findings during the month of September 2015.

2. Monitoring Methodology

2.1. Vessel-based Line-transect Survey

2.1.1. According to the requirement of the updated EM&A manual, dolphin monitoring programme should cover all transect lines in WL survey area (see Figure 1) twice per month throughout the entire construction period. The co-ordinates of all transect lines are shown in Table 1.

Table 1. Co-ordinates of transect lines in WL survey area

Line No.		Easting	Northing		Line No.		Easting	Northing
1	Start Point	803750	818500		7	Start Point	800200	810450
1	End Point	803750	815500		7	End Point	801400	810450
2	Start Point	803750	815500		8	Start Point	801300	809450
2	End Point	802940	815500		8	End Point	799750	809450
3	Start Point	802550	814500		9	Start Point	799400	808450
3	End Point	803700	814500		9	End Point	801430	808450
4	Start Point	803120	813600		10	Start Point	801500	807450
4	End Point	801640	813600		10	End Point	799600	807450
5	Start Point	801100	812450		11	Start Point	800300	806500
5	End Point	802900	812450		11	End Point	801750	806500
6	Start Point	802400	811500		12	Start Point	801760	805450
6	End Point	800660	811500		12	End Point	800700	805450

2.1.2. The survey team used standard line-transect methods (Buckland et al. 2001) to conduct the systematic vessel surveys, and followed the same technique of data collection that has been adopted over the last 16 years of marine mammal monitoring surveys in Hong Kong developed by HKCRP (see Hung

2012). For each monitoring vessel survey, a 15-m inboard vessel with an open upper deck (about 4.5 m above water surface) was used to make observations from the flying bridge area.

- 2.1.3. Two experienced observers (a data recorder and a primary observer) made up the on-effort survey team, and the survey vessel transited different transect lines at a constant speed of 13-15 km per hour. The data recorder searched with unaided eyes and filled out the datasheets, while the primary observer searched for dolphins and porpoises continuously through 7 x 50 *Fujinon* marine binoculars. Both observers searched the sea ahead of the vessel, between 270° and 90° (in relation to the bow, which is defined as 0°). One to two additional experienced observers were available on the boat to work in shift (i.e. rotate every 30 minutes) in order to minimize fatigue of the survey team members. All observers were experienced in small cetacean survey techniques and identifying local cetacean species.
- 2.1.4. During on-effort survey periods, the survey team recorded effort data including time, position (latitude and longitude), weather conditions (Beaufort sea state and visibility), and distance traveled in each series (a continuous period of search effort) with the assistance of a handheld GPS.
- 2.1.5. Data including time, position and vessel speed were also automatically and continuously logged by handheld GPS throughout the entire survey for subsequent review.
- 2.1.6. When dolphins were sighted, the survey team would end the survey effort, and immediately record the initial sighting distance and angle of the dolphin group from the survey vessel, as well as the sighting time and position. Then the research vessel was diverted from its course to approach the animals for species identification, group size estimation, assessment of group composition, and behavioural observations. The perpendicular distance (PSD) of the dolphin group to the transect line was later calculated from the initial sighting distance and angle.
- 2.1.7. Survey effort being conducted along the parallel transect lines that were perpendicular to the coastlines (as indicated in Figure 1) was labeled as “primary” survey effort, while the survey effort being conducted along the connecting lines between parallel lines was labeled as “secondary” survey

effort. According to HKCRP long-term dolphin monitoring data, encounter rates of Chinese white dolphins deduced from effort and sighting data collected along primary and secondary lines were similar in survey areas around Lantau Island. Therefore, primary and secondary survey effort were both presented as on-effort survey effort in this report.

- 2.1.8. Encounter rates of Chinese white dolphins (number of on-effort sightings per 100 km of survey effort) were calculated in WL survey area in relation to the amount of survey effort conducted during each month of monitoring survey. Only data collected under Beaufort 3 or below condition would be used for encounter rate analysis. Dolphin encounter rates were calculated using primary survey effort alone, as well as the combined survey effort from both primary and secondary lines.

2.2. *Photo-identification Work*

- 2.2.1. When a group of Chinese White Dolphins were sighted during the line-transect survey, the survey team would end effort and approach the group slowly from the side and behind to take photographs of them. Every attempt was made to photograph every dolphin in the group, and even photograph both sides of the dolphins, since the colouration and markings on both sides may not be symmetrical.
- 2.2.2. A professional digital camera (*Canon* EOS 7D or 60D model) equipped with long telephoto lenses (100-400 mm zoom) were available on board for researchers to take sharp, close-up photographs of dolphins as they surfaced. The images were shot at the highest available resolution and stored on Compact Flash memory cards for downloading onto a computer.
- 2.2.3. All digital images taken in the field were first examined, and those containing potentially identifiable individuals were sorted out. These photographs would then be examined in greater detail, and were carefully compared to the existing Chinese White Dolphin photo-identification catalogue maintained by HKCRP since 1995.
- 2.2.4. Chinese White Dolphins can be identified by their natural markings, such as nicks, cuts, scars and deformities on their dorsal fin and body, and their unique spotting patterns were also used as secondary identifying features (Jefferson 2000).

- 2.2.5. All photographs of each individual were then compiled and arranged in chronological order, with data including the date and location first identified (initial sighting), re-sightings, associated dolphins, distinctive features, and age classes entered into a computer database.

3. Monitoring Results

3.1. Vessel-based Line-transect Survey

- 3.1.1. During the monitoring month of September 2015, two complete sets of systematic line-transect vessel surveys were conducted on the 7th and 10th, to cover all transect lines in WL survey area twice. The survey routes of each survey day are presented in Figures 2-3.
- 3.1.2. From these surveys, a total of 65.34 km of survey effort was collected, with 97.7% of the total survey effort being conducted under favourable weather conditions (i.e. Beaufort Sea State 3 or below with good visibility) (Appendix I). Moreover, the total survey effort conducted on primary lines (the horizontal lines perpendicular to the coastlines) was 44.05 km, while the effort on secondary lines (the lines connecting the primary lines) was 21.29 km.
- 3.1.3. During the monitoring surveys conducted in September 2015, eight groups of 32 Chinese White Dolphins were sighted. All except one sighting were made during on-effort search, while five of these seven on-effort sightings were made on primary lines (Appendix II). None of the dolphin groups was associated with an operating fishing vessel.
- 3.1.4. Distribution of the eight dolphin sightings made during September's surveys is shown in Figure 4. Six of the eight dolphin sightings were concentrated at the southern portion of the survey area (i.e. between Peaked Hill and Fan Lau), while the other two sightings were located to the north of the HKLR09 alignment and near Tai O Peninsula respectively. Notably, a group of five dolphins was sighted just a few kilometres to the north of the HKLR09 alignment (Figure 4).
- 3.1.5. During the September's surveys, encounter rates of Chinese White Dolphins deduced from the survey effort and on-effort sighting data made under favourable conditions (Beaufort 3 or below) are shown in Tables 2 & 3.

Table 2. Dolphin encounter rates (sightings per 100 km of survey effort) per set during September's surveys in West Lantau (WL)

		Encounter rate (STG) (no. of on-effort dolphin sightings per 100 km of survey effort)	Encounter rate (ANI) (no. of dolphins from all on-effort sightings per 100 km of survey effort)
		Primary Lines Only	Primary Lines Only
West Lantau	Set 1: September 7 th	4.5	31.4
	Set 2: September 10 th	14.2	47.3

Table 3. Overall dolphin encounter rates (sightings per 100 km of survey effort) in September's surveys on primary lines only as well as both primary lines and secondary lines in West Lantau (WL)

	Encounter rate (STG) (no. of on-effort dolphin sightings per 100 km of survey effort)		Encounter rate (ANI) (no. of dolphins from all on-effort sightings per 100 km of survey effort)	
	Primary Lines Only	Both Primary and Secondary Lines	Primary Lines Only	Both Primary and Secondary Lines
West Lantau	9.2	9.4	39.2	37.6

3.1.6. The average group size of Chinese White Dolphins was 4.0 individuals per group during September's surveys, which was slightly higher than the ones in previous months of monitoring surveys.

3.1.7. Half of the dolphin groups were composed of only 1-3 animals, while there were three larger groups with 6-7 animals pre group.

3.2. Photo-identification Work

3.2.1. A total of 17 different individual Chinese White Dolphins were identified 21 times during September's surveys. Most individuals were sighted only once during the monitoring surveys, but two individuals (WL21 and WL207) were sighted twice while one individual (WL46) were sighted thrice (Appendices III and IV).

3.2.2. As in the recent monitoring months, a number of identified individuals (i.e. NL49, NL123, NL284, NL285, NL287) sighted in West Lantau during the present month ranged primarily in North Lantau waters in the past, with possible range shifts into West Lantau waters recently.

3.3. Conclusion

- 3.3.1. During this month of dolphin monitoring, marine construction activities have continued under this contract. However, no adverse impact on Chinese white dolphins was noticeable from general observations.
- 3.3.2. Due to the monthly variation in dolphin occurrence within the study area, it would be more appropriate to draw conclusion on whether any impacts on dolphins have been detected related to the construction activities of this project in the quarterly EM&A report, where comparison on distribution, group size and encounter rates of dolphins between the quarterly impact monitoring period (i.e. September to November 2015) and baseline monitoring period will be made.

4. References

- Buckland, S. T., Anderson, D. R., Burnham, K. P., Laake, J. L., Borchers, D. L., and Thomas, L. 2001. Introduction to distance sampling: estimating abundance of biological populations. Oxford University Press, London.
- Hung, S. K. 2012. Monitoring of marine mammals in Hong Kong waters – data collection: final report (2011-12). An unpublished report submitted to the Agriculture, Fisheries and Conservation Department of Hong Kong SAR Government, 120 pp.
- Hung, S. K. 2013. Monitoring of marine mammals in Hong Kong waters – data collection: inception report (2013-14). An unpublished report submitted to the Agriculture, Fisheries and Conservation Department of Hong Kong SAR Government.
- Jefferson, T. A. 2000. Population biology of the Indo-Pacific hump-backed dolphin in Hong Kong waters. Wildlife Monographs 144:1-65.

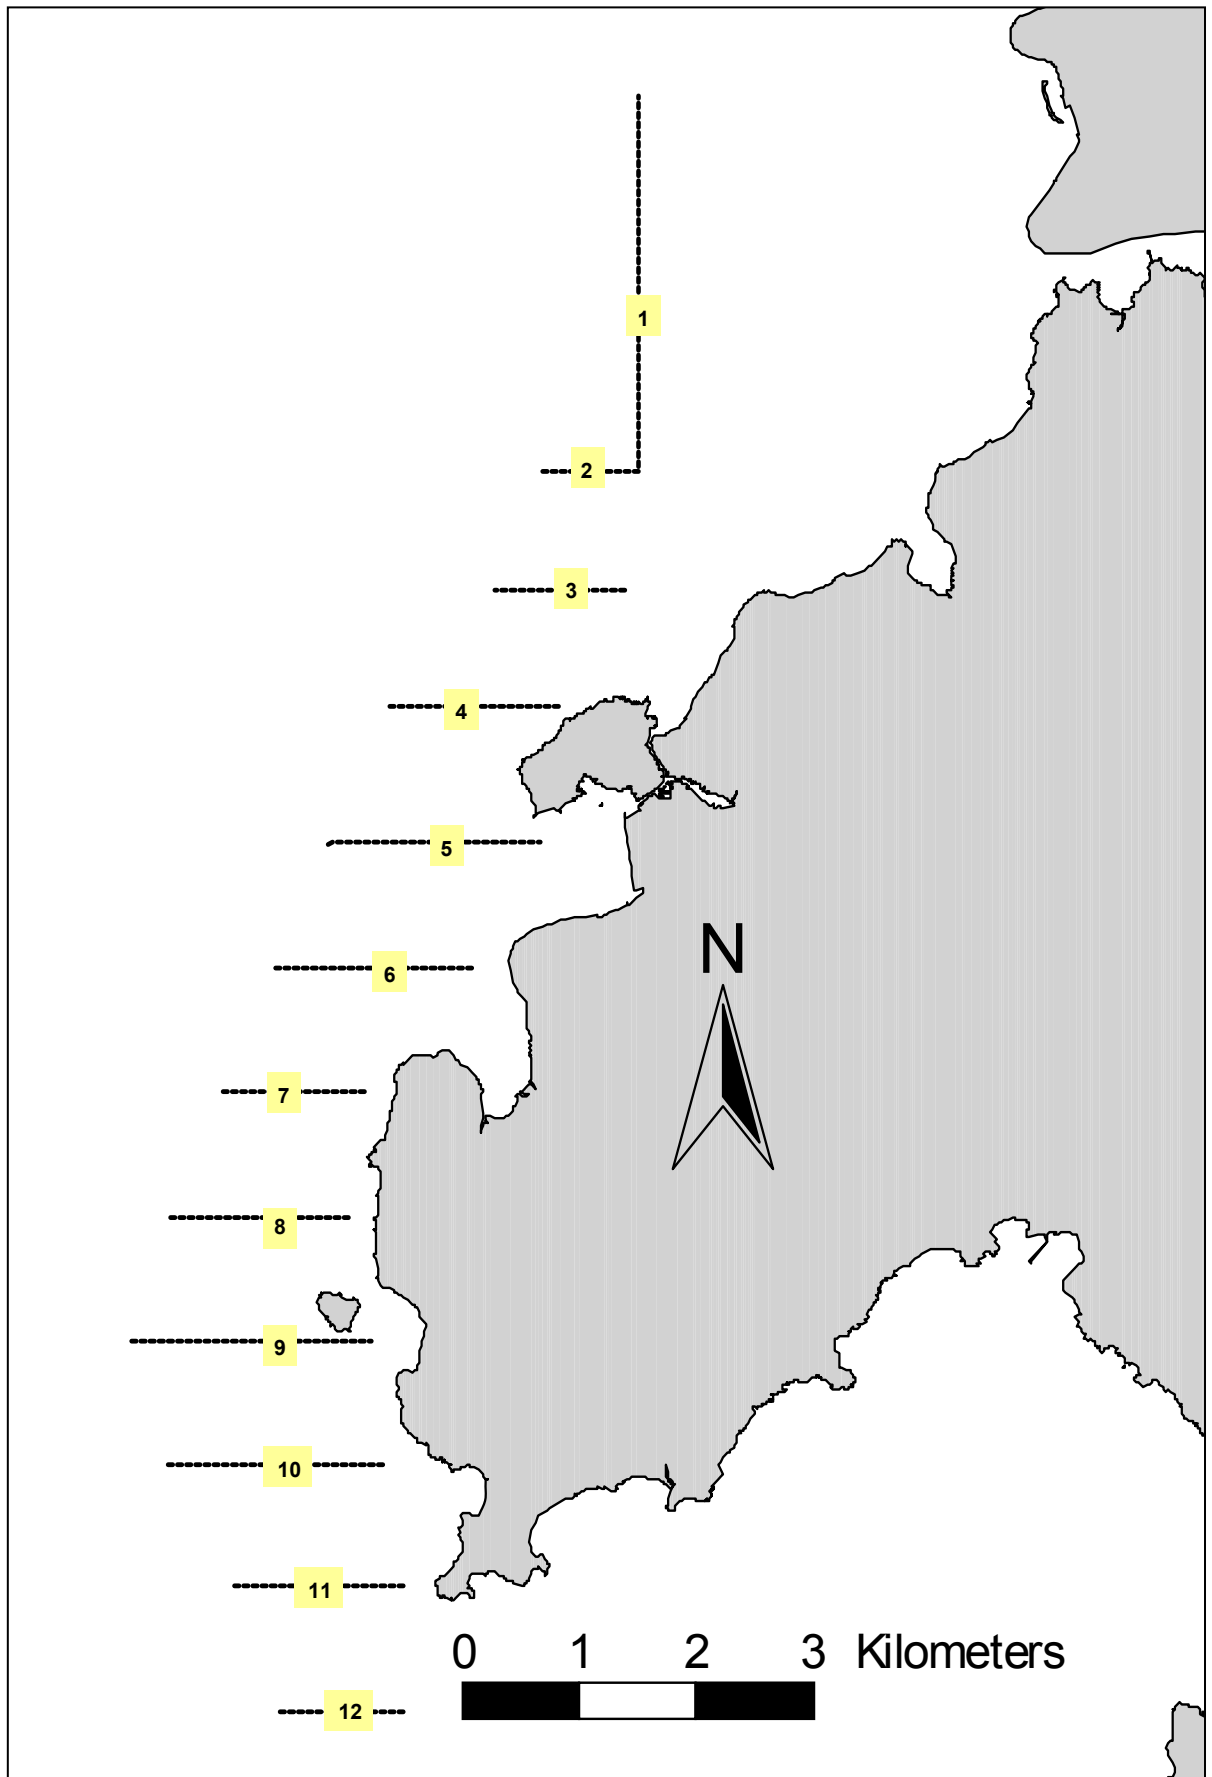


Figure 1. Transect Line Layout in West Lantau Survey Areas

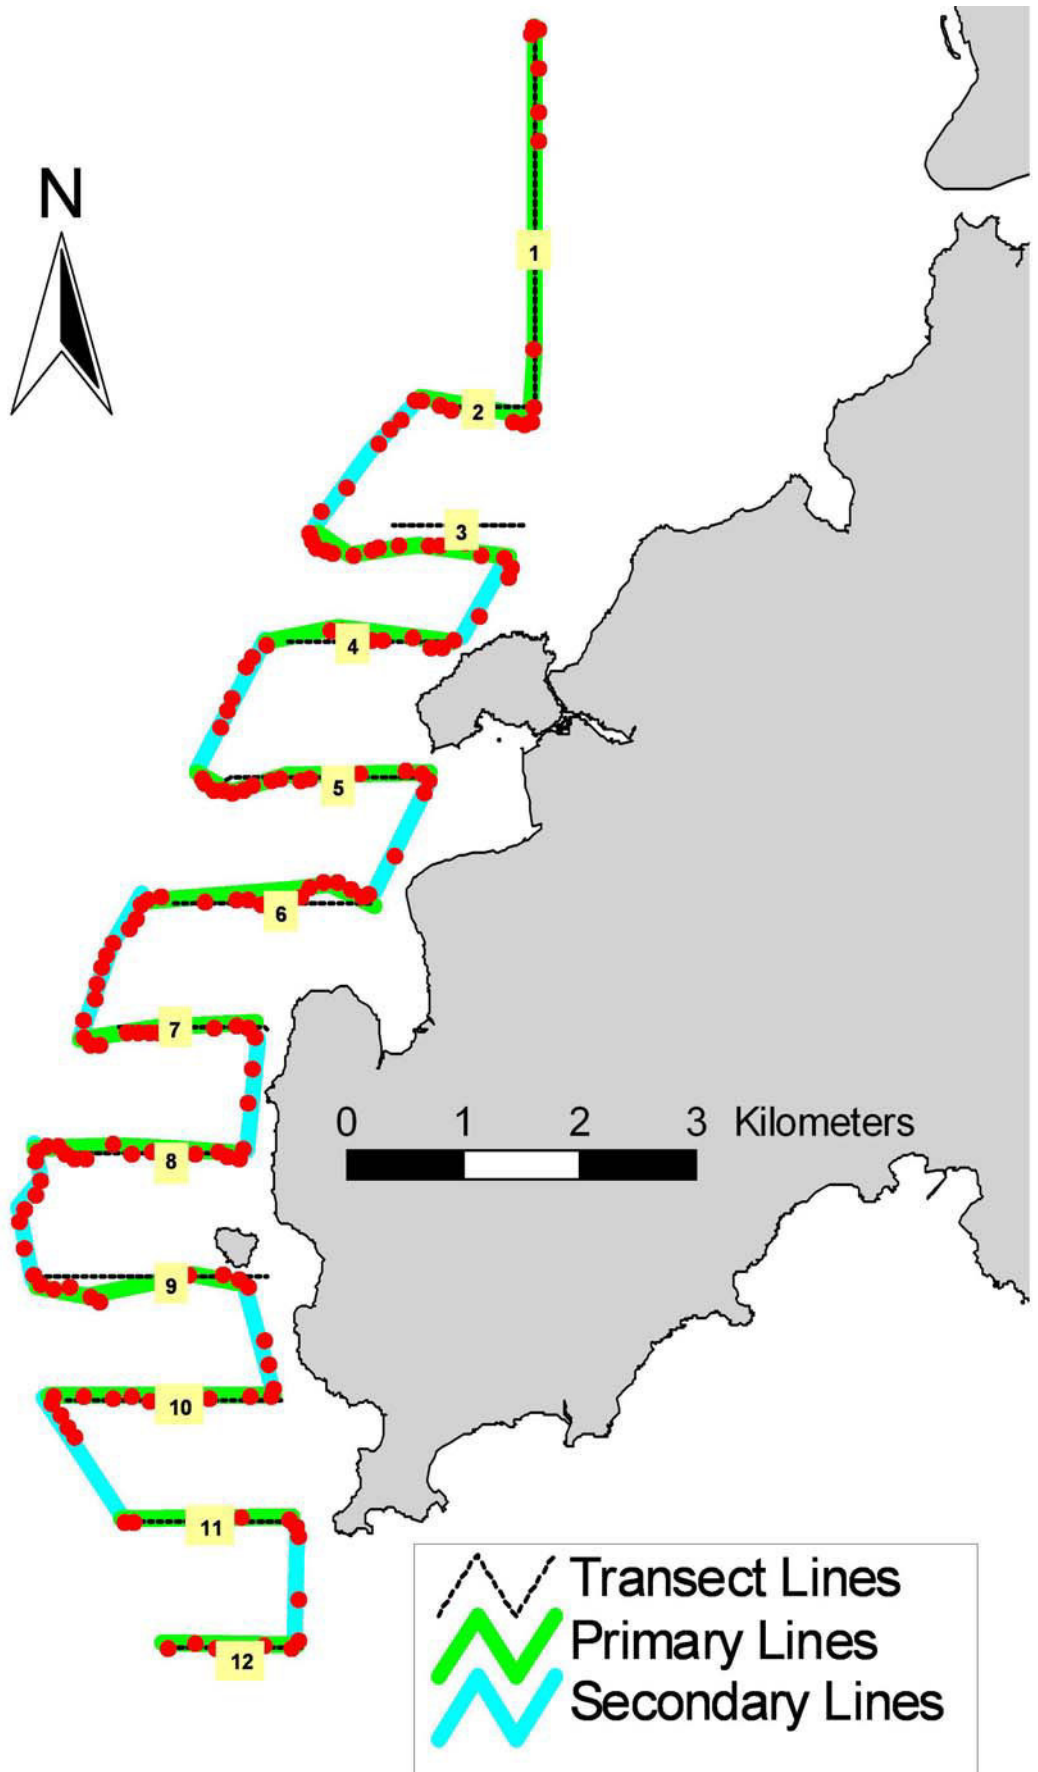


Figure 2. Survey Route on September 7th, 2015 (note: red dots represent the tracked positions of survey boat logged continuously by GPS throughout the course of the survey)

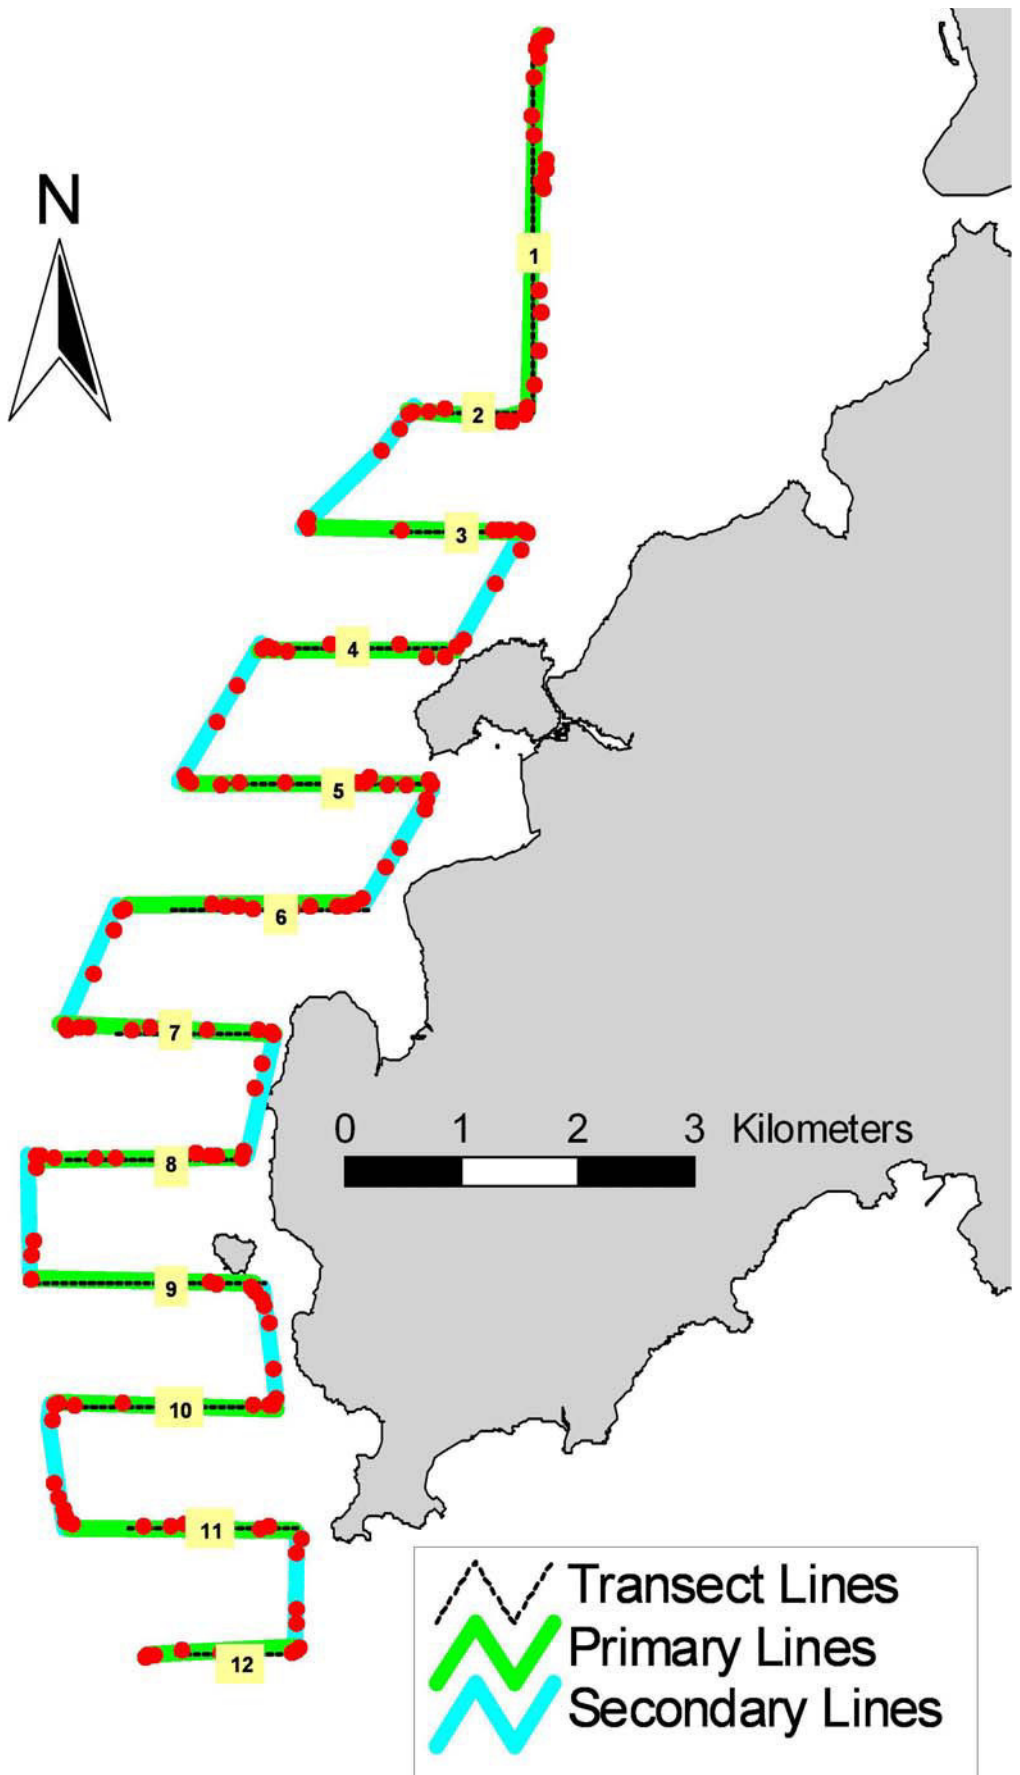


Figure 3. Survey Route on September 10th, 2015 (note: red dots represent the tracked positions of survey boat logged continuously by GPS throughout the course of the survey)

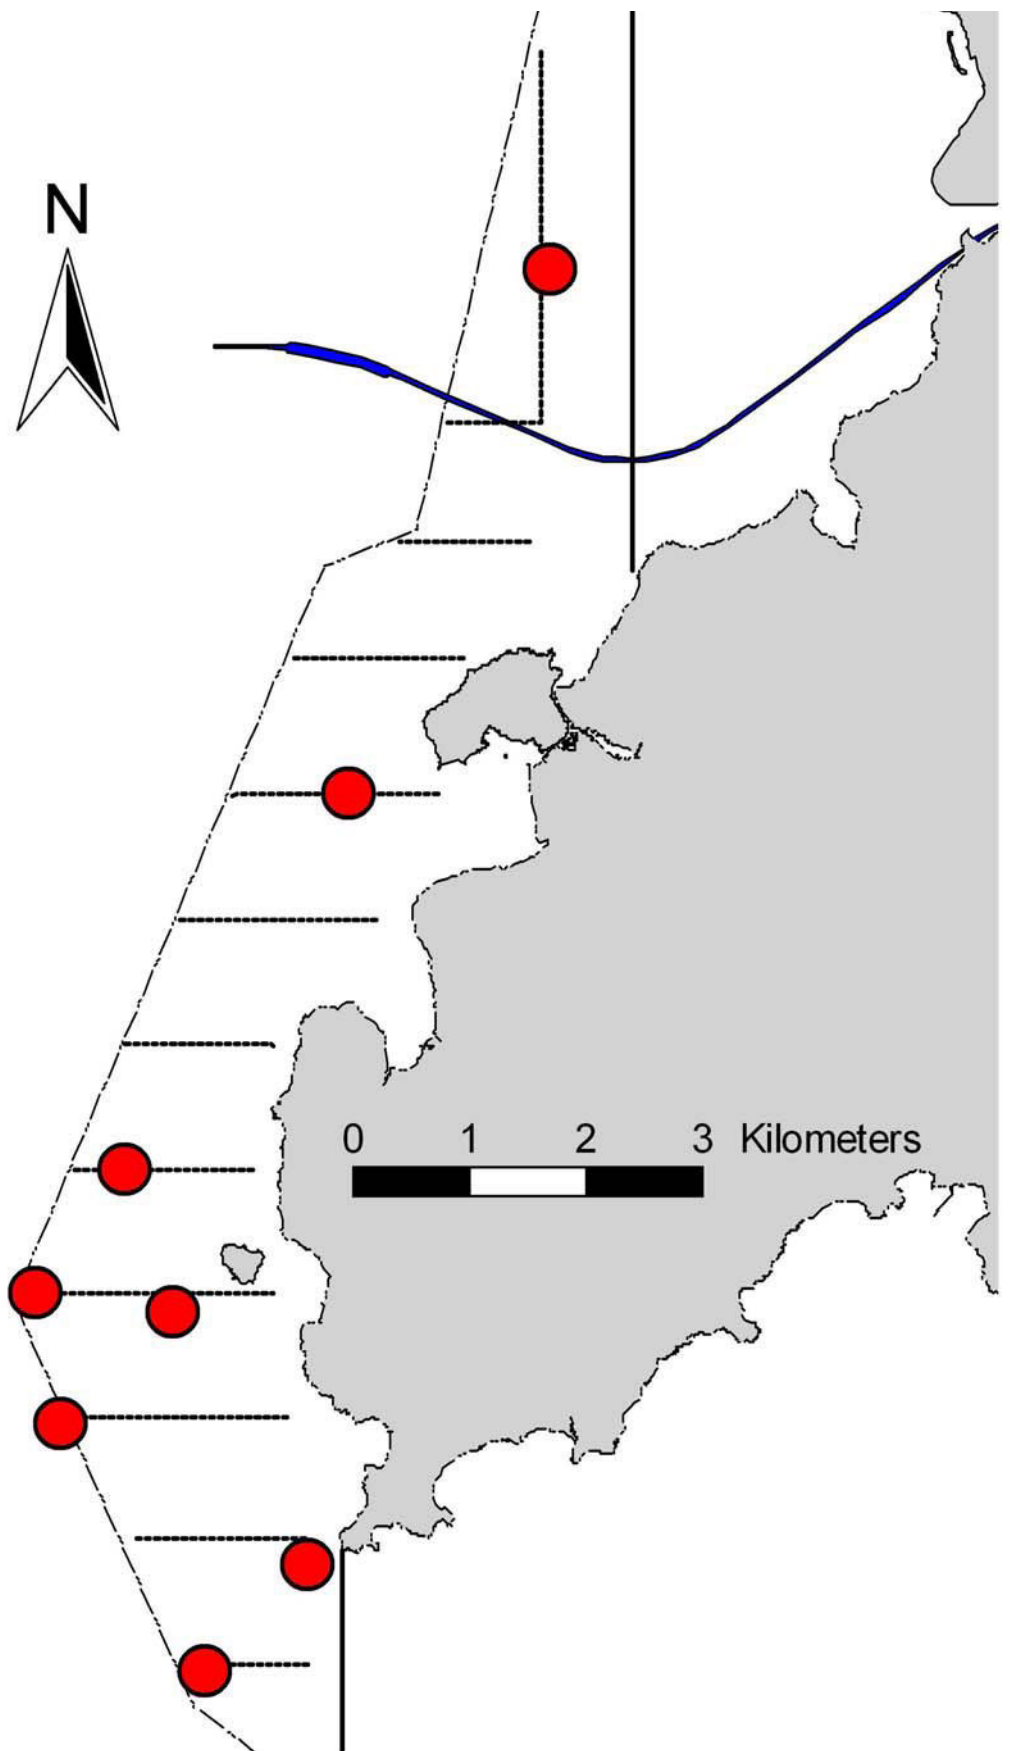


Figure 4. Distribution of Chinese White Dolphin Sighting during September 2015 HKLR09 Monitoring Surveys

Appendix I. HKLR09 Survey Effort Database (September 2015)

(Abbreviations: BEAU = Beaufort Sea State; P = Primary Line Effort; S = Secondary Line Effort)

DATE	AREA	BEAU	EFFORT	SEASON	VESSEL	TYPE	P/S
7-Sep-15	W LANTAU	2	11.50	AUTUMN	STANDARD31516	HKLR	P
7-Sep-15	W LANTAU	3	10.78	AUTUMN	STANDARD31516	HKLR	P
7-Sep-15	W LANTAU	2	4.70	AUTUMN	STANDARD31516	HKLR	S
7-Sep-15	W LANTAU	3	5.98	AUTUMN	STANDARD31516	HKLR	S
10-Sep-15	W LANTAU	2	9.98	AUTUMN	STANDARD31516	HKLR	P
10-Sep-15	W LANTAU	3	11.16	AUTUMN	STANDARD31516	HKLR	P
10-Sep-15	W LANTAU	4	0.63	AUTUMN	STANDARD31516	HKLR	P
10-Sep-15	W LANTAU	2	5.75	AUTUMN	STANDARD31516	HKLR	S
10-Sep-15	W LANTAU	3	3.99	AUTUMN	STANDARD31516	HKLR	S
10-Sep-15	W LANTAU	4	0.87	AUTUMN	STANDARD31516	HKLR	S

Appendix II. HKLR09 Chinese White Dolphin Sighting Database (September 2015)

(Abberviations: STG# = Sighting Number; HRD SZ = Dolphin Herd Size; BEAU = Beaufort Sea State; PSD = Perpendicular Distance; ND = Not Determined; BOAT ASSOC. = Fishing Boat Association; P/S: Sighting Made on Primary/Secondary Line)

DATE	STG #	TIME	HRD SZ	AREA	BEAU	PSD	EFFORT	TYPE	NORTHING	EASTING	SEASON	BOAT ASSOC.	P/S
7-Sep-15	1	1206	7	W LANTAU	3	152	ON	HKLR	808280	800584	AUTUMN	NONE	P
10-Sep-15	1	1254	1	W LANTAU	3	ND	OFF	HKLR	805390	800856	AUTUMN	NONE	
10-Sep-15	2	1309	6	W LANTAU	3	253	ON	HKLR	806251	801734	AUTUMN	NONE	S
10-Sep-15	3	1337	1	W LANTAU	3	323	ON	HKLR	807397	799633	AUTUMN	NONE	S
10-Sep-15	4	1402	2	W LANTAU	3	326	ON	HKLR	808438	799409	AUTUMN	NONE	P
10-Sep-15	5	1415	7	W LANTAU	4	435	ON	HKLR	809433	800164	AUTUMN	NONE	P
10-Sep-15	6	1520	3	W LANTAU	2	93	ON	HKLR	812463	802088	AUTUMN	NONE	P
10-Sep-15	7	1620	5	W LANTAU	2	41	ON	HKLR	816689	803819	AUTUMN	NONE	P

Appendix III. Individual dolphins identified during HKLR09 monitoring surveys in September 2015

ID#	DATE	STG#	AREA
NL49	10/09/15	7	W LANTAU
NL123	10/09/15	5	W LANTAU
NL264	10/09/15	7	W LANTAU
NL269	07/09/15	1	W LANTAU
NL279	07/09/15	1	W LANTAU
NL284	07/09/15	1	W LANTAU
NL285	10/09/15	5	W LANTAU
NL287	10/09/15	5	W LANTAU
NL288	10/09/15	7	W LANTAU
NL296	10/09/15	7	W LANTAU
WL05	10/09/15	7	W LANTAU
WL21	10/09/15	2	W LANTAU
	10/09/15	5	W LANTAU
WL46	07/09/15	1	W LANTAU
	10/09/15	2	W LANTAU
	10/09/15	5	W LANTAU
WL79	10/09/15	6	W LANTAU
WL190	07/09/15	1	W LANTAU
WL207	10/09/15	2	W LANTAU
	10/09/15	5	W LANTAU
WL216	10/09/15	6	W LANTAU

NL269_20150907_1



NL279_20150907_1



NL284_20150907_1



WL46_20150907_1



WL190_20150907_1



WL21_20150910_2



WL46_20150910_2



WL207_20150910_2



NL123_20150910_5



NL285_20150910_5



NL287_20150910_5



WL21_20150910_5



WL46_20150910_5



WL207_20150910_5



WL216_20150910_5



WL79_20150910_6



NL49_20150910_7



NL264_20150910_7





Appendix IV (cont'd).

APPENDIX J
WIND DATA

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
1-Sep-2015	0:00	1.7	WNW
1-Sep-2015	1:00	1.7	W
1-Sep-2015	2:00	3.2	WNW
1-Sep-2015	3:00	2.9	NW
1-Sep-2015	4:00	2.6	WNW
1-Sep-2015	5:00	2.3	WNW
1-Sep-2015	6:00	2.2	WNW
1-Sep-2015	7:00	2.7	W
1-Sep-2015	8:00	3.2	WNW
1-Sep-2015	9:00	3.2	WNW
1-Sep-2015	10:00	2.2	WNW
1-Sep-2015	11:00	2.9	WNW
1-Sep-2015	12:00	3.4	W
1-Sep-2015	13:00	3.6	WNW
1-Sep-2015	14:00	3.6	NW
1-Sep-2015	15:00	2.4	W
1-Sep-2015	16:00	3.3	W
1-Sep-2015	17:00	2.6	W
1-Sep-2015	18:00	2.4	W
1-Sep-2015	19:00	2.2	W
1-Sep-2015	20:00	2.4	WNW
1-Sep-2015	21:00	2.2	W
1-Sep-2015	22:00	2.7	W
1-Sep-2015	23:00	2.9	WSW
2-Sep-2015	0:00	2.9	SSW
2-Sep-2015	1:00	2.4	SSW
2-Sep-2015	2:00	2.7	SW
2-Sep-2015	3:00	2.2	SW
2-Sep-2015	4:00	2	SW
2-Sep-2015	5:00	1.4	SSW
2-Sep-2015	6:00	1.2	W
2-Sep-2015	7:00	1.3	SSW
2-Sep-2015	8:00	1.4	W
2-Sep-2015	9:00	1	W
2-Sep-2015	10:00	1	W
2-Sep-2015	11:00	1.4	WNW
2-Sep-2015	12:00	1.6	W
2-Sep-2015	13:00	0.5	WSW
2-Sep-2015	14:00	1.2	WNW
2-Sep-2015	15:00	1	WNW
2-Sep-2015	16:00	0.9	W
2-Sep-2015	17:00	1.4	WNW
2-Sep-2015	18:00	1	WNW
2-Sep-2015	19:00	1	WNW
2-Sep-2015	20:00	1	W
2-Sep-2015	21:00	1.4	SW
2-Sep-2015	22:00	1.3	SW
2-Sep-2015	23:00	1.2	SW
3-Sep-2015	0:00	1.7	WSW
3-Sep-2015	1:00	2.6	WSW
3-Sep-2015	2:00	1.9	WSW
3-Sep-2015	3:00	0.9	WSW
3-Sep-2015	4:00	0.7	SSW
3-Sep-2015	5:00	1.2	WSW
3-Sep-2015	6:00	1.2	WSW

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
3-Sep-2015	7:00	2.3	WNW
3-Sep-2015	8:00	2.7	SW
3-Sep-2015	9:00	1.8	W
3-Sep-2015	10:00	2.3	W
3-Sep-2015	11:00	3.2	WSW
3-Sep-2015	12:00	3.7	WNW
3-Sep-2015	13:00	3.3	NNE
3-Sep-2015	14:00	4	NNE
3-Sep-2015	15:00	3.9	SSE
3-Sep-2015	16:00	4.2	SSE
3-Sep-2015	17:00	3	SSE
3-Sep-2015	18:00	2.9	SSW
3-Sep-2015	19:00	3.2	WNW
3-Sep-2015	20:00	2.7	W
3-Sep-2015	21:00	3	WNW
3-Sep-2015	22:00	3.6	WNW
3-Sep-2015	23:00	1.9	WNW
4-Sep-2015	0:00	2.2	SW
4-Sep-2015	1:00	3.2	SW
4-Sep-2015	2:00	4.6	SW
4-Sep-2015	3:00	3.4	SW
4-Sep-2015	4:00	3.2	WSW
4-Sep-2015	5:00	4.3	WSW
4-Sep-2015	6:00	3.2	S
4-Sep-2015	7:00	3.9	W
4-Sep-2015	8:00	4	WNW
4-Sep-2015	9:00	4.3	WNW
4-Sep-2015	10:00	4	NW
4-Sep-2015	11:00	4.3	WNW
4-Sep-2015	12:00	4.2	NE
4-Sep-2015	13:00	4	WSW
4-Sep-2015	14:00	3.6	WSW
4-Sep-2015	15:00	3.6	WNW
4-Sep-2015	16:00	4.2	W
4-Sep-2015	17:00	3.4	W
4-Sep-2015	18:00	2.9	W
4-Sep-2015	19:00	3.7	W
4-Sep-2015	20:00	3.6	W
4-Sep-2015	21:00	4.2	WSW
4-Sep-2015	22:00	4.2	W
4-Sep-2015	23:00	4.2	W
5-Sep-2015	0:00	3.7	NW
5-Sep-2015	1:00	3	N
5-Sep-2015	2:00	4.1	S
5-Sep-2015	3:00	3.4	SSW
5-Sep-2015	4:00	3.9	W
5-Sep-2015	5:00	3	WSW
5-Sep-2015	6:00	4.3	SW
5-Sep-2015	7:00	2.2	WSW
5-Sep-2015	8:00	3.6	S
5-Sep-2015	9:00	4	SSW
5-Sep-2015	10:00	3.9	NNW
5-Sep-2015	11:00	2.2	N
5-Sep-2015	12:00	2.7	N
5-Sep-2015	13:00	2.9	N

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
5-Sep-2015	14:00	2.4	NE
5-Sep-2015	15:00	3.4	ESE
5-Sep-2015	16:00	2.7	W
5-Sep-2015	17:00	2.7	WNW
5-Sep-2015	18:00	4	SW
5-Sep-2015	19:00	2.6	WNW
5-Sep-2015	20:00	2.9	WNW
5-Sep-2015	21:00	4.3	WSW
5-Sep-2015	22:00	4	WSW
5-Sep-2015	23:00	3.6	WNW
6-Sep-2015	0:00	4	WSW
6-Sep-2015	1:00	3.7	WSW
6-Sep-2015	2:00	3.6	W
6-Sep-2015	3:00	4.3	SW
6-Sep-2015	4:00	3.6	SW
6-Sep-2015	5:00	2.7	WSW
6-Sep-2015	6:00	2.7	SW
6-Sep-2015	7:00	2.2	W
6-Sep-2015	8:00	2.7	S
6-Sep-2015	9:00	3.4	WNW
6-Sep-2015	10:00	3.3	SW
6-Sep-2015	11:00	3.4	WSW
6-Sep-2015	12:00	3	W
6-Sep-2015	13:00	4	WSW
6-Sep-2015	14:00	2.4	SW
6-Sep-2015	15:00	2.3	WNW
6-Sep-2015	16:00	4	NNE
6-Sep-2015	17:00	3.3	SE
6-Sep-2015	18:00	3.6	ESE
6-Sep-2015	19:00	3.3	ESE
6-Sep-2015	20:00	3.2	SW
6-Sep-2015	21:00	2.6	SW
6-Sep-2015	22:00	2.7	W
6-Sep-2015	23:00	2	W
7-Sep-2015	0:00	2	N
7-Sep-2015	1:00	2.1	N
7-Sep-2015	2:00	1.6	N
7-Sep-2015	3:00	1.4	E
7-Sep-2015	4:00	1.4	ENE
7-Sep-2015	5:00	1.1	ENE
7-Sep-2015	6:00	0.7	ENE
7-Sep-2015	7:00	0.6	ENE
7-Sep-2015	8:00	1.1	ENE
7-Sep-2015	9:00	1.6	NE
7-Sep-2015	10:00	2.1	NE
7-Sep-2015	11:00	2.3	ENE
7-Sep-2015	12:00	2.6	ENE
7-Sep-2015	13:00	2.9	E
7-Sep-2015	14:00	2.6	ENE
7-Sep-2015	15:00	2.9	ENE
7-Sep-2015	16:00	2.9	ENE
7-Sep-2015	17:00	2.7	ENE
7-Sep-2015	18:00	2.1	ENE
7-Sep-2015	19:00	1.7	ENE
7-Sep-2015	20:00	1.4	ENE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
7-Sep-2015	21:00	1.7	NE
7-Sep-2015	22:00	1.9	N
7-Sep-2015	23:00	0.9	NNE
8-Sep-2015	0:00	1.2	NNE
8-Sep-2015	1:00	1.7	NNE
8-Sep-2015	2:00	1.4	ENE
8-Sep-2015	3:00	1	E
8-Sep-2015	4:00	0.8	E
8-Sep-2015	5:00	1.1	NNE
8-Sep-2015	6:00	1.3	NE
8-Sep-2015	7:00	1.3	NNE
8-Sep-2015	8:00	1.9	NE
8-Sep-2015	9:00	2.6	NNE
8-Sep-2015	10:00	2.7	N
8-Sep-2015	11:00	2.6	NE
8-Sep-2015	12:00	2.6	NE
8-Sep-2015	13:00	2.7	NE
8-Sep-2015	14:00	4.2	NE
8-Sep-2015	15:00	4.7	NE
8-Sep-2015	16:00	2.4	W
8-Sep-2015	17:00	2.2	W
8-Sep-2015	18:00	3	W
8-Sep-2015	19:00	2.7	SW
8-Sep-2015	20:00	2.4	WSW
8-Sep-2015	21:00	3	WSW
8-Sep-2015	22:00	2.6	W
8-Sep-2015	23:00	2.3	WSW
9-Sep-2015	0:00	2.7	WSW
9-Sep-2015	1:00	3.3	WSW
9-Sep-2015	2:00	2.9	WSW
9-Sep-2015	3:00	2.6	WSW
9-Sep-2015	4:00	2	WSW
9-Sep-2015	5:00	2	WSW
9-Sep-2015	6:00	1.2	W
9-Sep-2015	7:00	1.3	W
9-Sep-2015	8:00	2	W
9-Sep-2015	9:00	3	W
9-Sep-2015	10:00	2.9	W
9-Sep-2015	11:00	2.9	W
9-Sep-2015	12:00	3.7	WNW
9-Sep-2015	13:00	2.9	W
9-Sep-2015	14:00	1.7	WNW
9-Sep-2015	15:00	2.6	WSW
9-Sep-2015	16:00	2.7	NNE
9-Sep-2015	17:00	3	NW
9-Sep-2015	18:00	2	W
9-Sep-2015	19:00	1.9	WNW
9-Sep-2015	20:00	1.4	W
9-Sep-2015	21:00	1.4	W
9-Sep-2015	22:00	0.9	W
9-Sep-2015	23:00	1.4	W
10-Sep-2015	0:00	1.4	N
10-Sep-2015	1:00	1	SSW
10-Sep-2015	2:00	0.6	NNE
10-Sep-2015	3:00	0.4	NNE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
10-Sep-2015	4:00	0.3	NE
10-Sep-2015	5:00	0.6	N
10-Sep-2015	6:00	0.1	N
10-Sep-2015	7:00	0.3	NW
10-Sep-2015	8:00	0.4	ESE
10-Sep-2015	9:00	0.5	ENE
10-Sep-2015	10:00	0.7	ENE
10-Sep-2015	11:00	2.4	ENE
10-Sep-2015	12:00	2.6	E
10-Sep-2015	13:00	2.4	E
10-Sep-2015	14:00	2.4	E
10-Sep-2015	15:00	2.9	ENE
10-Sep-2015	16:00	2.7	NE
10-Sep-2015	17:00	3	ENE
10-Sep-2015	18:00	2.2	ENE
10-Sep-2015	19:00	1.7	N
10-Sep-2015	20:00	2.3	E
10-Sep-2015	21:00	1.6	SSE
10-Sep-2015	22:00	1.6	N
10-Sep-2015	23:00	1.7	NNE
11-Sep-2015	0:00	1.7	E
11-Sep-2015	1:00	1.7	ESE
11-Sep-2015	2:00	1.6	NE
11-Sep-2015	3:00	1.9	ENE
11-Sep-2015	4:00	1.6	ENE
11-Sep-2015	5:00	1.1	NE
11-Sep-2015	6:00	1.4	WNW
11-Sep-2015	7:00	1.4	WNW
11-Sep-2015	8:00	1.3	WNW
11-Sep-2015	9:00	1.7	N
11-Sep-2015	10:00	2	N
11-Sep-2015	11:00	3	N
11-Sep-2015	12:00	3.2	N
11-Sep-2015	13:00	2.7	NE
11-Sep-2015	14:00	3	E
11-Sep-2015	15:00	2.9	ESE
11-Sep-2015	16:00	2	W
11-Sep-2015	17:00	2.4	N
11-Sep-2015	18:00	2	N
11-Sep-2015	19:00	1.9	N
11-Sep-2015	20:00	1.6	N
11-Sep-2015	21:00	1.4	ENE
11-Sep-2015	22:00	1.7	ENE
11-Sep-2015	23:00	1.6	ESE
12-Sep-2015	0:00	1.3	ENE
12-Sep-2015	1:00	1	NE
12-Sep-2015	2:00	0.8	NE
12-Sep-2015	3:00	1	NE
12-Sep-2015	4:00	1.1	NE
12-Sep-2015	5:00	1	NE
12-Sep-2015	6:00	0.7	NE
12-Sep-2015	7:00	0.3	NNE
12-Sep-2015	8:00	0.7	NE
12-Sep-2015	9:00	1.4	NE
12-Sep-2015	10:00	1.9	NE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
12-Sep-2015	11:00	2.7	NE
12-Sep-2015	12:00	3	NE
12-Sep-2015	13:00	2.4	NE
12-Sep-2015	14:00	2.6	ENE
12-Sep-2015	15:00	2.7	NE
12-Sep-2015	16:00	2.3	ENE
12-Sep-2015	17:00	2.7	NE
12-Sep-2015	18:00	2	NE
12-Sep-2015	19:00	3	NNE
12-Sep-2015	20:00	2.9	NE
12-Sep-2015	21:00	1.7	NNE
12-Sep-2015	22:00	1.1	ENE
12-Sep-2015	23:00	1.3	N
13-Sep-2015	0:00	1	WNW
13-Sep-2015	1:00	0.7	WNW
13-Sep-2015	2:00	0.9	W
13-Sep-2015	3:00	1.2	WSW
13-Sep-2015	4:00	0.9	W
13-Sep-2015	5:00	0.6	WSW
13-Sep-2015	6:00	0.8	WSW
13-Sep-2015	7:00	1.1	WSW
13-Sep-2015	8:00	0.8	W
13-Sep-2015	9:00	1.9	W
13-Sep-2015	10:00	1.9	SW
13-Sep-2015	11:00	2.6	SW
13-Sep-2015	12:00	3.2	WSW
13-Sep-2015	13:00	2.9	WSW
13-Sep-2015	14:00	3.3	WSW
13-Sep-2015	15:00	2.4	WSW
13-Sep-2015	16:00	3.2	WSW
13-Sep-2015	17:00	3	WSW
13-Sep-2015	18:00	2.4	WSW
13-Sep-2015	19:00	1.4	W
13-Sep-2015	20:00	0.9	WSW
13-Sep-2015	21:00	1.4	W
13-Sep-2015	22:00	1.1	SW
13-Sep-2015	23:00	1.1	SW
14-Sep-2015	0:00	1.7	W
14-Sep-2015	1:00	2	W
14-Sep-2015	2:00	2	S
14-Sep-2015	3:00	2.6	W
14-Sep-2015	4:00	1.6	W
14-Sep-2015	5:00	1.9	N
14-Sep-2015	6:00	1.7	N
14-Sep-2015	7:00	1.7	SW
14-Sep-2015	8:00	2.4	W
14-Sep-2015	9:00	2.6	W
14-Sep-2015	10:00	3	W
14-Sep-2015	11:00	3	WSW
14-Sep-2015	12:00	2.9	WNW
14-Sep-2015	13:00	3.2	W
14-Sep-2015	14:00	3.2	W
14-Sep-2015	15:00	2.3	W
14-Sep-2015	16:00	2.2	WNW
14-Sep-2015	17:00	2.3	W

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
14-Sep-2015	18:00	1.9	WSW
14-Sep-2015	19:00	2	W
14-Sep-2015	20:00	2.2	W
14-Sep-2015	21:00	2	SSW
14-Sep-2015	22:00	2	SSW
14-Sep-2015	23:00	1.7	SSW
15-Sep-2015	0:00	1.7	SSW
15-Sep-2015	1:00	0.9	SW
15-Sep-2015	2:00	0.8	SW
15-Sep-2015	3:00	0.9	W
15-Sep-2015	4:00	1.6	NNE
15-Sep-2015	5:00	2	NNE
15-Sep-2015	6:00	1.6	W
15-Sep-2015	7:00	1.9	SW
15-Sep-2015	8:00	2.3	WSW
15-Sep-2015	9:00	1.5	SW
15-Sep-2015	10:00	1.3	WSW
15-Sep-2015	11:00	1.4	WSW
15-Sep-2015	12:00	1.4	SW
15-Sep-2015	13:00	1.1	WSW
15-Sep-2015	14:00	1.3	WSW
15-Sep-2015	15:00	1.6	SW
15-Sep-2015	16:00	2	WSW
15-Sep-2015	17:00	1.4	WSW
15-Sep-2015	18:00	1.3	SW
15-Sep-2015	19:00	1	SW
15-Sep-2015	20:00	0.6	SW
15-Sep-2015	21:00	1	SW
15-Sep-2015	22:00	0.7	SW
15-Sep-2015	23:00	0.1	SW
16-Sep-2015	0:00	0.3	WNW
16-Sep-2015	1:00	1.1	W
16-Sep-2015	2:00	1	W
16-Sep-2015	3:00	1.6	W
16-Sep-2015	4:00	1.4	W
16-Sep-2015	5:00	1.2	SW
16-Sep-2015	6:00	0.3	W
16-Sep-2015	7:00	1.2	NNE
16-Sep-2015	8:00	1.4	N
16-Sep-2015	9:00	2	NNE
16-Sep-2015	10:00	2.9	ENE
16-Sep-2015	11:00	2.7	WSW
16-Sep-2015	12:00	3.2	SW
16-Sep-2015	13:00	2.7	W
16-Sep-2015	14:00	3	W
16-Sep-2015	15:00	3.4	SW
16-Sep-2015	16:00	2.9	W
16-Sep-2015	17:00	2.9	S
16-Sep-2015	18:00	2.6	WNW
16-Sep-2015	19:00	2	W
16-Sep-2015	20:00	1.8	WNW
16-Sep-2015	21:00	1.7	NW
16-Sep-2015	22:00	1.6	W
16-Sep-2015	23:00	1.9	W
17-Sep-2015	0:00	1.4	WNW

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
17-Sep-2015	1:00	1.4	W
17-Sep-2015	2:00	1.3	NNE
17-Sep-2015	3:00	1.2	ENE
17-Sep-2015	4:00	1	ENE
17-Sep-2015	5:00	1.6	W
17-Sep-2015	6:00	1.4	W
17-Sep-2015	7:00	1.3	E
17-Sep-2015	8:00	1.6	S
17-Sep-2015	9:00	1.6	SSW
17-Sep-2015	10:00	2.4	W
17-Sep-2015	11:00	2.9	W
17-Sep-2015	12:00	3	W
17-Sep-2015	13:00	3.3	W
17-Sep-2015	14:00	2.9	W
17-Sep-2015	15:00	3.3	SW
17-Sep-2015	16:00	2.9	SSW
17-Sep-2015	17:00	2.3	SSW
17-Sep-2015	18:00	2.4	WSW
17-Sep-2015	19:00	2.6	NW
17-Sep-2015	20:00	2.9	W
17-Sep-2015	21:00	3.3	W
17-Sep-2015	22:00	2.9	NW
17-Sep-2015	23:00	2.2	WNW
18-Sep-2015	0:00	2.3	NW
18-Sep-2015	1:00	2.6	NNE
18-Sep-2015	2:00	2.4	NE
18-Sep-2015	3:00	1.4	ENE
18-Sep-2015	4:00	1.3	W
18-Sep-2015	5:00	0.9	W
18-Sep-2015	6:00	0.9	W
18-Sep-2015	7:00	1.6	W
18-Sep-2015	8:00	2	SSW
18-Sep-2015	9:00	2.9	SW
18-Sep-2015	10:00	2.9	W
18-Sep-2015	11:00	3	ENE
18-Sep-2015	12:00	3	SSW
18-Sep-2015	13:00	3.4	SW
18-Sep-2015	14:00	3.4	S
18-Sep-2015	15:00	3.4	SW
18-Sep-2015	16:00	2.9	S
18-Sep-2015	17:00	2.7	SSW
18-Sep-2015	18:00	2.1	SSW
18-Sep-2015	19:00	1.9	SW
18-Sep-2015	20:00	1.9	SW
18-Sep-2015	21:00	1.9	SW
18-Sep-2015	22:00	2	W
18-Sep-2015	23:00	2	W
19-Sep-2015	0:00	1.9	W
19-Sep-2015	1:00	1.4	W
19-Sep-2015	2:00	1	W
19-Sep-2015	3:00	1	E
19-Sep-2015	4:00	1.2	ENE
19-Sep-2015	5:00	1	ESE
19-Sep-2015	6:00	1.4	SW
19-Sep-2015	7:00	1	W

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
19-Sep-2015	8:00	2.2	WNW
19-Sep-2015	9:00	3.2	SSW
19-Sep-2015	10:00	3.2	SSW
19-Sep-2015	11:00	3.2	SSW
19-Sep-2015	12:00	3.8	S
19-Sep-2015	13:00	3.2	E
19-Sep-2015	14:00	3.4	WSW
19-Sep-2015	15:00	2.4	SW
19-Sep-2015	16:00	3	SW
19-Sep-2015	17:00	3	SW
19-Sep-2015	18:00	2	WNW
19-Sep-2015	19:00	1.4	W
19-Sep-2015	20:00	1.2	W
19-Sep-2015	21:00	0.7	WSW
19-Sep-2015	22:00	0.8	SW
19-Sep-2015	23:00	0.5	SW
20-Sep-2015	0:00	0.4	SW
20-Sep-2015	1:00	0.8	WSW
20-Sep-2015	2:00	0.6	W
20-Sep-2015	3:00	0.5	W
20-Sep-2015	4:00	0.7	W
20-Sep-2015	5:00	1.2	W
20-Sep-2015	6:00	1	WSW
20-Sep-2015	7:00	1.2	S
20-Sep-2015	8:00	1.3	S
20-Sep-2015	9:00	2.3	SW
20-Sep-2015	10:00	3	SSW
20-Sep-2015	11:00	3.4	SW
20-Sep-2015	12:00	2.7	W
20-Sep-2015	13:00	3	ENE
20-Sep-2015	14:00	2.9	WNW
20-Sep-2015	15:00	2.3	W
20-Sep-2015	16:00	2.2	WSW
20-Sep-2015	17:00	2.1	W
20-Sep-2015	18:00	2.1	WNW
20-Sep-2015	19:00	1.8	W
20-Sep-2015	20:00	1.5	WNW
20-Sep-2015	21:00	1.4	W
20-Sep-2015	22:00	1.5	WNW
20-Sep-2015	23:00	1.3	WNW
21-Sep-2015	0:00	1.7	WNW
21-Sep-2015	1:00	1.6	WNW
21-Sep-2015	2:00	1.6	WNW
21-Sep-2015	3:00	1.7	WNW
21-Sep-2015	4:00	1.6	W
21-Sep-2015	5:00	1.4	WNW
21-Sep-2015	6:00	1.4	WNW
21-Sep-2015	7:00	1.1	WNW
21-Sep-2015	8:00	1.6	WNW
21-Sep-2015	9:00	1.4	W
21-Sep-2015	10:00	2	W
21-Sep-2015	11:00	2.4	WNW
21-Sep-2015	12:00	2.6	WNW
21-Sep-2015	13:00	2.3	SSW
21-Sep-2015	14:00	2.3	SW

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
21-Sep-2015	15:00	2.2	SW
21-Sep-2015	16:00	2.6	WNW
21-Sep-2015	17:00	2.3	NW
21-Sep-2015	18:00	1.7	WNW
21-Sep-2015	19:00	1.1	W
21-Sep-2015	20:00	0.9	W
21-Sep-2015	21:00	0.9	W
21-Sep-2015	22:00	1	WSW
21-Sep-2015	23:00	1	SW
22-Sep-2015	0:00	1.7	WSW
22-Sep-2015	1:00	1.7	SW
22-Sep-2015	2:00	1.6	SW
22-Sep-2015	3:00	1.4	SW
22-Sep-2015	4:00	1.6	SW
22-Sep-2015	5:00	1.3	WNW
22-Sep-2015	6:00	0.7	WNW
22-Sep-2015	7:00	0.7	WNW
22-Sep-2015	8:00	0.7	WNW
22-Sep-2015	9:00	1.1	WNW
22-Sep-2015	10:00	1	WNW
22-Sep-2015	11:00	1.7	WSW
22-Sep-2015	12:00	1.8	WSW
22-Sep-2015	13:00	1.4	WSW
22-Sep-2015	14:00	2.4	WSW
22-Sep-2015	15:00	2.9	SW
22-Sep-2015	16:00	2	SW
22-Sep-2015	17:00	2.4	SW
22-Sep-2015	18:00	2.6	SW
22-Sep-2015	19:00	2.3	WSW
22-Sep-2015	20:00	2.6	SW
22-Sep-2015	21:00	1.6	W
22-Sep-2015	22:00	1.6	W
22-Sep-2015	23:00	2.2	W
23-Sep-2015	0:00	1.3	SW
23-Sep-2015	1:00	1.4	WNW
23-Sep-2015	2:00	0.7	W
23-Sep-2015	3:00	0.3	W
23-Sep-2015	4:00	0.4	W
23-Sep-2015	5:00	0.3	SW
23-Sep-2015	6:00	0.4	SSW
23-Sep-2015	7:00	0.3	SW
23-Sep-2015	8:00	1.3	W
23-Sep-2015	9:00	1.4	W
23-Sep-2015	10:00	2.4	W
23-Sep-2015	11:00	3.2	SSW
23-Sep-2015	12:00	2.9	SSW
23-Sep-2015	13:00	3.4	SSW
23-Sep-2015	14:00	4.5	WNW
23-Sep-2015	15:00	3.3	W
23-Sep-2015	16:00	2.9	W
23-Sep-2015	17:00	2.6	WNW
23-Sep-2015	18:00	1.9	W
23-Sep-2015	19:00	1.7	WSW
23-Sep-2015	20:00	1.7	SW
23-Sep-2015	21:00	2.2	WNW

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
23-Sep-2015	22:00	2.7	WNW
23-Sep-2015	23:00	2.3	WSW
24-Sep-2015	0:00	1.6	WNW
24-Sep-2015	1:00	1.6	WNW
24-Sep-2015	2:00	1.2	WNW
24-Sep-2015	3:00	0.7	WNW
24-Sep-2015	4:00	1.3	WSW
24-Sep-2015	5:00	1.3	SSW
24-Sep-2015	6:00	1	SW
24-Sep-2015	7:00	0.7	WNW
24-Sep-2015	8:00	1	WNW
24-Sep-2015	9:00	1.6	WNW
24-Sep-2015	10:00	2.7	WSW
24-Sep-2015	11:00	2.7	SSW
24-Sep-2015	12:00	3.3	SW
24-Sep-2015	13:00	3.4	WSW
24-Sep-2015	14:00	3.3	SSW
24-Sep-2015	15:00	3.4	SW
24-Sep-2015	16:00	3.3	W
24-Sep-2015	17:00	3	WNW
24-Sep-2015	18:00	2.7	W
24-Sep-2015	19:00	2.2	WSW
24-Sep-2015	20:00	2.4	W
24-Sep-2015	21:00	2.4	WSW
24-Sep-2015	22:00	2.3	SW
24-Sep-2015	23:00	1.7	SW
25-Sep-2015	0:00	2.7	SW
25-Sep-2015	1:00	2.4	WSW
25-Sep-2015	2:00	2.4	WSW
25-Sep-2015	3:00	1.9	SW
25-Sep-2015	4:00	2	WNW
25-Sep-2015	5:00	1.9	WNW
25-Sep-2015	6:00	1.3	WSW
25-Sep-2015	7:00	1.3	SW
25-Sep-2015	8:00	1.2	WNW
25-Sep-2015	9:00	2	WNW
25-Sep-2015	10:00	1.6	WNW
25-Sep-2015	11:00	2.2	W
25-Sep-2015	12:00	2.7	WNW
25-Sep-2015	13:00	2.4	W
25-Sep-2015	14:00	2.3	W
25-Sep-2015	15:00	2	W
25-Sep-2015	16:00	2.2	W
25-Sep-2015	17:00	1	W
25-Sep-2015	18:00	1.3	W
25-Sep-2015	19:00	1	W
25-Sep-2015	20:00	0.8	WNW
25-Sep-2015	21:00	0.9	WNW
25-Sep-2015	22:00	0.4	W
25-Sep-2015	23:00	0.6	W
26-Sep-2015	0:00	0.3	S
26-Sep-2015	1:00	0.4	S
26-Sep-2015	2:00	0.6	S
26-Sep-2015	3:00	0.4	SW
26-Sep-2015	4:00	0.3	W

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
26-Sep-2015	5:00	0.3	WNW
26-Sep-2015	6:00	0.3	WNW
26-Sep-2015	7:00	0.6	N
26-Sep-2015	8:00	0.6	NNE
26-Sep-2015	9:00	1	E
26-Sep-2015	10:00	1.4	ENE
26-Sep-2015	11:00	1.5	ENE
26-Sep-2015	12:00	2.9	N
26-Sep-2015	13:00	3.3	SW
26-Sep-2015	14:00	1.7	W
26-Sep-2015	15:00	1.7	WSW
26-Sep-2015	16:00	2.4	WNW
26-Sep-2015	17:00	2.3	WNW
26-Sep-2015	18:00	2.4	W
26-Sep-2015	19:00	2.3	N
26-Sep-2015	20:00	1.1	N
26-Sep-2015	21:00	1	N
26-Sep-2015	22:00	0.8	N
26-Sep-2015	23:00	1	NW
27-Sep-2015	0:00	0.8	N
27-Sep-2015	1:00	0.9	N
27-Sep-2015	2:00	0.9	W
27-Sep-2015	3:00	0.7	WSW
27-Sep-2015	4:00	0.4	WNW
27-Sep-2015	5:00	0.4	W
27-Sep-2015	6:00	0.1	SW
27-Sep-2015	7:00	0.1	SW
27-Sep-2015	8:00	0.4	WSW
27-Sep-2015	9:00	0.8	W
27-Sep-2015	10:00	1	W
27-Sep-2015	11:00	1.6	WNW
27-Sep-2015	12:00	2.6	W
27-Sep-2015	13:00	3.3	W
27-Sep-2015	14:00	3	W
27-Sep-2015	15:00	3.2	W
27-Sep-2015	16:00	2.6	W
27-Sep-2015	17:00	2.6	W
27-Sep-2015	18:00	1.6	WSW
27-Sep-2015	19:00	1.7	W
27-Sep-2015	20:00	1.1	NW
27-Sep-2015	21:00	3.9	NNE
27-Sep-2015	22:00	0.4	NNE
27-Sep-2015	23:00	1	SW
28-Sep-2015	0:00	1	WSW
28-Sep-2015	1:00	1.3	S
28-Sep-2015	2:00	1.6	SW
28-Sep-2015	3:00	1.3	N
28-Sep-2015	4:00	0.9	N
28-Sep-2015	5:00	0.5	NE
28-Sep-2015	6:00	0.8	WSW
28-Sep-2015	7:00	1	WNW
28-Sep-2015	8:00	2.4	SW
28-Sep-2015	9:00	2.6	WNW
28-Sep-2015	10:00	3	WSW
28-Sep-2015	11:00	3	WSW

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
28-Sep-2015	12:00	3.6	WNW
28-Sep-2015	13:00	3.2	WNW
28-Sep-2015	14:00	3	W
28-Sep-2015	15:00	2.3	WNW
28-Sep-2015	16:00	1.9	WNW
28-Sep-2015	17:00	2	SSW
28-Sep-2015	18:00	1.6	SSW
28-Sep-2015	19:00	1.3	SW
28-Sep-2015	20:00	1.3	SW
28-Sep-2015	21:00	1.7	WNW
28-Sep-2015	22:00	2	WNW
28-Sep-2015	23:00	1.7	WNW
29-Sep-2015	0:00	1.4	WNW
29-Sep-2015	1:00	1	WNW
29-Sep-2015	2:00	1.2	WNW
29-Sep-2015	3:00	1	WNW
29-Sep-2015	4:00	0.5	WNW
29-Sep-2015	5:00	1	W
29-Sep-2015	6:00	0.7	WSW
29-Sep-2015	7:00	1	SW
29-Sep-2015	8:00	1.9	WSW
29-Sep-2015	9:00	2.4	WSW
29-Sep-2015	10:00	3.3	WSW
29-Sep-2015	11:00	3.7	W
29-Sep-2015	12:00	3.7	WSW
29-Sep-2015	13:00	3.9	WNW
29-Sep-2015	14:00	3.3	WNW
29-Sep-2015	15:00	2.9	NW
29-Sep-2015	16:00	2.7	NW
29-Sep-2015	17:00	2.3	WNW
29-Sep-2015	18:00	2.2	SW
29-Sep-2015	19:00	1	SW
29-Sep-2015	20:00	1	SW
29-Sep-2015	21:00	0.7	SW
29-Sep-2015	22:00	0.5	WNW
29-Sep-2015	23:00	0.4	WNW
30-Sep-2015	0:00	0.5	WNW
30-Sep-2015	1:00	0.8	ENE
30-Sep-2015	2:00	0.4	SSE
30-Sep-2015	3:00	0.5	WSW
30-Sep-2015	4:00	2.3	WSW
30-Sep-2015	5:00	2.2	WSW
30-Sep-2015	6:00	2.4	WSW
30-Sep-2015	7:00	2.2	WSW
30-Sep-2015	8:00	2.9	WSW
30-Sep-2015	9:00	3	WSW
30-Sep-2015	10:00	3.3	WSW
30-Sep-2015	11:00	3.9	SW
30-Sep-2015	12:00	4.6	WSW
30-Sep-2015	13:00	4.2	WSW
30-Sep-2015	14:00	4.2	WSW
30-Sep-2015	15:00	3.6	WSW
30-Sep-2015	16:00	3.2	WSW
30-Sep-2015	17:00	2.9	WSW
30-Sep-2015	18:00	2.9	WSW

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
30-Sep-2015	19:00	2.3	W
30-Sep-2015	20:00	2.3	WSW
30-Sep-2015	21:00	2.4	WNW
30-Sep-2015	22:00	2.3	WNW
30-Sep-2015	23:00	2	W

APPENDIX K
EVENT ACTION PLANS

Event / Action Plan for Air Quality

EVENT	ACTION			
	ET	IEC	SO	CONTRACTOR
ACTION LEVEL				
1. Exceedance for one sample	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Inform IEC and SO; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET; 2. Check Contractor's working method. 	<ol style="list-style-type: none"> 1. Notify Contractor. 	<ol style="list-style-type: none"> 1. Rectify any unacceptable practice; 2. Amend working methods if appropriate.
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> 1. Identify source; 2. Inform IEC and SO; 3. Advise the SO on the effectiveness of the proposed remedial measures; 4. Repeat measurements to confirm findings; 5. Increase monitoring frequency to daily; 6. Discuss with IEC and Contractor on remedial actions required; 7. If exceedance continues, arrange meeting with IEC and SO; 8. If exceedance stops, cease additional monitoring. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ET on the effectiveness of the proposed remedial measures; 5. Supervise Implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 	<ol style="list-style-type: none"> 1. Submit proposals for remedial to SO within 3 working days of notification; 2. Implement the agreed proposals; 3. Amend proposal if appropriate.

LIMIT LEVEL

<p>1.Exceedance for one sample</p>	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Inform SO, Contractor and EPD; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily; 5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and SO informed of the results. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the SO on the effectiveness of the proposed remedial measures; 5. Supervise implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Ensure remedial measures properly implemented. 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Amend proposal if appropriate.
<p>2.Exceedance for two or more consecutive samples</p>	<ol style="list-style-type: none"> 1. Notify IEC, SO, Contractor and EPD; 2. Identify source; 3. Repeat measurement to confirm findings; 4. Increase monitoring frequency to daily; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; 6. Arrange meeting with IEC and SO to discuss the remedial actions to 	<ol style="list-style-type: none"> 1. Discuss amongst SO, ET, and Contractor on the potential remedial actions; 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the SO accordingly; 3. Supervise the implementation of remedial 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Ensure remedial measures properly implemented; 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control; 5. Stop the relevant portion of works as determined by the SO until the exceedance is

	<p>be taken;</p> <p>7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and SO informed of the results;</p> <p>8. If exceedance stops, cease additional monitoring.</p>	<p>measures.</p>	<p>5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</p>	<p>abated.</p>
--	--	------------------	--	----------------

Abbreviations: ET – Environmental Team, IEC – Independent Environmental Checker, SO – Supervising Office

Event / Action Plan for Construction Noise

EVENT	ACTION			
	ET	IEC	SO	CONTRACTOR
Action Level	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Notify IEC and Contractor; 3. Report the results of investigation to the IEC, SO and Contractor; 4. Discuss with the Contractor and formulate remedial measures; 5. Increase monitoring frequency to check mitigation effectiveness. 	<ol style="list-style-type: none"> 1. Review the analysed results submitted by the ET; 2. Review the proposed remedial measures by the Contractor and advise the SO accordingly; 3. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Require Contractor to propose remedial measures for the analysed noise problem; 4. Ensure remedial measures are properly implemented 	<ol style="list-style-type: none"> 1. Submit noise mitigation proposals to IEC; 2. Implement noise mitigation proposals.
Limit Level	<ol style="list-style-type: none"> 1. Identify source; 2. Inform IEC, SO, EPD and Contractor; 3. Repeat measurements to confirm findings; 4. Increase monitoring frequency; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; 6. Inform IEC, SO and EPD 	<ol style="list-style-type: none"> 1. Discuss amongst SO, ET, and Contractor on the potential remedial actions; 2. Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the SO accordingly; 3. Supervise the implementation of 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Require Contractor to propose remedial measures for the analysed noise 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control;

EVENT	ACTION			
	ET	IEC	SO	CONTRACTOR
	<p>the causes and actions taken for the exceedances;</p> <p>7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and SO informed of the results;</p> <p>8. If exceedance stops, cease additional monitoring.</p>	<p>remedial measures.</p>	<p>problem;</p> <p>4. Ensure remedial measures properly implemented;</p> <p>5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</p>	<p>5. Stop the relevant portion of works as determined by the SO until the exceedance is abated.</p>

Event and Action Plan for Water Quality

Event	ET Leader	IEC	SO	Contractor
Action level being exceeded by one sampling day	<p>Repeat <i>in situ</i> measurement on next day of exceedance to confirm findings;</p> <p>Identify source(s) of impact;</p> <p>Inform IEC, contractor and SO;</p> <p>Check monitoring data, all plant, equipment and Contractor's working methods.</p>	<p>Check monitoring data submitted by ET and Contractor's working methods.</p>	<p>Confirm receipt of notification of non-compliance in writing;</p> <p>Notify Contractor.</p>	<p>Inform the SO and confirm notification of the non-compliance in writing;</p> <p>Rectify unacceptable practice;</p> <p>Amend working methods if appropriate.</p>
Action level being exceeded by two or more consecutive sampling days	<p>Repeat measurement on next day of exceedance to confirm findings;</p> <p>Identify source(s) of impact;</p> <p>Inform IEC, contractor, SO and EPD;</p> <p>Check monitoring data, all plant, equipment and Contractor's working methods;</p> <p>Ensure mitigation measures are implemented;</p> <p>Increase the monitoring frequency to daily until no exceedance of Action level;</p>	<p>Check monitoring data submitted by ET and Contractor's working method;</p> <p>Discuss with ET and Contractor on possible remedial actions;</p> <p>Review the proposed mitigation measures submitted by Contractor and advise the SO accordingly;</p> <p>Supervise the implementation of mitigation measures.</p>	<p>Discuss with IEC on the proposed mitigation measures;</p> <p>Ensure mitigation measures are properly implemented;</p> <p>Assess the effectiveness of the implemented mitigation measures.</p>	<p>Inform the Supervising Officer and confirm notification of the non-compliance in writing;</p> <p>Rectify unacceptable practice;</p> <p>Check all plant and equipment and consider changes of working methods;</p> <p>Submit proposal of additional mitigation measures to SO within 3 working days of notification and discuss with ET, IEC and SO;</p> <p>Implement the agreed mitigation measures.</p>
Limit level being exceeded by one sampling day	<p>Repeat measurement on next day of exceedance to confirm findings;</p> <p>Identify source(s) of impact;</p> <p>Inform IEC, contractor, SO and EPD;</p> <p>Check monitoring data, all plant, equipment and Contractor's working methods;</p> <p>Discuss mitigation measures with IEC, SO and Contractor;</p>	<p>Check monitoring data submitted by ET and Contractor's working method;</p> <p>Discuss with ET and Contractor on possible remedial actions;</p> <p>Review the proposed mitigation measures submitted by Contractor and advise the SO accordingly.</p>	<p>Confirm receipt of notification of failure in writing;</p> <p>Discuss with IEC, ET and Contractor on the proposed mitigation measures;</p> <p>Request Contractor to review the working methods.</p>	<p>Inform the SO and confirm notification of the non-compliance in writing;</p> <p>Rectify unacceptable practice;</p> <p>Check all plant and equipment and consider changes of working methods;</p> <p>Submit proposal of mitigation measures to SO within 3 working days of notification and discuss with ET, IEC and SO.</p>

Event	ET Leader	IEC	SO	Contractor
<p>Limit level being exceeded by two or more consecutive sampling days</p>	<p>Repeat measurement on next day of exceedance to confirm findings;</p> <p>Identify source(s) of impact;</p> <p>Inform IEC, contractor, SO and EPD;</p> <p>Check monitoring data, all plant, equipment and Contractor's working methods;</p> <p>Discuss mitigation measures with IEC, SO and Contractor;</p> <p>Ensure mitigation measures are implemented;</p>	<p>Check monitoring data submitted by ET and Contractor's working method;</p> <p>Discuss with ET and Contractor on possible remedial actions;</p> <p>Review the Contractor's mitigation measures whenever necessary to assure their effectiveness and advise the SO accordingly;</p> <p>Supervise the implementation of mitigation measures.</p>	<p>Discuss with IEC, ET and Contractor on the proposed mitigation measures;</p> <p>Request Contractor to critically review the working methods;</p> <p>Make agreement on the mitigation measures to be implemented;</p> <p>Ensure mitigation measures are properly implemented;</p> <p>Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the construction activities until no exceedance of Limit level.</p>	<p>Take immediate action to avoid further exceedance;</p> <p>Submit proposal of mitigation measures to SO within 3 working days of notification and discuss with ET, IEC and SO;</p> <p>Implement the agreed mitigation measures;</p> <p>Resubmit proposals of mitigation measures if problem still not under control;</p> <p>As directed by the Supervising Officer, to slow down or to stop all or part of the construction activities until no exceedance of Limit level.</p>

APPENDIX L
SUMMARY OF EXCEEDANCE

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road –
Section between HKSAR Boundary and Scenic Hill**

Exceedance Report

(A) Exceedance Report for Air Quality

Environmental Monitoring	Parameter	No. of Exceedance		No. of Exceedance related to the Construction Activities of this Contract	
		Action Level	Limit Level	Action Level	Limit Level
Air Quality	1-hr TSP	0	0	0	0
	24-hr TSP	0	0	0	0

**(B) Exceedance Report for Construction Noise
(NIL in the reporting period)**

(C) Exceedance Report for Water Quality

Environmental Monitoring	Parameter	No. of Exceedance		No. of Exceedance related to the Construction Activities of this Contract	
		Action Level	Limit Level	Action Level	Limit Level
Water Quality	Dissolved Oxygen (DO) (Surface & Middle)	0	0	0	0
	Dissolved Oxygen (DO) (Bottom)	0	0	0	0
	Turbidity	0	0	0	0
	Suspended Solids (SS)	4	3	0	0

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Date of Water Quality Monitoring: 2 September 2015

Part A – Exceedance Summary Tables

Table I: Parameter(s) – ~~Dissolved Oxygen (DO)~~ / ~~Turbidity (TURB)~~ / Suspended Solids (SS)

Station(s)	Tide	Baseline Action Level (mg/L)	Baseline Limit Level (mg/L)	Control Station(s)	Depth-average Value at Control Stations (mg/L)	120% of Control Station Action Level (mg/L)	130% of Control Station Limit Level (mg/L)	Depth-average Measured Value (mg/L)	Justification*	Validity (Yes/No)
IS1	Mid-ebb	23.5	34.4	CS2	29.3	35.2	38.1	<i>40.8</i>	(2), (3) & (6)	No
IS1	Mid-flood			CS1	17.8	21.4	23.1	<i>27.0</i>	(2) & (6)	No
IS2				<i>23.6</i>				(2) & (6)	No	
SR6				<i>44.8</i>				(2) & (6)	No	
ST1				<i>28.4</i>				(2) & (6)	No	
ST2				<i>42.2</i>				(2) & (6)	No	

Note: ***Bold Italic*** means Action Level exceedance
Bold Italic with underline means Limit Level exceedance

- *Remarks
- (1) – No major marine construction activity was conducted.
 - (2) – No pollution discharge from construction activity was observed.
 - (3) – Control Station value already exceeded either the Baseline Action or Limit Levels.
 - (4) – The exceeded results were similar or within the ranges baseline monitoring results.
 - (5) – Monitoring station is situated at the upstream of the construction sites.
 - (6) – Other(s): Please specify – Dispersion of sediment plume to the monitoring stations from the area outside the site boundary (i.e. works area not under and related to HY/2011/09) was observed.

Part B – Conclusion: No direct evidence that the exceedances were due to the Contract, therefore the exceedances are considered due to the other external factors rather than the contract works.

Part C – Recommendation: As the exceedances were not related to the contract works, no further action to be required.

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Location Plan:



Reviewed by: Dr. Priscilla Choy

Title: Environmental Team Leader

Date: 17 September 2015

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Date of Water Quality Monitoring: 4 September 2015

Part A – Exceedance Summary Tables

Table I: Parameter(s) – ~~Dissolved Oxygen (DO)~~ / ~~Turbidity (TURB)~~ / Suspended Solids (SS)

Station(s)	Tide	Baseline Action Level (mg/L)	Baseline Limit Level (mg/L)	Control Station(s)	Depth-average Value at Control Stations (mg/L)	120% of Control Station Action Level (mg/L)	130% of Control Station Limit Level (mg/L)	Depth-average Measured Value (mg/L)	Justification*	Validity (Yes/No)
SR1	Mid-ebb	23.5	34.4	CS2	9.5	11.4	12.4	27.7	(2), (4) & (6)	No

Note: ***Bold Italic*** means Action Level exceedance
Bold Italic with underline means Limit Level exceedance

- *Remarks
- (1) – No major marine construction activity was conducted.
 - (2) – No pollution discharge from construction activity was observed.
 - (3) – Control Station value already exceeded either the Baseline Action or Limit Levels.
 - (4) – The exceeded results were similar or within the ranges baseline monitoring results. (Please refer to Table I)
 - (5) – Monitoring station is situated at the upstream of the construction sites.
 - (6) – Other(s): Please specify – Sediment plume due to natural fluctuation of shallow water was observed.

Table I – Summary of Baseline Water Quality Monitoring Results during Mid-Flood Tide

Station(s)	Suspended Solids (mg/L)	
	Min	Max
SR1	8.4	31.5

Part B – Conclusion: No direct evidence that the exceedances were due to the Contract, therefore the exceedances are considered due to the other external factors rather than the contract works.

Part C – Recommendation: As the exceedances were not related to the contract works, no further action to be required.

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Location Plan:



Reviewed by: Dr. Priscilla Choy

Title: Environmental Team Leader

Date: 17 September 2015

APPENDIX M
SITE AUDIT SUMMARY

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge



Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Weekly Site Inspection Record Summary

Inspection Information

Checklist Reference Number	150901
Date	1 September 2015 (Tuesday)
Time	9:15 - 11:55 and 13:30 - 15:30

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-
Ref. No.	Remarks/Observations	Related Item No.
A. Water Quality		
150901-O01	• Sedimentation facilities according to the wastewater discharge license at P81 and P82 was not operated. The Contractor was reminded to rectify it as soon as possible.	B3i.
150901-R08	• To check the designated discharging location for treated effluent at Portion C.	B3
B. Ecology		
150901-R06	• To erect the fencing for protecting tree and clear the construction wastes / materials within the tree protection zone at between P86&P87, P91 and S8 entrance.	C30
C. Air Quality		
150901-R04	• Provide maintenance of the crane to avoid emitting heavy smoke at P71.	D19
D. Noise		
150901-R03	• To close the door of the crane at P71.	E9
E. Waste / Chemical Management		
150901-R02	• To seal the hole of the drip tray at P71.	F9
150901-R05	• Provide spill kit for oil leakage at P71.	F8
150901-R07	• Properly store the chemical containers at between P105 and P106.	F3i.
F. Permits/Licences		
	• No environmental deficiency was identified during site inspection.	
G. Others		
	• Follow-up on previous site audit session (Ref. No. 150825), all environmental deficiencies were improved/rectified by contractor during the site inspection.	

	Name	Signature	Date
Recorded by	Ivy Tam		1 September 2015
Checked by	Dr. Priscilla Choy		1 September 2015

Hong Kong-Zhuhai-Macao Bridge



Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Environmental Observations Identified during the Environmental Site Inspection
(1 September 2015)

	<p>Ref No: 150901-O01</p> <p>Impact: Water Quality (B3i.)</p> <p>Details: Sedimentation facilities according to the wastewater discharge license at P81 and P82 was not operated. The Contractor was reminded to rectify it as soon as possible.</p>
	<p>Ref No: 150901-R02</p> <p>Impact: Waste / Chemical Management (F9)</p> <p>Details: To seal the hole of the drip tray at P71.</p>
	<p>Ref No: 150901-R03</p> <p>Impact: Noise (E9)</p> <p>Details: To close the door of the crane at P71.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 150901-R04</p> <p>Impact: Air Quality (D19)</p> <p>Details: Provide maintenance of the crane to avoid emitting heavy smoke at P71.</p>
	<p>Ref No: 150901-R05</p> <p>Impact: Waste / Chemical Management (F8)</p> <p>Details: Provide spill kit for oil leakage at P71.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill



Between P86&P87



P91



S8 entrance

Ref No: 150901-R06

Impact:
Ecology (C30)

Details:
To erect the fencing for protecting tree and clear the construction wastes / materials within the tree protection zone at between P86&P87, P91 and S8 entrance.



Ref No: 150901-R07

Impact:
Waste / Chemical Management (F3i.)

Details:
Properly store the chemical containers at between P105 and P106.

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill



Ref No: 150901-R08

Impact:
Water Quality (B3)

Details:
To check the designated discharging location for treated effluent at Portion C.

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

**Rectification Actions taken by the Contractor for Environmental Deficiencies
Identified during Previous Audit Session**



Ref No: 150825-R01

Impact:
Water Quality (B20)

Details:
Clear the loose material which hanging at the boundary of P54.

Follow Up:
The loose material was cleared.



Ref No: 150825-R02

Impact:
Waste / Chemical Management (F1iii.)

Details:
Clear the rubbish at the barge next to P58.

Follow Up:
The rubbish was cleared.

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill



Barge next to P58



P58



Ref No: 150825-R03

Impact:

Waste / Chemical Management (F8)

Details:

Provide drip tray for the chemical containers at the barge next to P58 and at P58.

Follow Up:

The chemical containers were removed.

Ref No: 150825-R04

Impact:

Water Quality (B20)

Details:


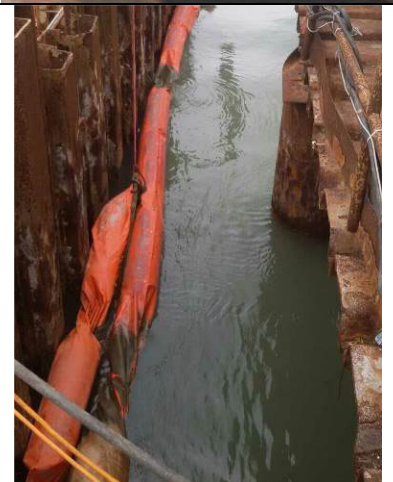

Clear the concrete materials at the platform and repair the iron wire gauze at P58.

Follow Up:

The concrete materials were cleared and the damaged iron wire gauze was repaired.

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 150825-R05</p> <p>Impact: Waste / Chemical Management (F8)</p> <p>Details: Clear the oil spillage as chemical waste at the barge next to P58.</p> <p>Follow Up: The oil spillage was cleared.</p>
	<p>Ref No: 150825-R06</p> <p>Impact: Water Quality (B25)</p> <p>Details: Properly deploy the silt curtain at P74.</p> <p>Follow Up: The damaged silt curtain was repaired.</p>
	<p>Ref No: 150825-R07</p> <p>Impact: Waste / Chemical Management (F8)</p> <p>Details: Clear the contaminated sand around the generator at P74.</p> <p>Follow Up: The contaminated sand was cleared.</p>

Contract HY/2011/09



Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Weekly Site Inspection Record Summary
Inspection Information

Checklist Reference Number	150908
Date	8 September 2015 (Tuesday)
Time	9:30 - 12:00


Ref. No.	Non-Compliance	Related Item No.
-	None identified	-
Ref. No.	Remarks/Observations	Related Item No.
	A. Water Quality	
150908-R02	• Properly deploy the silt curtain at P74, P69 and P70.	
150908-R06	• Ensure the wetsep at P81 is functioning properly to treat the muddy water.	B3i. B25
	B. Ecology	
	• No environmental deficiency was identified during site inspection.	
	C. Air Quality	
	• No environmental deficiency was identified during site inspection.	
	D. Noise	
	• No environmental deficiency was identified during site inspection.	
	E. Waste / Chemical Management	
150908-R01	• Provide spill kit at the platform at P74.	F8
150908-R03	• Clear the construction wastes at P70.	F4ii.
150908-R05	• Clear the oil spillage and maintenance of equipment are required to avoid oil leakage at P69.	F8
150908-R07	• Clear the damaged handrail at near the seawall area at P87.	F4ii.
	F. Permits/Licences	
150908-R04	• Provide valid construction noise permit at P70.	G1
	G. Others	
	• Follow-up on previous site audit session (Ref. No. 150901), follow up action is required for the item(s) 150901-O01 and R06.	

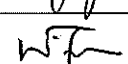	Name	Signature	Date
Recorded by	Ivy Tam		8 September 2015
Checked by	Dr. Priscilla Choy		8 September 2015

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Environmental Observations Identified during the Environmental Site Inspection
(8 September 2015)

	<p>Ref No: 150908-R01</p> <p>Impact: Waste / Chemical Management (F8)</p> <p>Details: Provide spill kit at the platform at P74.</p>
 <p>P74</p>  <p>P70</p>  <p>P69</p>	<p>Ref No: 150908-R02</p> <p>Impact: Water Quality (B3i.)</p> <p>Details: Properly deploy the silt curtain at P74, P69 and P70.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 150908-R03</p> <p>Impact: Waste / Chemical Management (F4ii.)</p> <p>Details: Clear the construction wastes at P70.</p>
	<p>Ref No: 150908-R04</p> <p>Impact: Permits/Licences (G1)</p> <p>Details: Provide valid construction noise permit at P70.</p>
	<p>Ref No: 150908-R05</p> <p>Impact: Waste / Chemical Management (F8)</p> <p>Details: Clear the oil spillage and maintenance of equipment are required to avoid oil leakage at P69.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill



Ref No: 150908-R06

Impact:
Water Quality (B25)

Details:
Ensure the wetsep at P81 is functioning properly to treat the muddy water.



Ref No: 150901-R07

Impact:
Waste / Chemical Management (F4ii.)

Details:
Clear the damaged handrail at near the seawall area at P87.

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

**Rectification Actions taken by the Contractor for Environmental Deficiencies
Identified during Previous Audit Session**

	<p>Ref No: 150901-R02</p> <p>Impact: Waste / Chemical Management (F9)</p> <p>Details: To seal the hole of the drip tray at P71.</p> <p>Follow Up: The hole of the drip tray was sealed.</p>
	<p>Ref No: 150901-R03</p> <p>Impact: Noise (E9)</p> <p>Details: To close the door of the crane at P71.</p> <p>Follow Up: The door of the crane was closed.</p>
	<p>Ref No: 150901-R04</p> <p>Impact: Air Quality (D19)</p> <p>Details: Provide maintenance of the crane to avoid emitting heavy smoke at P71.</p> <p>Follow Up: No further emission of heavy smoke was observed.</p>

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 150901-R05</p> <p>Impact: Waste / Chemical Management (F8)</p> <p>Details: Provide spill kit for oil leakage at P71.</p> <p>Follow Up: Spill kit was provided and the oil leakage was cleared by the worker.</p>
	<p>Ref No: 150901-R07</p> <p>Impact: Waste / Chemical Management (F3i.)</p> <p>Details: Properly store the chemical containers at between P105 and P106.</p> <p>Follow Up: Chemical containers were removed.</p>
	<p>Ref No: 150901-R08</p> <p>Impact: Water Quality (B3)</p> <p>Details: To check the designated discharging location for treated effluent at Portion C.</p> <p>Follow Up: The treated effluent was discharged properly.</p>

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge



Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Weekly Site Inspection Record Summary

Inspection Information

Checklist Reference Number	150915
Date	15 September 2015 (Tuesday)
Time	9:15 - 12:00 and 13:30 - 15:45


Ref. No.	Non-Compliance	Related Item No.
-	None identified	-
Ref. No.	Remarks/Observations	Related Item No.
	A. Water Quality	
150915-R01	• Clear the accumulated concrete debris at the platform at P20.	B20
150915-R04	• Clear the discarded iron bar at the seawall area at P100.	B21
150915-R05	• Clear the foam box and wooden board at the seawall area at P96.	B21
	B. Ecology	
	• No environmental deficiency was identified during site inspection.	
	C. Air Quality	
150915-R06	• Provide water spray for the dry exposed site area at Portion C.	D5, D6 & D14
	D. Noise	
	• No environmental deficiency was identified during site inspection.	
	E. Waste / Chemical Management	
150915-R02	• Clear the rubbish which was not disposed properly at the platform at P20.	F1iii.
150915-R03	• Provide drip tray for the chemical containers at the platform at P20.	F9
	F. Permits/Licences	
	• No environmental deficiency was identified during site inspection.	
	G. Others	
	• Follow-up on previous site audit session (Ref. No. 150908), follow up action is required for the item(s) 150908-R06.	

	Name	Signature	Date
Recorded by	Ivy Tam		15 September 2015
Checked by	Dr. Priscilla Choy		15 September 2015

Hong Kong-Zhuhai-Macao Bridge



Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Environmental Observations Identified during the Environmental Site Inspection
(15 September 2015)

	<p>Ref No: 150915-R01</p> <p>Impact: Water Quality (B20)</p> <p>Details: Clear the accumulated concrete debris at the platform at P20.</p>
	<p>Ref No: 150915-R02</p> <p>Impact: Waste / Chemical Management (F1iii.)</p> <p>Details: Clear the rubbish which was not disposed properly at the platform at P20.</p>
	<p>Ref No: 150915-R03</p> <p>Impact: Waste / Chemical Management (F9)</p> <p>Details: Provide drip tray for the chemical containers at the platform at P20.</p>

Hong Kong-Zhuhai-Macao Bridge





Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 150915-R04</p> <p>Impact: Water Quality (B21)</p> <p>Details: Clear the discarded iron bar at the seawall area at P100.</p>
	<p>Ref No: 150915-R05</p> <p>Impact: Water Quality (B21)</p> <p>Details: Clear the foam box and wooden board at the seawall area at P96.</p>
	<p>Ref No: 150915-R06</p> <p>Impact: Air Quality (D5, D6 & D14)</p> <p>Details: Provide water spray for the dry exposed site area at Portion C.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Rectification Actions taken by the Contractor for Environmental Deficiencies Identified during Previous Audit Session

	<p>Ref No: 150908-R01</p> <p>Impact: Waste / Chemical Management (F8)</p> <p>Details: Provide spill kit at the platform at P74.</p> <p>Follow Up: Spill kit was provided.</p>
 <p>P74</p>  <p>P70</p>  <p>P69</p>	<p>Ref No: 150908-R02</p> <p>Impact: Water Quality (B3i.)</p> <p>Details: Properly deploy the silt curtain at P74, P69 and P70.</p> <p>Follow Up: The damaged silt curtain was repaired and properly deployed.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 150908-R03</p> <p>Impact: Waste / Chemical Management (F4ii.)</p> <p>Details: Clear the construction wastes at P70.</p> <p>Follow Up: The construction wastes was cleared.</p>
	<p>Ref No: 150908-R04</p> <p>Impact: Permits/Licences (G1)</p> <p>Details: Provide valid construction noise permit at P70.</p> <p>Follow Up: The valid construction noise permit was provided.</p>
	<p>Ref No: 150908-R05</p> <p>Impact: Waste / Chemical Management (F8)</p> <p>Details: Clear the oil spillage and maintenance of equipment are required to avoid oil leakage at P69.</p> <p>Follow Up: The air compressor which has oil leakage problem was removed for maintenance.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 150908-R07</p> <p>Impact: Waste / Chemical Management (F4ii.)</p> <p>Details: Clear the damaged handrail at near the seawall area at P87.</p> <p>Follow Up: The damaged handrail was removed.</p>
	<p>Ref No: 150901-R06</p> <p>Impact: Ecology (C30)</p> <p>Details: To erect the fencing for protecting tree and clear the construction wastes / materials within the tree protection zone at between P86&P87, P91 and S8 entrance.</p> <p>Follow Up: The fencing was erected and construction wastes / materials within the tree protection zone were cleared.</p>
<p>Between P86&P87</p>	
	
<p>P91</p>	
	
<p>S8 entrance</p>	

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge



Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Weekly Site Inspection Record Summary



Inspection Information

Checklist Reference Number	150922
Date	22 September 2015 (Tuesday)
Time	9:15 - 11:45 and 13:30 - 14:45

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-
Ref. No.	Remarks/Observations	Related Item No.
	A. Water Quality	
	• No environmental deficiency was identified during site inspection.	
	B. Ecology	
150922-R02	• To remove the construction materials under the retained trees and provide a proper tree protection zone.	C31
	C. Air Quality	
	• No environmental deficiency was identified during site inspection.	
	D. Noise	
	• No environmental deficiency was identified during site inspection.	
	E. Waste / Chemical Management	
150922-R01	• Properly store the chemical containers at Portion C.	F8 & F9
	F. Permits/Licences	
	• No environmental deficiency was identified during site inspection.	
	G. Others	
	• Follow-up on previous site audit session (Ref. No. 150915), all environmental deficiencies were improved/rectified by contractor during the site inspection. However, follow up action is required for the item(s) 150908-R06.	

	Name	Signature	Date
Recorded by	Ivy Tam		22 September 2015
Checked by	Dr. Priscilla Choy		22 September 2015


Environmental Observations Identified during the Environmental Site Inspection
(22 September 2015)

	<p>Ref No: 150922-R01</p> <p>Impact: Waste / Chemical Management (F8 and F9)</p> <p>Details: Properly store the chemical containers at Portion C.</p>
	<p>Ref No: 150922-R02</p> <p>Impact: Ecology (C31)</p> <p>Details: To remove the construction materials under the retained trees and provide a proper tree protection zone.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

**Rectification Actions taken by the Contractor for Environmental Deficiencies
Identified during Previous Audit Session**

	<p>Ref No: 150915-R01</p> <p>Impact: Water Quality (B20)</p> <p>Details: Clear the accumulated concrete debris at the platform at P20.</p> <p>Follow Up: The platform at P20 was removed.</p>
	<p>Ref No: 150915-R02</p> <p>Impact: Waste / Chemical Management (F1iii.)</p> <p>Details: Clear the rubbish which was not disposed properly at the platform at P20.</p> <p>Follow Up: The platform at P20 was removed.</p>
	<p>Ref No: 150915-R03</p> <p>Impact: Waste / Chemical Management (F9)</p> <p>Details: Provide drip tray for the chemical containers at the platform at P20.</p> <p>Follow Up: The platform at P20 was removed.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 150915-R04</p> <p>Impact: Water Quality (B21)</p> <p>Details: Clear the discarded iron bar at the seawall area at P100.</p> <p>Follow Up: The discarded iron bar was cleared.</p>
	<p>Ref No: 150915-R05</p> <p>Impact: Water Quality (B21)</p> <p>Details: Clear the foam box and wooden board at the seawall area at P96.</p> <p>Follow Up: The foam box and wooden board at the seawall area were cleared.</p>
	<p>Ref No: 150915-R06</p> <p>Impact: Air Quality (D5, D6 & D14)</p> <p>Details: Provide water spray for the dry exposed site area at Portion C.</p> <p>Follow Up: The site area was observed wet.</p>

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge



Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Weekly Site Inspection Record Summary

Inspection Information

Checklist Reference Number	150930
Date	30 September 2015 (Wednesday)
Time	9:30 - 11:45

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-
Ref. No.	Remarks/Observations	Related Item No.
	A. Water Quality	
150930-R01	• Floating rubbish was observed near P75. The Contractor was reminded to clear it properly.	B21
150930-R02	• The Contractor was reminded to improve the discharge quality at P82/P83.	B3iii. &3iv.
	B. Ecology	
	• No environmental deficiency was identified during site inspection.	
	C. Air Quality	
	• No environmental deficiency was identified during site inspection.	
	D. Noise	
	• No environmental deficiency was identified during site inspection.	
	E. Waste / Chemical Management	
	• No environmental deficiency was identified during site inspection.	
	F. Permits/Licences	
	• No environmental deficiency was identified during site inspection.	
	G. Others	
	• Follow-up on previous site audit session (Ref. No. 150922), all environmental deficiencies were improved/rectified by contractor during the site inspection.	

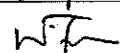	Name	Signature	Date
Recorded by	Ivy Tam		30 September 2015
Checked by	Dr. Priscilla Choy		30 September 2015

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Environmental Observations Identified during the Environmental Site Inspection
(30 September 2015)


 A photograph showing a narrow waterway. On the left, there are vertical wooden piles. A line of orange buoys runs along the water's surface. In the center, there is a large amount of floating rubbish, including plastic bottles, pieces of wood, and other debris. A green structure, possibly part of a boat or a bridge component, is visible on the right side.	<p>Ref No: 150930-R01</p> <p>Impact: Water Quality (B21)</p> <p>Details: Floating rubbish was observed near P75. The Contractor was reminded to clear it properly.</p>
 A photograph of a concrete structure, likely a part of a bridge or a waterway. The structure is made of concrete and has a discharge pipe on the right side. The water in the structure is murky and brown. There is a yellow wall in the background.	<p>Ref No: 150930-R02</p> <p>Impact: Water Quality (B3iii. & 3iv.)</p> <p>Details: The Contractor was reminded to improve the discharge quality at P82/P83.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

**Rectification Actions taken by the Contractor for Environmental Deficiencies
Identified during Previous Audit Session**

	<p>Ref No: 150922-R01</p> <p>Impact: Waste / Chemical Management (F8 and F9)</p> <p>Details: Properly store the chemical containers at Portion C.</p> <p>Follow Up: The chemical containers were removed.</p>
	<p>Ref No: 150922-R02</p> <p>Impact: Ecology (C31)</p> <p>Details: To remove the construction materials under the retained trees and provide a proper tree protection zone.</p> <p>Follow Up: The construction materials at near the trees were cleared.</p>

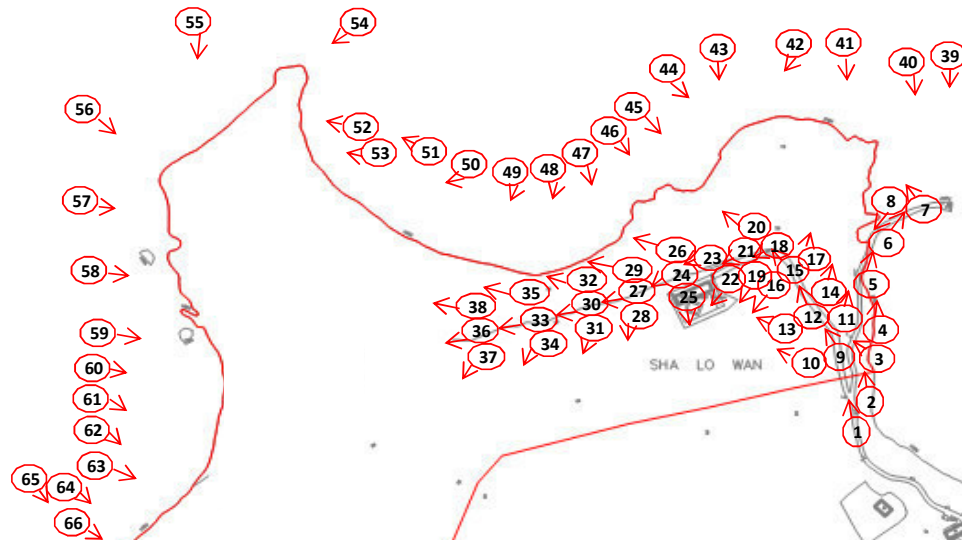

LEGEND

— Sha Lo Wan (West) Archaeological Site

SCALE	1:100	DATE	September 2015
CHECK	IT	DRAWN	JW
JOB No.	MA12014	FIGURE NO.	1
		REV	—



Photo 1



Photo 2



Photo 3



Photo 4



Photo 5



Photo 6



Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-
Section between HKSAR Boundary and Scenic Hill

Photographic Records for
Sha Lo Wan (West) Archaeological Site

SCALE

N.T.S.

DATE

Sep-15

Project No.

MA12014

Appendix

M1



Photo 7



Photo 8



Photo 9



Photo 10



Photo 11



Photo 12



Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-
Section between HKSAR Boundary and Scenic Hill

Photographic Records for
Sha Lo Wan (West) Archaeological Site

SCALE

N.T.S.

DATE

Sep-15

Project No.

MA12014

Appendix

M2



Photo 13



Photo 14



Photo 15



Photo 16

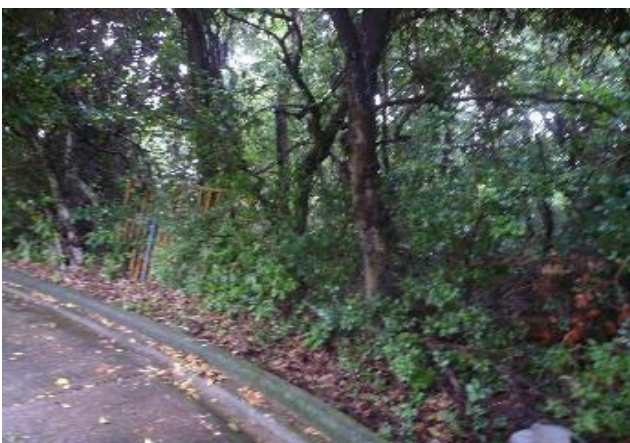


Photo 17



Photo 18



Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-
Section between HKSAR Boundary and Scenic Hill

Photographic Records for
Sha Lo Wan (West) Archaeological Site

SCALE	N.T.S.	DATE	Sep-15
Project No.	MA12014	Appendix	M3



Photo 19



Photo 20



Photo 21



Photo 22



Photo 23



Photo 24



Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-
Section between HKSAR Boundary and Scenic Hill

Photographic Records for
Sha Lo Wan (West) Archaeological Site

SCALE	N.T.S.	DATE	Sep-15
Project No.	MA12014	Appendix	M4



Photo 25



Photo 26

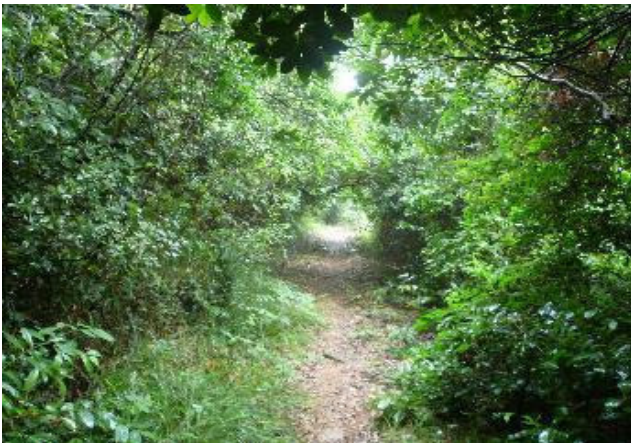


Photo 27



Photo 28



Photo 29



Photo 30



Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-
Section between HKSAR Boundary and Scenic Hill

Photographic Records for
Sha Lo Wan (West) Archaeological Site

SCALE

N.T.S.

DATE

Sep-15

Project No.

MA12014

Appendix

M5



Photo 31



Photo 32



Photo 33



Photo 34



Photo 35



Photo 36



Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-
Section between HKSAR Boundary and Scenic Hill

Photographic Records for
Sha Lo Wan (West) Archaeological Site

SCALE

N.T.S.

DATE

Sep-15

Project No.

MA12014

Appendix

M6



Photo 37



Photo 38



Photo 39



Photo 40



Photo 41



Photo 42



Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-
Section between HKSAR Boundary and Scenic Hill

Photographic Records for
Sha Lo Wan (West) Archaeological Site

SCALE

N.T.S.

DATE

Sep-15

Project No.

MA12014

Appendix

M7



Photo 43



Photo 44



Photo 45



Photo 46



Photo 47



Photo 48


	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road- Section between HKSAR Boundary and Scenic Hill Photographic Records for Sha Lo Wan (West) Archaeological Site	SCALE	DATE
		N.T.S.	Sep-15
		Project No.	Appendix
		MA12014	M8



Photo 49



Photo 50



Photo 51



Photo 52



Photo 53



Photo 54



Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-
Section between HKSAR Boundary and Scenic Hill

Photographic Records for
Sha Lo Wan (West) Archaeological Site

SCALE

N.T.S.

DATE

Sep-15

Project No.

MA12014

Appendix

M9



Photo 55



Photo 56



Photo 57



Photo 58



Photo 59



Photo 60


	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road- Section between HKSAR Boundary and Scenic Hill Photographic Records for Sha Lo Wan (West) Archaeological Site	SCALE	DATE
		N.T.S.	Sep-15
		Project No.	Appendix
		MA12014	M10



Photo 61



Photo 62



Photo 63




Photo 64



Photo 65



Photo 66

	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road- Section between HKSAR Boundary and Scenic Hill Photographic Records for Sha Lo Wan (West) Archaeological Site	SCALE	DATE
		N.T.S.	Sep-15
		Project No.	Appendix
		MA12014	M11

**APPENDIX N
UPDATED ENVIRONMENTAL
MITIGATION IMPLEMENTATION
SCHEDULE (EMIS)**

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
Air Quality							
S5.5.6.1	A1	1) The contractor shall follow the procedures and requirements given in the Air Pollution Control (Construction Dust) Regulation	Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.	Contractor	All construction sites	Construction stage	^
S5.5.6.2	A2	2) Proper watering of exposed spoil should be undertaken throughout the construction phase: <ul style="list-style-type: none"> • Any excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading; • Any dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads; • A stockpile of dusty material should not be extend beyond the pedestrian barriers, fencing or traffic cones. • The load of dusty materials on a vehicle leaving a construction site should be covered entirely by impervious sheeting to ensure that the dusty materials do not leak from the vehicle; • Where practicable, vehicle washing facilities with high pressure water jet should be provided at every discernible or designated vehicle exit point. The area where vehicle washing takes place and the road section between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores; 	Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.	Contractor	All construction sites	Construction stage	^ ^ ^ ^ ^
S5.5.6.2	A2	<ul style="list-style-type: none"> • When there are open excavation and reinstatement works, hoarding 	Good construction site	Contractor	All construction	Construction	^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>of not less than 2.4m high should be provided as far as practicable along the site boundary with provision for public crossing. Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period;</p> <ul style="list-style-type: none"> • The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials; • Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical continuously; • Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities so as to maintain the entire surface wet; • Where a scaffolding is erected around the perimeter of a building under construction, effective dust screens, sheeting or netting should be provided to enclose the scaffolding from the ground floor level of the building, or a canopy should be provided from the first floor level up to the highest level of the scaffolding; • Any skip hoist for material transport should be totally enclosed by impervious sheeting; • Every stock of more than 20 bags of cement or dry pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides; 	<p>practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.</p>		sites	stage	<p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">N/A</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
S5.5.6.2	A2	<ul style="list-style-type: none"> Cement or dry PFA delivered in bulk should be stored in a closed silo fitted with an audible high level alarm which is interlocked with the material filling line and no overfilling is allowed; Loading, unloading, transfer, handling or storage of bulk cement or dry PFA should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system; and Exposed earth should be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabiliser within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies. 	Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.	Contractor	All construction sites	Construction stage	N/A N/A N/A
S5.5.6.3	A3	3) The Contractor should undertake proper watering on all exposed spoil (with at least 8 times per day) throughout the construction phase.	Control construction dust	Contractor	All construction sites	Construction stage	*
S5.5.6.4	A5	5) Implement regular dust monitoring under EM&A programme during the construction stage.	Monitor the 24 hr and 1hr TSP levels at the representative dust monitoring stations to ensure compliance with relevant criteria throughout the construction period.	Contractor	Selected representative dust monitoring station	Construction stage	^
S5.5.7.1	A6	The following mitigation measures should be adopted to prevent fugitive dust emissions for concrete batching plant: <ul style="list-style-type: none"> Loading, unloading, handling, transfer or storage of any dusty 	Monitor the 24 hr and 1hr TSP levels at the representative dust	Contractor	Selected representative dust	Construction stage	^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>materials should be carried out in totally enclosed system;</p> <ul style="list-style-type: none"> All dust-laden air or waste gas generated by the process operations should be properly extracted and vented to fabric filtering system to meet the emission limits for TSP; Vents for all silos and cement/pulverised fuel ash (PFA) weighing scale should be fitted with fabric filtering system; The materials which may generate airborne dusty emissions should be wetted by water spray system; All receiving hoppers should be enclosed on three sides up to 3m above unloading point; All conveyor transfer points should be totally enclosed; All access and route roads within the premises should be paved and wetted; and Vehicle cleaning facilities should be provided and used by all concrete trucks before leaving the premises to wash off any dust on the wheels and/or body. 	<p>monitoring stations to ensure compliance with relevant criteria throughout the construction period.</p>		monitoring station		<p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p>
S5.5.2.7	A7	<p>The following mitigation measures should be adopted to prevent fugitive dust emissions at barging point:</p> <ul style="list-style-type: none"> All road surface within the barging facilities will be paved; Dust enclosures will be provided for the loading ramp; Vehicles will be required to pass through designated wheels wash facilities; and Continuous water spray at the loading points. 	Control construction dust	Contractor	All construction sites	Construction stage	<p>N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p>
Construction Noise (Air borne)							
S6.4.10	N1	1) Use of good site practices to limit noise emissions by considering the	Control construction airborne	Contractor	All construction	Construction	

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>following:</p> <ul style="list-style-type: none"> • only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme; • machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; • plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs; • silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works; • mobile plant should be sited as far away from NSRs as possible and practicable; • material stockpiles, mobile container site officer and other structures should be effectively utilised, where practicable, to screen noise from on-site construction activities. 	noise by means of good site practices		sites	stage	^ ^ ^ ^ ^
S6.4.11	N2	2) Install temporary hoarding located on the site boundaries between noisy construction activities and NSRs. The conditions of the hoardings shall be properly maintained throughout the construction period.	Reduce the construction noise levels at low-level zone of NSRs through partial screening.	Contractor	All construction sites	Construction stage	^
S6.4.12	N3	3) Install movable noise barriers (typically density @14kg/m ²), acoustic mat or full enclosure close to noisy plants including air compressor, generators, saw.	Screen the noisy plant items to be used at all construction sites	Contractor	For plant items listed in Appendix 6D of the EIA report at all construction sites	Construction stage	^
S6.4.13	N4	4) Select "Quiet plants" which comply with the BS 5228 Part 1 or TM	Reduce the noise levels of	Contractor	For plant items	Construction	^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		standards.	plant items		listed in Appendix 6D of the EIA report at all construction sites	stage	
S6.4.14	N5	5) Sequencing operation of construction plants where practicable.	Operate sequentially within the same work site to reduce the construction airborne noise	Contractor	All construction sites where practicable	Construction stage	^
	N6	6) Implement a noise monitoring under EM&A programme.	Monitor the construction noise levels at the selected representative locations	Contractor	Selected representative noise monitoring station	Construction stage	^
Waste Management (Construction Waste)							
S8.3.8	WM1	<u>Construction and Demolition Material</u> The following mitigation measures should be implemented in handling the waste: <ul style="list-style-type: none"> Maintain temporary stockpiles and reuse excavated fill material for backfilling and reinstatement; Carry out on-site sorting; Make provisions in the Contract documents to allow and promote the use of recycled aggregates where appropriate; Adopt 'Selective Demolition' technique to demolish the existing structures and facilities with a view to recovering broken concrete effectively for recycling purpose, where possible; Implement a trip-ticket system for each works contract to ensure that 	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal	Contractor	All construction sites	Construction stage	^ ^ ^ N/A ^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>the disposal of C&D materials are properly documented and verified; and</p> <ul style="list-style-type: none"> Implement an enhanced Waste Management Plan similar to ETWBTC (Works) No. 19/2005 – “Environmental Management on Construction Sites” to encourage on-site sorting of C&D materials and to minimize their generation during the course of construction. In addition, disposal of the C&D materials onto any sensitive locations such as agricultural lands, etc. should be avoided. The Contractor shall propose the final disposal sites to the Project Proponent and get its approval before implementation 					<p style="text-align: center;">*</p> <p style="text-align: center;">^</p>
S8.3.9 - S8.3.11	WM2	<p><u>C&D Waste</u></p> <ul style="list-style-type: none"> Standard formwork or pre-fabrication should be used as far as practicable in order to minimise the arising of C&D materials. The use of more durable formwork or plastic facing for the construction works should be considered. Use of wooden hoardings should not be used, as in other projects. Metal hoarding should be used to enhance the possibility of recycling. The purchasing of construction materials will be carefully planned in order to avoid over ordering and wastage. The Contractor should recycle as much of the C&D materials as possible on-site. Public fill and C&D waste should be segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal. Where practicable, concrete and masonry can be crushed and used as fill. Steel reinforcement bar can be used by scrap steel mills. Different 	<p>Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal</p>	Contractor	All construction sites	Construction stage	<p style="text-align: center;">^</p> <p style="text-align: center;">^</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		waste collection service and can supply the necessary storage containers; or be to a reuser of the waste, under approval from the EPD.					
S8.3.16	WM4	<u>Sewage</u> <ul style="list-style-type: none"> • Adequate numbers of portable toilets should be provided for the workers. The portable toilets should be maintained in a state, which will not deter the workers from utilizing these portable toilets. Night soil should be collected by licensed collectors regularly. 	Proper handling of sewage from worker to avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	^
S8.3.17	WM5	<u>General Refuse</u> <ul style="list-style-type: none"> • General refuse generated on-site should be stored in enclosed bins or compaction units separately from construction and chemical wastes. • A reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from construction and chemical wastes, on a daily basis to minimize odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law. • Aluminium cans are often recovered from the waste stream by individual collectors if they are segregated and made easily accessible. Separate labelled bins for their deposit should be provided if feasible. • Office wastes can be reduced through the recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered by the Contractor. In addition, waste separation facilities for paper, aluminum cans, 	Minimize production of the general refuse and avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	* ^ ^ ^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>plastic bottles etc., should be provided.</p> <ul style="list-style-type: none"> Training should be provided to workers about the concepts of site cleanliness and appropriate waste management procedure, including reduction, reuse and recycling of wastes. 					*
Water Quality (Construction Phase)							
S9.11.1 – S9.11.1.2	W1	<ul style="list-style-type: none"> Mitigation during the marine works to reduce impacts to within acceptable levels have been recommended and will comprise a series of measures that restrict the method and sequencing of dredging/backfilling, as well as protection measures. Details of the measures are provided below and summarised in the Environmental Mitigation Implementation Schedule in EM&A Manual. Export for dredged spoils from NWWCZ avoiding exerting high demand on the disposal facilities in the NWWCZ and, hence, minimise potential cumulative impacts; For the marine viaducts of HKLR, the bored piling will be undertaken within a metal casing; where public fill is proposed for filling below -2.5mPD, the fine content in the public fill will be controlled to 25%; single layer silt curtains will be applied around all works; during the first two months of dredging work for HKLR, the silt-removal efficiency of the silt-curtains shall be verified by examining the results of water quality monitoring points. The water quality monitoring points to be selected for the above shall be those close to the locations of the initial period of dredging work. Details in this regard shall be determined by the ENPO to be established, 	To control construction water quality	Contractor	During seawall dredging and filling	Construction stage	^ ^ N/A ^ N/A

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>taking account of the Contractor's proposed actual locations of his initial period of dredging work.</p> <ul style="list-style-type: none"> • silt curtain shall be fully maintained throughout the works. <p>In addition, dredging operations should be undertaken in such a manner as to minimise resuspension of sediments. Standard good dredging practice measures should, therefore, be implemented including the following requirements which should be written into the dredging contract.</p> <ul style="list-style-type: none"> • trailer suction hopper dredgers shall not allow mud to overflow; • use of Lean Material Overboard (LMOB) systems shall be prohibited; • mechanical grabs shall be designed and maintained to avoid spillage and should seal tightly while being lifted; • barges and hopper dredgers shall have tight fitting seals to their bottom openings to prevent leakage of material; • any pipe leakages shall be repaired quickly. Plant should not be operated with leaking pipes; • loading of barges and hoppers shall be controlled to prevent splashing of dredged material to the surrounding water. Barges or hoppers shall not be filled to a level which will cause overflow of materials or pollution of water during loading or transportation; • excess material shall be cleaned from the decks and exposed fittings of barges and hopper dredgers before the vessel is moved; • adequate freeboard shall be maintained on barges to reduce the likelihood of decks being washed by wave action; 					<p style="text-align: center;">*</p> <p style="text-align: center;">N/A</p> <p style="text-align: center;">N/A</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">*</p> <p style="text-align: center;">^</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<ul style="list-style-type: none"> • all vessels shall be sized such that adequate clearance is maintained between vessels and the sea bed at all states of the tide to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash; and • the works shall not cause foam, oil, grease, litter or other objectionable matter to be present in the water within and adjacent to the works site. 					<p style="text-align: center;">^</p> <p style="text-align: center;">*</p>
S9.11.1.3	W2	<p><u>Land Works</u></p> <p>General construction activities on land should also be governed by standard good working practice. Specific measures to be written into the works contracts should include:</p> <ul style="list-style-type: none"> • wastewater from temporary site facilities should be controlled to prevent direct discharge to surface or marine waters; • sewage effluent and discharges from on-site kitchen facilities shall be directed to Government sewer in accordance with the requirements of the WPCO or collected for disposal offsite. The use of soakaways shall be avoided; • storm drainage shall be directed to storm drains via adequately designed sand/silt removal facilities such as sand traps, silt traps and sediment basins. Channels, earth bunds or sand bag barriers should be provided on site to properly direct stormwater to such silt removal facilities. Catchpits and perimeter channels should be constructed in advance of site formation works and earthworks; • silt removal facilities, channels and manholes shall be maintained and any deposited silt and grit shall be removed regularly, including 	To control construction water quality	Contractor	During seawall dredging and filling	Construction stage	<p style="text-align: center;">^</p> <p style="text-align: center;">N/A</p> <p style="text-align: center;">*</p> <p style="text-align: center;">*</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<ul style="list-style-type: none"> • wastewater generated from concreting, plastering, internal decoration, cleaning work and other similar activities, shall be screened to remove large objects; • vehicle and plant servicing areas, vehicle wash bays and lubrication facilities shall be located under roofed areas. The drainage in these covered areas shall be connected to foul sewers via a petrol interceptor in accordance with the requirements of the WPCO or collected for off site disposal; • the contractors shall prepare an oil / chemical cleanup plan and ensure that leakages or spillages are contained and cleaned up immediately; • waste oil should be collected and stored for recycling or disposal, in accordance with the Waste Disposal Ordinance; • all fuel tanks and chemical storage areas should be provided with locks and be sited on sealed areas. The storage areas should be surrounded by bunds with a capacity equal to 110% of the storage capacity of the largest tank; and • surface run-off from bunded areas should pass through oil/grease traps prior to discharge to the stormwater system. 					<p style="text-align: center;">^</p> <p style="text-align: center;">N/A</p> <p style="text-align: center;">*</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p>
S9.14	W3	Implement a water quality monitoring programme	Control water quality	Contractor	At identified monitoring location	During construction period	^
Ecology (Construction Phase)							
S10.7	E1	<ul style="list-style-type: none"> • Good site practices to avoid runoff entering woodland habitats in Scenic Hill 	Avoid potential disturbance on habitat of Romer's Tree	Designer; Contractor	Scenic Hill	During construction	^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<ul style="list-style-type: none"> Reinstate works areas in Scenic Hill Avoid stream modification in Scenic Hill 	Frog in Scenic Hill				N/A ^
S10.7	E2	<ul style="list-style-type: none"> Use closed grab in dredging works. Install silt curtain during the construction. Limit dredging and works fronts. Good site practices Strict enforcement of no marine dumping. Site runoff control Spill response plan 	Minimise marine water quality impacts	Contractor	Seawall,	During construction	^ ^ ^ ^ ^ ^
S10.7	E3	<ul style="list-style-type: none"> Reprovision of replacement Artificial Reefs (of the same volume as the existing ARs inside Marine Exclusion Zone) 	Mitigate water quality impacts on the existing ARs	Project proponent	To be determined	Construction phase or operation phase	N/A
S10.7	E4	Watering to reduce dust generation; prevention of siltation of freshwater habitats; Site runoff should be desilted, to reduce the potential for suspended sediments, organics and other contaminants to enter streams and standing freshwater	Prevent Sedimentation from Land-based works areas	Contractor	Land-based works areas	During construction	^
S10.7	E5	Good site practices, including strictly following the permitted works hours, using quieter machines where practicable, and avoiding excessive lightings during night time	Prevent disturbance to terrestrial fauna and habitats	Contractor	Land-based works areas	During construction	^
S10.7	E6	<ul style="list-style-type: none"> Dolphin Exclusion Zone; Dolphin watching plan 	Minimize temporary marine habitat loss impact to dolphins	Contractor	Marine works	During marine works	^ ^
S10.7	E7	<ul style="list-style-type: none"> Decouple compressors and other equipment on working vessels Avoidance of percussive piling Marine underwater noise monitoring 	Minimise marine noise impacts on dolphins	Contractor	Marine works	During marine works	^ ^ ^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<ul style="list-style-type: none"> Temporal suspension of drilling bored pile casing in rock during peak dolphin calving season in May and June 					N/A
S10.7	E8	<ul style="list-style-type: none"> Control vessel speed Skipper training. Predefined and regular routes for working vessels; avoid Brothers Islands. 	Minimise marine traffic disturbance on dolphins	Contractor	Marine traffic	During marine works	^ ^ ^
S10.10	E9	<ul style="list-style-type: none"> Dolphin vessel monitoring 	Minimise marine traffic disturbance on dolphins	Contractor	North Lantau and West Lantau	Prior to construction, during construction, and 1 year after operation	^
Fisheries							
S11.7	F1	<ul style="list-style-type: none"> Reprovision of replacement Artificial Reefs(of the same volume as the existing ARs inside Marine Exclusion Zone) 	Mitigate water quality impacts on the existing ARs	Project proponent	To be determined	Construction phase or operation phase	N/A
S11.7	F2	<ul style="list-style-type: none"> Reduce re-suspension of sediments Limit dredging and works fronts. Good site practices Strict enforcement of no marine dumping Spill response plan 	Minimise marine water quality impacts	Contractor	Seawall,	During construction	^ ^ ^ ^ ^
Landscape & Visual (Construction Phase)							
S14.3.3.3	LV2	Mitigate both Landscape and Visual Impacts <ul style="list-style-type: none"> G1. Grass-hydroseed bare soil surface and stock pile areas. 	Minimise visual & landscape impact	Contractor	HKLR	Construction stage	N/A

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<ul style="list-style-type: none"> • G2. Add planting strip and automatic irrigation system if appropriate at some portions of bridge or footbridge to screen bridge and traffic. • G3. For HKLR, providing aesthetic design on the viaduct, tunnel portals, at-grade roads (e.g. subtle colour tone and slim form for viaduct, featured form of tunnel portals, roadside planting along at-grade roads and landscape berm on) to beautify the HKLR alignment. • G5. Vegetation reinstatement and upgrading to disturbed areas. • G6. Maximize new tree, shrub and other vegetation planting to compensate tree felled and vegetation removed. • G7. Provide planting area around peripheral of and within HKLR for tree screening buffer effect. • G8. Plant salt tolerant native tree and shrubs etc along the planter strip at affected seawall. • G9. Reserve of loose natural granite rocks for re-use. Provide new coastline to adopt “natural-look” by means of using armour rocks in the form of natural rock materials and planting strip area accommodating screen buffer to enhance “natural-look” of the new coastline (see Figure 14.4.2 for example). 					<p style="text-align: center;">N/A</p> <p style="text-align: center;">N/A</p> <p style="text-align: center;">N/A</p> <p style="text-align: center;">N/A</p> <p style="text-align: center;">N/A</p> <p style="text-align: center;">N/A</p>
S14.3.3.3	LV3	<p><u>Mitigate Visual Impacts</u></p> <ul style="list-style-type: none"> • V1.Minimize time for construction activities during construction period. • V2.Provide screen hoarding at the portion of the project site / works areas / storage areas near VSRs who have close low-level views to the Project during HKLR construction. 					<p style="text-align: center;">^</p> <p style="text-align: center;">^</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
EM&A							
S15.2.2	EM1	An Independent Environmental Checker needs to be employed as per the EM&A Manual.	Control EM&A Performance	Project Proponent	All construction sites	Construction stage	^
S15.5 - S15.6	EM2	1) An Environmental Team needs to be employed as per the EM&A Manual. 2) Prepare a systematic Environmental Management Plan to ensure effective implementation of the mitigation measures. 3) An environmental impact monitoring needs to be implementing by the Environmental Team to ensure all the requirements given in the EM&A Manual are fully complied with.	Perform environmental monitoring & auditing	Contractor	All construction sites	Construction stage	^ ^ ^

Remarks: ^ Compliance of mitigation measure
 * Recommendation was made during site audit but improved/rectified by the contractor
 N/A Not Applicable at this stage as no such site activities were conducted in the reporting month (e.g. concrete batching plan, barging point, seawall dredging and filling, bored piling, landscaping works etc)

**APPENDIX O
WASTE GENERATION IN THE
REPORTING MONTH**



Appendix: C6 Monthly Summary Waste Flow Table

Name of Department: HyD

Contract No.: HY/2011/09

Monthly Summary Waste Flow Table for 2015 (Year)

Month	Actual Quantities of Inert C&D Materials Generated Monthly						Actual Quantities of C&D Wastes Generated Monthly				
	Total Quantity Generated ¹¹	Hard Rock and Large Broken Concrete ⁶	Reused in the Contract ^{8,9}	Reused in other Projects ^{5,8,9}	Disposed as Public Fill ⁷	Imported Fill ^{6,7,8,9}	Metals ¹²	Paper/ cardboard packaging	Plastics ³	Chemical Waste	Others, e.g. general refuse ^{8,9}
	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 kg)	(in '000 kg)	(in '000 kg)	(in '000 m ³)
Jan	4.101	0.000	0.000	0.000	4.101	0.000	0.070	0.485	0.000	0.000	0.566
Feb	3.823	0.000	0.000	0.000	3.823	0.000	0.000	0.550	0.000	0.000	0.241
Mar	0.681	0.000	0.000	0.000	0.681	0.000	0.096	0.729	0.000	0.793	0.299
Apr	0.406	0.000	0.000	0.000	0.406	0.000	0.049	0.909	0.000	0.000	0.202
May	0.176	0.000	0.000	0.000	0.176	0.000	0.005	1.096	0.000	0.000	0.267
Jun	0.287	0.000	0.000	0.000	0.287	0.000	0.095	1.146	0.000	0.000	0.234
Sub-Total	9.472	0.000	0.000	0.000	9.472	0.000	0.314	4.915	0.000	0.793	1.807
Jul	0.293	0.000	0.000	0.000	0.293	0.000	0.071	1.064	0.000	2.378	0.280
Aug	0.764	0.000	0.000	0.000	0.764	0.000	0.020	1.031	0.000	0.000	0.273
Sep	0.555	0.000	0.000	0.000	0.555	0.000	0.144	TBC	0.000	0.000	0.267
Oct											
Nov											
Dec											
Total	11.084	0.000	0.000	0.000	11.084	0.000	0.550	7.010	0.000	3.171	2.626



Forecast of Total Quantities of C&D Materials to be Generated from the Contract¹⁰

Total Quantity Generated ¹¹	Hard Rock and Large Broken Concrete ⁶	Reused in the Contract ^{8,9}	Reused in other Projects ^{5,8,9}	Disposed as Public Fill ⁷	Imported Fill ^{6,7,8,9}	Metals	Paper/ cardboard packaging	Plastics ³	Chemical Waste	Others, e.g. general refuse ^{8,9}
(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 kg)	(in '000 kg)	(in '000 kg)	(in '000 m ³)
229.311	0.000	3.200	73.111	100.000	53.000	4.000	30.000	0.000	10.000	8.000

- Notes:
- (1) The performance targets are given in ER Appendix 8J Clause 14 and the EM&A Manual.
 - (2) The waste flow table shall also include C&D materials to be imported for use at the Site.
 - (3) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material.
 - (4) The Contractor shall also submit the latest forecast of the total amount of C&D materials expected to be generated from the Works, together with a breakdown of the nature where the total amount of C&D materials expected to be generated from the Works is equal to or exceeding 50,000 m³. (ER Part 8 Clause 8.8.5 (d) (ii) refers).
 - (5) The materials reused in other Project shall not be treated as waste under the Waste Disposal Ordinance (CAP354).
 - (6) According to the EIA Appendix 8B, the density of rock (bulked) is 2.0 tonnes/m³.
 - (7) According to the EIA Appendix 8B, the density of soil (bulked) is 1.8 tonnes/m³.
 - (8) Assuming the loading quantities of a 30-tonne truck is 8.0m³.
 - (9) Assuming the loading quantities of a 24-tonne truck is 6.5m³.
 - (10) The forecast of C&D materials to be generated from the Contract is sourced from the works program in December 2014.
 - (11) The volume of Total Quantity Generated means the volume of Hard Rock and Large Broken Concrete+Disposed as Public Fill+Imported Fill-Reused in the Contract-Reused in other Projects.
 - (12) The density of metal is 7,850 kg/m³.

**APPENDIX P
COMPLAINT LOG**

Appendix P - Complaint Log

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
Com-2013-04-001	Near Tung Chung New Development Pier	8 April 2013	EPD received the complaint on 8 April 2013. The complainant complained about oil was dumped from various vessels operating for Hong Kong-Zhuhai-Macao Bridge Hong Kong (HZMB HK) Projects near Tung Chung New Development Pier over the past few months.	1) The vessels photos in the complainant's photo are not the working vessels under Contract No. HK/2011/09. 2) No oil dumped from Contract No. HK/2011/09's working vessels was observed according to ET's site inspection conducted on 9 April 2013 at near Tung Chung New Development Ferry Pier. 3) Joint site inspection (DCVJV and ARUP) was conducted on 10 April 2013 and confirmed that Contract No. HY/2011/09's vessels are not involved the complaint case. 4) DCVJV will keep remind their boat crews not discharging contaminated effluent directly into the sea.	Closed
Com-2013-05-001	WA6	2 May 2013	ARUP received the complaint on 2 May 2013. The complainant alleged the noise nuisance was generated from the Works Area WA6 at around 13:00 on 1 May 2013 (Wednesday).	The site diary report was reviewed and confirmed that no works were carried out at WA6 on 1 May 2013. In addition, no noise was heard from WA6 according to the security guard who on duty at WA6 on 1 May 2013. Based on the information provided, the complaint regarding the construction noise at WA6 is not considered justifiable.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
Com-2013-05-002	WA6	18 May 2013	ARUP received the complaint on 18 May 2013. The complainant advised that the noise nuisance due to loading of metal parts at barge near the seawall of Works Area WA6 early morning (around 8:45a.m) on 18 May 2013 (Saturday).	Based on the record of site activities at WA6 on 18 May 2013, 4 metal plates and 2 oxygen-acetylene set were lifted onto a derrick boat “Chiu Kee” by a crane near seawall at WA6 in the morning on that day. Such operation was commenced around 8:40a.m and completed in 10 minutes during the normal construction working hour (0700 – 1900 Monday to Saturday). However, the duration of aforesaid activities is very short and infrequent. Nevertheless, the Contractor was reminded to strengthen their site supervision and provide training for the workers regularly to increase awareness of their environmental responsibilities to minimize the noise impact to the nearby residents and the specific mitigation measures for the complaint including but not limited to:- <ul style="list-style-type: none"> •To place wooden planks or rubber mats on ground for loading and unloading heavy or metal objects; and •To deploy professional personnel to supervise the works. 	Closed
Com-2013-05-003	Near Tung Chung New Development Pier	18 May 2013	EPD received the public complaint on 18 May 2013. This complaint was a follow-up of a previous complaint received by EPD on 8	After receiving the complaint, additional site inspection was conducted at near Tung Chung New Development Pier on 30 May 2013 to investigate whether oil	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
			<p>April 2013 (Com-2013-04-001).</p> <p>The complainant complained again about the oil was dumped from various vessels operating for Hong Kong-Zhuhai-Macao Bridge Hong Kong (HZMB HK) Projects near Tung Chung New Development Pier over the past months.</p>	<p>dumped was due to Contract No. HY/2011/09's vessels. During the site inspection, three working vessels under Contract No.HY/2011/09 was anchored off near Tung Chung New Development Pier. No oil dumped from Contract No. HY/2011/09's vessels were observed and the water around the vessels was clear. The following mitigation measures have been implemented by DCVJV:</p> <ul style="list-style-type: none"> • DCVJV has sent the letter to the shipping agent to remind them to ensure the vessels under Contract No. HY/2011/09 are in good condition and any oil dumped to sea should be avoided to prevent water pollution. • Provide training to the vessel skippers for prevention of pollution from ships. • DCVJV requested vessel skippers to provide engine oil disposal records The vessel skippers assured to us that all waste lubricants were sent to waste collectors regularly and no oil discharge into seawater. 	
Com-2013-07-001	Southeast Quay of Chek Lap Kok near the junction of Chek Lap Kok South Road and Scenic Road	17 July 2013	The complaint was received by EPD on 17 th July 2013. According to the EPD's letter, the complainant was concerned for the noise nuisance generated from the	In response to the complaint, ET conducted two times site inspections at Southeast Quay at Chek Lap Kok between 18:45 and 20:30 hours on 23 July 2013 and 20:30 to 22:30 hours on 30 July 2013.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
			<p>operation of concrete lorry mixers during evening and night-time period at Southeast Quay of Chek Lap Kok.</p>	<p>During the inspections, the Ro-Ro barge was observed anchored off Southeast Quay at Chek Lap Kok but no concrete lorry mixer was observed throughout the inspection.</p> <p>On 23 July 2013, at about 19:35, one tug boat was observed travelling to Southeast Quay, Chek Lap Kok and left at about 19:40.</p> <p>On 30 July 2013, no tug boat and concrete lorry mixers were observed during the inspection.</p> <p>According to the Contractor, there was no concreting works for the pier sites on 23 July 2013 and therefore no loading and unloading operation at Southeast Quay at Chek Lap Kok.</p> <p>Concreting works were performed at Pier 0 on 30 July 2013. As the Contractor anticipated the arrival time of tug boat and flap-top barge at Southeast Quay will exceed 23:00 hours after the concreting works, they decided to arrange the tug boat and flap-top barge with concrete</p>	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<p>lorry mixers anchored off around Pier 66 after 23:00 hours. So, no loading and unloading operation at Southeast Quay at Chek Lap Kok was observed.</p> <p>Further night time site inspection was conducted on 22 August 2013 during the loading and unloading operation at Southeast Quay of Chek Lap Kok, the construction works conducted under Contract No. HY/2011/09 complied with the conditions in the CNP No. GW-RS0895-13.</p>	
Com-2013-11-001	Chek Lap Kok (CLK) South Road	16 November 2013	The complaint was received by project customer services on 16 th November 2013 regarding the dust problem at Chek Lap Kok (CLK) South Road.	<p>After receiving the complaint, ET conducted the site inspection on 19 and 29 November 2013 to check the appropriate environmental protection and pollution control measures which are properly implemented by the Contractor under HY/2011/09 (DCVJV). The observation are summarized as below:-</p> <ul style="list-style-type: none"> • Dust generation works was conducted by the other Contractor at South East Quay • Proper watering of haul road to avoid dust generation during vehicle / plant equipment movement. • Vehicle washing facilities provided 	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<p>at every site exit at CLK South Road and South Perimeter Road.</p> <ul style="list-style-type: none"> No dark smoke was observed emitting from the plant equipments. <p>Based on the information collected, the complaint of dust problem at Check Lap Kok South Road is considered not related to Contract No. HY/2011/09 as dust suppression measures has been properly implemented by the Contractor on site to prevent dust nuisance from the construction activities.</p>	
Com-2014-01-001	Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill (Contract No. HY/2011/09)	3 January 2014	The complaint was received by EPD on 3 rd January 2014. According to the EPD’s letter, a resident in Tai O District was concerned for the noise nuisance occasionally arising from the hammering or hitting of metals from Contract No. HY/2011/09.	<p>In response to the complaint, ET conducted an ad hoc night time site inspection at P0, P18 and P19 on 14 January 2014 between around 23:00 and 00:30 hours of 15 January 2014.</p> <p>In accordance with the site activities record and site inspections, the construction works conducted under Contract No. HY/2011/09 complied with the conditions in the CNP No. GW-RS1108-13.</p> <p>Nevertheless, the Contractor was advised to strictly follow the conditions of the permit because any deviation from the</p>	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<p>conditions may lead to cancellation of the permit, subsequent prosecution action and the Authority's refusal to issue further permit.</p> <p>In addition, the following environmental mitigation measures were recommended:</p> <ul style="list-style-type: none"> • Review and adjust the lighting directions of the barge, under safety consideration, to avoid potential visual impacts to residents in vicinities; • To ensure the equipment are maintaining in good operation condition; and • To strengthen site supervision and provide training for the workers regularly to increase awareness of their environmental responsibilities to minimize the noise impact to the nearby residents and the specific mitigation measures. 	
Com-2014-01-002	Hong Kong-Zhuhai-Macao Bridge	16 January 2014	The complaint was received by HyD's PR Team on 16 January 2014 that the complainant advised that the heavy exhaust fume affecting Tung Chung Crescent.	After receiving the complaint, ET conducted the site inspection on 21 January 2014 to check all the plant equipments which were operated for the construction works and air quality	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<p>mitigation measures.</p> <p>Based on the information collected, the complaint of heavy exhausts affecting Tung Chung Crescent is considered not related to Contract No. HY/2011/09 due to the following reason(s):-</p> <ol style="list-style-type: none"> 1) The work sites at Portion C and South East Quay at Portion A under Contract No. HY/2011/09 are approximately 800m from Tung Chung Crescent. Any unpleasant smell of exhaust fume would not be anticipated. 2) No heavy smoke was observed emitting from plants / equipment during the site inspection on 21 January 2014. 3) The vehicles and equipments were switched off while not in use. 4) All plant and equipment were well maintained and in good operating condition. 5) Air quality mitigation measures has been properly implemented by the Contractor on site to prevent dust nuisance from the construction activities. 	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
Com-2014-03-001	Oil Spillage at near Sha Lo Wan	5 March 2014	The complaint was received by EPD on 5 March 2014. The complainant suspected the oil leakage from the works area of Contract No. HY/2011/09 near Sha Lo Wan	Based on ET site inspection, no oil spillage from the works area under Contract No. HY/2011/09 at near Sha Lo Wan was observed. In addition, spill kits are ready on site in order to dealing with spillage cases promptly. Nevertheless, DCVJV was also recommended the mitigation measures as below: <ul style="list-style-type: none"> • Provide training for the workers regularly regarding the mitigation measures on waste / chemical management. • Provide sufficient chemical spillage kit (e.g. oil absorbent) to all vessels and working platform. • Regular check the condition of vessels and plant equipments to ensure no leakage of oil. 	Closed
Com-2014-03-002	Construction Noise in the vicinity of the waters outside Sha Lo Wan	11 March 2014	The complaint was received by EPD on 11 March 2014. According to the EPD's letter, the complainant was concerned for the mobile crane which operating in the vicinity of the waters outside Sha Lo Wan after 23:00.	In accordance with an ad hoc site inspection on 18 March 2014, no construction works were conducted during the restricted hours. The 1 st investigation report has been submitted to EPD on 21 March 2014 and the 2 nd investigation report was submitted to EPD on 26 June 2014. The Contractor was advised to strictly	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<p>follow the conditions of the permit because any deviation from the conditions may lead to cancellation of the permit, subsequent prosecution action and the Authority’s refusal to issue further permit. Nevertheless, the Contractor was reminded to take sufficient noise mitigation measures to minimize the environmental impact on the nearby community:</p> <ul style="list-style-type: none"> · To space out noisy equipment and position it as far away as possible from the sensitive receivers; · To avoid concurrent uses of noisy equipment near the sensitive area; · To ensure the equipment are maintaining in good operation condition; · To turned off any idle equipment on site; and · To enclose the noisy part of the machine by acoustic insulation material if feasible. · To arrange tailor-made training for the Production Team including the management and foremen to explain to them the conditions and requirements listed on the CNP. · To delegate one Engineer for ensuring that all construction activities and PMEs used are in full compliance with the CNP 	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				and legislative requirements.	
Com-2014-04-001	Construction marine works by the company Bauer Hong Kong in Tung Chung	14 April 2014	The complaint was received by Agriculture, Fisheries and Conservation Department (AFCD) on 14 April 2014, the complainant complained that the dead dolphin was found under a platform at construction marine works by the company Bauer Hong Kong in Tung Chung (Macau Bridge Piling Works)	<p>In accordance with the photos showing a date of 27 November 2013 (08:00 – 08:25a.m.) which provided by the complainant, the dolphin was observed has been dead for some time and shows signs of decomposition. It was difficult to determine the cause of death of the deceased dolphin based on the photographs and the dead dolphin was found a few months ago. By examining the photos, it is found that the body was beside a barge, not under a working platform.</p> <p>In addition, the dead dolphin was found in the early morning in which the marine construction works have not been commenced. Therefore, from the above information the dead dolphin is considered to be washed to the work site. However, there is no significant increase of cetacean stranding were found in Hong Kong since the commencement of Contact No. HY/2011/09.</p> <p>In regard to the complaint, the following recommendations were made:</p>	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<ul style="list-style-type: none"> ➤ In case stranded cetaceans are found, the AFCD shall be contacted immediately and provide the following information to facilitate AFCD’s investigation: <ol style="list-style-type: none"> 1. Name and telephone number; 2. Date and time of discovery; 3. Location (as specific as possible); 4. Status of the stranded animal (i.e. alive, freshly dead, slightly decomposed, rotten, mummified); 5. Type and size of the stranded animal. ➤ To implement Dolphin Exclusion Zone during the installation of bored pile casing located in the waters to the west of Airport. ➤ To implement Dolphin Watching Plan after the bored piling casing is installed. 	
Com-2014-05-001	At the shore of Sha Lo Wan	13 May 2014	The complaint was received by EPD on 13 May 2014. According to the EPD’s email, the complainant was concerned about the sand material that was excavated on the shore of Sha Lo Wan for the construction of Hong Kong -	After receiving the complaint from a Sha Lo Wan’s village resident, the sub-contractor was instructed to stop the sand excavation and leave immediately. In addition, all sands excavated from the shore of Sha Lo Wan were returned back to the original area on 13 May 2014.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
			Zhuhai - Macao Bridge (HZMB) Project on 11 May 2014.	<p>Nevertheless, the Contractor was advised to arrange tailor-made training for Production Team including the management and foremen to explain to them the conditions and requirements listed on the Environmental Permit.</p> <p>In addition, indicative poles and flags are recommended to put within the site boundary to identify the extent of land areas in Sha Lo Wan / Sha Lo Wan (West) Archaeological site.</p>	
Com-2014-05-002	At the shore of Sha Lo Wan	27 May 2014	The complaint was received by EPD on 27 May 2014. According to the EPD's email, the complainant was concerned about the dumping rubbles along the shore area of Sha Lo Wan on 27 May 2014.	<p>The complaint investigation report for the complaint of dumping rubbles along the shore area of Sha Lo Wan was submitted to EPD on 4 June 2014.</p> <p>EPD and AFCD provided their comments on 5 and 9 June 2014 respectively.</p> <p>A meeting among DCVJV, ARUP, IEC, ET, EPD and AFCD was held on 17 June 2014. According to the meeting, further information is required to include in the complaint investigation report and the report was submitted to EPD on 4 March 2015.</p>	Complaint investigation report is under review by EPD

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
Com-2014-05-003	Pier 39 to 50	29 May 2014	ARUP received the complaint on 29 May 2013. The complainant advised that the workers disposed hundreds of kg of waste spoils (concrete and earth) into the sea every day in the existing locations of HZMB site area.	Based on the investigation findings, the waste spoils (concrete and earth) were disposed to HY/2010/02 Project according to approved WMP. The following recommendations were made: <ul style="list-style-type: none"> • To check for any accumulation of waste spoils (concrete and earth) on site. • To cover the wastes skip with waste spoils before removing from site. • To carry out inspection of pier(s) regularly to ensure the frontline staff loads inert materials to approved barge properly. • To clean the waste storage areas regularly and do not cause dust nuisance. 	Closed
Com-2014-08-001	Near Sha Lo Wan	27 August 2014	ARUP received the complaint on 27 August 2013. The complainant was concerned about the dust on the surface of the roro-barge.	Based on the investigation findings, dusty materials at the ro-ro barge at P63 and dust generation when vehicles passing by at the roro-barge at Southeast Quay were observed. The following recommendations were made: <ul style="list-style-type: none"> • To check for any accumulation of dusty materials at roro-barge. • To cover the stockpile of dusty materials before removing from site. • To clean the surface of roro-barge 	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				regularly and do not cause dust and water quality nuisance. <ul style="list-style-type: none"> • To maintain the surface of ro-ro-barge wet especially during the vehicle movements. Water misting is considered an acceptable measure to control dust emissions. • To check and replace the worn sand bags at the surface of ro-ro-barge to prevent the turbid water from entering to the sea when watering the barge surface. 	
Com-2014-11-001	HZMB-HKLR – Section between HKSAR Boundary and Scenic Hill (Contract No. HY/2011/09)	11 November 2014	The complaint was received by EPD on 11 November 2014. According to the EPD’s email, the complaint was received from one of the green groups Sea Shepherd. They complained that the residual concrete had been washed off from the deck surface of a flat-top barge into the sea, and marine littering had been spotted by a worker of HZMB-HKLR – Section between HKSAR Boundary and Scenic Hill (Contract No. HY/2011/09)	Based on the investigation findings, residue concrete or wastewater contaminated with concrete overflowing/spilling into the sea from the ro-ro barge and marine littering were suspected. The following recommendations were made: <ul style="list-style-type: none"> ➤ Properly clear the concrete stains on the three ro-ro barges (e.g. hand-held equipments such as shovel etc). Tarpaulin sheet is also recommended to provide when clearing the concrete stains at the edge of ro-ro barge to prevent these removed materials from getting into the sea. The worker should also pay special care to remove the concrete stains to 	Closed
Com-2014-11-002	HZMB-HKLR – Section between HKSAR Boundary and Scenic Hill	18 November 2014	The complaint was received by EPD on 18 November 2014. According to the EPD’s email, it was alleged that residual concrete		Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
	(Contract No. HY/2011/09)		had been poured out directly from the concrete lorry mixers on a ro-ro barge into the sea during night-time by the workers of HZMB-HKLR – Section between HKSAR Boundary and Scenic Hill (Contract No. HY/2011/09)	minimize the water quality nuisance. <ul style="list-style-type: none"> ➤ Keep cleanliness of the surface of ro-ro-barge and do not cause water quality nuisance. ➤ To check and reinforce the concrete / sand bag bund between baffles erected near the edge of the three ro-ro barges to avoid accidental leakage of wastewater from the deck regularly. ➤ Keep all debris/ aggregate away from the edge of ro-ro barge to prevent them from falling into the sea. ➤ Provide sufficient skips for temporary storage of concrete residue/wastewater. ➤ To check for any accumulation of residual waste concrete at the waste skip on ro-ro-barge. ➤ Provide spare and sufficient sand bags at each ro-ro barges to confine the concerned area in the event of accidental spillage of concrete when discharge the concrete from the concrete lorry mixers to pump truck. ➤ Provide absorptive materials to absorb the wastewater in case of accidental spillage of wastewater 	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				during washing concrete lorry mixers or other equipments. ➤ Assign trained staff to ensure proper management of environmental matters on each of the ro-ro barges in particular the handling of concrete residue/wastewater generated during operation. ➤ Keep record for collection of skip or temporary storage tank for wastewater and excess concrete. ➤ Ensure sufficient garbage bag / rubbish bin are provided at working barge / pier site. ➤ Provide training for the workers regularly regarding the water quality mitigation measures and waste management to increase their awareness of environmental protection.	
Com-2014-11-003	Floating Concrete Batching Plant (FCBP)	28 November 2014	The complaint was received by EPD on 28 November 2014. The complaint was received from one of the green groups Green Lantau Association. They complained about the hauling of the floating concrete batching plant (FCBP) by the tug boat to the site of Contract No. HY/2011/09 from the north-	Based on the information collected, the following conclusions were drawn: 1) It is suspected that the wake following the FCBP was resulted from disturbance to the bottom sediment when it was traveling during the lowest tide on that day. 2) The FCBP was traveling within the	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
			<p>east side had disturbed the seabed causing an increase of turbidity in marine waters at around noon of 15 November 2014.</p>	<p>site area and the maximum number of movement of a floating plant (and therefore tug boat) is two times per day. Average duration of each movement is around 1 hour/day. Therefore, the disturbance to the bottom sediment is considered temporary, localized and infrequent.</p> <p>3) No illegally discharge of wastewater or domestic wastewater to the sea from FCBP.</p> <p>4) Relevant environmental mitigation measures as shown in EP-352/2009/C were properly implemented.</p> <p>5) No deterioration of marine water quality based on the marine water quality monitoring results on 15 November 2014.</p> <p>Nevertheless, DCVJV was also recommended the mitigation measures as below:</p> <ul style="list-style-type: none"> • The vessel skipper should pay special care about the movement of deep draught vessel to avoid seabed disturbance. (e.g. speed restrictions) • In case of sediment plume was found behind vessel, the vessel skipper 	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				should further reduce vessel speed. • Minimum clearance of 0.6m should be maintained between vessels and the seabed in all tide conditions, to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash. (Reference: EIA-081/2002 - Construction of Lung Kwu Chau Jetty)	
Com-2014-12-001	Shores of Po Chue Tam and Shek Tsai Po, Tai O	7 December 2014	The complaint was received from one of the green groups Green Lantau Association. They complained about some waste materials (including a number of grey plastic mats and buoys) suspected in relation to the HZMB works have recently washed up on the shores of Po Chue Tam and Shek Tsai Po, Tai O	The owner of objects found on the shores could not be identified. DCVJV has taken initiative to remove these materials after receiving the complaint. Nevertheless, DCVJV was also recommended the mitigation measures as below: • Gather up and remove debris to keep the work site orderly. • Maintain site housekeeping. Designate areas for waste materials and provide containers. • Secure loose or light material that is stored on open floors. • Do not permit rubbish to fall freely from any level of the pier sites. • Provide training for the workers	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				regularly regarding the water quality mitigation measures and waste management to increase their awareness of environmental protection.	
Com-2014-12-002	Site Office of HZMB-HKLR – Section between HKSAR Boundary and Scenic Hill	2 December 2014	Highways Department (HyD) received a public complaint from a resident of Le Bleu Duex on 2 December 2014. According to the email from ARUP dated 3 December 2014, the complainant advised that the noise nuisance due to the metal parts were dropped onto the ground by people repetitively and loading or unloading a boat at the pier. The complaint was quoted, “A resident living in Le Bleu Duex addressed a complaint to CE of HyD at about 20:04 hrs last night. He complained about the noise nuisance coming from site office since 19:30 hrs last night. Repetitively metal parts had been dropped on the ground by people who seem to	Based on the information collected, the noise generated is considered due to the metal parts were dropped onto the ground at the seashore area near Le Bleu Duex. The metal pipe was unloaded at non-designated area and no powered mechanical equipment was used for unloading works at WA6 during restricted hour. The Contractor was reminded to take sufficient noise mitigation measures to minimize the environmental impact on the nearby community as recommended in the approved EIA report and the specific mitigation measures for the complaint including but not limited to:- <ul style="list-style-type: none"> • To place wooden planks or rubber mats on ground for loading and unloading heavy or metal objects; and • To deploy professional personnel to 	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
			<i>be loading or unloading a boat at the pier. Noise was still going on right now at 20:04.”</i>	supervise the works.	
Com-2014-12-003	Along the shore from Yat Tung to Tai O	24 December 2014	The complainant was concerned about the increase of marine refuse (water bottles and debris) along the shore from Yat Tung to Tai O suspected in relation to the HZMB works.	<p>The owner of marine refuse found on the shores could not be identified. DCVJV has taken initiative to remove these wastes after receiving the complaint. DCVJV will also take the initiative to clear the marine refuse along the shore from Yat Tung to Tai O, if necessary.</p> <p>Nevertheless, DCVJV was also recommended the mitigation measures as below:</p> <ul style="list-style-type: none"> • Gather up and remove debris to keep the work site orderly. • Maintain site housekeeping. Designate areas for waste materials and provide containers. • Secure loose or light material that is stored on open floors. • Do not permit rubbish to fall freely from any level of the pier sites. • Provide training for the workers regularly regarding the water quality mitigation measures and waste management to increase their awareness of environmental 	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				protection.	
Com-2015-06-001	The sea side at WA6 vertical seawall	6 June 2015	A resident living in Le Bleu Duex complained about noise from a barge which unloading materials at about 21:00 hrs last Saturday i.e. 6 June 2015	<p>Based on the information collected, the noise generated is considered due to the unloading of steel casings to the seashore area opposite to the China State Site Office.</p> <p>The person-in-charge of the barge has been reprimanded by the Contractor for causing noise nuisance to resident nearby. In addition, the Contractor had also reminded their subcontractors to avoid unloading of materials during restricted hours (i.e. 19:00 to 07:00 hours on any day and any time on public holidays including Sundays) without Construction Noise Permit (CNP).</p> <p>The Contractor was reminded to obtain Construction Noise Permit (CNP) for PME use in restricted hours.</p> <p>The Contractor was reminded again to take sufficient noise mitigation measures to minimize the environmental impact on the nearby community as recommended in the approved EIA report and the specific mitigation measures for the complaint including but not limited to:-</p> <ul style="list-style-type: none"> • To place wooden planks or rubber 	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				mats on ground for loading and unloading heavy or metal objects; and <ul style="list-style-type: none"> • To deploy professional personnel to supervise the works. 	

**APPENDIX Q
SUMMARY OF SUCCESSFUL
PROSECUTION**

Appendix Q - Summary of Successful Prosecution

Date of Successful Prosecution	Details of the Successful Prosecution	Status	Follow Up
20 October 2014	The non-compliance of construction noise permit (CNP) numbered GW-RS1217-13 that use of powered mechanical equipment not permitted in the CNP on 15 March 2014 between the hours of 7p.m. and 7a.m. at Pier 72.	The subcontractor was fined.	To ensure the construction works would comply with the CNP during restricted hours, a Permit-to-work system was formulated to control daily operation of the CNPs.