

## 東業德勤測試顧問有限公司

## **ETS-TESTCONSULT LTD.**

**TEST REPORT** 

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pul Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com



## China Harbour Engineering Co Ltd

Contract No.: CV/2021/09 Handling of Surplus Public Fill (2022-2023)

TUEN MUN AREA 38 FILL BANK
MONTHLY EM&A REPORT NO.31
(JULY 2024)

Prepared by:

LAU, Wing Sum Environmental Officer

Checked by:

LAU, Chi Leung Environmental Team Leader

Issue Date: 07 August 2024

Report No.: ENA44463



#### **UMWELT CONSULTING LIMITED**

23/F, On Hong Commercial Building, 145 Hennessy Road, Wan Chai, Hong Kong

**By Post** 

Our Ref : P231104-EMA-TMFB-202407-V

Date

: 12th August 2024

ETS-Testconsult Limited 8/F, Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, NT

Attn: Mr. LAU Chi Leung

## Environmental Permit (EP) No. EP-210/2005/F Expansion and Extension of Fill Bank at Tuen Mun Area 38 Monthly EM&A Report for July 2024

Dear Sir,

Pursuant to Condition 4.6 of Environmental Permit (EP) No. EP-210/2005/F, please note the report "Tuen Mun Area 38 Fill Bank Monthly EM&A Report No. 31 (July 2024)" dated 7 August 2024 submitted under the EP, certified by the Environmental Team Leader on 7 August 2024, had been reviewed and is hereby verified.

Should you have any query, please feel free to contact the undersigned at 3756 9590 or ivanting@umwelt.consulting.

Your faithfully,

For and on behalf of:

**Umwelt Consulting Limited** 

Ting o Chung Ivan

Independent Environmental Checker



ENA44463 Monthly EM&A Report No.31

IABLE O	FCONTENTS	Page
EXECUTI	VE SUMMARY	
1.0	INTRODUCTION	1
2.0	PROJECT INFORMATION	
	2.1 Construction Programme	1
	2.2 Project Organization and Management Structure	1
	2.3 Contact Details of Key Personnel	1
3.0	CONSTRUCTION PROGRESS IN THIS REPORTING MONTH	2
4.0	AIR QUALITY MONITORING	
	4.1 Monitoring Requirement	2
	4.2 Monitoring Equipment	
	4.3 Monitoring Parameters, Frequency and Duration	2 2 2 3 4
	4.4 Monitoring Locations and Schedule	2
	4.5 Monitoring Methodology	3
	4.6 Action and Limit levels	
	4.7 Event-Action Plans	4
	4.8 Results and Observations	4
5.0	MARINE WATER QUALITY MONITORING	
	5.1 Monitoring Requirements	4
	5.2 Monitoring Locations	4
	5.3 Monitoring Parameters and Frequency	4
	5.4 Monitoring Methodology and Equipment Used	5 – 6
	5.5 Action and Limit Levels	6 – 7
	5.6 Event and Action Plan	7
	5.7 Monitoring Duration and Period in this reporting month	7
	5.8 Marine Water Monitoring Results	7
6.0	NOISE MONITORING	•
	6.1 Monitoring Requirements	8
	6.2 Monitoring Equipment	8
	6.3 Monitoring Parameters, Duration and Frequency	8 8
	6.4 Monitoring Locations and Period	8 8-9
	6.5 Monitoring Procedures and Calibration Details	
	6.6 Action and Limit levels	9 9
	6.7 Event-Action Plans 6.8 Results and Observation	9
7.0		9
7.0	ENVIRONMENTAL AUDIT 7.1 Weekly Site Inspection and EPD's Site Inspection	9 – 10
	7.1 Weekly Site inspection and EPD's Site inspection 7.2 Review of Environmental Monitoring Procedures	10
	7.2 Review of Environmental Monitoring Procedures 7.3 Status of Environmental Licensing and Permitting	11
	7.3 Status of Environmental Electrising and Fermitting 7.4 Implementation Status	11 - 12
8.0	LANDSCAPE AND VISUAL	12
9.0	WASTE MANAGEMENT	12
9.0	9.1 Summary of Waste disposed of in this month	12
	·	12
40.0	9.2 Advice on the Solid and Liquid Waste Management Status	12
10.0	ENVIRONMENATL NON-CONFORMANCE	40
	10.1 Summary of air quality, noise and marine water quality	13 13
	10.2 Summary of Environmental Complaints	13
44.0	10.3 Summary of Notification of Summons and Prosecution	13 - 14
11.0	CONCLUSIONS AND RECOMMENTATIONS	
12.0	FUTURE KEY ISSUE	14



**APPENDIX** 

Contract No.: CV/2021/09 Handling of Surplus Public Fill (2022-2023) – Tuen Mun Area 38 Fill Bank

ENA44463 Monthly EM&A Report No.31

A B1 B2 B3 C1 C2 C3 D1 D2 D3 E	Organization Chart and Lines of Communication Calibration Certificates for Impact Air Quality Monitoring Equipments Impact Air Quality Monitoring Results Graphical Plots of Impact Air Quality Monitoring Data Calibration Certificates for Impact Marine Water Quality Monitoring Equipments Impact Marine Water Quality Monitoring Results Graphical Plots of Impact Marine Water Quality Monitoring Data Calibration Certificates for Impact Noise Monitoring Equipments Impact Noise Monitoring Results Graphical Plots of Impact Noise Monitoring Data Weather Condition
F G H I J K L M N O	Event-Action Plans Construction Programme Weekly ET's Site Inspection Record Implementation Schedule of Mitigation Measures Site General Layout Plan Monthly Summary Waste Flow Table Monitoring Schedule for the Coming Month Reporting Month Monitoring Schedule QA/QC Results of Laboratory Analysis Complaint Log
FIGURES Figure 1 Figure 2 Figure 3	Locations of Air Quality Monitoring Stations – Tuen Mun Area 38 Fill Bank Locations of Water Quality Monitoring Stations – Tuen Mun Area 38 Fill Bank Locations of Noise Monitoring Stations – Tuen Mun Area 38 Fill Bank
TABLES 2.1 4.1 4.2 4.3 4.4 4.5 5.1 5.2 5.3 5.4 5.5 6.6 6.1 6.2 6.3 7.1 7.2 7.3 9.1	Contact Details of Key Personnel Air Quality Monitoring Equipment Monitoring parameters, duration and frequency of air quality monitoring Action and Limit levels for 24-hr TSP and 1-hr TSP Summary of 1-hr TSP monitoring results Summary of 24-hr TSP monitoring results Monitoring Parameters and Frequency of the marine water Summary of testing procedure Details of Water Quality Monitoring Equipment (In-site measurement) Water Quality Action and Limit Levels Time Schedule of Water Quality Monitoring Summary of Marine Water Quality Exceedances in this reporting month Noise Monitoring Equipment Duration, Frequencies and Parameters of Noise Monitoring Action and Limit Levels for noise monitoring Key Findings of Weekly ET Site Inspections in this reporting month Summary of environmental licensing and permit status Summary of Environmental Complaints and Prosecutions Actual amounts of waste generated in this reporting month



ENA44463 Monthly EM&A Report No.31

#### **EXECUTIVE SUMMARY**

This monthly Environmental Monitoring and Audit (EM&A) report No.31 was prepared by Environmental Team (ET) of ETS-Testconsult Ltd (ETL) for the "Contract No. CV/2021/09 Handling of Surplus Public Fill (2022-2023) — Tuen Mun (TM) Area 38 Fill Bank" (The Project).

This report documented the findings of EM&A Works conducted during the operation phase of Fill Bank at TM Area 38 in July 2024.

#### Site Activities

As informed by the Contractor, the site activities in this reporting period were as below:

- 1. Operation of the Public Fill Reception Facilities at Tuen Mun Fill Bank (TMFB);
- 2. Operation of the Integrated Public Fill Reception Platform (Fixed Rigid Platform) at TMFB;
- 3. Operation and Maintenance of Wheel Washing Bays and Facilities at TMFB;
- 4. Operation and Maintenance of Wash House at TMFB:
- 5. Personnel Position Tracking and Proximity Detection System of Moving Plant at TMFB;
- 6. Operation and Maintenance a Digital Works Supervision System (DWSS) for TMFB:
- 7. Operation of a New Soil Platform for Preliminary Sorting of Public Fill at TMFB;
- 8. Operation of Concrete Slab at Wet Deposition Platform in TMFB
- 9. Operation and Maintenance of Crushing plant at TMFB;
- 10. Delivery of public fill to Taishan at TMFB;
- 11. Operation of Al System for Crushing Plant at TMFB
- 12. Implementation of C Easy system at TMFB (phase 1)
- 13. Carry out GCO Probe test and SRT
- 14. Operation of recycling public fill as blanket layer material of reclamation projects PMI No.70
- 15. Relocation works of soil platforms
- 16. Operation of new Integrated Public Fill Reception Platform at TMFB

#### **Environmental Monitoring Progress**

The summary of the monitoring activities in this monitoring month is listed below:

- 24-hour TSP Monitoring: 5 Occasions at 2 designated locations
- 1-hour TSP Monitoring: 15 Occasions at 2 designated locations
- Noise, Daytime: 9 Occasions at 2 designated locations
- Marine Water Quality Monitoring: 14 Occasions at 4 designated locations
- Weekly-site inspection: 5 Occasions

#### Air Monitoring

No exceedance of Action and Limit level was recorded for 1-hr and 24-hr TSP monitoring in the reporting period.

#### Noise Monitoring

No exceedance of Action and Limit level for noise monitoring was recorded in the reporting period.

#### Marine Water Quality Monitoring

No exceedance of action and limit level was recorded in the reporting period.

#### Weekly Site Inspection

In general, performance on environmental mitigation measures implemented was found to be satisfactory in this reporting period. The major findings observed during site inspections are presented in the Section 7.0.

#### Environmental Complaints, Notification of summons and successful prosecutions

No complaint, notification of summon and prosecution with respect to environmental issues was received in this reporting period.



ENA44463 Monthly EM&A Report No.31

#### Future Key Issues

Based on the site inspections and forecast of engineering works in the coming month, key issues to be considered are as follows:

- Dust generation from activities on site, such as vehicular movements along unpaved area and rock crushing activities;
- Noise impact from operating equipment and machinery on site; Wastewater and surface runoff from the site discharged into nearby water body; and
- Storage and usage of chemicals / fuel and chemical waste / waste oil.

ENA44463 Monthly EM&A Report No.31

#### 1.0 INTRODUCTION

China Harbour Engineering Co Ltd (CHEC) appointed Environmental Team (ET) of ETS-Testconsult Limited (ETL) to undertake the Environmental Monitoring and Audit (EM&A) for the "Contract No: CV/2021/09 –Handling of Surplus Public Fill (2022-2023) – Tuen Mun (TM) Area 38 Fill Bank" (The Project).

In accordance with the Condition 4 of Part C of Environmental Permit (No.: EP-210/2005/F) (the EP), an EM&A programme as set out in the Project Profile should be implemented.

The EM&A programme requires environmental monitoring for air quality, water quality and environmental site inspections for air quality, water quality, landscape and visual, and waste management. The EM&A requirements for each parameter described in the following sections include:

- All monitoring parameters;
- Monitoring schedules for the reporting month and the coming months;
- Action and Limit levels for all environmental parameters;
- Event/Action Plans;
- Environmental mitigation measures, as recommended in the Project Profile; and
- Environmental requirements in contract documents.

Baseline monitoring was completed in May 2003 by Stanger Asia Ltd. Action and Limit Levels were established for air and water quality parameters based on the baseline monitoring results.

This report documented the findings of EM&A Works conducted during the operation phase of Fill Bank at Tuen Mun Area 38 in July 2024.

#### 2.0 PROJECT INFORMATION

#### 2.1 Construction Programme

Details of construction programme are shown in Appendix G.

#### 2.2 Project Organization and Management Structure

The organization chart and lines of communication with respect to the on-site environmental management and monitoring program are shown in Appendix A.

#### 2.3 Contact Details of Key Personnel

The key personnel contact names and telephone numbers are shown in Table 2.1.

Table 2.1 Contact Details of Key Personnel

Table 2.1 Contact L	octails of itey i craomic			
Organization	Name of Key Staff	Project Role	Tel. No.	Fax No.
CEDD	Mr. C W Au Yeung, Andrew Cheung	Engineer's Representative	2623 9267 / 2762 5588	2714 0113
IEC (Umwelt)	Mr. Ivan Ting	IEC	3756 9590	3582 3310
Contractor (CHZH-JV)	Zhou Chang Ying	Senior Project Manager	96266299	22474108
ET (ETL)	C. L. Lau	ET Leader	2946 7791	2695 3944

July 2024 Page 1 of 14



ENA44463 Monthly EM&A Report No.31

#### 3.0 CONSTRUCTION PROGRESS IN THIS REPORTING MONTH

As informed by the Contractor, the activities in the reporting month include:

- 1. Operation of the Public Fill Reception Facilities at Tuen Mun Fill Bank (TMFB);
- 2. Operation of the Integrated Public Fill Reception Platform (Fixed Rigid Platform) at TMFB;
- 3. Operation and Maintenance of Wheel Washing Bays and Facilities at TMFB;
- 4. Operation and Maintenance of Wash House at TMFB;
- 5. Personnel Position Tracking and Proximity Detection System of Moving Plant at TMFB;
- 6. Operation and Maintenance a Digital Works Supervision System (DWSS) for TMFB;
- Operation of a New Soil Platform for Preliminary Sorting of Public Fill at TMFB;
- 8. Operation of Concrete Slab at Wet Deposition Platform in TMFB
- Operation and Maintenance of Crushing plant at TMFB;
- 10. Delivery of public fill to Taishan at TMFB;
- 11. Operation of Al System for Crushing Plant at TMFB
- 12. Implementation of C Easy system at TMFB (phase 1)
- 13. Carry out GCO Probe test and SRT
- 14. Operation of recycling public fill as blanket layer material of reclamation projects PMI No.70
- 15. Relocation works of soil platforms
- 16. Operation of new Integrated Public Fill Reception Platform at TMFB

#### 4.0 AIR QUALITY MONITORING

#### 4.1 Monitoring Requirement

1-hr and 24-hr TSP levels were monitored in the reporting month. Table 4.3 shows the Action and Limit Levels for the environmental monitoring works.

#### 4.2 Monitoring Equipment

Both 1-hour and 24-hour TSP air quality monitoring was performed using a High Volume Air Sampler (HVS) located at each of the designated monitoring station. Table 4.1 summarizes the equipment used in the air quality monitoring programme. Copies of the calibration certificates for the HVS and calibrator are attached in Appendix B1.

Table 4.1 Air Quality Monitoring Equipment

Equipment	Model and Make
HVS	Graseby GMW 2484 & 1180
Calibrator	Tisch TE-5025A 4128

#### 4.3 Monitoring Parameters, Frequency and Duration

Table 4.2 summarizes the monitoring parameters, monitoring duration and frequencies of air quality monitoring.

Table 4.2 Monitoring parameters, duration, frequency of air quality monitoring

Parameter	Duration	Frequency
24-hr TSP	24 hr	Once per six days
1-hr TSP	1 hr	Three times per six days

#### 4.4 Monitoring Locations and Schedule

In accordance with the Project Profile, two air-quality monitoring stations, namely TM-A1 and TM-A2, were selected for the 1-hr TSP and 24-hr TSP sampling.

Since the area for existing air monitoring station TM-A2 near Tipping Hall No.1 was handed over to EcoPark, air monitoring station TM-A2 was cancelled and the air monitoring was carried out at an alternative air monitoring station TM-RA2 (refer to Figure 1 attached) from 28 October 2008.

The locations of monitoring stations are shown in Figure 1.



ENA44463 Monthly EM&A Report No.31

During the reporting month, 1-hr and 24-hr TSP monitoring were carried out as the schedule. The details for 24-hr and 1-hr TSP monitoring carried out in this reporting month are summarized in Appendix B2.

#### 4.5 Monitoring Methodology

#### Both 1-hr and 24-hr air quality monitoring (High Volume Sampler)

#### Instrumentation

High volume sampler (HVS) complete with appropriate sampling inlets were employed for both 1-hour and 24-hour TSP monitoring. The sampler is composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complies with that required by USEPA standard Title 40, Code of Federation Regulations Chapter 1 (Part 50).

#### Installation

The installation of HVS refers to the requirement stated in Appendix D2 "General Technical Requirements of Environmental Monitoring" in the Environmental Monitoring and Audit Guidelines for Development Projects in Hong Kong published by EPD.

#### Operation/Analytical Procedures

Operating/analytical procedures for the operation of HVS are as below:

- Prior to the commencement of the dust sampling, the flow rate of the high volume sampler was
  properly set (between 0.6m³/min and 1.7m³/min.) in accordance with the manufacturer's
  instruction to within the range recommended in USEPA Standard Title 40, CFR Part 50. The
  flow rate is indicated on the flow rate chart.
- For TSP sampling, fiberglass filters (GA-55) were used.
- The power supply was checked to ensure the sampler worked properly.
- On sampling, the sampler was operated 5 minutes to establish thermal equilibrium before placing any filter media at designated air monitoring station.
- The filter holding frame was then removed by loosening the four nuts and carefully a weighted and conditioned filter was centered with the stamped number upwards, on a supporting screen.
- The filter was aligned on the screen so that the gasket formed an air-tight seal on the outer edges of the filter. Then the filter holder frame was tightened to the filter holder with swing bolts. The applied pressure should be sufficient to avoid air leakage at the edges.
- The programmable timer will be set for a sampling period of 1 hour / 24 hours. Information was
  recorded on the record sheet, which included the starting time, the weather condition and the
  filter number (the initial weight of the filter paper can be found out by using the filter number.).
- After sampling, the filter was transferred from the filter holder of the HVS to a sealed plastic bag and sent to the laboratory for weighting. The elapsed time was also recoded.
- Before weighting, all filters were conditioned in a desiccator for 24 hour with the temperature of 25°C ± 3°C and the relative humidity (RH) <50% ±5%.</li>

#### Maintenance & Calibration

- The HVS and their accessories should be maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
- HVS should be calibrated at bi-monthly intervals.

#### Wind Data Monitoring

Wind data included wind speed and wind direction were directly extracted from Tuen Mun Station of Hong Kong Observatory during this reporting month. The wind data are presented in Appendix E.

July 2024 Page 3 of 14

ENA44463 Monthly EM&A Report No.31

#### 4.6 Action and Limit Levels

Table 4.3 shows the Action and Limit levels for 24-hr TSP and 1-hr TSP monitoring.

Table 4.3 Action and Limit Levels for 24-hr TSP and 1-hr TSP

Monitoring	24-hr TSP (μg/m³)		Monitoring 24-hr TSP ( $\mu g/m^3$ ) 1-hr TSP ( $\mu g/m^3$ )		) (μg/m³)
Location	Action Level	Limit Level	Action Level	Limit Level	
TM-A1	192	260	344	500	
TM-RA2 *	192	260	344	500	

Remark (\*): Since the area for existing air monitoring station TM-A2 near Tipping Hall No.1 was handed over to EcoPark, air monitoring station TM-A2 was cancelled and the air monitoring was carried out at an alternative air monitoring station TM-RA2 from 28 October 2008. Since dust monitoring stations TM-A2 and TM-RA2 are located close to the major dust emission sources and no significant difference between them on the prevailing meteorological conditions, the baseline data from TM-A2 can also be valid in the case of TM-RA2.

#### 4.7 Event-Action Plans

Please refer to Appendix F for details.

#### 4.8 Results and Observations

All monitoring data of both 1-hr and 24-hr TSP monitoring is provided in Appendix B2. Graphical presentation of 1-hr and 24-hr TSP monitoring results for the reporting period is shown in Appendix B3. Wind data, including wind speed and wind direction, are annexed in Appendix E.

No exceedance of Action and Limit level was recorded for 1-hr and 24-hr TSP monitoring in the reporting month.

Generally, the Contractor implemented sufficient dust mitigation measures, including operation of wheel washing facilities and road dampening by water bowsers on the main haul roads and unpaved areas.

The monitoring results for 1-hr TSP and 24-hr TSP are summarized in Table 4.4 and 4.5 respectively.

Table 4.4 Summary of 1-hr TSP monitoring results

Monitoring Location	Average (µg/m3)	Range (µg/m3)	Action Level (µg/m3)	Limit Level (µg/m3)
TM-A1	232	225-238	344	500
TM-RA2	235	228-241	344	500

Table 4.5 Summary of 24-hr TSP monitoring results

Monitoring Location	Average (μg/m3)	Range (μg/m3)	Action Level (µg/m3)	Limit Level (µg/m3)
TM-A1	125	121-129	400	260
TM-RA2	128	124-132	192	260

#### 5.0 MARINE WATER QUALITY MONITORING

#### 5.1 Monitoring Requirements

In accordance with the Project Profile, impact marine water quality monitoring was conducted three days per week. Measurements were taken at both mid-flood and mid-ebb tides at three depths (i.e. 1m below surface, mid depth and 1m from seabed) at two control monitoring stations (TM-FC1 and TM-FC2) and two impact monitoring stations (TM-FM1and TM-FM2).

July 2024



ENA44463 Monthly EM&A Report No.31

#### 5.2 Monitoring Locations

As stipulated in the EM&A requirement, there were four monitoring stations undertaken during the impact monitoring. Figure 2 shows the locations of the marine water quality monitoring stations.

#### 5.3 Monitoring Parameters and Frequency

Monitoring of the marine water quality parameters and frequency are listed in Table 5.1.

Table 5.1 Monitoring Parameters and Frequency of the marine water

Monitoring Station	Parameter	Frequency	No. of Depths
	Depth (m)		
Control Stations:	Temperature (°C)		
TM-FC1 (Mid-ebb) and TM-FC2 (Mid-flood)	Dissolved Oxygen	3 days/week,	3
11VI-FC2 (1VIId-1100d)	(mg/L and % saturation)	ion) 2 tides/day	(Surface, mid-
Impact Stations:	Turbidity (NTU)	2 lides/day	depth & bottom)
TM-FM1 and TM-FM2	Salinity (ppt)		
/// /// d//d //// ///	Suspended solids (mg/L)		

#### 5.4 Monitoring Methodology and Equipment Used

#### For Location of the monitoring stations

#### Global Positing System (GPS)

A hand-held digital GPS was used to identify the designated monitoring stations prior to water sampling.

#### For Water Depth measurement

#### Echo Sounder

A portable, battery-operated echo sounder was used for the determination of water depth at each designated monitoring station.

#### For In-situ Water Quality Measurement

All in-situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme before use, and subsequently recalibrated at 3 monthly intervals or sometimes longer throughout all stages of the water quality monitoring.

#### Dissolved Oxygen, Salinity, Turbidity and Temperature Measuring Equipment

A portable, weatherproof multiparameter water quality meter (YSI Pro DSS) which complete with cable, sensor and DC power source were used for measuring DO, turbidity, salinity, pH and temperature:

- a dissolved oxygen level in the range of 0 to 50 mg/L and 0-500 % saturation;
- ■a turbidity in range 0-4000 NTU;
- a salinity in range 0-70 ppt;
- ■a temperature of -5-70 degree Celsius

A membrane electrode with automatic temperature compensation complete with a cable was installed.

#### For Water Sampling and Sample Analysis

In-situ monitoring was carried out at three depths: 1 meter below water surface, at mid-depth and 1 meter above the seabed. At each sampling depth, duplicate readings of dissolved oxygen content and turbidity were taken. The probes were drop into water, two consecutive measurements of

July 2024 Page 5 of 14



ENA44463 Monthly EM&A Report No.31

dissolved oxygen (DO), dissolved oxygen saturation (DOS), turbidity and salinity were taken. The difference between the two readings of each set was more than 25% of the value of the first reading while a third measurement would be conducted to ensure data precision.

#### Water Sampler

A water sampler comprising a transparent PVC cylinder, with a capacity of not less than 2 liters, was lowered into the water body at the predetermined depth. The both opening ends of the sampler were then closed accordingly by dead weight and water samples were collected.

#### **Water Container**

The sample container, made by high-density polythene, was rinsed with a portion of the water sample. The water sample was then transferred to the container, labeled with a unique sample ID and sealed with a screw cap. The water samples were stored in a cool box maintained at 4°C. The water samples were then delivered to a local HOKLAS-accredited laboratory (Environmental Laboratory, ETS-Testconsult Ltd, HOKLAS Registration No. 022) on the same day for analysis.

The summary of testing method of testing parameter as recommended by EIA or required by EPD, with the QA/QC results in accordance with the requirement of HOKLAS or international accredited scheme is shown in Table 5.2. For the QA/QC procedures, one QC sample, one duplicate sample and one sample spike of every batch of 20 samples were analysis. The QA/QC results are summarized in Appendix N.

Table 5.2 Summary of testing procedure

Laboratory Analysis	Testing Procedure	Detection Limit
Total suspended solids	In house method based on APHA 19 <sup>th</sup> ed 2540D	1.0 mg/L

#### In-situ measurement

All in-situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme before use. Responses of sensors and electrodes were checked with certified standard solutions before each use. The DO sensor was calibrated by wet bulb method and a zero check in distilled water was performed with the turbidity and salinity sensor before the strat of measurement.

At each measurement/sampling depth, two consecutive measurements of dissolved oxygen (DO), dissolved oxygen saturation (DOS), turbidity and salinity were taken. For DO, DOS, Turbidity and Salinity, measurements were conducted three days per week at both mid-ebb and mid-flood tides at three depths (i.e. 1m below surface, mid depth and 1m from seabed). The duplicate measurements were averaged if the difference was not greater than 25%. If the difference is greater than 25%, repeat measurement will be required to be carried out.

Table 5.3 shows the equipment used for in-situ monitoring of water quality. The calibration certificates are attached in Appendix C1.

Table 5.3 Details of Marine Water Quality Monitoring Equipment (In-site measurement)

Parameter	Model	Date of Calibration	Due Date	Equipment No.
Coordinate of Monitoring stations	Garmin eTrex 10		(Martin)	ET/EW/005/09
Dissolved Oxygen (Saturation), Temperature, Salinity, Turbidity	YSI Pro DSS Multiparameter Water Quality Meter	28/5/24	27/8/24	ET/EW/008/010*
Water Depth	Speedtech SM- 5		NAME OF THE PERSON OF THE PERS	ET/EW/002/08

Remark: Indicates the instrument should be calibrated on site.

ENA44463 Monthly EM&A Report No.31

#### 5.5 Action and Limit Levels

The water quality criteria, namely Action and Limit (A/L) levels are presented in the table below.

Table 5.4Water Quality Action and Limit Levels

Table 3.4 Water C	Quality Action and Elimit Levels	
Parameter	Action Level	Limit Level
DO (mg/L)	Surface & Middle	Surface & Middle
	<4.78 mg/L (5%-ile of baseline data)	<4.00 mg/L (1%-ile of baseline data)
	<u>Bottom</u>	<u>Bottom</u>
	<4.16 mg/L (5%-ile of baseline data)	<2.00 mg/L
SS (mg/L)	>120% of the upstream control station's	>130% of the upstream control station's
(Depth-	SS at the same tide on the same day	SS at the same tide on the same day
averaged)		
Turbidity (NTU)	>120% of the upstream control station's	>130% of the upstream control station's
(Depth-	turbidity at the same tide on the same	turbidity at the same tide on the same
averaged)	day	day

#### 5.6 Event and Action Plan

Please refer to the Appendix F for details.

#### 5.7 Monitoring Duration and Period in this reporting period

Table 5.5 is the time schedule for the marine water quality monitoring events that were conducted in this reporting period. Duration of marine water quality monitoring is detailed in Appendix C2.

Table 5.5 Time Schedule of Marine Water Quality Monitoring

		July-2024			
Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
1	2	3	4	5	6
8	9	10	11	12	13
15	16	17	18	▼ 19	20
22	23	24	25	▼ 26	27
29	▼ 30	31	,		
	1 8 15 22	1 2 8 9 15 16 22 23	Monday         Tuesday         Wednesday           1         2         3           8         9         10           15         16         17           22         23         24	Monday         Tuesday         Wednesday         Thursday           1         2         3         4           8         9         10         11           15         16         17         18           22         23         24         25	Monday         Tuesday         Wednesday         Thursday         Friday           1         2         3         4         5           8         9         10         11         12           15         16         17         18         19           22         23         24         25         26

Remark: (▼) = Marine water quality monitoring carried out by ET

#### Marine Water Quality Monitoring Results

The impact water quality measurement results are detailed in Appendix C2. Appendix C3 presents the water quality monitoring data and graphical presentations of monitoring results respectively. The summary of marine water quality exceedances is shown in Table 5.6.

Table 5.6 Summary of Marine Water Quality Exceedances in this reporting period

Table 5.0		lary or Marine	DO			J	
Tide	Station	Exceedance Level	Surface & Middle	Bottom	Turbidity	SS	Total
	T04 C044	Action	0	0	0	0	0
M:	TM-FM1	Limit	0	0	0	0	0
Mid-Ebb	TA 4 5 1 4 0	Action	0	0	0	0	0
	TM-FM2	Limit	0	0	0	0	0
Mid-	TM-FM1	Action	0	0	0	0	0

July 2024 Page 7 of 14



ENA44463 Monthly EM&A Report No.31

Flood		Limit	0	0	0	0	0
	TM-FM2	Action	0	0	0	0	0
	I IVI-FIVIZ	Limit	0	0 0	0	0	0
7	otal	Action	0	0	0	0	0
1	Ulai	Limit	0	0	0	0	0

According to the summary of marine water monitoring results, no exceedance of action and limit level was recorded in this reporting month.

#### 6.0 Noise Monitoring

#### 6.1 Monitoring Requirements

Noise monitoring was conducted at 2 designated monitoring stations as specified in the Sections 25.10A of the Particular Specification for good site practice.

The equipment, parameter, frequency, duration, methodology, calibration details, results and observations of the noise monitoring for the reporting month are presented in this section.

#### 6.2 Monitoring Equipment

An Integrating Sound Level Meter was used for noise monitoring. It was a Type 1 sound level meter capable of giving a continuous readout of the noise level reading including equivalent continuous sound pressure level ( $L_{eq}$ ) and percentile sound pressure level ( $L_{x}$ ). It complies with International Electro Technical Commission Publications IEC 61672 Type 1 specification, and speed in m/s was used to monitor the wind speed.

Table 6.1 summarizes noise monitoring equipment model being used. A copy of the calibration certificate for noise meter and calibrator are attached in Appendix D1.

Table 6.1 Noise Monitoring Equipment

3 - 4	APTO-STA
Equipment	Model
Sound Level Meter	Rion NL-52 / Rion NL-31
Calibrator	Rion NC-73

#### 6.3 Monitoring Parameters, Duration and Frequency

Duration, frequencies and parameters of noise measurement are presented in Table 6.2.

Table 6.2 Duration, Frequencies and Parameters of Noise Monitoring

Time period	Duration/min	Parameters	Frequency
Day-time: 0700-1900 hrs on normal weekday	30	Leq, L10, L90	Twice per week

#### 6.4 Monitoring Locations and Period

Since Lands Dept did not approve to carry out noise monitoring at their own area where the noise monitoring stations TM-N1 and TM-N2 located due to the security, noise monitoring carried out at two noise monitoring stations TM-RN1 and TM-RN2 (refer to the figure 3 attached) from 18 December 2007.

The noise monitoring locations, TM-RN1 and TM-RN2 are shown in Figure 3. The noise measurement at TM-RN1 and TM-RN2 are façade measurement.

The noise-monitoring period of monitoring stations is summarized in Appendix D2.

#### 6.5 Monitoring Procedures and Calibration Details

#### Operation/Analysis Procedures

The Sound Level Meter was set on a tripod at a height of 1.2m above the ground.



ENA44463 Monthly EM&A Report No.31

- For free field measurement, the meter was positioned away from any nearby reflective surfaces.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:

Frequency weighting: A
Time weighting: Fast
Time measurement: 30 min

- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94 dB at 1000HZ. If the difference in the calibration level before and after measurement was more than 1dB, the measurement would be considered invalid and repeat measurement would be required after re-calibration or repair of the equipment.
- The wind speed was frequently checked with a portable wind meter.
- During the monitoring period, the Leq, L10 and L90 were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- Free Field correction to the measurements should be made. Correction factor of +3dB(A) should be made to the free Field measurements. Noise monitoring would be cancelled in the presence of fog, rain, wind with a steady speed exceeding 5m/s, or wind gusts exceeding 10m/s.

#### Maintenance and Calibration

- The microphone head of the sound level meter and calibrator are cleaned with soft cloth in quarterly intervals.
- The meter is sent to the supplier or HOKLAS laboratory to check and calibrated in yearly intervals.

#### 6.6 Action and Limit Levels

The Action and Limit levels for noise levels derived as illustrated in Table 6.3.

Table 6.3 Action and Limit Levels for noise monitoring

Time Period	Action	Limit
0700-1900 hrs on normal weekdays	When one documented complaint is received	65 dB(A)

#### 6.7 Event-Action Plans

Please refer to the Appendix F for details.

#### 6.8 Results and Observation

The detail of the noise monitoring is provided in Appendix D2. Graphical presentation of the monitoring result for the reporting period is shown in Appendix D3.

Since no documented complaint on noise issue was received in this reporting period, no Action Level exceedance was recorded. Besides, no exceedance in Limit Level was recorded according to the result from Day-time noise monitoring.

The major sources of noise pollution observed in this reporting month were noise from the traveling dump trucks and from the operation of site machines.

July 2024 Page 9 of 14



ENA44463 Monthly EM&A Report No.31

#### 7.0 ENVIRONMENTAL AUDIT

#### 7.1 Weekly ET Site Inspections and EPD's Site Inspection

#### 7.1.1 Weekly ET Site Inspections

Weekly site inspections were carried out by ET to monitor the timely implementation of proper environmental pollution control and mitigation measures for the Project. In this reporting month, five weekly site inspections were conducted on 04, 11, 18, 25 and 29 July 2024. Summaries of key findings of weekly ET site inspections in this month are described in Table 7.1.

Table 7.1 Key Findings of Weekly ET Site Inspections in this reporting month

Table 1.1	Rey i indings of weekly L	. I Olle mapecuona in un	s reporting month	
Date	Key Findings	Action(s) Taken recommended by ET	Action(s) Taken by the Contractor	Rectification Status by ET
		recommended by E1	during the site audit	Status by L1
04			aumig me ene aaan	
July	No defective work or obse	ervation was recorded durir	ng the weekly ET site i	nspection
2024			•	,
11				
July	No defective work or obse	ervation was recorded durir	ng the weekly ET site i	nspection
2024				
18				
July	No defective work or obse	ervation was recorded durii	ng the weekly ET site i	inspection
2024				
25				
July	No defective work or obse	ervation was recorded durii	ng the weekly ET site i	inspection
2024				•
29				
July	No defective work or obse	ervation was recorded durii	ng the weekly ET site i	inspection
2024				•

#### 7.1.2 The State of Air Quality Control of 3RS area in TMFB

As there was the concern about the dust emission in the 3RS collection area of TMFB, EPD arranged a joint site inspection on 06 October 2022 and the contractor carried out mitigation measures, including increasing the frequency of water spraying by water lorries, setting up water spraying machine in the 3RS area and providing cleaning at the site haul road, to minimize the dust emission. The location of 3RS and discharge point would be inspected in every weekly environmental audit.

#### 7.1.3 EPD's Site Inspection

EPD's site inspection was carried out on 17 July 2024 in this reporting period.

#### 7.2 Review of Environmental Monitoring Procedures

The monitoring works conducted by the ET were inspected internally on a regular basis. The following observations have been recorded for the monitoring works:

#### Air Quality Monitoring

- The monitoring team recorded the observations around the monitoring stations within and outside of the construction site.
- The monitoring team recorded the temperature, air pressure and general weather condition on the monitoring day.

#### Water Quality Monitoring

- The monitoring team recorded the observations around the monitoring stations, which might affect the results; and
- Major water pollution sources were identified and recorded.

July 2024 Page 10 of 14

ENA44463 Monthly EM&A Report No.31

#### Noise Monitoring

- The monitoring team recorded the observations around the monitoring station, which might affect the results.
- Major noise sources were identified and recorded.

#### 7.3 Status of Environmental Licensing and Permitting

All permits/licenses valid in this reporting month are summarized in Table 7.2.

Table 7.2 Summary of environmental licensing and permit status

Description	Permit No.		Period	Section
		From	То	1
Environmental Permit	EP- 210/2005/F	01/01/24		Issued
Chemical Waste Registration	5296-421- C1186-33	20/04/17		Spent battery containing heavy metals and spent lubricating oil
Effluent Discharge License	WT0004275 5-2022		29/02/28	dust suppression activities and contaminated surface runoff treated by screening facilities and sedimentation tanks (sedimentation and chemical precipitation).
Marine Dumping Permit	EP/MD/25- 005	01/07/24	30/09/24	Approval for dumping 499,999 tons (approximately equal to 277,777 cu.m. bulked quantity) of Public Fill (Reclamation Materials) from Tseung Kwan O Area 137 Fill Bank and Tuen Mun Area 38 Fill Bank to designated dumping area at Guanghaiwan of Taishan
Billing Account for Waste Disposal	7042821	22/05/17	H5523	
Notification Pursuant to Section 3(1) of the Air Pollution Control (Construction Dust)	475208	12/04/17		ST.

#### 7.4 Implementation Status

#### 7.4.1 Implementation Status of Environmental Mitigation Measures

An updated summary of the Environmental Mitigation Implementation Schedule (EMIS) is presented in Appendix I. Most of the necessary mitigation measures were implemented properly.

#### 7.4.2 Implementation Status of Event and Action Plan

No exceedance of Action and Limit levels was recorded for 1-hr and 24-hr TSP monitoring in the reporting month. Apart from this, there was no exceedance on noise recorded in this month.

According to the marine water monitoring results, no action-level and limit-level exceedance was recorded in this reporting period.

Hence, no further action was required to be implemented.

## 7.4.3 Implementation Status of Environmental Complaint, Notification of Summon and Successful Prosecution Handling

No complaint, notification of summon and prosecution with respect to environmental issues was received in this reporting period.

July 2024 Page 11 of 14



ENA44463 Monthly EM&A Report No.31

A summary of environmental complaints, notifications of summons and successful prosecutions was given in Table 7.3.

Table 7.3 Summary of Environmental Complaints and Prosecutions

Complaints	logged	Summons served Successful Prose		osecution	
July 2024	Cumulative	July 2024	Cumulative	July 2024	Cumulative
0	8	0	0	0	0

#### 8.0 LANDSCAPE AND VISUAL

Landscape and visual site audit were carried out on a weekly basis to monitor environmental issues in order to ensure that all mitigation measures were implemented timely and properly. The findings in this reporting period were:

- The maximum stockpiling height at the Fill Bank was limited to a maximum of +65.2 mPD;
- The Contractor hydroseeded the outer slopes of the Fill Bank as far as practicable;
- The Contractor removed the stockpile of public fill in a sequence to allow the outer hydroseeded to be removed later than other portions as far as practicable; and
- Lighting was set to minimize night-time glare.

#### 9.0 WASTE MANAGEMENT

#### 9.1 Summary of Waste disposed of in this period

The actual amounts of different types of waste disposed of by the activities of the Project in the period are shown in Table 9.1 and the Monthly Summary Waste Flow Table is shown in Appendix K.

Table 9.1 Actual amounts of Waste generated in this reporting month

Waste Type	Actual Amount	Disposal Locations
Public Fill ('000m³)	0	Tuen Mun 38 Fill Bank
C&D Waste (Others – e.g. general refuse) ('000kg)	35.7	WENT Landfill
Chemical Waste (kg)/(L)	0(L)	Collected by licensed collector

#### 9.2 Advice on the Solid and Liquid Waste Management Status

The Contractor should provide sufficient preventive measures during equipment maintenance works so as to avoid oil leakage on the ground. In the event of any oil leakage, the Contractor should clean up the polluted soil and handle all the materials used for this cleaning works as chemical waste.

The drain outlet of all the bunded areas should be plugged properly. Besides, pre-cast drip trays were provided for oil drums at several areas, such as workshop and chemical storage area. The Contractor should collect and dispose of any stagnant water accumulated in the concrete bunding and drip trays and handle them as chemical waste.

The Contractor should use suitable containers with proper labels to store chemical wastes in accordance with Code of Practice on the Packaging, Labeling and Storage of Chemical Waste. The Contractor should also advise their workers of the proper procedures in handling the chemical waste. All the trip tickets for chemical waste disposal should be properly kept in the site office.

The Contractor was reminded to increase the frequency of inspection and cleaning of the site drainage system, including permanent desilting chambers, desilting facilities, oil interceptor bypass tank and all the trapezoidal channels. Moreover, the Contractor should apply approved pesticides in the stagnant water ponds.

All the runoff from the parking area should be pumped to the desilting facilities and oil interceptors to remove suspended solids and oil & grease prior to discharge.

July 2024



ENA44463 Monthly EM&A Report No.31

All the discharge measures were managed under Effluent Discharge License. No discharge is allowed before the approval of discharge permit.

#### 10.0 ENVIRONMENTAL NON-CONFORMANCE

#### 10.1 Summary of air quality, noise and marine water quality

No exceedance of Action and Limit level was recorded for 1-hr and 24-hr TSP monitoring in the reporting period.

According to the marine water monitoring results, no action-level and limit-level exceedance was recorded in the reporting period.

The noise level measured at the monitoring station complied with the Limit Level of 65dB(A). No complaint was received regarding noise issue in this reporting period.

#### 10.2 Summary of Environmental Complaints

No complaint was received in this reporting period.

#### 10.3 Summary of Notification of Summons and Prosecution

There was no notification of summon and prosecution respect to environmental issues registered in this reporting period.

#### 11.0 CONCLUSIONS AND RECOMMENDATIONS

#### Conclusions

Impact monitoring of air quality, noise and water quality were carried out at designated locations in this reporting period.

According to the summary of air monitoring results, no exceedance of Action and Limit levels was recorded for 1-hr and 24-hr TSP monitoring in the reporting period.

According to the marine water monitoring results, no action-level and limit-level exceedance was recorded in the reporting period.

The noise level measured at the monitoring station complied with the Limit Level of 65dB(A). No complaint was received regarding noise issue in this reporting period.

According to the weekly site inspections carried out in this reporting period, the Contractor generally implemented sufficient dust mitigation measures, including operation of the mist spraying systems and automatic wheel washing facilities, dampening of haul roads and stockpiling areas.

No complaint, prosecution or notification of summons was received in this reporting period.

#### Recommendations

According to the environmental site inspections performed in the reporting period, the following recommendations were provided:

#### Air Quality

- Ensure the frequency of water spraying on haul roads, unloading areas and stockpiles to be sufficient to suppress the dust sources;
- Provide proper maintenance for the powered mechanical equipment and barges to avoid emission of dark smoke;
- Provide water spraying onto the truckloads during inspection of fill material;
- Conduct road sweeping on all paved haul roads and public roads especially outside and near the site egress by the road sweeper. Undertake water spraying on stockpiling area by water bowser:
- Erect adequate speed limit signs to advise the truck drivers of the speed limit;
- Operate mist spraying systems and automatic water sprinklers in the Fill Bank;



ENA44463 Monthly EM&A Report No.31

- Implement the dust mitigation measures for the construction activities;
- Designate proper haul roads to ensure effective water spraying; and
- Ensure all vehicles to be washed before leaving the site egress by provision, operation and maintenance of automatic wheel washing facilities.

#### Noise

- Conduct noisy activities at a farther location from the NSRs.
- Proper schedule of noisy operation and use of quiet machineries on site.

#### Water Quality

- Maintain the drainage system, including the trapezoidal channels and permanent desilting chambers regularly; and
- Remove the stagnant water or provide approved pesticides for the stagnant water in the permanent desilting chambers, if any.

#### Chemical and Waste Management

- Remove waste materials from the site to avoid accumulation regularly:
- Handle and store chemical wastes properly;
- Remove unwanted material in the existing stockpiles and avoid further dumping of such material:
- Provide and maintain sufficient drip trays for diesel drums, chemical containers, chemical waste storage drums and diesel operated generator set;
- Maintain good housekeeping at the workshop area;
- Ensure sufficient tarpaulin sheets are provided to cover drip trays; and
- Avoid soil being polluted during oil filling and equipment maintenance; hence, properly remove and store the contaminated soil, if any.

#### Landscape and Visual

- Provide hydroseeding on the exposed slopes, on which the final profile has been formed:
- Erect all the site hoarding/chaining fences in accordance with agreed design at proper location;
- Maintain the hydroseeded slopes properly.

#### 12.0 FUTURE KEY ISSUES

Based on the site inspections and forecast of engineering works in the coming month, key issues to be considered are as follows:


- Dust generation from activities on site, such as vehicular movements along unpaved area and rock crushing activities;
- Noise impact from operating equipment and machinery on site;
- Wastewater and surface runoff from the site discharged into nearby water body;
- Regular checking of the drainage system;
- Flood prevention; and
- Noise from operation of the crushing plant.

- END OF REPORT -



## Appendix A

**Project Organization Chart** 

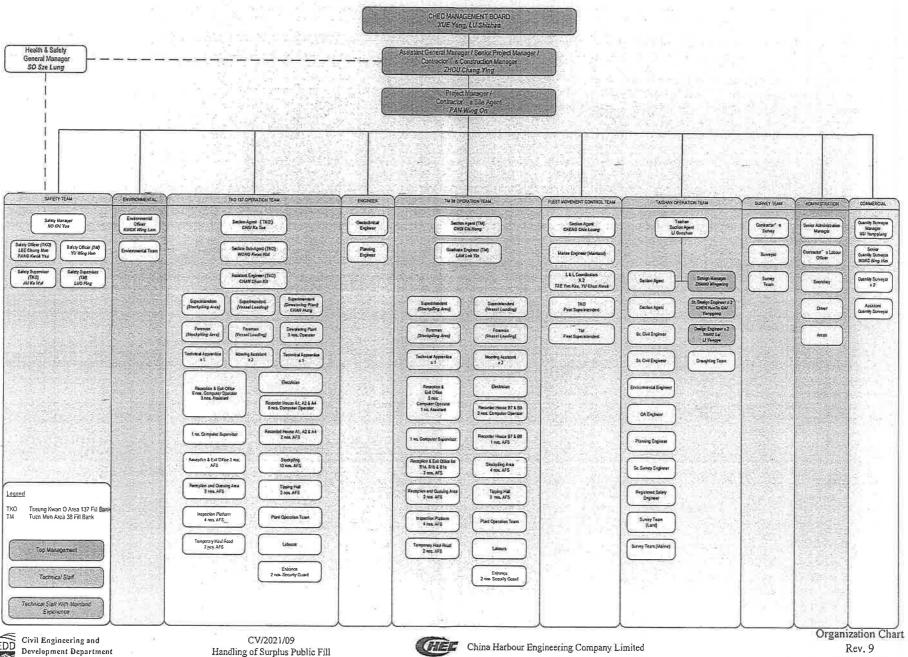



## Appendix B1

Calibration Certificates for Impact Air Quality Monitoring Equipments



RECALIBRATION **DUE DATE:** 

January 15, 2025

**Calibration Certification Information** 

Cal. Date: January 15, 2024

Rootsmeter S/N: 438320

Ta: 295

°K

Operator:

Jim Tisch

Run

2

3

4

Pa: 756.4

mm Hg

Calibration Model #:

TE-5025A

Vol. Init

(m3)

3

5

Calibrator S/N: 4228

Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
2	1	1.4400	3.3	2.00
4	1	1.0250	6.4	4.00
6	1	0.9240	8.0	5.00
8	1	0.8780	8.9	5.50

	THE PARTY OF THE P		A STATE OF THE PARTY OF THE PAR	A. Carrier and Market	The second secon	
8.00	12.8	0.7230	1	10	9	5
	***************************************	on	ata Tabulati			
$\sqrt{\Delta H \left( \text{Ta/Pa} \right)}$ (y-axis)	Qa (x-axis)	Va	)(_Tstd_) Ta_) s)	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right)}$	Qstd (x-axis)	Vstd (m3)
0,8832	0,6914	0.9956	0	1.418	0.6951	1.0010
1.2490	0.9674	0.9915	4	2.005	0.9726	0.9969
1.3964	1.0708	0.9894	1	2.242	1.0766	0.9948
1.4646	1.1256	0.9882	.5	2.351	1.1316	0.9936
1.7664	1.3597	0.9831	1	2,836	1.3671	0.9884
1.32521	m=	7	33	2.1163	m=	77
-0.03025			57	-0.048	b=	QSTD
0.99987			87	0.9998	r=	-

	Calculation	S	
Vstd=	ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va=	ΔVol((Pa-ΔP)/Pa)
Qstd=	Vstd/ΔTime	Qa≖	Va/ΔTime
	For subsequent flow rat	e calculatio	ns:
Qstd=	$1/m\left(\left(\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}\right)-b\right)$	Qa=	1/m((√ΔH(Ta/Pa))-b

	Standard Conditions
Tstd:	298.15 °K
Pstd:	760 mm Hg
	Key
ΔH: calibrator	manometer reading (in H2O)
ΔP: rootsmete	er manometer reading (mm Hg)
Ta: actual abs	olute temperature (°K)
Pa: actual bar	ometric pressure (mm Hg)
b: intercept	
m: slope	


#### RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the **Determination of Suspended Particulate Matter in** the Atmosphere, 9.2.17, page 30

Tisch Environmental, Inc. 145 South Miami Avenue Village of Cleves, OH 45002 www.tisch-env.com

TOLL FREE: (877)263-7610

FAX: (513)467-9009



## 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

eristrong Industrial Centre 34-36 Au Pul Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944

#### TEST REPORT

## **Calibration Report** High Volume Air Sampler

Manufacturer

Graseby GMW

Date of Calibration

15 June 2024

Serial No.

2484 (ET/EA/003/27)

Calibration Due Date

14 August 2024

Method


Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations

Manual

Results

Flow recorder read	ling (cfm)	53	46	41	34	28
Qstd (Actual flow r	ate, m³/min)	1.55	1.40	1.25	1.05	0.86
Pressure:	Temp.:	301	K			

#### Sampler 2484 Calibration Curve Site: Tuen Mun 38 (TM-A1)

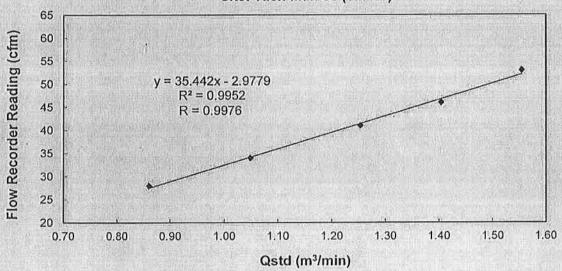

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\*/ unacceptable\* for use.

Calibrated by

(Assistant Supervisor)

Checked by :

LAU, Chi Leung

(Environmental Team Leader)

- END OF REPORT -



## 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pul Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com

#### TEST REPORT

#### <u>Calibration Report</u> of High Volume Air Sampler

Manufacturer

Graseby GMW

Date of Calibration

15 June 2024

Serial No.

: 1180 (ET/EA/003/04)

Calibration Due Date

14 August 2024

Method


Based on Operations Manual for the 5-point calibration using standard calibration kit

manufactured by Tisch TE-5025 A

Results

Flow recorder reading (cfm)	5	3	52	44	33	25
Ostd (Actual flow rate, m³/min)	1.6	64	1.50	1.30	1.08	0.83
Pressure : 753.51	mm Hg		Temp.:	301	K	

#### Sampler 1180 Calibration Curve Site: Tuen Mun (TM-RA2)

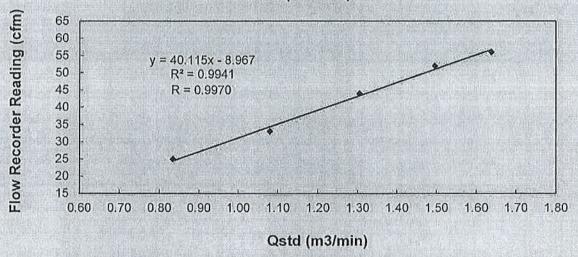

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\* / unacceptable \* for use.

Calibrated by :

MAK, Kei Wai

(Assistant Supervisor)

Checked by

AU, Chi Leung

(Environmental Team Leader)

- END OF REPORT -



## Appendix B2

Impact Air Quality Monitoring Results



## Summary of 24-hr TSP Monitoring Results

Monitoring Station

TM-A1

Sta	art	Fin	nish	Elaps	e Time	Sampling	Flow Rate	(m³/min.)	Average	Filter W	/eight (g)	3
Date	Time	Date	Time	Initial	Final	Time (hrs)	Initial	Final	(m³/min.)	Initial	Final	Conc. (μg/m³)
06/07/24	09:30	07/07/24	09:30	18160.31	18184.31	24.00	1.0715	1.0715	1.0715	2.8113	3.0088	128
12/07/24	08:00	13/07/24	13:20	18187.31	18211.31	24.00	1.0715	1.0715	1.0715	2.7132	2.8999	121
18/07/24	09:00	19/07/24	09:00	18214.31	18238.31	24.00	1.0433	1.0433	1.0433	2.7481	2.9359	125
24/07/24	08:30	25/07/24	08:30	18241.31	18265.31	24.00	1.0433	1.0433	1.0433	2.7344	2.9282	129
30/07/24	09:10	31/07/24	09:10	18268.31	18292.31	24.00	1.0433	1.0433	1.0433	2.7312	2.9175	124

Monitoring Station

TM-RA2

Sta	ırt	Fin	ish	Elaps	e Time	Sampling	Flow Rate	(m³/min.)	Average	Filter W	/eight (g)	0 ( 3
Date	Time	Date	Time	Initial	Final	Time (hrs)	Initial	Final	(m³/min.)	Initial	Final	Conc. (μg/m³)
06/07/24	09:40	07/07/24	09:40	33447.53	33471.53	24.00	1.0711	1.0711	1.0711	2.7634	2.9655	131
12/07/24	08:00	13/07/24	08:00	33474.53	33498.53	24.00	1.0711	1.0711	1.0711	2.7533	2.9446	124
18/07/24	09:05	19/07/24	09:05	33501.53	33525.53	24.00	1.0462	1.0462	1.0462	2.8146	3.0059	127
24/07/24	08:30	25/07/24	08:30	33528.53	33552.53	24.00	1.0462	1.0462	1.0462	2.7538	2.9527	132
30/07/24	09:20	31/07/24	09:20	33555.53	33579.53	24.00	1.0462	1.0462	1.0462	2.7584	2.9497	127



## Summary of 1-hr TSP Monitoring Results

Monitoring Station

TM-A1

MOLITOLITY				T:			. 3		F:14 147	-1	
Date	111	ne	Elapse	Time	Sampling	Flow Rate	e (m³/min.)	Average	Filter vv	eight (g)	Conc. (μg/m³
2 4.13	Start	Finish	Initial	Final	Time (hrs)	Initial	Final	(m³/min.)	Initial	Final	Garrer (pagran
02/07/24	09:20	10:20	18157.31	18158.31	1.00	1.0433	1.0433	1.0433	2.7405	2.7547	227
02/07/24	10:45	11:45	18158.31	18159.31	1.00	1.0433	1.0433	1.0433	2.7530	2.7675	232
04/07/24	08:50	09:50	18159.31	18160.31	1.00	1.0715	1.0715	1.0715	2.7501	2.7648	229
09/07/24	14:10	15:10	18184.31	18185.31	1.00	1.0715	1.0715	1.0715	2.7726	2.7877	235
09/07/24	15:20	16:20	18185.31	18186.31	1.00	1.0715	1.0715	1.0715	2.7089	2.7238	232
11/07/24	13:30	14:30	18186.31	18187.31	1.00	1.0715	1.0715	1.0715	2.7333	2.7479	227
13/07/24	08:50	09:50	18211.31	18212.31	1.00	1.0715	1.0715	1.0715	2.7506	2.7654	230
13/07/24	09:50	10:50	18212.31	18213.31	1.00	1.0715	1.0715	1.0715	2.7623	2.7773	233
16/07/24	09:40	10:40	18213.31	18214.31	1.00	1.0433	1.0433	1.0433	2.6618	2.6760	227
20/07/24	10:10	11:10	18238.31	18239.31	1.00	1.0433	1.0433	1.0433	2.6986	2.7133	235
20/07/24	13:00	14:00	18239.31	18240.31	1.00	1.0433	1.0433	1.0433	2.7523	2.7668	232
22/07/24	09:30	10:30	18240.31	18241.31	1.00	1.0433	1.0433	1.0433	2.7121	2.7270	238
25/07/24	10:15	11:15	18265.31	18266.31	1.00	1.0433	1.0433	1.0433	2.7088	2.7235	235
25/07/24	14:00	15:00	18266.31	18267.31	1.00	1.0433	1.0433	1.0433	2.6989	2.7138	238
27/07/24	10:00	11:00	18267.31	18268.31	1.00	1.0433	1.0433	1.0433	2.7380	2.7521	225



## Summary of 1-hr TSP Monitoring Results

Monitoring Station : TM-RA2


MOHILOHIN	Jolation		1 1 1 1 1	naz							
Date	Tir	me	Elapse	e Time	Sampling	Flow Rate	e (m³/min.)	Average	Filter W	eight (g)	
Date	Start	Finish	Initial	Final	Time (hrs)	Initial	Final	(m³/min.)	Initial	Final	Conc. (μg/m <sup>3</sup>
02/07/24	09:30	10:30	33444.53	33445.53	1.00	1.0462	1.0462	1.0462	2.7487	2.7632	231
02/07/24	10:50	11:50	33445.53	33446.53	1.00	1.0462	1.0462	1.0462	2.6893	2.7041	236
04/07/24	09:00	10:00	33446.53	33447.53	1.00	1.0711	1.0711	1.0711	2.7618	2.7768	233
09/07/24	14:15	15:15	33471.53	33472.53	1.00	1.0711	1.0711	1.0711	2.7407	2.7560	238
09/07/24	15:25	16:25	33472.53	33473.53	1.00	1.0711	1.0711	1.0711	2.7042	2.7194	237
11/07/24	13:40	14:40	33473.53	33474.53	1.00	1.0711	1.0711	1.0711	2.7531	2.7679	230
13/07/24	08:55	09:55	33498.53	33499.53	1.00	1.0711	1.0711	1.0711	2.7379	2.7528	232
13/07/24	09:55	10:55	33499.53	33500.53	1.00	1.0711	1.0711	1.0711	2.7092	2.7244	237
16/07/24	09:55	10:55	33500.53	33501.53	1.00	1.0462	1.0462	1.0462	2.7152	2.7297	231
20/07/24	10:20	11:20	33525.53	33526.53	1.00	1.0462	1.0462	1.0462	2.7089	2.7239	239
20/07/24	13:00	14:00	33526.53	33527.53	1.00	1.0462	1.0462	1.0462	2.7391	2.7539	236
22/07/24	09:35	10:35	33527.53	33528.53	1.00	1.0462	1.0462	1.0462	2.6989	2.7140	241
25/07/24	10:20	11:20	33552.53	33553.53	1.00	1.0462	1.0462	1.0462	2.7233	2.7383	239
25/07/24	14:05	15:05	33553.53	33554.53	1.00	1.0462	1.0462	1.0462	2.7132	2.7283	241
27/07/24	10:05	11:05	33554.53	33555.53	1.00	1.0462	1.0462	1.0462	2.7241	2.7384	228




## Appendix B3

**Graphical Plots of Impact Air Quality Monitoring Data** 

## 1-hour TSP level at TM-A1

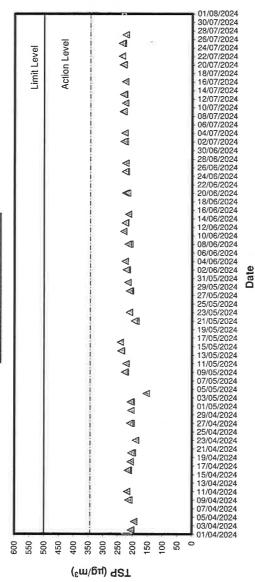


# 1-hour TSP level at TM-RA2

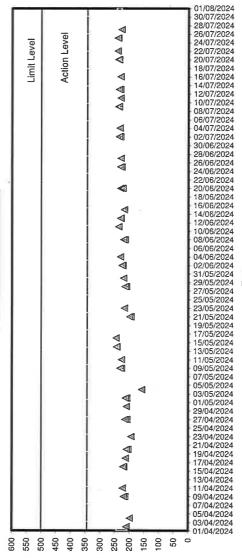


TSP (µg/m3)



## 24-hour TSP level at TM-A1

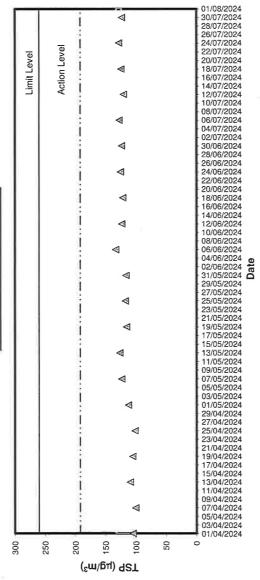

# 24-hour TSP level at TM-RA2

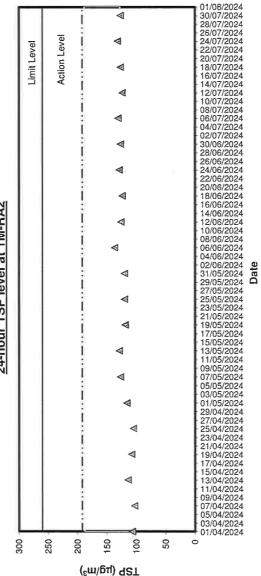



### Appendix C1

Calibration Certificates for Impact Marine Water Quality Monitoring Equipments

## Performance Check / Calibration of Multiparameter Water Quality Meter

Equipment Ref. No. 3

ET/EW/008/010

Manufacturer

YSI

Model No.

Pro DSS

Serial No.

18E105421

Date of Calibration

28/5/2024

Calibration Due Date

27/8/2024

#### Results

#### 1. Temperature

(Method Reference: Section 6 of internation Accreditation New Zealand Technical Guide no. 3 Second edition March 2008:

Working Thermometer Calibration Procedure)

Working Incimometer Cantration Treedaily		
Reading of Reference Thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)
15.6	15.6	+0.0
25,1	25.0	-0.1
29.3	29.5	+0.2

Tolerance Limit (°C): ± 2.0

#### 2. pH

(Method Reference: APHA 19ed 4500-H+B)

Expected Reading (pH unit)	Displayed Reading (pH unit)	Tolerance (pH unit)
4,00		
6.86		
9.18		

Tolerance Limit (pH unit): ± 0.10

#### 3. Conductivity

(Method Reference: APHA 19ed 2510 B)

Expected Reading (µS/cm)	Displayed Reading (µS/cm)	Tolerance (%)
145.2	146.1	+0.6
1414	1436	+1.6
12892	12572	-2.5
56761	57254	+0.9

Tolerance Limit (µS/cm): ± 10.0%

#### 4. Salinity

(Method Reference: APHA 19ed 2520 B)

dictioned in the tree by				
Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)		
10.0	10.10	+1.0		
20.0	20.50	+2,5		
30.0	30.70	+2.3		

Tolerance Limit (g/L): ± 10.0%



#### Performance Check / Calibration of Multiparameter Water Quality Meter

Equipment Ref. No. :

ET/EW/008/010

Manufacturer

YSI

Model No.

Pro DSS

Serial No.

18E105421

Date of Calibration

28/5/2024

Calibration Due Date

27/8/2024

5. Dissolved Oxygen

(Method Reference: APHA 19ed 4500-O G)

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)
1.73	1.64	-0.09
4.62	4.48	-0.14
5.91	6.03	+0.12

Tolerance Limit (mg/L): ± 0.20

6. Turbidity

(Method Reference: APHA 19ed 2130 B)

Expected Reading (NTU)	Displayed Reading (NTU)	Tolerance (%)
10	10.5	+5.00
40	41.1	+2.75
100	104.0	+4.00
400	413.0	+3.25

Tolerance Limit (NTU): ± 10.0%

The equipment complies " / does not comply " with the specified requirements and is deemed acceptable " / unacceptable." for use.

# Delete as appropriate

Calibrated by a

(Technician)

Approved by :

Guy, Kong Ping Ki

(Laboratory Manager)

28/0x/2016



### Appendix C2

**Impact Marine Water Quality Monitoring Results** 

Monitoring Statlon :

TM-FC1



Date	Time	Ambient Temp (°C) /	Monitorl	ng Depth	Temp	Salini	y (ppl)	Dissolv	red Oxygen	(mg/L)		d Oxygen lion (%)	Tu	ırbidily (NT		Susper	ded Solids	s (mg/L)
Dale	Time	Weather Condition		n)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depin-
		30	Surlace	1.0	24.8	19.7 19.8	19.8	6.84	6.83		92.3 91.9	92.1	0.72	0.74	4.5100	3.6	3.8	
02/07/24	16:00:56	1999	Middle	10.9	22.9	27,9	28.0	5,64	5.64	6.23	77_1	77,0	0.96	0.96	1.02	2.0	2,3	2.6
		/ Fine	_			28.0 30.2		5.63 4.92			76.9 66.9		0.95			2.6		
	-		Bollom	20.7	21,9	30.3	30,2	4,90	4.91	4.91	66.8	66,9	1.37	1.36		2.0	1,6	
		30	Surface	1.0	24.5	19.6 19.6	19,6	7.02 6,99	7.01	6.33	94.1 93.8	94,0	0.48	0.50		3.0 2.9	3.0	
04/07/24	17:32:04		Middle	10.5	22.9	27.5 27.5	27.5	5.67	5.66	0.00	77.3 77.1	77.2	0.77	0.76	0.83	5.6 3.9	4.8	3,8
		/ Fine	Boltom	20.2	22,1	30.4	30.4	4.85	4.85	4.85	66.3	66.3	1,21	1.21		3.5	3.7	İ
			Surlana	10	25.0	30.4 25.6	ne e	7.46	7.47	_	66.2 104.4	1010	1.20	0.00		3.8 1.6		
		31	Surface	1.0	25.0	25.6 30.3	25,6	7.47 6.18	7.47	6.82	104.8 86.1	104.6	0.32	0.33	į	1.6	1.6	
06/07/24	19:00:53		Middle	10,5	23.2	30.3	30.3	6.15	6,17		85.7	65.9	0.68	0.66	0,74	1.0	1.4	1.7
		/ Fine	Bollom	19.9	22,4	31.6 31.6	31,6	5.34	5,33	5,33	73.9 73.5	73.7	1,24	1.25		1.3	2,0	
		31	Surface	1.0	25.4	28.6	28.6	6.75	6.74		96.8	96,7	1.10	1.09		5.2	5,1	
09/07/24	8:59:02	31	Middle	11.5	23.2	28.7 31.4	31.4	6.73 5.58	5.57	6.16	96.5 78.2	78,1	1.08	1,41	1.34	5.0 5.8	4.8	5.5
00/0//24	0.00.02	/ Fine		_		31.4	_	5.56 5.17			78.0 71.3	-	1.42	_	1 34	3.7 6.0		3.5
			Boltom	22.0	22.1	31,9	31.9	5.16	5.17	5.17	71.2	71.3	1.53	1.53		7.1	6.6	<u></u>
		30	Surface	1.0	25.0	15.0 14.9	15.0	6.16 6.25	6.21	E 70	81.2 82.5	81.9	1.17	1.20	1	3.6	2.9	
11/07/24	9:19:02		Middle	11.4	21.9	29.8 29.0	29.4	4.81 4.86	4.84	5,52	65.3 65.9	65.6	1.21	1 23	1,33	4.8	3.8	3.0
		/ Fine	Bollom	21.5	21.5	30.8	30.8	4.81	4.73	4.73	65.2	64.2	1.57	1.58		3.2	2,4	
	-		_	_	_	30.8 18.4		4.65 6.84	- 0	4.75	63.2 91.6		1.58 0.77			1.5		
		30	Surface	1.0	24.8	19.5	18.9	6.49	6.67	6.00	87.0	89.3	0.71	0.74		2.8	2.4	
13/07/24	11:26:17		Middle	11,6	22.5	27.6 28.0	27.8	5.35 5.30	5,33		72.5 71.8	72.2	1.27	1.24	1.14	1.2	2.1	2.3
		/ Fine	Bottom	21.8	21.4	31.6 31.6	31.6	4.47 4.41	4.44	4.44	60.8	60.4	1.37	1,44		1.6	2.5	ĺ
			Surface	1.0	25.2	16.5	18,5	7.88	7.88		105.1	105.1	0.63	0.63		5.4	4.4	
		29				16.5 29.4		7.87 6.54	-	7.20	105.0 88.9		0.63			3.3 4.9		
16/07/24	16:36:09	15:	Middle	10.5	22.1	29.4	29,4	6,50	6.52		88.4	88.7	1.12	1,11	0.94	3.9	4.4	4.9
		/ Fine	Bollom	20.1	20.9	33.3 33.3	33.3	4.92 4.88	4.90	4.90	66.4	66.7	1.14	1.10		6.9 4.9	5.9	
		28	Surlace	1.0	25.3	22.9	22.9	7.88 7.86	7.87		109.2	109.1	0.73	0.74	13	5.0 5.1	5.1	
18/07/24	17:46:36		Middle	10.7	22.6	27.8	27.8	8,64	6.63	7.25	90.2	90.1	0.95	0.97	0.92	3.4	3.3	3.9
		/ Fine	D. II.		04.0	27.8 33.1		6,62 5.38			89.9 73.7	_	0.98	_		3.2	_	
			Bollom	20.2	21,3	33.2 18.6	33,1	5.32 7.24	5.35	5,35	72.9 97.3	73,3	1.06	1.06		4.0	3.2	
		30	Surface	1.0	25.6	16.6	16.6	7.23	7,24	7.01	97.0	97.2	0.90	0.91		2.5 5.4	4.0	
20/07/24	18:46:56		Middle	10.5	22.6	28.3	28.4	6.80	6.79	719.	92.7 92.3	92.5	1.02	1.03	1.09	2.1	2.2	2,9
		/ Cloudy	Boltom	19.9	22.1	32.6	32.6	6.35 6.32	6.34	6.34	87.9	87.7	1.35	1.34		2.4	2,5	ĺ
			Surface	1.0	23.4	32.6 28.2	28.3	5.22	5.18		97.5 72.1	71.5	1.03	1,09		2.5 3.6	3.7	
		31		-		28.4		5.13 4.99		5.09	70.8 68.9		1.15	_		3.7	_	
23/07/24	7:42:17	(Flac	Middle	11.3	23.1	28.9	28.9	5.02	5.01		69.2	69.1	2.05	2,04	1.78	2.1	2.2	3.7
		/ Fine	Ballom	21.7	23.0	29.1	29.2	5.09	5.07	5.07	70.2 69.7	70.0	2.19	2.22		4.8 5.8	5.3	
		31	Surface	1.0	23.5	28.2 28.2	28.2	5.34 5.31	5.33		73,9 73.4	73.6	1.22	1.24		1,4	1.4	
25/07/24	8:30:37		Middle	11:1	23.2	29.0	29.0	5.26	5.25	5.29	72.7	72.6	1.46	1.46	1.48	2.8	2.7	2.0
		/ Fine		_		29.0	_	5.24 5.18		F 47	72.5 71.5	_	1.45			2.6		
			Bottom	21,2	23,0	29.2	29.2	5.16	5.17	5.17	71.2	71.3	1.76	1,75		2.4	2.0	
		29	Surface	1.0	23.7	23.4	23,5	5.26 5.25	5.26	5.21	71.1 71.0	71.1	1.82	1.84	8	1.4	1,6	
27/07/24	10:00:24		Middle	11.2	23,2	29.2 29.3	29,2	5.18 5.14	5.16	J	71.7 71.2	71.5	1.53	1,54	1.78	1,7	1.7	2.5
		/ Cloudy	Bottom	21.4	23.1	29.9	29.9	4.97	4.96	4.96	69.0	68.8	1.97	1.98		2,6	4.2	
			-			29.9		4.95 5.65	_		68.6 79.3		1.98	- 11		5.8 5.6		
		28	Surface	1.0	24,3	28.2	28.1	5.63 5.47	5.64	5.55	78.9 76.1	79.1	1.23	1,22		4.5	5.1	
29/07/24	13:55:26		Middle	10.6	23.5	29.0	29.0	5.45	5.46		76.1 75.8	76,0	1.41	1,42	1.43	4.5 6.7	5,6	5.2
		/ Cloudy	Boltom	20.0	23.2	30.0 30.1	30,0	4.99	4.99	4.99	69.4 69.3	69.4	1.63	1.65		3.8 6.3	5.1	
		00	Surface	1.0	24.1	26.1	26,1	6.04	6.03		83.5	83.4	1.09	1,10		3.0	2.5	
31/07/24	17:02:31	28	Middle	10.7	_	26.1 28.8		5.69		5.86	83.2 79.2		1.10		,,, ]	2.0 5.4		
51101124	17.02.31	/ Cloudy			23.6	28.8 29.9	28-8	5.67 5.13	5.68		78.9 71.3	79.1	1.38	1.37	1.41	2.6	4.0	3.6
	ıl	, 0.000	Bollom	20.3	23.2	30.0	29.9	5.13	5.12	5.12	70.9	71:1	1.76	1.76	1	3.3	4.2	

### Mid-Flood Tide

Monitoring Station:

TM-FM1



		Ambient	Monitoria	ng Depth	Тетр	Salini	ly (ppt)	Dissolv	ed Oxygen	(mg/L)		d Oxygen	Tu	rbidity (NT	U)	Susper	nded Solids	s (mg/L)
Date	Time	Temp (°C) / Weather Condition		n)	(°C)	Value	Average	Value	Average	Depth- average	Value	lion (%) Average	Value	Average	Depth- average	Value	Average	Depth-
		30	Surface	1,0	24.8	20.2	20.2	6,68	6.67	average	90,3	90.1	0.77	0.75	average	1,4	1,8	average
02/07/24	16:18:45		Middle	9,0	23.1	28,4	28.4	5.53 5.51	5.52	6,09	76,1 75,8	76.0	0.97	1,00	1.03	2.2	2.7	2,4
		/ Fine	Ballom	17.1	22,6	30.5	30.5	4,88	4.88	4.88	67,3	67.2	1,35	1.36		1.7	2.8	
			Surface	1.0	24.5	30.6 19.8	19.8	4.87 7.16	7.15		67.1 96.1	96.0	0.46	0.48		3,9 2,4	2-1	
04/07/24	17:51:52	30	Middle	9.0	22.9	19,8	27.6	7.14 5.59	5.57	6.36	95,8 76,3	76.0	0.49	0.76	0.83	1.8	1.8	2.5
04/0//24	17.01.52	/ Fine	_	-		27.6 30.7	-	5.54 4.71		4.70	75.7 64.7	-	0.75		1	3.9		
			Bollom	17.1	22.3	30.7 25.7	30.7	4.68 7.25	4.70	4.70	64,2 101.6	64.5	1.27	1,26		3.2	3.6	-
		31	Surface	1,0	25.0	25.8	25.8	7.22 6.04	7.24	6.63	101.2	101.4	0.39	0,38		2.0	1.6	
06/07/24	19:20:41		Middle	8,8	23.2	30.5	30.5	6.02	6,03		84,1	84,2	0.75	0,74	0.82	2.9	2.0	1,8
		/ Fine	Bottom	17.0	22.4	31.6	31.6	5.06	5.09	5.09	70,7	70,4	1.32	1,33		1.9	2.0	
		31	Surface	1.0	25.4	28.4	28,4	6.66	6,66	6.04	95,4 95,1	95,3	1.03	1.05		4.0	4.2	
09/07/24	6:36:09		Middle	9.3	23.5	31.2 31.2	31.2	5.44 5.41	5.43	0.04	76.6 76.2	76.4	1.42	1.43	1.35	5.4 4.5	5.0	5.0
		/ Fine	Bottom	17,6	22.6	31.6	31:7	5.06	5,05	5.05	70,3 69,9	70.1	1.55	1.57	1	6.4 5.0	5.7	1
		30	Surface	1,0	25.2	14.7	14.7	6.09	6,18		80,4 82,8	81.6	1.20	1.19		2.0	1.9	
11/07/24	9:37:07		Middle	7,9	23,4	24.0	23,9	5.60	5.71	5,95	75.5	77.0	1,28	1,26	1,26	3.7	3.3	2,8
		/ Fine	Boltom	14.5	21.7	23.9 30.5	30.6	5.82 4.92	4.83	4.83	78,4 66,8	65.5	1.23	1.33		3.0	3.3	
			Surface	1.0	24.7	30.6 18.0	18.0	4.73 6.84	6.77		64,2 91,2	90.3	1.36 0.62	0.63		3,5 1.4	1.4	
13/07/24	44.00.04	30	-			18.0 27.0	_	6.70 5.90	5.63	6,30	89,3 79.8		0.63		1.01	1.4		1.6
13/07/24	11:06:01	/ Fine	Middle	8.9	22.6	27.0	27.0	5.75 4.62			77.8 62.7	78.8	1.21	1.16	1.01	1.3	1.5	'.°
			Boltom	15.7	21.9	29.9 16.5	29,9	4.56 7.78	4,59	4.59	61,9 103.8	62,3	1.23	1,24		1.6	1.8	
		29	Surface	1,0	25.2	16.6 28.4	16.5	7.82	7.80	7.28	104.2	104.0	0.68	0.69		5.4	4.5	
16/07/24	16:15:08		Middle	9.4	22.3	28.4	28.4	6.74	6,76		91,4	91,6	1,13	1.15	0.91	4,2	4.8	4.8
		/ Fine	Bottom	18.0	21.4	32.8 32.9	32,8	5.18 5.12	5,15	5,15	70.9 69.6	70.3	0.92	0.90		5,3 5,2	5.3	
		28	Surface	1.0	25.3	22.2	22,2	7.98	8.00	7,38	110.6	110.4	0.79	0.81		1.0	1.7	
18/07/24	17:32:42		Middle	9.5	22.6	27.0 27.0	27.0	6.78	6.77	7,00	91.7 91.3	91.5	1.08	1.09	1.01	5.5 3.1	4.3	3.1
		/ Fine	Bottom	17.9	21.4	32.1 32.2	32.2	5,55 5,53	5.54	5.54	75.7 75.3	75,5	1.12	1.13		3,8	3,2	
		30	Surface	1.0	25.6	16.4 16.5	18.4	7.18	7.16		96.4 95.8	96,1	0.86	0.87		2.1	2,3	
20/07/24	18:32:42		Middle	9,2	22.5	27.9	27.9	6.66	6,65	6.90	90.4	90.2	0.94	0.94	1.03	2.0	3.2	3.8
		/ Cloudy	Boltom	17.1	22.2	32,1	32.1	6,28	6,26	6,26	86.8	86,5	1.28	1.30		5.0	5,9	1
			Surface	1.0	23.4	32,1 28,2	28.2	6.23 5.23	5.21		86,2 72,2	71.9	1,31	1.57		8,8 4.0	3.5	
23/07/24	8:01:00	31	Middle	7.5	23.2	26.3 26.7	28.6	5.18 5.04	5.06	5,13	71.6 59.6	69.9	1.54	1.86	1.84	3.0	3.0	4,1
		/ Fine	Bollom	13.8	23.1	28.4 29.0	28.9	5.08 4.98	5.03	5.03	70.1 68.7	69.3	1.83	2.10		2.9 5.5	5.8	
				-	-	28.8		5.07 5.42		5,00	69.9 75.0	74.9	2,13		-	6.0		
		31	Surface	1,0	23,5	28.3	28,3	5,40 5,37	5.41	5,38	74,8 74,4		1.20	1.18		1,5	1.9	
25/07/24	8:50:39	/ Fine	Middle	8,1	23.3	29,0	29.0	5,34	5,36		74.0 72.6	74.2	1.41	1.40	1.42	3,8	3.3	3,3
		, , ,,,,	Bottom	15.1	23,2	29,4	29.4	5.22	5,23	5,23	72.2	72,4	1.69	1.67	_	3,9	4.7	
		29	Surface	1.0	23.7	23.6	23.6	5.49	5,48	5,42	74,2	74_1	1.93	1.94		2,3	2,4	
27/07/24	10:17:01		Middle	8.2	23.4	29,3 29,4	29.3	5,38 5,33	5.36		74.8	74.4	1.65	1.67	1,88	3.4	2.9	3.1
		/ Cloudy	Boltom	15.6	23.2	29,9 29,9	29.9	5.14 5.13	5,14	5,14	71.5 71.3	71.4	2,03	2,03		3.0	4.0	
		28	Surlace	1.0	24.3	28.2	28.2	5.64 5.63	5,64		79,2 79,0	79.1	1.18	1.20		4,7 5,7	5.2	
29/07/24	13:32:47		Middle	9.0	23.7	29,1 29,1	29.1	5,44 5.41	5,43	5,53	75,9 75,4	75,7	1.34	1.35	1.41	4.5 6.7	5,6	5,8
		/ Cloudy	Bollom	17.0	23.3	30,1	30.1	4.96	4.94	4.94	69,2	68.9	1.66	1.67	1	6.1	6,6	
		28	Surface	1.0	24,1	25.9 25.9	25_9	6.08	6,07		83,9	83.7	1,14	1,15		3,0	3,2	
31/07/24	16:40:13	26	Middle	8.8	23.7	28,5	28.5	5,66	5.65	5.86	78,7	78.5	1,16	1.47	1_47	3,5	3.1	2.9
		/ Cloudy	Bottom	16.6	23.3	28.5 29,5	29.5	5.63	5.20	5.20	78.3 72,4	72.2	1.48	1.80		2,7	2,5	
						29,6	-3.0	5,16			72,0		1,82		L	2,6		L

### Mid-Flood Tide

Monitoring Station :

TM-FM2



Date	Time	Temp (°C) /		ng Depth	Temp	Salini	ly (ppl)	Dissolv	ed Oxygen		Dissolve Satura	d Oxygen lian (%)	Τι	ırbidily (NT		Susper	ided Solids	
		Weather Condition	("	m)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depti
		30	Surface	1.0	24 B	19.9	19.9	6.62 6.58	6.60	6.01	89.4 88.9	89.2	0.63	0.66		2.9	2.5	3217
02/07/24	16:30:43		Middle	8.8	23,1	28.0 28.0	28.0	5.44 5.41	5.43	0.01	74.7 74.1	74.4	0.97	0.98	1.03	2.4	3,0	2.7
		/ Fine	Bottom	16.6	22.6	30.2	30.2	4.76	4.75	4.75	65.6	65.5	1.43	1.44		2.6	2.6	
	_		0.1			30.2 19.5		7.03			65.3 94.1		1.45 0.52	5	-	2.5		
		30	Surface	1.0	24-4	19.6	19.6	7.00	7.02	6.24	93,7	93.9	0.56	0.54		3.5	2,9	
04/07/24	18:06:27		Middle	9.1	23.0	27.3 27.3	27.3	5.46 5.45	5.46		74.5	74.5	0.83	0.84	0.91	2.6	2.5	3.
		/ Fine	Boltom	17.0	22.6	30.3	30.3	4.68	4.67	4.67	64.5	64.3	1.34	1:35		5.6 5.2	5.4	
			Surface	1.0	25,1	25.5	25.5	7.33	7.33		102.7	102.7	0.40	0.40		1.3	1.5	
00107/04		31	-	-		25.6 30.8		7.32 6.14	_	6.73	102.6 85.9		0.39	_		1.6	-	
06/07/24	19:46:13	/ Fine	Middle	9.0	23,3	30.6	30.8	6.13	6,14		85.8	85.9	0.74	0.73	0.81	1.8	2.1	1.
		7 Fille	Boltom	16.8	22.4	31.9 32.0	31.9	5-17 5-14	5-16	5.16	71.7	71.5	1.28	1,30		1.4	1.4	
		31	Surface	1.0	25,3	28.6 28.6	28.6	6.63 6.61	6.62		94.9 94.6	94.8	1.16	1,17		5.7	5,4	
09/07/24	8:18:35	1988	Middle	9.3	23.4	31.4	31.4	5.48	5.46	6.04	77.1	76.9	1.51	1,52	1.45	4.0	3.9	4.
		/ Fine			<u> </u>	31.4 31.9		5.44			76.7 70.1		1.52		1840	3.8		
			Bollom	17.5	22.5	31.9	31.9	5.02	5-04	5.04	69.7	69.9	1.68	1.67		4.4	4.6	
		30	Surlace	1.0	25.1	15.0 15.0	15.0	6.02	6.12	5.00	79.5 82.1	80.8	1.24	1.26		2.7	3.2	
11/07/24	9:55:53		Middle	7.7	23.5	23.4	23.4	5.72	5.68	5.90	77.2	76.5	1.24	1.28	1.29	4.8	3.8	3.
		/ Fine	Bottom	13.9	21.6	23.4 30.7	30.7	5.53 4.98	4.70	4.79	75.8 67.6	ce o	1.32	4.00		2.7	0.4	
			DOILOIN	10.9	21.0	30.6 20.1	30.7	4.59 6.59	4.79	4.79	62.3 88.1	65.0	1.31 0.75	1,32		1.6	2.1	_
		30	Surface	1,0	24.2	20.1	20.1	6,45	6.52	6.31	86.3	87.2	0.75	0.75		3.2 1.8	2.4	
13/07/24	10:50:01		Middle	8.6	23.5	25.2 25.4	25.3	6.06	6,10		83.4	82.7	1.07 1-18	1.13	1.04	2.7	3.2	з.
		/ Fine	Bollom	16,1	21.5	31.0	31.0	4.50	4,46	4.46	61.1	60.5	1.26	1.23		2.2	3.5	
			Curlana	40	05.0	31.1 16.4	10.5	4.41 8.14	0.42		59.9 108.7		1.20 0.69	_		4.8 5.1	=	
		29	Surface	1.0	25.3	18.5 27.1	16.5	8.20	8.17	7.57	109.4	109.1	0.64	0.67		4.2	4.7	
16/07/24	16:05:09		Middle	8.7	22.7	27.1	27.1	7.01 6.91	6.96		95.1 93.7	94.4	1.01	1.03	0.93	4.3	4.3	5.
		/ Fine	Bottom	16.1	21.8	31.5 31.5	31.5	5.67 5.65	5.66	5.66	77.6 76.8	77.2	1.08	1.10		5.9 6.2	6.1	
		28	Surface	1.0	25.4	22.5	22.5	7.95	7.94		110.1	109.9	0.72	0.74		4.1	3.2	
18/07/24	17:18:01	20	Middle	8.6	22.7	22.5 27.3	27.3	7.92 6.73	6,72	7.33	109.7 91.4	91.2	0.75	0.99	0.93	3.0	2.8	3.
		/ Fine	-		-	27.3 32.4		6.71 5.44			90.9		1.00	0.55	0.33	2.6 4.6	2.0	3.
			Bollom	16.3	21.4	32.5	32.5	5.40	5.42	5.42	73.8	74.1	1.08	1.06		4.3	4.5	
		30	Surface	1.0	25.7	16.5 16.5	16.5	7.04	7.03	6.78	94.7 94.3	94.5	0.92	0.93		3.2 5.0	4.1	
20/07/24	18:17:27		Middle	8.2	22.6	27.9 27.9	27.9	6.53 6.51	6.52	6.78	88.8 88.5	88.7	0.99	1.01	1,10	3.0	2.6	3.
		/ Cloudy	Botlom	15.3	22.3	32.1	32.1	6-14	6,13	6,13	85.1	84.8	1.02	1.38		2.1	3.6	
	_				_	32.1 28.0		6.11 5.32			84.5 73.5		1.38	_		4,4		
		31	Surface	1.0	23.5	27.7	27.8	5.36	5.34	5.21	74.1	73.8	1.17	1.20		4.7	4.7	
23/07/24	8:18:04		Middle	9.0	23.3	28.5	28.4	5.04	5,09		69.6 70.9	70.3	1.93	1.92	1.76	5.2	4.5	4.4
		/ Fine	Bollom	16.7	23.2	28.7	28.8	5.05 5.00	5,03	5.03	69.7 69.1	69.4	2,12	2,15		4.0	4.0	
			Surlace	1.0	23.5	28.2	28.2	5.21	5,20		72.1	72.0	2.18	1.13		4.0 3.7	4.7	
0.5/5-1-1		31				28.3 29.0		5.19 5.06		5.13	71.8 70.1		1.12			5.7 3.5	-	
25/07/24	9:05:16	150	Middle	8.9	23.3	29.0	29.0	5.05	5.06		69.9	70.0	1,42	1.42	1.40	2.0	2.8	3,
		/ Fine	Bollom	16.9	23.2	29.2	29.2	4.97	4.98	4.98	68.8 69.0	68.9	1.65	1.66		3.4	2.9	
		29	Surlace	1.0	23.7	23.5	23.6	5.35	5.35	2	72.3	72.3	1.94	1.96		2.8	4.0	
27/07/24	10:34:43	29	Middle	8.8	23.3	23.6 29.3	29.3	5.34 5.28	5.28	5.31	72.3 73.3	73.3	1.98	1.67	1.89	5.1 2.4	2.8	3.3
LITOTIE4	10.04.45	/ Cloudy	IVIICOLO	0.0	2010	29.3 29.9	25.3	5.27 5.06	3,20		73.2 70.3	73.3	1.66	1.07	1.69	3.1	2.8	3
		, claddy	Bollom	16.4	23.2	29.9	29.9	5.03	5,05	5.05	69 9	70.1	2.06	2,05		3.4	3.1	
		28	Surface	1.0	24.3	27.9 28.0	28.0	5.78 5.75	5.77		81.0 80.4	80.7	1.25	1.25		6.5 6.3	6,4	
29/07/24	13:21:27		Middle	8.6	23.7	28.6	28.6	5.50	5.49	5.63	76,5	76.4	1.46	1,47	1.48	6.8	6.4	6.
		/ Cloudy			_	28.6		5.48			76.3 70.5		1.48			6.0 5.8	_	J.
			Bollom	16,3	23.4	29.8	29.7	5.01	5,04	5.04	69.8	70.2	1.72	1.71		5.2	5,5	
		28	Surface	1.0	24.1	26.1 26.1	26.1	6.05 6.02	6.04	5.85	83.6 83.3	83.5	1.19	1.21		4.0 4.8	4.4	
31/07/24	16:20:53		Middle	8.5	23.7	28.5 28.5	28.5	5.67 5.64	5.66	3.63	78.9 78.5	78.7	1.51	1.52	1.50	4.5 2.7	3.6	3.6
		/ Cloudy	Bollom	16.0	23.4	29.7	29.7	5.18	5.16	5.16	72.2	71.9	1.75	1.76		2.8	2.9	
				.,010		29.7		5.14	510	5.10	71,5	5	1,77			3.0	2.13	

### Mid-Flood Tide

Monitoring Statlon :

TM-FC2



		Ambient Temp (°C) /	Monitori	ng Deplh	Temp	Salinit	y (ppt)	Dissolv	ed Oxygen	(mg/L)		d Oxygen tion (%)	Tu	rbidily (NT	U)	Susper	nded Solid:	s (mg/L)
Date	Time	Weather Condition		п)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
		30	Surface	1.0	24.7	20.3	20.3	6.51	6.50		88.0 87.6	87.8	0.75	0.75		3.3	3.3	
02/07/24	16:47:53	30	Middle	8.4	23.0	20.4	28.5	6.48 5.22	5.22	5,86	71.7	71.7	0.74	1.00	1.04	2.3	2.3	2.8
02/0//24	10.47.53	/ Fine	IVIGORE	O,N		28.5 30.8	26.5	5.21 4.65	Jee		71_6 64_2	71.7	1.01	1.00	1,04	2.2		2,0
		711116	Bollom	15.9	22.5	30.8	30.8	4.63	4.64	4.64	64.0	64.1	1.36	1.37		2.1	2.9	
		30	Surface	1.0	24.4	19.4	19.5	7.07	7.06	1	94.5	94.4	0.49	0.50		3.5 2.5	3.0	
04/07/24	18:31:58		Middle	8.6	23.1	27.7	27.7	5.66	5.64	6,35	77.5	77.2	0.81	0.82	0.86	4,8	4.2	3,5
04/01/24	16.31.56	/ Fine	Wildole	0.0	20.1	27.7 30.4	2713	5.62 4.76	5,01		76.9 65.8	17,02	0.83	UIUL	0,00	3.6	-	-
		7 T MIC	Bollom	16,3	22.7	30.5	30,4	4.72	4.74	4.74	65.1	65,5	1.28	1.28		2.8	3,3	
		31	Surface	1,0	25,0	25.4 25.5	25.5	7.28 7.24	7.26		101,8	101.6	0.38	0,39		1.7	1.7	
06/07/24	20:10:51		Middle	8.9	23.3	30,5	30,6	6.06	6.05	6.65	84.7	84.5	0.82	0.83	0.82	2.9	2,3	1,8
VV.7.	20110101	/ Fine				30,6	1.0	6.03 5.16	- 12		84.3 71.5		0.83			1.6		1
		,,,,,,	Bollom	16.6	22.5	31.7	31.6	5.14	5.15	5.15	71.2	71.4	1.25	1.24		1.9	1.5	
		31	Surface	1.0	25.3	28,4	28.4	6.84	6.84	3	97.8 97.7	97.8	1.12	1-13		4.4	4.2	
09/07/24	B:00:19	Ů.	Middle	9.1	23.4	31.3	31.3	5.69	5.68	6.26	80.0	79.8	1.48	1.51	1,42	6.2	6.4	5,4
OSIGITES	0.00.15	/ Fine	IVIIOUIU	0.1	20.4	31.3 31.8	0110	5.66 5.24			79.6 72.7		1.53			6.6 5.7	_	-
		771110	Bottom	17.0	22.5	31.8	31.8	5.22	5,23	5.23	72,6	72.7	1,64	1.63		5.4	5,6	
		30	Surface	1.0	25.1	14.9	14.9	6.13 6.10	6,12	- 8	80,9 80,5	80.7	1.22	1.24		1.9	2,7	
11/07/24	10;12:13		Middle	8.1	23.5	23.5	23.6	5.79	5,78	5.95	78.0	77.8	1,29	1,31	1,33	2.7	2.8	2.6
		/ Fine			-	23.6		5.76 4.86			77,5 65,9		1.32		100	1.9	$\vdash$	1
		771110	Bottom	15,3	21.6	30.4	30.4	4.85	4,86	4.86	65.7	65.8	1.44	1.44		2.9	2,4	
		30	Surface	1.0	24.9	17.7	17.1	6.93	6,96		92.6 92,6	92,6	0.62	0.64		5.3 3.2	4.3	
13/07/24	10:31:03	50	Middle	8.2	22.2	28.6	28.7	5.52	5.40	6.18	74.8	73.2	0.98	1.05	1.03	2.2	2.4	2.8
13/0//24	10.51.05	/ Fine	WILCOIG	0.2		28.7 30.2	20.7	5.27 4.43	0.40		71.5 60.2	70.2	1,12	1.00		2.6	_	1
		7 Fille	Bottom	15.5	21.8	30.4	30.3	4.42	4,43	4.43	60.0	60-1	1.43	1.39		1.5	1.6	
		29	Surface	1.0	25.2	16,4 16.5	16,4	8.13 8.20	8.17		108.4	108,9	0.73	0.73		6.7	6.8	
16/07/24	15:45:10	29	Middle	8.7	22,5	27.6	27.6	6,91	6.89	7,53	93,6	93.4	0.73	1.00	0.85	5.7	6.3	5.9
10/07/24	13.43.10	/ Fine	MICCIO	0.7	22,0	27,6 32.8	27.0	6.87 5.20	0.05		93.2	30,4	1.03	1100	0.00	6.8		- 0.0
		71110	Bollom	16.3	21.0	32,8	32,8	5.17	5.19	5.19	70.4	70.6	0.79	0,83		4.3	4.5	
		28	Surface	1.0	25.4	22.6	22.7	8.03	8.03		111.3	111.2	0.80	0.79		4,2 5,0	4.6	
18/07/24	17:00:40	25.9	Middle	8,4	22.6	27.5	27.5	6.87	6.86	7.44	93.2	93.1	1.06	1.07	1.00	5.8	5.8	4.5
10/0//24	17.00.40	/ Fine	MINOIB	0,4	22.0	27,5 32,6	2/1-3	6.85 5.56	0.00	_	92.9 76.0	33.1	1,07	1,07	1.00	5.7 4.0	3,0	- "."
		7 Fille	Bottom	15.9	21.4	32.6	32.6	5.53	5.55	5.55	75,6	75.8	1.15	1-15		2.1	3.1	
		30	Surface	1.0	25.6	16.8	18.8	7,22	7.19		97.1 96.3	96.7	0.97	0,98		5.2	5.3	
20/07/24	18:00:14	30	Middle	8.1	22.7	28.2	28,2	6.79	6.77	6,98	92.7	92.4	1.05	1.05	1.12	4.4	3.8	4.7
20/07/24	10.00.14	/ Cloudy	IVIIOGIG	0.1		28.3 32.5		6.75 6.31	0.,,		92.1 87.5	- 02	1,04	1.00		3,1 4,5	-	-
		7 Oldudy	Boltom	15,0	22.2	32.5	32.5	6.25	6.28	6,28	86.7	87.1	1.35	1.34		5.7	5,1	
		31	Surface	1,0	23.7	27.2 27.5	27.4	5.51 5.44	5,48		76.1 75.1	75.6	1.09	1.13		4.4 2.8	3.6	
23/07/24	8:47:22		Middle	8.1	23.4	28,1	28.2	5.32	5.31	5,39	73.5	73.3	1.89	1,88	1,65	5.3	5.2	4,4
20/0//21	GIVILL	/ Fine			-	28.3		5.29 5.49			73.1 75.7		1.07	-		3.8	_	-
		7130	Boltom	14.8	23,3	28,4	28.3	5.40	5.45	5.45	74.6	75.2	1.97	1.94		5.2	4.5	
		31	Surface	1.0	23.6	28,3 28,3	28.3	5.16	5.15		71.6 71.2	71.4	1.26	1.27		3.0	4.9	
25/07/24	9:30:50		Middle	8.8	23.4	29.2	29.2	5.08	5.09	5.12	70.6	70.7	1.46	1.47	1.48	2.9	3.5	3,6
	1.00.00	/ Fine	-	-		29.3 29.6		5.09 4.95	_		70.7 68.8		1.48		1	4.0 2.9	-	1
			Bollom	16.4	23,3	29.6	29.6	4,92	4.94	4,94	68.4	68.6	1,74	1.71		1,9	2,4	
		29	Surface	1,0	23,8	23,4	23.5	5.12 5.12	5,12		69 3 69 4	69.4	2.05	2,04		3.2 4.2	3.7	
27/07/24	10:51:37		Middle	8.7	23.5	29,2	29.2	5.09	5.09	5,10	70.8	70.8	1.68	1.69	1,99	2,6	3.7	3,4
27707124	10.01.07	/ Cloudy	-			29.2 29.7		5,08			70.7 67.9		1.69			3.7	-	1
		, Gloudy	Bollom	16.3	23,4	29.8	29.7	4,85	4.86	4,86	67.5	67.7	2.24	2,24		2.0	2,9	
		28	Surface	1.0	24,3	28.2	28.1	5.81 5.78	5,80		81.5 81.1	81.3	1.26	1.27		4.0 6.2	5_1	
29/07/24	12:00:14	20	Middle	9.5	23.7	28.8	28,8	5.78	5.53	5,66	77.2	77_1	1.43	1,45	1.49	5.9	6.0	5.3
29/0//24	13:00:14	I Claud	MIDDIN	8,5	23.7	28.8	20,8	5.52	5.53		76.9	7751	1.47	1,45	1.49	6.1	-	1 5.3
		/ Cloudy	Bollom	15.9	23.4	29.9	29.9	5.15 5.13	5.14	5.14	71.8 71.6	71.7	1.76	1,74		4.3 5.5	4.9	
		20	Surface	1.0	24,1	26.4	26,4	6.08	6.07		84.2	B4.1	1.22	1.23		2.5	2.4	
	16:00:19	28	-		00.0	26.4 28.9	20.0	6.06 5.64	5.00	5,85	83.9 78.8	78.6	1.46	1,46	1.50	2.3	3.2	3.5
01/03/01			Middle	8.4	23.8	28,9	28,9	5.62	5,63	ı	78.4	78.6	1.45	1,46	1.50	2.3	] 32	3,5
31/07/24	10.00.13	/ Cloudy	-			29.8		5.06			70.6		1.80		1	4.1		1

Monitoring Station :

TM-FC1



Date	Time	Ambient Temp (°C) /		ng Depth	Temp	Safini	ty (ppt)	Dissolv	ved Oxygen	(mg/L)		d Oxygen lion (%)	To	urbidily (NT	U)	Suspe	nded Solid	s (mg/L)
53(0		Weather Condition	(1	m)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
		30	Surface	1.0	24.8	20.5	20.5	6.37	6.35		86,3 85.8	86.1	0.81	0.83		2.4	2.6	
02/07/24	10:18:41		Middle	11.1	22.9	28.5	28,6	5.38	5.37	5.86	73.8	73.7	1.02	1.03	1.06	3.6	3.1	2.5
		/ Fine	Bottom	21.1	22.1	28.6 30.7	30,8	5.36 4.92	4.90	4,90	73.5 67.4	67.2	1.03	1.34		1.8	2.0	
	-			-		30.8 19.6	_	4.88 7.11		4,50	67.0 95.0		1,35	1.54		3.2	2.0	-
		30	Surface	1.0	24.3	19.7	19,6	7.07	7.09	6,28	94.5	94.8	0,61	0,61		4.1	3,7	
04/07/24	12:05:06		Middle	11,3	22.9	27.5 27.5	27,5	5,49 5,46	5,48		74.8	74,6	0.84	0,85	0,95	2.0	2.1	3.0
		/ Fine	Boltom	21.4	22.2	30.5 30.5	30,5	4.77	4.77	4.77	65.4 65.2	65,3	1.39	1.40		2.8	3,4	
		31	Surlace	1.0	25,3	25.6	25,6	7.34	7,33		103.3	103.2	0.42	0.41		1.4	1.3	
06/07/24	13:49:42	31	Middle	11.1	23.2	25.6 30.2	30.2	7.32 5.93	5.92	6.62	103.0 82.6	82.4	0.40 0.85	0.86	0.90	1.1	2.2	1,7
00/0//21	10.40.42	/ Fine		-	-	30.3		5.90 5.12			82.2 70.9		0.86	7.0	0.30	3,2 1,2	-	1"
	<u></u>		Bollom	21.2	22.5	31.4	31.4	5.09	5.11	5.11	70.5	70.7	1.45	1.44		2:1	1.7	
		31	Surface	1.0	25,5	28.3	28,3	6.77	6,76	6,30	97.0 96.6	96.8	1.25	1.26		5.3 6.1	5.7	
09/07/24	15:00:43		Middle	11,2	23.3	31.1	31.1	5.85 5.83	5,84	0,00	82.0 81.8	81.9	1.54	1,56	1,55	5.7	5.6	6.2
		/ Fine	Bollom	21.5	22.2	31.7	31.7	5.36	5,35	5,35	74.0	73.7	1.82	1.84		6,7	7,3	1
			Surlace	1,0	24.8	31.7 16.0	15.9	5,33 5,43	5,56		73.4 71.6	73,4	1.86	1.14		7.9 4.5	4.5	
		30			- 15.7	15.9 29.1	_	5.69 4.48		5,00	75.1 60.8		1.14			4,5		
11/07/24	16:55:54	/ Fine	Middle	10.8	22.1	29,3	29.2	4.40	4.44		59.7	60.3	1.08	1,09	1.24	4.3	4.2	3,9
		7 Fille	Bollom	20,0	21.6	30.7 30.8	30.8	4.21	4.27	4.27	58.8 57.1	58.0	1.43	1,51		3.8	3.0	
		30	Surface	1.0	24.7	19.3	19.4	6.76 6.57	6.67		90.8	89.5	0.64	0.64		2.3	2.5	
13/07/24	16:31:00		Middle	10.7	22.2	28.9 28.8	28.9	5.46 5.36	5.41	6.04	74.1 72.7	73.4	1.26	1.23	1_08	2.0	2.8	3.0
	1	/ Fine	Bollom	20.0	21.5	31.3	31.3	4.43	4.42	4.42	60.2	60.1	1.36	1,36		3.0	3.8	
			Curtana	4.0	05.4	31.4 16.6		4.40 8.26	_	_	59.9 110.1		1.35	_		4.5 6.8		$\vdash$
		29	Surface	1.0	25,1	16.6 29.1	16.6	8.26 6.37	8,26	7.31	110,0 86,8	110.1	0.69	0.65		5.7	6.3	
16/07/24	8:45:17		Middle	10,3	22,3	29,3	29.2	6,35	6,36		86.3	86,6	1.24	1,23	0.96	4.0	3.9	5.4
		/ Fine	Boltom	19.5	21,0	32.9 33.0	33.0	5.12	5.10	5.10	69,6 69,0	69,3	1.00	1.00		6.7 5.5	6.1	
		28	Surface	1.0	25,3	22.4	22.4	7.95 7.94	7,95		109.9	109.8	0.89	0.91		2.3	2.0	
18/07/24	10:00:49	- EE 3	Middle	10.6	22.6	28,9	28.9	6.65	6.64	7.29	90,9	90.8	1.15	1.15	1,11	5.0	4.9	3.6
		/ Fine	Bottom	20.0	21,2	29.0 33.0	33,0	6.62 5.48	5.46	5,46	90.6 74.8	74.6	1.14	1.27		4.B 2.7	3.9	1
						33.0 16.6		7.18		5,40	74.3 96.1		1.02			5.0 3.0	-	
		30	Surface	1,0	25,5	16.6	16.6	7.13	7.15	6.95	95.7	95.9	1.03	1,03		3.1	3.1	
20/07/24	11:30:21		Middle	10.7	22.8	28,5 28.5	28.5	6,77 6,75	6.76		92.7 92.4	92.6	1.14	1.15	1.18	3.7	3,5	4.4
		/ Cloudy	Bottom	20,3	22.1	32.7 32.7	32.7	6.32	6,30	6,30	87.6 87.0	87.3	1.37 1.38	1,38		7.2 6.0	6.6	
		31	Surface	1.0	23.4	28.1	28,1	5,21	5.18		71.9	71.4	1,40	1,42		5.3	4.1	
23/07/24	14:56:02	31	Middle	11.0	23.2	28.8	28.7	5.14 5.01	5.00	5.09	70.9 69.2	69.0	1.44 2.78	2.71	2.37	2.9 6.3	6.4	5.6
		/ Fine		_		28.6	_	4.98 5.03		F.01	68,7 69.4		2.63 3.06			6.5		""
			Botlom	20.6	23.2	29.0 27.9	28.8	4.99 5.67	5.01	5.01	68.9 78.5	69.2	2.93	3.00		6.4	6.4	
		31	Surface	1,0	23.6	27.9	27.9	5.64	5.66	5.60	77.9	78.2	1.20	1.19		5.1	3.9	
25/07/24	16:00:33		Middle	11,0	23.3	28.5 28.6	28.6	5.55 5.52	5,54		76.7 76.3	76.5	1.51	1,52	1,51	2.8	2,7	3.4
		/ Fine	Bollom	21.0	23,1	29.0 29.1	29.0	5.47 5.43	5.45	5,45	75.5 75.0	75.3	1.83	1.82		2.8	3.5	
		29	Surlace	1,0	23,7	24.7	24.7	5.24	5,24		71.3	71,3	1.69	1.71		5.1	4.0	
27/07/24	16:59:46	29	Middle	11,1.	23.3	24.7 30.2	30.2	5.23 5.16	5.16	5.20	71.2 72.0	71.9	1.72	1.66	1.77	3.2	3,8	4.6
		/ Cloudy	_			30.2 30.6	- 2	5.15 5.07			71.8 70.8		1,65		/	4.4 6.0		4.6
			Bollom	21.0	23.2	30,6	30.6	5,06	5,07	5,07	70.6	70.7	1,94	1,96		5,8	5.9	
		28	Surface	1.0	24.1	27.3	27.4	5.78 5.76	5,77	5.60	80.4	80.3	1.34	1,35		5.0 6.0	5,5	
29/07/24	7:30:51		Middle	10,2	23.5	28.7 28.7	28.7	5.43 5.42	5.43	3.00	75.3 75.2	75.3	1.65	1.66	1.61	5.5 7.2	6.4	6.4
		/ Cloudy	Bottom	19,5	23.2	29.7	29,8	5.08	5.07	5.07	70.6	70.5	1.82	1,83		7.9	7.4	
	$\vdash$		Surface	1.0	24.0	29.8 24.5	24.5	5.06 5.94	5.94		70,3 81,2	81,1	1,83	1,30		6.9	4.2	-
21/07/2	0.00 15	28		-		24.5 28.4		5,93 5,57		5,75	80,9 77,3		1.31			3.9 2,6		
31/07/24	9:00:43	/ Cloudy	Middle	10,4	23,6	28,4	28.4	5.55	5,56		77.0	77.2	1,47	1.46	1,51	2,6	2,6	3.2
		r Cloudy	Boltom	19,9	23,3	29.6	29.7	5.08	5.07	5.07	70,6 70,2	70.4	1,76	1,77		2,6	2.9	

### Mid-Ebb Tide

Monitoring Station :

TM-FM1



Dala	Time	Amblent Temp (°C) /	Monllori	ng Depth	Temp	Salinii	y (ppl)	Dissolv	ed Oxygen	(mg/L)	Dissolve Satura	d Oxygen tion (%)	Tu	rbidity (NT	U)	Susper	nded Selids	s (mg/L)
Date	TIMIE	Weather Condition	(1	n)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
		30	Surface	1.0	24,8	20.7	20.8	6.28	6,27		85,2 84,8	85.0	0.82	0,83		2.0	2,2	
02/07/24	10:00:35		Middle	9.7	23.0	28.7	28.7	5.12 5.10	5.11	5.69	70.4 70.3	70.4	1.04	1,05	1,11	1.6	2,3	2.1
		/ Fine	Bollom	18.4	22.6	30.9	30.9	4.75	4.75	4.75	65.7 65.6	65.7	1.47	1,46		1.1	1.7	1
			Surface	1.0	24.5	20.1	20-1	6.85	6.85		92.1	92.0	0.54	0.56		3.0	3,6	
04107104	11.40.57	30	_	9.5	23.1	20.1	28.0	6.84 5.25	5.24	6.04	91.8 72.0	71.9	0.58	0.83	0.88	4.2 2.9	2.9	3.2
04/07/24	11:42:57	/ Fine	Middle			28.0 31.0	_	5.23 4.55	_		71.8 63.1		0.83		0.00	2.8 3.1	-	0.2
			Bollom	18.1	22.7	31.0 25.7	31,0	4.51 7.62	4.53	4,53	62.4 107.3	62.8	1.27 0.41	1,27		3,4	3.3	_
		31	Surface	1.0	25.3	25.7	25,7	7.58	7.60	6.83	106.5	106,9	0.42	0.42		2,9	2.4	
06/07/24	13:32:55		Middle	9,3	23.3	30.3	30,3	6.07	6.06		84.7	84.5	0.82	0.84	0,90	1,3	1,6	1,8
		/ Fine	Bollom	17.6	22.7	31.7 31.7	31.7	5,28 5,27	5,28	5.28	73.5	73.5	1,46 1,44	1.45		1.1	1.5	
		31	Surface	1.0	25,6	28,3 28,3	28.3	6.73	6.72	0.00	96.7 96.1	96,4	1.32	1,33		4.9 3.5	4.2	
09/07/24	15:21:55		Middle	8,8	23.4	31.2 31.2	31.2	5.94 5.91	5.93	6,32	83.5 83.2	83.4	1.67	1.68	1.65	5.1 8.5	5.8	5.2
		/ Fine	Bottom	16.4	22.3	31.8	31.9	5.48 5.43	5.46	5,46	75.8 75.1	75.5	1.94	1.94		8.6 4.7	5.7	1
			Surface	1.0	25.3	14-1	14.2	6.33	6.43		83,4	84.7	1.19	1,17		3.0	2.8	
11/07/24	16:31:06	30	Middle	B.4	23.3	14.3	24.2	6.52 5.08	5.22	5,82	85.9 68.5	70.4	1.15	1.24	1.21	1.4	1,4	2.2
11101124	10.01.00	/ Fine	_	_		24.2 30.7		5.36 4.41	4.30	4.30	72.2 59.8	58.3	1.27	1.21		1,4	2.5	
			Bottom	15,4	21.5	30.7 19.1	30,7	4.19 6.71		4.30	56,8 90.2	_	1.20 0.59			3.1 4.7	-	
		30	Surface	1.0	24,8	19.2	19.1	6.64 5.94	6.68	6,31	89.0 80.5	89,6	0.67 1.24	0,63		5.2	5.0	-
13/07/24	16:51:20		Middle	8.0	22,5	26.9	27.2	5.93	5,94		80.3	80.4	1.30	1,27	1,08	1.3	2.3	2,9
		/ Fine	Bollom	15.9	21,8	30.3	30.3	4.81 4.79	4.80	4.80	65.4 65.1	65.3	1,29	1,33		1.0	1.4	_
		29	Surface	1.0	25.1	16.6	16.6	7.96 8.02	7.99	7.39	106.1	106.5	0.59	0.59		6.6	6.3	
16/07/24	9:03:08		Middle	9.0	22.4	27.9	27.9	6.79	6.78	1.00	92.0 91.9	92.0	1.04	1:05	0.85	6.8	6.5	5,8
		/ Fine	Bottom	17.2	21.0	33.0 33.0	33.0	5.16 5.11	5.14	5.14	70.2 69.5	69.9	0.96	0.93		4.8	4.6	
		28	Surface	1.0	25.3	22.1	22:1	7.86 7.84	7.85		108.4	108,3	0.82	0.83		3,2	2.6	
18/07/24	10:16:43		Middle	9.2	22.6	28.5	28.6	6.59	6.59	7.22	89.9	89.9	1.10	1,11	1.05	3.9	3.4	2.9
	1	/ Fine	Bottom	17.5	21.3	32.6	32,6	5,36	5.35	5.35	73.2	73.0	1.23	1.23		1.5	2,7	1
		Once	Surface	1.0	25.6	32.6 17.1	17,2	5.33 7.24	7.23		72.8 97.6	97.4	0.96	0.96		3.9	2,8	
20/07/24	11:47:44	30	Middle	9.4	22.8	17.2 28.4	28.4	7.21 6.69	6.88	7.05	97.1	94.1	0,96 1.05	1.06	1.15	1.8 3.6	4.2	3.8
20/07/24	11.97.99	/ Cloudy	_			28.4 32.7	925	6.42		6.41	93.9 89.1	_	1.07	1.44	200	4.7	4.5	""
			Bottom	17.9	22,2	32.7 27.5	32.7	6.39 5.41	6.41	6.41	88.7 74.7	88.9	1.45	_		4.7 6.6	-	-
		31	Surface	1.0	23.6	27.8 28.7	27.6	5.29	5,35	5.21	73.0 69.7	73.9	1.35	1.33		6.8	6.7	
23/07/24	14:36:54		Middle	8.9	23.2	28,5	28.6	5.10	5.08		70.5	70.1	2.51	2.47	2.20	6.5	6.5	6.2
		/ Fine	Boltom	16.3	23.2	28.6 28.8	28.7	5.21	5.16	5.16	71.9 70.4	71.2	2.78	2.79		5.6	5,4	_
		31	Surface	1.0	23.6	27.7	27.7	5,56 5,54	5.55	5,51	76.9 76.6	76.7	1,12	1.14		3.2 2.5	2.9	
25/07/24	15:37:31		Middle	8.4	23.4	28.2	28.3	5,48 5,45	5.47	10.	75.7 75.3	75.5	1.45	1.46	1.44	3.2	3.4	3.4
		/ Fine	Bottom	15.7	23,3	29.0 29.0	29.0	5.39 5.38	5.39	5.39	74.7	74.5	1.73	1.74		4.1 3.8	4.0	
		29	Surface	1.0	23.8	24.2	24.2	5.18 5.16	5.17		70.4 70.2	70.3	1.71	1.72		4.2 5.5	4,9	
27/07/24	16:41:40		Middle	8.5	23.5	29.8 29.8	29.8	5.12	5.11	5.14	71.5	71.3	1.65	1,66	1,76	5.3	4.4	4.6
		/ Cloudy	Bollom	16.1	23.4	30.0	30.0	4,97	4.96	4.96	69.6	69.4	1,90	1,91		3.7	4.5	
	-	5242	Surface	1,0	24.1	30.0 27.5	27.5	4.95 5.64	5.63		69.1 78.6	78.5	1.91	1.34		5.3 7.4	7.3	1
00/03/2:	7,40.10	28	_			27.5 28.8	-	5.62 5.39		5.50	78.3 74.8		1.35	1,67	1.02	7.2 5.8	6.5	7.0
29/07/24	7:48:48	/ Cloudy	Middle	8.6	23.5	28.8	28.8	5,36 4,95	5,38		74.5 69.0	74.7	1.65		1.63	7.2 8.3		- ""
		,	Bottom	16,3	23.3	30.0	30.0	4.94	4.95	4.95	68.8 82.1	68.9	1,89	1,88		6,0	7,2	_
		28	Surface	1.0	24.0	23.9	23.9	6.03	6,02	6.06	81.9	82.0	1.16	1,16		4,3	3,3	-
31/07/24	9:24:05		Middle	8.8	23.6	28.1	28.1	5,65 6.54	6.10	"	78.3 90.6	84.5	1.32	1.33	1.40	2.3	3.1	3.2
		/ Cloudy	Bottom	16.5	23.3	29.5 29.5	29.5	4.97	4.95	4.95	69.1 68.5	68.8	1.71	1.72		2,9	3,1	1

Monitoring Station :

TM-FM2



Date	Time	Ambient Temp (°C) / Weather		ng Depth m)	Temp (°C)	_	ty (ppl)	_	ved Oxygen			ed Oxygen Ilion (%)	Ti	ırbidity (NT		Suspe	nded Solid	A. E.
	-	Condition	ļ ,	, I	10	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth
		30	Surface	1.0	24.8	20.3	20.4	6.33	6.32	5.78	85.7 85.4	85.6	0.77	0.78		1.3	1.8	
02/07/24	9:48:23		Middle	9.3	23.1	28.4 28.4	28.4	5.26 5.22	5.24	0.70	72.4	72.1	0.98	1_00	1.05	3,1 3,8	3.5	2,7
		/ Fine	Boltom	17.6	22.6	30.5	30.5	4.79	4.77	4.77	66-1	65.8	1.36	1-37		3.0	2.7	İ
			Surface	1.0	24.4	30.5 19.8	19.8	4.75 6.98	0.07		65.5 93.5	02.4	1.37 0.66	0.05		2.4		H
		30	SUITACE	1.0	24,4	19.8 27.6	19,6	6.96 5.31	6.97	6.13	93.3	93.4	0.64	0.65		2.5	3.3	
04/07/24	11:25:53		Middle	9.4	23.1	27.6	27-6	5.28	5.30		72.7	72.5	0.87	0.88	0.97	3.6	3.5	3.4
		/ Fine	Bottom	17.5	22.7	30.7	30.7	4.66 4.65	4.66	4.66	64.5 64.4	64.5	1.39	1,39		3.0	3.5	
			Surface	1.0	25.2	25.5	25.5	7.45	7.44		104.6	104.5	0.36	0.37		1.1	1.9	
06/07/24	13:17:42	31	Middle	9.2	00.0	25.5 30.1	00.4	7.42 5.97		6.70	104.3 83.2	_	0.38	-		1.3		
00/07/24	13.17.42	/ Fine	IVIOOIB	9.2	23.3	30.1 31.3	30-1	5.94 5.19	5.98		82.8	83.0	0.78	0.77	0.85	1.8	1.6	1.8
		771116	Boltom	17.4	22.8	31.3	31,3	5.16	5.18	5,18	72.2	72.0	1-41	1.43		1.5	2.0	
		31	Surface	1.0	25.6	28.4	28.4	6.79 6.75	6.77		97.5 97.0	97.3	1.34	1.34		6.2	5.4	
09/07/24	15:37:00		Middle	8.6	23.4	31.2	31.2	6-12	6.10	6.44	86.0	85.8	1.74	1.75	1-68	6,7	7.7	6.5
		/ Fine		_		31.9	_	6.08 5.53			85.5 76.5	-	1.76	_		8.7 7.5		
			Bottom	16.0	22.3	31.9	31.9	5,50	5,52	5.52	76.2	76.4	1.97	1.96		5.5	6.5	_
		30	Surface	1.0	24,9	15.8 16.0	15,9	5.68	5.77	5.47	75.1 77.4	76.3	1.23	1,22		3.4	3.3	
11/07/24	16:08:06	-	Middle	8.0	23.4	24.1	24.1	5.05 5.31	5.18	3.47	68.1 71.8	69.9	1.39	1.35	1.29	3.2 2.7	3.0	3.2
		/ Fine	Bollom	14,9	21.7	30.6	30.7	4.38	4.30	4.30	59.5	58.4	1.28	1.32		3.9	3.3	
			-			30.7 19.0		4.22 6.49			57.2 87.2		1,35 0.71			2.7		-
		30	Surlace	1.0	24.8	19.3	19.2	6,41	6.45	6.15	85.8	86.5	0.70	0.71		4.7	3.8	
13/07/24	17:06:14		Middle	8.3	22-2	28.6 28.6	28.6	5.93 5.75	5.84		80.4 77.9	79.2	1.13	1,06	1,05	3.9	4.0	3.5
		/ Fine	Bollom	15.8	21.5	31.1 31.1	31.1	4.43	4.41	4.41	60.2 59.6	59.9	1.36	1.39		2-1	2.6	1
			Surlace	1.0	25.2	16.5	16.5	7.98	8.00		106.2	106.7	0.65	0.65		3.0 6.2	5.5	
		29			_	16.5 27.0		8.03 6.91	_	7.44	107.1 93.6	-	0.64 0.96	_		4.7 6.8	3.5	
16/07/24	9:15:08	(Fig.	Middle	8,3	22-7	27.1	27.0	6.85	6.88		92.7	93.2	0.92	0.94	0.86	7.5	7.2	6.0
		/ Fine	Boltom	15.8	21.3	31.8	31.8	5.39	5,38	5,38	73.2 73.1	73.2	1.02	1.01		6.1 4.4	5.3	
		28	Surface	1.0	25.3	22.6 22.7	22.6	7,65 7.61	7,63		105.8 105.1	105.5	0.74	0.75		1.8	2,5	
18/07/24	10:37:17		Middle	8.5	22,7	29.2	29.2	6.34	6.33	6.98	87.0	86.9	1.05	1.07	1.00	4.9	4.2	3.5
		/ Fine				29.2 33.2		6.32 5.17			86.7 70.9	7.1	1.08		1,00	3.5		0.0
			Bottom	15.8	21.4	33.2	33.2	5.15	5.16	5.16	70.7	70.8	1.19	1.18		4.0	3.9	
		30	Surface	1.0	25.7	16.9	16.8	6.96 6.94	6.95	6.74	93.8 93.4	93.6	0.94	0.95		3.1 4.1	3.6	
20/07/24	12:09:12		Middle	8.4	22.9	28.8	28.9	6.55 6.52	6.54	3.74	90.0 89.6	89.8	1.03	1.03	1.12	4.1 5.3	4.7	4.9
		/ Cloudy	Boltom	15,9	22,3	32,8	32.6	6.11	6.10	6.10	84.9	84.7	1,38	1.39		6.2	6.5	
			Surface	1.0	23.5	32.8 28.0	28,1	6.08 5.29			84.5 73.1		1.40	-		6.8		
		31	Sunace	1.0	23.5	28.2	26,1	5.22 5-13	5.26	5.18	72.1	72.6	1.56	1.52		6.1	5.1	
23/07/24	14:00:58		Middle	8.7	23.3	28.5 28.6	28.6	5.07	5.10		70.9	70,5	2.30	2,27	2.16	3.9	5,1	5,4
		/ Fine	Bollom	16.7	23.2	28.7	28.7	5.11	5.15	5.15	70.6 71.6	71.1	2.67	2,71		6.8 5.5	6.2	
		21	Surlace	1.0	23.6	27.6	27.6	5.37	5.37		74.2	74.2	1.22	1.23		1.6	2,3	
25/07/24	15:36:56	31	Middle	8.9	22.4	27.7 28.2	28.2	5.36 5.20	F 10	5.28	74.2 71.8	74.0	1.48	4.40	4.10	2.9	-	
23/01/24	15.36.56	/ Fine	MINOR	89	23.4	28.2 28.9	28:2	5.18 5.04	5.19		71.4 69.8	71.6	1.50	1.49	1.49	2.0	3.8	3.1
		, , , , , , ,	Bottom	16.7	23.3	28.9	28.9	5.03	5.04	5.04	69.6	69.7	1.76	1.74		2.7	3.3	
		29	Surface	1.0	23.8	24.0	24.0	5.07	5.07		68.9 68.7	68.8	1.72	1.73		3.2	3.2	
27/07/24	16:20:51		Middle	8.9	23.5	29.5	29.5	5.02	5.01	5.04	70.0	69.8	1.64	1.63	1.74	2,9	3.3	3.9
		/ Cloudy	Bollom	16.7	22.4	29,6 30.0	20.0	5.00 4.94	4.04	4.04	69.6 68.9	60.0	1.62			3,6 5,5		
			COLLOUI	16,7	23.4	30.0 27.3	30.0	4.93 5.65	4.94	4.94	68.8	68.9	1.87	1.86		5.3	5.4	
		28	Surface	1.0	24.1	27,3	27.3	5.65	5.64	5.48	78.6 78.5	78.6	1.36	1,37		7.0 5.4	6.2	
29/07/24	8:02:23		Middle	8.4	23.6	28.5 28.6	28.5	5.34 5.30	5.32	3,40	74.2 73.5	73.9	1.71	1.72	1.68	6.4	5.3	5.7
		/ Cloudy	Bottom	15.7	23.4	29.7	29.7	4.92	4.91	4.91	68.5	68.3	1.96	1.96		4.8	5.8	
				-		29.7 23.6	-	4.89 5.98			68-1 81.4	-	1.95		_	6.7 3.5		
		28	Surface	1.0	24.0	23.9	23.9	5.95	5.97	5.74	80.9	81,2	1.12	1.13		2.6	3.1	
31/07/24	9:43:04		Middle	8.4	23.6	28.1	28.1	5.52 5.50	5,51		76.5 76.3	76.4	1.43	1.45	1.47	3.5 5.4	4.5	3.4
		/ Cloudy	Bottom	15.8	23.3	29.4 29.5	29.5	5.04	5,03	5.03	70.0 69.6	69.8	1.82	1.83		3.0	2.8	li

### Mid-Ebb Tide

Monitoring Station:

TM-FC2




Data		Ambient Temp (°C) /	Monitoria	ng Depth	Тетр	Salinii	ly (ppl)	Dissolv	ed Oxygen	(mg/L)		d Oxygen lion (%)	Τι	ırbidity (NT	U)	Suspe	nded Solid	s (mg/L)
Date	Time	Wealher Condition		п)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth-
		30	Surface	1.0	24.8	20.4	20.4	6.53 6.50	6.52		68.4 67.9	88.2	0.78	0.79		4.1	3.4	
02/07/24	9:30:36		Middle	8.9	23.0	28.3	28.3	5,34	5.33	5,92	73.3	73,2	1.03	1.04	1.09	2.3	2.2	2,7
		/ Fine	Boltom	16.7	22.6	28.3 35.7	30.7	5.32 4.87	4.86	4.86	73.1 67.3	67.2	1.05	1.44		2,6	2.5	1
				15-2	-	30.7 19.5		4.85 7.06		1100	67 <sub>1</sub> 0 94 <sub>1</sub> 5		1.46 0.53			3.6		
		30	Surface	1.0	24,4	19,6	19.6	7.02	7,04	6.25	93.8	94.2	0.56	0,55		3.4	3,5	
04/07/24	11:05:19		Middle	9.0	23-0	27.4	27.4	5.47 5.43	5.45		74.7	74.4	0.79	0.81	0.86	4.1 3.5	3.8	3.5
		/ Fine	Boitom	17.0	22.7	30.6	30.6	4.74	4.73	4.73	65.6 65.3	65.5	1.22	1,23		3.4	3.2	
		31	Surlace	1.0	25.1	25.6	25.6	7,58	7.57		106.3	106.2	0,32	0.33		1.4	1.6	
06/07/24	13:00:22	31	Middle	9.2	23.4	25.6 30.2	30.2	7,56 6,03	6.02	6,80	106,0 84.3	84.1	0,34	0.70	0.80	1.8	2.5	1,8
	TOTOGEL	/ Fine	-	_		30,3	-	6.01 5.26			83.9 73.2		0.71 1.36			1.7		
			Bottom	17.3	22.8	31,4	31.3	5.22	5,24	5,24	72.7	73.0	1.39	1.3B		5.8	1.4	
		31	Surface	1.0	25.6	28,4 28,5	28.4	6.66 6.62	6.64	6.37	95.7 95.2	95.5	1.23	1.22		4.6	5.2	
09/07/24	16:00:20	-	Middle	8.5	23.5	31.3	31.3	6.13	6.11	0.07	86.3 85.6	86.0	1.56	1.54	1,50	6.9	5.7	5.4
		/ Fine	Boltom	16,0	22.4	32.0	32.0	5.43	5,43	5.43	75.3	75.3	1.72	1.74		4.5	5.3	
			Surface	1.0	25.1	32,0 15,0	15.1	5.42 5.93	6.02		75.2 78.3	79.5	1.75 1.16	1.17		6.0 2.1	2,3	
		30				15,1 24,2		6.10 5.13		5,63	80.6		1.17			4.1	-	
11/07/24	15:47:15	/51	Middle	8,4	23.4	24.1	24.2	5.34	5.24		71.9	70.6	1,27	1.25	1.17	5.9	5.0	3.9
		/ Fine	Boilom	15.8	21.8	30,1	30,3	4.19	4.24	4.24	58.2 56.8	57.5	1.18	1.11		5.5 3.2	4.4	
		30	Surlace	1.0	24.7	18.3	18.2	6.84	6.78		91.4	90.4	0.61	0.64		2.1	1.9	
13/07/24	17:23:00		Middle	6,8	23.1	24.0	23.9	6.48	6.51	6,64	86.9	87.4	1.11	1.13	1.08	4.6	4.3	3.5
		/ Fine	Bollom	14.5	21.7	23,8 30.4	30.6	6.54 4.70	4.67	4,67	87.9 63.8	63.4	1.15	1.46		4.0	4.2	
					-	30.8 16.5		4.63 8.07		4107	62.9 107.6		0.71	-		4.2 3.9		
		29	Surface	1.0	25,2	16.5	16.5	8.10	8.09	7.41	108.0	107,8	0,73	0.72	ļ	5.0	4.5	
16/07/24	9:33:08		Middle	8.2	22.6	27.5 27.5	27.5	6.76	6.73		91.7	91.3	1.04	1.06	0,93	3.6	4,3	5,2
		/ Fine	Bottom	15.1	21.6	31.2	31.2	5.57 5.48	5.53	5,53	75.8 74.6	75.2	1.05	1.03		7.0 6.6	6.8	
		-	Surlace	1.0	25.2	22.2	22.2	7.87	7.86		108.5	108.4	0.81	0.80		4.6	4.0	
18/07/24	11:00:33	28	Middle	8.4	22.7	22,3 28,8	28.8	7.85 6.64	6.62	7.24	90.9	90.7	0.79 1.13	1.13	1.05	3,3	3.4	3.7
10/07/24	11.00.00	/ Fine	_	-		28.8 33.0		6.60 5.39			90.4 74.0		1.12		1.03	3.3	-	3.7
			Bollom	15.6	21.5	33,0	33.0	5.38	5,39	5,39	73.7	73.9	1.23	1,22		2.9	3.7	
		30	Şurface	1.0	25.8	16,6 16.7	16.6	7.12	7.11	6.91	96.1 95.5	95.8	1.00	1.01		5.1	5.3	
20/07/24	12:31:39		Middle	8,2	23,0	28.7 28.8	28.8	6.73	6.72	0.51	92.6 92.2	92.4	1.16	1.17	1.18	4.8 5.5	5.2	4.9
		/ Cloudy	Bollom	15.4	22.4	32.6	32.6	6.27	8.27	6,27	87.3	87.3	1,36	1,38		4.2	4.3	
			Surface	1.0	23.6	32,8 27.6	27.8	6.28 5.42	5.39		87.2 74.9	74.4	1,39	1.33	-	3.7	3.9	
		31	_			27,9 28,3	-	5.35 5.26		5,31	73.9 72.6		1,34	-		4.1 6.1	-	
23/07/24	13:47:15		Middle	8.7	23,3	28.4	28.3	5.22	5,24		72.2	72.4	1,65	1.63	1.64	7,2	6.7	5,8
		/ Fine	Bollom	16.0	23.3	28,4 26.5	28.4	5.27 5.24	5.26	5.26	72.8 72.4	72.6	2.00 1.95	1.98		7,2 6,6	6,9	
		31	Surface	1.0	23.7	27.9 27.9	27.9	5.22 5.23	5.23		72.3 72.5	72.4	1.29	1,30		3.5 2.0	2.6	
25/07/24	15:00:48		Middle	8.6	23.4	28,4	28,5	5.16	5.15	5,19	71,4	71.2	1,52	1.53	1,53	2.6	2.2	3,3
		/ Fine	Bollom	16.2	23.3	28,5 29,0	29.0	5.03	5.01	5.01	71.1 69.7	69.4	1.74	1.76		5.0	4.9	1
			_			29.1		4.99 5.03		3.01	69.2 68.3		1.78			4.7 5.6		
		29	Surface	1.0	23.8	23,9	23.9	5.03	5,03	5.00	68.3	68.3	1,86	1,85		7,3	6,5	
27/07/24	16:02:26		Middle	8.7	23.5	29,3 29,3	29.3	4.98	4.98		69.3 69.2	69.3	1.63	1.63	1,85	4.7	4.5	4.8
		/ Cloudy	Bottom	16.5	23.4	29.8 29.8	29.8	4.95 4.92	4.94	4,94	69.0 68.6	68.8	2.05	2.07		3.0	3.4	
		225	Surface	1.0	24.2	27.2	27.2	5.81	5.81		80.9	80.9	1.27	1.28		6,3	5.7	
20/07/04	0.21.42	28	-			27.2 28,4		5.80 5.57		5,68	80.8 77.3		1.56	-	1 55	5.0 8.1	_	
29/07/24	8:21:43	/ Cloudy	Middle	8,1	23.6	28.5 29.8	28.4	5,54 5,12	5,56		76.9 71.4	77.1	1.57	1.57	1,55	9.9	9.0	7,3
		, Gloudy	Boltom	15.2	23.4	29.8	29.8	5.11	5.12	5_12	71.2	71,3	1.83	1.81		6.2	7.1	
		28	Surface	1.0	24.0	24.2	24.2	6.07	6,07	6.00	82.7 82.8	82.8	1.07	1.08		3.5 5.0	4.3	
31/07/24	10:03:35		Middle	8.2	23.7	28,4 28.4	28.4	5.69 5.68	5.69	5.88	79.1 79.0	79.1	1,33	1.35	1.35	3.4	2.5	3.6
		/ Cloudy	Bollom	15.2	23.4	29.7	29.7	5.13	5.11	5_11	71.5	71.2	1,62	1.64		3.2	4.0	1
	L		55,1011	,,,,,,	2014	29,7	1 -3.7	5.09	V.11		70.8		1,65			4.8		L




### Appendix C3

**Graphical Plots of Impact Marine Water Quality Monitoring Data** 


Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

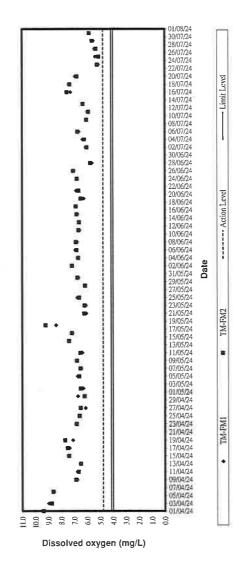


Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

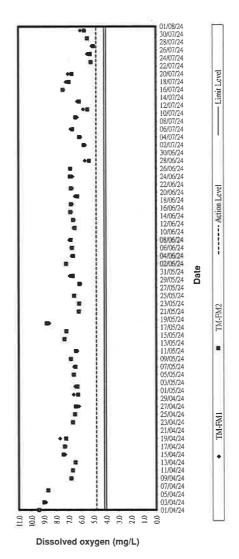


Dissolved Oxygen (Bottom) at Mid-Flood Tide

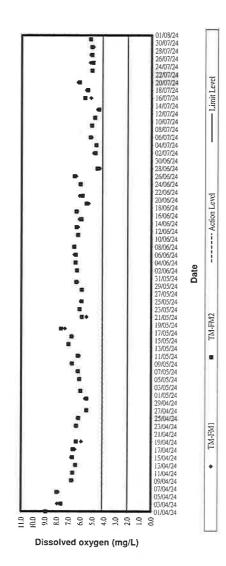


Dissolved Oxygen (Bottom) at Mid-Ebb Tide

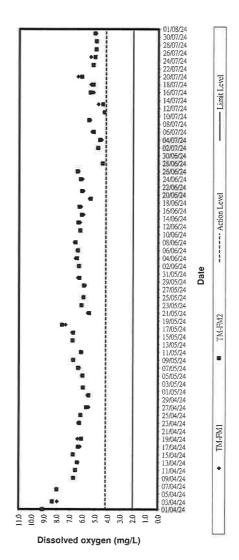

Turbidity (Depth-average) at Mid-Flood Tide

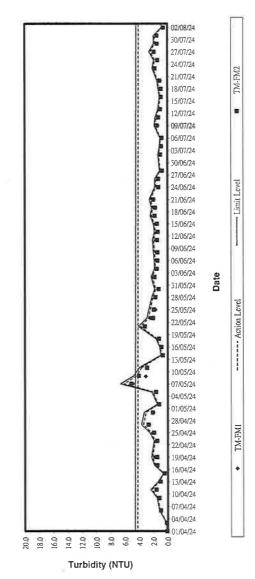


Turbidity (Depth-average) at Mid-Ebb Tide

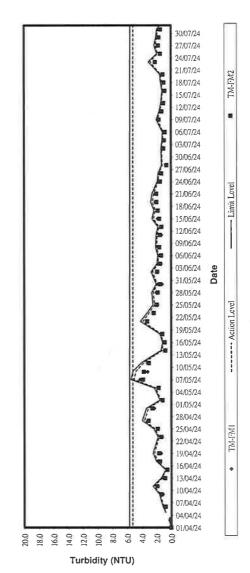




# Suspended solids (Depth-average) at Mid-Flood Tide

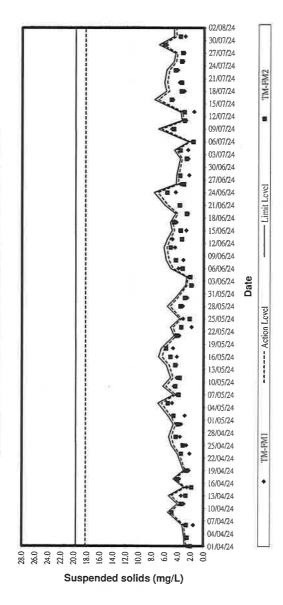


# Suspended Solids (Depth-average) at Mid-Ebb Tide

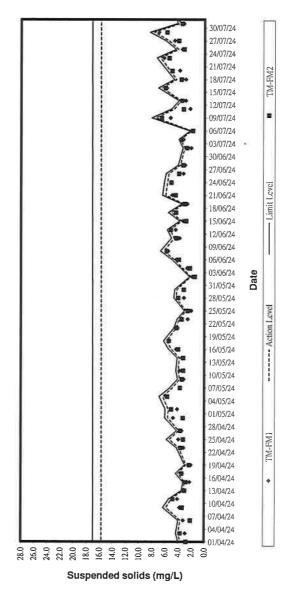




Turbidity (Depth-average) at Mid-Flood Tide

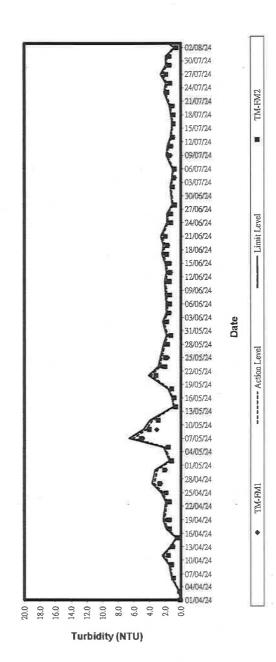


Turbidity (Depth-average) at Mid-Ebb Tide

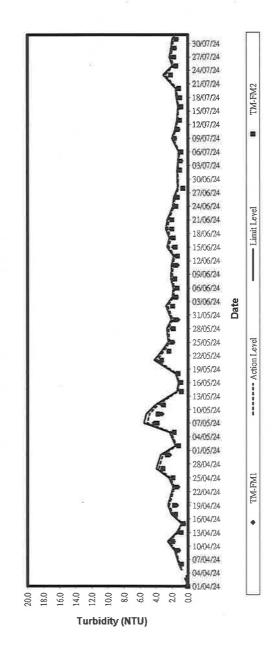




Suspended solids (Depth-average) at Mid-Flood Tide

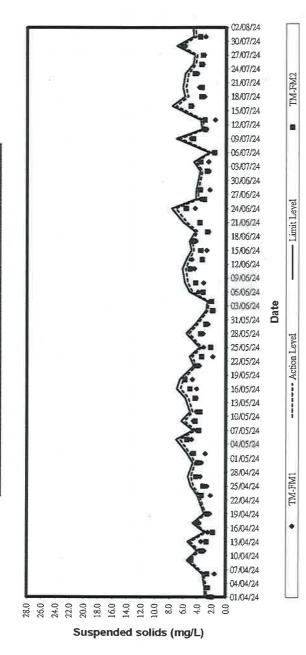

Suspended Solids (Depth-average) at Mid-Ebb Tide

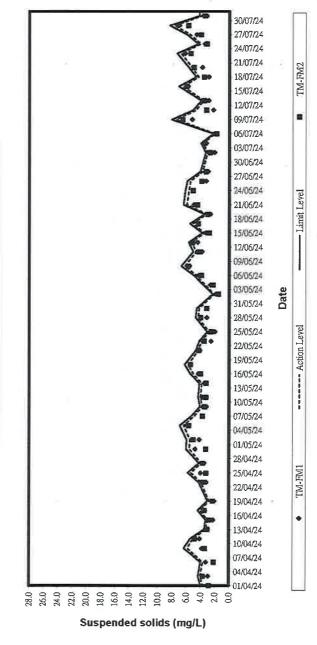



### Appendix D1

Calibration Certificates for Impact Noise Monitoring Equipments



34-36 Au Pul Wan Street.

F: +852 2695 3944 E: etl@ets-testconsult.com W: www.els-testconsult.com



Form Q/AS/C/02 Issue 1(1/4) [02/22]

### Calibration Certificate

Certificate No.

: CSA38446

### Information Provided by Customer

ETS - Testconsult Limited

Address

8/F., Block B, Veristrong Industrial Centre, 34 - 36 Au Pui Wan Street, Fotan, Shatin, Hong Kong

### Information of Unit-under-test (UUT)

Description

Sound Level Calibrator

Manufacturer

RION

Equipment I.D.

ET/EN/002/01

Type

NC-73

Serial No.

10196943

### Laboratory Information

Lab. Ref. No.

Q/CAL/23/9463/I

Date of Calibration Date of Issue

23-Nov-2023

24-Nov-2023

Procedure

: CQS/002/A

Date of Receipt

: 15-Nov-2023

Calibration Location

: Calibration Laboratory

### Calibration Condition

Ambient Temperature : (20 ± 3) °C

: 30 minutes

Stabilizing Time Ambient Pressure

: (1000 ± 50) hPa

Relative Humidity

: (50±20) %

Sampling

: As received

### Reference equipment

- Multi-function sound calibrator, ET/2801/01
- Measuring Amplifier, ET/2702/01/01
- Signal generator, ET/2503/01
- Reference Oscilloscope, ET/2502/01

### Calibration specification

- To perform the calibration of sound level calibrator,

### Calibration result

The results are detailed on the subsequent pages.

- The calibration results apply to the particular unit-under-test only.
- The values given in this calibration certificate only to the values measureed at the time of test & any uncertainties quoted will not include allowance for the equipment long term drift, varifications with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement

Calibrated By

Tony MA (Technician) Approved By:

CHAN Chi Wai

The results shown in this certificate are traceable to the International System of Units (SI) or recognised measurement standards. This report shall not be reproduced unless with prior written approval from this laboratory.



8/F Block B, Veristrong industrial Centre, 34-36 Au Pul Wan Street, Fo Tan, Hong Kong

T: +852 2895 8318 F: +852 2895 3944 E: at@ets-testconsult.com W: www.sts-testconsult.com



### **Calibration Certificate**

Certificate No. : CSA38446

Page : 2 of 2

### Calibration Result:

1. Measured Sound Pressure Level:

Nominal Frequency	Nominal Output	Measured Output (dB)	Expanded	Coverage
(Hz)	Sound Pressure (dB)		Uncertatiny (dB)	Factor
1000	94.0	93,9	0.13	2,0

2. Actual Output Frequency

Nominal Frequency	Nominal Output	Measured Output (Hz)	Expanded	Goverage
(Hz)	Sound Pressure (dB)		Uncertatiny (Hz)	Factor
1000	94.0	980.783	0.067	2.0

### Remark:

- The uncertainty quoted is based on 95 % confidence level.
- Measured output are mean of three measurements.

\*\*\*End of certificate\*\*\*



8/F Block B, Veristrong Industrial Centre, 34-36 Au Pul Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com



Form Q/AS/C/01 Issue 1(1/7) [09/21]

### **Calibration Certificate**

Certificate No.

: CSA40052

Page

1 of

3

### Information Provided by Customer

Customer

: ETS - Testconsult Limited

Address

: 8/F., Block B, Veristrong Industrial Centre, 34 - 36 Au Pui Wan Street, Fotan, Shalin, Hong Kong

### Information of Unit-under-test (UUT)

	Sound Level Meter	Microphone	Pre-amplifier	Sound Calibrator
Manufacturer	RION '	RION	RION	N/A
Туре	NL-31	UC-53A	NH-21	
Equipment I.D. no.	ET/EN/003/12		· 100 克尔尔 (1997)	
Serial No.	.00773032	01291	25043	ECHICA TO THE STATE OF
Adaptors used		空 空性差 / /		Charles and a second
Resolution	0.1 dB	Dignis (Hall)		

### Laboratory Information

Lab. Ref. No.

; Q/CAL/24/0052/I

Procedure

: CQS/001/A

Date of Calibration

: 11-Jan-2024

Date of Receipt

: 3-Jan-2024

Date of Issue

12-Jan-2024

Calibration Location

: Calibration Laboratory

### **Calibration Condition**

Ambient Temperature : (20 ± 3) °C

: 30 minutes

Relative Humidity

: (50 ± 20) %

Stabilizing Time Ambient Pressure

: (1000 ± 50) hPa

Sampling ; As received

### Reference equipment

- Multi-function sound calibrator, ET/2801/01
- Signal generator, ET/2503/01

### Calibration specification

- To perform the calibration of linearity and frequency response by multi-function sound calibrator.

### Calibration result

- The results are detailed on the subsequent pages.

### Remarks

- The calibration results apply to the particular unit-under-test only.
- The values given in this calibration certificate only to the values measureed at the time of test & any uncertainties quoted will
  not include allowance for the equipment long term drift, varifications with environmental changes, vibration and shock during
  transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement.

Calibrated By:

Tony MA (Technician)

Approved By:

CHAN Chi Wai

The results shown in this certificate are traceable to the International System of Units (SI) or recognised measurement standards. This report shall not be reproduced unless with prior written approval from this laboratory.



8/F Block B, Veristrong Industrial Centre, 34-36 Au Pul Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com



### **Calibration Certificate**

Certificate No. ; CSA40052

Page : 2 of 3

### Calibration Result:

1 Reference Sound Pressure Level : (Unit in: dB)

Ra	nge / Mode		Reference Level	REF Frequency (kHz)	UUT Reading	Deviation	Expanded Uncertatiny	Coverage Factor
	Self-cal		94.0		94.0	0.0	0.13	2.0
	Range	40 to 130	104.0	1	104.0	0.0	0.13	2.0
	Mode	Fast	114.0		114.0	0,0	0.13/	2.0
A-Weighting	Self-cal	到多观	94.0	VLV2	94.0	0.0	0.13	2.0
	Range	40 to 130	104.0	1	104.0	0.0	0.13	2.0
	Mode	Slow	114.0		114.0	0.0	0.13	2.0
	Self-cal	1 1 1	94.0		94.0	0.0	0.13	2.0
	Range	40 to 130	104.0	1	104.0	0.0	0.13	2,0
	Mode	Fast	114.0		114.0	0.0	0.13	2.0
C-Weighting	Self-cal		94.0		93.9	-0.1	0,13	2.0
	Range	40 to 130	104.0	1	103,9	-0.1	0.13	2,0
	Mode	Slow	114.0		113,9	0.0	0,13	2.0

2 Measurement for other range on reference sound pressure level: (Unit in: dB)

Rar	Range / Mode		Reference Level	REF Frequency (kHz)	UUT Reading	Deviation	Expanded Uncertatiny	Coverage Factor
	Range	30 to 120	94.0		94.0	0.0	0.13	2.0
Mode	Fast						I MELLON	
A Maratan Hara	Range	20 to 110	94.0		94.0	0.0	0.13	2.0
A-Weighting	Mode	Fast	34.0		91.0		9.10	
	Range	20 to 100	94.0		94.0	0.0	0.13	2.0
	Mode	Fast	94.0		5-9,U	9.0	9.19	

### Remark:

- The uncertainty quoted is based on 95 % confidence level.
- UUT reading are mean of three measurements.
- Deviation = UUT Reading Reference Level

\*\*\*



8/F Block B, Veristrong Industrial Centre, 34-36 Au Pul Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: et@ets-testconsult.com W: www.ets-testconsult.com



### **Calibration Certificate**

Certificate No.

CSA40052

Page

3 of 3

### Calibration Result:

Acoustic Sensitivity and Frequency Response:

3 Frequency Response A-Weighting (Unit In: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class : Specification
10,03003	first 20 Charles		31.5	54.6	54.5	-0.1	-39.4 +/- 2.0
100000			63	67.8	67.9	0.1	-26.2 +/- 1.5
			125	77.9	78.0	0.1	-16,1 +/- 1,5
			250	85.4	85.5	0.1	-8.6 +/- 1.4
		Galana	500	90,8	90.8	0.0	-3.2 +/- 1.4
40 to 130	Fast	94	1000 (Ref.)	94.0	94.0	0.0	0+/-1.1
			2000	95.1	95.0	-0.1	+1,2 +/- 1.8
0.05			4000	94.9	94.5	-0.4	+1.0 +/- 1.6
			8000	92.9	90.9	-2.0	-1.1 (+2.1 ; - 3.1)
THE REAL PROPERTY.		100000	12500	89.7	86.3	-3,4	-4.3 (+3.0 ; -6.0)
			16000	87.5	83.6	-3.9	-6.6 (+3.5 ; -17.0)

4 Frequency Response C-Weighting : (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class Specification
33(2)		W 32	31.5	91.0	90,9	-0.1	-3.0 +/- 2.0
	200		63	93.2	93.2	0.0	-0.8 +/- 1.5
			125	93.8	93.9	0.1	-0.2 +/- 1.5
			250	94.0	94.1	0.1	0.0 +/- 1.4
- 56			500	94.0	94.1	0.1	0.0 +/- 1.4
40 to 130	Fast	94	1000 (Ref.)	94.0	94.0	0.0	0 +/- 1.1
			2000	93.7	93.7	0.0	-0.2 +/- 1.8
1874			4000	93.1	92,7	-0.4	-0.8 +/- 1.6
			8000	91.0	89.0	-2.0	-3.0 (+2.1 ; -3.1)
			12500	87.8	84.4	-3.4	-6.2 (+3.0 ; -6.0)
LULA AVE			16000	85.6	81.7	-3.9	-8.5 (+3.5 ; -17.0)

- Expended uncertainty of measurement:

len bis	Range (Hz)	(dB)	Range (Hz)	(dB)
18 4 (10)	31.5	0.15	2000	0.13
Section 1	63	0.13	4000	0.13
94 dB	125	0.13	8000	0,14
94 06	250	0.12	12500	0.14
	500	0.12	16000	0.14
	1000	0.13		

Remark:

- Manufacturer specification
- IEC 61672 class 1
- Signal level at 1000 Hz is set as indication of reference sound pressure level.
- The uncertainty quoted is based on 95 % confidence level with coverage factor k=2,0.
- UUT reading are mean of three measurements.
- Deviation = UUT Reading Reference Level



8/F Block B, Veristrong Industrial Centre, 34-36 Au Pul Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com



Form Q/AS/C/01 Issue 1(1/7) [09/21]

### Calibration Certificate

Certificate No.

: CSA44621

Page

### Information Provided by Customer

ETS - Testconsult Limited

Address

8/F., Block B, Veristrong Industrial Centre, 34 - 36 Au Pui Wan Street, Fotan, Shatin, Hong Kong

### Information of Unit-under-test (UUT)

	Sound Level Meter	Microphone	Pre-amplifler	Sound Calibrator
Manufacturer	RION	RION	RION	N/A
Туре	NL-52	UC-59	NH-25	2000 C C C
Equipment I.D. no.	ET/EN/003/17			
Serial No.	00264519	03558	64644	
Adaptors used				
Resolution	0.1 dB			

### Laboratory Information

Lab. Ref. No.

Date of Issue

: Q/CAL/24/5138/I

: CQS/001/A

Date of Calibration

s 16-Jul-2024

Date of Receipt

: 25-Jun-2024

18-Jul-2024

Calibration Location

: Calibration Laboratory

### Calibration Condition

Ambient Temperature : (20 ± 3) °C

Relative Humidity

: (50 ± 20) %

Stabilizing Time Ambient Pressure

: (1000 ± 50) hPa

Sampling

: As received

### Reference equipment

- Multi-function sound calibrator, ET/2801/01
- Signal generator, ET/2503/01

### Calibration specification

To perform the calibration of linearity and frequency response by multi-function sound calibrator,

### Calibration result

- The results are detailed on the subsequent pages.

### Remarks

- The calibration results apply to the particular unit-under-test only.
- The values given in this calibration certificate only to the values measureed at the time of test & any uncertainties quoted will not include allowance for the equipment long term drift, varifications with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement

Calibrated By:

Tommy TAM (Technician) Approved By:

**CHAN Chi Wai** 



6/F Block B, Veristrong Industrial Centre, 34-36 Au Pul Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com



**Calibration Certificate** 

Certificate No. : CSA44621

Page: 2 of

### Calibration Result:

1 Reference Sound Pressure Level : (Unit in: dB)

Ra	nge / Mode		Reference Level	REF Frequency (kHz)	UUT Reading	Deviation	Expanded Uncertatiny	Coverage Factor
	Self-cal		94.0		93.9	-0,1	0.13	2.0
	Range	30 to 130	104.0	1	103.9	-0.1	0.13	2.0
A 144-1-1-1	Mode	Fast	114.0		113,9	-0.1	0.13	2.0
A-Weighting	Self-cal	H Section	94.0		93,8	-0,2	0.13	2.0
	Range	30 to 130	104.0	1 1	103,9	-0.1	. 0.13	2.0
	Mode	Slow	114.0		113.9	-0.1	0,13	2.0
	Self-cal		94.0	KANTI.	93,8	-0.2	0.13	2.0
	Range	30 to 130	104,0	16 5	103.9	-0.1	0.15	2.0
	Mode	Fast	114.0		113.8	-0.2	0.13	2,0
C-Weighting	Self-cal	1	94,0		93,8	-0.2	0.13	2.0
	Range	30 to 130	104.0	1	103.9	-0.1	0.15	2.0
	Mode	Slow	114.0		113.9	-0.1	0.13	2.0
	Self-cal		94.0		93.8	-0.2	0.13	2.0
	Range	30 to 130	104.0	1	103.9	-0.1	0.13	2,0
	Mode	Fast	114.0		113,9	0.1	0,13	2.0
Z-Weighting	Self-cal	100	94.0		93.8	-0.2	0,13	2,0
	Range	30 to 130	104.0	1	103.9	-0.1	0.13	2.0
	Mode	Slow	114.0		113.9	-0.1	0,13	2.0

### Remark:

- The uncertainty quoted is based on 95 % confidence level.
- UUT reading are mean of three measurements.
- Deviation = UUT Reading Reference Level

...



8/F Block B, Veristrong Industrial Centre, 34-36 Au Pul Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: ell@ets-testconsult.com W: www.ets-testconsult.com



### **Calibration Certificate**

Certificate No.

CSA44621

Page

### Calibration Result:

Acoustic Sensitivity and Frequency Response:

2 Frequency Response A-Weighting (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	Expanded Uncertainty	Coverage Factor
	West and		31.5	54.6	32.2	-22,4	0.15	2,0
			63	67.8	50.0	-17.8	0.13	2.0
1.00			125	77.9	65,5	-12.4	0,13	2.0
			250	85,4	78.1	-7.3	0.12	2.0
			500	90.8	07.8	-3,0	0.14	2.0
30 to 130	Fast	94	1000 (Ref.)	94.0	93.8	-0.2	0.13	2.0
			2000	95,1	95.0	-0,1	0.13	2,0
			4000	94.9	93.5	-1.4	0.13	2.0
			8000	92.9	89,6	-3,3	0.14	2,0
	ment H		12500	89.7	63,4	-6.3	0.14	2.0
			16000	87.5	79.5	-8,0	0,14	2.0

### 3 Frequency Response C-Weighting (Unit In: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	Expanded Uncertainly	Coverage Factor
			31.5	91,0	67.6	-23.4	0.15	2.0
212			63	93.2	75.4	-17.8	0.15	2.0
			125	93.8	81.6	-12.2	0.15	2.0
			250	94.0	86,8	-7,2	0,12	2.0
3.951		BALLA	500	94.0	91.2	-2,8	0.12	2.0
30 to 130	Fast	94	1000 (Ref.)	94.0	93.8	-0.2	0.13	2.0
			2000	93.7	93.6	-0.1	0,13	2.0
			4000	93.1	91.7	-1.4	0.13	2.0
			8000	91.0	87.7	-3.3	0.14	2,0
			12500	87.8	81.5	-6.3	0.14	2,0
		120 3	16000	85,6	77.5	-8.1	0,14	2.0

### 4 Frequency Response Z-Weighting (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Devlation	Expanded Uncertainty	Coverage Factor
S			31.5	94.0	70.6	-23.4	0.14	2.0
			63	94,0	76.3	-17.7	0,15	2,0
			125	94.0	81,8	-12.2	0,15	2,0
			250	94.0	86.8	-7.2	0.14	2.0
1			500	94.0	91.1	-2,9	0.12	2.0
30 to 130	Fast	94	1000 (Ref.)	94.0	93.8	-0.2	0,13	2.0
190114			2000	94.0	93.8	-0.2	0,13	2.0
			4000	94.0	92,5	-1,5	0.13	2,0
100			8000	94.0	90,6	-3,4	0.14	2,0
	1-1-12		12500	94.0	0;88	-6.0	0,14	2.0
			16000	94.0	87,2	-6.8	0.14	2.0

Remark

- Signal level at 1000 Hz is set as indication of reference sound pressure level.
- The uncertainty quoted is based on 95 % confidence level with coverage factor k=2.0.
- UUT reading are mean of three measurements.
- Deviation = UUT Reading Reference Level



8/F Block B, Veristrong Industrial Centre, 34-36 Au Pul Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com



Form Q/AS/C/01 Issue 1(1/7) [09/21]

### **Calibration Certificate**

Certificate No.

: CSA42566

Page

1 0

3

### Information Provided by Customer

Customer

ETS - TESTCONSULT LIMITED

Address

8/F., Block B, Veristrong Industrial Centre, 34 - 36 Au Pul Wan Street, Fotan, Shatin, Hong Kong

### Information of Unit-under-test (UUT)

	Sound Level Meter	Microphone ·	Pre-amplifier	Sound Calibrator
Manufacturer'	RION ,	RION		N/A
Туре	NL-52	UC-59	NH-25	
Equipment I.D. no.	ET/EN/003/18			
Serial No.	00264520	09668	64646 **	7.23
Adaptors used		Sand Mass Confiden		
Resolution	0.1 dB			

### Laboratory Information

Lab. Ref. No.

Date of Issue

Q/CAL/24/2856/I

Procedure

: CQS/001/A

Date of Calibration : 1

18-Apr-2024 19-Apr-2024 Date of Receipt
Calibration Location

: 11-Apr-2024 : Calibration Laboratory

### Calibration Condition

Ambient Temperature

mperature : (20 ± 3) °C

Stabilizing Time Ambient Pressure : 30 minutes : (1000 ± 50) hPa Relative Humidity

: (50 ± 20) %

Sampling

: As received

### Reference equipment

- Multi-function sound calibrator, ET/2801/01
- Signal generator, ET/2503/01

### Calibration specification

- To perform the calibration of linearity and frequency response by multi-function sound calibrator.

### Calibration result

- The results are detailed on the subsequent pages.

### Remarks

- The calibration results apply to the particular unit-under-test only.
- The values given in this calibration certificate only to the values measureed at the time of test & any uncertainties quoted will
  not include allowance for the equipment long term drift, varifications with environmental changes, vibration and shock during
  transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement.

Calibrated By ;

Tommy TAM (Technician) Approved By:

CHAN Chi Wai

The results shown in this certificate are traceable to the international System of Units (SI) or recognised measurement standards. This report shall not be reproduced unless with prior written approval from this laboratory.



8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 6318 F: +852 2695 3944 E: ell@els-lestconsult.com W: www.ets-lestconsult.com



### Calibration Certificate

Certificate No. : CSA42566

nn - 2 of 2


### Calibration Result:

1 Reference Sound Pressure Level : (Unit in: dB)

Ra	nge / Mode	A N	Reference Level	REF Frequency (kHz)	UUT Reading	Deviation	Expanded Uncertaliny	Coverage Factor
	Self-cal		94.0		93.9	-0.1	0.13	2,0
	Range	30 to 130	104.0	1	104.0	0.0	0,13	2,0
A Mainhtine	Mode	Fast	114.0		114,0	0.0	0.13	2.0
A-Weighting	Self-cal	*	94.0		93,9	0,1	0.13	2.0
	Range	30 to 130	104.0	1	104.0	0.0	0.13	2.0
	Mode	Slow	114.0		114.0	0.0	0.13	2.0
	Self-cal	ly and the	94.0		93,9	-0.1	0.13	2.0
	Range	30 to 130	104.0	1	104.0	0.0	0.13	2.0
C-Weighting	Mode	Fast	114.0		114,0	0.0	0.13	2.0
C-vveignting	Self-cal		94,0		93.9	-0.1	0.13	2.0
	Range	30 to 130	104.0	1	104.0	0.0	0.13	2.0
	Mode	Slow	114.0		114.0	0.0	0.13	2.0
	Self-cal	10.00	94.0		93.9	-0.1	0.13	2,0
	Range	30 to 130	104.0	1 1	103.9	-0.1	0.13	2.0
710/-1-11	Mode	Fasi	114.0		113.9	-0.1	0.13	2.0
Z-Weighting	Self-cal		94.0		93.9	-0.1	0.13	2.0
	Range	30 to 130	104.0	1	103,9	-0.1	0.13	2.0
	Mode	Slow	114.0		113.9	-0.1	0.13	2.0

### Remark:

- The uncertainty quoted is based on 95 % confidence level.
- UUT reading are mean of three measurements.
- Deviation = UUT Reading Reference Level



Veristrong Industrial Centre, 34-36 Au Pul Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: elt@els-testconsult.com W: www.els-testconsult.com



### **Calibration Certificate**

Form Q/AS/C/01 Issue 1(3/7) [09/21]

Certificate No.

CSA42566

### Calibration Result:

### Acoustic Sensitivity and Frequency Response:

### 2. Frequency Response A-Weighting (Unit in: dB)

Range	Made	Applied Level	Frequency (Hz)	Reference Lavel	UUT Reading	Deviation	IEC 61672-1:2002 class 1 Specification
	construction		31,5	54.6	54.8	0.2	-39,4 +/- 2.0
			63	67.8	67.9	0.1	-28.2 +/- 1.5
and Allenda	188711		125	77.9	77.9	0.0	-15.1 +/- 1.5
0.2			250	85.4	65.4	0.0	-8.6 +/- 1.4
	THE ME		500	90.8	90.7	-0.1	-3.2 +/- 1.4
30 to 130	Fast	94	1000 (Ref.)	94.0	93.9	-0,1	0 +/- 1.1
I Hatel			2000	95,1	95.1	0.0	+1.2 +/- 1,6
			4000	94.9	95,0	0.1	+1.0 +/- 1.6
E - 61 (-)		Transaction of the	8000	92.9	93.2	0.3	-1.1 (+2.1 ; - 3.1)
1120			12500	89.7	88.4	-1,3	-4,3 (+3,0 ; -8.0)
With the Park	E COLUMN		16000	87.5	84.8	-2,7	-5,8 (+3.5; -17,0)

### 3 Frequency Response C-Weighting : (Unit in; dB)

Range	Mode	Applied Level	Fraquency (Hz)	Reference Level	UUT Reading	Deviation	IEG 61672-1:2002 class Specification
			31.5 91.0		90,9	-0.1	-3,0 +/- 2,0
DOM: DOM:	Fast		63	93,2	93.2	0.0	-0,8 +/- 1,5
			125	93.8	93,9	0.1	-0.2 +/- 1,5
		A 200, A1 1 20	250	94.0	94,0	0,0	0,0 +/- 1.4
			500	94,0	84,0	0.0	0,0 +/- 1,4
30 to 130		94	1000 (Ref.)	94.0	93.9	-0.1	0 +/- 1.1
SAMAGE HARE			2000	93,7	93.7	0,0	-0.2 +/- 1,8
			4000	93.1	93.2	0.1	-0,8 +/- 1.6
		MILE ST	8000	91,0	91,3	0.3	-3.0 (+2.1 ; -3.1)
			12500	87.8	86,5	-1.3	-6.2 (+3.0 ; -6.0)
		142 Bus.	16000	85,6	82,8	-2.8	-8.5 (+3.5 ; -17.0)

### Frequency Response Z-Weighting : (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class 1 Specification
TAIL BUT	and the state of	503/63/mm	31.5	94.0	94,0	0.0	0.0 +/- 2.0
			63	94;0	94,1	0,1	0,0 +/- 1,5
			125	94.0	94,0	0.0	0.0 +/- 1,5
			250	94,0	94,0	0.0	0.0 +/- 1,4
			500	94.0	93,9	-0.1	0.0 +/- 1.4
30 to 130	Fast	94	1000 (Ref.)	94,0	93.9	-0.1	0 +/- 1.1
			2000	94,0	93,8	-0.2	0,0 +/- 1,6
			4000	94,0	94.0	0.0	0,0 +/- 1.6
= (==)		L	8000	94,0	94,2	0.2	0.0 (+2,1; -3,1)
			12500	94.0	93,0	-1,0	0.0 (+3,0; -8.0)
			16000	94,0	92.5	-1,5	0.0 (+3.5 ; -17.0)

THE TEST	Range (Hz)	(dB)	Range (Hz)	(dB)
	31,5	0.15	2000	0,13
-8.	63	0.15	4000	0.13
	125	0,15	8000	0.14
4 dB	250	0,12	12500	0.14
	500	0.12	16000	0,14
	1000	0.13		

- IEC 61672 class 1
- Signal level at 1000 Hz is set as indication of reference sound pressure level.
- The uncertainty quoted is based on 95 % confidence level with coverage factor k=2.0,
- · UUT reading are mean of three measurements,
- Deviation = UUT Reading Reference Level



# Appendix D2 Impact Noise Monitoring Results



### **Day-time Noise Monitoring**

Monitoring Location: TM-RN1 \*

Date	Start Sampling	Noi	se Level dB	(A)	Wind	Major Noise	Weather Condition
Date	Time (hh:mm)	Leq(30min)	L <sub>10</sub>	L <sub>90</sub>	Speed (m/s)	Sources	
2/7/2024	11:00	57.1	58.2	56.3	0.2	General site work	Sunny
4/7/2024	11:25	57.1	58.3	54.5	0.2	General site work	Sunny
9/7/2024	9:30	57.0	58.5	54.1	0.2	General site work	Fine
11/7/2024	11:00	57.1	58.3	54.5	0.2	General site work	Sunny
16/7/2024	8:25	56.7	58.2	54.3	0.2	General site work	Sunny
18/7/2024	9:00	57.1	58.2	54.5	0.2	General site work	Sunny
23/7/2024	9:40	58.1	59.7	54.4	0.2	General site work	Fine
25/7/2024	9:40	57.7	59.1	54.6	0.2	General site work	Cloudy
30/7/2024	9:30	57.4	58.8	54.9	0.2	General site work	Cloudy

Remark: Since Lands Department did not approve us to enter their own area where the noise monitoring stations TM-N1 located due to the security, noise monitoring was carried out at noise monitoring stations TM-RN1 (refer to the figure 3 attached) in this reporting month.

### Monitoring Location: TM-RN2 \*

Date	Start Sampling	Noise Level dB (A)			Wind Speed	Major Noise Sources	Weather Condition
Date	Time (hh:mm)	Leq(30min)	L <sub>10</sub>	(m/c)			
2/7/2024	11:05	57.2	57.8	55.2	0.2	General site work	Sunny
4/7/2024	11:30	58.1	59.2	54.3	0.2	General site work	Sunny
9/7/2024	9:35	57.7	59.2	55.0	0.2	General site work	Fine
11/7/2024	11:05	57.5	58.1	54.2	0.2	General site work	Sunny
16/7/2024	8:30	57.6	58.0	54.6	0.2	General site work	Sunny
18/7/2024	9:35	57.1	58.2	54.5	0.2	General site work	Sunny
23/7/2024	9:45	59.2	60.3	55.8	0.2	General site work	Fine
25/7/2024	9:45	58.2	59.8	55.1	0.2	General site work	Cloudy
30/7/2024	9:35	58.1	59.7	55.3	0.2	General site work	Cloudy

Remark: Since Lands Department did not approve us to enter their own area where the noise monitoring stations TM-N2 located due to the security, noise monitoring was carried out at noise monitoring stations TM-RN2 (refer to the figure 3 attached) in this reporting month.




# Appendix D3

**Graphical Plots of Impact Noise Monitoring Data** 



### Noise Monitoring (Day-time)

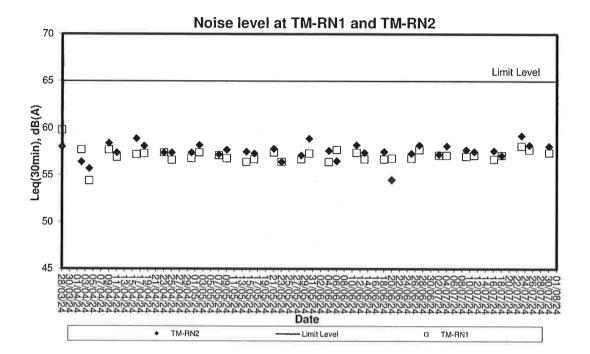



Appendix E
Weather Condition

Daily Extract of Meteorological Observations , July 2024 - Tuen Mun

The second secon	Daily Extract of Wetcorological Observations, July 2024 - Tuell Wall								
	Mean	les de			Mean	Mean	Total	Prevailing	Mean
	Pressure	Ai	r Temperati	ire	Dew	Relative	Rainfall	Wind	Wind
X X III	(hPa)				Point	Humidity	(mm)	Direction	Speed
Day		Absolute	Mean	Absolute	(deg. C)	(%)		(degrees)	(km/h)
		Daily	(deg.C)	Daily					
		Max	(40-8-0)	Min				300	- 単
Sec. 18		(deg. C)		(deg. C)					
1	1005.4	32.4	30.6	29.3	26.4	78	2.5	210	31.5
2	1006.9	32.7	30.5	29.1	26.4	79	5.3	190	28.8
3	1011.5	33.6	30.5	28.7	26.1	78	191	100	12.7
4	1011.8	32.5	30.2	27.7	25.9	78	5.1	130	6.1
5	1008.8	34.6	30.7	28.5	25.9	76	1.5	110	3.6
6	1008.2	34	30.8	29.2	26.3	77	0.2	120	8.5
7	1008.9	34.8	31.6	29.6	26.3	74	Trace	160	14.7
8	1008.2	34.4	31.1	29.5	25.4	72	0.2	220	11.8
9	1008.3	34.3	31	28.9	25.3	72	Trace	190	11.7
10	1008.6	34.5	30.6	27	25.6	75	10.7	180	9.7
11	1006.8	32.2	30.2	28.5	25.9	78	6.5	180	13.1
12	1004.8	31.7	29.5	27.4	26.4	84	24.4	170	11.6
13	1005.3	33.8	30.7	27.7	26	76	8	160	16.3
14	1007.3	34.6	30.3	26.7	26.7	82	90	90	24
15	1008.4	33	29.7	27.9	26.8	85	13.6	90	25.6
16	1008.5	30.4	29	26	26.4	86	15.7	90	20.8
17	1008.9	32.7	29.5	26.7	26.1	83	13.7	100	16.7
18	1009.1	30.9	28,4	26.7	26.1	88	19.6	100	16.4
19	1007.5	30.8	29	27.1	27	89	40.5	80	11.1
20	1007.5	33.5	30.3	29	27.5	85	3.7	80	23.7
21	1007.1	32.1	30.1	28.6	27	83	4.7	90	23.9
22	1005,3	33.5	30.6	29	26.8	80	0.2	90	16.7
23	1001.6	33.3	30.7	28.8	25.9	76		230	14.2
24	996.9	32.7	30.3	28.7	26.3	80	Son Asses	260	22.3
25	992.2	33.1	30.9	29.5	26.6	78	Trace	250	47.5
26	995.2	30.3	29.8	28.9	27	85	3.9	240	39.3
27	1002.8	30.2	28.7	27	26.4	88	34.7	220	24.5
28	1005.9	27.8	27.1	26.4	26	94	69.4	110	17.8
29	1006.1	29.6	27.6	26.6	25.6	89	6.7	110	20.5
30	1006	30.3	27.6	26.1	25.6	89	29.5	110	10.8
31	1007.7	30.2	28.1	26.2	25.9	88	48.2	200	17.5

Rainfall measured in increment of 0.5 mm. Amount of < 0.5 mm cannot be detected



Appendix F

Event-Action Plans

EVENT	EVENT/ACTION PLAN FOR AIR QUALITY EXCEEDANCE										
		ACTION									
	ET Leader	IC(E)	ER	Contractor							
	<u> </u>	ACTION LEVEL									
Exceedance for one sample	Identify source, investigate the causes of exceedance and propose remedial measures     Inform ER, IC(E) and Contractor     Repeat measurement to confirm finding     Increase monitoring frequency to daily	Check monitoring data submitted by the ET     Check contractor's working method	Notify Contractor	Rectify any unacceptable practise     Amend working methods if appropriate							
2. Exceedance for two or more consecutive samples	of exceedance and propose remedial measures 2. Inform IC(E) and Contractor 3. Repeat measurements to confirm finding 4. Increase monitoring frequency to daily	Check monitoring data submitted by the ET Leader     Check the Contractor's working method     Discuss with ET and Contractor on possible remedial measures     Advise the ER on the effectiveness of the proposed remedial measures     Supervise implementation of remedial	Confirm receipt of notification of failure in writing     Notify the Contractor     Ensure remedial measures properly implemented	Submit proposals for remedia actions to IC(E) within 3 working days of notification     Implement the agreed proposals     Amend proposal if appropriate							
	<ol> <li>Discuss with IC(E) and Contractor on remedial actions</li> <li>If exceedance continues, arrange meeting with IC(E) and ER.</li> <li>If exceedance stops, cease additional monitoring</li> </ol>	measures									
		LIMIT LEVEL	Confirm receipt of notification	1. Take immediate action to							
Exceedance for one sample	Identify source, investigate the causes of exceedance and propose remedial measures     Inform ER, Contractor and EPD     Repeat measurement to confirm finding     Increase monitoring frequency to daily     Assess the effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results	Check monitoring data submitted by the ET Leader     Check Contractor's working method     Discuss with ET and Contractor on possible remedial measures     Advise the ER on the effectiveness of the proposed remedial measures     Supervise implementation of remedial measures	of failure in writing  Notify the Contractor  Ensure remedial measures properly implemented	avoid further exceedance  2. Submit proposals for remedia actions to IC(E) within 3 working days of notification  3. Implement the agreed proposals  4. Amend proposal if appropriate.							

\$ 8 0

E	VENT		EVENT/ACTION PLAN FOR AIR QUA	ALITY EXCEEDANCE	
		ET Leader	ACTION IC(E)	ER	Contractor
2	. Exceedance for two or more consecutive samples	<ol> <li>Identify source, investigate the causes of exceedance and propose remedial measures</li> <li>Notify IC(E), ER, EPD and Contractor</li> <li>Repeat measurement to confirm finding</li> <li>Increase monitoring frequency to dally</li> <li>Carry out analysis of contractor's working procedures to determine possible mitigation to be implemented</li> <li>Arrange meeting with IC(E) and ER to discuss the remedial actions to be taken</li> <li>Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results</li> <li>If exceedance stops, cease additional monitoring</li> </ol>	Discuss amongst ER, ET and Contractor on the potential remedial actions     Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly     Supervise the implementation of remedial measures	1. Confirm receipt of notification of failure in writing 2. Notify Contractor 3. In consultation with the IC(E), agree with the Contractor on the remedial measures to be implemented 4. Ensure remedial measures are properly implemented 5. If exceedances continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated	1. Take immediate action to avoid further exceedances 2. Submit proposals for remedial actions to IC(E) within 3 working days of notification 3. Implement the agreed proposals 4. Resubmit proposals if problem still not under control 5. Stop the relevant activity of works as determined by the ER until the exceedance is abated

2

(<del>)</del>

₩.

In I have been some book board on some book board on a contraction of the source of and some of a state of the source of the sou

56

8

±i

EVENT		EVENT/ACTION PLAN FO		
	ET Leader	IC(E)	ER	Contractor
Action Level	Notify the IC(E) and the Contractor.     Carry out investigation.     Report the results of investigation to the IC(E) and the Contractor.     Discuss with the Contractor and formulate remedial measures.     Increase monitoring frequency to check mitigation effectiveness	Review the analysed results submitted by the ET.     Review the proposed remedial measures by the Contractor and advise the ER accordingly.     Supervise the implementation of remedial measures.	Confirm receipt of notification of failure in writing.     Notify the Contractor.     Require the Contractor to propose remedial measures for the analysed noise problem.     Ensure remedial measures are properly implemented.	Submit noise mitigation proposals to IC(E).     Implement noise mitigation proposals.
Limit Level	<ol> <li>Notify the IC(E), the ER, the EPD and the Contractor.</li> <li>Identify source.</li> <li>Repeat measurement to confirm findings.</li> <li>Increase monitoring frequency.</li> <li>Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented.</li> <li>Inform the IC(E), the ER and the EPD the causes &amp; actions taken for the exceedances.</li> <li>Assess effectiveness of Contractor's remedial actions and keep the IC(E), the EPD and the ER informed of the results</li> <li>If exceedance due to the construction works stops, cease additional monitoring</li> </ol>	<ol> <li>Discuss amongst the ER, the ET Leader and the Contractor on the potential remedial actions.</li> <li>Review the Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly.</li> <li>Supervise the implementation of remedial measures.</li> </ol>	1. Confirm receipt of notification of failure in writing. 2. Notify the Contractor. 3. Require the Contractor to propose remedial measures for the analysed noise problem. 4. Ensure remedial measures are properly implemented. 5. If exceedances continue, consider what activity of the work is responsible and instruct the Contractor to stop that activity of work until the exceedances is abated.	1. Take immediate action to avoid further exceedance 2. Submit proposals for remedial actions to IC(E) within 3 working days of notification. 3. Implement the agreed proposals. 4. Resubmit proposals if problem still not under control. 5. Stop the relevant activity of works as determined by the ER until the exceedances is abated.

2.5

Event	EVEN	T AND ACTION PLAN FOR W ACTIO		E
	ET Leader	Contractor	ER	IEC
Action level being exceeded by one sampling day	Identify source(s) of impact;     Repeat in-situ measurement to confirm findings;     Notify Contractor in writing within 24 hours of identification of the exceedance     Check monitoring data, all plant, equipment and Contractor's working methods;     Carry out Investigation     Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works     Discuss mitigation measures with Contractor if exceedance is due to the construction works within 4 working days     Repeat measurement on next day of exceedance if exceedance is due to the construction works	1. Notify the ER and IEC in writing within 24 hours of identification of exceedance 2. Rectify unacceptable practice; 3. Check all plant and equipment; 4. Submit investigation report to IEC and ER within 3 working days of the identification of an exceedance 5. Consider changes of working method if exceedance is due to the construction works 6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER if exceedance is due to the construction works within 4 working days of identification of an exceedance 7. Implement the agreed mitigation measures within reasonable time scale	1. Notify EPD and other relevant governmental agencies in writing within 24 hours of the identification of the exceedance 2. Discuss with IEC, ET and Contractor on the proposed mitigation measures; 3. Require contractor to propose remedial measures for the analysed problem if related to the construction works 4. Ensure remedial measures are properly implemented 5. Assess the effectiveness of the mitigation measure	1. Check monitoring data submitted by ET 2. Confirm ET assessment if exceedance is due / not due to the works 3. Discuss with ET, ER and Contractor on the mitigation measures 4. Review contractor's mitigation measures whenever necessary to ensure their effectiveness and advise the ER accordingly 5. Supervise the implementation of mitigation measures

\*

to the state of th

¥

Event		EVENT AND ACTION PLAN	FOR WATER QUALITY	
		ACTIC	DN	
	ET Leader	Contractor	ER	IEC
Action level being exceeded by more than one consecutive sampling days	<ol> <li>Identify source(s) of impact;</li> <li>Repeat in-situ measurement to confirm findings</li> <li>Notify Contractor in writing within 24 hours of identification</li> <li>Check monitoring data, all plant, equipment and Contractor's working methods</li> <li>Carry out investigation</li> <li>Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works</li> <li>Discuss mitigation measures with IEC and Contractor within 4 working of identification of an exceedance</li> <li>Ensure mitigation measures are implemented;</li> <li>Prepare to increase the monitoring frequency to daily;</li> <li>Repeat measurement on next day of exceedance.</li> </ol>	investigation to IEC and ER within 3 working days of the identification of an exceedance 6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days of identification of an exceedance 7. Implement the agreed mitigation measures within reasonable time scale	<ol> <li>Notify EPD and other relevant governmental agencies in writing within 24 hours of the identification of the exceedance</li> <li>Discuss with IEC, ET and Contractor on the proposed mitigation measures;</li> <li>Require contractor to propose remedial measures for the analysed problem if related to the construction works</li> <li>Ensure remedial measures are properly implemented</li> <li>Assess the effectiveness of the mitigation measure</li> </ol>	<ol> <li>Check monitoring data submitted by ET</li> <li>Confirm ET assessment if exceedance is due / not due to the works</li> <li>Discuss with ET, ER and Contractor on the mitigation measures.</li> <li>Review contractor's mitigation measures whenever necessary to ensure their effectiveness and advise the ER accordingly</li> <li>Assess the effectiveness of the implemented mitigation measures.</li> </ol>

Event	EVEN	T AND ACTION PLAN FOR W	ATER QUALITY EXCEEDANCE	E
	722-	ACTIO	N ER	IEC
	ET Leader	Contractor		
Limit level being exceeded by one sampling day	<ol> <li>Repeat in-situ measurement to confirm findings;</li> <li>Identify source(s) of impact;</li> <li>Notify Contractor in writing within 24 hours of identification of the exceedance</li> <li>Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>Carry out investigation</li> <li>Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works</li> <li>Discuss mitigation measures with IEC, ER and Contractor within 4 working of identification of an exceedance</li> <li>Ensure mitigation measures are implemented;</li> <li>Increase the monitoring frequency to daily until no exceedance of Limit Level.</li> </ol>	<ol> <li>Notify IEC and ER in writing; within 24 hours of the identification of the exceedance</li> <li>Rectify unacceptable practice;</li> <li>Check all plant and equipment;</li> <li>Consider changes of working methods;</li> <li>Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance</li> <li>Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days of the identification of an exceedance</li> <li>Implement the agreed mitigation measures within reasonable time scale</li> </ol>	1. Notify EPD and other relevant governmental agencies in writing within 24 hours of identification of exceedance 2. Discuss with IEC, ET and Contractor on the proposed mitigation measures; 3. Request Contractor to critically review the working methods; 4. Ensure remedial measures are properly implemented 5. Assess the effectiveness of the implemented mitigation measures.	1. Check monitoring data submitted by ET 2. Confirm ET assessment if exceedance is due / not due to the works 3. Discuss with ET, ER and Contractor on the mitigation measures. 4. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly. 5. Assess the effectiveness of the Implemented mitigation measures

\*

e \* & g

<u>.</u> #

Event	EVEN	IT AND ACTION PLAN FOR W	ATER QUALITY EXCEEDANCE	E
		ACTIO	N	
	ET Leader	Contractor	ER	IEC
Limit Level being exceeded by more than one consecutive sampling days	<ol> <li>Repeat in-situ measurement to confirm findings;</li> <li>Identify source(s) of impact;</li> <li>Notify Contractor in writing within 24 hours of identification of the exceedance</li> <li>Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>Carry out investigation</li> <li>Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works</li> <li>Discuss mitigation measures with IEC, ER and Contractor;</li> <li>Ensure mitigation measures are implemented;</li> <li>Increase the monitoring frequency to daily until no exceedance of Limit Level for two consecutive days.</li> </ol>	<ol> <li>Notify ER and IEC in writing within 24 hours of the identification of the exceedance and</li> <li>Rectify unacceptable practice;</li> <li>Check all plant and equipment;</li> <li>Consider changes of working methods;</li> <li>Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance</li> <li>Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days;</li> <li>Implement the agreed mitigation measures within reasonable time scale</li> <li>As directed by the Engineer, to slow down or to stop all or part of the marine work or construction actives.</li> </ol>	<ol> <li>Notify EPD and other relevant governmental agencies in writing within 24 hours of identification of exceedance</li> <li>Discuss with IEC, ET and Contractor on the proposed mitigation measures;</li> <li>Request Contractor to critically review the working methods;</li> <li>Ensure remedial measures are properly implemented</li> <li>Assess the effectiveness of the implemented mitigation measures;</li> <li>Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the marine work until no exceedance of Limit Level.</li> </ol>	<ol> <li>Check monitoring data submitted by ET</li> <li>Confirm ET assessment if exceedance is due / not due to the works</li> <li>Discuss with ER, ET and Contractor on the mitigation measures.</li> <li>Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly.</li> <li>Assess the effectiveness of the implemented mitigation measures.</li> </ol>



Appendix G

Construction Programme

ID @	Task Name	Start	Finish	Duration	Predecess	otime risk allowances	Actual Start	Actual Finish	% Complete	Qtr 2, 2024		Jun		Jul
1 1	Contract duration of Contract CV/2021/9		Wed 31/7/24		77		Mon 1/1/24	NA	71% 17	TO WAY		3011		201.
2 1	Contract date, Date of Letter of Acceptance	Mon 1/1/24	Mon 1/1/24	1 day			Mon 1/1/24	Mon 1/1/24	160%					7
VE	Starting Date of the Works	Mon 1/1/24	Mon 1/1/24	1 day			Mon 1/1/24	Mon 1/1/24	100%					
V(4)		Mon 1/1/24	Mon 1/1/24	1 day			Mon 1/1/24	Mon 1/1/24	100%				9	
7	Starting Date of Section 2 of the Works		Mon 1/1/24					Mon 1/1/24						
ーシー	Starting Date of Section 3 of the Works		Mon 1/1/24		_			Mon 1/1/24	A 100 CO. CO. CO. CO. CO. CO. CO. CO. CO. CO.					
100			Sun 31/12/23				-1-31-31-31-3	Sun 31/12/2	1000					
	Completion Date of Section 1 of the Works		Wod 31/7/24				NA NA	NA NA	4				1	
	Completion Date of Section 2 of the Works	The second second	A CONTRACTOR OF THE PARTY OF TH	A CONTRACTOR					0%					
153			Wed 31/7/24				NA	NA	D%					
169	Completion Date of Section 3 of the Works		Mon 30/9/24				NA.	NA .	0%					
100	Planned completion dates		Wod 31/7/24				NA.	NA	0%					
2 (09	Planned competion date of Section 1		Wed 31/7/24				NA .	NA	0%					
3 [24	Planned competion date of Section 2	Wed 31/7/24	Wed 31/7/24	1 day			NA	NA	0%					
4	Planned competion date of Section 3	Mon 30/9/24	Mon 30/9/24	1 day			NA.	NA	0%				-	
IS 🗸	Access Date of the Site	Mon 1/1/24	Mon 1/1/24	1 day			Mon 1/1/24	Mon 1/1/24	100%					
6 15	Portion A2, A3a, A3b, A3e, A4, A5a, A5b, A7c2, A10 and		Mon 1/1/24					Mon 1/1/24						
A	A11 (within 60 days after starting date)			1,000				1	1001					1
7 14	Portion B1, B3, B6a, B6b and B7 (within 60 days after starting date)	Mon 1/1/24	Mon 1/1/24	1 day			Mon 1/1/24	Mon 1/1/24	100%					İ
100		100000	-	1		4								
ls VE	Portion A1, A7a, A7b, A7c1, A9, A9a and B6c (7 day's advance notice after starting date)	Mon 1/1/24	Mon 1/1/24	1 day			Mon 1/1/24	Mon 1/1/24	100%					
	Portion B6c		Man 4 Way	d dec	-		Man Charle	Managan	100%					
9 🗸			Mon 1/1/24	A Committee of the Comm				Mon 1/1/24	and a common little					
20 🖼	Hand back of the Site	Wed 31/7/24	Wed 31/7/24				NA.	NA	0%				1	
a VE	Portion AZ, AJa, A3b, A3c, A4, A5s, A7c2, A10 and A11 (of at an earlier date notified by the Project Manager with 30 days' advance notice)	or Mon 1/1/24	Mon 1/1/24	0 days			Mon 1/1/24	Mon 1/1/24	100%					
2 18	Portion A1, A7b, A7c1, A9 and A9a (or at an earlier date as notified by the Project Manager with 30 days" advance noti-	s Mon 1/1/24 ce)	Man 1/1/24	0 days			Mon 1/1/24	Mon 1/1/24	100%					
3 √6	Portion 81, 83, 86a, 86b and 87 (or at an earlier date as notified by the Project Manager with 30 days' advance noti-	Mon 1/1/24 (e)	Man 1/1/24	0 days			Mon 1/1/24	Mon 1/1/24	100%					1
4 /8	Portion 86c (or at an cauter date as notified by the Project Manager with 30 days' advance notice)	Mon 1/1/24	Mon 1/1/24	0 days	6		Mon 1/1/24	Mon 1/1/24	100%					
25	Section 1 of the Works - Tseung Kwan O Area 137 Fill Bank	Mon 1/1/24	Wed 31/7/24	213 days	455		Mon 1/1/24	NA	71%					-
26 🗸	Taking over the existing facilities at the Tseung Kwan O	Mon 1/1/24	Mon 1/1/24	1 day	488	0	Mon 1/1/24	Mon 1/1/24	100%					
27	Area 137 Fill Bank within Portion A of the Site Operation of the the Tseung Kwan O Area 137 Fill Bank	Mon 1/1/24	Wed 31/7/24	213 days	2688	ó	Mon 1/1/24	NA	71%					
8 🖼	within Poston A of the Site Operation and maintenance of the serveillance system	Mon 1/1/24	West 31/7/24	213 days	2658		Mon 1/1/24	NA	71%					
:0 mmd=	within Portion A of the Site		A COLUMN TO THE PARTY OF THE PA	A CONTRACTOR OF THE			DESCRIPTIONS	The second					The State of	
9 🕮	Operation and maintenance of the existing tipping halfs the Tseung Kwan O Area 137 Fill Bank within Portion A the Site	at Mon 1/1/24 of	Wed 31/7/24	213 days	2655	0	Mon 1/1/24	NA	71%					-
0 🖼	Provision, operation and maintenance of the Crushing Plant at the Tseung Kwan O Area 137 Fill Bank within Portion A of the Site	Mon 1/1/24	Wed 31/7/24	213 days	2688	0	Mon 1/1/24	NA .	71%		10 No. 101			
31 69	Operation and maintenance of the dowatering plant at to	ne Mon 1/1/24	Wed 31/7/24	213 days	2688	0	Mon 1/1/24	NA	71%					
land.	Tseung Kwan O Area 137 Fill Bank within portion A of the	10	AMERICAN TAL		CENTRAL .		University of the Control of the Con		T IT					
2 1	Site Chai Wan and Mui Wo Barging Points to the TKO Area 137 Fill Bank within Portion A of the Site	Mon 1/1/24	Wed 31/7/24	213 days	2655	0	Mon 1/1/24	NA .	71%		I SOUTH			
								. 075						
3	Handing over the facilities at the Tseung Kwan O Area 137Fill Bank within Portion A of the Site to the Employe	Wed 31/7/24	Wed 31/7/24	1 day		10	NA	NA	0%					
4	Planned Completion Date (Section 1)	Wed 31/7/24	Wed 31/7/24	1 day			Wed 31/7/24	NA.	0%					
5	Section 2 of the Works - Tuen Mun Area 38 Fill Bank		Wed 31/7/24				Mon 1/1/24	NA	71%					
6 1	Taking over the existing facilities at the Tuen Mun Area		Mon 1/1/24		500	n	Mon 1/1/24		100%					
· •	Fill Bank within Portion B of the Site					(A)		ACCOMMODISCENSOR II						
7 5	Operation of the Tuen Mun Area 38 Fill Bank within	Mon 1/1/24	Wed 31/7/24	213 days	588	0	Mon 1/1/24	:NA	71%				the state of the state of	no service and delicated street
3 63	Portion B of the Site Operation and maintenance of the surveillance system	Mon 1/1/24	Wed 31/7/24	213 days	588	0	Mon 1/1/24	NA	71%				-	
	within Portion B of the Site						-		11					_L
	Task			P	roject Sum	mary	Q	▼ Inac	tive Summary	nimmininininininininininininininininini	Manual Summary	•	External Milestone	(()
ject:	Split		30010001100		xternal Tas		Manager 1		nual Task	Ö	Start-only		Progress	
nonth rolling p	orogramme CV/2021/09 S.A. May - Jul 2024									Ť			_	
L. MORES	Mileston		•	E-	xternal Mil-	ertone	A	Dur	ation-only	2++11#4####17#4+P7#1R##	Finish-only		■ Deadline	T.
de: [10/7/2024	, Indicatori	e	•		ALC: HOL IVIII	estorie	•	Dui	ation-only	5+4118749491284-6211566	i it its it-offing		a decarrie	•

 $\mathbf{a}^{(i)}$ 

0	Task Name	Start	Finish		Predecesso	time risk allowances	Actual Start	Actual Finish	% Complete	Qtr 2, 2024 let May Jun Jul
9 🕮	Operation and maintenance of the existing the Tuen Mun Area 35 Fill Bank within Por		Wod 31/7/24	0 days	588	0	NA	NA	054	
0 2	Operation and Maintenance of the Crushin Tuen Mun Area 38 Fill Bank within Portion	g Plant at the Wed 31/7/24 B of the Site	Wed 31/7/24	0 days	558	0	NA	NA	0%	
1 55	Operation and maintennance of glass cull compartment at the Tuen Mun Area 38 FB Portion 8 of the Sile	et storage Mon 1/1/24 Bank within	Wed 31/7/24	213 days	SSS	ō	Mon 1/1/24	NA I	71%	
2	Planned Completion Date (Section 2)	Wed 31/7/24	Wed 31/7/24	1 day		-	NA.	NA	.0%	
3	Section 3 of the Works - Designated Recla the Mainland	mation Sites in Sat 18/11/23	Mon 30/9/24	317 days			Sat 18/11/23	NA NA	63%	<b></b>
4	Collection and delivery of Public Fill by Tseung Kwan O Area 137 Fill Bank and Area 38 Fill Bank to the Desiognated Re Sites in the Mainland	the Tuen Mun	Mon 30/9/24	317 days			Sat 18/11/2:	NA .	59%	
5 1	. 1st quarter of year 2024	Sat 18/11/23	Sun 18/2/24	92 days		ļ	Sat 18/11/23	Sun 18/2/24	100%	
6 1	Submitting application documents to application of dumping permits	EPD for Fri 1/12/23	Fri 1/12/23	1 day		0	Fri 1/12/23	Fri 1/12/23	100%	
7 1	Obtaining the dumping permit from	EPD Sat 2/12/23	Sun 31/12/23	30 days	46	1	Sat 2/12/23	Sun 31/12/23	100%	<del>-</del>
8 🗸	Submitting Application documents to for the application of the dumping po the sea	the Employer Sat 18/11/23 prmit of waste at	Sun 19/11/23	1 day		Ö.	Set 18/11/23	Sun 19/11/23	100%	
9 🗸	Obtaining the dumping permits from Ecology and environment of the Per of China through the Employer	Ministry of Mon 20/11/23 pple's Republic	Fri 29/12/23	40 days	48	1	Mon 20/11/23	Fri 29/12/23	100%	
0 ~	Obtaining all necessary permits, lice approvals and concents	nses, Sat 30/12/23	Sat 30/12/23	0 days		0	Sat 30/12/23	Sat 30/12/23	100%	
1 7	Collection and delivery of public Fill	lo Taishan Mon 1/1/24	Sun 18/2/24	49 days	50		Mon 1/1/24	Sun 18/2/24	100%	
2	2nd quarter of year 2024		Sun 30/6/24			1	Mon 15/1/24	NA	83%	
3 🗸	Submitting application documents to application of dumping permits	EPD for Tue 30/1/24	Wed 31/1/24	1 day		0	Tue 30/1/24	Wed 31/1/24	100%	
1	Obtaining the dumping permit from	EPD Thu 1/2/24	Sun 18/2/24	18 days	53	2007	Thu 1/2/24	Sun 18/2/24	100%	
5 4	Submitting Application documents to for the application of the dumping po the sea	the Employer Mon 15/1/24 frmit of waste at	Mon 15/1/24	1 day			Mon 15/1/24	Mon 15/1/24	100%	
6 🗸	Obtaining the dumping permits from Ecology and environment of the Per of China through the Employer	Ministry of Tue 18/1/24 pple's Republic	Wed 14/2/24	30 days	55	3	Tue 16/1/24	Wed 14/2/24	100%	
7 🗸	<ul> <li>Obtaining all necessary pormits, lice and concents</li> </ul>		Wed 14/2/24	1 day		0	Wed 14/2/24	Wed 14/2/24		
3	Collection and delivery of Public Fill		Sun 30/6/24	2000		0	Mon 19/2/24		77%	
9	3rd quarter of year 2024		Mon 30/9/24	A CONTRACTOR OF THE PARTY OF TH	71111		Tue 14/5/24		10%	
0 ~	Submitting application documents to application of dumping pormits		Sat 1/6/24	1 day			Sat 1/8/24		100%	1
1 🖼	Obtaining the dumping permit from		Sat 29/6/24		60		NA.	NA	0%	
2 🗸	Submitting Application documents to for the application of the dumping potential that sea	the Employer Tue 14/5/24 ermit of waste at	Tue 14/5/24	1 day		0	Tue 14/5/24	Tue 14/5/24	100%	#   P
3 🕮	Obtaining the dumping permits from Ecology and environment of the Per of China through the Employer (ass	ple's Republic : umed on	Sun 23/6/24	10000	62	7	Wed 15/5/24		41%	¥
4	Obtaining all necessary permits, lice and concents						NA	NA	0%	
5 09	Collection and delivery of public fill t		Mon 30/9/24	110000000000000000000000000000000000000	64	0	NA	NA	0%	
6	Removal, excavation and deposition of and/or deposited Public Fill within the l Reclamation Sites in the Mainland	stockpiled Mon 1/1/24 Designated	Wed 31/7/24	213 days			Mon 1/1/24	NA	71%	
8	Removal, excavation and deposition of and/or deposited Public Fill within the I Reclamation Sites in the Mainland	stockpiled Mon 1/1/24 Designated	Wed 31/7/24	213 days			Mon 1/1/24	NA:	71%	
9	Design and construction of seawalls in with new berthing facilities at zone B	association Thu 1/2/24	Sat 28/9/24	241 days			Thu 1/2/24	NA	50%	
_		Task	-		roject Sum	nmary	V	■ Inact	ive Summa	mary Manual Summary ♦ External Milestone
ject:		Split			xternal Tas	-		Man	ual Task	Start-only Progress
ronth rolling io: [10/7/20	g programme CV/2021/09 S.A. May - Jul 2024 [24]	Milestone	•		external Mil		•		tion-only	
	•						-			mary Rollup ◆ External Tasks ♦
		Summary			nactive Mil-	⊂rous.	-	—— iviani	والاللالادامة	HIDIY NORD ▼ LACHIDI 103N3 V

ID	0	Task Name	Start	Finish	Duration	Predecesso	time risk allowances		Actual Finish	% Complete		Qtr 2, 2024 May	3	Jun	Jul
70	1	Obtaining the dumping permits from Ministry of Ecology and environment of the People's Republic of China through the Employer for Zone 8	Thu 1/2/24	Thu 1/2/24	1 day		0	Thu 1/2/24	Thu 1/2/24	100%	724		•		
71	~	Properation of design submission	Fri 2/2/24	Fri 16/2/24	15 days	70		Fri 2/2/24	Fri 16/2/24	100%	1				
72	V	Obtaining all necessary design approvals and concents	Sat 17/2/24	Sun 17/3/24	30 days	71		Sat 17/2/24	Sun 17/3/24	100%	1				1
73		Construction of the berthing facilities	Mon 18/3/24	Fri 13/9/24	180 days	72		Mon 18/3/24	NA	41%			Victorial Control		A STATE OF THE PARTY OF THE PAR
74		Obtaining the construction completion certificate	Sat 14/9/24	Sat 28/9/24	15 days	73	2	NA .	;NA	0%					
75		Design and construction of seawalls (approximate 200m) in association with new berthing facility at Zone B of the Designated Reclamation Sites in the Mainland	Thu 1/2/24	Tue 30/7/24	181 days			Thu 1/2/24	NA	67%					
76	~	Obtaining the permits from Ministry of Ecology and environment of the People's Republic of China through the Employer for Zone B		Thu 1/2/24	1 day			Thu 1/2/24	Thu 1/2/24	100%					
77	V	Preparation of design submission	Fri 2/2/24	Sat 2/3/24	30 days	76	2	Fri 2/2/24	Sat 2/3/24	100%	Ì				1: 1
78	V	Obtaining all necessary design approvals and concents	Sun 3/3/24	Mon 1/4/24	30 days	77	2	Sun 3/3/24	Mon 1/4/24	100%					II III
79		Construction of seawalls	Tue 2/4/24	Sun 36/6/24	90 days	78	14	Tue 2/4/24	NA:	66%					
80		Obtaining the construction completion certificate (subject to Project's Manager's instruction)	Mon 1/7/24	Tue 30/7/24	30 days	79		NA	NA	0%					
81	04	Site Formation works at Tsang Tsul site	Mon 1/1/24	Wed 31/7/24	213 days			Mon 1/1/24	NA	71%	-				
82	V	Carrying out of general site clearance and initial survey	Mon 1/1/24	Tue 30/1/24	30 days			Mon 1/1/24	Tue 30/1/24						
83	1	Construction of a haul road leading to the site	Wod 31/1/24	Thu 29/2/24	30 days	82	2	Wed 31/1/24	Thu 29/2/24	100%					1
84	<b>E</b>	Collection of fill material deliviered by marine transportation through the berthing facility and disposal of the fill material collected to areas within the site	Fri 1/3/24	Wed 31/7/24	153 days		o .	Fri 1/3/24	NA	60%					
85	(n el	Planned Completion Date (Section 3)	Mon 30/9/24	Mon 30/9/24	1 day			NA .	NA.	0%					

(\*)

.

	Task		Project Summary	9	Inactive Summary	************************	Manual Summary	•	External Milestone	
oject;	Split	111111111111111111111111111111111111111	External Tasks		Manual Task	<b>•</b>	Start-only		Progress	
onth rolling programme CV/2021/09 S.A. May - Jul 2024 c: [10/7/2024]	Milestone	• 0 0	External Milestone	•	Duration-only		Finish-only		Deadline	&
	Summary		Inactive Milestone	E	Manual Summary Rollup	•	External Tasks	<		



# Appendix H Weekly ET's Site Inspection Record



4-7-2024

Time

90 40)

Weather

Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy

Wind

Calm / Light / Breeze / Strong

Temperature

18

Humidity

High / Moderate / Lov

Inspected by	CEDD	Contractor / Sub-Contactor	ET
Signature:			IEC Rep.
Name:	CKPS	W.L. Kirok	IEC Rep.  Chry
Title	Azew	E.D	JEC Rap.



Environmental Checklist		ement Stages		Remark	
	Yes	No	N/A		
Fugitive Dust Emission					
The maximum stockpiling height at the fill bank shall be limited to a maximum of +65.2mPD.	1				
Hoarding of at least 2.4m high shall be erected along the site boundary adjacent to Lung Mun Road, River Trade Terminal and EcoPark.	1				
Dust control / mitigation measures shall be provided to prevent dust nuisance.	1				
Water sprays shall be provided and used to dampen materials.	1				
All stockpile of aggregate or soil should be enclosed or covered, and water applied in dry or windy condition.	1				
Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards and shall be covered by a clean tarpaulin.	1				
Unpaved areas should be watered regularly to avoid dust generation.	1				
The designated site main haul road shall be paved with concrete, bituminous materials, hardcores or metal plates and kept regular watering.	1				
The public road around the site entrance should be kept clean and free from dust.	1				
Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	1				
Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	1				
The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water	1				
<ul> <li>Tipping halls at the waterfront provided for transfer of public fill from trucks to barges shall be of enclosed design with top and 3-sides enclosed to prevent spillage of material into marine water.</li> </ul>	1			-W- WWW	
Vehicle and equipment should be switched off while not in use.	V	1			
All plant and equipment should be well maintained e.g. without black smoke emission.	1				
Open burning should be prohibited.	V				
<ul> <li>Approval or exemption Non-road Mobile Machinery (NRMM) labels should be painted or securely fixed on regulated machines and non-road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).</li> </ul>	1	Ü.			
Full implementation of on-shore power supply for marine vessels while at berth.			11	In progress	
Increase of the use of internal trucks with at least Euro VI standard to at least 57% of the internal truck fleet.	1				
Noise Impact					
<ul> <li>The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.</li> </ul>	V				
The constructions works should be scheduled to minimize noise nuisance.	1				
<ul> <li>Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.</li> </ul>	1				
<ul> <li>Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.</li> </ul>	1				
Air compressors and hand held breakers should have noise labels.	1				



	Environmental Checklist Implementation Stages*				Remark
		Yes	_		
	Compressors and generators should operate with door closed.	1	1	1	
	Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	1	1		
Ď.	Noisy equipment and mobile plant shall always be site away from NSRs.	1	-		
N	ater Quality				
	Drainage system and the sand / silt removal facilities should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	V	10000	961565	The state of the s
	The storm water intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	7			
	Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	V			
	The material shall be properly covered to prevent washed away especially before rainstorm.	1		T	
fi.	The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.	V			
	Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete: latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD	٧			
Ŀ	Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	1			- Vanada - V
	A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	1		i	
	The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	7			
	Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided.	1			
	The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	1			<u> </u>
	Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	1 1			
	The barges shall be in right size such that adequate clearance in maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	1			
	All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	1			
	Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	1			
	Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	1			
	The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	٧			
	A waste collection vessel shall be deployed to remove floating debris.	1	= 7.		
an	dscape and Visual				
	The maximum stockpilling height at the fill bank shall be limited to a maximum of +65.2mPD.	1			
	Surface of outer slopes of the Fill Bank shall preferably be hydroseeded.	1			



Environmental Checklist	Implementation Stages*			
	Yes	No	N/A	
Stockpile of public fill shall be removed in a sequence to allow the outer hydrseeded to be removed later than other portions as far as practicable.	1			H(Ha)+12-1-1
<ul> <li>Casuarina equisetifolia were planted as buffer tree along the northern perimeter of the Site. The height of Casuarina equisetifolia was maintained at bleast 3m above soil level.</li> </ul>	1			
Lighting shall be set to minimise night-time glare.	1	1		MANAGEMENT WAS TO SHOW THE STATE OF THE STAT
Vaste Management				n Funda Ell
Construction Waste Management				
<ul> <li>Relevant licence / permits for disposal of construction waste or excavated materials available for inspection.</li> </ul>	1			
Excavated material to be generated from construction works to be re-used on-site as far as practicable to reduce off-site disposal.	√	#58		
Mud and debris should be removed from waterworks access roads and associated drainage systems.	1			
<ul> <li>Provision of sufficient waste disposal points and regular collection for disposal. Appropriate measures should be employed to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers.</li> </ul>	1			
<ul> <li>Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal.</li> </ul>	1			
<ul> <li>Prior to disposal of C&amp;D waste, recyclable materials should be salvaged for reuse (such as wood and metal) and inert waste utilised as public fill to minimise the quantity of waste to be disposed of to landfill.</li> </ul>	1			
<ul> <li>In order to monitor the disposal of C&amp;D material and solid wastes at public filling areas and landfills, and to control fly-tipping, a trip-ticket system should be included as one of the contractual requirements.</li> </ul>	4			
Any soil contaminated with chemicals/oils shall be removed from site and the void created shall be filled with suitable materials.	1			
Chemical Waste Management				
It is required to register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes.	1			
<ul> <li>After use, chemical wastes (e.g. cleaning fluids, solvents, lubrication oil and fuel) should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes.</li> </ul>	1			
<ul> <li>Spent chemicals should be stored and collected by an approved operator for disposal at the Chemical Waste Treatment Facility or other licensed facility in accordance with the Chemical Waste (General) Regulation.</li> </ul>	1			
<ul> <li>Chemical wastes should be separated for special handling and appropriate treatment at the Chemical Waste Treatment Facility.</li> </ul>	V			
<ul> <li>Chemical wastes including waste oil should be stored properly in designated areas, e.g. chemical waste storage area.</li> </ul>	1			
The designated chemical waste storage area should only be used for storing chemical wastes.	1	1		
The set-up of chemical waste storage area should				
Be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition.	V	1		
Be enclosed on at least 3 sides and securely closed.	V			
<ul> <li>Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest.</li> </ul>	1			



	Environmental Checklist	Environmental Checklist Implementation Stages*		Remark	
_		Yes	No	N/A	
•	Have adequate ventilation.	<b>V</b>	T Total		44
٠	Be covered to prevent rainfall entering (water collected within the bund must be tested and disposal as chemical waste if necessary).	√			
*	Be arranged so that incompatible materials are adequately separated.	V			
•	Warning panels should be displayed at the waste storage area.	√			
	Waste storage area should be cleaned and maintained regularly.	V	-		
	Chemical waste should be transported regularly by a registered chemical waste collector to a facility licensed to receive chemical waste.	7			
×	All generators, fuel and oil storage should be within bundle areas.	1	-	-	
	Oil leakage from machinery, vehicle and plant should be prevented.	-	1	$\vdash$	1 - 10 - 10 - 10 - 10 - 10 - 10 - 10 -
	In the event of chemical waste / dangerous goods / chemicals spillage or leakage, the procedures as outlined in the Spillage Response Plan should be followed.	1			
٠	The dangerous goods / chemical spillage or leakage procedures (including equipments) should be in place.	V			<del> </del>
Go	ood Site Practices				
	Nomination of approved personnel, such as site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.	V		(a) Section (	
	Training of site personnel in proper waste management and chemical handling procedures should be provided.	1			and the second
•	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	1			and the second s
•	Proper storage and site practices to minimise the potential for damage or contamination of construction materials.	V			
•	The Environmental Permit should be displaced conspicuously on site.	7			
•	Construction noise permits should be posted at site entrance or available for site inspection.	7			
•	Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	1			
•	Chemical storage area provided with lock and located on sealed areas.	7			
	All chemicals should be placed at the banded area with adequate band capacity (>110% of largest tank).	1		-	
	Any unused chemicals or those with remaining functional capacity should be recycled.	V	7		
•	Regular cleaning and maintenance programme for waste storage area, drainage systems, silt traps, sumps and oil interceptors.	1			
	To encourage collection of aluminium cans by individual collectors.	1			
•	Separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	1			
•	A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be used, e.g. trip ticket system for chemical waste disposal. Quantities could be determined by weighing each load or other suitable methods.	<b>√</b>			
ğ.	A collection area should be provided where waste can be stored and loaded prior to removal from site. An enclosed and covered area is preferred to reduce the occurrence of 'wind blown' light material. If an open area is unavoidable for the storage or loading/unloading of wastes, then the area should be bunded and all the polluted surface run-off collected within this area should be diverted into wastewater treatment system.	1			



		(Yes/No)	Date

	Name	Title	Signature/	Date
Checked by	June Lau	ET Representative	1/2	04 July 2024



11-7-2024

Time

10200

Weather

Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy

Wind

: Calm / Light/ Breeze / Strong

Temperature

30°C

Humidity

High / Moderate (Low

Inspected by	CEDD	Contractor / Sub-Contactor	ET
Signature:			
		4	
Name:	CKIN		
	(1) 6	W.L.Kuoz	Clis
Title	Answ		=-
	*	E.O	



Environmental Checklist		ement		Remark
	Yes		N/A	
Fugitive Dust Emission				
The maximum stockpiling height at the fill bank shall be limited to a maximum of +65.2mPD.	1			
Hoarding of at least 2.4m high shall be erected along the site boundary adjacent to Lung Mun Road, River Trade Terminal and EcoPark.	1			
Dust control / mitigation measures shall be provided to prevent dust nuisance.	1			
Water sprays shall be provided and used to dampen materials.	1			
Ali stockpile of aggregate or soil should be enclosed or covered, and water applied in dry or windy condition.	1			
<ul> <li>Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards and shall be covered by a clean tarpaulin.</li> </ul>	1			
Unpaved areas should be watered regularly to avoid dust generation.	V			
<ul> <li>The designated site main haul road shall be paved with concrete, bituminous materials, hardcores or metal plates and kept regular watering.</li> </ul>	1			
The public road around the site entrance should be kept clean and free from dust.	1			
<ul> <li>Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.</li> </ul>	V			
<ul> <li>Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.</li> </ul>	1			
The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.	1			
<ul> <li>Tipping halls at the waterfront provided for transfer of public fill from trucks to barges shall be of enclosed design with top and 3-sides enclosed to prevent spillage of material into marine water.</li> </ul>	1			
Vehicle and equipment should be switched off while not in use.	V	To the second		
All plant and equipment should be well maintained e.g. without black smoke emission.	1	100		
Open burning should be prohibited.	√.			1612
<ul> <li>Approval or exemption Non-road Mobile Machinery (NRMM) labels should be painted or securely fixed on regulated machines and non-road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).</li> </ul>	V			
Full implementation of on-shore power supply for marine vessels while at berth.			1	In progress
<ul> <li>Increase of the use of internal trucks with at least Euro VI standard to at least 57% of the internal truck fleet.</li> </ul>	1			
Noise Impact				
<ul> <li>The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.</li> </ul>	1			
The constructions works should be scheduled to minimize noise nuisance.	1	1	87	
<ul> <li>Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.</li> </ul>	1			
<ul> <li>Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.</li> </ul>	1			
Air compressors and hand held breakers should have noise labels.	1	Š.		



Environmental Checklist		ement Stages		Remark
	Yes	No	N/A	
Compressors and generators should operate with door closed.	1		Y .	15.875-01
Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	1			
Noisy equipment and mobile plant shall always be site away from NSRs.	1			
Water Quality				
Drainage system and the sand / silt removal facilities should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	V			
The storm water intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	1			
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	1			
The material shall be properly covered to prevent washed away especially before rainstorm.	1			
The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.	- V	- m		
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD	7		101	
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	7			
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	1			
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	1			
Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided.	V			
The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	1			3
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	1			
The barges shall be in right size such that adequate clearance in maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	1			
All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	V			
Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	1			
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	V			
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	1			
A waste collection vessel shall be deployed to remove floating debris.	1	201		
andscape and Visual				
The maximum stockpilling height at the fill bank shall be limited to a maximum of +65.2mPD.	V			
Surface of outer slopes of the Fill Bank shall preferably be hydroseeded.	J			



Environmental Checklist		ement		Remark
	Yes	No	N/A	
Stockpile of public fill shall be removed in a sequence to allow the outer hydrseeded to be removed later than other portions as far as practicable.	V			
<ul> <li>Casuarina equisetifolia were planted as buffer tree along the northern perimeter of the Site. The height of Casuarina equisetifolia was maintained at bleast 3m above soil level.</li> </ul>	1			
Lighting shall be set to minimise night-time glare.	1			M
Waste Management				
Construction Waste Management				
Relevant licence / permits for disposal of construction waste or excavated materials available for inspection.	1			
Excavated material to be generated from construction works to be re-used on-site as far as practicable to reduce off-site disposal.	1			
Mud and debris should be removed from waterworks access roads and associated drainage systems.	1			
Provision of sufficient waste disposal points and regular collection for disposal. Appropriate measures should be employed to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers.	1			
<ul> <li>Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal.</li> </ul>	٦			
<ul> <li>Prior to disposal of C&amp;D waste, recyclable materials should be salvaged for reuse (such as wood and metal) and inert waste utilised as public fill to minimise the quantity of waste to be disposed of to landfill.</li> </ul>	1			
<ul> <li>In order to monitor the disposal of C&amp;D material and solid wastes at public filling areas and landfills, and to control fly-tipping, a trip-ticket system should be included as one of the contractual requirements.</li> </ul>	1			
Any soil contaminated with chemicals/oils shall be removed from site and the void created shall be filled with suitable materials.	1			
Chemical Waste Management				no different della della
<ul> <li>It is required to register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes.</li> </ul>	1			
<ul> <li>After use, chemical wastes (e.g. cleaning fluids, solvents, lubrication oil and fuel) should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes.</li> </ul>	V		1	
<ul> <li>Spent chemicals should be stored and collected by an approved operator for disposal at the Chemical Waste Treatment Facility or other licensed facility in accordance with the Chemical Waste (General) Regulation.</li> </ul>	1			
<ul> <li>Chemical wastes should be separated for special handling and appropriate treatment at the Chemical Waste Treatment Facility.</li> </ul>	V			
Chemical wastes including waste oil should be stored properly in designated areas, e.g. chemical waste storage area.	1			
The designated chemical waste storage area should only be used for storing chemical wastes.	1			7 22 2 2 2 2
The set-up of chemical waste storage area should				
Be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition.	1			H
Be enclosed on at least 3 sides and securely closed.	1			
Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest.	1			



	Environmental Checklist		ment		Remark
		Yes	No	N/A	
٠	Have adequate ventilation.	1			
<b>5</b>	Be covered to prevent rainfall entering (water collected within the bund must be tested and disposal as chemical waste if necessary).	1			
4	Be arranged so that incompatible materials are adequately separated.	7		-	
T:	Warning panels should be displayed at the waste storage area.	1	-		
₩.	Waste storage area should be cleaned and maintained regularly.	1			
	Chemical waste should be transported regularly by a registered chemical waste collector to a facility licensed to receive chemical waste.	1			
	All generators, fuel and oil storage should be within bundle areas.	1			
•	Oil leakage from machinery, vehicle and plant should be prevented.		V		
•	In the event of chemical waste / dangerous goods / chemicals spillage or leakage, the procedures as outlined in the Spillage Response Plan should be followed.	1			
•	The dangerous goods / chemical spillage or leakage procedures (including equipments) should be in place.	1			
Go	od Site Practices		Vers		
a ·	Nomination of approved personnel, such as site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.	1	HEE		
•	Training of site personnel in proper waste management and chemical handling procedures should be provided.	V			
ř	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	1			
•	Proper storage and site practices to minimise the potential for damage or contamination of construction materials.	7	= 7		
	The Environmental Permit should be displaced conspicuously on site.	1			and the state of t
	Construction noise permits should be posted at site entrance or available for site inspection.	1	= = = =	-	
	Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	1			
,	Chemical storage area provided with lock and located on sealed areas.	7			T-1000-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1
	All chemicals should be placed at the banded area with adequate band capacity (>110% of largest tank).	7-			
	Any unused chemicals or those with remaining functional capacity should be recycled.	1			
•	Regular cleaning and maintenance programme for waste storage area, drainage systems, silt traps, sumps and oil interceptors.	1	-		
•	To encourage collection of aluminium cans by individual collectors.	7			
	Separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	1			×
•	A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be used, e.g. trip ticket system for chemical waste disposal. Quantities could be determined by weighing each load or other suitable methods.	1			
•	A collection area should be provided where waste can be stored and loaded prior to removal from site. An enclosed and covered area is preferred to reduce the occurrence of 'wind blown' light material. If an open area is unavoidable for the storage or loading/unloading of wastes, then the area should be bunded and all the polluted surface run-off collected within this area should be diverted into wastewater treatment system.	1			



Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
	[e]			
in the same of the				

	Name	Title	Signature /\	Date
Checked by	June Lau	ET Representative		11 July 2024



Inspection Date | 18-7-2-24

Time : [0260

Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy

Wind Salm (Light / Breeze / Strong

Temperature § 3(°C

Humidity High / Moderate (Low

Inspected by	CEDD	Contractor / Sub-Contactor	ET
Signature:	1	4	1
Name:	CKN	W.L. Kw 01c	Oris
Title	Axen	€.0	ET



Environmental Checklist		ment tages		Remark
2	Yes	No	N/A	
Fugitive Dust Emission				
The maximum stockpiling height at the fill bank shall be limited to a maximum of +65.2mPD.	1		and the	
Hoarding of at least 2.4m high shall be erected along the site boundary adjacent to Lung Mun Road, River Trade Terminal and EcoPark.	1			
Dust control / mitigation measures shall be provided to prevent dust nuisance.	1			
Water sprays shall be provided and used to dampen materials.	1			
All stockpile of aggregate or soil should be enclosed or covered, and water applied in dry or windy condition.	V			
Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards and shall be covered by a clean tarpaulin.	1			
Unpaved areas should be watered regularly to avoid dust generation.	1			
The designated site main haul road shall be paved with concrete, bituminous materials, hardcores or metal plates and kept regular watering.	V			
The public road around the site entrance should be kept clean and free from dust.	1			
Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	1 1			
Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	1			
The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water,	1			
Tipping halls at the waterfront provided for transfer of public fill from trucks to barges shall be of enclosed design with top and 3-sides enclosed to prevent spillage of material into marine water.	1			
Vehicle and equipment should be switched off while not in use.	1			
All plant and equipment should be well maintained e.g. without black smoke emission.	1	T.	lc_"	
Open burning should be prohibited,	1			
Approval or exemption Non-road Mobile Machinery (NRMM) labels should be painted or securely fixed on regulated machines and non-road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).	1			
Full implementation of on-shore power supply for marine vessels while at berth.			1	In progress
Increase of the use of internal trucks with at least Euro VI standard to at least 57% of the internal truck fleet.	1			
Noise Impact				
The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	1			
The constructions works should be scheduled to minimize noise nuisance.	V		-	
Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.	1			
Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	1	7	i -	
Air compressors and hand held breakers should have noise labels.	17		1	



Environmental Checklist		ement Stages		Remark
	Yes	No	N/A	
Compressors and generators should operate with door closed.	V			
Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	1	†	1	
Noisy equipment and mobile plant shall always be site away from NSRs.	1			
Water Quality				
Drainage system and the sand / silt removal facilities should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	1		PHOREGOE	
The storm water intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	1			
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	1			
The material shall be properly covered to prevent washed away especially before rainstorm.	T-V-			
The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.	1	1		
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	1	2000	731 Mar.	
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	1			
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	1		-	
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	1			
Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided.	1			
The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	1			
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water,	1			
The barges shall be in right size such that adequate clearance in maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	1			
All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	1			
Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	7			
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	1			
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	1			
A waste collection vessel shall be deployed to remove floating debris.	V			
andscape and Visual				
The maximum stockpiling height at the fill bank shall be limited to a maximum of +65.2mPD.	V			
Surface of outer slopes of the Fill Bank shall preferably be hydroseeded:	V			



Environmental Checklist		Implementation Stages*				Remark
	Yes		N/A			
Stockpile of public fill shall be removed in a sequence to allow the outer hydrseeded to be removed later than other portions as far as practicable.	√					
<ul> <li>Casuarina equisetifolia were planted as buffer tree along the northern perimeter of the Site. The height of Casuarina equisetifolia was maintained at bleast 3m above soil level.</li> </ul>	1					
Lighting shall be set to minimise night-time glare.	1					
Vaste Management						
Construction Waste Management						
Relevant licence / permits for disposal of construction waste or excavated materials available for inspection.	1					
Excavated material to be generated from construction works to be re-used on-site as far as practicable to reduce off-site disposal.	1					
Mud and debris should be removed from waterworks access roads and associated drainage systems.	1					
<ul> <li>Provision of sufficient waste disposal points and regular collection for disposal. Appropriate measures should be employed to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers.</li> </ul>	1					
<ul> <li>Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal.</li> </ul>	1		20.7%			
Prior to disposal of C&D waste, recyclable materials should be salvaged for reuse (such as wood and metal) and inert waste utilised as public fill to minimise the quantity of waste to be disposed of to landfill.	V					
In order to monitor the disposal of C&D material and solid wastes at public filling areas and landfills, and to control fly-tipping, a trip-ticket system should be included as one of the contractual requirements.	1					
Any soil contaminated with chemicals/oils shall be removed from site and the void created shall be filled with suitable materials.	1					
Chemical Waste Management						
It is required to register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes.	1					
After use, chemical wastes (e.g. cleaning fluids, solvents, lubrication oil and fuel) should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes.	1	7				
<ul> <li>Spent chemicals should be stored and collected by an approved operator for disposal at the Chemical Waste Treatment Facility or other licensed facility in accordance with the Chemical Waste (General) Regulation.</li> </ul>	1					
<ul> <li>Chemical wastes should be separated for special handling and appropriate treatment at the Chemical Waste Treatment Facility.</li> </ul>	1	1	H			
Chemical wastes including waste oil should be stored properly in designated areas, e.g. chemical waste storage area.	1					
<ul> <li>The designated chemical waste storage area should only be used for storing chemical wastes.</li> </ul>	1					
The set-up of chemical waste storage area should						
<ul> <li>Be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition.</li> </ul>	1	0				
Be enclosed on at least 3 sides and securely closed.	1			The state of the s		
<ul> <li>Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest.</li> </ul>	1					



	Environmental Checklist		ement Stages		Remark
		Yes	No	N/A	
•	Have adequate ventilation.	1			
•	Be covered to prevent rainfall entering (water collected within the bund must be tested and disposal as chemical waste if necessary).	1			
ě	Be arranged so that incompatible materials are adequately separated.	1			
	Warning panels should be displayed at the waste storage area.	1			
٠	Waste storage area should be cleaned and maintained regularly.	V			
•	Chemical waste should be transported regularly by a registered chemical waste collector to a facility licensed to receive chemical waste.	1		2120	
	All generators, fuel and oil storage should be within bundle areas.	1			
٠	Oil leakage from machinery, vehicle and plant should be prevented.		V	-	
٠	In the event of chemical waste / dangerous goods / chemicals spillage or leakage, the procedures as outlined in the Spillage Response Plan should be followed.	1			
	The dangerous goods / chemical spillage or leakage procedures (including equipments) should be in place:	1	- 19	120	
Go	od Site Practices				
	Nomination of approved personnel, such as site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.	1			
*	Training of site personnel in proper waste management and chemical handling procedures should be provided.	1			
•	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	7			
	Proper storage and site practices to minimise the potential for damage or contamination of construction materials.	1	-		******
•	The Environmental Permit should be displaced conspicuously on site.	7			
	Construction noise permits should be posted at site entrance or available for site inspection.	V		20	
	Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	√			
	Chemical storage area provided with lock and located on sealed areas.	7			
Ē	All chemicals should be placed at the banded area with adequate band capacity (>110% of largest tank).	1			
	Any unused chemicals or those with remaining functional capacity should be recycled.	1	ATT-	-	
	Regular cleaning and maintenance programme for waste storage area, drainage systems, silt traps, sumps and oil interceptors.	7			The Care Continue of
	To encourage collection of aluminium cans by individual collectors.	V-			
4,	Separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	1	-		
	A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be used, e.g. trip ticket system for chemical waste disposal. Quantities could be determined by weighing each load or other suitable methods.	V			
•	A collection area should be provided where waste can be stored and loaded prior to removal from site. An enclosed and covered area is preferred to reduce the occurrence of 'wind blown' light material. If an open area is unavoidable for the storage or loading/unloading of wastes, then the area should be bunded and all the polluted surface run-off collected within this area should be diverted into wastewater treatment system.	1			



Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
			1		
					-
emark					

	Name	Title	Signature	Date
Checked by	June Lau	ET Representative	1	18 July 2024



25/7/24

Time

10:00

Weather

Sunny / (Fine) / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy

Wind

: Calm / (light) Breeze / Strong

Temperature

32 (

Humidity

: High / Moderate / Cow

Inspected by	CEDD	Contractor / Sub-Contactor	ET
Signature).	1		Muk
Name:	Ckn	W.L. Kwac	Mak Jej Was
Title	Agen	E.0	E,T



Environmental Checklist		ment		Remark
	Yes	No	N/A	
Fugitive Dust Emission				
The maximum stockpiling height at the fill bank shall be limited to a maximum of +65.2mPD.	₹			
Hoarding of at least 2.4m high shall be erected along the site boundary adjacent to Lung Mun Road, River Trade Terminal and EcoPark.	V			
Dust control / mitigation measures shall be provided to prevent dust nuisance.	1			
Water sprays shall be provided and used to dampen materials.	V			
All stockpile of aggregate or soil should be enclosed or covered, and water applied in dry or windy condition.	1			
Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards and shall be covered by a clean tarpaulin.	1			
Unpaved areas should be watered regularly to avoid dust generation.	٧	1		
The designated site main haul road shall be paved with concrete, bituminous materials, hardcores or metal plates and kept regular watering.	V			
The public road around the site entrance should be kept clean and free from dust.	1			
<ul> <li>Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.</li> </ul>	1			
Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	1			
The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.	1			
Tipping halls at the waterfront provided for transfer of public fill from trucks to barges shall be of enclosed design with top and 3-sides enclosed to prevent spillage of material into marine water.	1			, , , , , , , , , , , , , , , , , , ,
Vehicle and equipment should be switched off while not in use.	<b>V</b>			
All plant and equipment should be well maintained e.g. without black smoke emission.	V			N 18 3001
Open burning should be prohibited.	V			
<ul> <li>Approval or exemption Non-road Mobile Machinery (NRMM) labels should be painted or securely fixed on regulated machines and non-road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).</li> </ul>	1		1	
Full implementation of on-shore power supply for marine vessels while at berth.			V.	In progress
Increase of the use of internal trucks with at least Euro VI standard to at least 57% of the internal truck fleet.	1			
Noise Impact				
<ul> <li>The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.</li> </ul>	1			
The constructions works should be scheduled to minimize noise nulsance.	1			
<ul> <li>Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.</li> </ul>	√°			
<ul> <li>Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.</li> </ul>	1			
Air compressors and hand held breakers should have noise labels.	1			



•	Environmental Checklist	Implementation Stages*			Remark
		Yes	No	N/A	
•01 -01	Compressors and generators should operate with door closed.	V			
•	Machines and plants that may be in intermittent use should be shut down between work periods or should be throftled down to a minimum.	V			
1	Noisy equipment and mobile plant shall always be site away from NSRs.	1			
N.	ater Quality			66	
	Drainage system and the sand / silt removal facilities should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	V	SEMBLE		
	The storm water intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	1			
	Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	1			
	The material shall be properly covered to prevent washed away especially before rainstorm.	1			
	The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.	1			
E .	Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	1	1		
	Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	V			
	A wheel washing bay shall be provided at the site exit and wash-water shall have sand and sitt settled out or removed before being discharged into storm drains.	1			
	The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	7			
	Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided.	1			
	The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	1			
	Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	1	. 6		
	The barges shall be in right size such that adequate clearance in maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	1	"		
	All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	V			
	Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	1			2
	Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	1			
	The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	V			
	A waste collection vessel shall be deployed to remove floating debris.	V			
an	dscape and Visual				
	The maximum stockpiling height at the fill bank shall be limited to a maximum of +65.2mPD.	V	Constant	- Carlon II	
315	Surface of outer slopes of the Fill Bank shall preferably be hydroseeded.	-1	-	D. I	



Environmental Checklist		lementation Stages*		Remark
	Yes	No	N/A	
Stockpile of public fill shall be removed in a sequence to allow the outer hydrseeded to be removed later than other portions as far as practicable.	1			
<ul> <li>Casuarina equisetifolia were planted as buffer tree along the northern perimeter of the Site. The height of Casuarina equisetifolia was maintained at bleast 3m above soil level.</li> </ul>	4			
Lighting shall be set to minimise night-time glare.	1			
Vaste Management				
Construction Waste Management				
Relevant licence / permits for disposal of construction waste or excavated materials available for inspection.	V			
Excavated material to be generated from construction works to be re-used on-site as far as practicable to reduce off-site disposal.	1			
Mud and debris should be removed from waterworks access roads and associated drainage systems.	1			
<ul> <li>Provision of sufficient waste disposal points and regular collection for disposal. Appropriate measures should be employed to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers.</li> </ul>	٧			
<ul> <li>Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal.</li> </ul>	٧			Pu
<ul> <li>Prior to disposal of C&amp;D waste, recyclable materials should be salvaged for reuse (such as wood and metal) and inert waste utilised as public fill to minimise the quantity of waste to be disposed of to landfill.</li> </ul>	1			
In order to monitor the disposal of C&D material and solid wastes at public filling areas and landfills, and to control fly-tipping, a trip-ticket system should be included as one of the contractual requirements.	1			
<ul> <li>Any soil contaminated with chemicals/oils shall be removed from site and the void created shall be filled with suitable materials.</li> </ul>	√.			
Chemical Waste Management				
<ul> <li>It is required to register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes.</li> </ul>	٧			
<ul> <li>After use, chemical wastes (e.g. cleaning fluids, solvents, lubrication oil and fuel) should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes.</li> </ul>	V			
Spent chemicals should be stored and collected by an approved operator for disposal at the Chemical Waste Treatment Facility or other licensed facility in accordance with the Chemical Waste (General) Regulation.	1			
<ul> <li>Chemical wastes should be separated for special handling and appropriate treatment at the Chemical Waste Treatment Facility.</li> </ul>	1			
<ul> <li>Chemical wastes including waste oil should be stored properly in designated areas, e.g. chemical waste storage area.</li> </ul>	1			
<ul> <li>The designated chemical waste storage area should only be used for storing chemical wastes.</li> </ul>	<b>1</b>			
The set-up of chemical waste storage area should				
<ul> <li>Be suitable for the substance they are holding, resistant to согтовіоп, maintained in a good condition.</li> </ul>	\ \			
Be enclosed on at least 3 sides and securely closed.	1			
Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest.	1			



	Environmental Checklist		ement		Remark
		Yes	No	N/A	
•	Have adequate ventilation.	V			
	Be covered to prevent rainfall entering (water collected within the bund must be tested and disposal as chemical waste if necessary).	1			
•	Be arranged so that incompatible materials are adequately separated.	1			
	Warning panels should be displayed at the waste storage area.	1			
	Waste storage area should be cleaned and maintained regularly.	V			
*	Chemical waste should be transported regularly by a registered chemical waste collector to a facility licensed to receive chemical waste.	1	-		
ě	All generators, fuel and oil storage should be within bundle areas.	1			
	Oil leakage from machinery, vehicle and plant should be prevented.		1	-	
•	In the event of chemical waste / dangerous goods / chemicals spillage or leakage, the procedures as outlined in the Spillage Response Plan should be followed.	1			
	The dangerous goods / chemical spillage or leakage procedures (including equipments) should be in place.	1			
Go	od Site Practices				
	Nomination of approved personnel, such as site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.	V			
,	Training of site personnel in proper waste management and chemical handling procedures should be provided.	V			The state of the s
•	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	1			
•	Proper storage and site practices to minimise the potential for damage or contamination of construction materials.	1			
	The Environmental Permit should be displaced conspicuously on site.	1		HITTE STATE	
	Construction noise permits should be posted at site entrance or available for site inspection.	7			
	Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	1			
	Chemical storage area provided with lock and located on sealed areas.	7	-		****
	All chemicals should be placed at the banded area with adequate band capacity (>110% of largest tank).	7			W1 475 2
	Any unused chemicals or those with remaining functional capacity should be recycled.	7			
r	Regular cleaning and maintenance programme for waste storage area, drainage systems, silt traps, sumps and oil interceptors.	j	-		
	To encourage collection of aluminium cans by individual collectors.	J			
<b>*</b> ::	Separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	1			
•	A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be used, e.g. trip ticket system for chemical waste disposal. Quantities could be determined by weighing each load or other suitable methods.	1	-		THE MINING AND ADDRESS.
ži.	A collection area should be provided where waste can be stored and loaded prior to removal from site. An enclosed and covered area is preferred to reduce the occurrence of 'wind blown' light material. If an open area is unavoidable for the storage or loading/unloading of wastes, then the area should be bunded and all the polluted surface run-off collected within this area should be diverted into wastewater treatment system.	1			



Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
				ş.
	Details of defective works or observations	Details of defective works or observations Proposed Follow Up Action	Details of defective works or observations Proposed Follow Up Action Photo Ref.	Required

	Name	Title	Signature	Date
Checked by	June Lau	ET Representative	1/\	25 July 2024



29/7/24

Time

1

10=00

Weather

: Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy

Wind

Calm / (ight / Breeze / Strong

Temperature

\*\*

Humidity

: High / Moderate / Low

300

Inspected by	CEDD	Contractor / Sub-Contactor	ET
Signature:	1/	- h i km	IEC Rep.
		7601	Nak
Name:	CKV	hickey win	TEC Rip 32 Mak Kei Wai
Title	Mari	ASM	In the second se



Environmental Checklist		ment		Remark
	Yes	No	N/A	
-ugitive Dust Emission				
The maximum stockpiling height at the fill bank shall be limited to a maximum of +65.2mPD <sub>e</sub> ,	1			VI
Hoarding of at least 2.4m high shall be erected along the site boundary adjacent to Lung Mun Road, River Trade Terminal and EcoPark.	1			
Dust control / mitigation measures shall be provided to prevent dust nuisance.	1			
Water sprays shall be provided and used to dampen materials.	1			
All stockpile of aggregate or soil should be enclosed or covered, and water applied in dry or windy condition.	1			
Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards and shall be covered by a clean tarpaulin.	V			-
Unpayed areas should be watered regularly to avoid dust generation,	V			
The designated site main haul road shall be paved with concrete, bituminous materials, hardcores or metal plates and kept regular watering.	1			
The public road around the site entrance should be kept clean and free from dust.	V			
Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	1			
Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	1		-	
The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water:	1			
Tipping halls at the waterfront provided for transfer of public fill from trucks to barges shall be of enclosed design with top and 3-sides enclosed to prevent spillage of material into marine water.	1			
Vehicle and equipment should be switched off while not in use.	V	-		
All plant and equipment should be well maintained e.g. without black smoke emission.	1			
Open burning should be prohibited.	1			
Approval or exemption Non-road Mobile Machinery (NRMM) labels should be painted or securely fixed on regulated machines and non-road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).	1			
Full implementation of on-shore power supply for marine vessels while at berth.			1	In progress
Increase of the use of internal trucks with at least Euro VI standard to at least 57% of the internal truck fleet.	1			
Noise Impact				
The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	1			
The constructions works should be scheduled to minimize noise nuisance.	1			
<ul> <li>Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.</li> </ul>	1			
Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	1		11121	
Air compressors and hand held breakers should have noise labels.	1	-		



Environmental Checklist		ement Stages		Remark
	Yes		N/A	
Compressors and generators should operate with door closed.	1		9	
Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum	. 1			
Noisy equipment and mobile plant shall always be site away from NSRs.	1			
Water Quality				
Drainage system and the sand / silt removal facilities should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	1	and the second		
The storm water intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	1			<del></del>
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	1			
The material shall be properly covered to prevent washed away especially before rainstorm.	V			
The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water,	1			-
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete; latex, vinyl, bittimen, or other suitable surface stabilizer approved by CEDD.	7			The age
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	1			
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	V			
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	1			24 - 30
Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided.	V			
The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	V			
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	V			
The barges shall be in right size such that adequate clearance in maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	1			
All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	٧			
Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	1			
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	√			
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	1			
A waste collection vessel shall be deployed to remove floating debris.	: 1			
andscape and Visual				
The maximum stockpiling height at the fill bank shall be limited to a maximum of +65.2mPD.	V		1	
Surface of outer slopes of the Fill Bank shall preferably be hydroseeded.	V			



Environmental Checklist		ement Stages		Remark
	Yes	No	N/A	
Stockpile of public fill shall be removed in a sequence to allow the outer hydrseeded to be removed later than other portions as far as practicable.	Arm.			
Casuarina equisetifolia were planted as buffer tree along the northern perimeter of the Site. The height of Casuarina equisetifolia was maintained at bleast 3m above soil level.	1			
· Lighting shall be set to minimise night-time glare.	1			
Vaste Management				
Construction Waste Management				
Relevant licence / permits for disposal of construction waste or excavated materials available for inspection.	1			
Excavated material to be generated from construction works to be re-used on-site as far as practicable to reduce off-site disposal.	1			
Mud and debris should be removed from waterworks access roads and associated drainage systems.	1			
Provision of sufficient waste disposal points and regular collection for disposal. Appropriate measures should be employed to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers.	4			
Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal.	Į V			
<ul> <li>Prior to disposal of C&amp;D waste, recyclable materials should be salvaged for reuse (such as wood and metal) and inert waste utilised as public fill to minimise the quantity of waste to be disposed of to landfill.</li> </ul>	7			
<ul> <li>In order to monitor the disposal of C&amp;D material and solid wastes at public filling areas and landfills, and to control fly-tipping, a trip-ticket system should be included as one of the contractual requirements.</li> </ul>	V			
Any soil contaminated with chemicals/oils shall be removed from site and the void created shall be filled with suitable materials.	1			
Chemical Waste Management				
It is required to register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes.	٨			
<ul> <li>After use, chemical wastes (e.g. cleaning fluids, solvents, lubrication oil and fuel) should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes.</li> </ul>				
<ul> <li>Spent chemicals should be stored and collected by an approved operator for disposal at the Chemical Waste Treatment Facility or other licensed facility in accordance with the Chemical Waste (General) Regulation.</li> </ul>	1			
<ul> <li>Chemical wastes should be separated for special handling and appropriate treatment at the Chemical Waste Treatment Facility.</li> </ul>	1			
<ul> <li>Chemical wastes including waste oil should be stored properly in designated areas, e.g. chemical waste storage area.</li> </ul>	√			
The designated chemical waste storage area should only be used for storing chemical wastes.	1	1		
The set-up of chemical waste storage area should				
Be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition.	1			
Be enclosed on at least 3 sides and securely closed.	1			
<ul> <li>Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest.</li> </ul>	1			



	Environmental Checklist		ment		Remark
		Yes	-	N/A	
•	lave adequate ventilation.	1			
ar I	Be covered to prevent rainfall entering (water collected within the bund must be tested and disposal as chemical waste if necessary).	1			
Well.	Se arranged so that incompatible materials are adequately separated.	1			
• \	Varning panels should be displayed at the waste storage area,	1			
• \	Vaste storage area should be deaned and maintained regularly,	J			
• (	Chemical waste should be transported regularly by a registered chemical waste collector to a facility licensed to receive chemical waste.	1			
* /	All generators, fuel and oil storage should be within bundle areas.	1			<del></del>
. (	Dit leakage from machinery, vehicle and plant should be prevented.		V	inite i	
• [	n the event of chemical waste / dangerous goods / chemicals spillage or leakage, the procedures as outlined in the Spillage Response Plan should be followed.	1			
	The dangerous goods / chemical spillage or leakage procedures (including equipments) should be in place.	7			
Good	Site Practices				
4	Nomination of approved personnel, such as site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.	1			
	raining of site personnel in proper waste management and chemical handling procedures should be provided.	7			
• (	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	1			
• 1	Proper storage and site practices to minimise the potential for damage or contamination of construction materials.	V			
E .	he Environmental Permit should be displaced conspicuously on site.	1			
(	Construction noise permits should be posted at site entrance or available for site inspection.	- 1			
	Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	V			
. (	hemical storage area provided with lock and located on sealed areas.	1			
. /	Il chemicals should be placed at the banded area with adequate band capacity (>110% of largest tank).	7			
. /	any unused chemicals or those with remaining functional capacity should be recycled.	7			bilania
ı f	Regular cleaning and maintenance programme for waste storage area, drainage systems, silt traps, sumps and oil interceptors.	1			
• 1	o encourage collection of aluminium cans by individual collectors.	7			
• 8	eparate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	1			
■ A	recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be used, e.g. trip ticket system or chemical waste disposal. Quantities could be determined by weighing each load or other suitable methods.	1			
to	collection area should be provided where waste can be stored and loaded prior to removal from site. An enclosed and covered area is preferred reduce the occurrence of 'wind blown' light material. If an open area is unavoidable for the storage or loading/unloading of wastes, then the area hould be bunded and all the polluted surface run-off collected within this area should be diverted into wastewater treatment system.	1		E II	



## Summary of the Weekly Site Inspection:

ltem	Details of defective works or observations	Proposed Follow Up Action	Photo Ref	Further Action Required (Yes/No)	Target Completion Date
25					
emark			2 100		

1175-211300-21-21-	Name	Title	Signature	Date
Checked by	June Lau	ET Representative		29 July 2024



# Appendix I

Implementation Schedule of Mitigation Measures



Contract No.: CV/2021/09

Handling of Surplus Public Fill (2022-2023) - Tuen Mun Area 38 Fill Bank

**Environmental Mitigation Implementation Schedule** 

	Location	Implementation Status					
Environmental Protection Measures	S Ir				Not Applicable		
Air Quality							
The maximum stockpiling height at the fill bank shall be limited to a maximum of +65.2mPD.	All areas	1					
<ul> <li>Hoarding of at least 2.4m high shall be erected along the site boundary adjacent to Lung Mun Road, River Trade Terminal and EcoPark.</li> </ul>	Site boundary	7					
Dust control / mitigation measures shall be provided to prevent dust nuisance.	All areas	1					
Water sprays shall be provided and used to dampen materials.	All areas	1		,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,			
All stockpile of aggregate or soil should be enclosed or covered, and water applied in dry or windy condition.	All areas	1					
Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards and shall be covered by a clean tarpaulin.	All areas	√			2 31 14 1		
<ul> <li>Unpaved areas should be watered regularly to avoid dust generation.</li> </ul>	Site Egress	√					
<ul> <li>The designated site main haul road shall be paved with concrete, bituminous materials, hardcores or metal plates and kept regular watering.</li> </ul>	All haul roads	7					
The public road around the site entrance should be kept clean and free from dust.	All areas	1					
Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	Site Egress	1		-20			
Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	Site Egress	1					
The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.	All areas	1					
Tipping halls at the waterfront provided for transfer of public fill from trucks to barges shall be of enclosed design with top and 3-sides enclosed to prevent spillage of material into marine water.	Tipping halls	7					
Vehicle and equipment should be switched off while not in use.	All areas	1			0 0		
All plant and equipment should be well maintained e.g. without black smoke emission.	All areas	√		1 1.1			
Open burning should be prohibited.	All areas	√					
<ul> <li>Approval or exemption Non-road Mobile Machinery (NRMM) labels should be painted or securely fixed on regulated machines and non-road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).</li> </ul>	All areas	1					
Full implementation of on-shore power supply for marine vessels while at berth.	Barging points	•	1				
Increase of the use of internal trucks with at least Euro VI standard to at least 57% of the internal truck fleet.	All areas	1					



Contract No.: CV/2021/09 Handling of Surplus Public Fill (2022-2023) - Tuen Mun Area 38 Fill Bank

	Location	Implementation Status					
Environmental Protection Measures		Implemented	Partially implemented	Not implemented	Not Applicable		
Noise Impact				<b>建工业</b>			
<ul> <li>The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.</li> </ul>	All areas	1	145				
Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.	All areas	V					
Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	All areas	V					
Air compressors and hand held breakers should have noise labels.	All areas	V					
Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	All areas	1					
<ul> <li>Noisy equipment and mobile plant shall always be site away from NSRs.</li> </ul>	All areas	1					
Water Quality							
The existing / realigned intercepting channels and the sand / silt removal facilities shall be used and maintained.	All areas	1					
Temporary intercepting drains should be used at the stockpilling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	All areas	1					
The storm water intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	All areas	1					
The material shall be properly covered to prevent washed away especially before rainstorm.	All areas	1					
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	All areas		1				
The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.	Temporary Slopes	1					
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	All areas	1					
<ul> <li>A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.</li> </ul>	Wheel Washing facility	1					
<ul> <li>The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.</li> </ul>	Site Egress	√					
<ul> <li>Sewage from toilets shall be discharged into a foul sewer, or chemical toilets shall be provided.</li> </ul>	Site Office	7					
<ul> <li>The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.</li> </ul>	All areas	7					
<ul> <li>Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.</li> </ul>	All areas	1					
<ul> <li>Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.</li> </ul>	Along the seafront	1					
A waste collection vessel shall be deployed to remove floating debris.	Along the seafront	V					



Contract No.: CV/2021/09 Handling of Surplus Public Fill (2022-2023) - Tuen Mun Area 38 Fill Bank

	Location	Implementation Status					
Environmental Protection Measures		Implemented	Partially implemented	Not implemented	Not Applicable		
Landscape and Visual							
The maximum stockpiling height at the fill bank shall be limited to a maximum of +65.2mPD.	All areas	7					
Surface of outer slopes of the Fill Bank shall preferably be hydroseeded.	Completed slopes	1					
<ul> <li>Stockpile of public fill shall be removed in a sequence to allow the outer hydrseeded to be removed later than other portions as far as practicable.</li> </ul>	Completed slopes	1					
<ul> <li>Casuarina equisetifolia were planted as buffer tree along the northern perimeter of the Site. The height of Casuarina equisetifolia was maintained at least 3m above soil level.</li> </ul>	Site boundary	√					
Lighting shall be set to minimise night-time glare.	All areas	1					
Waste Management							
Construction Waste Management							
Relevant licence / permits for disposal of construction waste or excavated materials available for inspection.	All areas	1					
Excavated material to be generated from construction works to be re-used on-site as far as practicable to reduce off-site disposal.	All areas	1					
<ul> <li>Mud and debris should be removed from waterworks access roads and associated drainage systems.</li> </ul>	All areas	√					
<ul> <li>Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal.</li> </ul>	All areas	1					
<ul> <li>Prior to disposal of C&amp;D waste, recyclable materials should be salvaged for reuse (such as wood and metal) and inert waste utilised as public fill to minimise the quantity of waste to be disposed of to landfill.</li> </ul>	All areas	7					
<ul> <li>In order to monitor the disposal of C&amp;D material and solid wastes at public filling areas and landfills, and to control fly-tipping, a trip-ticket system should be included as one of the contractual requirements.</li> </ul>	All areas	√					
Any soil contaminated with chemicals/oils shall be removed from site and the void created shall be filled with suitable materials.	All areas	√ √					
Chemical Waste Management							
<ul> <li>It is required to register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes.</li> </ul>	Waste Storage Area	√					
<ul> <li>After use, chemical wastes (e.g. cleaning fluids, solvents, lubrication oil and fuel) should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes.</li> </ul>	Waste Storage Area	1					
<ul> <li>Spent chemicals should be stored and collected by an approved operator for disposal at the Chemical Waste Treatment Facility or other licensed facility in accordance with the Chemical Waste (General) Regulation.</li> </ul>	Waste Storage Area	1					
Chemical wastes should be separated for special handling and appropriate treatment at the Chemical Waste Treatment Facility.	Waste Storage Area	1					
Chemical wastes including waste oil should be stored properly in designated areas, e.g. chemical waste storage area.	Waste Storage Area	1					
The designated chemical waste storage area should only be used for storing chemical wastes.	Waste Storage Area	1					



Contract No.: CV/2021/09

Handling of Surplus Public Fill (2022-2023) - Tuen Mun Area 38 Fill Bank

Environmental Destaction Management		Implementation Status						
Environmental Protection Measures		Implemented	Partially implemented	Not implemented	Not Applicable			
The set-up of chemical waste storage area should								
<ul> <li>Be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition.</li> </ul>	Waste Storage Area	1						
Be enclosed on at least 3 sides and securely closed.	Waste Storage Area	√						
Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest.	Waste Storage Area	1						
Have adequate ventilation.	Waste Storage Area	1						
Be covered to prevent rainfall entering (water collected within the bund must be tested and disposal as chemical waste if necessary).	Waste Storage Area	<b>V</b>						
Be arranged so that incompatible materials are adequately separated.	Waste Storage Area	1						
Warning panels should be displayed at the waste storage area.	Waste Storage Area	1						
Waste storage area should be cleaned and maintained regularly.	Waste Storage Area	V						
Chemical waste should be transported by a registered chemical waste collector to a facility licensed to receive chemical waste.	All areas	1						
All generators, fuel and oil storage should be within bundle areas.	All areas	<b>√</b>						
Oil leakage from machinery, vehicle and plant should be prevented.	All areas	1						
In the event of chemical waste / dangerous goods / chemicals spillage or leakage, the procedures as outlined in the Spillage Response Plan should be followed.	All areas	1	_					
The dangerous goods / chemical spillage or leakage procedures (including equipments) should be in place.	All areas	1						
Good Site Practices								
Nomination of approved personnel, such as site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.	All areas	1						
Training of site personnel in proper waste management and chemical handling procedures should be provided.	All areas	1						
Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	All areas	√						
Proper storage and site practices to minimise the potential for damage or contamination of construction materials.	All areas	√						
The Environmental Permit should be displaced conspicuously on site.	Site Entrance	1						
Construction noise permits should be posted at site entrance or available for site inspection.	Site Entrance				1			
Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	All areas	<b>V</b>						
Chemical storage area provided with lock and located on sealed areas.	Chemical Storage Area	√						




Contract No.: CV/2021/09 Handling of Surplus Public Fill (2022-2023) - Tuen Mun Area 38 Fill Bank

	Location		Implementation Status			
Environmental Protection Measures		implemented	Partially implemented	Not implemented	Not Applicable	
All chemicals should be placed at the banded area with adequate band capacity (>110% of largest tank).	Chemical Storage Area	1				
Any unused chemicals or those with remaining functional capacity should be recycled.	All areas	1				
Regular cleaning and maintenance programme for waste storage area, drainage systems, silt traps, sumps and oil interceptors.	All areas	1				
<ul> <li>To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.</li> </ul>	All areas	1				
<ul> <li>A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be used, e.g. trip ticket system for chemical waste disposal. Quantities could be determined by weighing each load or other suitable methods.</li> </ul>	All areas	√				
<ul> <li>A collection area should be provided where waste can be stored and loaded prior to removal from site. An enclosed and covered area is preferred to reduce the occurrence of 'wind blown' light material. If an open area is unavoidable for the storage or loading/unloading of wastes, then the area should be bunded and all the polluted surface run-off collected within this area should be diverted into wastewater treatment system.</li> </ul>	All areas	٧			ı.S	
Remove wastes in a timely manner.	All areas	1				



Appendix J
Site General Layout plan

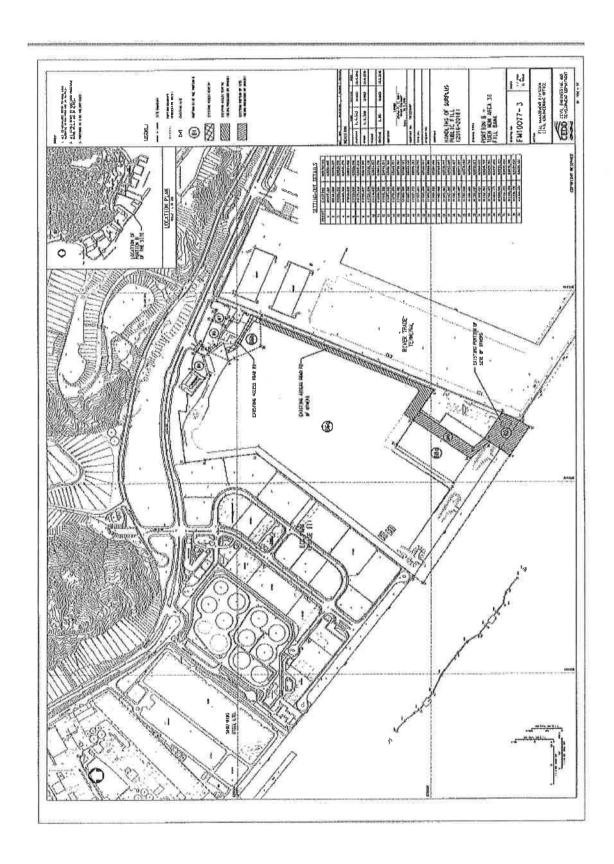



# Appendix K Monthly Summary Waste Flow Table

## **Monthly Summary Waste Flow Table for 2024**

	Actual Quantities of Inert C&D Materials Generated Monthly  Actual Quantities of C&D Wastes Generated Monthly								stes Generated Mo	nthly	
Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging	Plastics (see Note 3)	Chemical Waste	Others, e.g. general refuse
	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000 kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)
Jan	0	0	0	0	0	0	167.18	0	0	0	449.88
Feb	0	0	0	0	0	0	147.63	0	0	0	65.28
Mar	0	0	0	0	0	0	172.64	0	0	0	45.64
Арг	0	0	0	0	0	0	156.97	0	0	0	112.76
May	0	0	0	0	0	0	160.95	0	0	0	138.16
Jun	0	0	0	0	0	0	147.13	0	0	0	135.95
Sub-total	. 0	0 - 5	0	0	0	0	952.5	0	0	0	947.67
Jul	0	0	0	0	0	0	211.16	0	0	0	119.74
Aug											
Sep											
Oct											
Nov											
Dec		_									
Total	0	0	0	0	0	0	1163.66	0	0	0	1067.41

#### Notes:

- (1) The performance targets are given in PS Clause 1.108(14).
- (2) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- (3) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material
- (4) The Contractor shall also submit the latest forecast of the total amount of C&D materials expected to be generated from the works, together with a breakdown of the nature where the total amount of C&D materials expected to be generated from the works is equal to or exceeding 50,000 m<sup>3</sup>.
- (5) This waste flow table is under Contract (No. CV/2021/09) and the quantities of materials shown in the table is the sum of the material quantities generated by TKO137 Fill Bank and TM38 Fill Bank



# Appendix L

**Monitoring Schedule for the Coming Month** 



Time Schedule for Impact Water Quality Monitoring (WQM), Impact Air Monitoring (1-hrTSP, 24-hr TSP and 24-hr RSP), Weekly Site Inspection (Weekly SI) and Impact Noise Monitoring
August 2024

Sunday		Tuesday	Wednesday	Thursday	Friday 2-Aug	Saturday 3-Aug
28-Jul	Weekly SI (am)  WQM Mid-ebb (07:30-09:00) Mid-flood	24-hr TSP 24-hr RSP NM	31-Jul WQM Mid-ebb (09:00-10:30) Mid-flood	1-hr TSP x 2 NM Weekly SI (am)	1-hr TSP x 1 Set 24 hr (05/08) WQM Mid-ebb (11:00-12:30) Mid-flood	3-40
Solbert III) make	(13:00-14:30)		(16:00-17:30)		(17:30-19:00)	
4-Aug	24-hr TSP 24-hr RSP WQM Mid-ebb (11:30-13:00) Mid-flood (18:00-19:30)	6-Aug 1-hr TSP x 2 NM	7-Aug WQM Mid-flood (07:00-08:30) Mid-ebb (13:00-14:30)	8-Aug 1-hr TSP x 1 Set 24 hr (11/08) NM Weekly SI (am)	WQM Mld-flood (08:00-09:30) Mid-ebb (14:30-16:00)	, 10-Au
11-Aug	12-Aug	13-Aug	14-Aug	15-Aug	16-Aug	17-Au
24-hr TSP 24-hr RSP	WQM Mid-flood (11:00-12:30) Mid-ebb (16:30-18:00)	1-hr TSP x 2 NM		1-hr TSP x 1 NM Weekly SI (am) WQM Mid-ebb (08:30-10:00) Mid-flood (18:00-17:30)		24-hr TSP 24-hr RSP WQM Mid-ebb (10:30-12:00) Mid-flood (17:00-18:30)
18-Aug	19-Aug	20-Aug	21-Aug		23-Aug	24-Au
		1-hr TSP x 2 NM WQM Mid-flood (07:00-08:30) Mid-ebb (12:30-14:00)		1-hr TSP x 1 Set 24 hr (23/08) NM Weekly SI (am) WQM Mid-flood (08:00-09:30) Mid-ebb (14:00-15:30)	24-hr TSP 24-hr RSP	1-hr TSP x 2 WQM Mid-flood (98:30-11:00) Mid-ebb (15:30-17:00)
25-Aug	26-Aug	27-Aug	28-Aug		30-Aug	31-Au
		1-hr TSP x 1 NM WQM Mid-ebb (07:00-08:30) Mid-flood (13:00-14:30)		24-hr TSP 24-hr RSP NM Weekly SI (am) WQM Mid-ebb (09:30-11:00) Mid-flood (16:00-17:30)		1-hr TSP x 2 WQM Mid-ebb (10:00-11:30) Mid-flood (17:30-19:00)

- Remarks:


  1. The monitoring schedule may be changed due to unforeseen circumstances such as adverse weather.


  2. RSP measurement is not required in the EM&A manual and RSP would not presented in EM&A report.



# Predicted tide schedule from the Hong Kong Observatory for Impact Water Quality Monitoring (WQM)

### August 2024

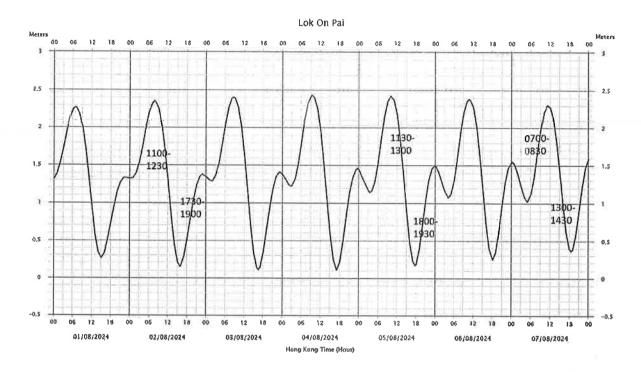


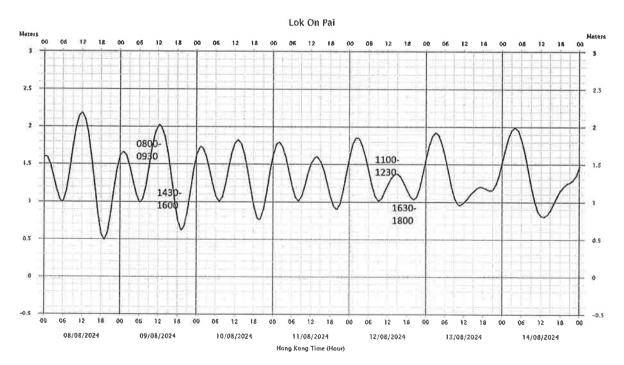




## Predicted tide schedule from the Hong Kong Observatory for Impact Water Quality Monitoring (WQM)

### August 2024

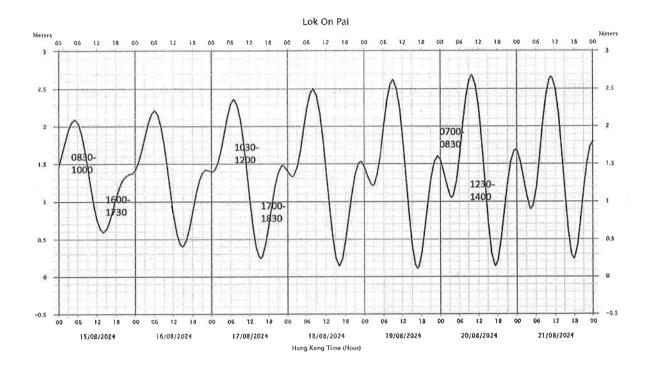


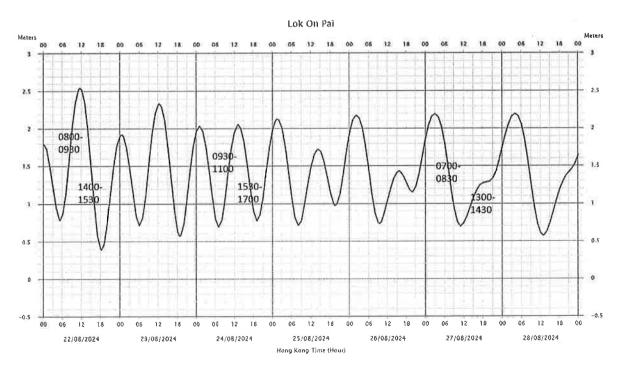



## Predicted tide schedule from the Hong Kong Observatory for Impact Water Quality Monitoring (WQM)

### August 2024

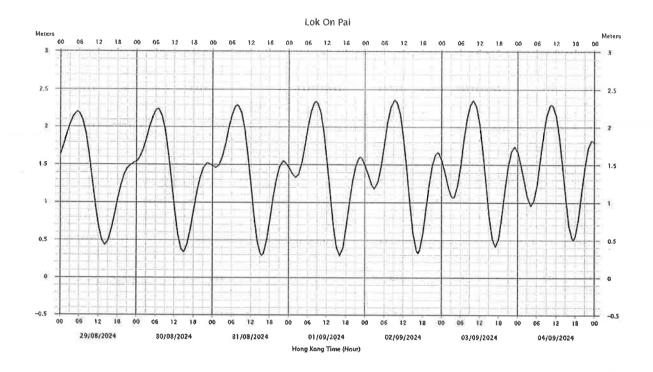



# Appendix M Reporting Month Monitoring Schedule



Time Schedule for Impact Water Quality Monitoring (WQM), Impact Air Monitoring (1-hrTSP, 24-hr TSP and 24-hr RSP), Weekly Site Inspection (Weekly SI) and Impact Noise Monitor July 2024

Sunday 30-Jun	The second secon	Tunsday 2-Ju	Wednesday 3-Jul		Friday 5-Jul	Saturday 6-
			0.30	4500	5-001	•
4-hr TSP		1-hr TSP x 2		1-hr TSP x 1		24-hr TSP
4-hr TSP	3.00	NM	1	Weekly SI (am)		24-hr TSP
			1	NM		
		WQM	l	WQM		WQM
		Mid-ebb	l	Mid-ebb		Mid-ebb
		(09:30-11:00)	l	(11:00-12:30)		(13:00-14:30)
8 4 4 6 6		Mid-flood	I	Mid-flood		Mid-flood
		(16:00-17:30)	l	(17:30-19:00)		(19:00-20:30)
7-Jul	8-Jul		10-Ju		12-Jul	(19:00-20:30)
				1-hr TSP x 1	12 000	
	1	1-hr TSP x 2	I	Set 24 hr (12/07)	24-hr TSP	1-hr TSP x 2
		NM	l	NM	24-hr TSP	· · · · · · · · · · · · · · · · · · ·
			1	Weekly SI (am)		
		WQM		WQM		WOM
		Mid-flood	l	Mid-flood		
	1		I			Mid-flood
	1	(08:00-09:30)	I	(09:00-10:30)		(10:30-12:00)
	1	Mid-ebb	l	Mid-ebb	i i	Mid-ebb
		(15:00-16:30)		(15:30-17:00)		(16:30-18:00)
14-Jul	15-Jul	16-Jul	17-Jul		19-Jul	20
		4 to TOD 4		24-hr TSP		
		1-hr TSP x 1		24-hr TSP	IT.	1-hr TSP x 2
		NM	l	NM		
		Value a la company		Weekly SI (am)		or to be recovered
		WQM	l	WQM		WQM
		Mid-ebb		Mid-ebb		Mid-ebb
		(08:30-10:00)	l	(10:00-11:30)		(11:30-13:00)
		Mid-flood		Mid-flood		Mid-flood
		(15:30-17:00)		(17:00-18:30)		(18:00-19:30)
21-Jul	22-Jul	23-Jul	24-Jul	25-Ju	26-Jul	(18.00-19.30)
					.1	
		1-hr TSP x 1	24-hr TSP	1-hr TSP x 2		1-hr TSP x 1
		Set 24 hr (23/07)	24-hr TSP	NM		
		NM		Weekly SI (am)		
		WQM	l	WQM '		wam .
		Mid-flood	I	Mid-flood		Mid-flood
		(07:30-09:00)	I	(08:30-10:00)		(10:00-11:30)
		Mid-ebb	l	Mid-ebb		Mid-ebb
	1	(13:30-15:00)	l.			
28-Jul	29-Jul	(13:30-10:00) 30-Jul	34.14	(15:00-16:30)		(16:00-17:30)
20-30	29-301	30-30	31-Jul	1-Aug	2-Aug	3.4
		24-hr TSP		1-hr TSP x 2		1-hr TSP x 1
	Weekly SI (am)	24-hr TSP	l	NM	1	101 X 1
	and or family	NM	I	' <b>*</b> '''	I	
	wam		wam .		WQM	
	Mid-ebb		Mid-ebb		Mid-ebb	
	(07:30-09:00)		(09:00-10:30)		(11:00-12:30)	
	Mid-flood		Mid-flood		Mid-flood	
	(13:00-14:30)		(16:00-17:30)	1	(17:30-19:00)	

The monitoring schedule may be changed due to unforeseen circumstances such as adverse weather.

RSP measurement is not required in the EM&A manual and RSP would not presented in EM&A report.



# Appendix N

**QA/QC** Results of Laboratory Analysis



## **QA/QC Results of Laboratory Analysis of Total Suspended Solids**

	QC Sample Analysis	Sample D	uplicate	Sampl	e Spike	
Sampling Date	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery ©	
	102.1	FC1-S	2.82	FM2-M	91.6	
	98.4	FM2-B	8.00	EM1-S	88.3	
2024/7/2	99.9	EM1-M	6.06	EC2-B	115.3	
	104.6	FC1-S	6.90	FM2-M	106.4	
	99.8	FM2-B	1.77	EM1-S	96.5	
2024/7/4	102.4	EM1-M	7.14	EC2-B	102.9	
	99.9	FC1-S	0.00	FM2-M	90.3	
	99.9	FM2-B	6.90	EM1-S	89.8	
2024/7/6	100.0	EM1-M	0.00	EC2-B	94.7	
	100.5	FC1-S	7.41	FM2-M	109.8	
	102.3	FM2-B	4.08	EM1-S	115.8	
2024/7/9	102.9	EM1-M	1.94	EC2-B	93.3	
	102.8	FC1-S	2.82	FM2-M	105.3	
	102.6	FM2-B	7.69	EM1-S	113.4	
2024/7/11	101.6	EM1-M	7.41	EC2-B	98.2	
	102.6	FC1-S	5.13	FM2-M	83.9	
	98.9	FM2-B	8.70	EM1-S	95.0	
2024/7/13	100.6	EM1-M	9.52	EC2-B	84.0	
	99.1	FC1-S	1.83	FM2-M	104.3	
	103.1	FM2-B	7.02	EM1-S	98.2	
2024/7/16	102.1	EM1-M	0.00	EC2-B	82.3	
202-17710	100.1	FC1-S	2.02	FM2-M	105.3	
	99.7	FM2-B	6.32	EM1-S	91.0	
2024/7/18	99.4	EM1-M	8.00	EC2-B	97.8	
202-11110	102.9	FC1-S	4.08	FM2-M	116.7	
	103.2	FM2-B	6.90	EM1-S	119.4	
2024/7/20	103.6	EM1-M	8.00	EC2-B	108.9	
202 111120	96.6	FC1-S	8.00	FM2-M	89.2	
	102.6	FM2-B	9.52	EM1-S	98.9	
2024/7/23	102.1	EM1-M	0.00	EC2-B	87.0	
202-11120	100.8	FC1-S	7.41	FM2-M	112.1	
	98.2	FM2-B	0.00	EM1-S		
2024/7/25	99.2	EM1-M	6.06	EC2-B	103.9 87.7	
2027/1/20	101.5	FC1-S	5.71			
	101.3	FM2-B	3.64	FM2-M	88.5	
2024/7/27	100.1	EM1-M		EM1-S	86.2	
404711141	103.9	FC1-S	5.83	EC2-B	91.4	
			6.90	FM2-M	93.3	
2024/7/20	102.1	FM2-B	7.14	EM1-S	102.5	
2024/7/29	101.3	EM1-M	9.84	EC2-B	115.0	
	103.8	FC1-S	3.28	FM2-M	114.3	
2024/7/24	101.9	FM2-B	6.90	EM1-S	93.6	
2024/7/31	104.2	EM1-M	2.60	EC2-B	84.0	

Note:(\*)% Recovery of QC sample should be between 80% to 120%. (\*)% Error of Sample Duplicate should be between –10% to 10%. (®)% Recovery of Sample Spike should be between 80% to 120%.



Appendix O

**Complaint Log** 



# Complaint Log

Log Ref.	Location	Received Date	Details of Complaint	Investigation / Mitigation Action	Status
001	Lung Mun Road near Tuen Mun Area 38 Fill Bank	24 May 2017	One complaint received on 24 May 2017, which was forwarded to ET on 03 June 2017, from public against the rocks and debris deposited on the road surface along Lung Mun Road near Tuen Mun Area 38 Fill Bank. The complainant complained that waste generated caused an environmental nuisance.	Refer to the ET site investigation on 06 June 2017, the condition of Lung Mun Road near Tuen Mun Area 38 Fill Bank was found satisfactory.  Details of Action(s) Taken by the Contactor:  1. Regular water spraying by water lorries is provided for road cleaning at Lung Mun Road;  2. Regular cleaning on Lung Mun Road and the access road at the site exit by road sweeper to remove mud and gravel is arranged four times on each working day;  3. Site vehicles are washed to remove any dusty materials from their bodies and wheels by using high pressure water jet manually at the entrance of work site before leaving;  4. Site vehicle for transporting materials are covered properly by using clean tarpaulin sheets;  5. Regular cleaning at the site haul road is provided to minimize the fugitive dust emission.	Closed
002	Lung Mun Road near Tuen Mun Area 38 Fill Bank	16 April 2018	One complaint received on 16 April 2018 from public and forwarded to ET by email at 10:51 on 25 May 2018. The complaint detail was"來往屯門第 38 區填料庫的龍門路沿路有很多泥頭車出入,泥頭會從車上掉至路面上,要求部門跟進及回覆。"	Refer to the ET site investigation on 26 May 2018, the condition of Lung Mun Road near Tuen Mun Area 38 Fill Bank was found satisfactory.  Details of Action(s) Taken by the Contactor:  1. Regular cleaning on Lung Mun Road and the access road at the site exit by road sweeper to remove mud and gravel is arranged four times on each working day;  2. Regular water spraying by water lorries is provided for road cleaning at Lung Mun Road;  3. Site vehicles are washed to remove any dusty materials from their bodies and wheels by using high pressure water jet manually at the entrance of work site before leaving;  4. Site vehicles for transporting materials are covered properly by using clean tarpaulin sheets; Regular cleaning at the site haul road is provided.	Closed



003	Lung Mun Road near Tuen Mun Area 38 Fill Bank	26 June 2018	One complaint received on 26 June 2018 from public and forwarded to ET by email at 13:58 on 03 July 2018. The complaint detail was" 當天水車於 6 時出動洗街,導致交通阻塞."	Refer to the ET site investigation on 07 July 2018, the condition of Lung Mun Road near Tuen Mun Area 38 Fill Bank was found satisfactory.  Details of Action(s) Taken by the Contactor:  1. Improve the road washing plan to avoid washing in traffic peak peroid  2. Revised the road washing schedule as soon as possible once there is traffic jam	Closed
004	Tuen Mun Area 38 Fill Bank	06 October 2021	A complaint was received on 06 October 2021 from public regarding dust nuisance within TM38 Fill Bank and was forwarded to ET by email on 06 October 2021 for investigation.	Refer to the ET site investigation on 12 October 2021, no defective observation related to dust emission was recorded during the investigation.  Details of Action(s) Taken by the Contactor:  1. Regular water spraying by water lorries is provided for dust suppression inside the Fill Bank.  2. Regular cleaning at the site haul road is provided to minimize the dust emission.	Closed



005	Tuen Mun Area 38 Fill Bank	28 June 2022	A complaint was received on 28 June 2022, which was forwarded to ET by email on 28 June 2022 for investigation, from public against "土木工程署屯門第 38 區填料庫經常發出異味,致現場的空氣及環境被受污染,土木工程拓展署難辭其咎,環保署亦應就現場大量大型車輛造成的空氣污染作出跟進。"	Refer to the ET site investigation on 30 June 2022, no defective observation related to dust emission was recorded during the investigation  Details of Action(s) Taken by the Contactor:  1. Regular water spraying by water lorries is provided for dust suppression inside the Fill Bank;  2. Regular cleaning at the site haul road is provided to minimize the dust emission;  3. Site vehicles are washed to remove any dusty materials from their bodies and wheels by using high pressure water jet manually at the entrance of work site before leaving;	Closed
006	Tuen Mun Area 38 Fill Bank	05 July 2022	A complaint was received on 05 July 2022, which was forwarded to ET by email on 15 July 2022 for investigation, from an environmental group against "為何 TM38 區之斜坡不同蓋上帆布".	Refer to the ET site investigation on 14 July 2022, no defective observation related to dust emission was recorded during the investigation.  Details of Action(s) Taken by the Contactor:  1. Regular water spraying by water lorries is provided for dust suppression inside the Fill Bank.  2. Regular cleaning at the site haul road is provided to minimize the dust emission.	Closed





007	Tuen Mun Area 38 Fill Bank	30 September 2022	A complaint was received on 30 September 2022, which was forwarded to ET by email on 03 October 2022 for investigation, against "In recent days, we found that there was significant dust emission from the fill bank. As you are aware that we need to conduct RSP and TSP monitoring at the site boundary with very tight limits. We worry that these situations might affect our measurement. Please see the videos attached. They are taken on 21 Sept and one on 26 Sept. Grateful if you could investigate the cases and ensure dust is properly controlled.".	The video provided by the complainant showed that there was serious dust emission in 3RS collection area of public fill. Based on this situation, mitigation measures implemented in TM38 Fill Bank were reviewed and enhanced to avoid dust emission.  A joint site inspection and meeting was carried out on 06 October 2022 to discuss the dust emission at TM38 Fill Bank. The location of 3RS and discharge point would be inspected in every weekly environmental audit. The status of 3RS location would be recorded to monthly EM&A report.  Details of Action(s) Taken by the Contactor:  1. Increasing the frequency of water spraying by water lorries inside the Fill Bank.  2. Setting up water spraying machine in the 3RS area 3. Regular cleaning at the site haul road is provided to minimize the dust emission.	Closed
008	Tuen Mun Area 38 Fill Bank	25 January 2024	A complaint was received on 25 January 2024, which was forwarded to ET by email on 26 January 2024 for investigation, from public against dust nuisance and lack of lighting facilities "投訴屯門 38 區填料庫,沙塵四起,要求加強灑水。要求增加石屎路。夜間增加照明。"	Refer to the ET site investigation on 14 July 2022, no defective observation related to dust emission was recorded during the investigation.  Details of Action(s) Taken by the Contactor:  3. Increasing the frequency of water spraying by water lorries to suppress dust emission inside the Fill Bank.  4. Regular cleaning at the site haul road is provided to minimize the dust emission.	Closed



**Figures** 



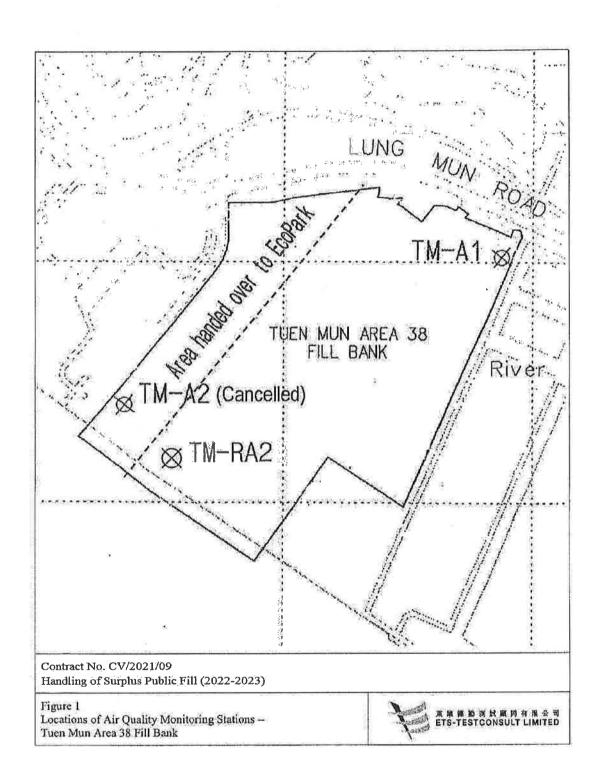

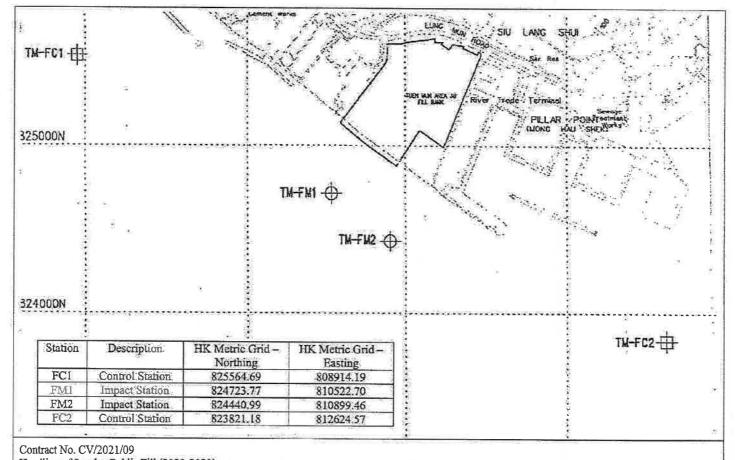

Handling of Surplus Public Fill (2022-2023)

Figure 2 Locations of Water Quality Monitoring Station — Tuen Mun Area 38 Fill Bank



