



China State Construction Engineering (Hong Kong) Ltd.

Contract No. CV/2007/03

**Development at Anderson Road –  
Site Formation and Associated  
Infrastructure Works**

**Monthly EM&A Report for  
December 2018**

January 2019

	Name	Signature
Prepared & Checked:	Alex Chan	
Reviewed, Approved & Certified:	Yiu Wah Fung (ETL)	

Version: 0

Date: 11 January 2019

**Disclaimer**

This report is prepared for China State Construction Engineering (Hong Kong) Ltd. and is given for its sole benefit in relation to and pursuant to Contract No. CV/2007/03 Development at Anderson Road – Site Formation and Associated Infrastructure Works and may not be disclosed to, quoted to or relied upon by any person other than China State Construction Engineering (Hong Kong) Ltd. without our prior written consent. No person (other than China State Construction Engineering (Hong Kong) Ltd.) into whose possession a copy of this report comes may rely on this report without our express written consent and China State Construction Engineering (Hong Kong) Ltd. may not rely on it for any purpose other than as described above.

AECOM Asia Co. Ltd.

11/F, Grand Central Plaza, Tower 2, 138 Shatin Rural Committee Road, Shatin, NT, Hong Kong.

Tel: (852) 3922 9000 Fax: (852) 2317 7609 www.aecom.com

Ref.: OAPANDSNEM00\_0\_2094L.19

11 January 2019

Engineer's Representative  
Ove Arup & Partners  
Level 5, Festival Walk  
80 Tat Chee Avenue  
Kowloon Tong, Kowloon  
Hong Kong

By Post and Fax: 2407 8382

Attention: Mr. YK Cheung

Dear Sir,

**Re: Contract No. CV/2007/03 (Environmental Permit No. EP-140/2002)  
Development at Anderson Road  
Site Formation and Associated Infrastructure Works  
Monthly EM&A Report for December 2018**

Reference is made to the Environmental Team's submission of the draft Monthly EM&A Report for December 2018 received by e-mail on 11 January 2019 for our review and comment.

Please be informed that we have no adverse comment on the captioned submission. We write to verify the captioned submission in accordance with Condition 3.3 of the Environmental Permit No. EP-140/2002.

Thank you very much for your attention and please feel free to contact the undersigned should you require further information.

Yours faithfully,



David Yeung  
Independent Environmental Checker

c.c.            AECOM            Attn.: Mr. Y. W. Fung  
                  CSCEC            Attn.: Mr. Holmes Wong

By Fax: 3922 9797  
By Email

Q:\Projects\OAPANDSNEM00\Corr\OAPANDSNEM00\_0\_2094L.19.docx

## Table of Content

	Page
<b>EXECUTIVE SUMMARY .....</b>	<b>1</b>
<b>1 INTRODUCTION.....</b>	<b>4</b>
1.1 Background .....	4
1.2 Scope of Report .....	4
1.3 Project Organization.....	4
1.4 Summary of Construction Works .....	5
1.5 Summary of EM&A Programme Requirements .....	6
<b>2 AIR QUALITY MONITORING.....</b>	<b>7</b>
2.1 Monitoring Requirements .....	7
2.2 Monitoring Equipment .....	7
2.3 Monitoring Locations .....	7
2.4 Monitoring Parameters, Frequency and Duration .....	8
2.5 Monitoring Methodology .....	8
2.6 Monitoring Schedule for the Reporting Month .....	10
2.7 Monitoring Results .....	11
<b>3 NOISE MONITORING.....</b>	<b>12</b>
3.1 Monitoring Requirements .....	12
3.2 Monitoring Equipment .....	12
3.3 Monitoring Locations .....	12
3.4 Monitoring Parameters, Frequency and Duration .....	13
3.5 Monitoring Methodology .....	13
3.6 Monitoring Schedule for the Reporting Month .....	14
3.7 Monitoring Results .....	14
<b>4 ENVIRONMENTAL SITE INSPECTION AND AUDIT.....</b>	<b>15</b>
4.1 Site Inspection.....	15
4.2 Advice on the Solid and Liquid Waste Management Status .....	16
4.3 Environmental Licenses and Permits.....	16
4.4 Implementation Status of Environmental Mitigation Measures.....	17
4.5 Summary of Exceedances of the Environmental Quality Performance Limit .....	17
4.6 Summary of Complaints, Notification of Summons and Successful Prosecutions .....	17
<b>5 FUTURE KEY ISSUES .....</b>	<b>18</b>
5.1 Construction Programme for the Coming Two Months.....	18
5.2 Key Issues for the Coming Two Months .....	18
5.3 Monitoring Schedule for the Coming Month .....	18
<b>6 CONCLUSIONS AND RECOMMENDATIONS .....</b>	<b>19</b>
6.1 Conclusions.....	19
6.2 Recommendations .....	19

---

**List of Tables**

Table 1.1	Contact Information of Key Personnel
Table 2.1	Air Quality Monitoring Equipment
Table 2.2	Locations of Air Quality Monitoring Stations
Table 2.3	Air Quality Monitoring Parameters, Frequency and Duration
Table 2.4	Summary of 1-hour TSP Monitoring Results in the Reporting Period
Table 2.5	Summary of 24-hour TSP Monitoring Results in the Reporting Period
Table 3.1	Noise Monitoring Equipment
Table 3.2	Locations of Impact Noise Monitoring Stations
Table 3.3	Noise Monitoring Parameters, Frequency and Duration
Table 3.4	Summary of Impact Noise Monitoring Results in the Reporting Period
Table 4.1	Summary of Environmental Licensing and Permit Status

**List of Figures**

Figure 1.1	General Layout Plan
Figure 2.1	Monitoring Locations

**List of Appendices**

Appendix A	Project Organization Structure
Appendix B	Implementation Schedule of Environmental Mitigation Measures
Appendix C	Summary of Action and Limit Levels
Appendix D	Calibration Certificates of Equipment
Appendix E	EM&A Monitoring Schedules
Appendix F	Air Quality Monitoring Results and their Graphical Presentations
Appendix G	Noise Monitoring Results and their Graphical Presentations
Appendix H	Meteorological Data for the Reporting Month
Appendix I	Event Action Plan
Appendix J	Cumulative Statistics on Exceedances, Complaints, Notification of Summons and Successful Prosecutions



## **EXECUTIVE SUMMARY**

The Project “Development at Anderson Road – Site Formation and Associated Infrastructure Works” (hereafter called “the Project”) is proposed to form platforms for housing development and associated uses in area of about 20 hectares, and to carry out necessary infrastructural upgrading or improvement works to cater for the proposed development.

China State Construction Engineering (Hong Kong) Limited (CSCE) was commissioned as the Contractor of the Project. AECOM Asia Co. Ltd. (AECOM) was employed by CSCE as the Environmental Team (ET) to undertake the Environmental Monitoring and Audit (EM&A) works for the Project.

The impact EM&A for the Project includes air quality and noise monitoring. The EM&A programme for Sau Ming Primary School (ID 4) and Sau Mau Ping Catholic Primary School (ID 5) commenced on 1 May 2008, while for Kwun Tong Government Secondary School (ID 1A), On Yat House (ID 2) and Sau Nga House (ID 3) commenced on 1 June 2008.

The monitoring stations ID 4 & ID 5 will serve both the entire Development of Anderson Road (Schedule 3 Designated Project (DP)) project as well as the Widening of Po Lam Road (Schedule 2 DP) project.

The construction for the Widening of Po Lam Road (Schedule 2 DP) project was commenced on 21 September 2011.

This report documents the findings of EM&A works for ID 1A, ID 2, ID 3, ID 4 and ID 5 conducted in the period between 1 and 31 December 2018. According to the Contractor, construction activities in the reporting period were:

- Site clearance works

---

**Breaches of Action and Limit Levels for Air Quality**

All 1-hour TSP and 24-hour TSP results were below the Action and Limit Levels in the reporting month.

**Breaches of Action and Limit Levels for Noise**

According to the information provided by the Contractor, no Action Level exceedance of noise was recorded since no noise related complaint was received in the reporting month.

No exceedance of Limit Level of noise was recorded in the reporting month.

**Complaint, Notification of Summons and Successful Prosecution**

According to the information provided by the Contractor, no environmental complaint and no notification of summons and successful prosecution were received in the reporting month.

**Reporting Changes**

There was no reporting change in the reporting month.

### **Future Key Issues**

Key issues to be considered in the coming month included:-

- Properly store and label oil drums and chemical containers placed on site;
- Proper chemicals, chemical wastes and wastes management;
- Maintenance works should be carried out within roofed, paved areas with proper drainage system to handle run-off from maintenance works;
- Collection and segregation of construction waste and general refuse should be carried out properly and regularly;
- Site runoff should be properly collected and treated prior to discharge;
- Regular review and maintenance of drainage systems and desilting facilities;
- Exposed slopes/soil stockpiles should be properly treated to avoid generation of silty surface run-off during rainstorm;
- Proper mitigation measures should be provided to avoid relocation of treated contaminated soil;
- Regular review and maintenance of wheel washing facilities provided at all site entrances/exits;
- Suppress dust generated from work processes with use of bagged cements, earth movements, drilling works, breaking works, excavation activities, exposed areas/slopes/soil stockpiles and haul road traffic;
- Conduct regular inspection of the working machineries within works area to avoid any dark smoke emission and oil leakage;
- Quieter powered mechanical equipment should be used;
- Provision of proper and effective noise control measures, such as erection of movable noise barriers during blasting, breaking and drilling works and at crushing plant works area and provision of acoustic material wrapping to breaking tips of breakers; and
- Proper protection and regular inspection of existing trees, transplanted/retained trees.

## 1 INTRODUCTION

### 1.1 Background

- 1.1.1 The Project site is located in the East Kowloon District. It is bounded by Anderson Road to the north, the realigned Sau Mau Ping Road to the south, Po Lam Road to the east, and Lee On Road and Shun On Road to the west.
- 1.1.2 The objective of the Project “Development at Anderson Road Site Formation and Associated Infrastructure Works” under Contract CV/2007/03 (hereafter called “the Project”) is to provide land for constructing public housing and government and public facilities. The development will provide 16,100 public housing units for 48,000 people in phases between 2015 and 2016.
- 1.1.3 The scope of works of this Project includes construction of site formation, roads, drains and upgrading of existing infrastructure to provide usable land of about 20 hectares for housing and associated government, institution or community uses at the site between existing Anderson Road Quarry and Sau Mau Ping Road in Kwun Tong District.
- 1.1.4 The Project was anticipated to be completed in the fourth quarter of 2016.
- 1.1.5 Part of the Project involving widening of existing Po Lam Road is a designated project and is governed by an Environmental Permit (EP) EP-140/2002, while the rest of the Project is non-designated. Baseline monitoring covering the entire Project site was undertaken and baseline monitoring report was prepared prior to commencement of construction of the Project in accordance with Conditions 3.2 and 3.4 of the EP (EP-140/2002) and the Environmental Monitoring and Audit (EM&A) Manual. The construction for the Widening of Po Lam Road was commenced on 21 September 2011.
- 1.1.6 According to the EP and the EM&A Manual of the Project, there is a need of an EM&A programme including air quality and noise monitoring.
- 1.1.7 The EM&A programme for Sau Ming Primary School (ID 4) and Sau Mau Ping Catholic Primary School (ID 5) commenced on 1 May 2008, while for Kwun Tong Government Secondary School (ID 1A), On Yat House (ID 2) and Sau Nga House (ID 3) commenced on 1 June 2008.
- 1.1.8 The monitoring stations ID 4 & ID 5 will serve both the entire Development of Anderson Road (Schedule 3 Designated Project (DP)) project as well as the Widening of Po Lam Road. (Schedule 2 DP) project.
- 1.1.9 AECOM Asia Co. Ltd. (AECOM) was employed by the Contractor, China State Construction Engineering (Hong Kong) Limited (CSCE), as the Environmental Team (ET) to undertake the EM&A works for the Project. In accordance with the EM&A Manual of the Project, environmental monitoring of air quality, noise and environmental site inspections would be required for this Project.

### 1.2 Scope of Report

- 1.2.1 This is the 136<sup>th</sup> monthly EM&A Report under the Contract CV/2007/03 - Development at Anderson Road – Site Formation and Associated Infrastructure Works. This report presents a summary of the environmental monitoring and audit works, list of activities and mitigation measures proposed by the ET for the Project in December 2018 for ID 1A, ID 2, ID 3, ID 4 and ID 5.

### 1.3 Project Organization

- 1.3.1 The project organization structure is shown in Appendix A. The key personnel contact names and numbers are summarized in Table 1.1.

**Table 1.1 Contact Information of Key Personnel**

<b>Party</b>	<b>Position</b>	<b>Name</b>	<b>Telephone</b>	<b>Fax</b>
ER (Ove Arup)	Resident Engineer	Yu Kit CHEUNG	2407 0300	2407 8382
	Assistant Resident Engineer	Brendon LEE	2407 0300	2407 8382
IEC (Ramboll)	Independent Environmental Checker	David Yeung	3465 2888	3465 2899
Contractor (CSCE)	Site Agent	Holmes Wong	2704 2095	2702 6553
	Safety and Environmental Officer	Raymond Ma	6221 9331	2702 6553
ET (AECOM)	ET Leader	Yiu Wah Fung	3922 9366	2317 7609

#### **1.4 Summary of Construction Works**

1.4.1 According to the Contractor, the Contractor has carried out the following major activities in the reporting month:

- Site clearance works

1.4.2 The general layout plan of the Project site showing the contract area is shown in Figure 1.1.

1.4.3 The environmental mitigation measures implementation schedule are presented in Appendix B.

## **1.5 Summary of EM&A Programme Requirements**

1.5.1 The EM&A programme required environmental monitoring for air quality, noise and environmental site inspections for air quality, noise, water quality, chemical and waste management. The EM&A requirements for each parameter described in the following sections include:-

- All monitoring parameters;
- Monitoring schedules for the reporting month;
- Action and Limit levels for all environmental parameters;
- Event / Action Plan;
- Environmental mitigation measures, as recommended in the Project EIA study final report; and
- Environmental requirement in contract documents.

## 2 AIR QUALITY MONITORING

### 2.1 Monitoring Requirements

2.1.1 In accordance with the EM&A Manual, 1-hour and 24-hour TSP levels at 5 air quality monitoring stations were established. Impact 1-hour TSP monitoring was conducted for at least three times every 6 days, while impact 24-hour TSP monitoring was carried out for at least once every 6 days. The Action and Limit level of the air quality monitoring is provided in Appendix C.

### 2.2 Monitoring Equipment

2.2.1 24-hour TSP air quality monitoring was performed using High Volume Sampler (HVS) located at each designated monitoring station. The HVS meets all the requirements of the EM&A Manual. Portable direct reading dust meters were used to carry out the 1-hour TSP monitoring. Brand and model of the equipment is given in Table 2.1.

**Table 2.1 Air Quality Monitoring Equipment**

Equipment	Brand and Model
Portable direct reading dust meter (1-hour TSP)	Sibata Digital Dust Monitor (Model No. LD-3 and LD-3B)
High Volume Sampler (24-hour TSP)	Tisch Total Suspended Particulate Mass Flow Controlled High Volume Air Sampler (Model No. TE-5170) & Graseby High Volume TSP Sampler (Model No. GMW 2310)
Calibration Kit for High Volume Sampler	Orifice (Model No. TE-5025A)

### 2.3 Monitoring Locations

2.3.1 Monitoring stations, ID 2, ID 3, ID 4 and ID 5, were set up at the proposed locations in accordance with EM&A Manual, while monitoring station, ID 1A, was set up at a location agreed by the ER and IEC. Figure 2.1 shows the locations of the monitoring stations. Table 2.2 describes the details of the monitoring stations.

**Table 2.2 Locations of Air Quality Monitoring Stations**

ID	Location	Monitoring Station
1A	Kwun Tong Government Secondary School	Roof top of the premises facing Anderson Road
2	On Yat House	Roof top of the premises facing Lee On Road
3	Sau Nga House	Roof top of the premises facing Sau Mau Ping Road
4	Sau Ming Primary School	Roof top of the premises
5	Sau Mau Ping Catholic Primary School	Roof top of the premises



## 2.4 Monitoring Parameters, Frequency and Duration

2.4.1 Table 2.3 summarizes the monitoring parameters, frequency and duration of impact TSP monitoring.

**Table 2.3 Air Quality Monitoring Parameters, Frequency and Duration**

Monitoring Station	Parameter	Frequency and Duration
ID 1A, ID 2, ID 3, ID 4 & ID5	1-hour TSP	At least 3 times every 6 days
	24-hour TSP	At least once every 6 days

## 2.5 Monitoring Methodology

### 2.5.1 24-hour TSP Monitoring

- (a) The HVS was installed in the vicinity of the air sensitive receivers. The following criteria were considered in the installation of the HVS:-
- (i) A horizontal platform with appropriate support to secure the sampler against gusty wind was provided.
  - (ii) The distance between the HVS and any obstacles, such as buildings, was at least twice the height that the obstacle protrudes above the HVS.
  - (iii) A minimum of 2 meters separation from walls, parapets and penthouse for rooftop sampler.
  - (iv) A minimum of 2 meters separation from any supporting structure, measured horizontally is required.
  - (v) No furnace or incinerator flues nearby.
  - (vi) Airflow around the sampler was unrestricted.
  - (vii) Permission was obtained to set up the samplers and access to the monitoring stations.
  - (viii) A secured supply of electricity was obtained to operate the samplers.
  - (ix) The sampler was located more than 20 meters from any dripline.
  - (x) Any wire fence and gate, required to protect the sampler, did not obstruct the monitoring process.
  - (xi) Flow control accuracy was kept within  $\pm 2.5\%$  deviation over 24-hour sampling period.
- (b) Preparation of Filter Papers
- (i) Glass fibre filters, G810 were labelled and sufficient filters that were clean and without pinholes were selected.
  - (ii) All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25 °C and not variable by more than  $\pm 3$  °C; the relative humidity (RH) was < 50% and not variable by more than  $\pm 5\%$ . A convenient working RH was 40%.
  - (iii) All filter papers were prepared and analysed by ALS Technichem (HK) Pty Ltd., which is a HOKLAS accredited laboratory and has comprehensive quality assurance and quality control programmes.

(c) Field Monitoring

- (i) The power supply was checked to ensure the HVS works properly.
- (ii) The filter holder and the area surrounding the filter were cleaned.
- (iii) The filter holder was removed by loosening the four bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully.
- (iv) The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter.
- (v) The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied was sufficient to avoid air leakage at the edges.
- (vi) Then the shelter lid was closed and was secured with the aluminium strip.
- (vii) The HVS was warmed-up for about 5 minutes to establish run-temperature conditions.
- (viii) A new flow rate record sheet was set into the flow recorder.
- (ix) On site temperature and atmospheric pressure readings were taken and the flow rate of the HVS was checked and adjusted at around 1.3 m<sup>3</sup>/min, and complied with the range specified in the EM&A Manual (i.e. 0.6-1.7 m<sup>3</sup>/min).
- (x) The programmable digital timer was set for a sampling period of 24 hrs, and the starting time, weather condition and the filter number were recorded.
- (xi) The initial elapsed time was recorded.
- (xii) At the end of sampling, on site temperature and atmospheric pressure readings were taken and the final flow rate of the HVS was checked and recorded.
- (xiii) The final elapsed time was recorded.
- (xiv) The sampled filter was removed carefully and folded in half-length so that only surfaces with collected particulate matter were in contact.
- (xv) It was then placed in a clean plastic envelope and sealed.
- (xvi) All monitoring information was recorded on a standard data sheet.
- (xvii) Filters were then sent to ALS Technichem (HK) Pty Ltd. for analysis.

(d) Maintenance and Calibration

- (i) The HVS and its accessories were maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
- (ii) HVSs were calibrated using TE-5025A Calibration Kit upon installation and thereafter at bi-monthly intervals.
- (iii) Calibration certificate of the TE-5025A Calibration Kit and the HVSs are provided in Appendix D.

## 2.5.2 1-hour TSP Monitoring

### (a) Measuring Procedures

The measuring procedures of the 1-hour dust meter were in accordance with the Manufacturer's Instruction Manual as follows:-

- (i) Turn the power on.
- (ii) Close the air collecting opening cover.
- (iii) Push the "TIME SETTING" switch to [BG].
- (iv) Push "START/STOP" switch to perform background measurement for 6 seconds.
- (v) Turn the knob at SENSI ADJ position to insert the light scattering plate.
- (vi) Leave the equipment for 1 minute upon "SPAN CHECK" is indicated in the display.
- (vii) Push "START/STOP" switch to perform automatic sensitivity adjustment. This measurement takes 1 minute.
- (viii) Pull out the knob and return it to MEASURE position.
- (ix) Push the "TIME SETTING" switch the time set in the display to 3 hours.
- (x) Lower down the air collection opening cover.
- (xi) Push "START/STOP" switch to start measurement.

### (b) Maintenance and Calibration

- (i) The 1-hour TSP meter was calibrated at 1-year intervals against a continuous particulate TEOM Monitor, Series 1400ab. Calibration certificates of the Laser Dust Monitors are provided in Appendix D.

## 2.6 Monitoring Schedule for the Reporting Month

2.6.1 The schedule for environmental monitoring in December 2018 is provided in Appendix E.

## 2.7 Monitoring Results

2.7.1 The monitoring results for 1-hour TSP and 24-hour TSP are summarized in Tables 2.4 and 2.5 respectively. Detailed air quality monitoring results are presented in Appendix F.

**Table 2.4 Summary of 1-hour TSP Monitoring Results in the Reporting Period**

	Average ( $\mu\text{g}/\text{m}^3$ )	Range ( $\mu\text{g}/\text{m}^3$ )	Action Level ( $\mu\text{g}/\text{m}^3$ )	Limit Level ( $\mu\text{g}/\text{m}^3$ )
<b>ID 1A</b>	65.9	63.5 – 68.8	201.5	500
<b>ID 2</b>	66.8	63.8 – 72.2	197.0	500
<b>ID 3</b>	65.8	62.5 – 73.1	203.7	500
<b>ID 4</b>	67.1	64.2 – 72.7	264.6	500
<b>ID 5</b>	67.0	64.5 – 71.8	267.4	500

**Table 2.5 Summary of 24-hour TSP Monitoring Results in the Reporting Period**

	Average ( $\mu\text{g}/\text{m}^3$ )	Range ( $\mu\text{g}/\text{m}^3$ )	Action Level ( $\mu\text{g}/\text{m}^3$ )	Limit Level ( $\mu\text{g}/\text{m}^3$ )
<b>ID 1A</b>	17.1	8.0 – 46.9	170.2	260
<b>ID 2</b>	33.8	13.6 – 67.6	200.0	260
<b>ID 3</b>	31.4	17.8 – 49.4	200.0	260
<b>ID 4</b>	19.9	13.3 – 28.2	181.3	260
<b>ID 5</b>	24.6	13.8 – 38.4	180.8	260

2.7.2 All 1-hour TSP and 24-hour TSP results were below the Action and Limit Levels in the reporting month.

2.7.3 The event action plan is annexed in Appendix I.

2.7.4 Major dust sources during the dust monitoring included construction dust from the Project site, construction dust from other construction sites nearby and nearby traffic emission.

2.7.5 Weather information including wind speed and wind direction is annexed in Appendix H. The information was obtained from Hong Kong Observatory Tseung Kwan O Automatic Weather Station and Anemometer Station.

### 3 NOISE MONITORING

#### 3.1 Monitoring Requirements

3.1.1 In accordance with the EM&A Manual, impact noise levels should be obtained at 5 noise monitoring stations. Impact noise monitoring was conducted for at least once per week during the construction phase of the Project. The Action and Limit level of the noise monitoring is provided in Appendix C.

#### 3.2 Monitoring Equipment

3.2.1 Noise monitoring was performed using sound level meter at each designated monitoring station. The sound level meters deployed comply with the International Electrotechnical Commission Publications (IEC) 651:1979 (Type 1) and 804:1985 (Type 1) specifications. Acoustic calibrator was deployed to check the sound level meters at a known sound pressure level. Brand and model of the equipment is given in Table 3.1.

**Table 3.1 Noise Monitoring Equipment**

Equipment	Brand and Model
Integrated Sound Level Meter	B&K (Model No. 2238 and 2250-L)
Acoustic Calibrator	B&K ( Model No. 4231)

#### 3.3 Monitoring Locations

3.3.1 Monitoring stations, ID 2, ID3, ID 4 and ID 5, were set up at the proposed locations in accordance with EM&A Manual, while monitoring station, ID 1A, was set up at a location agreed by the ER and IEC. Figure 2.1 shows the locations of the monitoring stations. Table 3.2 describes the details of the monitoring stations.

**Table 3.2 Locations of Impact Noise Monitoring Stations**

ID	Location	Monitoring Station
1A	Kwun Tong Government Secondary School	1m from the exterior of the roof top façade of the premises facing Anderson Road
2	On Yat House	1m from the exterior of the roof top façade of the premises facing Lee On Road
3	Sau Nga House	1m from the exterior of the roof top façade of the premises facing Sau Mau Ping Road
4	Sau Ming Primary School	1m from the exterior of the roof top façade of the premises facing Sau Mau Ping Road
5	Sau Mau Ping Catholic Primary School	1m from the exterior of the roof top façade of the premises facing Po Lam Road

### 3.4 Monitoring Parameters, Frequency and Duration

3.4.1 Table 3.3 summarizes the monitoring parameters, frequency and duration of impact noise monitoring.

**Table 3.3 Noise Monitoring Parameters, Frequency and Duration**

Monitoring Station	Parameter and Duration	Frequency
ID 1A, ID 2, ID 3, ID 4 & ID5	30-mins measurement at each monitoring station between 0700 and 1900 on normal weekdays. $L_{eq}$ , $L_{10}$ and $L_{90}$ would be recorded.	At least once per week

### 3.5 Monitoring Methodology

#### 3.5.1 Monitoring Procedure

- (a) The sound level meter was set on a tripod at a height of 1.2 m above the ground.
- (b) Façade measurements were made at all monitoring locations.
- (c) The battery condition was checked to ensure the correct functioning of the meter.
- (d) Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
  - (i) frequency weighting: A
  - (ii) time weighting: Fast
  - (iii) time measurement:  $L_{eq(30\text{-minutes})}$  during non-restricted hours i.e. 07:00 – 1900 on normal weekdays;  $L_{eq(5\text{-minutes})}$  during restricted hours i.e. 19:00 – 23:00 and 23:00 – 07:00 of normal weekdays, whole day of Sundays and Public Holidays
- (e) Prior to and after each noise measurement, the meter was calibrated using the acoustic calibrator for 94dB(A) at 1000 Hz. If the difference in the calibration level before and after measurement was more than 1 dB (A), the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
- (f) During the monitoring period, the  $L_{eq}$ ,  $L_{10}$  and  $L_{90}$  were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- (g) Noise measurement was paused during periods of high intrusive noise (e.g. dog barking, helicopter noise) if possible. Observations were recorded when intrusive noise was unavoidable.
- (h) Noise monitoring was cancelled in the presence of fog, rain, wind with a steady speed exceeding 5m/s, or wind with gusts exceeding 10m/s.

#### 3.5.2 Maintenance and Calibration

- (a) The microphone head of the sound level meter was cleaned with soft cloth at regular intervals.
- (b) The meter and calibrator were sent to the supplier or HOKLAS laboratory to check and calibrate at yearly intervals.
- (c) Calibration certificates of the sound level meters and acoustic calibrators are provided in Appendix D.

### 3.6 Monitoring Schedule for the Reporting Month

3.6.1 The schedule for environmental monitoring in December 2018 is provided in Appendix E.

### 3.7 Monitoring Results

3.7.1 The monitoring results for noise are summarized in Table 3.4 and the monitoring data is provided in Appendix G.

**Table 3.4 Summary of Impact Noise Monitoring Results in the Reporting Period**

	Average, dB(A), $L_{eq}$ (30 mins)	Range, dB(A), $L_{eq}$ (30 mins)	Limit Level, dB(A), $L_{eq}$ (30 mins)
<b>ID 1A</b>	61.8	51.9 – 65.1	*65/70
<b>ID 2</b>	60.2	57.0 – 61.6	75
<b>ID 3</b>	62.5	58.9 – 64.1	75
<b>ID 4</b>	62.0	58.1 – 63.9	*65/70
<b>ID 5</b>	61.9	55.6 – 64.2	*65/70

Note: \*Daytime noise Limit Level of 70dB (A) applies to education institutions while 65dB (A) applies during school examination period.

- 3.7.2 According to the information provided by the Contractor, no Action Level exceedance of noise was recorded since no noise related complaint was received in the reporting month.
- 3.7.3 No Limit Level exceedance of noise was recorded at all monitoring stations in the reporting month.
- 3.7.4 The event action plan is annexed in Appendix I.
- 3.7.5 Major noise sources during the noise monitoring included construction noise from the Project site, construction noise from other construction sites nearby, nearby traffic noise and noise from school activities and community noise.



## **4 ENVIRONMENTAL SITE INSPECTION AND AUDIT**

### **4.1 Site Inspection**

4.1.1 Site Inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures for the Project. In the reporting month, 4 site inspections were carried out on 7, 14, 20 and 28 December 2018. Particular observations and status of non-compliance are described below.

4.1.2 The Contractor rectified most of the observations as identified during the environmental site inspections in the reporting month within the agreed time frame. Rectification of the remaining identified items are being carried out by the Contractor. Follow-up inspections on the status on provision of mitigation measures will be conducted to ensure all identified items are mitigated properly.

#### 4.1.3 Air Quality Impact

- No specific observation was identified in the reporting month.

#### 4.1.4 Construction Noise Impact

- No specific observation was identified in the reporting month.

#### 4.1.5 Water Quality Impact

- No specific observation was identified in the reporting month.

#### 4.1.6 Chemical and Waste Management

No specific observation was identified in the reporting month.

#### 4.1.7 Landscape and Visual Impact

- No specific observation was identified in the reporting month.

#### 4.1.8 Miscellaneous

- No specific observation was identified in the reporting month.

## 4.2 Advice on the Solid and Liquid Waste Management Status

4.2.1 The Contractor is registered as a chemical waste producer for this Project. C&D materials and wastes sorting were carried out on site. Receptacles were available for C&D wastes and general refuse collection.

4.2.2 As advised by the Contractor, 0 tonnes of C&D materials were generated on site in the reporting month.

For C&D waste, 0 kg of metals was generated and collected by registered recycling collector. 0 kg of paper cardboard packaging and 0 kg of plastics were generated on site and collected by registered recycling collector. No chemical waste was collected by licensed chemical waste collectors. 128.59 ton of other types of wastes (e.g. general refuse and tree debris) were generated on site and disposed of at North East New Territories (NENT) Landfill.

4.2.3 The Contractor is advised to properly maintain on site C&D materials and wastes collection, sorting and recording system and maximize reuse / recycle of C&D materials and wastes. The Contractor is reminded to properly maintain the site tidiness and dispose of the wastes accumulated on site regularly and properly.

4.2.4 The Contractor is reminded that chemical waste containers should be properly treated and stored temporarily in designated chemical waste storage area on site in accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes.

## 4.3 Environmental Licenses and Permits

4.3.1 The environmental licenses and permits for this Project and valid in the reporting month is summarized in Table 4.1.

**Table 4.1 Summary of Environmental Licensing and Permit Status**

Statutory Reference	Description	Permit No.	Valid Period		Remarks
			From	To	
EIAO	Environmental Permit	EP-140/2002	--	--	- Widening of a section of Po Lam Road
		EP-483/2013	--	--	- Operation of a widened Po Lam Road
APCO	NA notification	--	16/04/09	--	- Whole Construction Site
WPCO	Discharge Licence	WT0002359 3-2016	22/02/16	31/08/19	- Discharge of Construction Runoff
WDO	Chemical Waste Producer Registration	5213-292- C3249-32	19/03/08	--	- Whole Construction Site
	Waste Charges Account	7006839	12/03/08	--	- Whole Construction Site

#### **4.4 Implementation Status of Environmental Mitigation Measures**

- 4.4.1 In response to the site audit findings, the Contractor carried out corrective actions promptly for particular items recorded. Outstanding items were closely monitored to ensure mitigation measures are implemented properly.
- 4.4.2 A summary of the Implementation Schedule of Environmental Mitigation Measures (EMIS) is presented in Appendix B. Many necessary mitigation measures were implemented properly.

#### **4.5 Summary of Exceedances of the Environmental Quality Performance Limit**

- 4.5.1 All 1-hour TSP and 24-hour TSP results were below the Action and Limit Levels in the reporting month.
- 4.5.2 According to the information provided by the Contractor, no Action Level exceedance of noise was recorded since no noise related complaint was received in the reporting month.
- 4.5.3 No Limit Level exceedance of noise was recorded at all monitoring stations in the reporting month.
- 4.5.4 Cumulative statistics on exceedances is provided in Appendix J.

#### **4.6 Summary of Complaints, Notification of Summons and Successful Prosecutions**

- 4.6.1 Complaints shall be referred to the ET Leader for action. The ET Leader shall undertake the following procedures upon receipt of any complaint:-
- Log complaint and date of receipt onto the complaint database and inform the IC(E) immediately;
  - Investigate the complaint to determine its validity, and assess whether the source of the problem is due to works activities;
  - Identify mitigation measures in consultation with the IC(E) if a complaint is valid and due to works;
  - Advise the Contractor if additional mitigation measures are required;
  - Review the Contractor's response to identified mitigation measures, and the updated situation;
  - If the complaint is transferred from EPD, submit interim report to EPD on status of the complaint investigation and follow-up action within the time frame assigned by EPD;
  - Undertake additional monitoring and audit to verify the situation if necessary, and review that circumstances leading to the complaint to not recur;
  - Report investigation results and subsequent actions to complainant (if the source of complaint is EPD, the results should be reported within the time frame assigned by EPD); and
  - Record the complaint, investigation, the subsequent actions and the results in the monthly EM&A reports.
- 4.6.2 During any complaint investigation work, the Contractor and the ER shall cooperate with the ET Leader in providing all necessary information and assistance for completion of the investigation. If mitigation measures are identified in the investigation, the Contractor shall promptly carry out the mitigation. The ER shall ensure that all necessary measures have been carried out by the Contractor.
- 4.6.3 Referring to the information provided by the Contractor, no environmental complaint and no notification of summons and successful prosecution were received in the reporting month.
- 4.6.4 Cumulative statistics on complaints, notification of summons and successful prosecutions is provided in Appendix J.

## **5 FUTURE KEY ISSUES**

### **5.1 Construction Programme for the Coming Two Months**

5.1.1 The major construction works in January and February 2019 will be:

- Site clearance works

### **5.2 Key Issues for the Coming Two Months**

5.2.1 Key issues to be considered in the coming months included:

- Properly store and label oil drums and chemical containers placed on site;
- Proper chemicals, chemical wastes and wastes management;
- Maintenance works should be carried out within roofed, paved areas with proper drainage system to handle run-off from maintenance works;
- Collection and segregation of construction waste and general refuse should be carried out properly and regularly;
- Site runoff should be properly collected and treated prior to discharge;
- Regular review and maintenance of drainage systems and desilting facilities;
- Exposed slopes/soil stockpiles should be properly treated to avoid generation of silty surface run-off during rainstorm;
- Proper mitigation measures should be provided to avoid relocation of treated contaminated soil;
- Regular review and maintenance of wheel washing facilities provided at all site entrances/exits;
- Suppress dust generated from work processes with use of bagged cements, earth movements, drilling works, breaking works, excavation activities, exposed areas/slopes/soil stockpiles and haul road traffic;
- Conduct regular inspection of the working machineries within works area to avoid any dark smoke emission and oil leakage;
- Quieter powered mechanical equipment should be used;
- Provision of proper and effective noise control measures, such as erection of movable noise barriers during blasting, breaking and drilling works and at crushing plant works area and provision of acoustic material wrapping to breaking tips of breakers; and
- Proper protection and regular inspection of existing trees, transplanted/retained trees.

## **6 CONCLUSIONS AND RECOMMENDATIONS**

### **6.1 Conclusions**

- 6.1.1 The construction phase of the project commenced in May 2008.
- 6.1.2 1-hour TSP, 24-hour TSP and noise monitoring were carried out in the reporting month.
- 6.1.3 All 1-hour TSP and 24-hour TSP results were below the Action and Limit Levels in the reporting month.
- 6.1.4 No Action Level exceedance of noise was recorded at all monitoring stations in the reporting month.
- 6.1.5 No Limit Level exceedance of noise was recorded at all monitoring stations in the reporting month.
- 6.1.6 Environmental site inspections were carried out 4 times in December 2018. Recommendations on remedial actions were given to the Contractor for the deficiencies identified during the site audit.
- 6.1.7 According to the information provided by the Contractor, no environmental complaint and no notification of summons and successful prosecution were received in the reporting month.

### **6.2 Recommendations**

- 6.2.1 According to the environmental site inspections performed in the reporting month, the following recommendations were provided:-
- 6.2.2 Air Quality Impact
- No specific observation was identified in the reporting month.
- 6.2.3 Construction Noise Impact
- No specific observation was identified in the reporting month.
- 6.2.4 Water Quality Impact
- No specific observation was identified in the reporting month.
- 6.2.5 Chemical and Waste Management
- No specific observation was identified in the reporting month.
- 6.2.6 Landscape and Visual Impact
- No specific observation was identified in the reporting month.
- 6.2.7 Miscellaneous
- No specific observation was identified in the reporting month.

---


---


## FIGURES

---


---



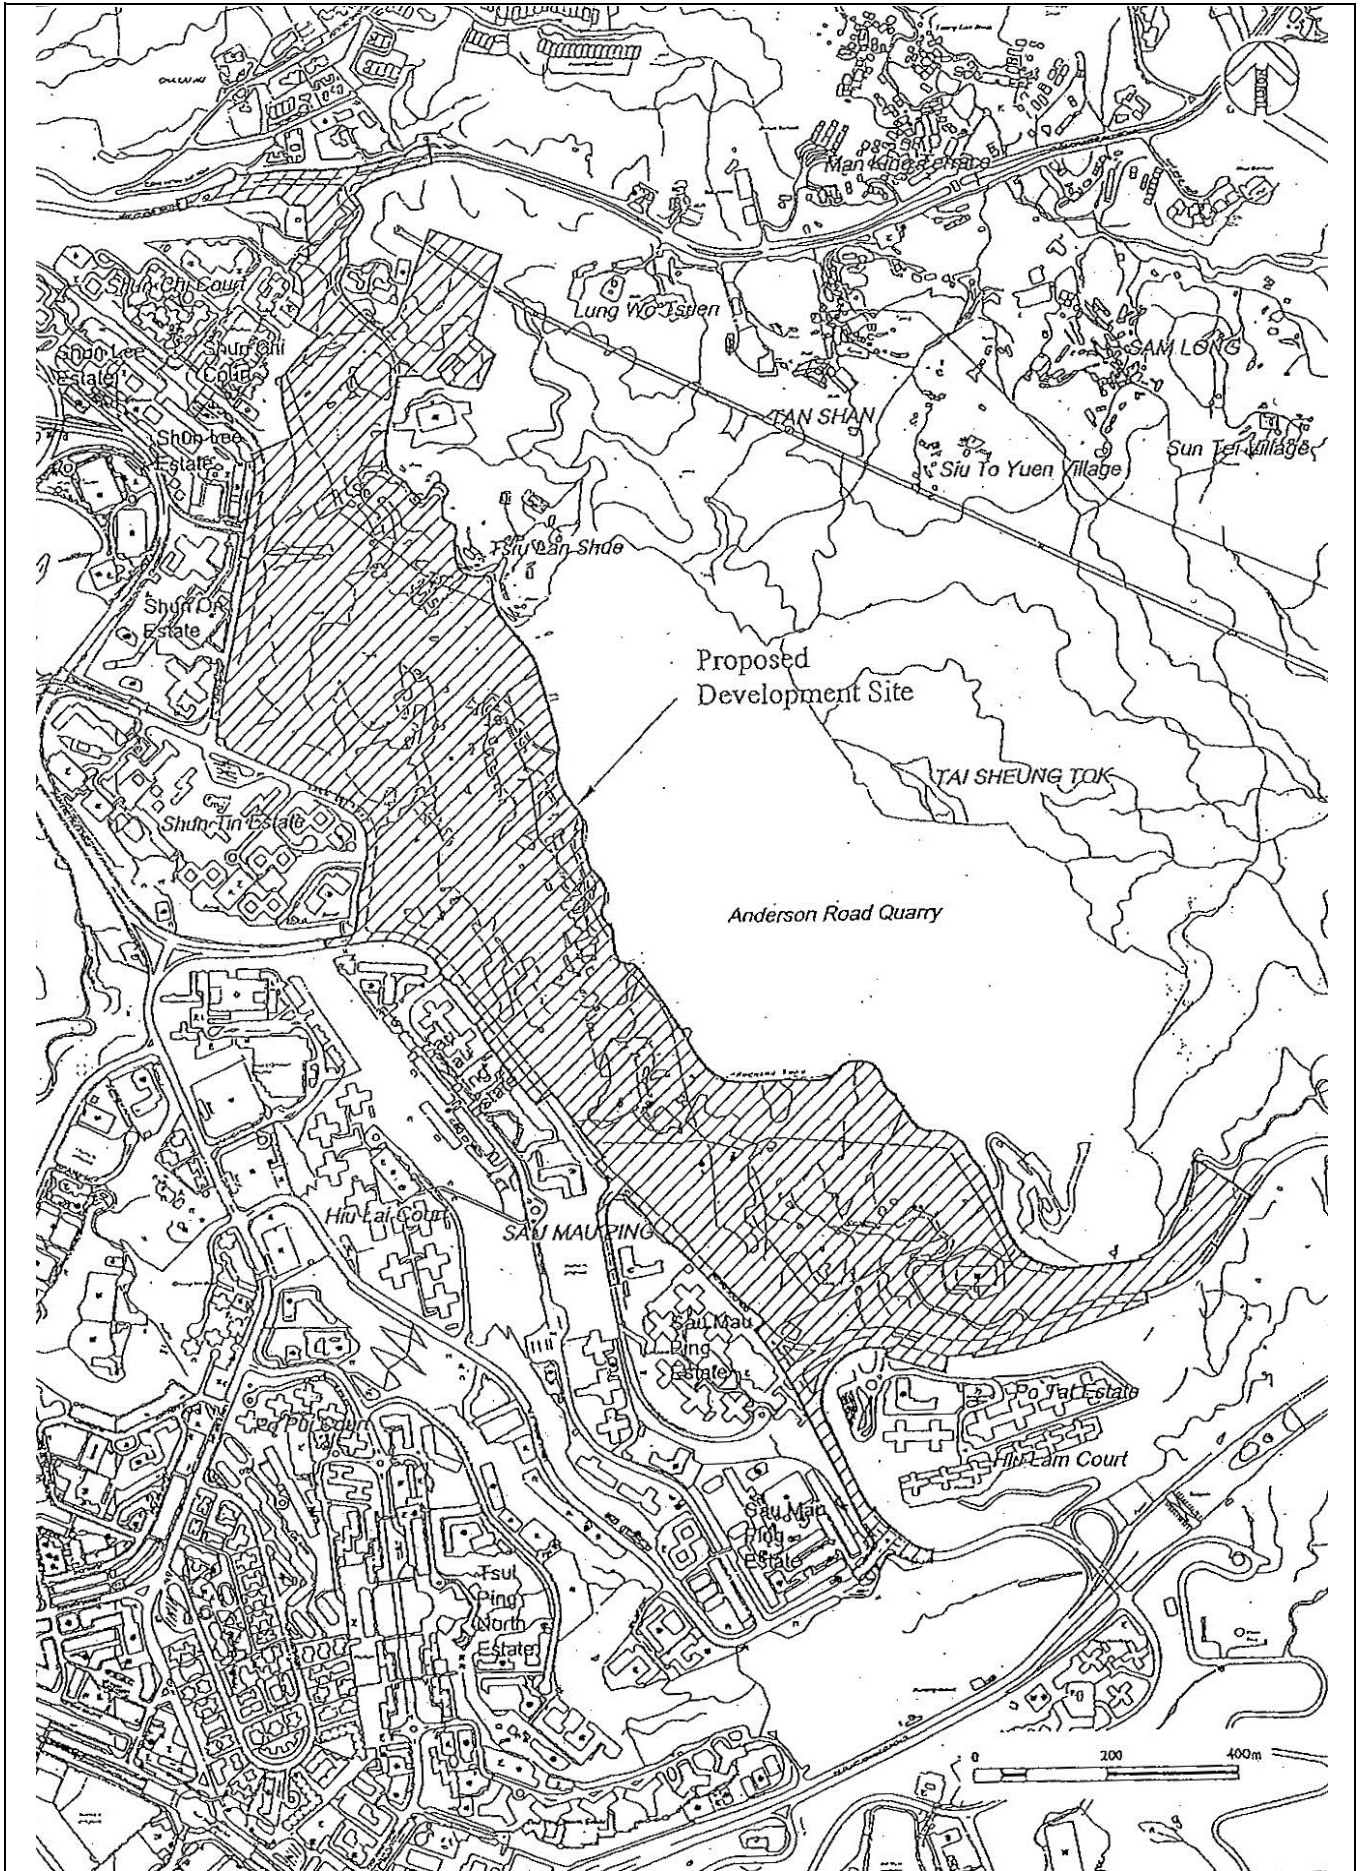

	Development at Anderson Road - Site Formation and Associated Infrastructure Works			SCALE	N.T.S.	DATE	Nov-09
	GENERAL LAYOUT PLAN			CHECK	ENFL	DRAWN	LCHC
				JOB NO.	60043155	DRAWING No.	Rev.
				FIG 1.1			



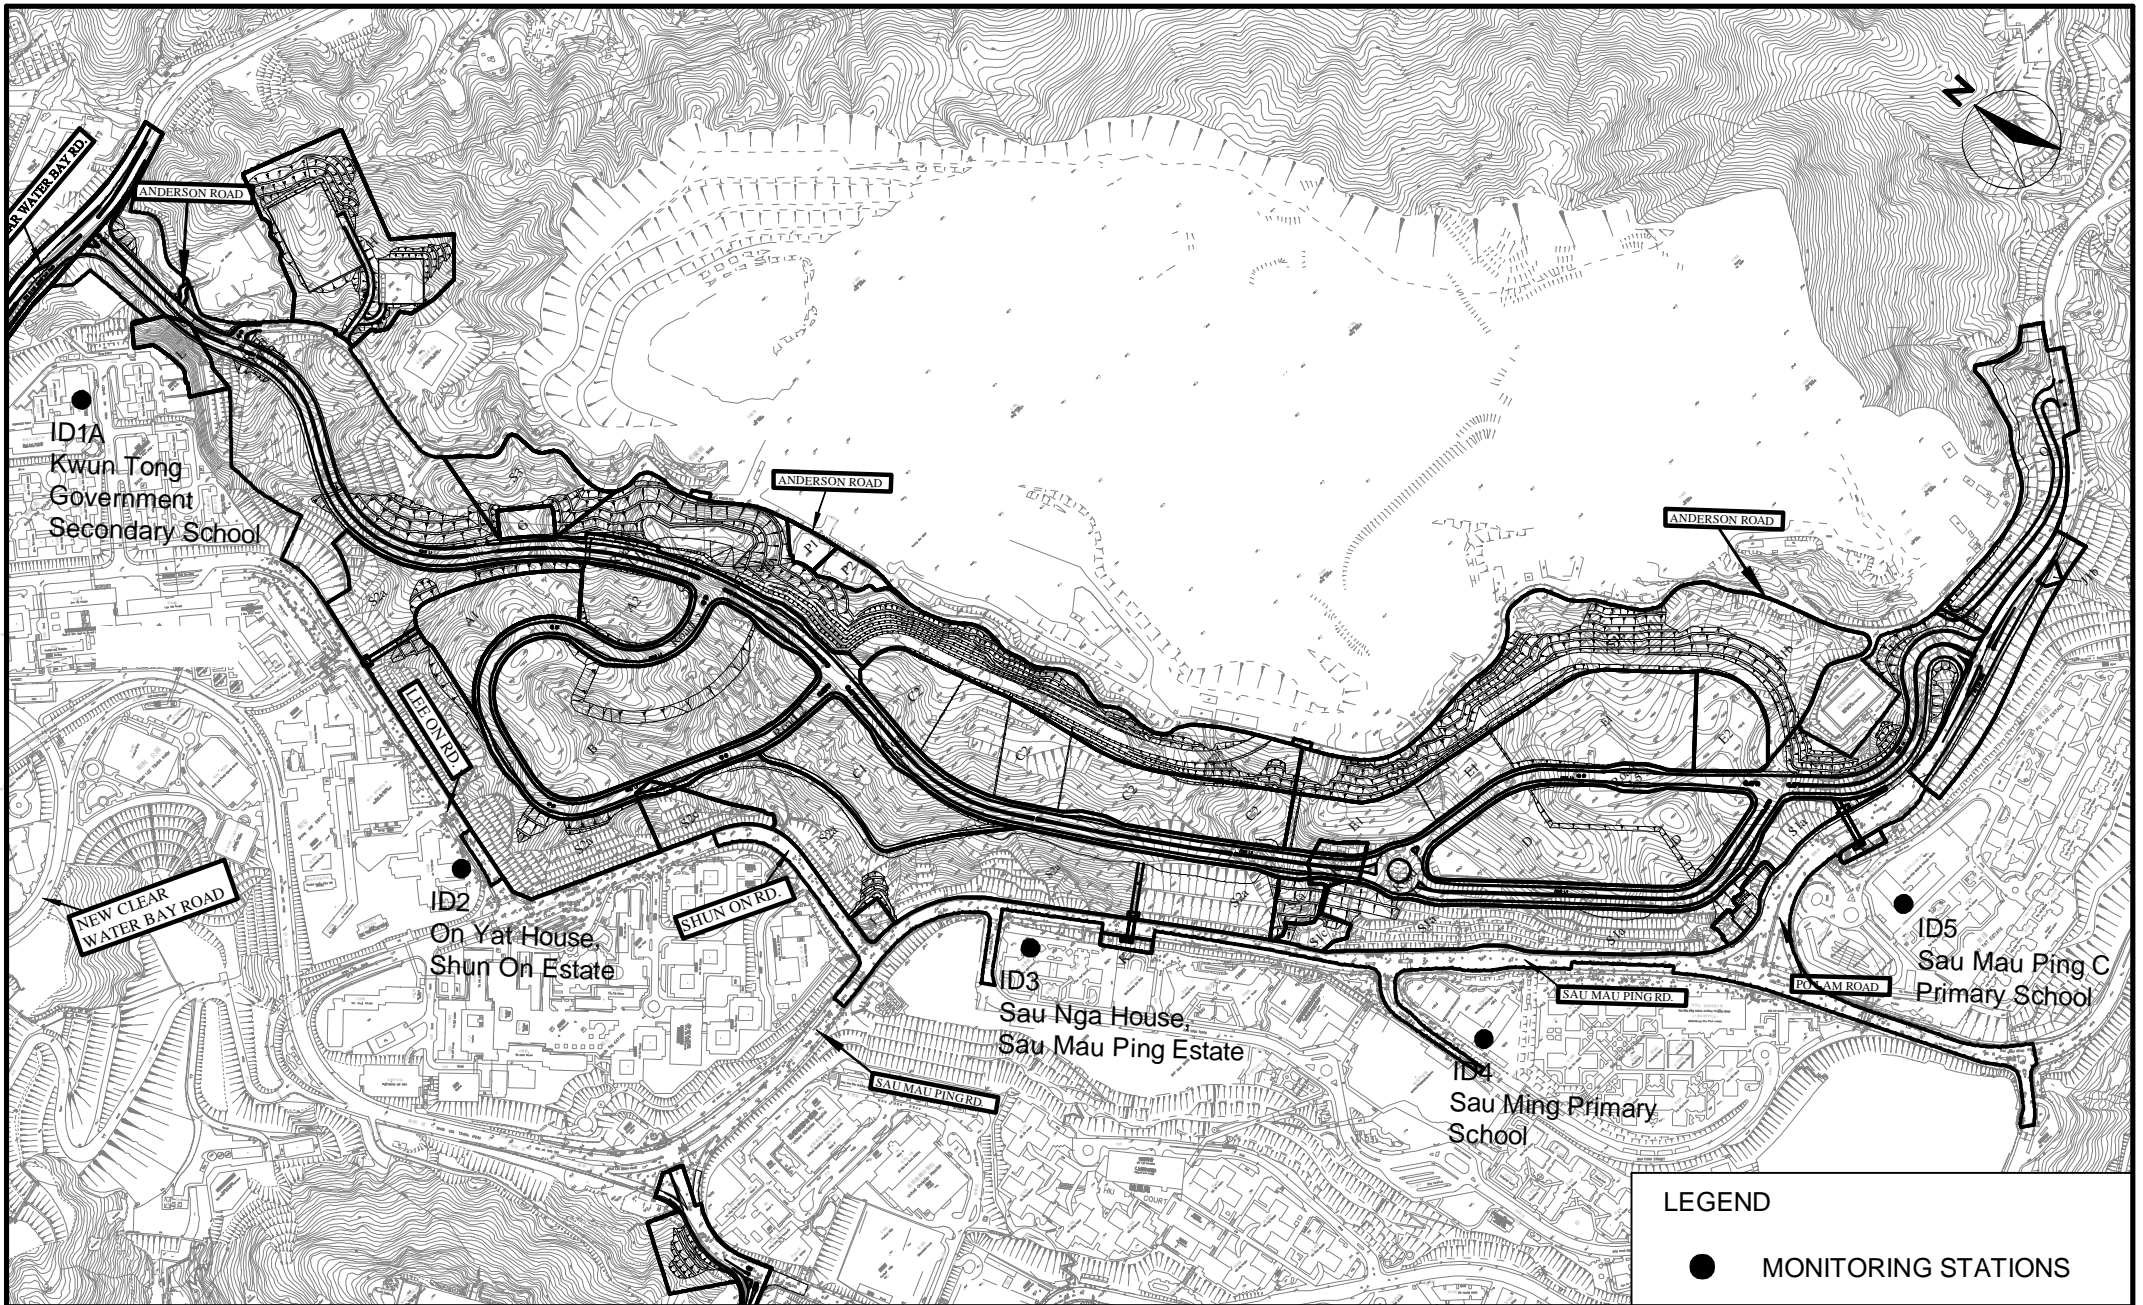

LEGEND			
●	MONITORING STATIONS		



**DEVELOPMENT AT ANDERSON ROAD**  
**SITE FORMATION AND ASSOCIATED INFRASTRUCTURE WORKS**  
**MONITORING LOCATIONS**


SCALE	N.T.S.	DATE	APR 08
CHECK	CWHY	DRAWN	RWHW
JOB No.	60043155	DRAWING No.	FIG 2.1
		REV	-

---

**APPENDIX A**

**Project Organization Structure**

---

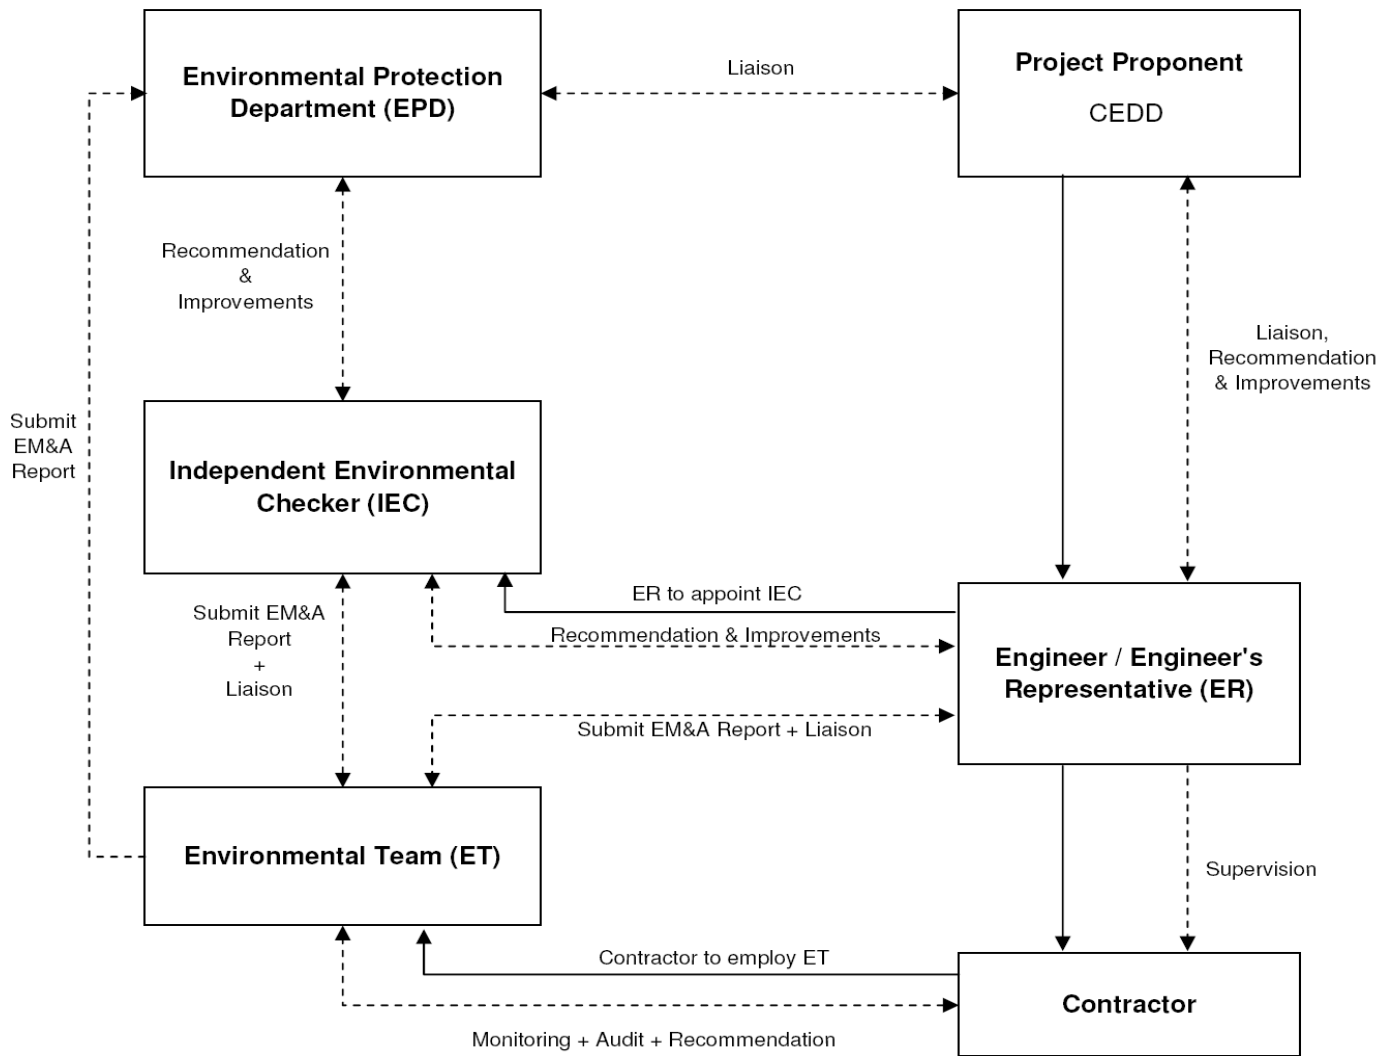

——— Employment Relationship  
 - - - - - Working Relationship



Contract No. CV/2007/03  
 Development at Anderson Road – Site Formation and Associated  
 Infrastructure Works

**Project Organization Structure**

SCALE	N.T.S.	DATE	2009
CHECK	ENFL	DRAWN	LCHC
JOB NO.	60043155	APPENDIX	Rev
		A	-

---

**APPENDIX B**

**Implementation Schedule of Environmental Mitigation  
Measures**

---



## Appendix B - Implementation Schedule of Environmental Mitigation Measures

Environmental Mitigation Measures		Location	Implementation Status
<b>Construction Noise Impact</b>			
Site Formation	Silenced powered mechanical equipment (PME) for most equipment (including drill rig, backhoe, dump truck, breaker and crane) and the decrease of percentage on time usage of drill rig among the Central Area from 50% to 40% is proposed.	All construction sites	V
	Temporary movable noise barrier shall be used to shield the noise emanating from the drilling rig in order to provide adequate shielding for the affected NSRs.	All construction sites	V
<b>Construction Air Quality Impact</b>			
General Site	Mean vehicle speed of haulage trucks at 10km/hr.	All construction sites	V
Practice	Twice daily watering of all open site areas.	All construction sites	V
	Regular watering (once every 1 hour) of all site roads and access roads with frequent truck movement.	All construction sites	V
	During road transportation of excavated spoil, vehicles should be covered to avoid dust impact. Wheel washing facilities should be installed at all site exits together with regular watering of the site access roads.	All construction sites	V
	Tarpaulin covering of all dusty vehicle loads transported to, from and between site locations.	All construction sites	V
	Establishment and use of vehicle wheel and body washing facilities at the exit points of the site, combined with cleaning of public roads were necessary.	Site exits	V

China State Construction Engineering (Hong Kong) Ltd.

General Site Practice	Suitable side and tailboards on haulage vehicles.	All construction sites	V
	Watering of temporary stockpiles.	All construction sites	V
Blasting	Use of select aggregate and fines to stem the charge with drill holes and watering of blast face.	All construction sites	N/A
	Use of vacuum extraction drilling methods.	All construction sites	N/A
	Carefully sequenced blasting.	All construction sites	N/A
Crushing	Fabric filters installed for the crushing plant.	All construction sites	N/A
	Water sprays on the crusher.	All construction sites	N/A
Loading and Unloading Points, and conveyor Belt System	Water sprays at all fixed loading and unloading points (at the crusher and conveyor belts).	All construction sites	N/A
	The loading point at the crusher is enclosed with dust collection system installed.	All construction sites	N/A
	When transferring materials from conveyor belt or crusher to the dump trucks or chutes, dust curtains are used for controlling dust.	All construction sites	N/A
	Cover the conveyor belts with steel roof and canvas sides.	All construction sites	N/A
<b>Construction Water Quality Impact</b>			
Construction Phase	All active working areas should be bounded to retain storm water with sufficient retention time to ensure that suspended solids are not discharged from the site in concentrations above those specified in the TM for the Victoria Harbour (Phase I) WCZ. All fuel storage areas should be bounded with drainage directed to an oil interceptor.	Site drainage system	V

China State Construction Engineering (Hong Kong) Ltd.

	Separate treatment facilities may be required for effluent from site offices, toilets (unless chemical toilets are used) and canteens.	Site drainage system	V
	Discharged wastewater from the construction sites to surface water and/or public drainage systems should be controlled through licensing. Discharge should follow fully the terms and conditions in the licenses.	All works area	V
	Relevant practice for dealing with various type of construction discharges provided in EPD's ProPECC Note PN 1/94 should be adopted.	All works area	V
<b>Waste Management</b>			
Waste Disposal	Different types of wastes should be segregated, stored, transported and disposed of separately in accordance with the relevant legislative requirements and guidelines as proper practice of waste management.	All construction sites	V
	Sorting of wastes should be done on-site. Different types of wastes should be segregated and stored in different stockpiles, containers or skips to enhance recycling of materials and proper disposal of spoil.	All construction sites	V
	Excavated spoil should be used as much as possible to minimize off-side fill material requirements and disposal of spoil.	All construction sites	V
	Chemical waste should be recycled on-site or removed by licenced companies. It should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical wastes. When off-site	All construction sites	V



China State Construction Engineering (Hong Kong) Ltd.

	disposal is required, it should be collected and delivered by licenced contractors to Tsing Yi Chemical Waste Treatment Facility and disposed of in accordance with the Chemical Waste (General) Regulation.		
	Necessary mitigation measures should be adopted to prevent the uncontrolled disposal of chemical and hazardous waste into air, soil, surface waters and ground waters.	All construction sites	V
Waste Storage	Chemical material storage areas should be bounded, constructed of impervious materials and have the capacity to contain 120 percent of the total volume of the containers. Indoor storage areas must have sufficient ventilation to prevent the build-up of fumes, and must be capable of evacuating the space in the event of an accidental release. Outdoor storage areas must be covered with a canopy or contain provisions for the safe removal of rainwater. In both cases, storage areas must not be connected to the foul or stormwater sewer system.	All construction sites	V
	Dangerous materials as defined under the DGO, including fuel, oil and lubricants, should be stored and properly labelled on site in accordance with the requirements in the DGO. If transportation of hazardous materials is necessary, hazardous materials, chemical wastes and fuel should be packed or stored in containers or vessels of suitable design and construction to prevent leakage, spillage or escape.	All construction sites	V
	Human waste should be discharged into septic tanks provided by the contractors and removed regularly by a hygiene services company. Refuse containers such as open skips should be provided at every work site for use	All construction sites	V

China State Construction Engineering (Hong Kong) Ltd.

	by the workforce. On-site refuse collection points must also be provided.		
<b>Landscape and Visual</b>			
Additional Measures	Planting and vegetation restoration (including transplanted trees) on soil slopes including restoration of grassland, scrub and woodland on slopes around the development platforms and access road. Restoration would be undertaken using predominantly native species.	Whole development	V
Additional Measures	Screen planting along the access roads, to limit impacts of elevated structures and rock slopes.	Whole development	V
	Colouring of shotcrete slopes.	Whole development	V
	Limited planting on shotcrete slopes.	Whole development	V
	Landscape buffers and planting in and around the development itself to screen partially close views of the site.	Whole development	V
	Screen planting in front of retaining walls / granite cladding to those walls to reduce glare and visual impacts.	Whole development	V
	Careful design of road elevated structure and abutments, to limit visual impacts.	Whole development	V
	Roadside landscape features / hardworks to limit visual impacts.	Whole development	V
	Conservation of CDG or CDV recovered from the site for re-use in the landscape restoration.	Whole development	V
	Preservation (by transplanting if necessary) of any trees identified as being of particular landscape value.	Whole development	V
<b>Ecology</b>			

China State Construction Engineering (Hong Kong) Ltd.

	Woodland planting on soft cut slopes available (about 13.4ha) within the development site. Native species, preferably with documented ecological utility, should be used.	Soft cut slopes	V
	Seeds of the native species when possible should be added into the hydroseeding mix. Seedlings should be pit planted with placement of slow release fertilizer.	Soft cut slopes	N/A
	Maintenance and service, including weeding, fertilizing, replacement of dead plants, etc. should be performed during the first 1 years of planting to enhance the survival rate of the plants.	Soft cut slopes	N/A
<b>Contaminated Land</b>			
	In accordance with the approved Contamination Assessment Report (CAR) and Remediation Action Plan (RAP) in Nov 2006, it is recommended that cement solidification / stabilization prior to on-site backfill for heavy metal contaminated soil and excavation followed by disposal at designated landfill for organic contaminated soil. Upon the completion of the proposed remediation exercise as outlined in CAR & RAP, a Remediation Report will be compiled for submission to EPD to demonstrate that the proposed soil remediation has been carried out properly and satisfactorily. Results from the confirmation tests will also be included in the Remediation Report. Photos showing the area of excavation, the solidification process, and remediated soil and site shall also be included in the report for reference.	Locations specified in CAR	V

China State Construction Engineering (Hong Kong) Ltd.

<b>Landfill Gas Hazard</b>			
	Further site investigation should be carried out during the detailed design stage in order to measure landfill gas around the perimeter of the site, to re-confirm that there is no preferential pathway for landfill gas migration and to assess the potential for landfill gas hazards on the future development. If a landfill gas hazard is identified, mitigation measures should be proposed and implemented to address the hazard.	The whole development site	V

Legend: V = implemented;  
 x = not implemented;  
 @ = partially implemented;  
 N/A = not applicable

---

**APPENDIX C**

**Summary of Action and Limit Levels**

---

## Appendix C - Summary of Action and Limit Levels

Table 1 – Action and Limit Levels for 1-hour TSP

Location	Action Level	Limit Level
ID 1A	201.5	500
ID 2	197.0	500
ID 3	203.7	500
ID 4	264.6	500
ID 5	267.4	500

Table 2 – Action and Limit Levels for 24-hour TSP

Location	Action Level	Limit Level
ID 1A	170.2	260
ID 2	200.0	260
ID 3	200.0	260
ID 4	181.3	260
ID 5	180.8	260

Table 3 – Action and Limit Levels for Construction Noise (0700-1900 hrs of normal weekdays)

Location	Action Level	Limit Level
ID 1A	When one documented complaint is received from any one of the sensitive receivers	*65 / 70 dB(A)
ID 2		75 dB(A)
ID 3		75 dB(A)
ID 4		*65 / 70 dB(A)
ID 5		*65 / 70 dB(A)

\*Daytime noise Limit Level of 70 dB(A) applies to education institutions, while 65dB(A) applies during school examination period

---

**APPENDIX D**

**Calibration Certificates of Equipments**

---

# Certificate of Calibration

Calibration Certification Information			
Cal. Date: December 26, 2017	Rootsmeter S/N: 438320	Ta: 291	°K
Operator: Jim Tisch		Pa: 763.3	mm Hg
Calibration Model #: TE-5025A	Calibrator S/N: <b>0843</b>		

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4140	3.2	2.00
2	3	4	1	1.0010	6.4	4.00
3	5	6	1	0.8910	7.9	5.00
4	7	8	1	0.8480	8.8	5.50
5	9	10	1	0.7030	12.7	8.00

Data Tabulation					
Vstd (m3)	Qstd (x-axis)	$\sqrt{\Delta H \left( \frac{Pa}{Pstd} \right) \left( \frac{Tstd}{Ta} \right)}$ (y-axis)	Va	Qa (x-axis)	$\sqrt{\Delta H (Ta/Pa)}$ (y-axis)
1.0241	0.7243	1.4342	0.9958	0.7042	0.8732
1.0198	1.0188	2.0283	0.9916	0.9906	1.2349
1.0178	1.1423	2.2677	0.9896	1.1107	1.3807
1.0166	1.1988	2.3783	0.9885	1.1656	1.4481
1.0113	1.4386	2.8684	0.9834	1.3988	1.7464
<b>QSTD</b>	m=	<b>2.00314</b>	<b>QA</b>	m=	<b>1.25433</b>
	b=	<b>-0.01725</b>		b=	<b>-0.01050</b>
	r=	<b>0.99996</b>		r=	<b>0.99996</b>

Calculations			
Vstd=	$\Delta Vol \left( \frac{Pa - \Delta P}{Pstd} \right) \left( \frac{Tstd}{Ta} \right)$	Va=	$\Delta Vol \left( \frac{Pa - \Delta P}{Pa} \right)$
Qstd=	Vstd/ΔTime	Qa=	Va/ΔTime
For subsequent flow rate calculations:			
Qstd=	$1/m \left( \left( \sqrt{\Delta H \left( \frac{Pa}{Pstd} \right) \left( \frac{Tstd}{Ta} \right)} \right) - b \right)$	Qa=	$1/m \left( \left( \sqrt{\Delta H (Ta/Pa)} \right) - b \right)$

Standard Conditions	
Tstd:	298.15 °K
Pstd:	760 mm Hg
Key	
ΔH:	calibrator manometer reading (in H2O)
ΔP:	rootsmeter manometer reading (mm Hg)
Ta:	actual absolute temperature (°K)
Pa:	actual barometric pressure (mm Hg)
b:	intercept
m:	slope

RECALIBRATION
US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30











# AECOM Asia Company Limited

## Graseby TSP Mass Flow Controlled High Volume Air Sampler Field Calibration Report

Station Sau Ming Primary School (ID4)  
 Date: 20-Nov-18  
 Pump No.: 1275  
 Equipment No.: A-001-28T  
 Model: GMW 2310

Operator: Shum Kam Yuen  
 Next Due Date: 20-Jan-19  
 Verified Against: O.T.S -- 843  
 Expiration Date: 26-Dec-2018

Ambient Condition					
Temperature, Ta	297	Kelvin	Pressure, Pa	761.8	mmHg

Orifice Transfer Standard Information					
Equipment No.:	843	Slope, mc	2.00314	Intercept, bc	-0.01725
Last Calibration Date:	26-Dec-17	$mc \times Qstd + bc = [H \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	26-Dec-18				

Calibration of TSP Sampler					
Calibration Point	H in. of water	$[H \times (Pa/760) \times (298/Ta)]^{1/2}$	Qstd (m <sup>3</sup> /min) X - axis	W in. of oil	$[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$ Y-axis
1	7.3	2.71	1.36	5.2	2.29
2	6.3	2.52	1.27	4.5	2.13
3	4.9	2.22	1.12	3.3	1.82
4	3.8	1.95	0.98	2.3	1.52
5	2.8	1.68	0.85	1.7	1.31

**By Linear Regression of Y on X**  
 Slope, mw = 1.9643 Intercept, bw = -0.3782  
 Correlation Coefficient\* = 0.9991

**Set Point Calculation**

From the TSP Field Calibration Curve, take Qstd = 1.21 m<sup>3</sup>/min (43 CFM)  
 From the Regression Equation, the "Y" value according to

$$m \times Qstd + b = [W \times (Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point W =  $(m \times Qstd + b)^2 \times (760 / Pa) \times (Ta / 298) =$  3.97

\*If Correlation Coefficient < 0.990, check and recalibrate again.

Remarks: \_\_\_\_\_

QC Reviewer: WS CHAN Signature: [Signature] Date: 20/11/18

# AECOM Asia Company Limited

## Graseby TSP Mass Flow Controlled High Volume Air Sampler Field Calibration Report

Station Sau Mau Ping Catholic Primary School (ID5) Operator: Shum Kam Yuen  
 Date: 20-Nov-18 Next Due Date: 20-Jan-19  
 Pump No.: 10088 Verified Against: O.T.S -- 843  
 Equipment No.: A-001-13T Expiration Date: 26-Dec-2018  
 Model: GMW 2310

Ambient Condition					
Temperature, Ta	297	Kelvin	Pressure, Pa	761.8	mmHg

Orifice Transfer Standard Information					
Equipment No.:	843	Slope, mc	2.00314	Intercept, bc	-0.01725
Last Calibration Date:	26-Dec-17	$mc \times Q_{std} + bc = [H \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	26-Dec-18				

Calibration of TSP Sampler					
Calibration Point	H in. of water	$[H \times (Pa/760) \times (298/Ta)]^{1/2}$	Qstd (m <sup>3</sup> /min) X - axis	W in. of oil	$[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$ Y-axis
1	7.2	2.69	1.35	5.6	2.37
2	6.1	2.48	1.25	4.4	2.10
3	5.2	2.29	1.15	3.5	1.88
4	4.2	2.06	1.04	2.6	1.62
5	3.2	1.79	0.90	1.6	1.27

By Linear Regression of Y on X  
 Slope , mw = 2.4151 Intercept, bw = -0.9004  
 Correlation Coefficient\* = 0.9996

**Set Point Calculation**

From the TSP Field Calibration Curve, take Qstd = 1.21 m<sup>3</sup>/min (43 CFM)  
 From the Regression Equation, the "Y" value according to

$$m \times Q_{std} + b = [W \times (Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point W =  $(m \times Q_{std} + b)^2 \times (760 / Pa) \times (Ta / 298) =$  4.06

\*If Correlation Coefficient < 0.990, check and recalibrate again.

Remarks: \_\_\_\_\_  
 \_\_\_\_\_

QC Reviewer: W S CHAN Signature: PK Date: 20/11/18

## EQUIPMENT CALIBRATION RECORD

Type: Laser Dust Monitor  
 Manufacturer/Brand: SIBATA  
 Model No.: LD-3  
 Equipment No.: A.005.07a  
 Sensitivity Adjustment Scale Setting: 557 CPM  
 Operator: Mike Shek (MSKM)

### Standard Equipment

Equipment: Rupprecht & Patashnick TEOM®  
 Venue: Cyberport (Pui Ying Secondary School)  
 Model No.: Series 1400AB  
 Serial No: Control: 140AB219899803  
 Sensor: 1200C143659803 K<sub>o</sub>: 12500  
 Last Calibration Date\*: 3 May 2018

\*Remarks: Recommended interval for hardware calibration is 1 year

### Calibration Result

Sensitivity Adjustment Scale Setting (Before Calibration): 557 CPM  
 Sensitivity Adjustment Scale Setting (After Calibration): 557 CPM

Hour	Date (dd-mm-yy)	Time	Ambient Condition		Concentration <sup>1</sup> (mg/m <sup>3</sup> ) Y-axis	Total Count <sup>2</sup>	Count/ Minute <sup>3</sup> X-axis
			Temp (°C)	R.H. (%)			
1	05-05-18	09:15 - 10:15	27.6	79	0.05367	2151	35.85
2	05-05-18	10:15 - 11:15	27.6	80	0.05864	2347	39.12
3	05-05-18	11:15 - 12:15	27.7	80	0.06661	2679	44.65
4	05-05-18	12:15 - 13:15	27.7	79	0.06335	2546	42.43

Note: 1. Monitoring data was measured by Rupprecht & Patashnick TEOM®  
 2. Total Count was logged by Laser Dust Monitor  
 3. Count/minute was calculated by (Total Count/60)

By Linear Regression of Y or X

Slope (K-factor): 0.0015  
 Correlation coefficient: 0.9994

Validity of Calibration Record: 5 May 2019

Remarks:

QC Reviewer: YW Fung

Signature: 

Date: 07 May 2018

## EQUIPMENT CALIBRATION RECORD

Type: Laser Dust Monitor  
 Manufacturer/Brand: SIBATA  
 Model No.: LD-3  
 Equipment No.: A.005.09a  
 Sensitivity Adjustment Scale Setting: 797 CPM  
 Operator: Mike Shek (MSKM)

### Standard Equipment

Equipment: Rupprecht & Patashnick TEOM®  
 Venue: Cyberport (Pui Ying Secondary School)  
 Model No.: Series 1400AB  
 Serial No: Control: 140AB219899803  
 Sensor: 1200C143659803 K<sub>o</sub>: 12500  
 Last Calibration Date\*: 3 May 2018

\*Remarks: Recommended interval for hardware calibration is 1 year

### Calibration Result

Sensitivity Adjustment Scale Setting (Before Calibration): 797 CPM  
 Sensitivity Adjustment Scale Setting (After Calibration): 797 CPM

Hour	Date (dd-mm-yy)	Time	Ambient Condition		Concentration <sup>1</sup> (mg/m <sup>3</sup> ) Y-axis	Total Count <sup>2</sup>	Count/ Minute <sup>3</sup> X-axis
			Temp (°C)	R.H. (%)			
1	05-05-18	09:45 - 10:45	27.6	79	0.05483	2176	36.26
2	05-05-18	10:45 - 11:45	27.7	80	0.05813	2324	38.73
3	05-05-18	11:45 - 12:45	27.7	79	0.06734	2701	45.02
4	05-05-18	12:45 - 13:45	27.7	79	0.06375	2545	42.41

Note: 1. Monitoring data was measured by Rupprecht & Patashnick TEOM®  
 2. Total Count was logged by Laser Dust Monitor  
 3. Count/minute was calculated by (Total Count/60)

By Linear Regression of Y or X

Slope (K-factor): 0.0015  
 Correlation coefficient: 0.9977

Validity of Calibration Record: 5 May 2019

Remarks:

QC Reviewer: YW Fung

Signature: 

Date: 07 May 2018

## EQUIPMENT CALIBRATION RECORD

Type: Laser Dust Monitor  
 Manufacturer/Brand: SIBATA  
 Model No.: LD-3  
 Equipment No.: A.005.10a  
 Sensitivity Adjustment Scale Setting: 753 CPM  
 Operator: Mike Shek (MSKM)

### Standard Equipment

Equipment: Rupprecht & Patashnick TEOM®  
 Venue: Cyberport (Pui Ying Secondary School)  
 Model No.: Series 1400AB  
 Serial No.: Control: 140AB219899803  
 Sensor: 1200C143659803 K<sub>c</sub>: 12500  
 Last Calibration Date\*: 3 May 2018

\*Remarks: Recommended interval for hardware calibration is 1 year

### Calibration Result

Sensitivity Adjustment Scale Setting (Before Calibration): 753 CPM  
 Sensitivity Adjustment Scale Setting (After Calibration): 753 CPM

Hour	Date (dd-mm-yy)	Time	Ambient Condition		Concentration <sup>1</sup> (mg/m <sup>3</sup> ) Y-axis	Total Count <sup>2</sup>	Count/ Minute <sup>3</sup> X-axis
			Temp (°C)	R.H. (%)			
1	05-05-18	10:00 - 11:00	27.7	80	0.05415	2164	36.06
2	05-05-18	11:00 - 12:00	27.7	80	0.05973	2375	39.58
3	05-05-18	12:00 - 13:00	27.7	79	0.06718	2693	44.88
4	05-05-18	13:00 - 14:00	27.7	80	0.06486	2587	43.11


Note: 1. Monitoring data was measured by Rupprecht & Patashnick TEOM®  
 2. Total Count was logged by Laser Dust Monitor  
 3. Count/minute was calculated by (Total Count/60)

By Linear Regression of Y or X

Slope (K-factor): 0.0015  
 Correlation coefficient: 0.9986

Validity of Calibration Record: 5 May 2019

Remarks:

QC Reviewer: YW Fung Signature:  Date: 07 May 2018



## EQUIPMENT CALIBRATION RECORD

Type: Laser Dust Monitor  
 Manufacturer/Brand: SIBATA  
 Model No.: LD-3  
 Equipment No.: A.005.11a  
 Sensitivity Adjustment Scale Setting: 799 CPM  
 Operator: Mike Shek (MSKM)

### Standard Equipment

Equipment: Rupprecht & Patashnick TEOM®  
 Venue: Cyberport (Pui Ying Secondary School)  
 Model No.: Series 1400AB  
 Serial No: Control: 140AB219899803  
 Sensor: 1200C143659803 K<sub>0</sub>: 12500  
 Last Calibration Date\*: 3 May 2018

\*Remarks: Recommended interval for hardware calibration is 1 year

### Calibration Result

Sensitivity Adjustment Scale Setting (Before Calibration): 799 CPM  
 Sensitivity Adjustment Scale Setting (After Calibration): 799 CPM

Hour	Date (dd-mm-yy)	Time	Ambient Condition		Concentration <sup>1</sup> (mg/m <sup>3</sup> ) Y-axis	Total Count <sup>2</sup>	Count/ Minute <sup>3</sup> X-axis
			Temp (°C)	R.H. (%)			
1	06-05-18	10:00 - 11:00	27.9	80	0.05121	2045	34.08
2	06-05-18	11:00 - 12:00	27.9	81	0.05413	2164	36.06
3	06-05-18	12:00 - 13:00	27.9	80	0.05616	2252	37.53
4	06-05-18	13:00 - 14:00	28.0	80	0.05824	2321	38.68


Note: 1. Monitoring data was measured by Rupprecht & Patashnick TEOM®  
 2. Total Count was logged by Laser Dust Monitor  
 3. Count/minute was calculated by (Total Count/60)

By Linear Regression of Y or X

Slope (K-factor): 0.0015  
 Correlation coefficient: 0.9976

Validity of Calibration Record: 6 May 2019

Remarks:

QC Reviewer: YW Fung Signature:  Date: 07 May 2018

## EQUIPMENT CALIBRATION RECORD

Type: Laser Dust Monitor  
 Manufacturer/Brand: SIBATA  
 Model No.: LD-3B  
 Equipment No.: A.005.13a  
 Sensitivity Adjustment Scale Setting: 643 CPM  
 Operator: Mike Shek (MSKM)

### Standard Equipment

Equipment: Rupprecht & Patashnick TEOM®  
 Venue: Cyberport (Pui Ying Secondary School)  
 Model No.: Series 1400AB  
 Serial No: Control: 140AB219899803  
 Sensor: 1200C143659803 Ko: 12500  
 Last Calibration Date\*: 3 May 2018

\*Remarks: Recommended interval for hardware calibration is 1 year

### Calibration Result

Sensitivity Adjustment Scale Setting (Before Calibration): 643 CPM  
 Sensitivity Adjustment Scale Setting (After Calibration): 643 CPM

Hour	Date (dd-mm-yy)	Time	Ambient Condition		Concentration <sup>1</sup> (mg/m <sup>3</sup> ) Y-axis	Total Count <sup>2</sup>	Count/ Minute <sup>3</sup> X-axis
			Temp (°C)	R.H. (%)			
1	06-05-18	10:15 - 11:15	27.9	80	0.05124	2057	34.28
2	06-05-18	11:15 - 12:15	27.9	81	0.05453	2179	36.32
3	06-05-18	12:15 - 13:15	28.0	81	0.05658	2273	37.88
4	06-05-18	13:15 - 14:15	28.0	80	0.05736	2307	38.45

Note: 1. Monitoring data was measured by Rupprecht & Patashnick TEOM®  
 2. Total Count was logged by Laser Dust Monitor  
 3. Count/minute was calculated by (Total Count/60)

By Linear Regression of Y or X

Slope (K-factor): 0.0015  
 Correlation coefficient: 0.9968

Validity of Calibration Record: 6 May 2019

Remarks:

QC Reviewer: YW Fung Signature:  Date: 07 May 2018

## EQUIPMENT CALIBRATION RECORD

Type: Laser Dust Monitor  
 Manufacturer/Brand: SIBATA  
 Model No.: LD-3B  
 Equipment No.: A.005.16a  
 Sensitivity Adjustment Scale Setting: 521 CPM

Operator: Mike Shek (MSKM)

### Standard Equipment

Equipment: Rupprecht & Patashnick TEOM®  
 Venue: Cyberport (Pui Ying Secondary School)  
 Model No.: Series 1400AB  
 Serial No: Control: 140AB219899803  
 Sensor: 1200C143659803 K<sub>0</sub>: 12500  
 Last Calibration Date\*: 3 May 2018

\*Remarks: Recommended interval for hardware calibration is 1 year

### Calibration Result

Sensitivity Adjustment Scale Setting (Before Calibration): 521 CPM  
 Sensitivity Adjustment Scale Setting (After Calibration): 521 CPM

Hour	Date (dd-mm-yy)	Time	Ambient Condition		Concentration <sup>1</sup> (mg/m <sup>3</sup> ) Y-axis	Total Count <sup>2</sup>	Count/ Minute <sup>3</sup> X-axis
			Temp (°C)	R.H. (%)			
1	14-07-18	10:15 - 11:15	29.1	79	0.04328	1742	29.03
2	14-07-18	11:15 - 12:15	29.1	78	0.04673	1874	31.23
3	14-07-18	12:15 - 13:15	29.2	79	0.04904	1961	32.68
4	14-07-18	13:15 - 14:15	29.2	79	0.04734	1897	31.62


Note: 1. Monitoring data was measured by Rupprecht & Patashnick TEOM®  
 2. Total Count was logged by Laser Dust Monitor  
 3. Count/minute was calculated by (Total Count/60)

By Linear Regression of Y or X

Slope (K-factor): 0.0015  
 Correlation coefficient: 0.9974

Validity of Calibration Record: 14 July 2019

Remarks:

QC Reviewer: YW Fung Signature:  Date: 16 July 2018



## CERTIFICATE OF CALIBRATION

Certificate No.: 18CA0914 03 Page 1 of 2

### Item tested

Description:	Sound Level Meter (Type 1)	Microphone
Manufacturer:	B & K	B & K
Type/Model No.:	2238	4188
Serial/Equipment No.:	2800927	2791211
Adaptors used:	-	-

### Item submitted by

Customer Name: AECOM ASIA CO., LTD.  
Address of Customer: -  
Request No.: -  
Date of receipt: 14-Sep-2018

Date of test: 17-Sep-2018

### Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Multi function sound calibrator	B&K 4226	2288444	23-Aug-2019	CIGISMEC
Signal generator	DS 360	33873	24-Apr-2019	CEPREI
Signal generator	DS 360	61227	23-Apr-2019	CEPREI

### Ambient conditions

Temperature:  $21 \pm 1$  °C  
Relative humidity:  $55 \pm 10$  %  
Air pressure:  $1005 \pm 5$  hPa

### Test specifications

- 1, The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580: Part 1: 1997 and the lab calibration procedure SMTP004-CA-152.
- 2, The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of  $\pm 20\%$ .
- 3, The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference between the free-field and pressure responsiveness of the Sound Level Meter.

### Test results

This is to certify that the Sound Level Meter conforms to BS 7580: Part 1: 1997 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate.

Actual Measurement data are documented on worksheets.

Approved Signatory:

Feng Junqi

Date: 18-Sep-2018

Company Chop:



**Comments:** The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.





## CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 18CA0914 03 Page 2 of 2

### 1, Electrical Tests

The electrical tests were performed using an equivalent capacitance substituted for the microphone. The results are given in below with test status and the estimated uncertainties. The "Pass" means the result of the test is inside the tolerances stated in the test specifications. The "-" means the result of test is outside these tolerances.

Test:	Subtest:	Status:	Expanded Uncertainty (dB)	Coverage Factor
Self-generated noise	A	Pass	0.3	
	C	Pass	1.0	2.1
	Lin	Pass	2.0	2.2
Linearity range for Leq	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	Reference SPL on all other ranges	Pass	0.3	
	2 dB below upper limit of each range	Pass	0.3	
	2 dB above lower limit of each range	Pass	0.3	
Linearity range for SPL	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	Frequency weightings	A	Pass	0.3
Time weightings	C	Pass	0.3	
	Lin	Pass	0.3	
	Single Burst Fast	Pass	0.3	
Peak response	Single Burst Slow	Pass	0.3	
	Single 100µs rectangular pulse	Pass	0.3	
R.M.S. accuracy	Crest factor of 3	Pass	0.3	
	Time weighting I	Single burst 5 ms at 2000 Hz	Pass	0.3
Time averaging	Repeated at frequency of 100 Hz	Pass	0.3	
	1 ms burst duty factor 1/10 <sup>3</sup> at 4kHz	Pass	0.3	
	1 ms burst duty factor 1/10 <sup>4</sup> at 4kHz	Pass	0.3	
Pulse range	Single burst 10 ms at 4 kHz	Pass	0.4	
	Sound exposure level	Single burst 10 ms at 4 kHz	Pass	0.4
Overload indication	SPL	Pass	0.3	
	Leq	Pass	0.4	

### 2, Acoustic tests

The complete sound level meter was calibrated on the reference range using a B&K 4226 acoustic calibrator with 1000Hz and SPL 94 dB. The sensitivity of the sound level meter was adjusted. The test result at 125 Hz and 8000 Hz are given in below with test status and the estimated uncertainties.

Test:	Subtest	Status	Expanded Uncertainty (dB)	Coverage Factor
Acoustic response	Weighting A at 125 Hz	Pass	0.3	
	Weighting A at 8000 Hz	Pass	0.5	

### 3, Response to associated sound calibrator

N/A

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

- End -

Calibrated by:

Date:

Fung Chi Yip  
17-Sep-2018

Checked by:

Date:

Shek Kwong Tat  
18-Sep-2018

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



## CERTIFICATE OF CALIBRATION

Certificate No.: 18CA0321 01-02 Page 1 of 2

### Item tested

Description:	Sound Level Meter (Type 1)	Microphone	Preamp
Manufacturer:	B & K	B & K	B & K
Type/Model No.:	2250-L	4950	ZC0032
Serial/Equipment No.:	2681366	2665582	17190
Adaptors used:	-	-	-

### Item submitted by

Customer Name: AECOM ASIA CO LTD  
Address of Customer: -  
Request No.: -  
Date of receipt: 21-Mar-2018

Date of test: 23-Mar-2018

### Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Multi function sound calibrator	B&K 4226	2288444	08-Sep-2018	CIGISMEC
Signal generator	DS 360	33873	25-Apr-2018	CEPREI
Signal generator	DS 360	61227	01-Apr-2018	CEPREI

### Ambient conditions

Temperature:  $21 \pm 1$  °C  
Relative humidity:  $50 \pm 10$  %  
Air pressure:  $1000 \pm 5$  hPa

### Test specifications

1. The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580: Part 1: 1997 and the lab calibration procedure SMTP004-CA-152.
2. The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of  $\pm 20\%$ .
3. The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference between the free-field and pressure responsess of the Sound Level Meter.

### Test results

This is to certify that the Sound Level Meter conforms to BS 7580: Part 1: 1997 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate.

Actual Measurement data are documented on worksheets.

Approved Signatory:

  
Feng Jun Qi

Date: 24-Mar-2018

Company Chop:



Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.





# CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 18CA0321 01-02

Page 2 of 2

## 1, Electrical Tests

The electrical tests were performed using an equivalent capacitance substituted for the microphone. The results are given in below with test status and the estimated uncertainties. The "Pass" means the result of the test is inside the tolerances stated in the test specifications. The "-" means the result of test is outside these tolerances.

Test:	Subtest:	Status:	Expanded Uncertainty (dB)	Coverage Factor
Self-generated noise	A	Pass	0.3	
	C	Pass	0.8	
	Lin	Pass	1.6	
Linearity range for Leq	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	Reference SPL on all other ranges	Pass	0.3	
	2 dB below upper limit of each range	Pass	0.3	
	2 dB above lower limit of each range	Pass	0.3	
Linearity range for SPL	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	A	Pass	0.3	
	C	Pass	0.3	
Frequency weightings	Lin	Pass	0.3	
	Time weightings	Single Burst Fast	Pass	0.3
	Single Burst Slow	Pass	0.3	
Peak response	Single 100µs rectangular pulse	Pass	0.3	
	R.M.S. accuracy	Crest factor of 3	Pass	0.3
Time weighting I	Single burst 5 ms at 2000 Hz	Pass	0.3	
	Repeated at frequency of 100 Hz	Pass	0.3	
Time averaging	1 ms burst duty factor 1/10 <sup>3</sup> at 4kHz	Pass	0.3	
	1 ms burst duty factor 1/10 <sup>4</sup> at 4kHz	Pass	0.3	
Pulse range	Single burst 10 ms at 4 kHz	Pass	0.4	
Sound exposure level	Single burst 10 ms at 4 kHz	Pass	0.4	
Overload indication	SPL	Pass	0.3	
	Leq	Pass	0.4	

## 2, Acoustic tests

The complete sound level meter was calibrated on the reference range using a B&K 4226 acoustic calibrator with 1000Hz and SPL 94 dB. The sensitivity of the sound level meter was adjusted. The test result at 125 Hz and 8000 Hz are given in below with test status and the estimated uncertainties.

Test:	Subtest	Status	Expanded Uncertainty (dB)	Coverage Factor
Acoustic response	Weighting A at 125 Hz	Pass	0.3	
	Weighting A at 8000 Hz	Pass	0.5	

## 3, Response to associated sound calibrator

N/A

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

- End -

Calibrated by:		Checked by:	
Date:	Fung Chi Yip 23-Mar-2018	Date:	Lam Tze Wai 24-Mar-2018

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



## CERTIFICATE OF CALIBRATION

Certificate No.: 18CA0406 02-02

Page: 1 of 2

### Item tested

Description: Acoustical Calibrator (Class 1)  
Manufacturer: B & K  
Type/Model No.: 4231  
Serial/Equipment No.: 3006428 / N004.03  
Adaptors used: -

### Item submitted by

Customer: AECOM ASIA CO LIMITED  
Address of Customer: -  
Request No.: -  
Date of receipt: 06-Apr-2018

Date of test: 09-Apr-2018

### Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Lab standard microphone	B&K 4180	2341427	11-Apr-2018	SCL
Preamplifier	B&K 2673	2743150	05-May-2018	CEPREI
Measuring amplifier	B&K 2610	2346941	03-May-2018	CEPREI
Signal generator	DS 360	33873	25-Apr-2018	CEPREI
Digital multi-meter	34401A	US36087050	25-Apr-2018	CEPREI
Audio analyzer	8903B	GB41300350	21-Apr-2018	CEPREI
Universal counter	53132A	MY40003662	22-Apr-2018	CEPREI

### Ambient conditions

Temperature:  $21 \pm 1$  °C  
Relative humidity:  $50 \pm 10$  %  
Air pressure:  $1005 \pm 5$  hPa

### Test specifications


1. The Sound Calibrator has been calibrated in accordance with the requirements as specified in IEC 60942 1997 Annex B and the lab calibration procedure SMTP004-CA-156.
2. The calibrator was tested with its axis vertical facing downwards at the specific frequency using insert voltage technique.
3. The results are rounded to the nearest 0.01 dB and 0.1 Hz and have not been corrected for variations from a reference pressure of 1013.25 hectoPascals as the maker's information indicates that the instrument is insensitive to pressure changes.

### Test results

This is to certify that the sound calibrator conforms to the requirements of annex B of IEC 60942: 1997 for the conditions under which the test was performed. This does not imply that the sound calibrator meets IEC 60942 under any other conditions.

Details of the performed measurements are presented on page 2 of this certificate.

Approved Signatory:

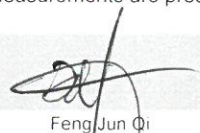

Feng Jun Qi

Date: 11-Apr-2018

Company Chop:







## CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 18CA0406 02-02

Page: 2 of 2

### 1, Measured Sound Pressure Level

The output Sound Pressure Level in the calibrator head was measured at the setting and frequency shown using a calibrated laboratory standard microphone and insert voltage technique. The results are given in below with the estimated uncertainties.

Frequency Shown Hz	Output Sound Pressure Level Setting dB	Measured Output Sound Pressure Level dB	(Output level in dB re 20 $\mu$ Pa)	
			Estimated	Expanded Uncertainty dB
1000	94.00	94.20		0.10

### 2, Sound Pressure Level Stability - Short Term Fluctuations

The Short Term Fluctuations was determined by measuring the maximum and minimum of the fast weighted DC output of the B&K 2610 measuring amplifier over a 20 second time interval as required in the standard. The Short Term Fluctuation was found to be:

At 1000 Hz **STF = 0.015 dB**

Estimated expanded uncertainty 0.005 dB

### 3, Actual Output Frequency

The determination of actual output frequency was made using a B&K 4180 microphone together with a B&K 2673 preamplifier connected to a B&K 2610 measuring amplifier. The AC output of the B&K 2610 was taken to an universal counter which was used to determine the frequency averaged over 20 second of operation as required by the standard. The actual output frequency at 1 KHz was:

At 1000 Hz **Actual Frequency = 999.96 Hz**

Estimated expanded uncertainty 0.1 Hz Coverage factor  $k = 2.2$

### 4, Total Noise and Distortion

For the Total Noise and Distortion measurement, the unfiltered AC output of the B&K 2610 measuring amplifier was connected to an Agilent Type 8903 B distortion analyser. The TND result at 1 KHz was:

At 1000 Hz **TND = 0.4 %**

Estimated expanded uncertainty 0.7 %

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

- End -

Calibrated by:

Fung Chi Yip

Date: 09-Apr-2018

Checked by:

Lam Tze Wai

Date: 11-Apr-2018

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.

---

**APPENDIX E**

**EM&A Monitoring Schedules**

---

**CV/2007/03 - Development at Anderson Road  
Impact Air Quality and Noise Monitoring Schedule for December 2018**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
						1-Dec
						24-hour TSP 1-hour TSP  (ID1A, 2-5)
2-Dec	3-Dec	4-Dec	5-Dec	6-Dec	7-Dec	8-Dec
					24-hour TSP 1-hour TSP Noise (ID1A, 2-5)	
9-Dec	10-Dec	11-Dec	12-Dec	13-Dec	14-Dec	15-Dec
				24-hour TSP 1-hour TSP Noise (ID1A, 2-5)		
16-Dec	17-Dec	18-Dec	19-Dec	20-Dec	21-Dec	22-Dec
			24-hour TSP 1-hour TSP Noise (ID1A, 2-5)			24-hour TSP 1-hour TSP  (ID1A, 2-5)
23-Dec	24-Dec	25-Dec	26-Dec	27-Dec	28-Dec	29-Dec
					24-hour TSP 1-hour TSP Noise (ID1A, 2-5)	
30-Dec	31-Dec					

The schedule is subject to change due to unforeseeable circumstances (e.g. adverse weather, etc)

---

**APPENDIX F**

**Air Quality Monitoring Results and  
their Graphical Presentations**

---

**Appendix F**  
**Air Quality Monitoring Results**

**1-hour TSP Monitoring Results at Station ID 1A (Kwun Tong Government Secondary School)**

Date	Start Time (hh:mm)	1st Hour	2nd Hour	3rd Hour
		Conc. ( $\mu\text{g}/\text{m}^3$ )	Conc. ( $\mu\text{g}/\text{m}^3$ )	Conc. ( $\mu\text{g}/\text{m}^3$ )
1-Dec-18	10:05	64.6	66.9	67.8
7-Dec-18	10:50	65.2	65.9	65.0
13-Dec-18	10:05	63.5	65.3	64.0
19-Dec-18	10:30	65.8	64.7	65.3
22-Dec-18	10:20	67.4	67.6	65.2
28-Dec-18	10:00	67.2	68.8	66.7
Average				65.9
Min				63.5
Max				68.8

**1-hour TSP Monitoring Results at Station ID 2 (On Yat House)**

Date	Start Time (hh:mm)	1st Hour	2nd Hour	3rd Hour
		Conc. ( $\mu\text{g}/\text{m}^3$ )	Conc. ( $\mu\text{g}/\text{m}^3$ )	Conc. ( $\mu\text{g}/\text{m}^3$ )
1-Dec-18	10:20	67.1	68.3	65.9
7-Dec-18	10:30	64.8	64.8	65.3
13-Dec-18	10:26	65.1	67.7	65.5
19-Dec-18	10:15	66.2	66.7	66.7
22-Dec-18	10:33	63.8	65.5	67.0
28-Dec-18	10:15	69.1	71.0	72.2
Average				66.8
Min				63.8
Max				72.2

**1-hour TSP Monitoring Results at Station ID 3 (Sau Nga House)**

Date	Start Time (hh:mm)	1st Hour	2nd Hour	3rd Hour
		Conc. ( $\mu\text{g}/\text{m}^3$ )	Conc. ( $\mu\text{g}/\text{m}^3$ )	Conc. ( $\mu\text{g}/\text{m}^3$ )
1-Dec-18	10:40	64.4	67.4	66.0
7-Dec-18	10:10	64.7	65.0	65.3
13-Dec-18	10:45	64.9	65.9	66.3
19-Dec-18	10:00	64.9	65.1	65.3
22-Dec-18	10:50	62.5	62.9	64.6
28-Dec-18	10:55	67.1	73.1	68.7
Average				65.8
Min				62.5
Max				73.1

**1-hour TSP Monitoring Results at Station ID 4 (Sau Ming Primary School)**

Date	Start Time (hh:mm)	1st Hour	2nd Hour	3rd Hour
		Conc. ( $\mu\text{g}/\text{m}^3$ )	Conc. ( $\mu\text{g}/\text{m}^3$ )	Conc. ( $\mu\text{g}/\text{m}^3$ )
1-Dec-18	10:55	65.5	67.8	68.3
7-Dec-18	9:50	64.2	64.7	64.9
13-Dec-18	11:03	64.7	68.0	65.9
19-Dec-18	9:45	65.0	64.8	65.5
22-Dec-18	11:06	68.1	70.0	67.2
28-Dec-18	11:15	69.0	72.7	70.9
Average				67.1
Min				64.2
Max				72.7

**1-hour TSP Monitoring Results at Station ID 5 (Sau Mau Ping Catholic Primary School)**

Date	Start Time (hh:mm)	1st Hour	2nd Hour	3rd Hour
		Conc. ( $\mu\text{g}/\text{m}^3$ )	Conc. ( $\mu\text{g}/\text{m}^3$ )	Conc. ( $\mu\text{g}/\text{m}^3$ )
1-Dec-18	11:10	67.6	68.5	69.4
7-Dec-18	9:30	64.5	64.8	64.5
13-Dec-18	11:22	65.7	67.6	64.8
19-Dec-18	9:30	66.1	65.9	66.4
22-Dec-18	11:23	66.7	67.8	65.1
28-Dec-18	13:05	68.7	69.9	71.8
Average				67.0
Min				64.5
Max				71.8

**Appendix F**  
**Air Quality Monitoring Results**

**24-hour TSP Monitoring Results at Station ID 1A (Kwun Tong Government Secondary School)**

Date	Weather Condition	Air Temp. (°C)	Atmospheric Pressure(hPa)	Flow Rate (m <sup>3</sup> /min.)		Av. flow (m <sup>3</sup> /min)	Total vol. (m <sup>3</sup> )	Filter Weight (g)		Particulate weight(g)	Elapse Time		Sampling Time(hrs.)	Conc. (µg/m <sup>3</sup> )
				Initial	Final			Initial	Final		Initial	Final		
1-Dec-18	Sunny	24.2	1018.3	1.3111	1.3098	1.31	1887.0	2.6875	2.7095	0.0220	21732.39	21756.39	24.00	11.7
7-Dec-18	Cloudy	23.3	1018.5	1.3538	1.3604	1.36	1954.2	2.6853	2.7010	0.0157	21756.39	21780.39	24.00	8.0
13-Dec-18	Fine	18.1	1025.1	1.3187	1.3161	1.32	1897.1	2.6668	2.6842	0.0174	21780.39	21804.39	24.00	9.2
19-Dec-18	Sunny	21.5	1019.5	1.3687	1.3599	1.36	1964.6	2.6555	2.6845	0.0290	21804.39	21828.39	24.00	14.8
22-Dec-18	Sunny	25.2	1017.0	1.2086	1.2093	1.21	1740.9	2.6611	2.6820	0.0209	21828.39	21852.39	24.00	12.0
28-Dec-18	Sunny	20.2	1021.6	1.3110	1.3100	1.31	1887.1	2.6776	2.7662	0.0886	21852.39	21876.39	24.00	46.9
													Average	17.1
													Min	8.0
													Max	46.9

**24-hour TSP Monitoring Results at Station ID 2 (On Yat House)**

Date	Weather Condition	Air Temp. (°C)	Atmospheric Pressure(hPa)	Flow Rate (m <sup>3</sup> /min.)		Av. flow (m <sup>3</sup> /min)	Total vol. (m <sup>3</sup> )	Filter Weight (g)		Particulate weight(g)	Elapse Time		Sampling Time(hrs.)	Conc. (µg/m <sup>3</sup> )
				Initial	Final			Initial	Final		Initial	Final		
1-Dec-18	Sunny	24.2	1018.3	1.3023	1.3009	1.30	1874.3	2.6802	2.7057	0.0255	24001.12	24025.12	24.00	13.6
7-Dec-18	Cloudy	23.3	1018.5	1.3480	1.3548	1.35	1946.0	2.6674	2.7413	0.0739	24025.12	24049.12	24.00	38.0
13-Dec-18	Fine	18.1	1025.1	1.3101	1.3073	1.31	1884.5	2.6710	2.7045	0.0335	24049.12	24073.12	24.00	17.8
19-Dec-18	Sunny	21.5	1019.5	1.3633	1.3543	1.36	1956.7	2.6950	2.7542	0.0592	24073.12	24097.12	24.00	30.3
22-Dec-18	Sunny	25.2	1017.0	1.2932	1.2940	1.29	1862.8	2.6732	2.7991	0.1259	24097.12	24121.12	24.00	67.6
28-Dec-18	Sunny	20.2	1021.6	1.3000	1.3010	1.30	1872.7	2.6914	2.7586	0.0672	24121.12	24145.12	24.00	35.9
													Average	33.8
													Min	13.6
													Max	67.6

**24-hour TSP Monitoring Results at Station ID 3 (Sau Nga House)**



Date	Weather Condition	Air Temp. (°C)	Atmospheric Pressure(hPa)	Flow Rate (m <sup>3</sup> /min.)		Av. flow (m <sup>3</sup> /min)	Total vol. (m <sup>3</sup> )	Filter Weight (g)		Particulate weight(g)	Elapse Time		Sampling Time(hrs.)	Conc. (µg/m <sup>3</sup> )
				Initial	Final			Initial	Final		Initial	Final		
1-Dec-18	Sunny	24.2	1018.3	1.3123	1.3109	1.31	1888.7	2.6658	2.7035	0.0377	26315.01	26339.01	24.00	20.0
7-Dec-18	Cloudy	23.3	1018.5	1.3542	1.3610	1.36	1954.9	2.6784	2.7307	0.0523	26339.01	26363.01	24.00	26.8
13-Dec-18	Fine	18.1	1025.1	1.3101	1.3073	1.31	1884.5	2.6710	2.7045	0.0335	26363.01	26387.01	24.00	17.8
19-Dec-18	Sunny	21.5	1019.5	1.3695	1.3605	1.37	1965.6	2.6757	2.7558	0.0801	26387.01	26411.01	24.00	40.8
22-Dec-18	Sunny	25.2	1017.0	1.3033	1.3041	1.30	1877.3	2.6768	2.7695	0.0927	26411.01	26435.01	24.00	49.4
28-Dec-18	Sunny	20.2	1021.6	1.3100	1.3110	1.31	1887.1	2.6921	2.7557	0.0636	26435.01	26459.01	24.00	33.7
													Average	31.4
													Min	17.8
													Max	49.4

**24-hour TSP Monitoring Results at Station ID 4 (Sau Ming Primary School)**




Date	Weather Condition	Air Temp. (°C)	Atmospheric Pressure(hPa)	Flow Rate (m <sup>3</sup> /min.)		Av. flow (m <sup>3</sup> /min)	Total vol. (m <sup>3</sup> )	Filter Weight (g)		Particulate weight(g)	Elapse Time		Sampling Time(hrs.)	Conc. (µg/m <sup>3</sup> )
				Initial	Final			Initial	Final		Initial	Final		
1-Dec-18	Sunny	24.2	1018.3	1.3120	1.3105	1.31	1888.2	2.6661	2.6981	0.0320	27115.01	27139.01	24.00	16.9
7-Dec-18	Cloudy	23.3	1018.5	1.3598	1.3674	1.36	1963.6	2.6678	2.7080	0.0402	27139.01	27163.01	24.00	20.5
13-Dec-18	Fine	18.1	1025.1	1.3200	1.3173	1.32	1899.9	2.6673	2.6926	0.0253	27163.01	27187.01	24.00	13.3
19-Dec-18	Sunny	21.5	1019.5	1.3770	1.3669	1.37	1975.6	2.6829	2.7348	0.0519	27187.01	27211.01	24.00	26.3
22-Dec-18	Sunny	25.2	1017.0	1.3019	1.3028	1.30	1875.4	2.6723	2.7251	0.0528	27211.01	27235.01	24.00	28.2
28-Dec-18	Sunny	20.2	1021.6	1.3090	1.3100	1.31	1885.7	2.6795	2.7061	0.0266	27235.01	27259.01	24.00	14.1
													Average	19.9
													Min	13.3
													Max	28.2

**24-hour TSP Monitoring Results at Station ID 5 (Sau Mau Ping Catholic Primary School)**

Date	Weather Condition	Air Temp. (°C)	Atmospheric Pressure(hPa)	Flow Rate (m <sup>3</sup> /min.)		Av. flow (m <sup>3</sup> /min)	Total vol. (m <sup>3</sup> )	Filter Weight (g)		Particulate weight(g)	Elapse Time		Sampling Time(hrs.)	Conc. (µg/m <sup>3</sup> )
				Initial	Final			Initial	Final		Initial	Final		
1-Dec-18	Sunny	24.2	1018.3	1.3074	1.3059	1.31	1881.6	2.6799	2.7059	0.0260	23806.57	23830.57	24.00	13.8
7-Dec-18	Cloudy	23.3	1018.5	1.3589	1.3663	1.36	1962.1	2.6720	2.7076	0.0356	23830.57	23854.57	24.00	18.1
13-Dec-18	Fine	18.1	1025.1	1.3159	1.3129	1.31	1892.7	2.6663	2.6940	0.0277	23854.57	23878.57	24.00	14.6
19-Dec-18	Sunny	21.5	1019.5	1.3755	1.3657	1.37	1973.7	2.6756	2.7514	0.0758	23878.57	23902.57	24.00	38.4
22-Dec-18	Sunny	25.2	1017.0	1.2976	1.2986	1.30	1869.3	2.6786	2.7367	0.0601	23902.57	23926.57	24.00	32.2
28-Dec-18	Sunny	20.2	1021.6	1.3100	1.3110	1.31	1887.1	2.6765	2.7334	0.0569	23926.57	23950.57	24.00	30.2
													Average	24.6
													Min	13.8
													Max	38.4

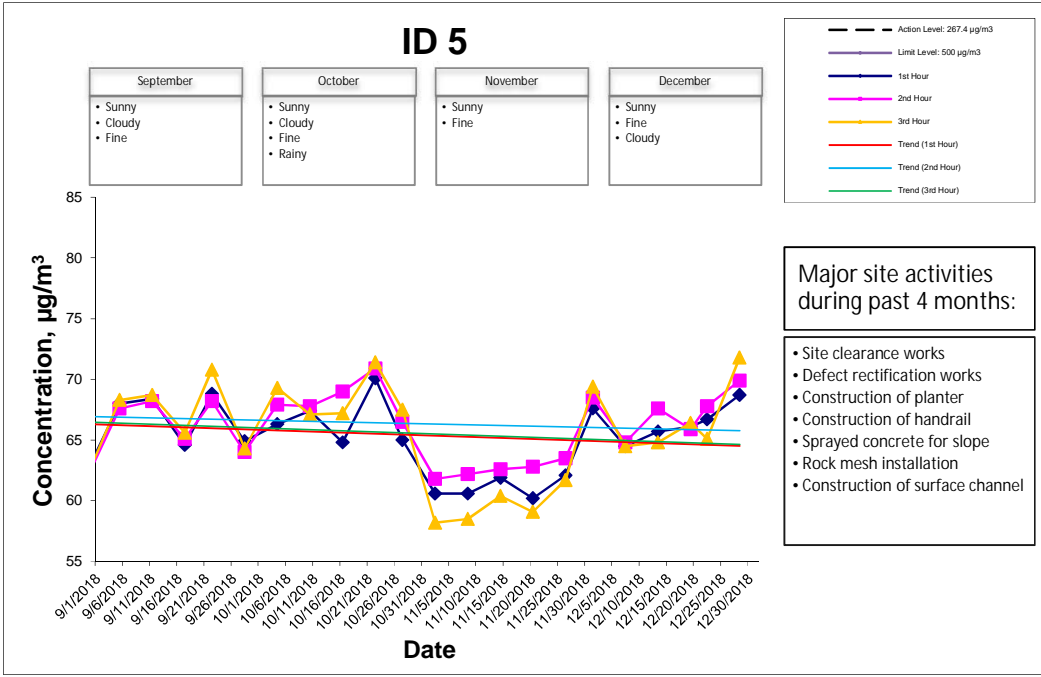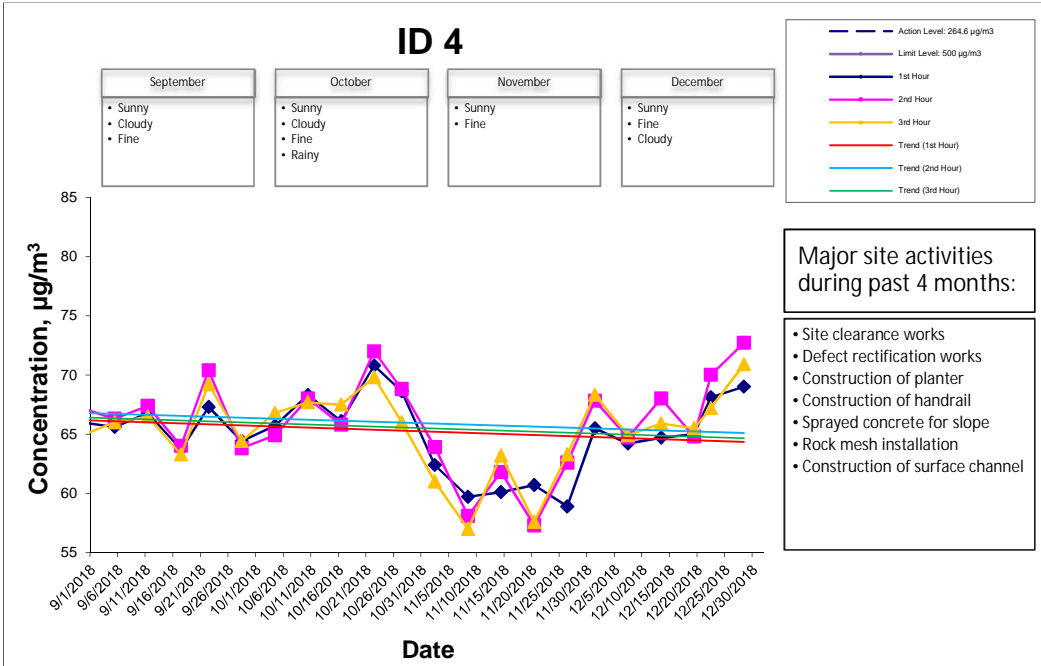

	<b>Development at Anderson Road - Site Formation and Associated Infrastructure Works</b>	SCALE	N.T.S.	DATE	Jan-19
	<b>Graphical Presentations of Impact 1-hour TSP Monitoring Results</b>	CHECK	FYW	DRAWN	DTTW
		JOB NO.	60043155	APPENDIX No.	Rev.
				F	-

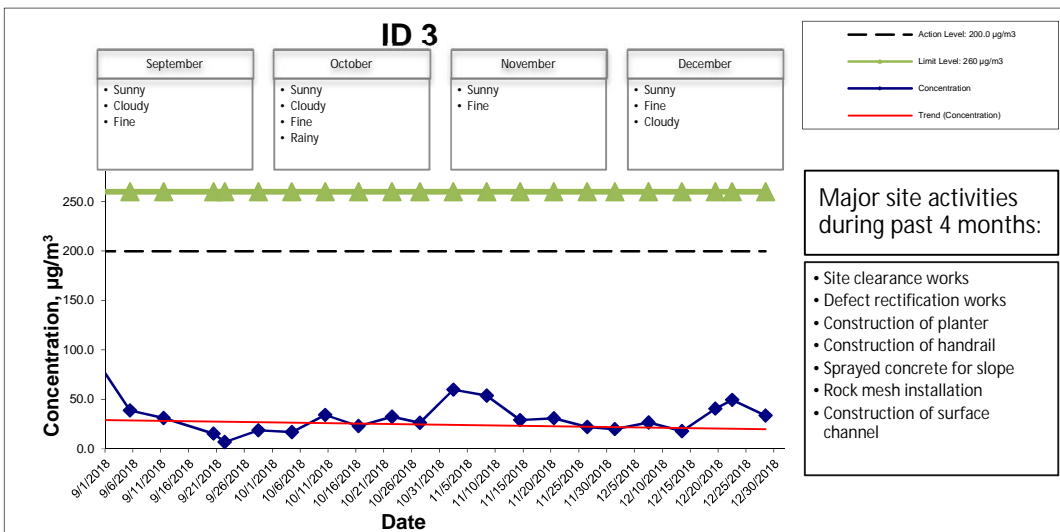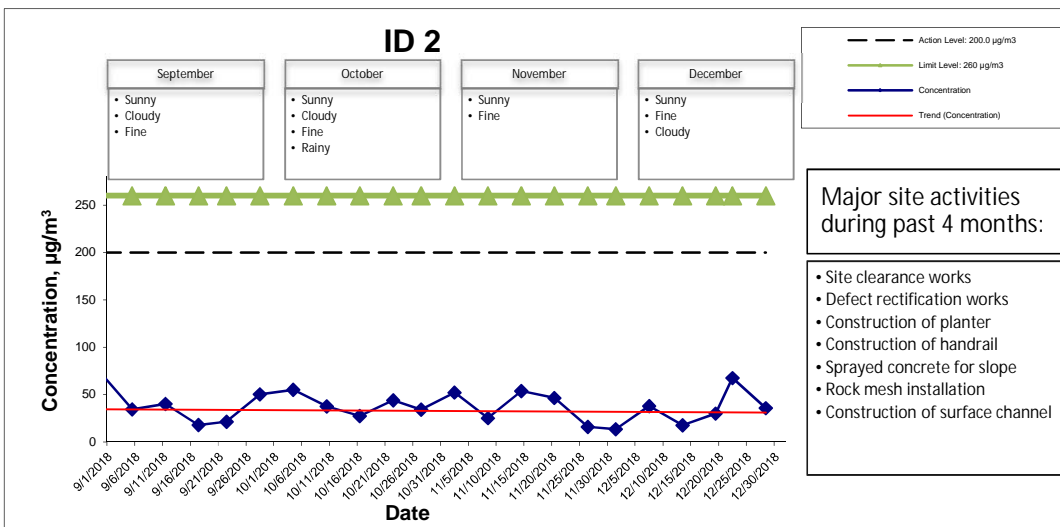
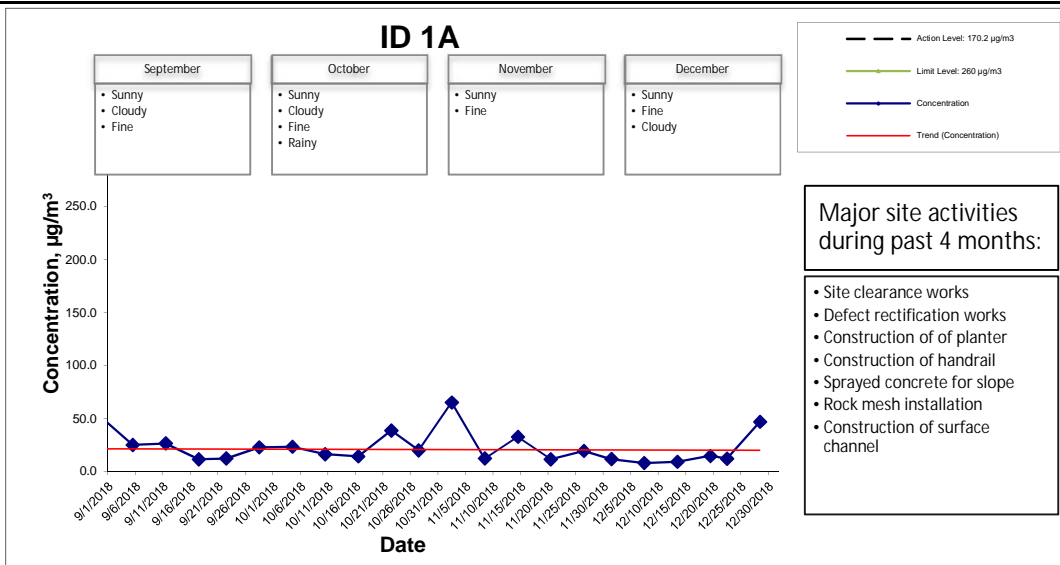


**Development at Anderson Road - Site Formation  
and Associated Infrastructure Works**

**Graphical Presentations of Impact 24-hour TSP  
Monitoring Results**

SCALE	N.T.S.	DATE	Dec-18
CHECK	FYW	DRAWN	DTTW
JOB NO.	60043155	APPENDIX No.	Rev.
		F	-



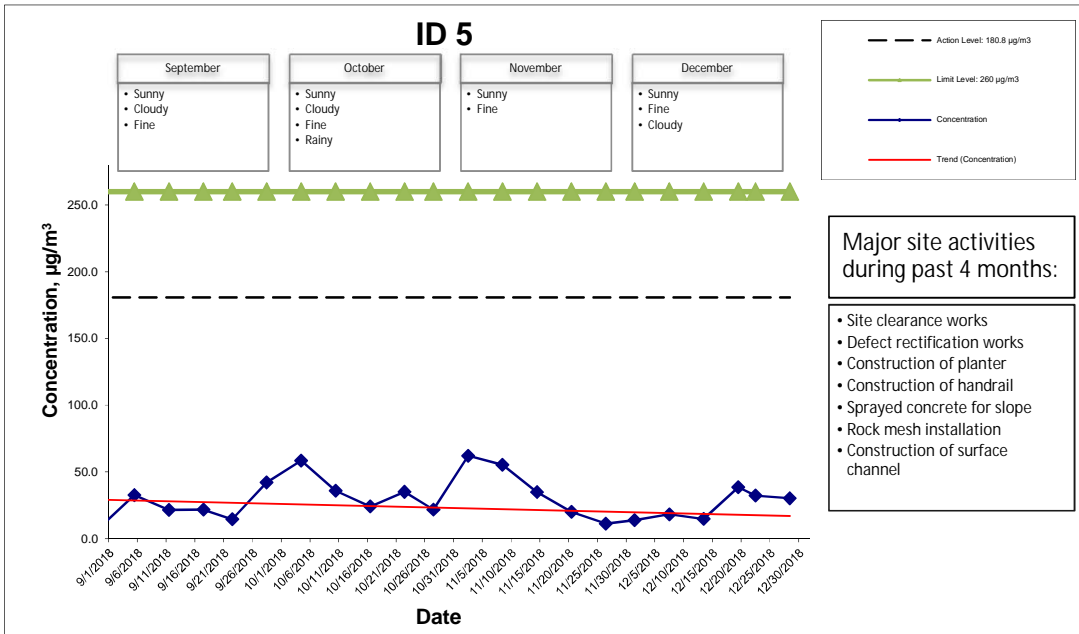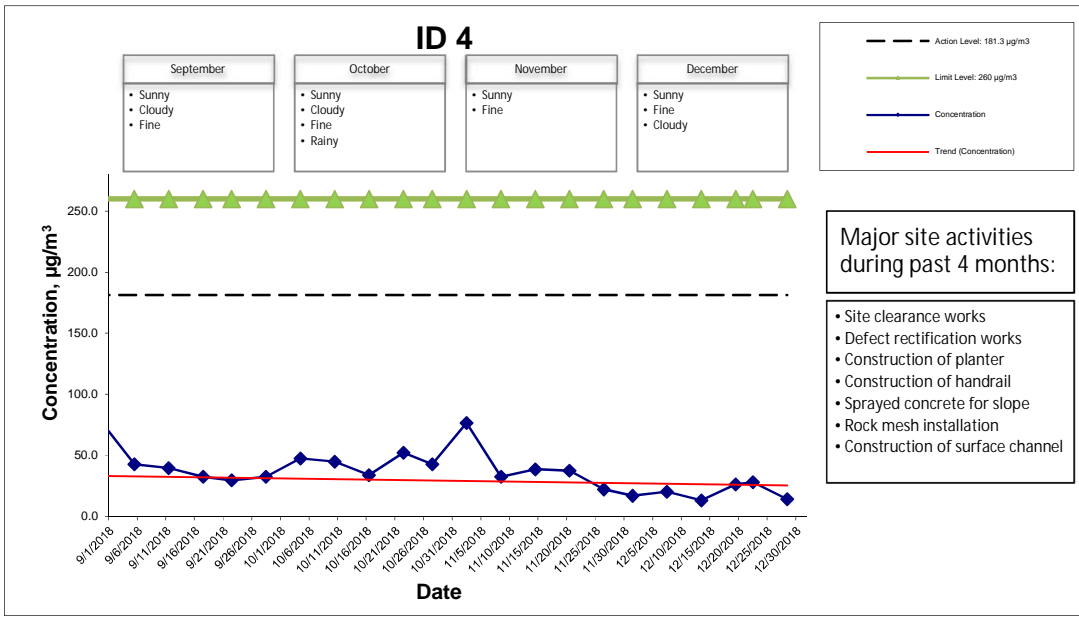


**Development at Anderson Road - Site Formation  
and Associated Infrastructure Works**


**Graphical Presentations of Impact 24-hour TSP  
Monitoring Results**

SCALE	N.T.S.	DATE	Jan-19
CHECK	FYW	DRAWN	DTTW
JOB NO.	60043155	<b>APPENDIX No.</b>	<b>Rev.</b>
		F	-


### ID 1A

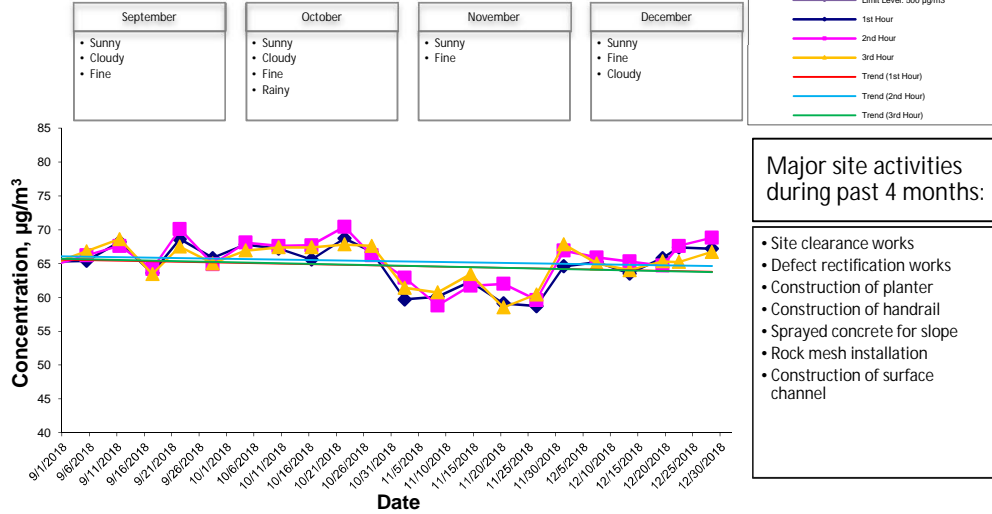

### ID 2

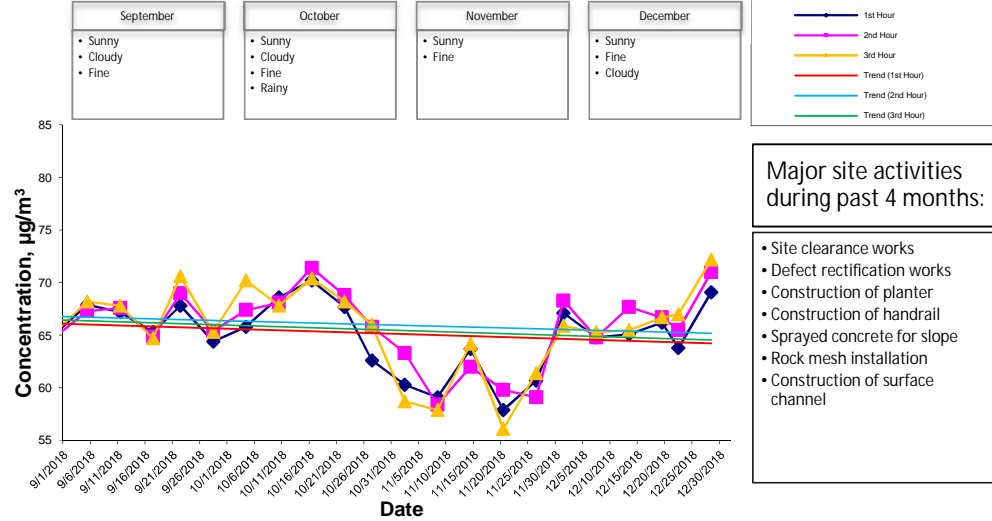

### ID 3

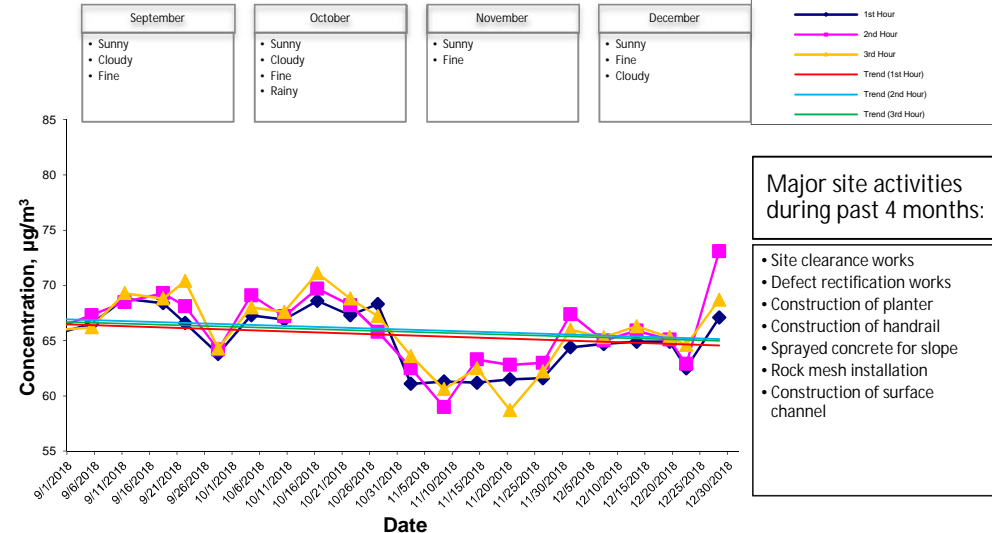

**Development at Anderson Road - Site Formation  
and Associated Infrastructure Works**

**Graphical Presentations of Impact 1-hour TSP  
Monitoring Results**

SCALE	N.T.S.	DATE	Jan-19
CHECK	FYW	DRAWN	DTTW
JOB NO.	60043155	APPENDIX No.	Rev.
		F	-

---

**APPENDIX G**

**Noise Monitoring Results and  
their Graphical Presentations**

---

## Appendix G Noise Monitoring Results

Daytime Noise Monitoring Results at Station ID 1A (Kwun Tong Government Secondary School)

Date	Weather Condition	Noise Level for 30-min, dB(A)*				Baseline Corrected Level, dB(A)	Baseline Noise Level, dB(A)	Limit Level**, dB(A)	Exceedance (Y/N)
		Time	L90	L10	Leq				
7-Dec-18	Cloudy	10:50	62.5	66.3	64.2	63.1	57.8	70	N
13-Dec-18	Fine	10:08	58.0	62.5	60.9	58.0	57.8	70	N
19-Dec-18	Sunny	10:30	63.6	66.5	65.8	65.1	57.8	70	N
28-Dec-18	Sunny	10:00	55.5	59.5	58.8	51.9	57.8	70	N
		Min	55.5	59.5		51.9			
		Max	63.6	66.5		65.1			
		Average	--	--		61.8			

Daytime Noise Monitoring Results at Station ID 2 (On Yat House)

Date	Weather Condition	Noise Level for 30-min, dB(A)*				Baseline Corrected Level, dB(A)	Baseline Noise Level, dB(A)	Limit Level, dB(A)	Exceedance (Y/N)
		Time	L90	L10	Leq				
7-Dec-18	Cloudy	11:30	61.8	64.6	63.9	59.4	62.0	75	N
13-Dec-18	Fine	13:10	58.3	63.0	61.6	61.6	62.0	75	N
19-Dec-18	Sunny	11:15	61.7	64.9	63.2	57.0	62.0	75	N
28-Dec-18	Sunny	10:15	59.5	65.5	64.7	61.4	62.0	75	N
		Min	58.3	63.0		57.0			
		Max	61.8	65.5		61.6			
		Average	--	--		60.2			

Daytime Noise Monitoring Results at Station ID 3 (Sau Nga House)

Date	Weather Condition	Noise Level for 30-min, dB(A)*				Baseline Corrected Level, dB(A)	Baseline Noise Level, dB(A)	Limit Level, dB(A)	Exceedance (Y/N)
		Time	L90	L10	Leq				
7-Dec-18	Cloudy	13:35	56.5	60.4	58.9	58.9	64.1	75	N
13-Dec-18	Fine	14:02	60.0	65.0	63.3	63.3	64.1	75	N
19-Dec-18	Sunny	13:30	60.5	63.6	62.0	62.0	64.1	75	N
28-Dec-18	Sunny	10:55	60.5	68.0	67.1	64.1	64.1	75	N
		Min	56.5	60.4		58.9			
		Max	60.5	68.0		64.1			
		Average	--	--		62.5			

Daytime Noise Monitoring Results at Station ID 4 (Sau Ming Primary School)




Date	Weather Condition	Noise Level for 30-min, dB(A)*				Baseline Corrected Level, dB(A)	Baseline Noise Level, dB(A)	Limit Level**, dB(A)	Exceedance (Y/N)
		Time	L90	L10	Leq				
7-Dec-18	Cloudy	14:15	60.4	63.6	61.3	61.3	65.7	70	N
13-Dec-18	Fine	14:49	60.5	65.5	63.9	63.9	65.7	70	N
19-Dec-18	Sunny	14:15	61.0	64.2	62.9	62.9	65.7	70	N
28-Dec-18	Sunny	11:15	62.0	69.5	66.4	58.1	65.7	70	N
		Min	60.4	63.6		58.1			
		Max	62.0	69.5		63.9			
		Average	--	--		62.0			

Daytime Noise Monitoring Results at Station ID 5 (Sau Mau Ping Catholic Primary School)



Date	Weather Condition	Noise Level for 30-min, dB(A)*				Baseline Corrected Level, dB(A)	Baseline Noise Level, dB(A)	Limit Level**, dB(A)	Exceedance (Y/N)
		Time	L90	L10	Leq				
7-Dec-18	Cloudy	15:00	62.3	65.2	63.6	63.6	64.7	70	N
13-Dec-18	Fine	15:37	63.7	66.8	65.2	55.6	64.7	70	N
19-Dec-18	Sunny	15:00	62.3	65.4	64.2	64.2	64.7	70	N
28-Dec-18	Sunny	13:05	63.5	60.5	59.5	59.5	64.7	70	N
		Min	62.3	60.5		55.6			
		Max	63.7	66.8		64.2			
		Average	--	--		61.9			

\* - Façade measurement

\*\* - Limit Level of 70dB(A) applies to education institutes while 65dB(A) applies during school examination period.

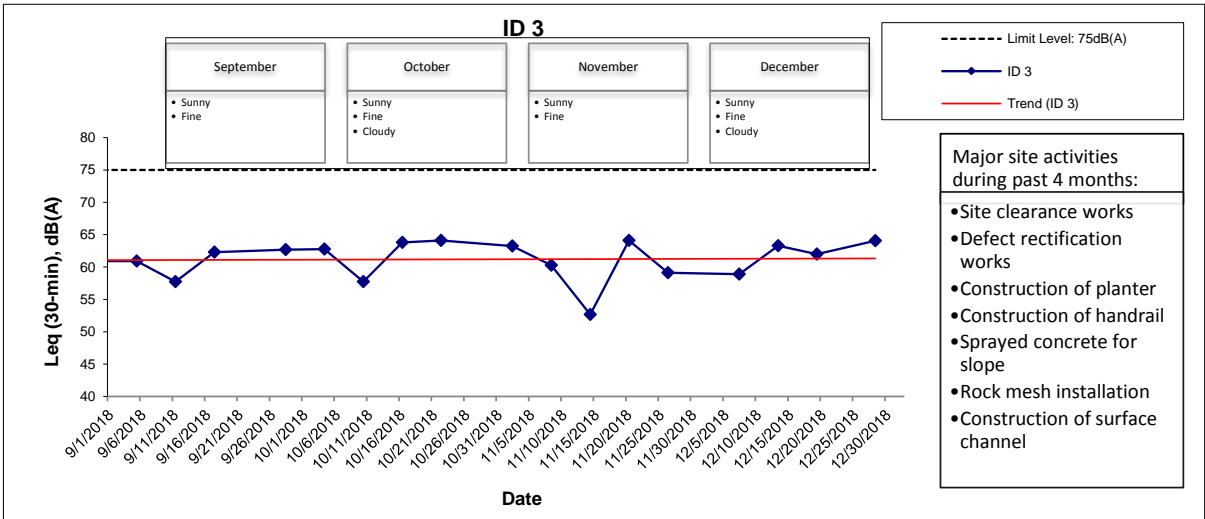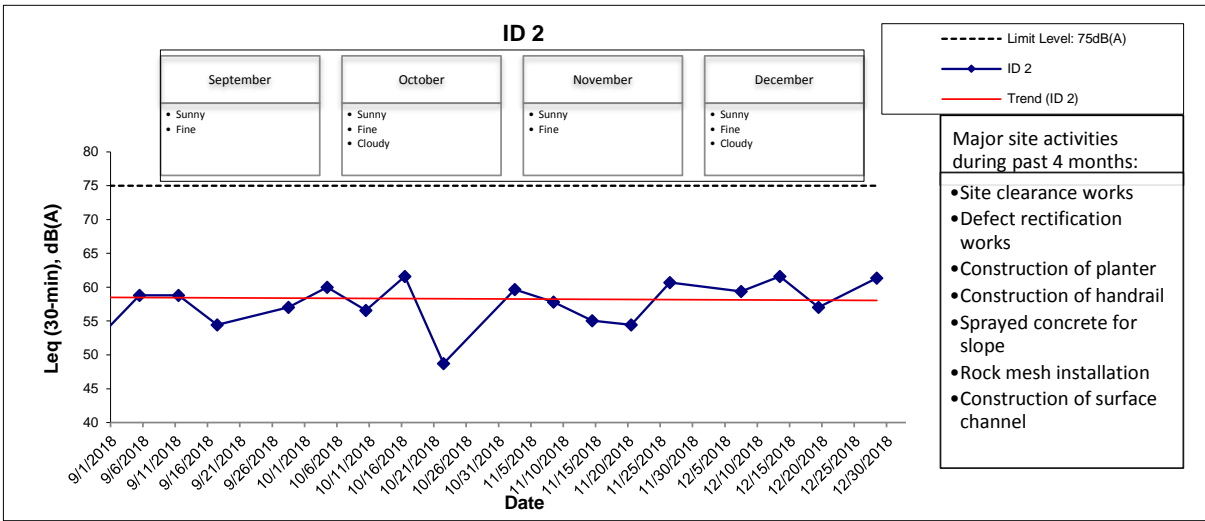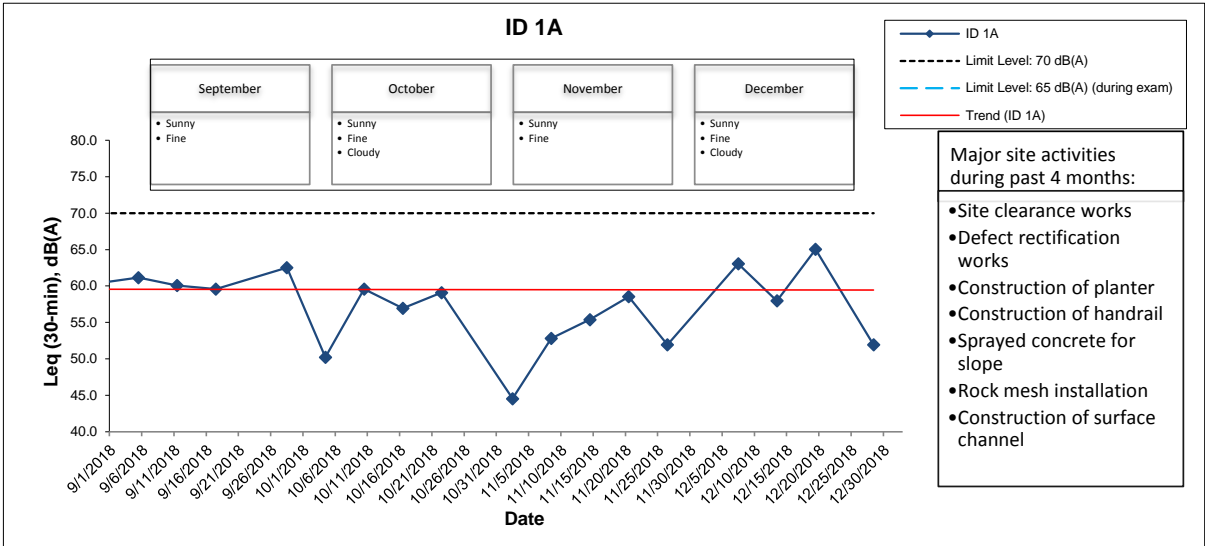

	<b>Development at Anderson Road - Site Formation and Associated Infrastructure Works</b>		SCALE	N.T.S.	DATE	Nov-18
	<b>Graphical Presentations of Noise Monitoring Results</b>		CHECK	FYW	DRAWN	DTTW
			JOB NO.	60043155	APPENDIX	G

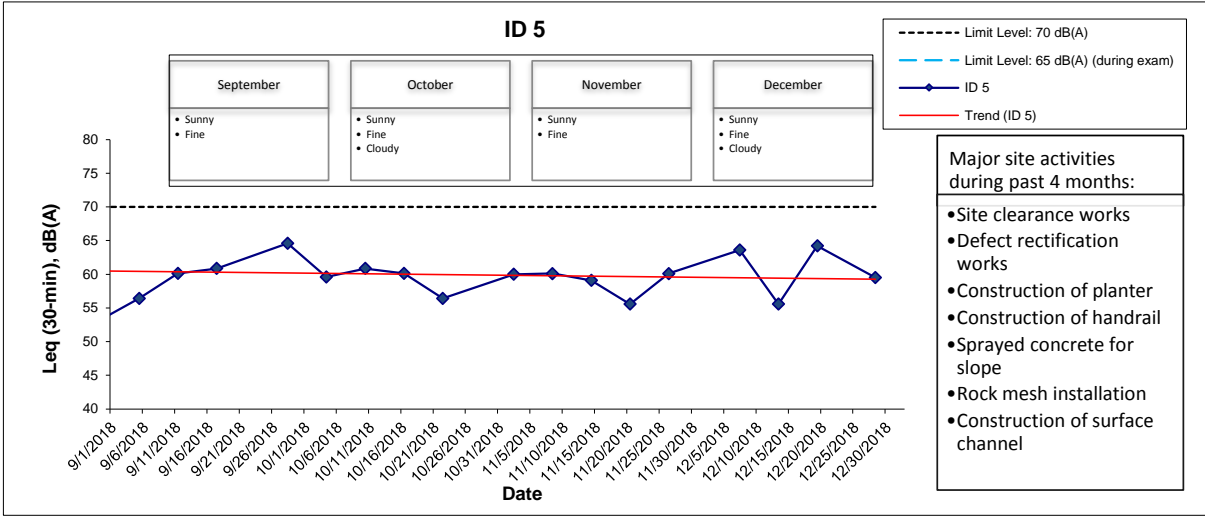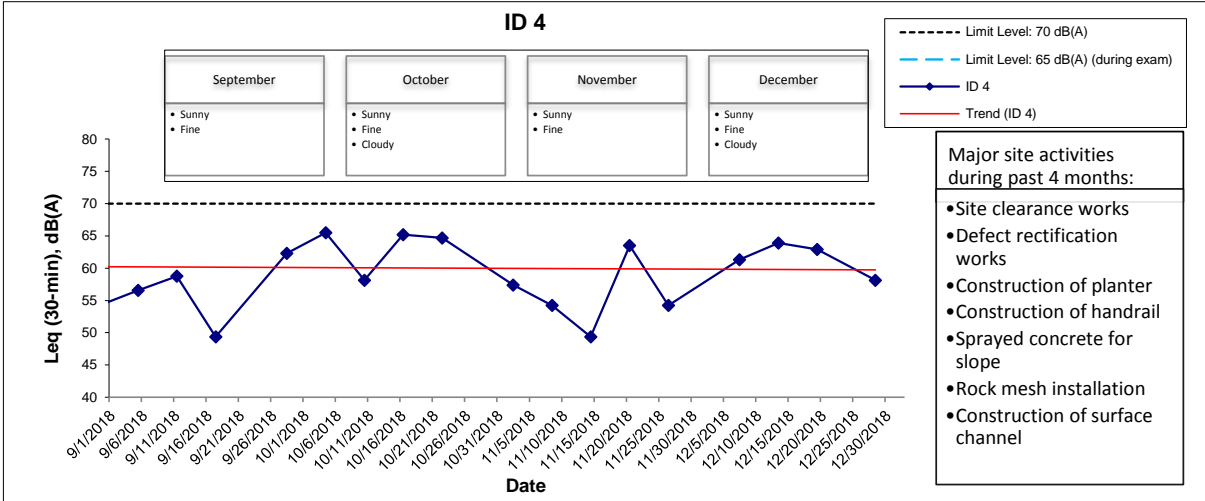

**Development at Anderson Road - Site Formation and Associated Infrastructure Works**

**Graphical Presentations of Noise Monitoring Results**

SCALE	N.T.S.	DATE	Jan-19
CHECK	FYW	DRAWN	DTTW
JOB NO.	60043155	APPENDIX	Rev
		G	-

---

**APPENDIX H**

**Meteorological Data for the Reporting Month**

---

[Home](#)[What's new](#)[About us](#)[HKO Side Lights](#)[Our Services](#)[Visitors Figures](#)[Press releases](#)[Weather Note \(Chinese\)](#)[Weather Warning](#)[Local Weather](#)[Observations](#)[Weather Forecast](#)[Weather Monitoring](#)[Imagery](#)[Computer Forecast](#)[Products](#)[MyObservatory](#)[Met on Map](#)[Tropical Cyclones](#)[Aviation Weather](#)[Services](#)[Marine Meteorological](#)[Services](#)[Weather Information for](#)[Sports](#)[Weather Information for](#)[Communities](#)[China Weather](#)[World Weather](#)[Climatological Information  
Services](#)[> Climate Watch](#)[> Climate Statistics](#)[> Climate Prediction](#)[> Climate Knowledge](#)[> Need More](#)[Information?](#)[> Global Climate](#)[Services](#)[> Other Useful Links](#)[Climate Forecast](#)[Climate Change](#)[El Nino and La Nina](#)[Earthquakes and](#)[Tsunamis](#)[Astronomy, Space](#)[Weather and](#)[Geomagnetism](#)[Time and Calendar](#)[Back](#)

## Daily Extract of Meteorological Observations , December 2018

Year  Month  

Day	Hong Kong Observatory								King's Park	Waglan Island <sup>^</sup>	
	Mean Pressure (hPa)	Air Temperature			Mean Dew Point (deg. C)	Mean Relative Humidity (%)	Mean Amount of Cloud (%)	Total Rainfall (mm)	Total Bright Sunshine (hours)	Prevailing Wind Direction (degrees)	Mean Wind Speed (km/h)
		Absolute Daily Max (deg. C)	Mean (deg. C)	Absolute Daily Min (deg. C)							
01	1018.3	24.2	22.1	21.1	18.1	78	56	0.0	6.2	***	***
02	1016.4	24.3	22.4	21.2	19.3	83	51	0.0	9.3	***	***
03	1016.5	26.0	23.7	22.0	19.8	79	58	0.0	7.2	***	***
04	1016.0	27.1	24.8	22.7	20.6	78	58	0.0	9.1	***	***
05	1015.5	24.8	23.6	22.5	20.3	82	82	Trace	0.6	***	***
06	1015.5	25.1	23.3	21.6	20.4	84	83	0.1	2.0	***	***
07	1018.5	23.3	21.1	18.5	19.1	88	90	1.0	0.0	***	***
08	1021.6	19.7	18.0	16.7	13.7	76	88	0.0	0.2	***	***
09	1021.5	18.3	17.0	16.4	12.6	75	90	Trace	0.5	***	***
10	1019.7	18.3	17.0	15.1	12.6	75	88	0.2	0.1	***	***
11	1020.3	20.4	18.0	16.5	12.0	68	84	Trace	4.9	***	***
12	1024.2	16.5	14.9	13.7	8.9	67	84	0.0	0.0	***	***
13	1025.1	18.1	15.6	13.5	9.6	68	86	0.0	2.6	***	***
14	1025.3	18.2	16.8	15.5	11.7	72	88	0.0	0.0	***	***
15	1023.5	21.2	18.9	17.2	14.3	75	64	0.0	6.6	***	***
16	1022.0	20.9	19.3	18.0	14.6	74	88	Trace	1.2	***	***
17	1022.2	21.0	18.0	15.6	9.1	56	38	0.0	8.4	***	***
18	1022.2	20.2	18.1	16.2	10.1	60	38	0.0	8.5	***	***
19	1019.5	21.5	19.9	18.5	16.0	78	78	0.0	6.4	***	***
20	1016.5	23.2	21.6	20.1	18.8	84	80	0.0	2.0	***	***
21	1016.1	25.0	22.4	21.4	19.9	86	68	0.0	8.7	***	***
22	1017.0	25.2	22.2	20.0	18.0	77	66	0.0	7.1	***	***
23	1017.6	22.5	20.1	17.5	18.2	89	96	10.5	0.0	***	***
24	1017.5	19.0	18.0	16.8	15.6	86	99	0.1	0.0	***	***
25	1015.5	21.1	19.7	18.5	16.3	81	90	0.0	0.1	***	***
26	1014.3	23.6	20.9	18.7	18.0	84	27	0.0	9.4	***	***
27	1016.6	22.8	20.6	18.9	16.7	79	77	Trace	3.5	***	***
28	1021.6	20.2	18.1	16.3	12.6	70	79	Trace	6.8	***	***
29	1026.1	16.3	14.0	12.5	8.2	68	87	Trace	0.6	***	***
30	1026.5	15.4	12.6	10.3	6.7	67	83	Trace	5.6	***	***
31	1027.0	15.6	13.2	11.8	7.4	68	77	0.0	4.4	***	***
Mean/Total	1019.9	21.3	19.2	17.6	14.8	76	75	11.9	122.0	***	***
Normal <sup>§</sup>	1020.5	20.2	17.9	15.9	11.9	69	52	26.8	172.2	070	26.0

\*\*\* unavailable

<sup>^</sup> Information of wind direction and wind speed for Waglan Island are based on automatic weather station data since January 1989

Trace means rainfall less than 0.05 mm

<sup>§</sup> 1981-2010 Climatological Normal, unless otherwise specified



Radiation Monitoring,  
Assessment and  
Protection

Educational Resources

---

Publications

---

Media and Information  
Services

---

Audio/Video Webpage

---

Electronic services

World Meteorological  
Organization-Official City  
Weather Forecasts

---

World Meteorological Day

---

Severe Weather  
Information Centre 2.0

---

World Meteorological  
Organization-Global  
Severe Weather

Public forms

---

Contact & Support

---

Access to information

---

Tender notices

---

Links

---

Important notices

---

Personalized Website

---

Mobile Version

---

RSS Feeds

---

Text Only Version

---

Back



---

**APPENDIX I**

**Event Action Plan**

---

## Appendix I – Event Action Plan

### Event and Action Plan for Air Quality

Event	ACTION			
	ET	IC(E)	ER	Contractor
<b>ACTION LEVEL</b>				
Exceedance for one sample	<ol style="list-style-type: none"> <li>1. Identify source</li> <li>2. Inform IC(E) and ER.</li> <li>3. Repeat measurement to confirm finding.</li> <li>4. Increase monitoring frequency to daily</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET.</li> <li>2. Check Contractor's working method.</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify Contractor.</li> </ol>	<ol style="list-style-type: none"> <li>1. Rectify any unacceptable practice.</li> <li>2. Amend working methods if appropriate.</li> </ol>
Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> <li>1. Identify source.</li> <li>2. Inform IC(E) and ER.</li> <li>3. Repeat measurements to confirm findings.</li> <li>4. Increase monitoring frequency to daily.</li> <li>5. Discuss with IC(E) and Contractor for remedial actions required.</li> <li>6. If exceedance continues, arrange meeting with IC(E) and ER.</li> <li>7. If exceedance stops, cease additional monitoring.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET.</li> <li>2. Check Contractor's working method.</li> <li>3. Discuss with ET and Contractor on possible remedial measures.</li> <li>4. Advise ER on the effectiveness of proposed remedial measures.</li> <li>5. Supervise implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify Contractor.</li> <li>3. Ensure remedial actions properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Submit proposal for remedial actions to IC(E) within 3 working days of notification.</li> <li>2. Implement the agreed proposals.</li> <li>3. Amend proposal if appropriate.</li> </ol>

## Event and Action Plan for Air Quality

Event	ACTION			
	ET	IC(E)	ER	Contractor
<b>LIMIT LEVEL</b>				
Exceedance for one sample	<ol style="list-style-type: none"> <li>1. Identify source.</li> <li>2. Inform ER and EPD.</li> <li>3. Repeat measurement to confirm finding.</li> <li>4. Increase monitoring frequency to daily.</li> <li>5. Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET.</li> <li>2. Check Contractor's working method.</li> <li>3. Discuss with ET and Contractor on possible remedial measures.</li> <li>4. Advise ER on the effectiveness of proposed remedial measures.</li> <li>5. Supervise implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify Contractor.</li> <li>3. Ensure remedial actions properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance.</li> <li>2. Submit proposals for remedial actions to IC(E) within 3 working days of notification.</li> <li>3. Implement the agreed proposals</li> <li>4. Amend proposal if appropriate.</li> </ol>
Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> <li>1. Identify source.</li> <li>2. Inform ER and EPD.</li> <li>3. Repeat measurements to confirm finding.</li> <li>4. Increase monitoring frequency to daily.</li> <li>5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented.</li> <li>6. Arrange meeting with IC(E) and ER to discuss the remedial actions to be taken.</li> <li>7. Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results.</li> <li>8. If exceedance stops, cease additional monitoring.</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss amongst ER, ET and Contractor on the potential remedial actions.</li> <li>2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise ER accordingly.</li> <li>3. Supervise implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify Contractor.</li> <li>3. In consultation with IC(E), agree with Contractor on the remedial measures to be implemented.</li> <li>4. Ensure remedial measures properly implemented.</li> <li>5. If exceedance continues, consider what portion of the work is responsible and instruct Contractor to stop the portion of work until the exceedance is abated.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance.</li> <li>2. Submit proposals for remedial actions to IC(E) within 3 working days of notification.</li> <li>3. Implement the agreed proposals.</li> <li>4. Amend proposal if appropriate.</li> </ol>

## Event and Action Plan for Noise

Event	Action			
	ET	IC(E)	ER	Contractor
1.Exceedance for Action Level	<ol style="list-style-type: none"> <li>1. Notify IC(E) and Contractor.</li> <li>2. Carry out investigation.</li> <li>3. Report the results of investigation to IC(E) and Contractor.</li> <li>4. Discuss with Contractor and formulate remedial measures.</li> <li>5. Increase monitoring frequency to check mitigation effectiveness.</li> </ol>	<ol style="list-style-type: none"> <li>1. Review the analysed results submitted by ET.</li> <li>2. Review the proposed remedial measures by the Contractor and advise ER accordingly.</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify Contractor.</li> <li>3. Require Contractor to propose remedial measures for the analysed noise problem.</li> <li>4. Ensure remedial measures are properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Submit noise mitigation proposals to IC(E).</li> <li>2. Implement noise mitigation proposals.</li> </ol>
1.Exceedance for Limit Level	<ol style="list-style-type: none"> <li>1. Notify IC(E), ER, EPD and Contractor.</li> <li>2. Identify sources.</li> <li>3. Repeat measurements to confirm finding.</li> <li>4. Increase monitoring frequency.</li> <li>5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented.</li> <li>6. Inform IC(E), ER and EPD the causes and actions taken for the exceedance.</li> <li>7. Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results.</li> <li>8. If exceedance stops, cease additional monitoring.</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss amongst ER, ET and Contractor on the potential remedial actions.</li> <li>2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise ER accordingly.</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify Contractor.</li> <li>3. Require Contractor to propose remedial measures for the analysed noise problem.</li> <li>4. Ensure remedial measures are properly implemented</li> <li>5. If exceedance continues, consider what portion of the work is responsible and instruct Contractor to stop that portion of work until the exceedance is abated.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance.</li> <li>2. Submit proposals for remedial actions to IC(E) within 3 working days of notification.</li> <li>3. Implement the agreed proposals.</li> <li>4. Resubmit proposals if problem still not under control.</li> <li>5. Stop the relevant portion of works as determined by ER until the exceedance is abated.</li> </ol>

---

**APPENDIX J**

**Cumulative Statistics of Exceedances, Complaints,  
Notification of Summons and Successful Prosecutions**

---

## Appendix J - Cumulative Statistics on Exceedances, Complaints, Notification of Summons and Successful Prosecutions

### Cumulative statistics on Exceedances

		Total no. recorded in this month	Total no. recorded since project commencement
<b>1-Hour TSP</b>	Action	-	-
	Limit	-	-
<b>24-Hour TSP</b>	Action	-	17
	Limit	-	1
<b>Noise</b>	Action	-	32
	Limit	-	1



**Cumulative statistics on Complaints, Notifications of Summons and Successful Prosecutions**

	<b>Date Received</b>	<b>Subject</b>	<b>Status</b>	<b>Total no. recorded in this month</b>	<b>Total no. recorded since project commencement</b>
<b>Environmental complaints</b>	-	-	-	-	75
<b>Notification of summons</b>	-	-	-	-	6
<b>Successful Prosecutions</b>	-	-	-	-	2