

15 January 2016

By Fax (3767 5922) and By Post

ARUP
Level 5, Festival Walk
80 Tat Chee Avenue
Kowloon Tong, Kowloon

Attention: Mr. Colin Meadows / Mr. Michael Chan

Dear Sirs,

**Re: Agreement No. CE 48/2011 (EP)
Environmental Project Office for the
HZMB Hong Kong Link Road, HZMB Hong Kong Boundary Crossing
Facilities, and Tuen Mun-Chek Lap Kok Link – Investigation**


**Contract No. HY/2011/09 HZMB Hong Kong Link Road –
Section between HKSAR Boundary and Scenic Hill
Revised Monthly EM&A Report for December 2015 (EP-352/2009/D)**

Reference is made to the captioned Report (Version 2.0) certified by the Environmental Team Leader (ETL) received on 15 January 2016.

We have no adverse comments on the captioned Report and verify it in accordance with Condition 4.4 of EP-352/2009/D.

Thank you for your kind attention. Please do not hesitate to contact the undersigned or the ENPO Leader, Mr. Y H Hui, should you have any queries.

Yours sincerely,
For and on behalf of
Ramboll Environ Hong Kong Limited

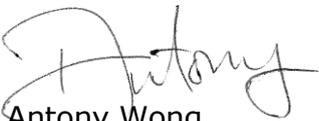

Antony Wong
Independent Environmental Checker
Hong Kong Link Road

c.c.	HyD	Mr. Matthew Fung	(By Fax: 3188 6614)
	HyD	Mr. K Y Yung	(By Fax: 3188 6614)
	ARUP	Mr. Eric Chan	(By Fax: 2268 3970)
	Cinotech	Dr. Priscilla Choy	(By Fax: 3107 1388)
	DCVJV	Mr. Chu Chung Sing	(By Fax: 3121 6688)

Internal: DY, YH, CL, LP, ENPO Site

Q:\Projects\HYDHZMBEEM00\02_Proj_Mgt\02_Corr\HYDHZMBEEM00_0_3766L.16.doc

Dragages -China Harbour-VSL JV

Contract HY/2011/09
Hong Kong-Zhuhai-Macao Bridge
Hong Kong Link Road-Section between
HKSAR Boundary and Scenic Hill

Monthly EM&A Report

December 2015
(Version 2.0)

Certified By 
Dr. Priscilla Choy
Environmental Team Leader
(Date: 14 January 2016)

REMARKS:

The information supplied and contained within this report is, to the best of our knowledge, correct at the time of printing.

CINOTECH accepts no responsibility for changes made to this report by third parties

CINOTECH CONSULTANTS LTD
Room 1710, Technology Park,
18 On Lai Street,
Shatin, NT, Hong Kong
Tel: (852) 2151 2083 Fax: (852) 3107 1388
Email: info@cinotech.com.hk

TABLE OF CONTENTS

	Page
EXECUTIVE SUMMARY	1
Introduction	1
Environmental Monitoring and Audit Progress	1
Breaches of Action and Limit Levels	2
Future Key Issues	3
1 INTRODUCTION	5
Purpose of the report	5
Structure of the report.....	5
2 CONTRACT INFORMATION	7
Background	7
Contract Organisation.....	8
Construction Programme.....	9
Summary of Construction Works Undertaken During Reporting Month	9
Status of Environmental Licences, Notification and Permits.....	13
3 AIR QUALITY MONITORING	15
Monitoring Requirements.....	15
Monitoring Location.....	15
Monitoring Equipment	15
Monitoring Parameters, Frequency and Duration	15
Monitoring Methodology and QA/QC Procedure.....	16
1-hour and 24-hour TSP Air Quality Monitoring	16
<i>Instrumentation</i>	16
<i>HVS Installation</i>	16
<i>Filters Preparation</i>	16
<i>Operating/Analytical Procedures</i>	16
Results and Observations	17
Event and Action Plan	18
4 NOISE MONITORING	19
Monitoring Requirements.....	19
Monitoring Location.....	19
Monitoring Equipment	19
Monitoring Parameters, Frequency and Duration	19
Monitoring Methodology and QA/QC Procedures	20
<i>Maintenance and Calibration</i>	20
Results and Observations	20
Event and Action Plan.....	21
5 WATER QUALITY MONITORING.....	22
Monitoring Requirements.....	22
Monitoring Locations	22
Monitoring Equipment	23
Monitoring Parameters, Frequency	25
Monitoring Methodology	25
<i>Instrumentation</i>	25
<i>Operating/Analytical Procedures</i>	25
<i>Laboratory Analytical Methods</i>	26

<i>QA/QC Requirements</i>	26
<i>Maintenance and Calibration</i>	27
Results and Observations	27
Event and Action Plan	28
6 DOLPHIN-RELATED MONITORING	29
Monitoring Requirements.....	29
DOLPHIN MONITORING (LINE-TRANSECT VESSEL SURVEY)	29
Monitoring Requirements.....	29
Monitoring Location.....	29
Monitoring Frequency	30
Monitoring Day	30
Monitoring Results	30
ADDITIONAL LAND-BASED DOLPHIN BEHAVIOUR AND MOVEMENT MONITORING	31
7 ENVIRONMENTAL SITE INSPECTION	32
Site Audits	32
Implementation Status of Environmental Mitigation Measures.....	32
Advice on the Solid and Liquid Waste Management Status	36
8 ENVIRONMENTAL NON-CONFORMANCE (EXCEEDANCES)	37
Summary of Exceedances	37
Summary of Notification of Summons and Successful Prosecution.....	37
9 FUTURE KEY ISSUES	38
Key Issues in the Coming Month	38
Monitoring Schedule for the Next Month	39
Construction Programme for the Next Month.....	39
10 CONCLUSIONS AND RECOMMENDATIONS	40
Conclusions	40
Recommendations	41

LIST OF TABLES

Table I	Summary Table for Monitoring Activities in the Reporting Month
Table II	Summary Table for Events Recorded in the Reporting Month
Table 2.1	Key Contacts of the Contract
Table 2.2	Status of Environmental Licences, Notification and Permits
Table 3.1	Location for Air Quality Monitoring Locations
Table 3.2	Air Quality Monitoring Equipment
Table 3.3	Impact Dust Monitoring Parameters, Frequency and Duration
Table 3.4	Summary Table of 1-hour TSP Monitoring Results during the Reporting Month
Table 3.5	Summary Table of 24-hour TSP Monitoring Results during the Reporting Month
Table 3.6	Observation at Dust Monitoring Stations
Table 4.1	Location for Noise Monitoring Locations
Table 4.2	Noise Monitoring Equipment
Table 4.3	Noise Monitoring Parameters, Frequency and Duration
Table 4.4	Summary Table of Noise Monitoring Results during the Reporting Month
Table 4.5	Observation at Noise Monitoring Stations
Table 5.1	Location for Marine Water Quality Monitoring Locations
Table 5.2	Water Quality Monitoring Equipment
Table 5.3	Water Quality Monitoring Parameters and Frequency
Table 5.4	Methods for Laboratory Analysis for Water Samples
Table 5.5	Summary of Water Quality Exceedances
Table 6.1	Co-ordinates of transect lines in WL survey area
Table 6.2	Dolphin encounter rates (sightings per 100 km of survey effort) in December's surveys
Table 6.3	Progress Record of Additional Land-based Dolphin Behaviour and Movement Monitoring in December 2015
Table 7.1	Observations and Recommendations of Site Audit

LIST OF FIGURE

Figure 1a-d	Site Layout Plan
Figure 2	Project Organisation for Environmental Works
Figure 3	Locations of Air Quality, Noise and Wind Monitoring Stations
Figure 4	Locations of Water Quality Monitoring Stations

LIST OF APPENDICES

Appendix A	Construction Programme
Appendix B	Action and Limit Levels
Appendix C	Copies of Calibration Certificates
Appendix D	Environmental Monitoring Schedules
Appendix E	1-hour TSP Monitoring Results
Appendix F	24-hour TSP Monitoring Results
Appendix G	Noise Monitoring Results
Appendix H	Water Quality Monitoring Results
Appendix I	Dolphin Monitoring Report (Line Transect)
Appendix J	Wind Data
Appendix K	Event Action Plans
Appendix L	Summary of Exceedance
Appendix M	Site Audit Summary
Appendix N	Updated Environmental Mitigation Implementation Schedule
Appendix O	Waste Generation in the Reporting Month
Appendix P	Complaint Log
Appendix Q	Summary of Successful Prosecutions

EXECUTIVE SUMMARY

Introduction

1. This is the 35th monthly Environmental Monitoring and Audit (EM&A) Report prepared by Cinotech Consultants Limited for the project “Contract No. HY/2011/09 – Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill” (hereinafter called the “Contract”). This report documents the findings of EM&A Works conducted in December 2015.

Environmental Monitoring and Audit Progress

2. A summary of the monitoring activities in this reporting month is listed in **Table I** below:

Table I Summary Table for Monitoring Activities in the Reporting Month

Parameter(s)	Date(s)
1-hr TSP Monitoring	3 rd , 9 th , 15 th , 21 st , 25 th and 31 st December 2015
24-hr TSP Monitoring	3 rd , 9 th , 15 th , 21 st , 25 th and 31 st December 2015
Noise Monitoring	4 th , 10 th , 16 th , 22 nd and 28 th December 2015
Water Quality Monitoring	2 nd , 4 th , 7 th , 9 th , 11 th , 14 th , 16 th , 18 th , 21 st , 23 rd , 25 th , 28 th and 30 th December 2015
Dolphin Monitoring (Line-transect Vessel Surveys)	3 rd and 10 th December 2015
Additional Land-based Dolphin Behaviour and Movement Monitoring	1 st and 8 th December 2015
Environmental Site Inspection	1 st , 10 th , 15 th , 23 rd and 29 th December 2015
Archaeological Site Inspection	29 th December 2015

Breaches of Action and Limit Levels

3. Summary of the environmental exceedances of the reporting month is tabulated in **Table II**.

Table II Summary Table for Events Recorded in the Reporting Month

Environmental Monitoring	Parameter	No. of Exceedance		Total No. of Exceedance	No. of Exceedance related to the Construction Activities of this Contract		Total No. of Exceedance related to the Construction Activities of this Contract
		Action Level	Limit Level		Action Level	Limit Level	
Air Quality	1-hr TSP	0	0	0	0	0	0
	24-hr TSP	0	0	0	0	0	0
Noise	Leq(30min)	0	0	0	0	0	0
Water Quality	Dissolved Oxygen (DO) (Surface & Middle)	0	0	0	0	0	0
	Dissolved Oxygen (DO) (Bottom)	0	0	0	0	0	0
	Turbidity	0	0	0	0	0	0
	Suspended Solids (SS)	14	0	14	0	0	0

1-hour TSP Monitoring

4. All 1-hour TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

24-hour TSP Monitoring

5. All 24-hour TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Construction Noise

6. All construction noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Water Quality

7. All water quality monitoring was conducted as scheduled in the reporting month. There are fourteen Action Level and no Limit Level exceedances for suspended solids were recorded. No Action/Limit Level exceedance for dissolved oxygen and turbidity were recorded.
8. According to the investigation, no pollution discharge was observed from the site. In addition, adverse water quality outside the site boundary and dispersion of sediment plume to the monitoring stations from the area outside the site boundary (i.e. works area not under and related to HY/2011/09) were observed. Therefore, the exceedances are considered not due to the Contract.

Complaint Log

9. No environmental complaint was received in the reporting month.

Notification of Summons and Successful Prosecutions

10. No notification of summons and successful prosecution was received in the reporting month.

Reporting Changes

11. This report has been developed in compliance with the reporting requirements for the subsequent monthly EM&A Report as required by the EM&A Manual for Hong Kong Link Road (EM&A Manual).

Future Key Issues

12. Major site activities for the coming reporting month will include:

WA4

- Fabrication of lifting frames
- Deliveries of frame structures

WA7

- Fabrication of cofferdam frame structures

Marine Viaduct (P0 to P80)

- Remove rockfill platform for rock breaking for cofferdam installation
- Completed concrete plug, cutting steel casing and blinding concrete
- Enhancement work to cofferdam to improve water tightness
- Pile testing

Pile Cap Construction:

- Installation of precast cap shells
- Concreting
- Kingpost installation and associated steel welding works
- Concreting trimming

Column Construction:

- Lifting works
- Lift concreting
- Pier head works
- Pier head concreting

Precast Column Erection

- Installation of base units and precast units
- Stressing of vertical nailing tendons
- Vertical Tendons Stressed
- Grouting Vertical Tendons
- Pier Head Concrete

Deck Erection

- Setting up of equipment
- Segment erection

Precast Segment

- Segment casting

Land Viaduct (P81 to Abutment at Scenic Hill Tunnel (SHT))

- Commencement of reinstatement works
- Removal of falsework
- Removal of steel bracket system
- Construction of upper bearing plinths

1 INTRODUCTION

- 1.1 Cinotech Consultants Limited (Cinotech) was appointed by Dragages -China Harbour-VSL JV (hereinafter called “the Contractor”) as the Environmental Team (ET) to undertake the Environmental Monitoring and Audit (EM&A) programme during construction phase of the Contract No. HY/2011/09 – Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill” (hereinafter called the “Contract”) in accordance with EP Conditions 2.1.

Purpose of the report

- 1.2 This is the 35th EM&A report which summarises the impact monitoring results and audit findings for the EM&A programme in December 2015.

Structure of the report

- 1.3 The structure of the report is as follows:

Section 1: **Introduction** - purpose and structure of the report.

Section 2: **Contract Information** - summarises background and scope of the Contract, site description, project organization and contact details, construction programme, the construction works undertaken and the status of Environmental Permits/Licenses during the reporting month.

Section 3: **Air Quality Monitoring** - summarises the monitoring parameters, monitoring programmes, monitoring methodologies, monitoring frequency, monitoring locations, Action and Limit Levels, monitoring results and Event / Action Plans.

Section 4: **Noise Monitoring** - summarises the monitoring parameters, monitoring programmes, monitoring methodologies, monitoring frequency, monitoring locations, Action and Limit Levels, monitoring results and Event / Action Plans.

Section 5: **Water Quality Monitoring** - summarises the monitoring parameters, monitoring programmes, monitoring methodologies, monitoring frequency, monitoring locations, Action and Limit Levels, monitoring results and Event / Action Plans.

Section 6: **Dolphin-Related Monitoring** - summarises the monitoring parameters, monitoring programmes, monitoring methodologies, monitoring frequency, monitoring locations and monitoring results.

Section 7: **Environmental Site Inspection** - summarises the audit findings of the weekly site inspections undertaken within the reporting month.

Section 8: **Environmental Non-conformance** - summarises any monitoring exceedance, environmental complaints, environmental summons and successful prosecutions within the reporting month.

Section 9: **Future Key Issues** - summarises the impact forecast and monitoring schedule for the next three months.

Section 10: **Conclusions and Recommendation**

2 CONTRACT INFORMATION

Background

- 2.1 The proposed Hong Kong - Zhuhai - Macao Bridge Hong Kong Link Road (HKLR) is 12km long connecting the Hong Kong-Zhuhai-Macao Bridge (HZMB) at the HKSAR Boundary with the Hong Kong Boundary Crossing Facilities (HKBCF) situated at the north eastern waters of the Hong Kong International Airport, opening a new and direct connection route between Hong Kong, Macao and the Western Pearl River Delta.
- 2.2 The HKLR comprises a 9.4km long viaduct section from the HKSAR boundary to Scenic Hill on the Airport Island; a 1km tunnel section to the reclamation formed along the east coast of the Airport Island and a 1.6km long at-grade road section on the reclamation connecting to the HKBCF. The tunnel section of HKLR will pass under Scenic Hill, Airport Road and Airport Railway to minimize the environmental and visual impacts to Tung Chung residents.
- 2.3 An application (No ESB-110/2003) for an Environmental Impact Assessment (EIA) Study Brief under Section 5(1) of the Environmental Impact Assessment Ordinance (EIAO) was submitted by Highways Department (the Project Proponent) on 8 October 2003 with a Project Profile (No. No. PP-201/2003) for the Hong Kong - Zhuhai - Macao Bridge Hong Kong Section and North Lantau Highway Connection. The Hong Kong - Zhuhai - Macao Bridge Hong Kong Section and North Lantau Highway Connection has subsequently been renamed as HKLR. EPD issued an EIA Study Brief (No: ESB-110/2003) in November 2003 to the Project Proponent to carry out an EIA study.
- 2.4 An EIA Study (Reg. No. AEIAR-144/2009) has been undertaken to provide information on nature and extent of environmental impacts arising from the construction and operation of HKLR. The Environmental Permit was issued on 4 November 2009 (Permit No. EP-352/2009). Pursuant to Section 13 of the EIAO, the Director of Environmental Protection amends the Environmental Permit (No. EP-352/2009) based on the Application No. VEP-339/2011 and the environmental Permit (Permit No. EP-352/2009/A) was issued on 9 November 2011 for HKLR to the Highways Department as the Permit Holder. Subsequently, the Director of Environmental Protection amends the Environmental Permits (No. EP-352/2009/A, EP-352/2009/B, EP-352/2009/C) based on the Application No. VEP-409/2013, VEP-411/2013 and VEP-459/2014 respectively. The environmental Permit (Permit No. EP-352/2009/D) was then issued on 22 December 2014.
- 2.5 **Figure 1a-d** shows the layout of the Contract and the scope of the Contract works comprises the following major items:
 - a dual 3-lane carriageway in the form of viaduct from the HKSAR boundary (connecting with the HZMB Main Bridge) to the Scenic Hill (connecting with the tunnel under separate Contract No. HY/2011/03), of approximately 9.4km in length with a hard shoulder for each bound of carriageway and a utilities trough on the outer edge of each bound of viaducts;
 - a grade-separated turnaround facility located near San Shek Wan, composed of sliproads in the form of viaduct with single-lane carriageway bifurcated from the HKLR mainline with an elevated junction above the mainline;

- provision of ancillary facilities including, but not limited to, meteorological enhancement measures including the provisioning of anemometers and modification of the wind profiler station at hillside of Sha Lo Wan, provisioning of a compensatory marine radar, and provisioning of security systems; and
- associated civil, structural, geotechnical, marine, environmental protection, landscaping, drainage and highways electrical and mechanical (E&M) works, street lightings, traffic aids and sign gantries, marine navigational aids, ship impact protection system, water mains and fire hydrants, lightning protection system, structural health monitoring and maintenance management system (SHM&MMS), supervisory control and data acquisition (SCADA) system, as well as operation and maintenance provisions of viaducts, provisioning of facilities for installation of traffic control and surveillance system (TCSS), provisioning of facilities for installation of telecommunication cables/equipments and reprovisioning works of affected existing facilities/utilities.

Contract Organisation

2.6 Different parties with different levels of involvement in the Contract organization include:

- Supervising Officer’s Representative (SOR) – Ove Arup & Partners Hong Kong Limited (ARUP)
- Contractor –Dragages -China Harbour-VSL JV (DCVJV)
- Environmental Team (ET) – Cinotech Consultants Ltd. (Cinotech)

2.7 The proposed project organization and lines of communication with respect to the on-site environmental management structure are shown in **Figure 2**. The key personnel contact names and numbers are summarized in **Table 2.1**.

Table 2.1 Key Contacts of the Contract

Party	Position	Position	Phone No.	Fax No.
SOR (ARUP)	CRE	Mr. Michael Chan	3767 5803	3767 5922
		Mr. Colin Meadows	3767 5801	
ENPO/IEC (Ramboll Environ)	Environmental Project Office Leader	Mr. Y. H Hui	3465 2888	3465 2899
	Independent Environmental Checker	Mr. Antony Wong	3465 2888	3465 2899
Contractor (DCVJV)	Deputy Project Director	Mr. W.K Poon	3121 6638	3121 6688
	Environmental Officer	Mr. CHU Chung Sing	3121 6672	
	24-hour Hotline	--	6898 6161	--
ET (Cinotech)	Environmental Team Leader	Dr. Priscilla Choy	2151 2089	3107 1388

2.8 Ramboll Environ Hong Kong Limited (Ramboll Environ) is employed by the Highways Department as the Independent Environmental Checker (IEC) and Environmental Project Office (ENPO) for the Project.

Construction Programme

2.9 A copy of Contractor's construction programme is provided in **Appendix A**.

Summary of Construction Works Undertaken During Reporting Month

2.10 The major site activities undertaken in the reporting month included:

Land Viaduct (P85 to Abutment at SHT) & Marine Viaduct (P81 - P84)

- (a) P83R backfilling and removal of wailings and struts are in progress.
- (b) P83L pier head was completed.
- (c) P82R reinstatement works (backfilling and removal of wailings and struts) commenced.
- (d) P82L 4 pours of column was completed.
- (e) P81R removal of cofferdam was completed.
- (f) P81L removal of cofferdam is in progress.
- (g) Portal Works:

Pier Location	Progress
P84	Removal of steel brackets are in progress
P85	Removal of steel bracket system was completed

- (h) Formwork erection and steel fixing for in-situ deck to Scenic Hill Abutment are in progress.

Marine Viaduct (P0 to P80)

Progress at P68, P69 & P75

Pier Location	Progress	
	Right Hand Side (RHS)	Left Hand Side (LHS)
P68	Cofferdam completed; Trimming of concrete pile head completed; Installation of formwork to be started.	Remove rockfill platform for rock breaking for cofferdam installation
P69	Cofferdam completed; Blinding layer completed. Trimming of concrete pile head to be started.	Cofferdam completed; Trimming of concrete pile head in progress
P75	Enhancement work to cofferdam to improve water tightness in progress	Enhancement work to cofferdam to improve water tightness in progress

Pile Cap Construction

- (a) Precast shells installation - all shells erected.

- (b) Stage 1 concreting - D19R-F1 & D20R-F1.
- (c) Stage 2 works - D19R-F1 & D20R-F1.
- (d) Stage 2 concreting - D19R-F1.
- (e) Kingpost installation and associated steel welding works for precast shell installation: all completed.
- (f) Advanced concrete trimming (inside casing) works: all completed.
- (g) Concrete trimming (inside cap shell): all completed.
- (h) Submerged pile cap works with cofferdam (excluded P69 & P75):

Pier Location	Side	Progress	Completed Pile Cap with Cofferdam Backfilled and Removed
P74	L	Concreting works of pile cap completed on 21-Aug-15, pier construction in progress	P70 - P73, P76 - P77
	R	Concreting works of pile cap completed on 29-Sep-15, pier construction in progress	
P78	L	Concreting works of pile cap completed on 24-Jan-15, pier construction in progress	
	R	Concreting works of pile cap completed on 30-Jan-15, pier construction in progress	

In-situ Column (Single) Construction

- (a) 1st lift works is in progress at P5 & P67.
- (b) 1st lift concrete was poured at P5 & P67.
- (c) 2nd lift works is in progress: P56 Ramp.
- (d) 2nd lift concrete pouring: NIL.
- (e) 3rd lift works is in progress at P55 Ramp, P57 Ramp and P74.
- (f) 3rd lift concrete pouring: P55 Ramp, P57 Ramp and P74L.
- (g) Pier head works is in progress: P56, P57 and P78.
- (h) Pier head concrete pouring: NIL.

Precast Column Erection

Description	Pier Location (in this reporting period)	Cumulative No. of Gridline (up to 28th of each month)
Commencement (i.e. starting from 1 st precast unit)	P12	29 (P12 - P16, P21 - P44)
Completion (i.e. completed installation of pier head unit)	P22, P26	27 (P13 - P16, P21, P22, P24 - P44)
Vertical Tendons Stressed	P13, P14	22 (P13, P14, P24, P25, P27 - P44)
Grouting Vertical Tendons	P13, P14, P24	22 (P13, P14, P24, P25, P27 - P44)
Pier Head Concrete	P27 - P28	18 (P27 - P44)

In-situ Double Blade Column Construction

Pier Location	Side	Progress	Completed Columns
P80	L	All casting completed in December 2015, total 3 lifts	P17 - P20 P71 - P73 P76 - P79
	R	All casting completed in December 2015, total 3 lifts	

Deck Erection

(a) Setting up of Equipment:

Type of Equipment	Status
Lifting Frames 1 (LF1)	1 st set loaded on flat barge awaiting for mobilization at P20

(b) Segment erection:

Type	Location of Segments erected in this reporting period	Number of Segments erected in this reporting period	Cumulative No. of Segments erected (up to 28th of each month)
Launching Gantry 1 (LG1)*	P97, P98, P99 and P100	60	554
Launching Gantry 2 (LG2)	P39, P40 and P49	92	412
Hanger Beam (HB)	P20	8	8
Lifting Frames 3 (LF3)	P62,P63,P65,P66	43	166
Typical Span SOP	P36 and P54	8	96
Long Span SOP	P18	4	28

* includes crane erection for P109

Precast Segment

(a) Segment Casting:

- Production affected by inclement weather: 1 days.
- Long span (L/S) segments temporary stored at CCCC4's Machong yard (A4).
- Off yard storage extension (A2 & A3) for typical segments completed.
- Line 1 modification of L/S storage ground beam for MCH1 segment was completed. The corresponding modification of L/S storage ground beam is in progress.
- Additional Line 0 for storage for L/S segments under construction.
- L/S segments of P71 loaded on barges for temporary storage (total 40 L/S segment were stored on 9 barges).

Item	Number in this reporting period	Cumulative No. of Precast Segment Completed (up to 28th of each month)
Segment Cast	145	3164

(b) Off-site Storage:

Area	No. in Off-site Storage
A1	0
A2	384
A3	222
A4	116(L/S) & 38(D)

Delivery for Precast Concrete Elements (by barge)

(a) Precast Deck Segments:

- Number of additional barges engaged in this period: 0.
- Number of deck segment deliveries in this period: 58 trips.
- Cumulative number of deck segment deliveries: 293 trips.

Segment Types	Segment Delivered in this reporting period	Cumulative No. of Precast Segment Delivered (up to 28th of each month)
A	195	723
B	0	0
C	10	38
D	19	49
E	74	586

(a) Precast column units:

- Number of additional barges engaged in this period: 0
- Cumulative number of barges: 1
- Number of column unit deliveries in this period: 2 trips
- Cumulative number of column unit deliveries: 46 trips

Unit Types	Number of units delivered in this reporting period	Cumulative No. of Precast Column Delivered (up to 28th of month)
3m	0	27
6m	10	142
PH1	2	34
PH2	0	20

(b) Temporary storage of long span segments:

- First two long span barges sent to Hong Kong P20-S1 & P20-S2.
- 7 barges remain at Zhongshan port loaded with long span segments.
- Two barges have been loaded with Long Span P71-S6 & P71-S7 for storage on pilecap in site.

Status of Environmental Licences, Notification and Permits

2.11 A summary of the relevant permits, licences, and/or notifications on environmental protection for this Contract is presented in **Table 2.2**.

Table 2.2 Status of Environmental Licences, Notification and Permits

Permit / License No.	Valid Period		Status
	From	To	
Environmental Permit (EP)			
EP-352/2009/D	22/12/2014	N/A	Valid
Construction Noise Permit (CNP)			
P81 – 83: GW-RS0814-15	30/07/2015(19:00)	29/01/2016(24:00)	Valid
P75 – 80: GW-RS0829-15	30 /07/2015(19:00)	31/12/2015(24:00)	Valid
Portion A: GW-RS0884-15	23/08/2015 (07:00)	22/02/2016 (23:00)	Valid
P69 – P74: GW-RS0967-15	08/09/2015(19:00)	07/03/2016(24:00)	Valid
P0 – P68: GW-RS1075-15	06/10/2015(19:00)	05/04/2016(24:00)	Cancelled on 10 December 2015
P101 – P114: GW-RS1092-15	19/10/2015(19:00)	31/12/2015(05:30)	Valid
P81 – P115: GW-RS1308-15	24/11/2015(19:00)	23/05/2016(24:00)	Valid
P0 – P68: GW-RS1345-15	10/12/2015(19:00)	09/06/2016(24:00)	Valid
P101 – P114: GW-RS1343-15	31/12/2015(19:00)	30/06/2016(05:30)	Valid
Notification pursuant to Air Pollution Control (Construction Dust) Regulation			
345773	04/06/2012	N/A	Receipt acknowledged by EPD
Billing Account for Construction Waste Disposal			
A/C# 7015341 (Construction Site)	11/06/2012	N/A	Valid
A/C# 7016948 (Vessel Disposal)	23/11/2015	29/02/2016	Valid
Registration of Chemical Waste Producer			
WPN 5213-951-D2499-01	18/07/2012	N/A	Valid
Effluent Discharge License under Water Pollution Control Ordinance			
WA6A(DCVJV site office): WT00014053-2012	12/09/2012	30/09/2017	Valid
WA6B (SOR site office): WT00014447-2012	30/10/2012	31/10/2017	Valid
WA3: WT00015118-2013	30/01/2013	31/01/2018	Valid

Permit / License No.	Valid Period		Status
	From	To	
<u>Portion C:</u> WT00015356-2013	22/02/2013	28/02/2018	Valid
<u>Portion A:</u> WT00016076-2013	21/05/2013	31/05/2018	Valid
<u>WA4B:</u> WT00014750-2012	12/08/2013	31/08/2018	Valid
<u>WA7:</u> WT00015722-2013	16/01/2013	31/01/2019	Valid
<u>P0 – P80:</u> WT00018203-2014	30/01/2013	31/01/2019	Valid
<u>P114:</u> WT00018631-2014	31/03/2014	31/03/2019	Valid
<u>P81-P83:</u> WT00021946-2015	08/07/2015	31/07/2020	Valid
Marine Dumping Permit			
<u>Dumping of Phase 1, 2a, 2b, 2c and 2d (Type 1-Open Sea Disposal) marine sediment at The Brothers Contaminated Mud Pits</u> EP/MD/16-088	09/10/2015	31/12/2015	Valid

3 AIR QUALITY MONITORING

Monitoring Requirements

- 3.1 In accordance with the EM&A Manual, impact 1-hour TSP and 24-hour TSP monitoring were conducted to monitor the air quality for the Contract. **Appendix B** shows the established Action/Limit Levels for the air quality monitoring works.
- 3.2 Impact 1-hour TSP monitoring was conducted for at least three times every 6 days, while impact 24-hour TSP monitoring was conducted for at least once every 6 days at 2 air quality monitoring stations.

Monitoring Location

- 3.3 Impact air quality monitoring was conducted at the 2 monitoring stations under the Contract, as shown in **Figure 3**. **Table 3.1** describes the locations of the air quality monitoring stations.

Table 3.1 Location for Air Quality Monitoring Locations

Monitoring Stations	Location
AMS1	Sha Lo Wan
AMS4	San Tau

Monitoring Equipment

- 3.4 **Table 3.2** summarizes the equipment used in the impact air monitoring programme. Copies of calibration certificates are attached in **Appendix C**.

Table 3.2 Air Quality Monitoring Equipment

Equipment	Model and Make	Quantity
HVS Sampler	TISCH Model: TE-5170	2
Calibrator	TISCH Model: TE-5025A	1
Wind Anemometer	DAVIS Model: Vantage PRO2 6152CUK	1

Monitoring Parameters, Frequency and Duration

- 3.5 **Table 3.3** summarizes the monitoring parameters and frequencies of impact dust monitoring during the course of the Contract activities. The air quality monitoring schedule for the reporting month is shown in **Appendix D**.

Table 3.3 Impact Dust Monitoring Parameters, Frequency and Duration

Parameters	Frequency
1-hr TSP	Three times / 6 days
24-hr TSP	Once / 6 days

Monitoring Methodology and QA/QC Procedure

1-hour and 24-hour TSP Air Quality Monitoring

Instrumentation

- 3.6 High Volume Samplers (HVS) completed with appropriate sampling inlets were employed for air quality monitoring. Each sampler was composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complies with that required by USEPA Standard Title 40, Code of Federation Regulations Chapter 1 (Part 50).

HVS Installation

- 3.7 The following guidelines were adopted during the installation of HVS:
- Sufficient support was provided to secure the sampler against gusty wind.
 - No two samplers were placed less than 2 meters apart.
 - The distance between the sampler and an obstacle, such as buildings, was at least twice the height that the obstacle protrudes above the sampler.
 - A minimum of 2 meters of separation from walls, parapets and penthouses was required for rooftop samples.
 - A minimum of 2 meters separation from any supporting structure, measured horizontally was required.
 - No furnaces or incineration flues were nearby.
 - Airflow around the sampler was unrestricted.
 - The samplers were more than 20 meters from the drip line.
 - Any wire fence and gate, to protect the sampler, should not cause any obstruction during monitoring.
 - Permission must be obtained to set up the samples and to obtain access to the monitoring stations; and
 - A secured supply of electricity is needed to operate the samplers.

Filters Preparation

- 3.8 Filter paper of size 8" X 10" was used. A HOKLAS accredited laboratory, ETS – Testconsult Limited (ETS), was responsible for the preparation of 24-hr conditioned and pre-weighed filter papers for Cinotech's monitoring team.
- 3.9 All filters, which were prepared by ETS, were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25 °C and not variable by more than ± 3 °C; the relative humidity (RH) was < 50% and not variable by more than ± 5 %. A convenient working RH was 40%.
- 3.10 ETS has comprehensive quality assurance and quality control programmes.

Operating/Analytical Procedures

- 3.11 Operating/analytical procedures for the air quality monitoring were highlighted as follows:

- Prior to the commencement of the dust sampling, the flow rate of the HVS was properly set (between 1.1 m³/min. and 1.4 m³/min.) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard Title 40, CFR Part 50.
- The power supply was checked to ensure the sampler worked properly.
- On sampling, the sampler was operated for 5 minutes to establish thermal equilibrium before placing any filter media at the designated air quality monitoring station.
- The filter holding frame was then removed by loosening the four nuts and carefully a weighted and conditioned filter was centered with the stamped number upwards, on a supporting screen.
- The filter was aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter. Then the filter holding frame was tightened to the filter holder with swing bolts. The applied pressure should be sufficient to avoid air leakage at the edges.
- The shelter lid was closed and secured with the aluminum strip.
- The timer was then programmed. Information was recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number).
- After sampling, the filter was removed and sent to the ETS for weighing. The elapsed time was also recorded.
- Before weighing, all filters were equilibrated in a conditioning environment for 24 hours. The conditioning environment temperature should be between 25°C and 30°C and not vary by more than ±3°C; the relative humidity (RH) should be < 50% and not vary by more than ±5%. A convenient working RH is 40%. Weighing results were returned to Cinotech for further analysis of TSP concentrations collected by each filter.

Maintenance/Calibration

3.12 The following maintenance/calibration was required for the HVS:

- The high volume motors and their accessories were properly maintained. Appropriate maintenance such as routine motor brushes replacement and electrical wiring checking were made to ensure that the equipment and necessary power supply are in good working condition.
- All HVS were calibrated (five point calibration) using Calibration Kit prior to the commencement of the baseline monitoring and thereafter at bi-monthly intervals.

Results and Observations

3.13 The monitoring results for 1-hour TSP and 24-hour TSP are summarized in **Table 3.4 and 3.5** respectively. Detailed monitoring results and graphical presentations of 1-hour and 24-hour TSP monitoring results are shown in **Appendices E and F** respectively.

Table 3.4 Summary Table of 1-hour TSP Monitoring Results during the Reporting Month

Monitoring Station	Concentration (µg/m ³)		Action Level, µg/m ³	Limit Level, µg/m ³
	Average	Range		
AMS1	41	13 – 93	381	500
AMS4	61	20 – 217	352	

Table 3.5 Summary Table of 24-hour TSP Monitoring Results during the Reporting Month

Monitoring Station	Concentration (µg/m ³)		Action Level, µg/m ³	Limit Level, µg/m ³
	Average	Range		
AMS1	52	25 – 114	170	260
AMS4	77	44 – 124	171	

- 3.14 All 1-hour TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedances were recorded.
- 3.15 All 24-hr TSP monitoring was conducted as scheduled in the reporting month. . No Action/Limit Level exceedances were recorded.
- 3.16 According to our field observations, the major dust source identified at the designated air quality monitoring stations in the reporting month are as follows:

Table 3.6 Observation at Dust Monitoring Stations

Monitoring Station	Major Dust Source
AMS1	Exhaust from marine traffic
AMS4	N/A

- 3.17 The wind speed and wind direction were recorded by the installed Wind Anemometer set at AMS4. The location is shown in **Figure 3**.
- 3.18 The wind data for the reporting month is summarized in **Appendix J**.

Event and Action Plan

- 3.19 Should non-compliance of the criteria occur, action in accordance with the Action Plan in **Appendix K** shall be carried out.

4 NOISE MONITORING

Monitoring Requirements

- 4.1 In accordance with EM&A Manual, two noise monitoring stations, namely NMS1 and NMS4 were selected for impact monitoring for the Contract. Impact noise monitoring was conducted for at least once per week during the construction phase of the Contract. **Appendix B** shows the established Action and Limit Levels for the noise monitoring works.

Monitoring Location

- 4.2 Impact noise monitoring was conducted at the 2 monitoring stations under the Contract, as shown in **Figure 3**. **Table 4.1** describes the locations of the noise monitoring stations.

Table 4.1 Location for Noise Monitoring Stations

Monitoring Stations	Location
NMS1	Sha Lo Wan
NMS4	San Tau

Monitoring Equipment

- 4.3 **Table 4.2** summarizes the noise monitoring equipment. Copies of calibration certificates are provided in **Appendix C**.

Table 4.2 Noise Monitoring Equipment

Equipment	Model and Make	Qty.
Integrating Sound Level Meter	SVAN 957	1
Calibrator	SV 30A	1

Monitoring Parameters, Frequency and Duration

- 4.4 **Table 4.3** summarizes the monitoring parameters, frequency and total duration of monitoring. The noise monitoring schedule is shown in **Appendix D**.

Table 4.3 Noise Monitoring Parameters, Frequency and Duration

Monitoring Stations	Parameter	Period	Frequency
NMS1 NMS4	L ₁₀ (30 min.) dB(A) L ₉₀ (30 min.) dB(A) L _{eq} (30 min.) dB(A) (as six consecutive L _{eq, 5min} readings)	0700-1900 hrs on normal weekdays	Once per week

Monitoring Methodology and QA/QC Procedures

- The microphone head of the sound level meter was positioned 1m exterior of the noise sensitive facade and lowered sufficiently so that the building's external wall acts as a reflecting surface.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
 - frequency weighting : A
 - time weighting : Fast
 - time measurement : $L_{eq}(30 \text{ min.}) \text{ dB(A)}$ (as six consecutive $L_{eq, 5\text{min}}$ readings) during non-restricted hours (i.e. 0700-1900 hrs on normal weekdays)
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94.0 dB at 1000 Hz. If the difference in the calibration level before and after measurement was more than 1.0 dB, the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
- During the monitoring period, the L_{eq} , L_{90} and L_{10} were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- Noise measurement was paused temporarily during periods of high intrusive noise (e.g. dog barking, helicopter noise) if possible and observation was recorded when intrusive noise was not avoided.
- Noise monitoring was cancelled in the presence of fog, rain, and wind with a steady speed exceeding 5 m/s, or wind with gusts exceeding 10 m/s. The wind speed shall be checked with a portable wind speed meter capable of measuring the wind speed in m/s.

Maintenance and Calibration

- 4.5 The microphone head of the sound level meter and calibrator were cleaned with a soft cloth at quarterly intervals.
- 4.6 The sound level meter and calibrator were checked and calibrated at yearly intervals.
- 4.7 Immediately prior to and following each noise measurement the accuracy of the sound level meter shall be checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Measurements may be accepted as valid only if the calibration levels from before and after the noise measurement agree to within 1.0 dB.

Results and Observations

- 4.8 The noise monitoring results are summarized in **Table 4.4**. Detailed monitoring results and graphical presentations of noise monitoring are shown in **Appendices G**.

Table 4.4 Summary Table of Noise Monitoring Results during the Reporting Month

Monitoring Station	Noise Level, $L_{eq(30min)}$ dB(A)		Limit Level
	Average	Range	
NMS1	65	61 – 68	75 dB(A)
NMS4	56	53 – 58	

Remark: +3dB(A) Façade correction included

- 4.9 All noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.
- 4.10 According to our field observations, the major noise source identified at the designated noise monitoring stations in the reporting month are as follows:

Table 4.5 Observation at Noise Monitoring Stations

Monitoring Station	Major Noise Source
NMS1	Air traffic & marine traffic noise
NMS4	Air traffic & marine traffic noise

Event and Action Plan

- 4.11 Should non-compliance of the criteria occur, action in accordance with the Action Plan in **Appendix K** shall be carried out.

5 WATER QUALITY MONITORING

Monitoring Requirements

- 5.1 According to EM&A Manual, impact water quality monitoring shall be carried out three days per week during the construction period. The interval between two sets of monitoring will not be less than 36 hours.
- 5.2 Replicate in-situ measurements and samples collected from each independent sampling event shall be collected to ensure a robust statistically interpretable database.
- 5.3 Impact water quality monitoring was conducted two times per monitoring day during mid ebb (within ± 1.75 hours of the predicted time) and mid flood tides (within ± 1.75 hours of the predicted time) at three depths (i.e. 1m below surface, mid-depth and 1m above seabed, except where the water depth less than 6m, mid-depth station may be omitted. Should the water depth be less than 3m, only the mid-depth station was monitored) Dissolved oxygen, Suspended solids (SS), turbidity, pH, salinity and temperature were monitored in accordance with the requirements set out in the EM&A Manual.
- 5.4 The proposal for changing Action and Limit Levels for water quality monitoring was submitted to EPD on 15 March 2013. No objection was received from EPD according to the letter (ref. (10) in Ax(3) to EP2/G/A/129pt.4) dated 25 March 2013. Therefore, the updated Action and Limit Levels for water quality monitoring was used for comparison starting from 25 March 2013.
- 5.5 **Appendix B** shows the established Action/Limit Levels for the water quality monitoring works.

Monitoring Locations

- 5.6 Impact water quality monitoring was conducted at 14 monitoring stations under the Contract which are summarized in **Table 5.1**. The monitoring station is also shown in **Figure 4**.

Table 5.1 Location for Marine Water Quality Monitoring Locations

Monitoring Stations	Coordinates	
	Easting	Northing
IS1	803474	815060
IS2	804851	815715
IS3	806502	815743
IS4	807008	816986
CS1	801784	812711
CS2	805849	818780
SR1	803126	812379
SR2	807856	816953
SR3	810525	816456
SR6	805837	821818
ST1	802677	816006
ST2	804055	818840

Monitoring Stations	Coordinates	
	Easting	Northing
ST3	800667	810126
SRA	809872	817152

Monitoring Equipment

Instrumentation

- 5.7 A multi-parameter meters (Model YSI 6820-C-M) were used to measure DO, turbidity, salinity, pH and temperature.

Dissolved Oxygen (DO) and Temperature Measuring Equipment

- 5.8 The instrument for measuring dissolved oxygen and temperature was portable and weatherproof complete with cable, sensor, comprehensive operation manuals and use DC power source. It was capable of measuring:
- a dissolved oxygen level in the range of 0-20 mg/L and 0-200% saturation; and
 - a temperature of 0-45 degree Celsius.
- 5.9 It has a membrane electrode with automatic temperature compensation complete with a cable.
- 5.10 Sufficient stocks of spare electrodes and cables were available for replacement where necessary.
- 5.11 Salinity compensation was built-in in the DO equipment.

Turbidity

- 5.12 Turbidity was measured in situ by the nephelometric method. The instrument was portable and weatherproof using a DC power source complete with cable, sensor and comprehensive operation manuals. The equipment was capable of measuring turbidity between 0-1000 NTU. The probe cable was not less than 25m in length. The meter was calibrated in order to establish the relationship between NTU units and the levels of suspended solids. The turbidity measurement was carried out on split water sample collected from the same depths of suspended solids samples.

Sampler

- 5.13 A water sampler, consisting of a transparent PVC or glass cylinder of a capacity of not less than two litres which can be effectively sealed with cups at both ends was used. The water sampler has a positive latching system to keep it open and prevent premature closure until released by a messenger when the sampler was at the selected water depth.

Water Depth Detector

- 5.14 A portable, battery-operated echo sounder was used for the determination of water depth

at each designated monitoring station.

pH

- 5.15 The instrument was consisting of a potentiometer, a glass electrode, a reference electrode and a temperature-compensating device. It was readable to 0.1pH in a range of 0 to 14. Standard buffer solutions of at least pH 7 and pH 10 were used for calibration of the instrument before and after use.

Salinity

- 5.16 A portable salinometer capable of recording salinity within the range of 0-40 ppt was used for salinity measurements.

Monitoring Position Equipment

- 5.17 A hand held Differential Global Positioning System (DGPS) was used during water quality monitoring to ensure the monitoring vessel is at the correct location before taking measurements.

Sample Container and Storage

- 5.18 Following collection, water samples for laboratory analysis were stored in high density polythene bottles (250ml/1L) with no preservatives added, packed in ice (cooled to 4°C without being frozen) and kept in dark during both on-site temporary storage and shipment to the testing laboratory. The samples were delivered to the laboratory as soon as possible and the laboratory determination works were started within 24 hours after collection of the water samples. Sufficient volume of samples was collected to achieve the detection limit.

Calibration of In Situ Instruments

- 5.19 All in situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or other international accreditation scheme before use, and subsequently re-calibrated at 3 monthly intervals throughout all stages of the water quality monitoring programme. Responses of sensors and electrodes were checked with certified standard solutions before each use. Wet bulb calibration for a DO meter was carried out before measurement at each monitoring event.
- 5.20 For the on site calibration of field equipment (Multi-parameter Water Quality System), the BS 1427:2009, "Guide to on-site test methods for the analysis of waters" was observed.
- 5.21 Sufficient stocks of spare parts were maintained for replacements when necessary. Backup monitoring equipment was also being made available so that monitoring can proceed uninterrupted even when some equipment was under maintenance, calibration, etc.
- 5.22 The equipment used for impact water quality monitoring is shown in **Table 5.2** and copies of the calibration certificates are shown in **Appendix C**. All the monitoring

equipment complied with the requirements set out in the EM&A Manual.

Table 5.2 Water Quality Monitoring Equipment

Equipment	Model and Make	Qty
Sonar Water Depth Detector	Garmin Fishfinder 140	2
Monitoring Position Equipment	KODEN DGPS (KGP913MKIID, GA-08 & BA-03)	2
Multi-parameter Water Quality System	YSI 6820-C-M and YSI 6920-M	2
Water Sampler	Kahlsico Water-Bottle Model 135DW 150	2

Monitoring Parameters, Frequency

5.23 **Table 5.3** summarizes the monitoring parameters, monitoring period and frequencies of the water quality monitoring. The water quality monitoring schedule for the reporting month is shown in **Appendix D**.

Table 5.3 Water Quality Monitoring Parameters and Frequency

Monitoring Stations	Parameters, unit	Depth	Frequency
IS1, IS2, IS3 IS4, CS1, CS2, SR1, SR2, SR3, SR6, ST1, ST2, ST3, SRA	<ul style="list-style-type: none"> Temperature(°C) pH(pH unit) turbidity (NTU) water depth (m) salinity (ppt) dissolved oxygen (DO) (mg/L and % of saturation) suspended solids (SS) (mg/L) 	<ul style="list-style-type: none"> 3 water depths: 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted. 	<ul style="list-style-type: none"> Impact monitoring: 3 days per week, at mid-flood and mid-ebb tides during the construction period of the Contract

5.24 Monitoring location/position, time, water depth, sampling depth, pH, salinity, DO saturation, water temperature, tidal stages, weather conditions and any special phenomena or work underway nearby were recorded.

Monitoring Methodology

Instrumentation

5.25 A multi-parameter meters (Model YSI 6820-C-M) were used to measure DO, turbidity, salinity, pH and temperature.

Operating/Analytical Procedures

5.26 The monitoring stations were accessed by the guide of a hand-held Differential Global Positioning System (DGPS) during water quality monitoring in accordance with the EM&A Manual. The depth of the monitoring location was measured using depth meter

in order to determine the sampling depths. Afterwards, the probes of the in-situ measurement equipment were lowered to the predetermined depths (1 m below water surface, mid-depth and 1 m above seabed) and the measurements were carried out accordingly.

- 5.27 At each measurement, two consecutive measurements of DO concentration, DO saturation, salinity, turbidity, pH and temperature were taken. The probes were retrieved out of the water after the first measurement and then re-deployed for the second measurement. Where the difference in the value between the first and second readings of each set was more than 25% of the value of the first reading, the reading was discarded and further readings were taken.
- 5.28 Water sampler was lowered into the water to the required depths of sampling. Upon reaching the pre-determined depth, a messenger to activate the sampler was then released to travel down the wire. The water sample was sealed within the sampler before retrieving. At each station, water samples at three depths (1 m below water surface, mid-depth and 1 m above seabed) were collected accordingly. Water samples were stored in a cool box and kept at less than 4°C but without frozen and sent to the laboratory as soon as possible. In addition, field information as described in Section 5.23 was also recorded.

Laboratory Analytical Methods

- 5.29 The testing of all parameters was conducted by CMA Testing and Certification Laboratories (HOKLAS Registration No.004) and comprehensive quality assurance and control procedures in place in order to ensure quality and consistency in results. The testing method, reporting limit and detection limit are provided in **Table 5.4**.

Table 5.4 Methods for Laboratory Analysis for Water Samples

Determinant	Instrumentation	Analytical Method	Detection Limit
Suspended Solid (SS)	Weighing	APHA 21e 2540D	0.5 mg/L

QA/QC Requirements

Decontamination Procedures

- 5.30 Water sampling equipment used during the course of the monitoring programme was decontaminated by manual washing and rinsed clean seawater/distilled water after each sampling event. All disposal equipment was discarded after sampling.

Sampling Management and Supervision

- 5.31 All sampling bottles were labelled with the sample I.D (including the indication of sampling station and tidal stage e.g. IS1_me_a), laboratory number and sampling date. Water samples were dispatched to the testing laboratory for analysis as soon as possible after the sampling. All samples were stored in a cool box and kept at less than 4°C but without frozen. All water samples were handled under chain of custody protocols and relinquished to the laboratory representatives at locations specified by the laboratory.

5.32 The laboratory determination works were started within 24 hours after collection of the water samples.

Quality Control Measures for Sample Testing

5.33 The samples testing were performed by CMA Testing and Certification Laboratories.

5.34 The following quality control programme was performed by the CMA Testing and Certification Laboratories for every batch of 20 samples:

- ✧ One set of quality control (QC) samples.

Maintenance and Calibration

5.35 All in situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or other international accreditation scheme before use, and subsequently re-calibrated at 3 monthly intervals throughout all stages of the water quality monitoring programme.

Results and Observations

5.36 The monitoring results and graphical presentation of water quality at the monitoring stations is shown in **Appendix H**.

5.37 The summary of exceedance record in reporting month is shown in **Appendix L** and summarized in the **Table 5.5**.

Table 5.5 Summary of Water Quality Exceedances

Station	Exceedance Level	DO (Surface & Middle)		DO(Bottom)		Turbidity		SS		Total Number of Exceedances	
		Mid-Ebb	Mid-Flood	Mid-Ebb	Mid-Flood	Mid-Ebb	Mid-Flood	Mid-Ebb	Mid-Flood	Mid-Ebb	Mid-Flood
IS1	Action Level								09/12/2015	0	1
	Limit Level									0	0
IS2	Action Level								09/12/2015	0	1
	Limit Level									0	0
IS3	Action Level							04/12/2015 11/12/2015		2	0
	Limit Level									0	0
IS4	Action Level								09/12/2015	0	1
	Limit Level									0	0
SR1	Action Level							11/12/2015	07/12/2015 14/12/2015 16/12/2015	1	3
	Limit Level									0	0
SR2	Action Level									0	0
	Limit Level									0	0
SR3	Action Level									0	0
	Limit Level									0	0
SR6	Action Level							11/12/2015	09/12/2015	1	1
	Limit Level									0	0
ST1	Action Level								09/12/2015	0	1
	Limit Level									0	0
ST2	Action Level								09/12/2015	0	1
	Limit Level									0	0
ST3	Action Level									0	0
	Limit Level									0	0
SRA	Action Level								16/12/2015	1	0
	Limit Level									0	0
Total	Action Level	0	0	0	0	0	0	4	10	14	
	Limit Level	0	0	0	0	0	0	0	0	0	

5.38 All water quality monitoring was conducted as scheduled in the reporting month. There are fourteen Action Level and no Limit Level exceedances for suspended solids were recorded. No Action/Limit Level exceedance for dissolved oxygen and turbidity were recorded.

5.39 According to the investigation, no pollution discharge was observed from the site. In addition, adverse water quality outside the site boundary and dispersion of sediment plume to the monitoring stations from the area outside the site boundary (i.e. works area not under and related to HY/2011/09) were observed. Therefore, the exceedances are considered not due to the Contract.

Event and Action Plan

5.40 Should non-compliance of the criteria occur, action in accordance with the Action Plan in **Appendix K** shall be carried out.

6 DOLPHIN-RELATED MONITORING

Monitoring Requirements

- 6.1 According to Section 10 of the EM&A Manual, four kinds of ecological monitoring works are required during the construction phase, namely dolphin monitoring, construction-phase underwater noise monitoring, dolphin behavior monitoring and land-based dolphin behavior and movement monitoring. The 30 days of construction-phase underwater noise monitoring, dolphin behavior monitoring and land-based dolphin behavior and movement monitoring were completed in July 2013.
- 6.2 The monitoring work shall be undertaken by suitably qualified specialist(s), (i.e. dolphin specialist and bio-acoustician), who shall have sufficient (at least 5-10 years) relevant post-graduate experience and publication in the respective aspects. They should be approved by Agriculture, Fisheries and Conservation Department (AFCD) and Environmental Protection Department (EPD).

Dolphin Monitoring (Line-transect Vessel Survey)

Monitoring Requirements

- 6.3 According to EM&A Manual Section 10.3.2, a dolphin monitoring programme should be set up to verify the predictions of impacts and to ensure that there are no unforeseen impacts on the dolphin population during construction phase.
- 6.4 Following the requirement in the EM&A Manual Section 10.4.1, the dolphin monitoring should adopt line-transect vessel survey method, and cover the following line-transect survey areas as in AFCD annual marine mammal monitoring programme.

Monitoring Location

- 6.5 For this contract, dolphin monitoring will be carried out in the West Lantau (WL) along the line transect as depicted in **Figure 1** of **Appendix I**. The co-ordinates of all transect lines are shown in **Table 6.1**.

Table 6.1 Co-ordinates of transect lines in WL survey area

Line No.		Easting	Northing	Line No.		Easting	Northing
1	Start Point	803750	818500	7	Start Point	800200	810450
1	End Point	803750	815500	7	End Point	801400	810450
2	Start Point	803750	815500	8	Start Point	801300	809450
2	End Point	802940	815500	8	End Point	799750	809450
3	Start Point	802550	814500	9	Start Point	799400	808450
3	End Point	803700	814500	9	End Point	801430	808450
4	Start Point	803120	813600	10	Start Point	801500	807450
4	End Point	801640	813600	10	End Point	799600	807450

Line No.		Easting	Northing	Line No.		Easting	Northing
5	Start Point	801100	812450	11	Start Point	800300	806500
5	End Point	802900	812450	11	End Point	801750	806500
6	Start Point	802400	811500	12	Start Point	801760	805450
6	End Point	800660	811500	12	End Point	800700	805450

Monitoring Frequency

6.6 Dolphin transect survey was carried out at least twice a month (i.e. complete all the transect lines of West Lantau survey area twice per month) throughout the construction period.

Monitoring Day

6.7 Dolphin monitoring was carried out on 3rd and 10th December 2015. The dolphin monitoring schedule for the reporting period is shown in **Appendix D**.

Monitoring Results

6.8 From these surveys, a total of 66.61 km of survey effort was collected, with 82.8% of the total survey effort being conducted under favorable weather conditions (i.e. Beaufort Sea State 3 or below with good visibility) Out of the 66.61 km of survey effort, the total survey effort conducted on primary lines (the horizontal lines perpendicular to the coastlines) was 45.11 km.

6.9 6 groups of 19 Chinese White Dolphins were sighted from primary lines. Distribution of the 7 dolphin sightings made during December’s surveys is shown in **Figure 4 of Appendix I**. These sightings were scattered from Tai O Peninsula to Fan Lau with no particular concentration, and it appeared that more sightings were made at the offshore waters than inshore waters. None of the dolphin sightings were made near the HKLR09 alignment during this monitoring month (**Figure 4 of Appendix I**).

6.10 Dolphin encounter rates deduced from the survey effort and on-effort sighting data made under favourable conditions (Beaufort 3 or below) are shown in **Table 6.2**.

Table 6.2 Dolphin encounter rates (sightings per 100 km of survey effort) in December’s surveys

		Encounter rate (STG) (no. of on-effort dolphin sightings per 100 km of survey effort)	Encounter rate (ANI) (no. of dolphins from all on-effort sightings per 100 km of survey effort)
		Primary Lines Only	Primary Lines Only
WL	Set 1: December 3 rd	12.4	62.2
	Set 2: December 10 th	14.1	33.0

6.11 The average group size of Chinese White Dolphins was 3.0 individuals per group during December’s surveys, which was slightly lower than the ones in previous months of monitoring surveys.

- 6.12 Five of the seven dolphin groups were composed of only 1-2 animals, while the other two dolphin groups were moderate in size with five and eight animals respectively.
- 6.13 During this month of dolphin monitoring, marine construction activities have continued under this contract. However, no adverse impact on Chinese white dolphins was noticeable from general observations.
- 6.14 Evaluation of impacts on dolphins due to construction work will be conducted in the quarterly EM&A report.
- 6.15 Detailed monitoring methodology and results can be found in **Appendix I**.

Additional Land-based Dolphin Behaviour and Movement Monitoring

- 6.16 Additional land-based dolphin behavior and movement monitoring was conducted on 1st and 8th December 2015 in the reporting month. The progress of the monitoring is summarized in the **Table 6.3**.

Table 6.3 Progress Record of Additional Land-based Dolphin Behaviour and Movement Monitoring in December 2015

Date	Time	Weather		Number of Staff	Number of Dolphin Sighting
		Beaufort	Visibility		
01/12/15	08:59 - 14:30	2	3	3	2
08/12/15	08:53 - 14:24	2-3	2.5	3	1

- 6.17 Detailed monitoring methodology and results will be provided in a separate report after the completion of full set of additional land-based dolphin behavior and movement monitoring.

7 ENVIRONMENTAL SITE INSPECTION

Site Audits

- 7.1 Site audits were carried out by ET on weekly basis to monitor the timely implementation of proper environmental management practices and mitigation measures in the Contract site. The summaries of site audits are attached in **Appendix M**.
- 7.2 Site audits were conducted on 1st, 10th, 15th, 23rd and 29th December 2015 by ET after the commencement of construction works for the Contract. A joint site audit with the representative with IEC, SOR, the Contractor and the ET was carried out on 29th December 2015. The details of observations during site audit can refer to **Table 7.1**.
- 7.3 According to EP condition 4.7 and EM&A Manual, periodic monitoring (every three months) of construction works shall be conducted to ensure the avoidance of any impacts on Sha Lo Wan (West) Archaeological Site. Access to Sha Lo Wan (West) Archaeological site for works areas and storage of construction equipment is not allowed. The 12th inspection to the Sha Lo Wan (West) Archaeological Site was conducted on 29th December 2015 and next inspection will be conducted in March 2015.

Implementation Status of Environmental Mitigation Measures

- 7.4 According to the EIA Study Report, Environmental Permit and the EM&A Manual, the mitigation measures detailed in the documents are recommended to be implemented during the construction phase. An updated summary of the EMIS is provided in **Appendix N**.
- 7.5 Regular marine travel route for marine vessels were implemented properly in accordance with the submitted plan and relevant records were kept properly.
- 7.6 Acoustic decoupling measures for the stationary equipment (generators, winch generators and air compressors) mounted on boards were adopted according to EP Condition 3.7 and EM&A Manual, Section 10.2.18.
- 7.7 Dolphin exclusion zone and dolphin watching plan according to EM&A Manual, Section 10.2.12 and EP Condition 3.5 was implemented by DCVJV's trained dolphin watcher.
- 7.8 Spill kits and booms are ready on site for the event of accidental spillage of oil or other hazardous chemicals from construction activities including vessels operating for the Contract.
- 7.9 During site inspections in the reporting month, no non-conformance was identified. The observations and recommendations made during the audit sessions are summarized in **Table 7.1**.

Table 7.1 Observations and Recommendations of Site Audit

Parameters	Date	Observations and Recommendations	Follow-up
<i>Water Quality</i>	01/12/2015	Properly deploy the silt curtain at P81 and P83.	Rectification/improvement was observed during the follow-up audit session on 10 December 2015.
	01/12/2015	Clear the floating rubbish and damaged silt curtain at P91.	Rectification/improvement was not observed during the follow-up audit session on 10 December 2015. Further follow-up on this item is required.
	10/12/2015	Properly deploy the silt curtain at P68.	Rectification/improvement was observed during the follow-up audit session on 23 December 2015.
	10/12/2015	Ensure adequate capacity of sedimentation facilities at Portion C (P110).	Rectification/improvement was observed during the follow-up audit session on 15 December 2015.
	10/12/2015	Clear the floating rubbish and damaged silt curtain at P91.	Rectification/improvement was not observed during the follow-up audit session on 15 December 2015. Further follow-up on this item is required.
	15/12/2015	Minor sediment plume was observed outside the silt curtain at P69. The Contractor was reminded to rectify this deficiency accordingly.	Rectification/improvement was observed during the follow-up audit session on 23 December 2015.
	15/12/2015	Floating rubbish was observed within the silt curtain at P69. The Contractor was reminded to clear it ASAP.	Rectification/improvement was observed during the follow-up audit session on 23 December 2015.
	15/12/2015	Properly deploy the silt curtain at P68.	Rectification/improvement was observed during the follow-up audit session on 23 December 2015.
	15/12/2015	Clear the floating rubbish and damage silt curtain at P91.	Rectification/improvement was not observed during the follow-up audit session on 23 December 2015. Further follow-up on this item is required.
	15/12/2015	Provide proper sedimentation facilities at P68 to ensure the discharge comply with WPCO license.	Rectification/improvement was not observed during the follow-up audit session on 23 December 2015. Further follow-up on this item is required.
	23/12/2015	Properly deploy the silt curtain at P78.	Rectification/improvement was observed during the follow-up audit session on 29 December 2015.
	29/12/2015	Clear the sand and debris at the platform at P69.	Rectification/improvement was observed during the follow-up audit session on 5 January 2016.

Parameters	Date	Observations and Recommendations	Follow-up
	29/12/2015	Provide wastewater treatment facilities at P69, if necessary.	Rectification/improvement was observed during the follow-up audit session on 5 January 2016.
<i>Ecology</i>	01/12/2015	Properly erect the fencing to protect the trees at P98.	Rectification/improvement was not observed during the follow-up audit session on 10 December 2015. Further follow-up on this item is required.
	10/12/2015	Properly erect the fencing to protect the trees at P98.	Rectification/improvement was not observed during the follow-up audit session on 15 December 2015. Further follow-up on this item is required.
	15/12/2015	Properly erect the fencing to protect the trees at P98.	Rectification/improvement was not observed during the follow-up audit session on 23 December 2015. Further follow-up on this item is required.
<i>Air Quality</i>	01/12/2015	Properly cover the stockpile of excavated materials at P88.	Rectification/improvement was observed during the follow-up audit session on 10 December 2015.
	10/12/2015	Provide NRMM label and noise emission label for the air compressor and excavator which will be used on site at P68.	Rectification/improvement was observed during the follow-up audit session on 23 December 2015.
	15/12/2015	Provide NRMM label for the air compressor at P68.	Rectification/improvement was observed during the follow-up audit session on 23 December 2015.
<i>Noise</i>	10/12/2015	Provide NRMM label and noise emission label for the air compressor and excavator which will be used on site at P68.	Rectification/improvement was observed during the follow-up audit session on 23 December 2015.
<i>Waste / Chemical Management</i>	01/12/2015	Provide waste sorting for the accumulated construction waste at P86.	Rectification/improvement was observed during the follow-up audit session on 10 December 2015.
	01/12/2015	Clear the rubbish at near the wetsep at Portion C (P110).	Rectification/improvement was observed during the follow-up audit session on 23 December 2015.
	01/12/2015	Clear the U-Channel at P102 and Portion C (P111).	Rectification/improvement was observed during the follow-up audit session on 15 December 2015.
	10/12/2015	Clear the rubbish at near the wetsep at Portion C (P110).	Rectification/improvement was observed during the follow-up audit session on 23 December 2015.
	10/12/2015	Clear the U-Channel at P102 and Portion C (P111).	Rectification/improvement was observed during the follow-up audit session on

Parameters	Date	Observations and Recommendations	Follow-up
			15 December 2015.
	10/12/2015	Clear the oil containers and oil leakage at near the discharging point at P106 (Portion C).	Rectification/improvement was observed during the follow-up audit session on 23 December 2015.
	10/12/2015	Provide proper area for the equipment (segment carrier) maintenance works to avoid soil contamination at P102.	Rectification/improvement was observed during the follow-up audit session on 23 December 2015.
	15/12/2015	Clear the rubbish at near the wetsep at Portion C (P110).	Rectification/improvement was observed during the follow-up audit session on 23 December 2015.
	15/12/2015	Clear the oil containers and oil leakage at near the discharging point at P106 (Portion C).	Rectification/improvement was observed during the follow-up audit session on 23 December 2015.
	15/12/2015	Provide proper area for the equipment (segment carrier / lift equipment) maintenance works to avoid soil contamination at P102 and P109.	Rectification/improvement was observed during the follow-up audit session on 23 December 2015.
	15/12/2015	Provide drip tray for the oil containers at P70.	Rectification/improvement was observed during the follow-up audit session on 23 December 2015.
	15/12/2015	Clear the oil spillage at near the air compressor at P68.	Rectification/improvement was observed during the follow-up audit session on 23 December 2015.
	23/12/2015	Provide drip tray for the chemical containers at P63, P64 and P78.	Rectification/improvement was observed during the follow-up audit session on 29 December 2015.
	23/12/2015	Clear the oily water at the drip tray as chemical waste at P64.	Rectification/improvement was observed during the follow-up audit session on 29 December 2015.
	23/12/2015	Clear the accumulated rubbish at P64 regularly.	Rectification/improvement was observed during the follow-up audit session on 29 December 2015.
	29/12/2015	Ensure the valves at the drip tray are closed to avoid the leakage of oily water at P69 & P70.	Rectification/improvement was observed during the follow-up audit session on 5 January 2016.
	29/12/2015	Provide drip tray for the chemical containers at P80.	Rectification/improvement was observed during the follow-up audit session on 5 January 2016.
Landscape & Visual Impact	N/A ⁽¹⁾	N/A ⁽¹⁾	N/A ⁽¹⁾
Permits/Licences	N/A ⁽¹⁾	N/A ⁽¹⁾	N/A ⁽¹⁾
Other	N/A ⁽¹⁾	N/A ⁽¹⁾	N/A ⁽¹⁾
Cultural Heritage (Sha Lo Wan (West) Archaeological	29/12/2015	N/A ⁽¹⁾	N/A ⁽¹⁾

Parameters	Date	Observations and Recommendations	Follow-up
<i>Site</i>			

Remark: N/A⁽¹⁾ - No major environmental deficiency was identified during the site inspection in the reporting month.

Advice on the Solid and Liquid Waste Management Status

- 7.10 According to the Contractor, 5,619m³ inert C&D materials were generated during the reporting month.
- 7.11 The Contractor was advised to minimize the wastes generated through the recycling or reusing. All mitigation measures stipulated in approved waste management plan shall be fully implemented.
- 7.12 The amount of wastes generated by the activities of the Contract during the reporting month is shown in **Appendix O**.

8 ENVIRONMENTAL NON-CONFORMANCE (EXCEEDANCES)

Summary of Exceedances

- 8.1 Summary of exceedance is provided in **Appendix L**.
- 8.2 No Action/Limit Level exceedance was recorded for air quality and construction noise.
- 8.3 There are fourteen Action Level and no Limit Level exceedances for suspended solids were recorded. No Action/Limit Level exceedance for dissolved oxygen and turbidity were recorded.
- 8.4 According to the investigation, no pollution discharge was observed from the site. In addition, adverse water quality outside the site boundary and dispersion of sediment plume to the monitoring stations from the area outside the site boundary (i.e. works area not under and related to HY/2011/09) were observed. Therefore, the exceedances are considered not due to the Contract

Summary of Environmental Complaint

- 8.5 No environmental related complaint was received in the reporting month. The Complaint Log is attached in **Appendix P**.

Summary of Notification of Summons and Successful Prosecution

- 8.6 There was one prosecution or notification of summons received since the Contract commencement. Summary of successful prosecution as attached in **Appendix Q**.

9 FUTURE KEY ISSUES

Key Issues in the Coming Month

9.1 Major site activities for the coming reporting month will include:

WA4

- Fabrication of lifting frames
- Deliveries of frame structures

WA7

- Fabrication of cofferdam frame structures

Marine Viaduct (P0 to P80)

- Remove rockfill platform for rock breaking for cofferdam installation
- Completed concrete plug, cutting steel casing and blinding concrete
- Enhancement work to cofferdam to improve water tightness
- Pile testing

Pile Cap Construction:

- Installation of precast cap shells
- Concreting
- Kingpost installation and associated steel welding works
- Concreting trimming

Column Construction:

- Lifting works
- Lift concreting
- Pier head works
- Pier head concreting

Precast Column Erection

- Installation of base units and precast units
- Stressing of vertical nailing tendons
- Vertical Tendons Stressed
- Grouting Vertical Tendons
- Pier Head Concrete

Deck Erection

- Setting up of equipment
- Segment erection

Precast Segment

- Segment casting

Land Viaduct (P81 to Abutment at Scenic Hill Tunnel (SHT))

- Commencement of reinstatement works
- Removal of falsework
- Removal of steel bracket system
- Construction of upper bearing plinths

Monitoring Schedule for the Next Month

9.2 The tentative environmental monitoring schedule for the next month is shown in **Appendix D**.

Construction Programme for the Next Month

9.3 A tentative construction programme is provided in **Appendix A**.

10 CONCLUSIONS AND RECOMMENDATIONS

Conclusions

- 10.1 The Environmental Monitoring and Audit (EM&A) Report presents the EM&A works undertaken in December 2015 in accordance with EM&A Manual.
- 10.2 No Action/Limit Level exceedance was recorded for air quality and construction noise.
- 10.3 There are fourteen Action Level and no Limit Level exceedances for suspended solids were recorded. No Action/Limit Level exceedance for dissolved oxygen and turbidity were recorded. According to the investigation, no pollution discharge was observed from the site. In addition, adverse water quality outside the site boundary and dispersion of sediment plume to the monitoring stations from the area outside the site boundary (i.e. works area not under and related to HY/2011/09) were observed. Therefore, the exceedances are considered not due to the Contract.
- 10.4 Dolphin transect survey was carried out on 3rd and 10th December 2015. No adverse impact on Chinese White Dolphins was noticeable from general observations.
- 10.5 Two days of additional Land-based Dolphin Behaviour and Movement Monitoring were conducted on 1st and 8th December 2015.
- 10.6 Environmental site inspection was conducted on 1st, 10th, 15th, 23rd and 29th December 2015 by ET in the reporting month. All deficiencies identified during the site inspection have already rectified / improved during the follow-up audit session.
- 10.7 The inspection to the Sha Lo Wan (West) Archaeological Site was conducted on 29th December 2015. No access to Sha Lo Wan (West) Archaeological site for works areas and storage of construction equipment was observed.
- 10.8 There was no environmental complaint, no notification of summons and successful prosecution received in the reporting month.
- 10.9 The ET will keep track on the EM&A programme to ensure compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

Recommendations

10.10 According to the environmental audit performed in the reporting month, the following recommendations were made:

Air Quality Impact

- To regularly maintain the quality of machinery and vehicles on site.
- To implement dust suppression measures on all haul roads, stockpiles, dry surfaces and excavation works.
- To provide hoarding along the entire length of that portion of the site boundary.

Noise Impact

- To inspect the noise sources inside the site.
- To space out noisy equipment and position the equipment as far away as possible from sensitive receivers.
- To provide temporary noise barriers for operations of noisy equipment near the noise sensitive receivers, if necessary.

Water Impact

- To prevent any surface runoff discharge into any stream course and sea.
- To review and implement temporary drainage system.
- To identify any wastewater discharges from site.
- To ensure properly maintenance for de-silting facilities.
- To clear the silt and sediment in the sedimentation tanks.
- To review the capacity of de-silting facilities for discharge.
- To divert all the water generated from construction site to de-silting facilities with enough handling capacity before discharge.
- To avoid accumulation of stagnant and ponding water on site.

Ecology Impact


- To implement Spill Response Plan in the event of accidental spillage of or other hazardous chemicals.
- To implement Dolphin Exclusion Zone during the installation of bored pile casing located in the waters to the west of Airport.
- To implement Dolphin Watching Plan after the bored piling casing is installed.
- To ensure the acoustically-decoupled measures were implemented for air compressors and other noisy equipment mounted on construction vessels according

to acoustic decoupling measures plan.



Waste/Chemical Management

- To check for any accumulation of waste materials or rubbish on site.
- To ensure the performance of sorting of C&D materials at source (during generation);
- To carry out inspection of dump truck at site exit to ensure inert and non-inert C&D materials are properly segregated before removing off site.
- To avoid any discharge or accidental spillage of chemical waste or oil directly from the site.
- To avoid improper handling or storage of oil drum on site.

FIGURE(S)

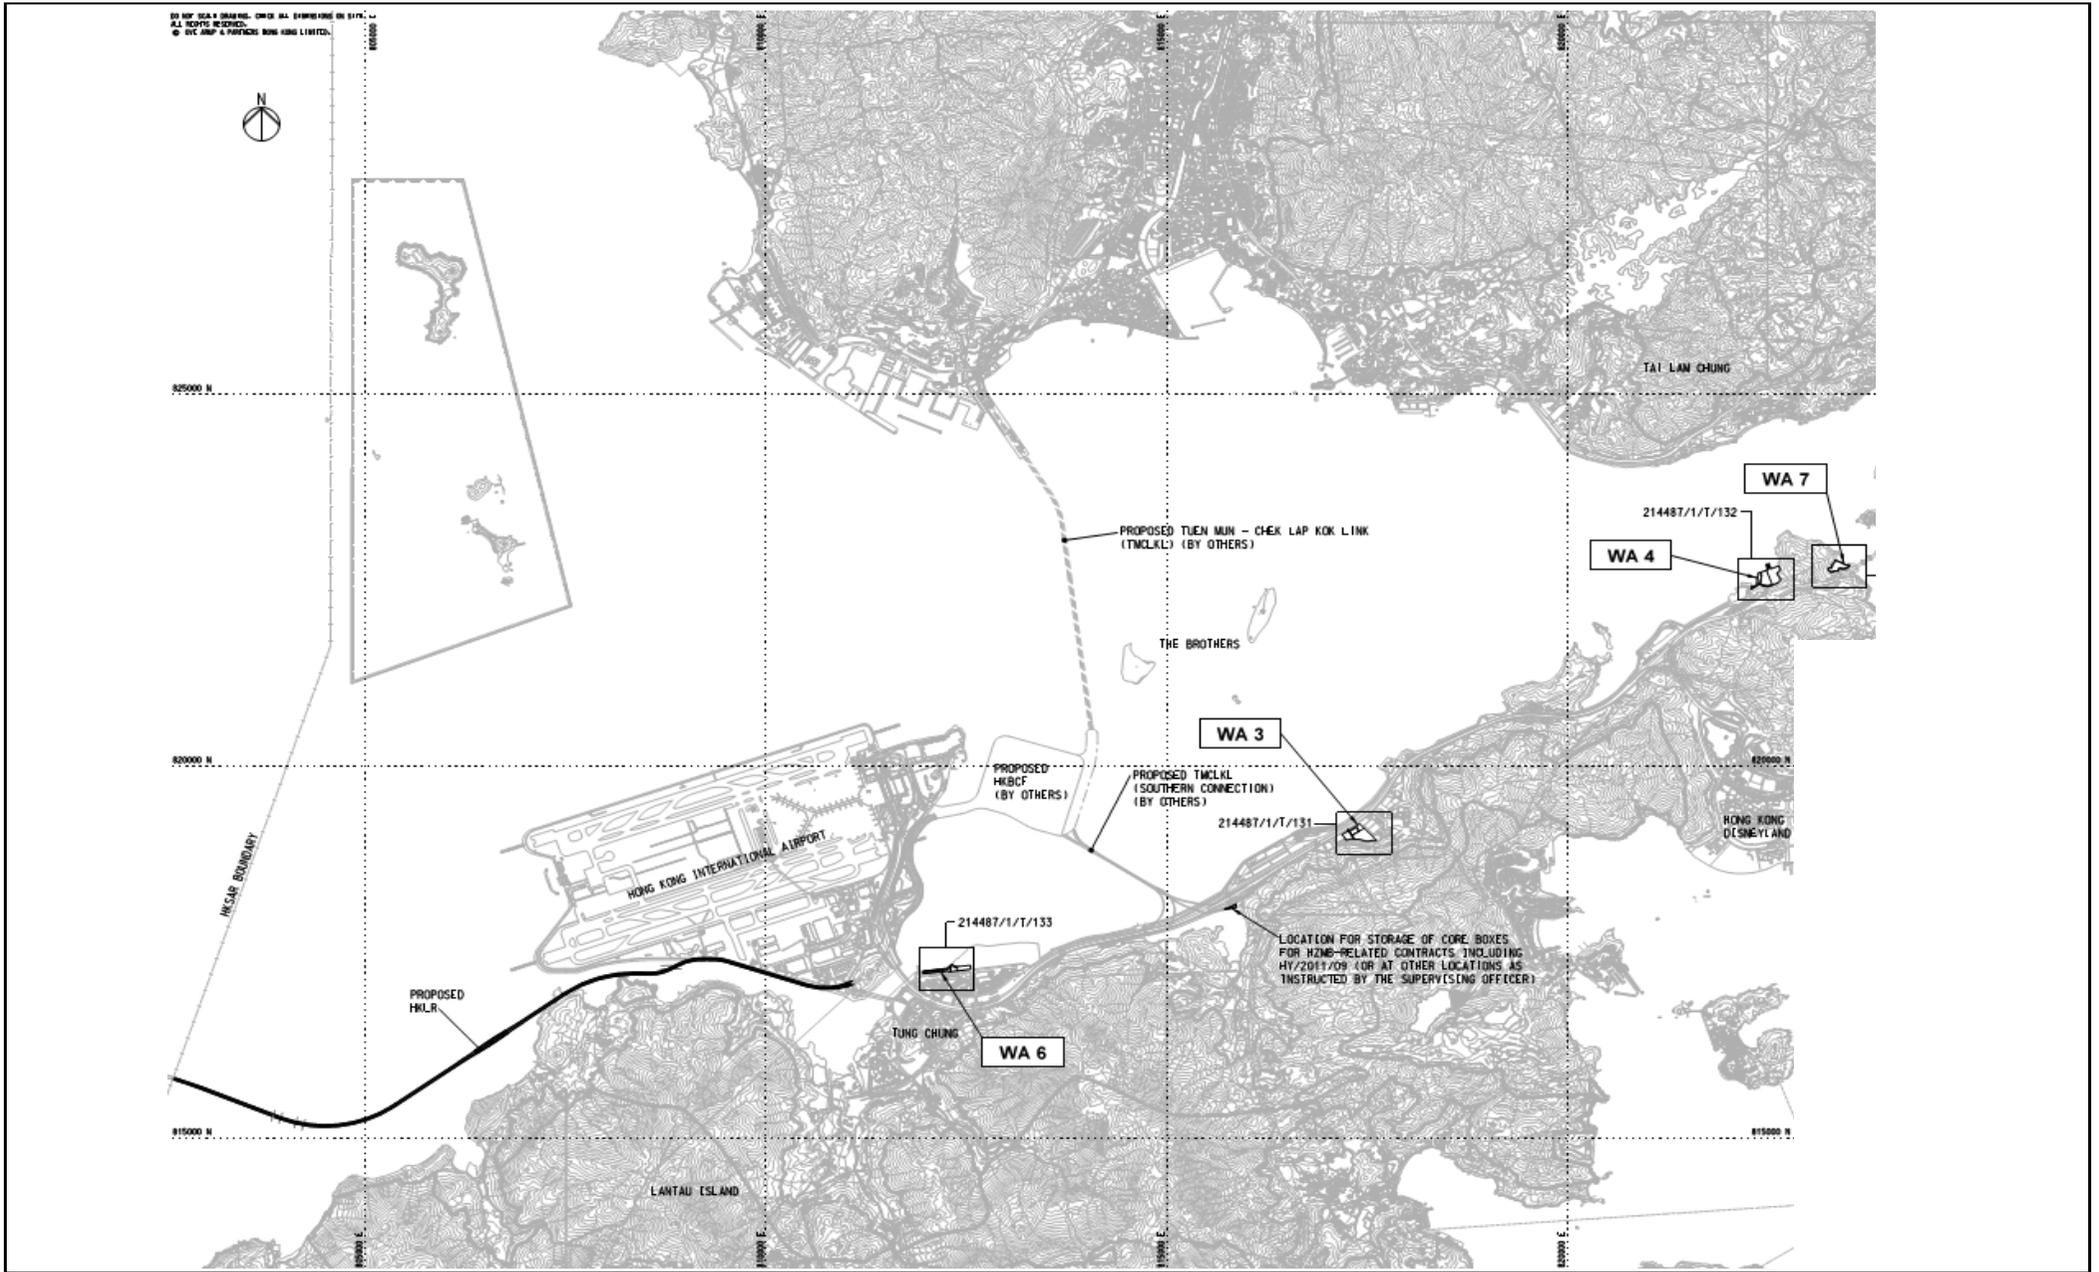


Title	Contract No. HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill Site Layout Plan (WA3, WA4, WA6 and WA7)		Scale	N.T.S	Propose	No. MA12014 Figure 1a	CINOTECH
	Date	Oct-15					

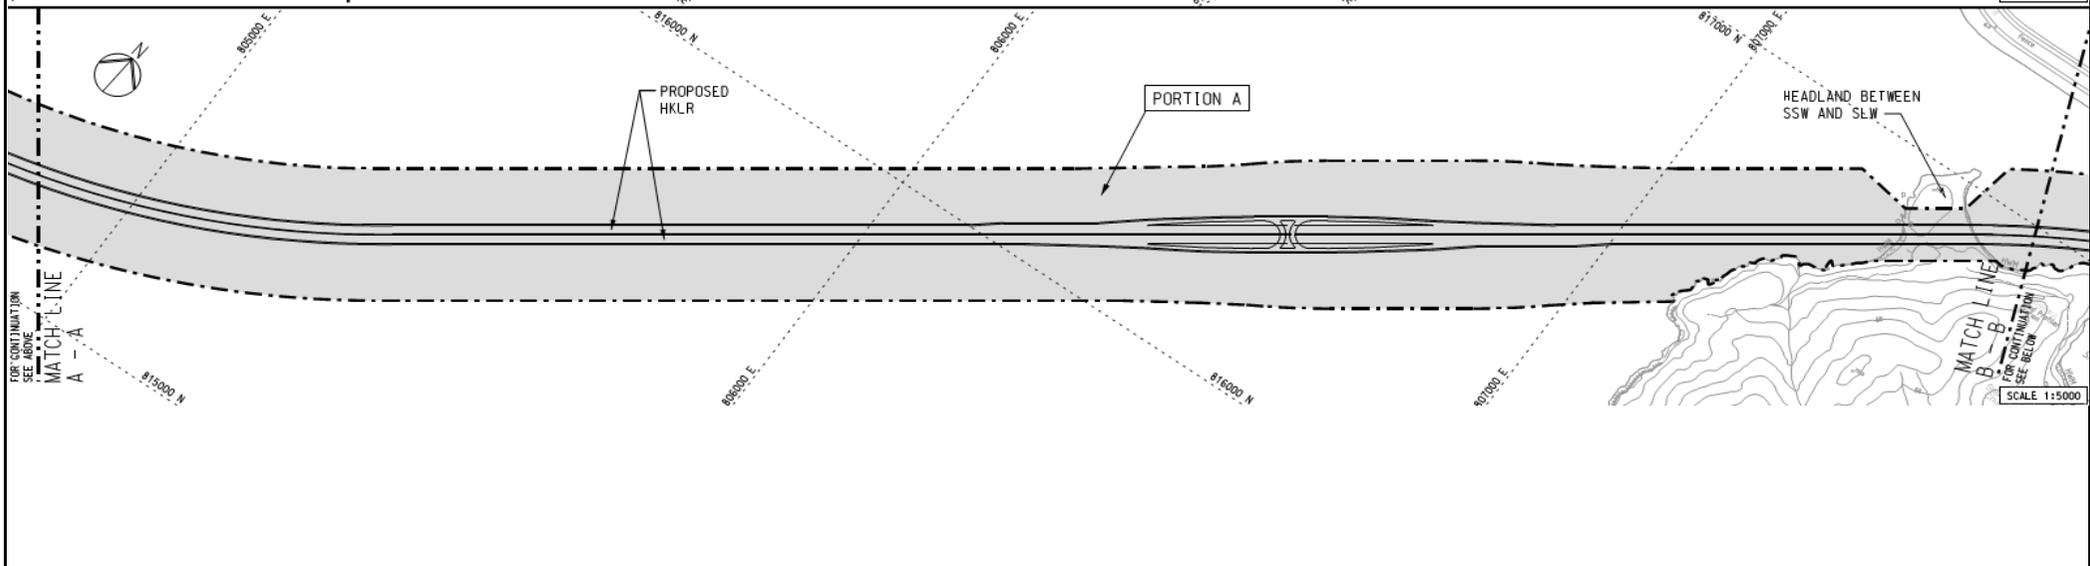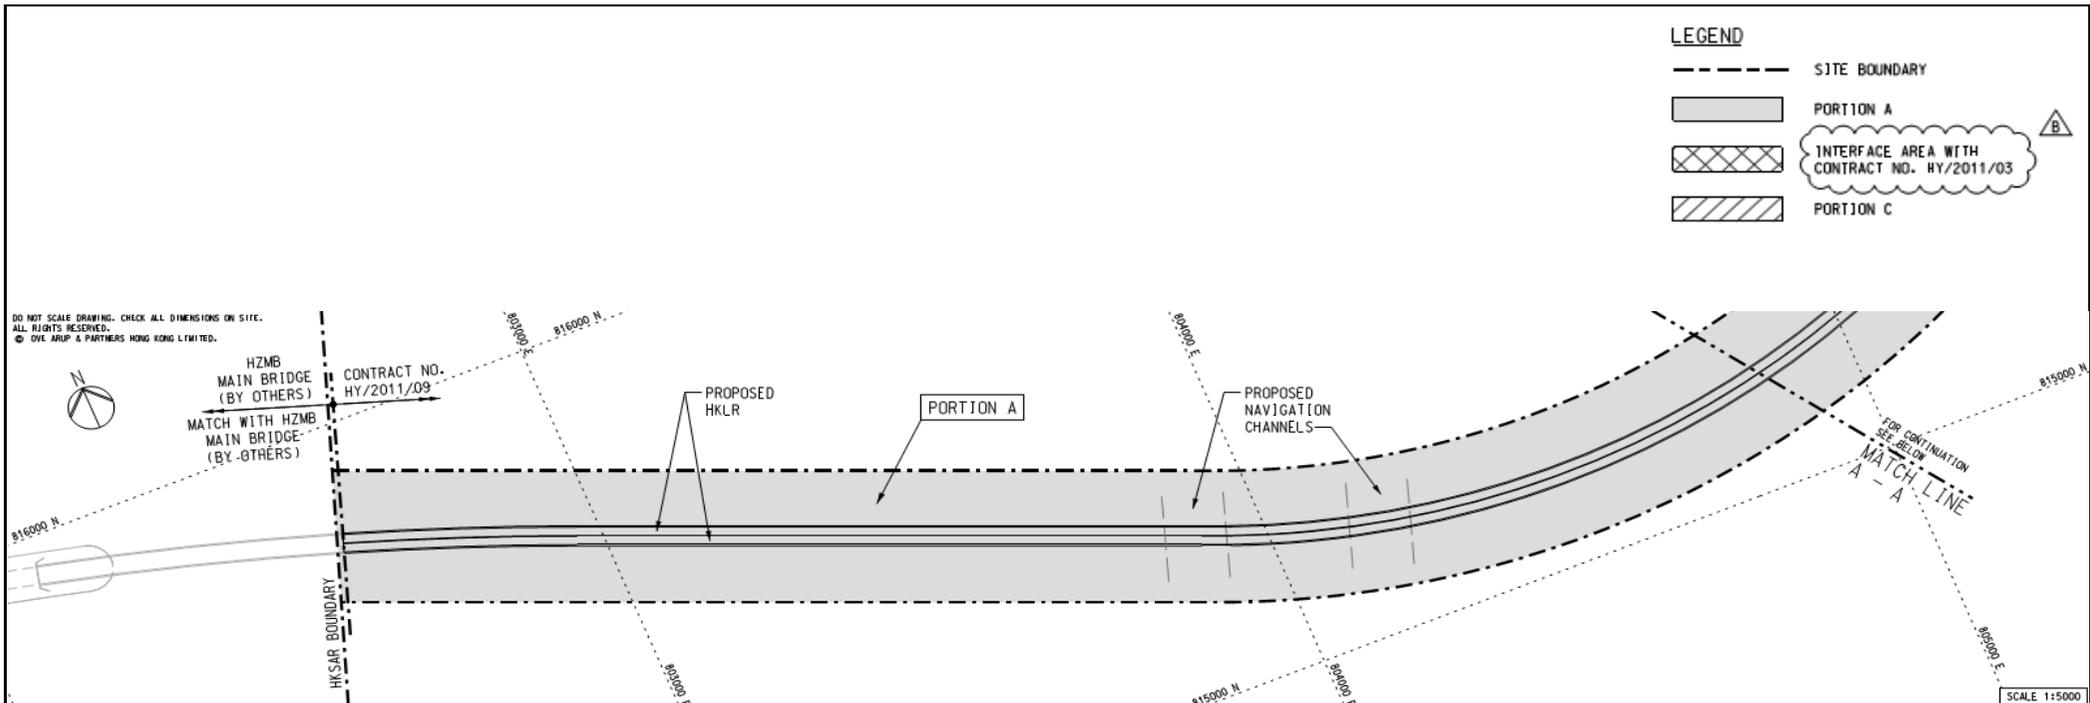

Title	Contract No. HY/2011/09		Scale	Propose
	Hong Kong-Zhuhai-Macao Bridge		N.T.S	No. MA12014
Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill			Date	Figure
Site Layout Plan (Portion A)			Oct-15	1b




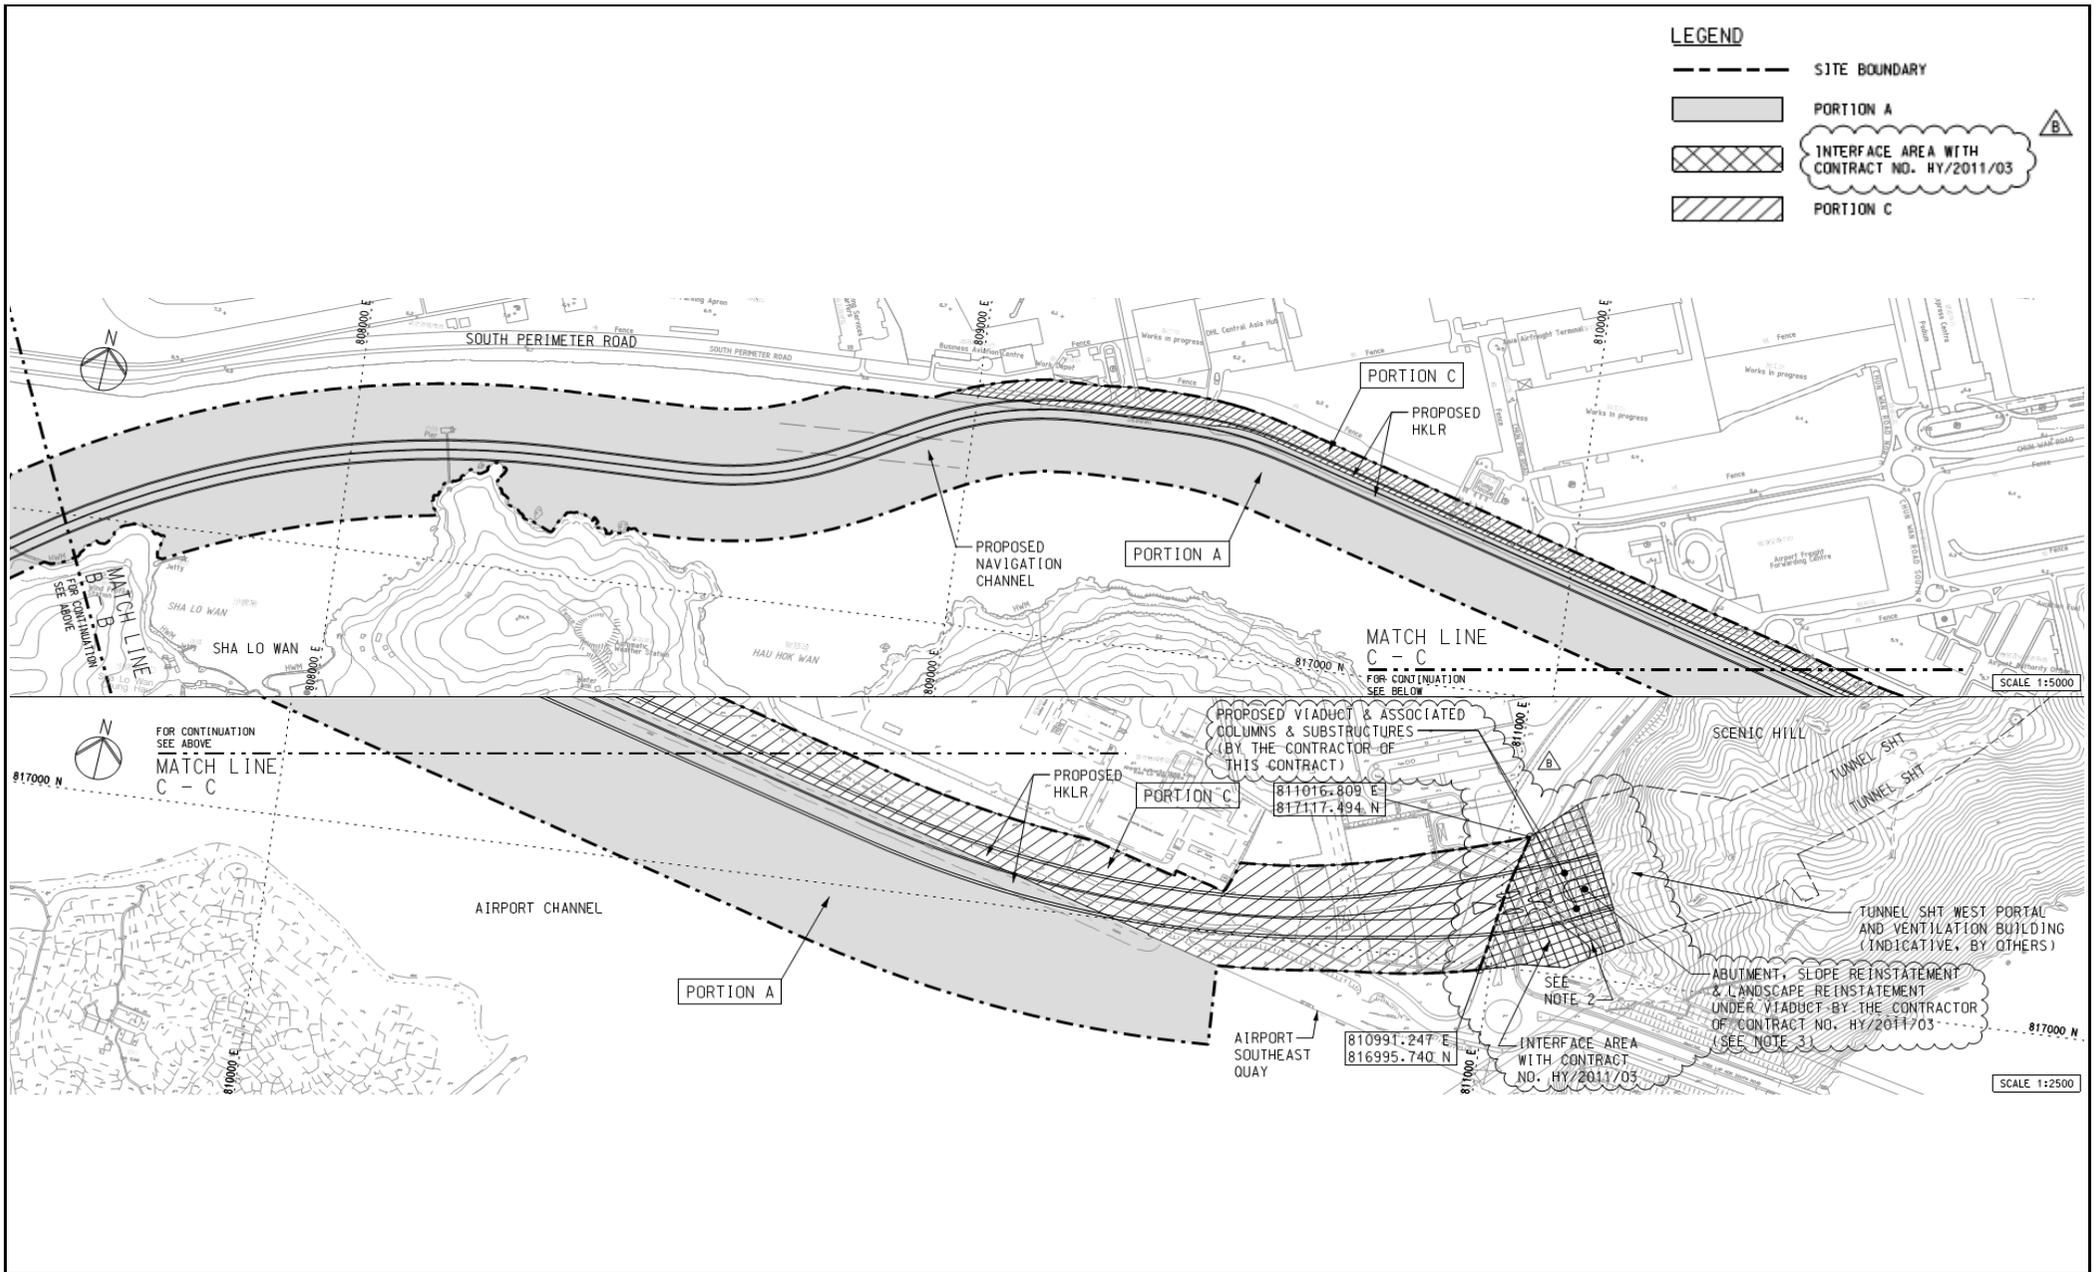


Title	Contract No. HY/2011/09	
	Hong Kong-Zhuhai-Macao Bridge	
	Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill	
	Site Layout Plan (Portion A and C)	

Scale	N.T.S	Propose No.	MA12014
Date	五月-13	Figure	1c



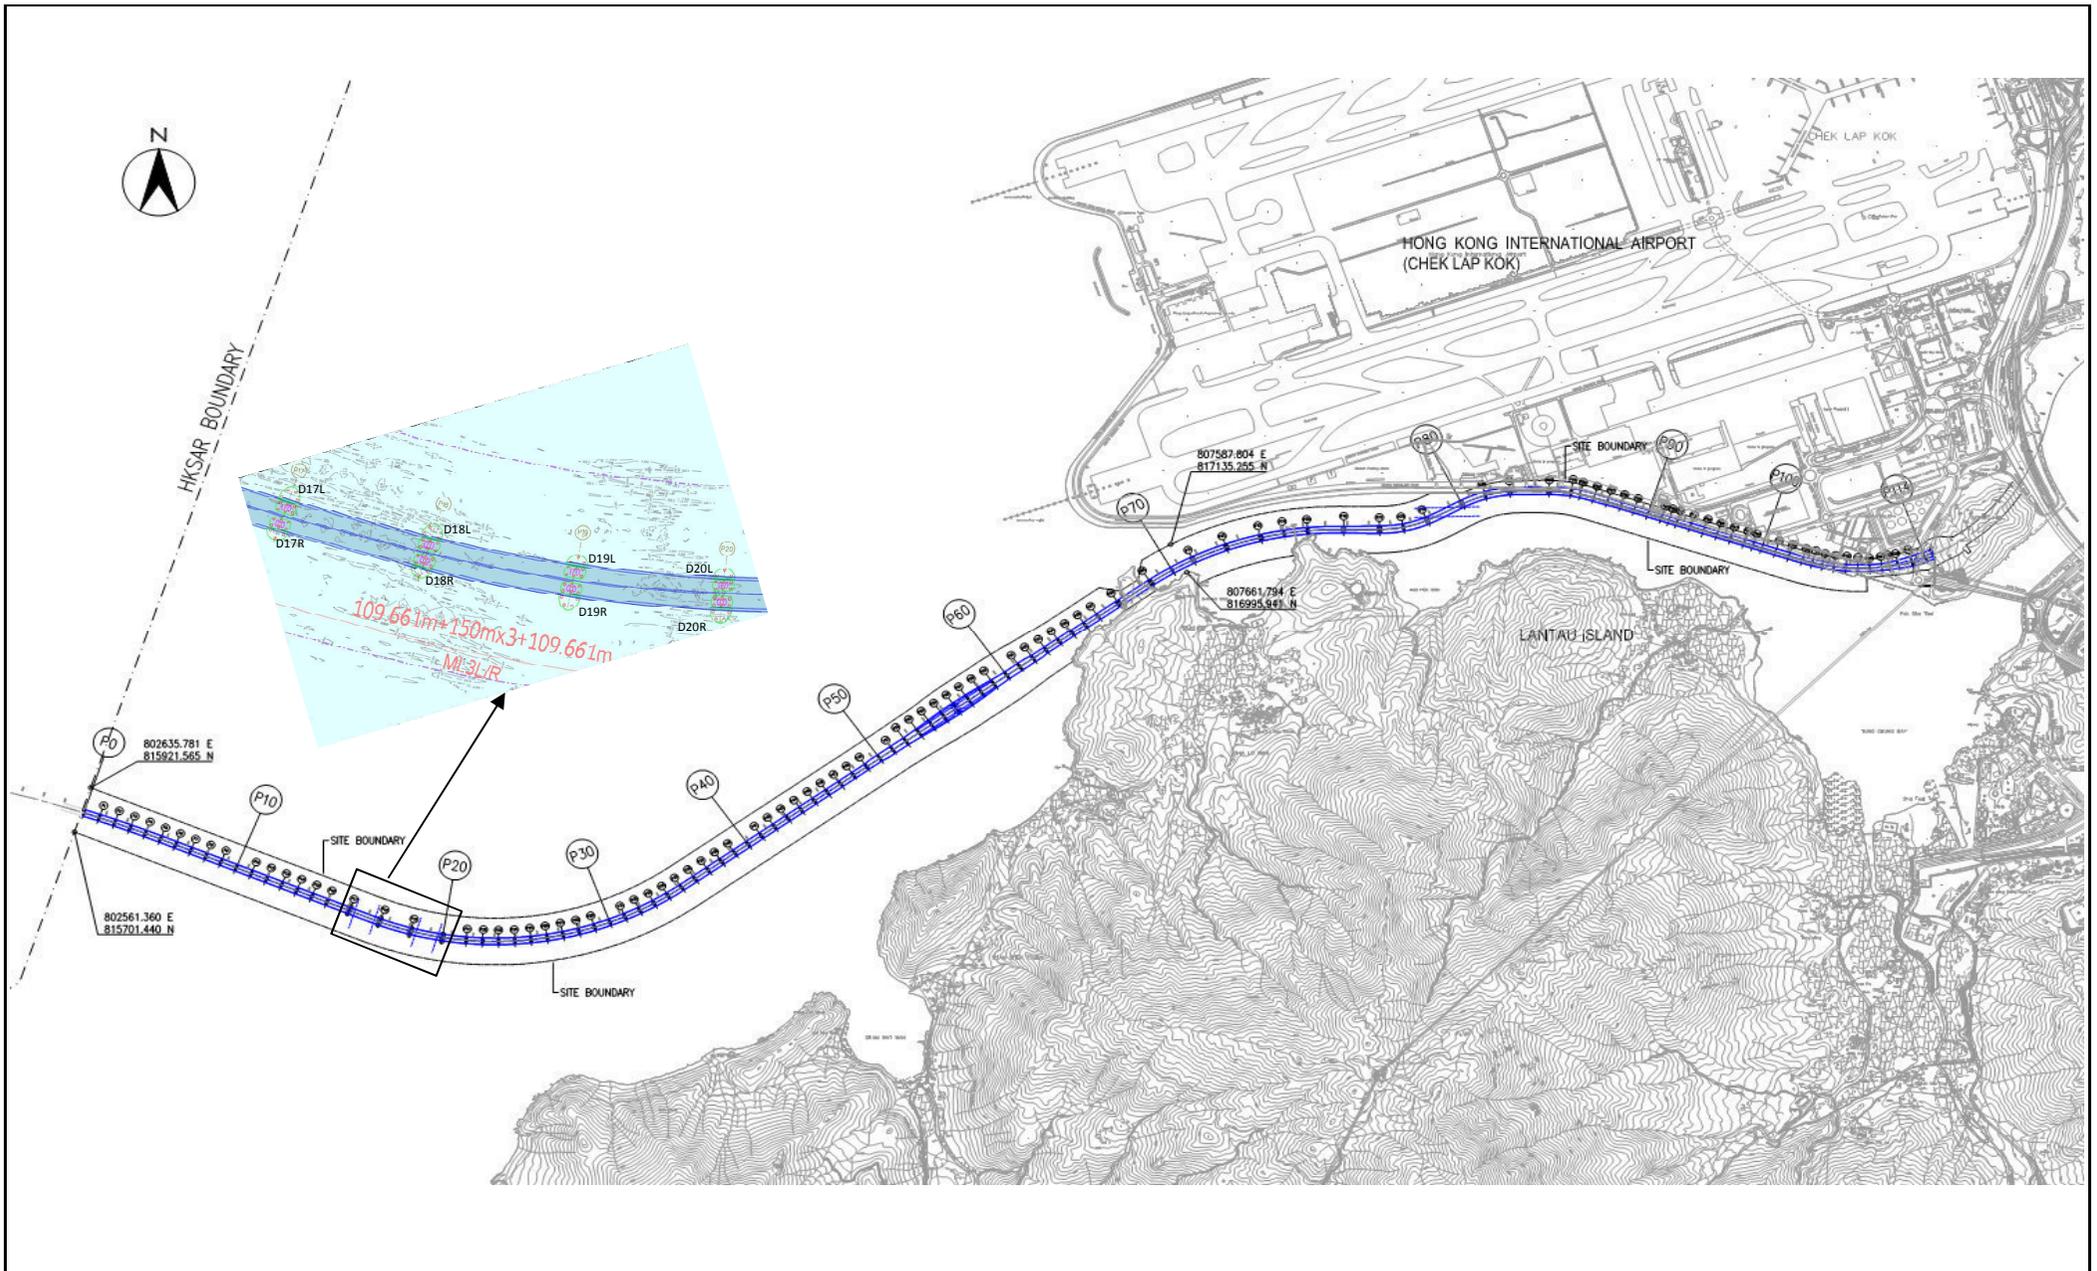

Title	Contract No. HY/2011/09		Scale	Propose No.	MA12014	CINOTECH
	Hong Kong-Zhuhai-Macao Bridge					
	Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill		Date	Figure		
	Site Layout Plan (Pier(s) Site)		Oct-15	1d		

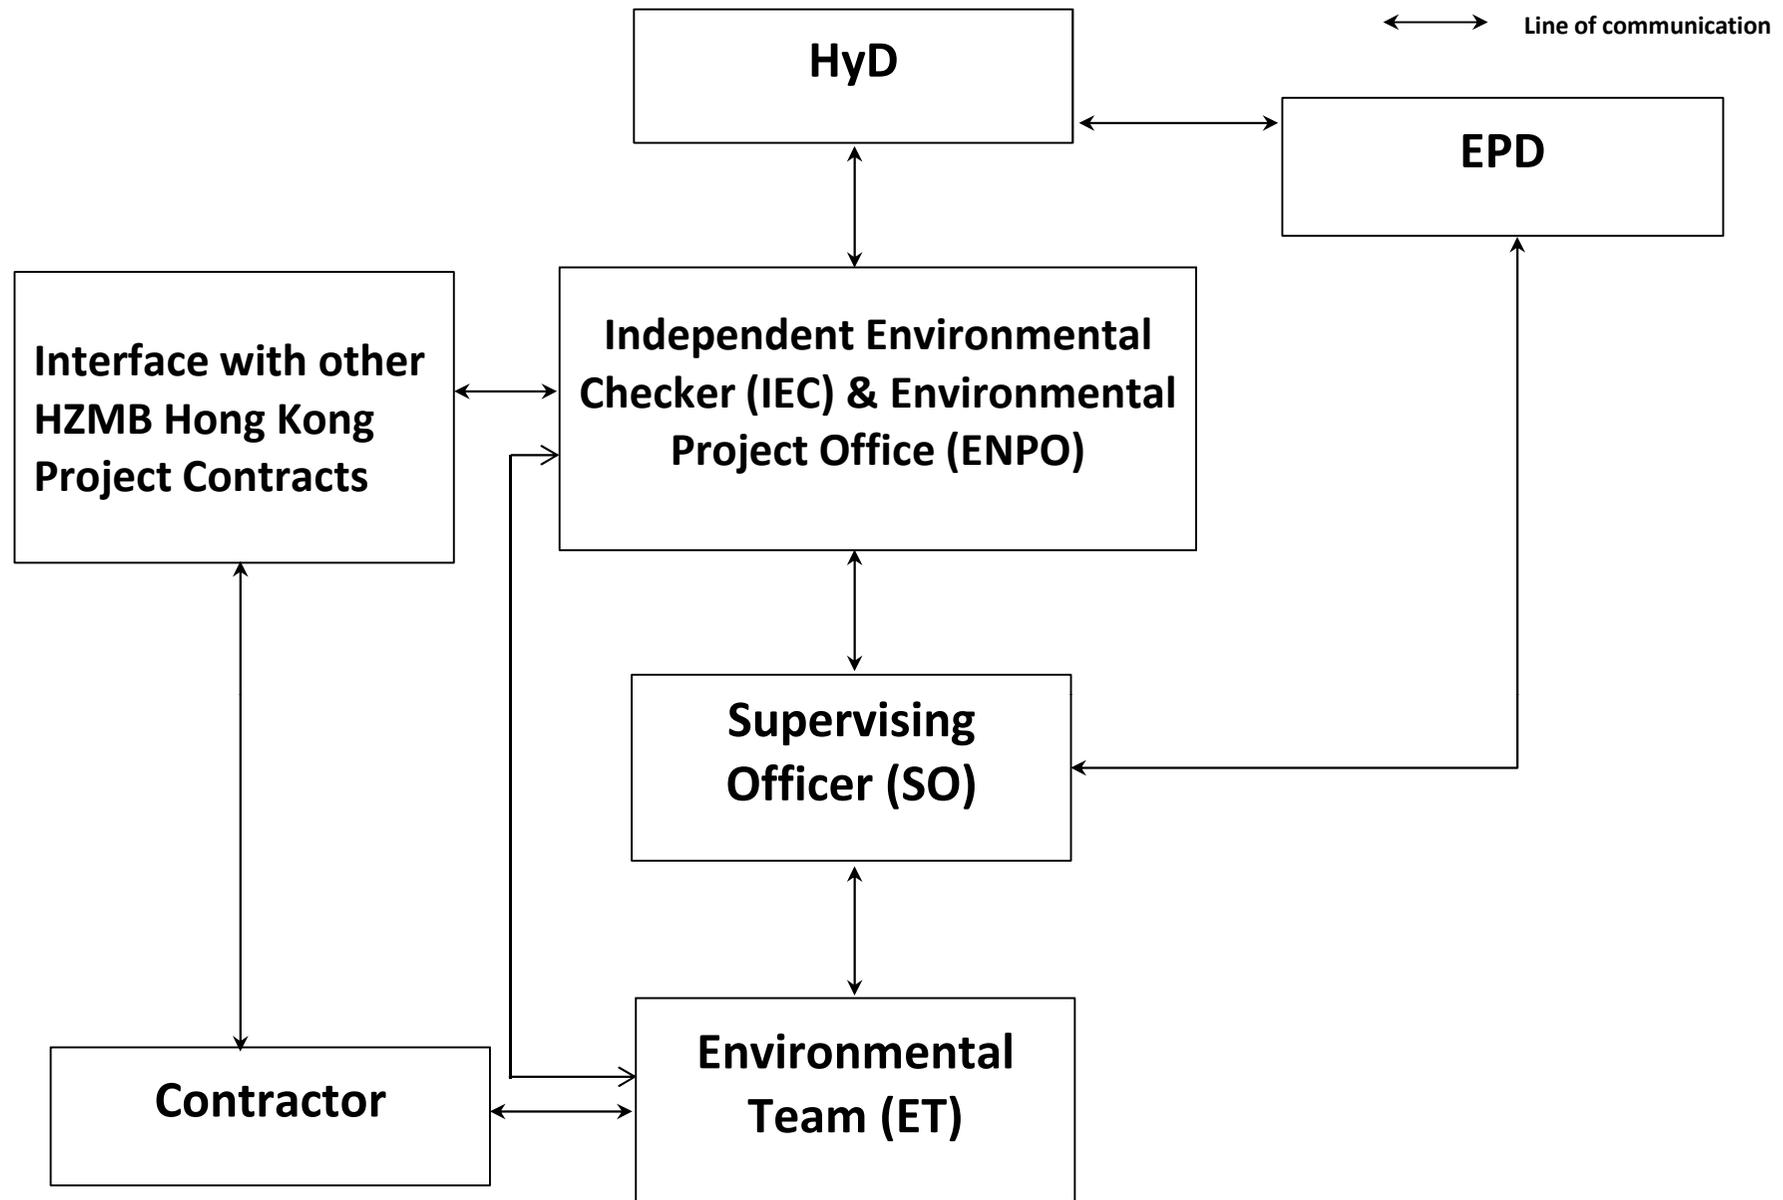


Title
 Contract No. HY/2011/09
 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between
 HKSAR Boundary and Scenic Hill
 Project Organisation for Environmental Works


Scale
 N.T.S
 Date
 Feb-13

Propose
 No. MA12014
 Figure
 2



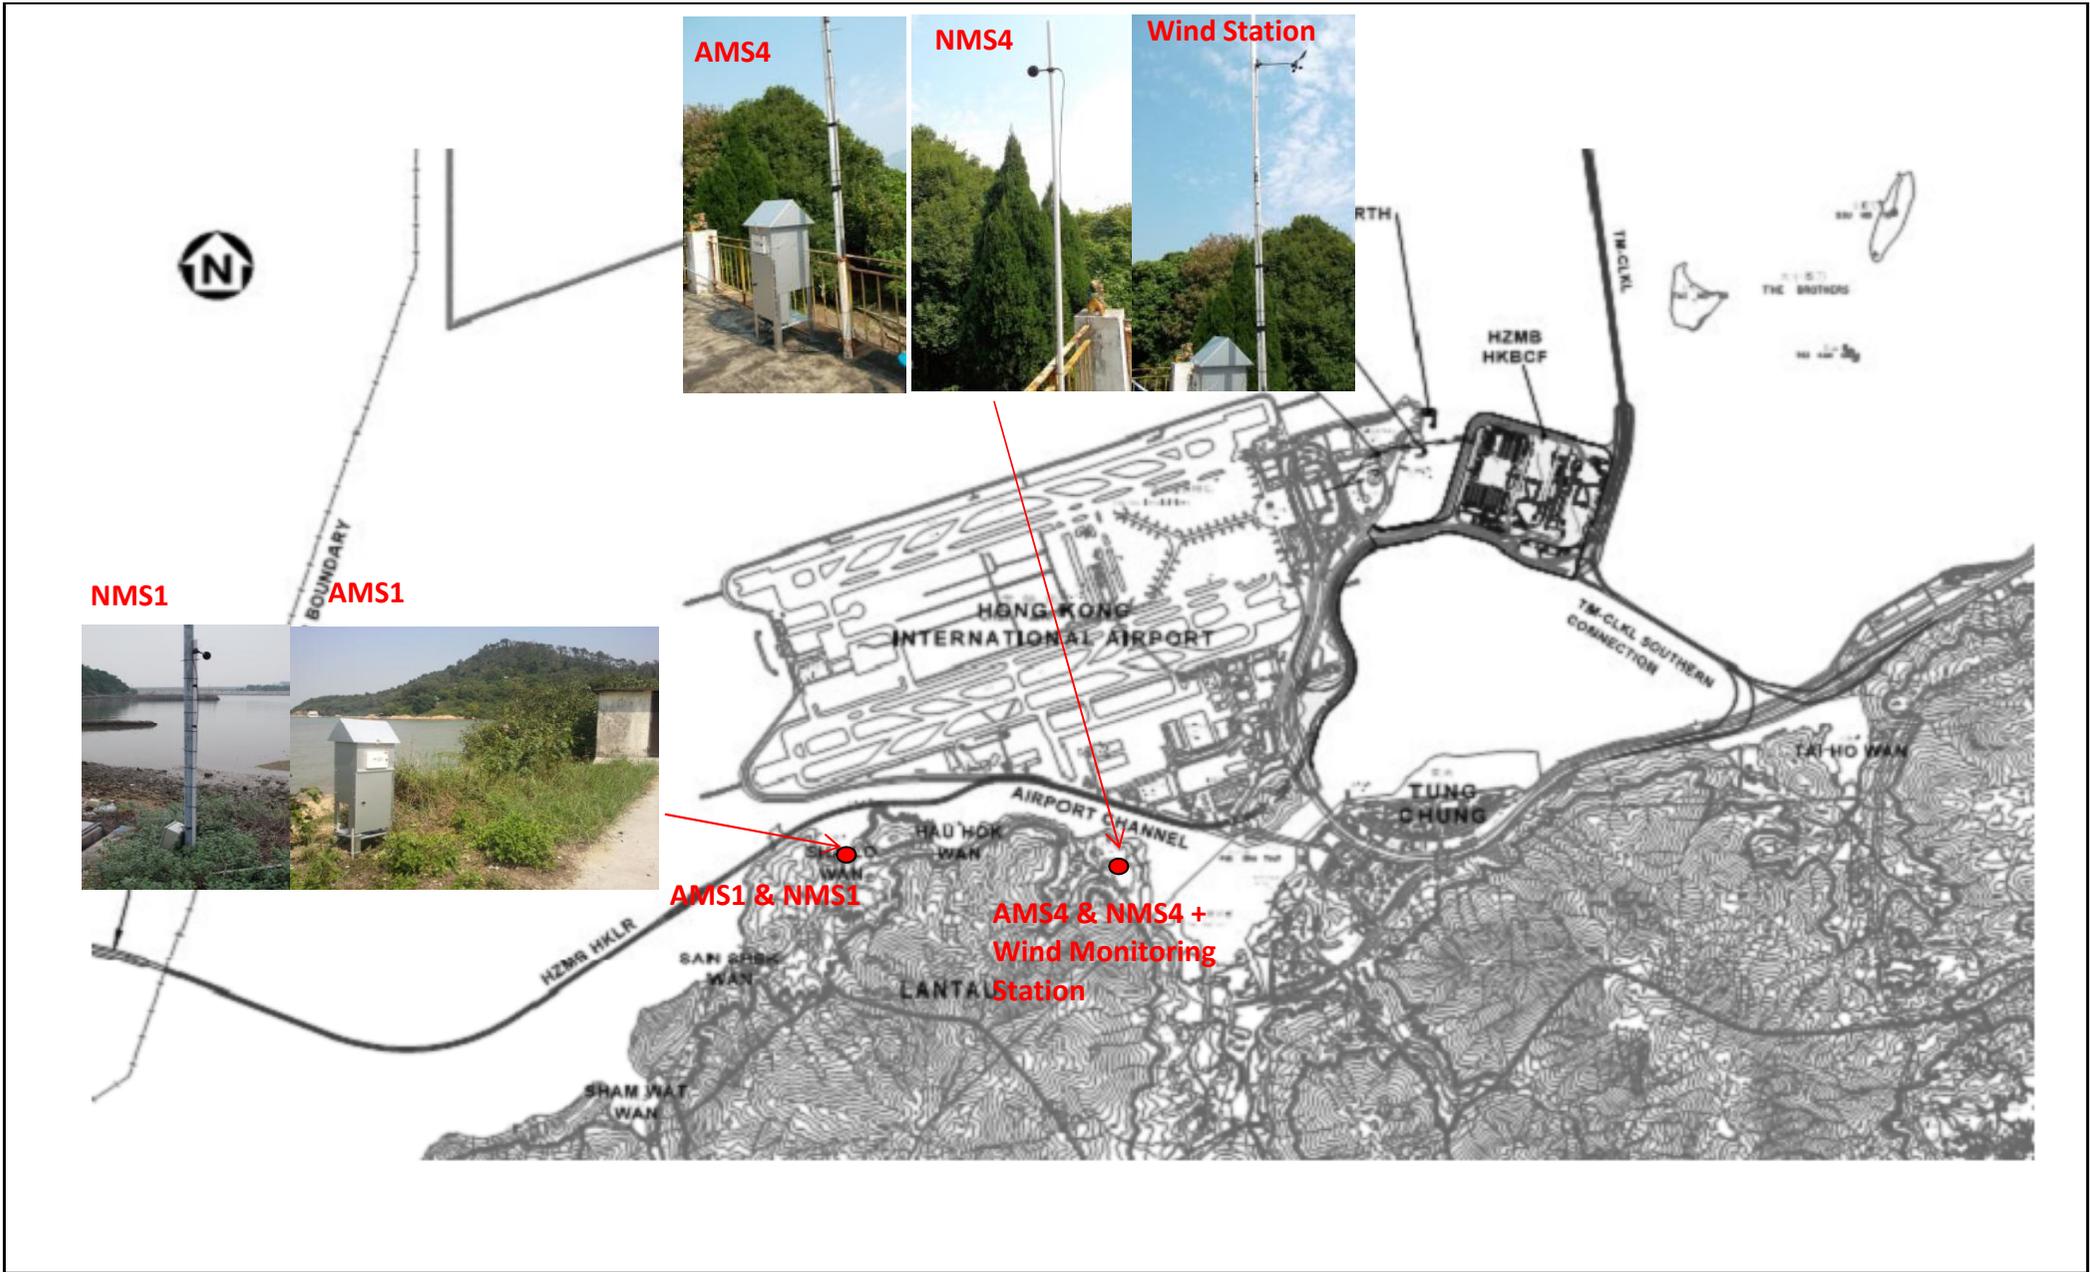

Title	Contract No. HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill		Scale	N.T.S	Propose No.	MA12014	CINOTECH
	Locations of Air Quality and Noise Monitoring Stations		Date	Feb-13	Figure	3	

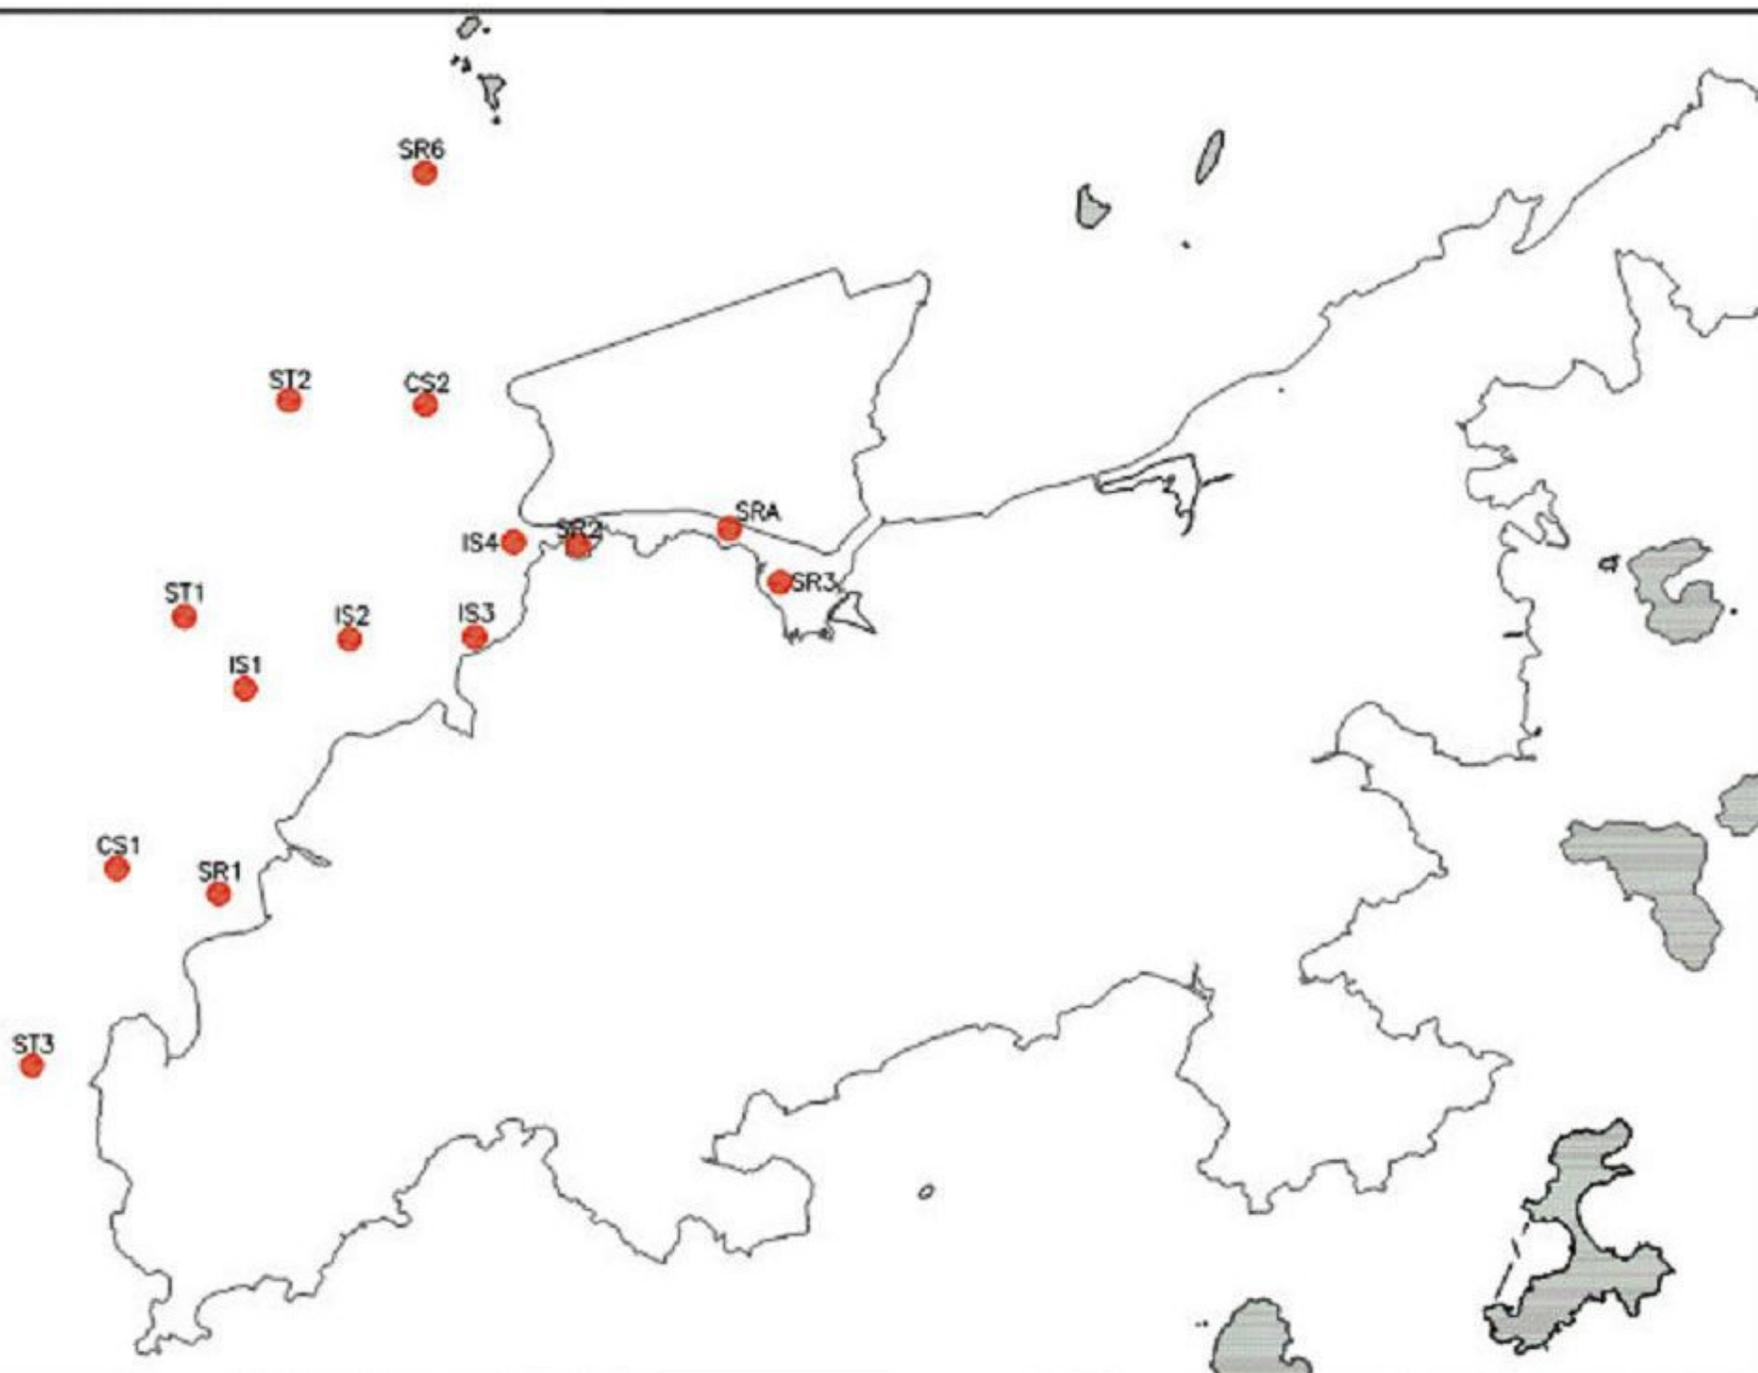

CINOTECH
Cinotech Consultants Limited

Contract No. HY/2011/09
Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road - Section
Between HKSAR Boundary and Scenic Hill
Locations of Marine Water Quality Monitoring Stations

SCALE	N.T.S	DATE	28 Jan 2013
CHECK	PC	DRAWN	IT
PROJECT NO.	MA12014	FIGURE NO.	4
		REV	-

**APPENDIX A
CONSTRUCTION PROGRAMME**



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1512 Start	1512 Finish	DWP01f Start	DWP01f Finish	2015				2016											
									December				January				February				March			
									30	07	14	21	28	04	11	18	25	01	08	15	22	29	07	14
HKZB Hong Kong Link Road - 3 Months Rolling Programme 1512 (based on DWP_01_f Final)																								
Project Key Dates																								
KD1035	Completion of Stage 4 of Works (1368d) Complete provisions for TCSS within Stage 4 29/2/16	0	0	0%		29/2/16*		29/2/16									◆	Completion of Stage 4						
Design and Design Checking of the Works																								
General Design Submission																								
GDS1150	Seismic Performance Assessment Report of Bridge/Viaduct	0	0	0%		28/12/15*		31/5/15									◆	Seismic Performance Assessment Report of Bridge/Viaduct						
Procurement and Fabrication																								
PGS2488	Fabrication & Deliver Lift Frames LF1_2	90	5	95%	2/3/15 A	1/1/16	31/5/15	28/8/15									◆	Fabrication & Deliver Lift Frames LF1_2						
Segment Casting																								
Type A Segment (2 set SOP, 8 set Field Seg.)																								
SC5068	Segment Casting for P15 SOP	14	14	0%	17/3/16	31/3/16	2/12/15	16/12/15									◆	Segment Casting for P15 SOP						
SC5088	Segment Casting for P16 SOP	7	7	0%	10/3/16	17/3/16	25/11/15	2/12/15									◆	Segment Casting for P16 SOP						
SC5108	Segment Casting for P21 SOP	7	7	0%	3/3/16	10/3/16	18/11/15	25/11/15									◆	Segment Casting for P21 SOP						
SC5128	Segment Casting for P22 SOP	14	14	0%	18/2/16	3/3/16	4/11/15	18/11/15									◆	Segment Casting for P22 SOP						
SC5138	Segment Casting for P22 field segment	30	30	0%	3/3/16	2/4/16	21/1/16	27/2/16									◆	Segment Casting for P22 field segment						
SC5148	Segment Casting for P23 SOP	14	14	0%	28/1/16	18/2/16	21/10/15	4/11/15									◆	Segment Casting for P23 SOP						
SC5168	Segment Casting for P24 SOP	14	14	0%	7/1/16	21/1/16	16/9/15	30/9/15									◆	Segment Casting for P24 SOP						
SC5178	Segment Casting for P24 field segment	60	60	0%	21/1/16	28/3/16	22/10/15	20/12/15									◆	Segment Casting for P24 field segment						
SC5188	Segment Casting for P25 SOP	14	4	75%	8/9/15 A	7/1/16	2/9/15	16/9/15									◆	Segment Casting for P25 SOP						
SC5198	Segment Casting for P25 field segment	30	20	32.5%	5/11/15 A	16/3/16	14/10/15	13/11/15									◆	Segment Casting for P25 field segment						
SC5208	Segment Casting for P26 SOP	14	0	100%	8/8/15 A	15/12/15 A	19/8/15	2/9/15									◆	Segment Casting for P26 SOP						
SC5218	Segment Casting for P26 field segment	30	22	27.5%	27/10/15 A	16/2/16	3/10/15	2/11/15									◆	Segment Casting for P26 field segment						
SC5228	Segment Casting for P27 SOP	14	0	100%	16/7/15 A	6/12/15 A	19/7/15	1/8/15									◆	Segment Casting for P27 SOP						
SC5238	Segment Casting for P27 field segment	30	15	50%	24/10/15 A	24/2/16	14/9/15	14/10/15									◆	Segment Casting for P27 field segment						
SC5258	Segment Casting for P28 field segment	30	15	50%	4/9/15 A	18/1/16	3/9/15	3/10/15									◆	Segment Casting for P28 field segment						
SC5268	Segment Casting for P29 SOP	14	7	50%	15/12/15 A	3/1/16	21/6/15	4/7/15									◆	Segment Casting for P29 SOP						
SC5278	Segment Casting for P29 field segment	30	30	0%	4/1/16	2/2/16	15/8/15	14/9/15									◆	Segment Casting for P29 field segment						
SC5298	Segment Casting for P30 field segment	30	3	90%	23/9/15 A	30/12/15	4/8/15	3/9/15									◆	Segment Casting for P30 field segment						
SC5318	Segment Casting for P31 field segment	30	1	97.5%	29/6/15 A	28/12/15	16/7/15	15/8/15									◆	Segment Casting for P31 field segment						
SC5338	Segment Casting for P32 field segment	30	0	100%	24/8/15 A	27/12/15 A	5/7/15	4/8/15									◆	Segment Casting for P32 field segment						
SC5798	Segment Casting for P56 field segment	30	0	100%	19/9/15 A	23/12/15 A	22/11/15	22/12/15									◆	Segment Casting for P56 field segment						

DWP_01f Programme
 Remaining Work
 ◆ Milestone

Actual Work
 Critical Remaining Work

Date	Revision	Checked	Approved
4/1/16	1512 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1512 Start	1512 Finish	DWP01f Start	DWP01f Finish	2015												2016											
									December				January				February				March				April				May			
									30	07	14	21	28	04	11	18	25	01	08	15	22	29	05	12	19	26	02	09	16	23	30	06
SC5818	Segment Casting for P57 field segment	30	12	58.4%	10/10/15 A	29/2/16	22/12/15	21/1/16	[Gantt chart bars for SC5818]																							
SC5828	Segment Casting for P58 SOP	14	0	100%	1/7/15 A	24/12/15 A	30/9/15	14/10/15	[Gantt chart bars for SC5828]																							
SC5838	Segment Casting for P58 field segment	30	15	50%	26/10/15 A	31/3/16	5/12/15	4/1/16	[Gantt chart bars for SC5838]																							
SC6008	Segment Casting for P67 SOP	7	7	0%	21/1/16	28/1/16	14/10/15	21/10/15	[Gantt chart bars for SC6008]																							
Type B Segment (1 set)																																
SC6149	Segment Casting for P55 field segment	108	54	50%	7/7/14 A	2/4/17	13/5/15	28/8/15	[Gantt chart bars for SC6149]																							
SC6169	Segment Casting for P57 field segment	108	81	25%	29/8/15 A	24/3/16	23/6/15	9/10/15	[Gantt chart bars for SC6169]																							
SC6179	Segment Casting for P58 field segment	108	30	72.2%	12/5/15 A	24/4/16	13/5/15	28/8/15	[Gantt chart bars for SC6179]																							
SC6189	Segment Casting for P59 field segment	114	0	100%	3/1/15 A	2/12/15 A	13/5/15	3/9/15	[Gantt chart bars for SC6189]																							
Type C Segment (2 set_Modify by Type D)																																
SC6228	Segment Casting for P67 SOP	10	10	0%	9/3/16	19/3/16	8/1/16	18/1/16	[Gantt chart bars for SC6228]																							
SC6229	Segment Casting for P67 field segment	20	20	0%	19/3/16	8/4/16	18/1/16	14/2/16	[Gantt chart bars for SC6229]																							
SC6238	Segment Casting for P70 SOP	20	20	0%	28/12/15*	16/1/16	10/7/15	29/7/15	[Gantt chart bars for SC6238]																							
SC6239	Segment Casting for P70 field segment	40	40	0%	17/1/16	3/3/16	30/7/15	7/9/15	[Gantt chart bars for SC6239]																							
SC6248	Segment Casting for P74 SOP	20	20	0%	2/1/16	22/1/16	9/11/15	29/11/15	[Gantt chart bars for SC6248]																							
SC6249	Segment Casting for P74 field segment	40	40	0%	22/1/16	9/3/16	29/11/15	8/1/16	[Gantt chart bars for SC6249]																							
Type CV Segment (1 set)																																
SC6268	Segment Casting for P81 SOP (CV)	40	40	0%	4/3/16	12/4/16	8/9/15	17/10/15	[Gantt chart bars for SC6268]																							
Type D Segment (2 set)																																
SC6089	Segment Casting for P61 field segment	75	6	92.5%	11/5/15 A	2/1/16	13/5/15	26/7/15	[Gantt chart bars for SC6089]																							
Type E Segment (4 set for E & 2 set for EV)																																
SC6318	Segment Casting for P87 field segment (EV)	54	44	19.4%	23/11/15 A	28/3/16	3/11/15	27/12/15	[Gantt chart bars for SC6318]																							
SC6328	Segment Casting for P88 field segment (EV)	54	41	25%	8/11/15 A	6/2/16	10/9/15	3/11/15	[Gantt chart bars for SC6328]																							
SC6338	Segment Casting for P89 field segment	27	27	0%	15/3/16	11/4/16	16/1/16	19/2/16	[Gantt chart bars for SC6338]																							
SC6348	Segment Casting for P90 field segment	27	27	0%	17/2/16	15/3/16	20/12/15	16/1/16	[Gantt chart bars for SC6348]																							
SC6358	Segment Casting for P91 field segment	27	25	5.6%	23/12/15 A	17/2/16	23/11/15	20/12/15	[Gantt chart bars for SC6358]																							
SC6368	Segment Casting for P92 field segment	3	3	0%	13/1/16	16/1/16	20/11/15	23/11/15	[Gantt chart bars for SC6368]																							
SC6378	Segment Casting for P93 field segment	27	14	47.2%	20/11/15 A	13/1/16	24/10/15	20/11/15	[Gantt chart bars for SC6378]																							
SC6388	Segment Casting for P94 field segment	27	2	91.7%	25/10/15 A	30/12/15	27/9/15	24/10/15	[Gantt chart bars for SC6388]																							
SC6408	Segment Casting for P96 field segment	27	0	100%	29/9/15 A	6/12/15 A	4/8/15	31/8/15	[Gantt chart bars for SC6408]																							
Type CH&CHV Segment (2 set SOP & 10 set Field Seg.)																																

DWP_01f Programme
 Remaining Work
 ◆ Milestone

Actual Work
 Critical Remaining Work

3MRP DWP_01f 1512

Date	Revision	Checked	Approved
4/1/16	1512 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1512 Start	1512 Finish	DWP01f Start	DWP01f Finish	2015															
									December				January				February				March			
									30	07	14	21	28	04	11	18	25	01	08	15	22	29	07	14
Pier P5L/R																								
Column Construction																								
WW1460	Construct column P5 - 2 nos. (in-situ section)	12	0	100%	25/11/15 A	10/12/15 A	8/10/15	24/10/15	Construct column P5 - 2 nos. (in-situ section)															
WW9000	Install base precast column segment at P5	1	1	0%	19/1/16	19/1/16	16/11/15	17/11/15	Install base precast column segment at P5															
WW9002	Align & cast stitch for base column segment at P5	8	8	0%	20/1/16	28/1/16	17/11/15	26/11/15	Align & cast stitch for base column seg															
WW9004	Install remain precast column & column head segment at P5	3	3	0%	21/3/16	23/3/16	22/12/15	24/12/15	Install remain precast column & column head segment at P5															
WW9010	Prestress works & infill concrete at P5	34	34	0%	24/3/16	9/5/16	28/12/15	5/2/16	Prestress works & infill concrete at P5															
Pier P6L/R																								
Column Construction																								
WW9020	Install base precast column segment at P6	1	1	0%	29/1/16	29/1/16	16/11/15	17/11/15	Install base precast column segment at P6															
WW9022	Align & cast stitch for base column segment at P6	8	8	0%	30/1/16	11/2/16	17/11/15	26/11/15	Align & cast stitch for base column segment at P6															
WW9024	Install remain precast column & column head segment at P6	3	3	0%	22/2/16	25/2/16	15/12/15	17/12/15	Install remain precast column & column head segment at P6															
WW9030	Prestress works & infill concrete at P6	34	34	0%	25/2/16	9/4/16	18/12/15	29/1/16	Prestress works & infill concrete at P6															
Pier P7L/R																								
Column Construction																								
WW9040	Install base precast column segment at P7	1	1	0%	28/12/15	28/12/15	26/10/15	27/10/15	Install base precast column segment at P7															
WW9042	Align & cast stitch for base column segment at P7	8	8	0%	29/12/15	7/1/16	27/10/15	5/11/15	Align & cast stitch for base column segment at P7															
WW9044	Install remain precast column & column head segment at P7	3	3	0%	21/1/16	25/1/16	19/11/15	23/11/15	Install remain precast column & column head segment at P7															
WW9050	Prestress works & infill concrete at P7	40	40	0%	25/1/16	15/3/16	23/11/15	12/1/16	Prestress works & infill concrete at P7															
ML02L/R 75mx8 - Stage 4 of Works																								
Pier P8L/R (M.J.)																								
Column Construction																								
WW9060	Install base precast column segment at P8	1	1	0%	8/1/16	8/1/16	5/11/15	6/11/15	Install base precast column segment at P8															
WW9062	Align & cast stitch for base column segment at P8	8	8	0%	9/1/16	18/1/16	6/11/15	16/11/15	Align & cast stitch for base column segment at P8															
WW9064	Install remain precast column & column head segment at P8	3	3	0%	15/2/16	18/2/16	30/11/15	2/12/15	Install remain precast column & column head segment at P8															
WW9070	Prestress works & infill concrete at P8	40	40	0%	18/2/16	9/4/16	3/12/15	21/1/16	Prestress works & infill concrete at P8															
Pier P9L/R																								
Column Construction																								
WW9080	Install base precast column segment at P9	1	1	0%	19/1/16	19/1/16	5/11/15	6/11/15	Install base precast column segment at P9															
WW9082	Align & cast stitch for base column segment at P9	8	8	0%	20/1/16	28/1/16	6/11/15	16/11/15	Align & cast stitch for base column segment at P9															
WW9084	Install remain precast column & column head segment at P9	3	3	0%	27/2/16	1/3/16	20/11/15	24/11/15	Install remain precast column & column head segment at P9															

DWP_01f Programme
 Remaining Work
 ◆ Milestone

Actual Work
 Critical Remaining Work

3MRP DWP_01f 1512

Date	Revision	Checked	Approved
4/1/16	1512 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1512 Start	1512 Finish	DWP01f Start	DWP01f Finish	2015												2016																			
									December				January				February				March				December				January				February				March			
									30	07	14	21	28	04	11	18	25	01	08	15	22	29	05	12	19	26	02	09	16	23	30	06	13	20	27	03	10	17	24	31
WW9090	Prestress works & infill concrete at P9	40	40	0%	2/3/16	22/4/16	24/11/15	13/1/16	[Gantt bar: Dec 24 to Jan 13]																															
Pier P10L/R																																								
Column Construction																																								
WW9100	Install base precast column segment at P10	1	1	0%	8/1/16	8/1/16	26/10/15	27/10/15	[Gantt bar: Dec 26 to Dec 27]																															
WW9102	Align & cast stitch for base column segment at P10	8	8	0%	9/1/16	18/1/16	27/10/15	5/11/15	[Gantt bar: Dec 27 to Jan 5]																															
WW9104	Install remain precast column & column head segment at P10	3	3	0%	27/2/16	1/3/16	19/11/15	21/11/15	[Gantt bar: Dec 19 to Dec 21]																															
WW9110	Prestress works & infill concrete at P10	34	34	0%	2/3/16	14/4/16	23/11/15	4/1/16	[Gantt bar: Dec 23 to Jan 4]																															
Pier P11L/R																																								
Column Construction																																								
WW9120	Install base precast column segment at P11	1	1	0%	28/12/15	28/12/15	13/10/15	14/10/15	[Gantt bar: Dec 28 to Dec 29]																															
WW9122	Align & cast stitch for base column segment at P11	8	8	0%	29/12/15	7/1/16	14/10/15	26/10/15	[Gantt bar: Dec 29 to Jan 7]																															
WW9124	Install remain precast column & column head segment at P11	3	3	0%	27/2/16	2/3/16	9/11/15	11/11/15	[Gantt bar: Dec 27 to Dec 29]																															
WW9130	Prestress works & infill concrete at P11	34	34	0%	2/3/16	15/4/16	12/11/15	21/12/15	[Gantt bar: Dec 12 to Dec 21]																															
Pier P12L/R																																								
Column Construction																																								
WW9140	Install base precast column segment at P12	1	0	100%	28/11/15 A	28/11/15 A	13/10/15	14/10/15	[Gantt bar: Dec 28 to Dec 29]																															
WW9142	Align & cast stitch for base column segment at P12	8	0	100%	30/11/15 A	4/12/15 A	14/10/15	26/10/15	[Gantt bar: Dec 30 to Jan 4]																															
WW9144	Install remain precast column & column head segment at P12	3	3	0%	6/2/16	12/2/16	12/11/15	14/11/15	[Gantt bar: Dec 12 to Dec 14]																															
WW9150	Prestress works & infill concrete at P12	34	34	0%	13/2/16	23/3/16	16/11/15	24/12/15	[Gantt bar: Dec 16 to Dec 24]																															
Pier P13L/R																																								
Column Construction																																								
WW9170	Prestress works & infill concrete at P13	34	14	60%	26/11/15 A	25/1/16	10/10/15	23/11/15	[Gantt bar: Dec 26 to Jan 23]																															
Pier P14L/R																																								
Column Construction																																								
WW9190	Prestress works & infill concrete at P14	34	20	40%	22/10/15 A	25/1/16	30/9/15	13/11/15	[Gantt bar: Dec 22 to Jan 13]																															
Pier P15L/R																																								
Column Construction																																								
WW9210	Prestress works & infill concrete at P15	52	42	20%	5/11/15 A	18/2/16	25/9/15	2/12/15	[Gantt bar: Dec 5 to Jan 2]																															
ML03L/R 109.661m+150mx3+109.661m Navigation Channel - Stage 4 of Works																																								
Pier P16L/R (M.J.)																																								
Column Construction																																								

DWP_01f Programme
 Remaining Work
 ◆ Milestone

Actual Work
 Critical Remaining Work

3MRP DWP_01f 1512

Page 6 of 17

Date	Revision	Checked	Approved
4/1/16	1512 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1512 Start	1512 Finish	DWP01f Start	DWP01f Finish	2015							2016													
									December				January			February			March										
									30	07	14	21	28	04	11	18	25	01	08	15	22	29	07	14	21				
Pier P29L/R (M.J.)																													
Column Construction																													
WW9412	Bearing Installation - P29	5	5	0%	15/2/16	20/2/16	31/10/15	6/11/15																					
Pier Segment Construction																													
WW5628	Prepare works for precast SOP P29 - 4 nos.	6	6	0%	20/2/16	27/2/16	6/11/15	13/11/15																					
WW5630	Install precast SOP P29 - 4 nos.	3	3	0%	27/2/16	2/3/16	13/11/15	17/11/15																					
WW5632	Insitu works for SOP P29 - 4 nos.	14	14	0%	2/3/16	18/3/16	17/11/15	3/12/15																					
Pier P30L/R																													
Column Construction																													
WW9432	Bearing Installation - P30	5	5	0%	20/1/16	26/1/16	30/10/15	5/11/15																					
Pier Segment Construction																													
WW5708	Prepare works for precast SOP P30 - 4 nos.	6	6	0%	26/1/16	2/2/16	5/11/15	12/11/15																					
WW5710	Install precast SOP P30 - 4 nos.	3	3	0%	2/2/16	5/2/16	12/11/15	16/11/15																					
WW5712	Insitu works for SOP P30 - 4 nos.	14	14	0%	5/2/16	25/2/16	16/11/15	2/12/15																					
Pier P31L/R																													
Pier Segment Construction																													
WW5788	Prepare works for precast SOP P31 - 4 nos.	11	11	0%	18/2/16	1/3/16	30/10/15	11/11/15																					
WW5790	Install precast SOP P31 - 4 nos.	3	3	0%	2/3/16	4/3/16	12/11/15	14/11/15																					
WW5792	Insitu works for SOP P31 - 4 nos.	8	8	0%	5/3/16	14/3/16	16/11/15	24/11/15																					
Pier P32L/R																													
Column Construction																													
WW9470	Prestress works & infill concrete at P32	34	0	100%	26/3/15 A	30/11/15 A	4/5/15	16/6/15																					
Pier Segment Construction																													
WW5868	Prepare works for precast SOP P32 - 4 nos.	11	11	0%	29/1/16	15/2/16	16/10/15	31/10/15																					
WW5870	Install precast SOP P32 - 4 nos.	3	3	0%	15/2/16	18/2/16	31/10/15	4/11/15																					
WW5872	Insitu works for SOP P32 - 4 nos.	8	8	0%	18/2/16	27/2/16	4/11/15	13/11/15																					
Pier P33L/R																													
Pier Segment Construction																													
WW5952	Insitu works for SOP P33 - 4 nos.	8	2	75%	14/11/15 A	2/2/16	3/11/15	12/11/15																					
Pier P34L/R																													
Pier Segment Construction																													

DWP_01f Programme
 Remaining Work
 ◆ Milestone
 Actual Work
 Critical Remaining Work

Date	Revision	Checked	Approved
4/1/16	1512 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1512 Start	1512 Finish	DWP01f Start	DWP01f Finish	2015												2016											
									December				January				February				March				April				May			
									30	07	14	21	28	04	11	18	25	01	08	15	22	29	05	12	19	26	02	09	16	23	30	06
WW6032	Insitu works for SOP P34 - 4 nos.	8	0	100%	9/11/15 A	11/12/15 A	22/10/15	31/10/15	Insitu works for SOP P34 - 4 nos.																							
Pier P35L/R																																
Pier Segment Construction																																
WW6112	Insitu works for SOP P35 - 4 nos.	8	0	100%	4/11/15 A	12/12/15 A	6/10/15	16/10/15	Insitu works for SOP P35 - 4 nos.																							
Pier P36L/R																																
Column Construction																																
WW9552	Bearing Installation - P36	5	5	0%	28/12/15	2/1/16	20/8/15	27/8/15	Bearing Installation - P36																							
Pier Segment Construction																																
WW6187	Prepare works for precast SOP P36 - 4 nos.	6	0	100%	7/12/15 A	14/12/15 A	27/8/15	4/9/15	Prepare works for precast SOP P36 - 4 nos.																							
WW6190	Install precast SOP P36 - 4 nos.	3	0	100%	15/12/15 A	17/12/15 A	4/9/15	9/9/15	Install precast SOP P36 - 4 nos.																							
WW6192	Insitu works for SOP P36 - 4 nos.	14	13	5%	21/12/15 A	15/2/16	9/9/15	30/9/15	Insitu works for SOP P36 - 4 nos.																							
ML06L/R 74.5mx8 - Stage 4 of Works																																
Pier P37L/R (M.J.)																																
Column Construction																																
WW9572	Bearing Installation - P37	5	5	0%	28/12/15	2/1/16	7/8/15	13/8/15	Bearing Installation - P37																							
Pier Segment Construction																																
WW6273	Insitu works for SOP P37 - 4 nos.	14	1	95%	23/11/15 A	4/1/16	27/8/15	15/9/15	Insitu works for SOP P37 - 4 nos.																							
Pier 38L/R																																
Column Construction																																
WW9592	Bearing Installation - P38	5	5	0%	28/12/15	2/1/16	28/7/15	4/8/15	Bearing Installation - P38																							
Pier Segment Construction																																
WW6352	Insitu works for SOP P38 - 4 nos.	14	0	100%	12/10/15 A	3/12/15 A	15/8/15	4/9/15	Insitu works for SOP P38 - 4 nos.																							
ML07L/R 73.396mx8 - Stage 4 of Works																																
Pier P51L/R																																
Pier Segment Construction																																
WW8708	Prepare works for precast SOP P51 - 4 nos.	11	11	0%	5/1/16	18/1/16	26/9/15	15/10/15	Prepare works for precast SOP P51 - 4 nos.																							
WW8710	Install precast SOP P51 - 4 nos.	4	4	0%	18/1/16	22/1/16	15/10/15	22/10/15	Install precast SOP P51 - 4 nos.																							
WW8712	Insitu works for SOP P51 - 4 nos.	7	7	0%	22/1/16	30/1/16	22/10/15	30/10/15	Insitu works for SOP P51 - 4 nos.																							
ML08L/R 70mx6 - Stage 4 of Works																																
Pier P53L/R (M.J.)																																
Column Construction																																

DWP_01f Programme
 Remaining Work
 ◆ Milestone
 Actual Work
 Critical Remaining Work

3MRP DWP_01f 1512

Date	Revision	Checked	Approved
4/1/16	1512 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1512 Start	1512 Finish	DWP01f Start	DWP01f Finish	2015												2016																			
									December				January				February				March				December				January				February				March			
									30	07	14	21	28	04	11	18	25	01	08	15	22	29	07	14	21	28	04	11	18	25	01	08	15	22	29	07	14	21	28	04
Column Construction																																								
WW7995	Bearing Installation - P59	5	5	0%	25/2/16	2/3/16	2/12/15	8/12/15	Bearing Installation - P59																															
WW8785	Bearing Installation - P59N/S	5	5	0%	17/3/16	23/3/16	23/12/15	31/12/15	Bearing Installation - P59N/S																															
Pier Segment Construction																																								
WW8218	Prepare works for precast SOP P59 - 4 nos.	6	6	0%	2/3/16	9/3/16	8/12/15	15/12/15	Prepare works for precast SOP P59 - 4 nos.																															
WW8220	Install precast SOP P59 - 4 nos.	4	4	0%	9/3/16	14/3/16	15/12/15	19/12/15	Install precast SOP P59 - 4 nos.																															
WW8222	Insitu works for SOP P59 - 4 nos.	14	14	0%	14/3/16	2/4/16	19/12/15	8/1/16	Insitu works for SOP P59 - 4 nos.																															
WW8858	Prepare works for precast SOP P59N/S (Turnaround Facility) - 4 nos.	6	6	0%	23/3/16	2/4/16	31/12/15	8/1/16	Prepare works for precast SOP P59N/S (Turnaround Facility) - 4 nos.																															
Pier P61L/R																																								
Pier Segment Construction																																								
WW8228	Prepare works for precast SOP P61 - 4 nos.	11	11	0%	28/12/15	9/1/16	8/7/15	23/7/15	Prepare works for precast SOP P61 - 4 nos.																															
WW8230	Install precast SOP P61 - 4 nos.	4	4	0%	11/1/16	14/1/16	23/7/15	29/7/15	Install precast SOP P61 - 4 nos.																															
WW8232	Insitu works for SOP P61 - 4 nos.	10	10	0%	15/1/16	26/1/16	29/7/15	12/8/15	Insitu works for SOP P61 - 4 nos.																															
ML10L/R 115m+180m+115m - Stage 4 of Works																																								
Pier P67L/R (M.J.)																																								
Column Construction																																								
AC1052	Construct column P67 - 2 nos. (insitu)	24	12	50%	7/12/15 A	15/2/16	19/11/15	16/12/15	Construct column P67 - 2 nos. (insitu)																															
AC1054	Construct column head P67 - 2 nos. (insitu)	21	21	0%	15/2/16	10/3/16	17/12/15	13/1/16	Construct column head P67 - 2 nos. (insitu)																															
Pier P68L/R																																								
Temporary Works																																								
AC2796	Install cofferdem for pile cap construction - P68L - 1 nos.	60	51	15%	7/10/15 A	29/2/16	22/9/15	8/12/15	Install cofferdem for pile cap construction - P68L - 1 nos.																															
Pile Cap Construction																																								
AC1100	Construct pile cap P68L - 1 nos.	40	40	0%	1/3/16	21/4/16	9/12/15	27/1/16	Construct pile cap P68L - 1 nos.																															
AC2856	Construct pile cap P68R - 1 nos.	40	20	50%	2/12/15 A	23/3/16	29/2/16	20/4/16	Construct pile cap P68R - 1 nos.																															
Pier P69L/R																																								
Pile Cap Construction																																								
AC1140	Construct pile cap P69 - 2 nos.	45	28	37%	2/12/15 A	30/1/16	8/10/15	2/12/15	Construct pile cap P69 - 2 nos.																															
Column Construction																																								
AC1150	Construct column P69 - 4 nos.	80	80	0%	30/1/16	16/5/16	3/12/15	11/3/16	Construct column P69 - 4 nos.																															
ML11L/R 109m+165mx2+109m - Stage 4 of Works																																								
Pier P70L/R (M.J.)																																								

DWP_01f Programme
 Remaining Work
 ◆ Milestone

Actual Work
 Critical Remaining Work

Date	Revision	Checked	Approved
4/1/16	1512 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1512 Start	1512 Finish	DWP01f Start	DWP01f Finish	2015							2016															
									December				January			February			March			January				February			March		
									30	07	14	21	28	04	11	18	25	01	08	15	22	29	07	14	21						
Column Construction																															
AC2519	Bearing Installation - P70	5	5	0%	5/3/16	11/3/16	20/11/15	26/11/15																							
Pier Segment Construction																															
AC1228	Prepare works for precast SOP P70 - 4 nos.	6	6	0%	11/3/16	18/3/16	26/11/15	3/12/15																							
AC1230	Install precast SOP P70 - 4 nos.	3	3	0%	18/3/16	22/3/16	3/12/15	7/12/15																							
AC1232	Insitu works for SOP P70 - 4 nos.	21	21	0%	22/3/16	21/4/16	7/12/15	4/1/16																							
Pier P71L/R																															
Pier Segment Construction																															
AC1312	Insitu works for SOP P71 - 6 nos.	54	11	80%	9/9/15 A	9/1/16	17/7/15	2/10/15	Insitu works for SOP P71 - 6 nos.																						
Pier P72L/R																															
Pier Segment Construction																															
AC1402	Insitu works for SOP P72 - 6 nos.	44	13	70%	22/10/15 A	13/1/16	3/10/15	27/11/15	Insitu works for SOP P72 - 6 nos.																						
Pier P73L/R																															
Pier Segment Construction																															
AC1488	Prepare works for precast SOP P73 - 6 nos.	6	6	0%	28/12/15	4/1/16	9/7/15	16/7/15	Prepare works for precast SOP P73 - 6 nos.																						
AC1490	Install precast SOP P73 - 6 nos.	6	6	0%	5/1/16	11/1/16	17/7/15	24/7/15	Install precast SOP P73 - 6 nos.																						
AC1493	Insitu works for SOP P73 - 6 nos.	54	54	0%	12/1/16	17/3/16	25/7/15	10/10/15	Insitu works for SOP P73 - 6 nos.																						
ML12L/R 109m+165mx2+109m - Stage 4 of Works																															
Pier P74L/R (M.J.)																															
Temporary Works																															
AC1520	Remove cofferdem for pier P74	18	18	0%	28/1/16	22/2/16	19/11/15	9/12/15	Remove cofferdem for pier P74																						
Column Construction																															
AC2676	Construct column P74 - 2 nos. (insitu)	36	6	84%	7/10/15 A	4/1/16	2/9/15	24/10/15	Construct column P74 - 2 nos. (insitu)																						
AC2686	Construct column head P74 - 2 nos. (insitu)	21	21	0%	4/1/16	28/1/16	26/10/15	18/11/15	Construct column head P74 - 2 nos. (insitu)																						
Pier P75L/R																															
Foundation - Bored Pile																															
AC2746	Pile testing P75	28	0	100%	22/8/15 A	3/12/15 A	31/10/15	27/11/15	Pile testing P75																						
Pile Cap Construction																															
AC1650	Construct pile cap P75 - 2 nos.	45	45	0%	28/12/15	22/2/16	28/11/15	22/1/16	Construct pile cap P75 - 2 nos.																						
Column Construction																															
AC1660	Construct column P75 - 4 nos.	77	77	0%	23/2/16	1/6/16	23/1/16	30/4/16	Construct column P75 - 4 nos.																						

DWP_01f Programme
 Remaining Work
 Milestone

Actual Work
 Critical Remaining Work

3MRP DWP_01f 1512

Date	Revision	Checked	Approved
4/1/16	1512 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1512 Start	1512 Finish	DWP01f Start	DWP01f Finish	2015												2016											
									December				January				February				March				April				May			
									30	07	14	21	28	04	11	18	25	01	08	15	22	29	05	12	19	26	02	09	16	23	30	06
Pier P76L/R																																
Temporary Works																																
AC1710	Remove cofferdem for pier P76	18	0	100%	2/11/15 A	9/12/15 A	2/10/15	27/10/15	Remove cofferdem for pier P76																							
Pier Segment Construction																																
AC1758	Prepare works for precast SOP P76 - 6 nos.	6	6	0%	2/1/16	9/1/16	28/10/15	3/11/15	Prepare works for precast SOP P76 - 6 nos.																							
AC1760	Install precast SOP P76 - 6 nos.	6	6	0%	9/1/16	16/1/16	4/11/15	10/11/15	Install precast SOP P76 - 6 nos.																							
AC1762	Insitu works for SOP P76 - 6 nos.	44	44	0%	16/1/16	11/3/16	11/11/15	4/1/16	Insitu works for SOP P76 - 6 nos.																							
Pier P77L/R																																
Pier Segment Construction																																
AC1838	Prepare works for precast SOP P77 - 6 nos.	6	6	0%	11/3/16	17/3/16	14/10/15	22/10/15	Prepare works for precast SOP P77 - 6 nos.																							
AC1840	Install precast SOP P77 - 6 nos.	6	6	0%	18/3/16	24/3/16	23/10/15	29/10/15	Install precast SOP P77 - 6 nos.																							
AC1842	Insitu works & cross beam for SOP P77 - 6 nos.	56	56	0%	25/3/16	8/6/16	30/10/15	6/1/16	Insitu works & cross beam for SOP P77 - 6 nos.																							
ML13L/R 115m+180m+115m - Stage 4 of Works																																
Pier P78L/R (M.J.)																																
Temporary Works																																
AC1880	Remove cofferdem for pier P78	18	18	0%	18/1/16	11/2/16	29/1/16	23/2/16	Remove cofferdem for pier P78																							
Column Construction																																
AC2706	Construct column head P78 - 2 nos. (insitu)	21	18	15%	9/12/15 A	18/1/16	5/1/16	29/1/16	Construct column head P78 - 2 nos. (insitu)																							
Pier P79L/R																																
Pier Segment Construction																																
AC2008	Prepare works for precast SOP P79 - 6 nos.	6	6	0%	15/3/16	22/3/16	9/12/15	15/12/15	Prepare works for precast SOP P79 - 6 nos.																							
AC2010	Install precast SOP P79 - 6 nos.	6	6	0%	22/3/16	1/4/16	16/12/15	22/12/15	Install precast SOP P79 - 6 nos.																							
Pier P80L/R																																
Column Construction																																
AC2080	Construct column P80 - 4 nos.	80	0	100%	2/10/15 A	8/12/15 A	10/11/15	17/2/16	Construct column P80 - 4 nos.																							
ML14L/R 115m+180m+100.561m - Stage 4 of Works																																
Pier P81L/R (M.J.)																																
Temporary Works																																
AC2130	Remove cofferdem and rockfill platform for pier P81	25	25	0%	28/12/15	26/1/16	6/11/15	5/12/15	Remove cofferdem and rockfill platform for pier P81																							
Pier P82L/R																																
Temporary Works																																

DWP_01f Programme
 Remaining Work
 ◆ Milestone

Actual Work
 Critical Remaining Work

Date	Revision	Checked	Approved
4/1/16	1512 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1512 Start	1512 Finish	DWP01f Start	DWP01f Finish	2015												2016											
									December				January				February				March				April				May			
									30	07	14	21	28	04	11	18	25	01	08	15	22	29	05	12	19	26	02	09	16	23	30	06
DC1660	Segment erection P54	20	20	0%	18/1/16	13/2/16	11/11/15	3/12/15	Segment erection P54																							
DC1880	Segment erection P65 (Learning)	30	0	100%	18/9/15 A	3/12/15 A	2/9/15	15/10/15	Segment erection P65 (Learning)																							
DC1900	Segment erection P66	20	7	65%	18/11/15 A	5/1/16	16/10/15	10/11/15	Segment erection P66																							
Lifting Frame Type 3_A/C/D																																
DC1010	Segment erection P49L	20	16	20%	17/12/15 A	1/4/16	23/12/15	18/1/16	Segment erection P49L																							
DC1012	Segment erection P49R	20	12	40%	12/12/15 A	10/3/16	6/11/15	28/11/15	Segment erection P49R																							
DC1030	Segment erection P50 (Learning)	30	30	0%	19/1/16	25/2/16	24/9/15	5/11/15	Segment erection P50 (Learning)																							
DC1800	Segment erection P61	40	40	0%	26/2/16	16/4/16	6/11/15	22/12/15	Segment erection P61																							
DC1820	Segment erection P62 (Learning)	36	18	50%	9/11/15 A	18/1/16	5/8/15	23/9/15	Segment erection P62 (Learning)																							
DC1840	Segment erection P63R	20	0	100%	23/9/15 A	7/12/15 A	19/1/16	13/2/16	Segment erection P63R																							
Segment Erection - Crane																																
Crane Erection (Marine Plant)																																
DC1035	+1 & +2 erection by crane for P52	24	24	0%	28/12/15*	28/1/16	9/12/15	11/1/16	+1 & +2 erection by crane for P52																							
DC1775	+1 & +2 erection by crane for P60	24	24	0%	29/1/16	9/3/16	12/1/16	19/2/16	+1 & +2 erection by crane for P60																							
External PT																																
DC2380	External PT for ML06L/R (Learning)	60	60	0%	14/3/16	2/6/16	15/12/15	29/2/16	External PT for ML06L/R (Learning)																							
Deck Construction between Landing Point on Airport Island and Scenic Hill																																
Segment Erection																																
Segment Erection - Launching Girder																																
Launching Girder No.1																																
DC5130	Segment erection P100	12	0	100%	19/11/15 A	4/12/15 A	14/10/15	29/10/15	Segment erection P100																							
DC5140	Segment erection P99 M.J	10	0	100%	1/12/15 A	15/12/15 A	30/10/15	10/11/15	Segment erection P99 M.J																							
DC5150	Segment erection P98	12	7	38.91%	16/12/15 A	6/1/16	11/11/15	24/11/15	Segment erection P98																							
DC5160	Segment erection P97	12	11	11.09%	22/12/15 A	18/1/16	25/11/15	8/12/15	Segment erection P97																							
DC5170	Segment erection P96	12	12	0%	19/1/16	1/2/16	9/12/15	22/12/15	Segment erection P96																							
DC5180	Segment erection P95	12	12	0%	2/2/16	18/2/16	23/12/15	8/1/16	Segment erection P95																							
DC5190	Segment erection P94	12	12	0%	19/2/16	3/3/16	9/1/16	22/1/16	Segment erection P94																							
DC5200	Segment erection P93	12	12	0%	4/3/16	17/3/16	23/1/16	5/2/16	Segment erection P93																							
DC5210	Segment erection P92 M.J	6	6	0%	18/3/16	24/3/16	6/2/16	16/2/16	Segment erection P92 M.J																							
DC5220	Segment erection P91	12	12	0%	25/3/16	12/4/16	17/2/16	1/3/16	Segment erection P91																							
Segment Erection - Crane Erection for Interface Span P115																																

DWP_01f Programme
 Remaining Work
 ◆ Milestone

Actual Work
 Critical Remaining Work

3MRP DWP_01f 1512

Date	Revision	Checked	Approved
4/1/16	1512 rolling based on DWP01f	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1512 Start	1512 Finish	DWP01f Start	DWP01f Finish	2015												2016											
									December				January				February				March				April				May			
									30	07	14	21	28	04	11	18	25	01	08	15	22	29	05	12	19	26	02	09	16	23	30	06
DC5460	Handover P115 Abutment [by HY/2011/03]	0	0	0%	28/12/15*		15/6/15		Handover P115 Abutment [by HY/2011/03]																							
DC5465	Bearing Installation - P115	10	10	0%	28/12/15	8/1/16	12/8/15	25/8/15	Bearing Installation - P115																							
DC5470	Plant mobilization for P114 & P115 end span erection	14	14	0%	9/1/16	25/1/16	26/8/15	12/9/15	Plant mobilization for P114 & P115 end span erection																							
DC5480	In-situ Deck between Eastern Abutment and P114 +10 Segment	75	75	0%	26/1/16	30/4/16	15/9/15	19/12/15	In-situ Deck between Eastern Abutment and P114 +10 Segment																							
External PT																																
DC5350	External PT for ML17L/R	35	35	0%	29/2/16	13/4/16	30/11/15	12/1/16	External PT for ML17L/R																							
DC5370	External PT for ML18L/R (Learning)	50	50	0%	28/12/15	27/2/16	24/9/15	28/11/15	External PT for ML18L/R (Learning)																							
Parapet and Utility Trough																																
DC5380	Road Barrier & utility trough installation ML18L/R (Learning)	90	90	0%	29/2/16	25/6/16	30/11/15	19/3/16	Road Barrier & utility trough installation ML18L/R (Learning)																							
Movement Joint																																
DC5670	Install Movement Joint - ML18	21	21	0%	29/2/16	23/3/16	30/11/15	23/12/15	Install Movement Joint - ML18																							
E&M Works																																
Summary Bars for Time Chainage Programme																																
Drainage & E&M Works																																
SUM1370	Drainage & E&M works for ML18	476	476	0%	29/2/16	28/11/17	30/11/15	7/7/17	Drainage & E&M works for ML18																							
Re-provisioning Radar at P20																																
EM1000	Re-provisioning the Platform & Radar at Pier P20	90	90	0%	28/12/15	20/4/16	15/9/15	9/1/16	Re-provisioning the Platform & Radar at Pier P20																							
Fire Fighting System																																
FM1170	Firemain installation for ML18	22	22	0%	29/2/16	29/3/16	30/11/15	29/12/15	Firemain installation for ML18																							
Ground Level Road Works																																
RD1090	Modification work for Sha Lo Wan wind profiler station (Wall extension)	120	120	0%	4/1/16*	4/6/16	4/1/16	4/6/16	Modification work for Sha Lo Wan wind profiler station (Wall extension)																							

DWP_01f Programme
 Remaining Work
 ◆ Milestone

Actual Work
 Critical Remaining Work

3MRP DWP_01f 1512

Date	Revision	Checked	Approved
4/1/16	1512 rolling based on DWP01f	Tim	

APPENDIX B
ACTION AND LIMIT LEVELS

Appendix B - Action and Limit Levels

Table B-1 Action and Limit Levels for 1-Hour TSP

Location	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
AMS1	381	500
AMS4	352	

Table B-2 Action and Limit Levels for 24-Hour TSP

Location	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
AMS1	170	260
AMS4	171	

Table B-3 Action and Limit Levels for Construction Noise

Time Period	Action Level	Limit Level
0700-1900 hrs on normal weekdays	When one documented complaint is received	75 dB(A) *

Noted: If works are to be carried during restricted hours, the conditions stipulated in the construction noise permit issued by the Noise Control Authority have to be followed.

(*) reduce to 70 dB(A) for schools and 65 dB(A) during school examination periods.

Table B-4 Action and Limit Levels for Water Quality

Parameter (unit)	Water Depth	Action Level	Limit Level
Dissolved Oxygen (mg/L) (surface, middle, bottom)	Surface and Middle	<u>5.0</u>	4.2 except 5 for FCZ
	Bottom	<u>4.7</u>	3.6
Turbidity (NTU)	Depth average	<u>27.5</u> and 120% of upstream control station's turbidity at the same tide of the same day	<u>47.0</u> and 130% of turbidity at the upstream control station at the same tide of same day
Suspended Solids (mg/L)	Depth average	<u>23.5</u> and 120% of upstream control station's SS at the same tide of the same day	<u>34.4</u> and 130% of SS at the upstream control station at the same tide of same day and 10mg/L for WSD Seawater Intakes

Note:

- (1) Depth-averaged is calculated by taking the arithmetic means of reading of all three depths
- (2) For DO, non-compliance of the water quality limit occurs when monitoring result is lower than the limit.
- (3) For SS & turbidity non-compliance of the water quality limits occur when monitoring result is higher than the limits.
- (4) All the figures given in the table are used for reference only and the EPD may amend the figures whenever it is considered as necessary.
- (5) The 1%-ile of baseline data for dissolved oxygen (surface and middle) and dissolved oxygen (bottom) are 4.2mg/L and 3.6mg/L respectively.

**APPENDIX C
COPIES OF CALIBRATION
CERTIFICATES**

High-Volume TSP Sampler

5-POINT CALIBRATION DATA SHEET

CINOTECH

File No. MA12014/67/0018

Project No. AMS 1 - Sha Lo Wan Operator: WK
 Date: 6-Nov-15 Next Due Date: 5-Jan-16
 Equipment No.: A-01-67 Serial No. 3218

Ambient Condition			
Temperature, Ta (K)	299.7	Pressure, Pa (mmHg)	763.2

Orifice Transfer Standard Information					
Equipment No.:	A-04-06	Slope, mc	0.0593	Intercept, bc	-0.02195
Last Calibration Date:	4-Feb-15	$mc \times Q_{std} + bc = [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	3-Feb-16	$Q_{std} = \{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$			

Calibration of TSP Sampler					
Calibration Point	Orifice			HVS	
	ΔH (orifice), in. of water	$[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$	Qstd (CFM) X - axis	ΔW (HVS), in. of water	$[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$ Y-axis
1	11.6	3.40	57.80	6.8	2.61
2	9.8	3.13	53.15	5.7	2.39
3	7.9	2.81	47.76	4.6	2.14
4	5.1	2.26	38.45	3.2	1.79
5	3.2	1.79	30.53	1.9	1.38


By Linear Regression of Y on X

Slope, $m_w =$ 0.0441 Intercept, $b_w =$ 0.0535
 Correlation coefficient* = 0.9987

*If Correlation Coefficient < 0.990, check and recalibrate.

Set Point Calculation
From the TSP Field Calibration Curve, take $Q_{std} = 43$ CFM
From the Regression Equation, the "Y" value according to
$m_w \times Q_{std} + b_w = [\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$
Therefore, Set Point; $W = (m_w \times Q_{std} + b_w)^2 \times (760 / Pa) \times (Ta / 298) =$ <u>3.80</u>

Remarks: _____

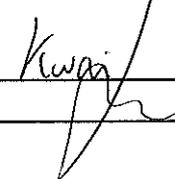Conducted by: Wk Tang Signature:  Date: 6/11/15
 Checked by: AS Signature: _____ Date: 6 November 2015

High-Volume TSP Sampler

5-POINT CALIBRATION DATA SHEET

CINOTECH

File No. MA12014/74/0018

Project No. AMS 4 - San Tau Operator: WK
 Date: 6-Nov-15 Next Due Date: 5-Jan-16
 Equipment No.: A-01-74 Serial No. 2202

Ambient Condition			
Temperature, Ta (K)	299.8	Pressure, Pa (mmHg)	763.4

Orifice Transfer Standard Information					
Equipment No.:	A-04-06	Slope, mc	0.0593	Intercept, bc	-0.02195
Last Calibration Date:	4-Feb-15	$mc \times Qstd + bc = [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	3-Feb-16	$Qstd = \{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$			

Calibration of TSP Sampler					
Calibration Point	Orifice			HVS	
	ΔH (orifice), in. of water	[ΔH x (Pa/760) x (298/Ta)] ^{1/2}	Qstd (CFM) X - axis	ΔW (HVS), in. of water	[ΔW x (Pa/760) x (298/Ta)] ^{1/2} Y-axis
1	11.5	3.39	57.55	7.9	2.81
2	9.8	3.13	53.15	6.8	2.61
3	7.4	2.72	46.24	5.1	2.26
4	5.2	2.28	38.82	3.3	1.82
5	3.4	1.84	31.46	2.2	1.48

By Linear Regression of Y on X
 Slope, mw = 0.0519 Intercept, bw = -0.1627
 Correlation coefficient* = 0.9991
 *If Correlation Coefficient < 0.990, check and recalibrate.

Set Point Calculation

From the TSP Field Calibration Curve, take Qstd = 43 CFM
 From the Regression Equation, the "Y" value according to

$$mw \times Qstd + bw = [\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point; W = (mw x Qstd + bw)² x (760 / Pa) x (Ta / 298) = 4.28

Remarks: _____

Conducted by: Wk Tang Signature: [Signature] Date: 6/11/15
 Checked by: [Signature] Signature: [Signature] Date: 6 November 2015



Equipment No A-04-06

TISCH ENVIRONMENTAL, INC.
 145 SOUTH MIAMI AVE
 VILLAGE OF CLEVELAND, OH
 45002
 513.467.9000
 877.263.7610 TOLL FREE
 513.467.9009 FAX

ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

Date - Feb 04, 2015 Rootmeter S/N 0438320 Ta (K) - 293
 Operator Tisch Orifice I.D. - 2896 Pa (mm) - 756.92

PLATE OR Run #	VOLUME START (m3)	VOLUME STOP (m3)	DIFF VOLUME (m3)	DIFF TIME (min)	METER	ORFICE
					DIFF Hg (mm)	DIFF H2O (in.)
1	NA	NA	1.00	1.4590	3.2	2.00
2	NA	NA	1.00	1.0330	6.4	4.00
3	NA	NA	1.00	0.9250	7.9	5.00
4	NA	NA	1.00	0.8800	8.8	5.50
5	NA	NA	1.00	0.7260	12.7	8.00

DATA TABULATION

Vstd	(x axis) Qstd	(y axis)	Va	(x axis) Qa	(y axis)
1.0086	0.6913	1.4233	0.9958	0.6825	0.8799
1.0044	0.9723	2.0129	0.9916	0.9599	1.2443
1.0023	1.0835	2.2505	0.9895	1.0697	1.3912
1.0011	1.1377	2.3603	0.9884	1.1231	1.4591
0.9959	1.3718	2.8467	0.9832	1.3542	1.7598
Qstd slope (m) = 2.09317			Qa slope (m) = 1.31071		
intercept (b) = -0.02195			intercept (b) = -0.01357		
coefficient (r) = 0.99997			coefficient (r) = 0.99997		
y axis = SQRT[H2O(Pa/760)(298/Ta)]			y axis = SQRT[H2O(Ta/Pa)]		

CALCULATIONS

Vstd = Diff. Vol [(Pa-Diff. Hg)/760] (298/Ta)
 Qstd = Vstd/Time

Va = Diff Vol [(Pa-Diff Hg)/Pa]
 Qa = Va/Time

For subsequent flow rate calculations:

Qstd = 1/m{ [SQRT(H2O(Pa/760)(298/Ta))] - b }
 Qa = 1/m{ [SQRT H2O(Ta/Pa)] - b }



Calibration Certificate

Certificate No. **506584**

Page 1 of 2 Pages

Customer : Dragages - China Harbour - VSL Joint Venture

Address : 3/F., Island Place Tower, 510 King's Road, North Point, H. K.

Order No. : Q52586

Date of receipt : 31-Jul-15

Item Tested

Description : Weather Stations,Vantage Pro2

Manufacturer : Davis

Model : 6152 CUK

Serial No. : AK130520006

Test Conditions

Date of Test : 3-Aug-15

Supply Voltage : --

Ambient Temperature : (23 ± 3)°C

Relative Humidity : (50 ± 25) %

Test Specifications

Calibration check.

Ref. Document/Procedure : Z04.

Test Results

The results are shown in the attached page(s).

Main Test equipment used:

<u>Equipment No.</u>	<u>Description</u>	<u>Cert. No.</u>	<u>Traceable to</u>
S155	Std. Anemometer	NSC201431181	NIM-PRC

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.


The test equipment used for calibration are traceable to International System of Units (SI).
The test results apply to the above Unit-Under-Test only

Calibrated by : 
Dorothy Cheuk

Approved by : 
Steve Kwan

Date: 4-Aug-15

This Certificate is issued by
Hong Kong Calibration Ltd
Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong
Tel 2425 8801 Fax 2425 6646



Calibration Certificate

Certificate No. 506584

Page 2 of 2 Pages

Results :

1. Wind Speed

Applied Value (m/s)	UUT Reading (m/s)
0.0	0.0
2.5	2.2
5.0	4.9
7.5	7.6
10.0	9.8
15.0	14.8
19.0	18.8

Uncertainty : $\pm (2 \% + 0.2 \text{ m/s})$

2. Wind Direction

Reference Value	UUT Indication
N (0°)	N (0°)
NE (45°)	NE (45°)
E (90°)	E (90°)
SE (135°)	SE (135°)
S (180°)	S (180°)
SW (225°)	SW (225°)
W (270°)	W (270°)
NW (315°)	NW (315°)

Remark : 1. UUT: Unit-Under-Test

2. Atmospheric Pressure : 998 hPa

3. Before the calibration of the Wind Direction function, the Arrow Head was adjusted to the magnetic NORTH direction while the monitor indicated N. The customer is reminded to do the alignment again after installation.

----- END -----



輝創工程有限公司

Sun Creation Engineering Limited
Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No. : C150005
證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號 : IC14-3254) Date of Receipt / 收件日期 : 29 December 2014

Description / 儀器名稱 : Sound & Vibration Analyser
Manufacturer / 製造商 : Svantek
Model No. / 型號 : SVAN957
Serial No. / 編號 : 23853
Supplied By / 委託者 : Dragages - China Harbour - VSL Joint Venture
3/F, Island Place Tower, 510 King's Road,
North Point, Hong Kong

TEST CONDITIONS / 測試條件

Temperature / 溫度 : $(23 \pm 2)^{\circ}\text{C}$ Relative Humidity / 相對濕度 : $(55 \pm 20)\%$
Line Voltage / 電壓 : ---

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 2 January 2015


TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.
All results are within manufacturer's specification.
The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via :

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By : 
測試 : K C Lee
Project Engineer

Certified By : 
核證 : K M Wu
Engineer

Date of Issue : 6 January 2015
簽發日期

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Certificate of Calibration

校正證書

Certificate No. : C150005
證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- Self-calibration using the Svantek acoustic calibrator SV30A, S/N : 24803 was performed before the test from 6.1.1 to 6.3.2
- The results presented are the mean of 3 measurements at each calibration point.
- Test equipment :

Equipment ID	Description	Certificate No.
CL280	40 MHz Arbitrary Waveform Generator	C140016
CL281	Multifunction Acoustic Calibrator	DC130171

- Test procedure : MA101N.

- Results :

6.1 Sound Pressure Level

6.1.1 Reference Sound Pressure Level

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)		
HIGH	SPL	A	Fast	114.00	1	113.8	± 1.1

6.1.2 Linearity

UUT Setting				Applied Value		UUT Reading (dB)
Range	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	
HIGH	SPL	A	Fast	114.00	1	113.8 (Ref.)
				104.00		103.8
				94.00		93.8

IEC 61672 Class 1 Spec. : ± 0.6 dB per 10 dB step and ± 1.1 dB for overall different.

6.2 Time Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)		
HIGH	SPL	A	Fast	114.00	1	113.8	Ref.
			Slow			113.8	± 0.3

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室所書面批准。

Sun Creation Engineering Limited – Calibration & Testing Laboratory

c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 – 校正及檢測實驗室

c/o 香港新界屯門興安里一號青山灣機樓四樓

Tel/電話: 2927 2606 Fax/傳真: 2744 8986 E-mail/電郵: callab@suncreation.com Website/網址: www.suncreation.com

Certificate of Calibration

校正證書

Certificate No. : C150005
證書編號

6.3 Frequency Weighting

6.3.1 A-Weighting


UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq.		
HIGH	SPL	A	Fast	114.00	63 Hz	87.6	-26.2 ± 1.5
					125 Hz	97.6	-16.1 ± 1.5
					250 Hz	105.1	-8.6 ± 1.4
					500 Hz	110.5	-3.2 ± 1.4
					1 kHz	113.8	Ref.
					2 kHz	115.0	+1.2 ± 1.6
					4 kHz	114.8	+1.0 ± 1.6
					8 kHz	112.8	-1.1 (+2.1 ; -3.1)
					12.5 kHz	109.5	-4.3 (+3.0 ; -6.0)

6.3.2 C-Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq.		
HIGH	SPL	C	Fast	114.00	63 Hz	113.0	-0.8 ± 1.5
					125 Hz	113.6	-0.2 ± 1.5
					250 Hz	113.8	0.0 ± 1.4
					500 Hz	113.8	0.0 ± 1.4
					1 kHz	113.8	Ref.
					2 kHz	113.6	-0.2 ± 1.6
					4 kHz	113.0	-0.8 ± 1.6
					8 kHz	110.9	-3.0 (+2.1 ; -3.1)
					12.5 kHz	107.6	-6.2 (+6.0 ; -∞)

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

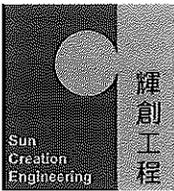

Certificate of Calibration

校正證書

Certificate No. : C150005
證書編號

Remarks : - UUT Microphone Model No. : ACO 7052S & S/N : 35989

- Mfr's Spec. : IEC 61672 Class 1

- Uncertainties of Applied Value :

114 dB : 63 Hz - 125 Hz	: ± 0.45 dB
250 Hz - 500 Hz	: ± 0.40 dB
1 kHz	: ± 0.30 dB
2 kHz - 4 kHz	: ± 0.45 dB
8 kHz	: ± 0.55 dB
12.5 kHz	: ± 0.80 dB
104 dB : 1 kHz	: ± 0.10 dB (Ref. 94 dB)
94 dB : 1 kHz	: ± 0.10 dB (Ref. 94 dB)
94 dB : 1 kHz	: ± 0.20 dB

- The uncertainties are for a confidence probability of not less than 95 %.

Note :

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室所書面批准。

Sun Creation Engineering Limited – Calibration & Testing Laboratory

c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 – 校正及檢測實驗室

c/o 香港新界屯門興安里一號青山灣機樓四樓

Tel/電話: 2927 2606

Fax/傳真: 2744 8986

E-mail/電郵: callab@suncreation.com

Website/網址: www.suncreation.com



輝創工程有限公司

Sun Creation Engineering Limited
Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No. : C150004
證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號 : IC14-3254) Date of Receipt / 收件日期 : 29 December 2014

Description / 儀器名稱 : Acoustic Calibrator
Manufacturer / 製造商 : Svantek
Model No. / 型號 : SV30A
Serial No. / 編號 : 24803
Supplied By / 委託者 : Dragages - China Harbour - VSL Joint Venture
3/F, Island Place Tower, 510 King's Road,
North Point, Hong Kong

TEST CONDITIONS / 測試條件

Temperature / 溫度 : (23 ± 2)°C Relative Humidity / 相對濕度 : (55 ± 20)%
Line Voltage / 電壓 : ---

TEST SPECIFICATIONS / 測試規範

Calibration check


DATE OF TEST / 測試日期 : 2 January 2015


TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.
All results are within manufacturer's specification.
The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via :


- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

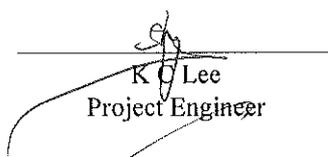Tested By : 
測試 : K O Lee
Project Engineer

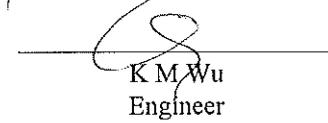Certified By : 
核證 : K M Wu
Engineer

Date of Issue : 6 January 2015
簽發日期

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.
本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

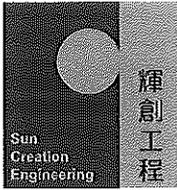

Certificate of Calibration

校正證書

Certificate No. : C150004
證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.
- Test equipment :

<u>Equipment ID</u>	<u>Description</u>	<u>Certificate No.</u>
CL130	Universal Counter	C143868
CL281	Multifunction Acoustic Calibrator	DC130171
TST150A	Measuring Amplifier	C141558

- Test procedure : MA100N.

- Results :

5.1 Sound Level Accuracy

UUT Nominal Value	Measured Value (dB)	Mfr's Spec. (dB)	Uncertainty of Measured Value (dB)
94 dB, 1 kHz	94.2	± 0.3	± 0.2
114 dB, 1 kHz	114.2		

5.2 Frequency Accuracy

UUT Nominal Value (kHz)	Measured Value (kHz)	Mfr's Spec.	Uncertainty of Measured Value (Hz)
1	0.999 98	1 kHz ± 0.02 %	± 0.01

Remark : - The uncertainties are for a confidence probability of not less than 95 %.

Note :

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

Sun Creation Engineering Limited – Calibration & Testing Laboratory

c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 – 校正及檢測實驗室

c/o 香港新界屯門興安里一號青山灣機樓四樓

Tel/電話: 2927 2606 Fax/傳真: 2744 8986 E-mail/電郵: callab@suncreation.com Website/網址: www.suncreation.com



佳力高試驗中心有限公司
CASTCO TESTING CENTRE LTD.

TEST REPORT
Chemical Analysis of Water
Accuracy check of YSI Sondes Environmental Monitoring System

Date of issue: 13-11-2015

Page 1 of 1 pages

Castco LRN: EN0151110-14

Sample details as supplied by customer

Customer : Dragages-China Harbour-VSL Joint Venture

Customer Ref. No. : --

Address: Tung Chung Waterfront Road, adjacent to Tung Chung New Development Pier

Job Title : Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road - Section between HKSAR Boundary and Scenic Hill

Contract No.: HY/2011/09

Laboratory Test Result

Instrument Name: Sonde Environmental Monitoring System

Manufacturer : YSI

Model No. : YSI 6820

Serial No. : 12B100804

Instrument No. : W.03.13

Date of Calibration : 10-11-2015

Date of Next Calibration : 10-02-2016

pH Value Check (pH Probe : Model: 6589, L/N: 14M)

Expected Reading (pH Unit)	Sonde Reading (pH Unit)	Tolerance (pH Unit)	Tolerance Limit (pH Unit)	Method Reference
4.00	4.12	+0.12	± 0.2	APHA 21e, 4500-H ⁺ B
7.02	7.08	+0.06		
10.06	9.98	-0.08		

Turbidity Check (Turbidity Sensor : Model: 6136, S/N: 11J100476)

Expected Reading (NTU)	Sonde Reading (NTU)	Tolerance (%)	Tolerance Limit (%)	Method Reference
4.00	3.8	-5.0	± 10	APHA 21e, 2130B
10.00	9.5	-5.0		
20.00	18.8	-6.0		
50.00	48.3	-3.4		
100.00	96.9	-3.1		

Conductivity Performance Check (Conductivity Sensor : Model: 6560, L/N : 14M100013)

Expected Reading (µS/cm)	Sonde Reading (µS/cm)	Tolerance (%)	Tolerance Limit (%)	Method Reference
1412 at 25 °C	1384 at 25 °C	-2.0	± 10	APHA 21e, 2510B

Salinity Performance Check (Salinity Sensor : Model: 6560, L/N: 14M100013)

Expected Reading (ppt)	Sonde Reading (ppt)	Tolerance (%)	Tolerance Limit (%)	Method Reference
33	33.26	+0.8	± 10	APHA 19e, 2520B

Dissolved Oxygen Check (Dissolved Oxygen Sensor : Model: 6562, L/N: 07E100029)

DO from Winkler Titration (mg/L)	Sonde Reading (mg/L)	Tolerance (mg/L)	Tolerance Limit (mg/L)	Method Reference
8.61	8.55	-0.06	± 0.20	APHA 21e, 4500-O C&G
4.57	4.71	+0.14		

Water Level Meter Check

Expected Reading (m)	Sonde Reading (m)	Tolerance (m)	Tolerance Limit (m)	Method Reference
1.00	1.04	+0.04	± 0.05	YSI Sondes Procedure Manual

Temperature Check


Expected Reading (°C)	Sonde Reading (°C)	Tolerance (°C)	Tolerance Limit (°C)	Method Reference
25.0	25.23	+0.23	± 2.0	Telarc Technical Guide No.3 1986

Checked by: _____


Au Kwok Kin
Senior Chemist

Certified by: _____

End of Report


Cheng Chi Fai
Senior Manager

Form No. ENV SONDE_T1 d4 22/02/2013

香港粉嶺安居街33號 33, On Kul Street, Fanling, Hong Kong.

香港粉嶺安全街29A號 29A, On Chuen Street, Fanling, Hong Kong.

E-mail: castco@navigator.com Website: www.castco.com.hk

Tel: 2677 2138
Fax: 2677 0351

COPY



佳力高試驗中心有限公司
CASTCO TESTING CENTRE LTD.

TEST REPORT
Chemical Analysis of Water
Accuracy check of YSI Sondes Environmental Monitoring System

Date of issue: 13-11-2015

Page 1 of 1 pages

Castco LRN: EN0151110-15

Sample details as supplied by customer

Customer : Dragages-China Harbour-VSL Joint Venture

Customer Ref. No. : --

Address: Tung Chung Waterfront Road, adjacent to Tung Chung New Development Pier

Job Title : Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road - Section between HKSAR Boundary and Scenic Hill

Contract No.: HY/2011/09

Laboratory Test Result

Instrument Name: Sonde Environmental Monitoring System

Manufacturer : YSI

Model No. : YSI 6920

Serial No. : 11J101088

Instrument No. : W.03.11

Date of Calibration : 10-11-2015

Date of Next Calibration : 10-02-2016

pH Value Check (pH Probe : Model: 6589, L/N: 1.5B)

Expected Reading (pH Unit)	Sonde Reading (pH Unit)	Tolerance (pH Unit)	Tolerance Limit (pH Unit)	Method Reference
4.00	4.11	+0.11	± 0.2	APHA 21e, 4500-H ⁺ B
7.02	7.09	+0.07		
10.06	9.96	-0.10		

Turbidity Check (Turbidity Sensor : Model: 6136, S/N: 13K103053)

Expected Reading (NTU)	Sonde Reading (NTU)	Tolerance (%)	Tolerance Limit (%)	Method Reference
4.00	4.2	+5.0	± 10	APHA 21e, 2130B
10.00	9.9	-1.0		
20.00	19.5	-2.5		
50.00	48.2	-3.6		
100.00	96.9	-3.1		

Conductivity Performance Check (Conductivity Sensor : Model: 6560, L/N: 15B100399)

Expected Reading (µS/cm)	Sonde Reading (µS/cm)	Tolerance (%)	Tolerance Limit (%)	Method Reference
1412 at 25 °C	1386 at 25 °C	-1.8	± 10	APHA 21e, 2510B

Salinity Performance Check (Salinity Sensor : Model: 6560, L/N: 15B100399)

Expected Reading (ppt)	Sonde Reading (ppt)	Tolerance (%)	Tolerance Limit (%)	Method Reference
33	32.76	-0.7	± 10	APHA 19e, 2520B

Dissolved Oxygen Check (Dissolved Oxygen Sensor : Model: 6562, L/N: 15A100700)

DO from Winkler Titration (mg/L)	Sonde Reading (mg/L)	Tolerance (mg/L)	Tolerance Limit (mg/L)	Method Reference
8.52	8.70	+0.18	± 0.20	APHA 21e, 4500-O C&G
4.57	4.64	+0.07		

Water Level Meter Check

Expected Reading (m)	Sonde Reading (m)	Tolerance (m)	Tolerance Limit (m)	Method Reference
1.00	1.03	+0.03	± 0.05	YSI Sondes Procedure Manual

Temperature Check

Expected Reading (°C)	Sonde Reading (°C)	Tolerance (°C)	Tolerance Limit (°C)	Method Reference
25.0	24.40	-0.60	± 2.0	Telarc Technical Guide No.3 1986

Checked by: _____

Au Kwok Kin
Senior Chemist

Certified by: _____

End of Report

Cheng Chi Fai
Senior Manager

Form No. ENV SONDE_T1 d3 22/02/2013

COPY

香港粉嶺安居街33號 33, On Kui Street, Fanling, Hong Kong.

香港粉嶺安全街29A號 29A, On Chuen Street, Fanling, Hong Kong.

E-mail: castco@netvigator.com Website: www.castco.com.hk

Tel: 2677 2138

Fax: 2677 0351

**APPENDIX D
ENVIRONMENTAL MONITORING
SCHEDULES**

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Impact Air Quality and Noise Monitoring Schedule in December 2015**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1-Dec	2-Dec	3-Dec	4-Dec	5-Dec
				24 hr TSP 1 hr TSP X 3	Noise	
6-Dec	7-Dec	8-Dec	9-Dec	10-Dec	11-Dec	12-Dec
			24 hr TSP 1 hr TSP X 3	Noise		
13-Dec	14-Dec	15-Dec	16-Dec	17-Dec	18-Dec	19-Dec
		24 hr TSP 1 hr TSP X 3	Noise			
20-Dec	21-Dec	22-Dec	23-Dec	24-Dec	25-Dec	26-Dec
	24 hr TSP 1 hr TSP X 3	Noise			24 hr TSP 1 hr TSP X 3	
27-Dec	28-Dec	29-Dec	30-Dec	31-Dec		
	Noise			24 hr TSP 1 hr TSP X 3		

Air Quality Monitoring Stations

AMS1 - Sha Lo Wan
AMS4 - San Tau

Noise Monitoring Stations

NMS1 - Sha Lo Wan
NMS4 - San Tau

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Tentative Impact Air Quality and Noise Monitoring Schedule in January 2016**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
					1-Jan	2-Jan
3-Jan	4-Jan	5-Jan	6-Jan	7-Jan	8-Jan	9-Jan
			24 hr TSP 1 hr TSP X 3	Noise		
10-Jan	11-Jan	12-Jan	13-Jan	14-Jan	15-Jan	16-Jan
		24 hr TSP 1 hr TSP X 3	Noise			
17-Jan	18-Jan	19-Jan	20-Jan	21-Jan	22-Jan	23-Jan
	24 hr TSP 1 hr TSP X 3	Noise			24 hr TSP 1 hr TSP X 3	
24-Jan	25-Jan	26-Jan	27-Jan	28-Jan	29-Jan	30-Jan
				24 hr TSP 1 hr TSP X 3	Noise	
31-Jan						

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

Air Quality Monitoring Stations

AMS1 - Sha Lo Wan
AMS4 - San Tau

Noise Monitoring Stations

NMS1 - Sha Lo Wan
NMS4 - San Tau

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Impact Water Quality Monitoring Schedule in December 2015**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1-Dec	2-Dec	3-Dec	4-Dec	5-Dec
			<u>Water Quality Monitoring</u> Mid-Flood 12:27 Mid-Ebb 18:06		<u>Water Quality Monitoring</u> Mid-Flood 14:16 Mid-Ebb 20:40	
6-Dec	7-Dec	8-Dec	9-Dec	10-Dec	11-Dec	12-Dec
	<u>Water Quality Monitoring</u> Mid-Ebb 10:06 Mid-Flood 16:06		<u>Water Quality Monitoring</u> Mid-Ebb 11:36 Mid-Flood 17:09		<u>Water Quality Monitoring</u> Mid-Ebb 12:52 Mid-Flood 18:14	
13-Dec	14-Dec	15-Dec	16-Dec	17-Dec	18-Dec	19-Dec
	<u>Water Quality Monitoring</u> Mid-Flood 9:17 Mid-Ebb 14:51		<u>Water Quality Monitoring</u> Mid-Flood 10:50 Mid-Ebb 16:34		<u>Water Quality Monitoring</u> Mid-Flood 12:42 Mid-Ebb 18:52	
20-Dec	21-Dec	22-Dec	23-Dec	24-Dec	25-Dec	26-Dec
	<u>Water Quality Monitoring</u> Mid-Ebb 8:51 Mid-Flood 15:20		<u>Water Quality Monitoring</u> Mid-Ebb 11:05 Mid-Flood 16:48		<u>Water Quality Monitoring</u> Mid-Ebb 12:49 Mid-Flood 18:12	
27-Dec	28-Dec	29-Dec	30-Dec	31-Dec		
	<u>Water Quality Monitoring</u> Mid-Flood 9:18 Mid-Ebb 14:52		<u>Water Quality Monitoring</u> Mid-Flood 10:33 Mid-Ebb 16:09			

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Tentative Impact Water Quality Monitoring Schedule in January 2016**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1-Dec			1-Jan	2-Jan
						<u>Water Quality Monitoring</u> Mid-Flood 12:45 Mid-Ebb 19:02
3-Jan	4-Jan	5-Jan	6-Jan	7-Jan	8-Jan	9-Jan
	<u>Water Quality Monitoring</u> Mid-Ebb 7:37 Mid-Flood 14:20		<u>Water Quality Monitoring</u> Mid-Ebb 10:19 Mid-Flood 15:48		<u>Water Quality Monitoring</u> Mid-Ebb 11:53 Mid-Flood 17:11	
10-Jan	11-Jan	12-Jan	13-Jan	14-Jan	15-Jan	16-Jan
	<u>Water Quality Monitoring</u> Mid-Flood 8:19 Mid-Ebb 13:56		<u>Water Quality Monitoring</u> Mid-Flood 9:37 Mid-Ebb 15:23		<u>Water Quality Monitoring</u> Mid-Flood 11:02 Mid-Ebb 17:06	
17-Jan	18-Jan	19-Jan	20-Jan	21-Jan	22-Jan	23-Jan
	<u>Water Quality Monitoring</u> Mid-Flood 13:43 Mid-Ebb 20:39		<u>Water Quality Monitoring</u> Mid-Ebb 9:54 Mid-Flood 15:35		<u>Water Quality Monitoring</u> Mid-Ebb 11:57 Mid-Flood 17:17	
24-Jan	25-Jan	26-Jan	27-Jan	28-Jan	29-Jan	30-Jan
	<u>Water Quality Monitoring</u> Mid-Flood 8:14 Mid-Ebb 13:52		<u>Water Quality Monitoring</u> Mid-Flood 9:15 Mid-Ebb 14:56		<u>Water Quality Monitoring</u> Mid-Flood 10:14 Mid-Ebb 16:04	
31-Jan						

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Construction-Phase Dolphin Monitoring in West Lantau (Line Transect Vessel Survey) in December 2015**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1-Dec	2-Dec	3-Dec	4-Dec	5-Dec
				Line Transect Vessel Survey		
6-Dec	7-Dec	8-Dec	9-Dec	10-Dec	11-Dec	12-Dec
				Line Transect Vessel Survey		
13-Dec	14-Dec	15-Dec	16-Dec	17-Dec	18-Dec	19-Dec
20-Dec	21-Dec	22-Dec	23-Dec	24-Dec	25-Dec	26-Dec
27-Dec	28-Dec	29-Dec	30-Dec	31-Dec		

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Tentative Construction-Phase Dolphin Monitoring in West Lantau (Line Transect Vessel Survey) in January 2016**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
					1-Jan	2-Jan
3-Jan	4-Jan	5-Jan	6-Jan	7-Jan	8-Jan	9-Jan
			Line Transect Vessel Survey			
10-Jan	11-Jan	12-Jan	13-Jan	14-Jan	15-Jan	16-Jan
				Line Transect Vessel Survey		
17-Jan	18-Jan	19-Jan	20-Jan	21-Jan	22-Jan	23-Jan
24-Jan	25-Jan	26-Jan	27-Jan	28-Jan	29-Jan	30-Jan
31-Jan						

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Additional Land-based Dolphin Behaviour and Movement Monitoring in December 2015**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1-Dec	2-Dec	3-Dec	4-Dec	5-Dec
		Additional Land-based Dolphin Behaviour and Movement Monitoring				
6-Dec	7-Dec	8-Dec	9-Dec	10-Dec	11-Dec	12-Dec
		Additional Land-based Dolphin Behaviour and Movement Monitoring				
13-Dec	14-Dec	15-Dec	16-Dec	17-Dec	18-Dec	19-Dec
20-Dec	21-Dec	22-Dec	23-Dec	24-Dec	25-Dec	26-Dec
27-Dec	28-Dec	29-Dec	30-Dec	31-Dec		

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Tentative Additional Land-based Dolphin Behaviour and Movement Monitoring in January 2016**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
					1-Jan	2-Jan
3-Jan	4-Jan	5-Jan	6-Jan	7-Jan	8-Jan	9-Jan
				Additional Land-based Dolphin Behaviour and Movement Monitoring		
10-Jan	11-Jan	12-Jan	13-Jan	14-Jan	15-Jan	16-Jan
			Additional Land-based Dolphin Behaviour and Movement Monitoring			
17-Jan	18-Jan	19-Jan	20-Jan	21-Jan	22-Jan	23-Jan
24-Jan	25-Jan	26-Jan	27-Jan	28-Jan	29-Jan	30-Jan
31-Jan						

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

**APPENDIX E
1-HOUR TSP MONITORING RESULTS
AND GRAPHICAL PRESENTATION**

Appendix E - 1-hour TSP Monitoring Results



Location AMS1 - Sha Lo Wan

Sampling Date	Start Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure, Pa (mmHg)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
					Initial	Final		Initial	Final		Initial	Final			
3-Dec-15	9:00	Sunny	292.1	767.9	2.8388	2.8401	0.0013	6420.9	6421.9	1.0	1.24	1.24	1.24	74.1	18
3-Dec-15	10:00	Sunny	292.3	767.7	2.8376	2.8386	0.0010	6421.9	6422.9	1.0	1.24	1.23	1.24	74.1	13
3-Dec-15	11:00	Sunny	292.5	767.5	2.8244	2.8265	0.0021	6422.9	6423.9	1.0	1.23	1.23	1.23	74.1	28
9-Dec-15	10:00	Cloudy	290.3	766.7	2.8137	2.8199	0.0062	6447.9	6448.9	1.0	1.24	1.24	1.24	74.3	83
9-Dec-15	13:00	Cloudy	290.5	766.5	2.8018	2.8041	0.0023	6448.9	6449.9	1.0	1.24	1.24	1.24	74.3	31
9-Dec-15	14:00	Cloudy	290.5	766.3	2.7850	2.7868	0.0018	6449.9	6450.9	1.0	1.24	1.24	1.24	74.3	24
15-Dec-15	13:00	Sunny	292.5	765.6	2.8079	2.8146	0.0067	6474.9	6475.9	1.0	1.23	1.23	1.23	74.0	91
15-Dec-15	14:02	Sunny	292.7	765.4	2.8144	2.8164	0.0020	6475.9	6476.9	1.0	1.23	1.23	1.23	73.9	27
15-Dec-15	15:05	Sunny	292.9	765.2	2.8255	2.8324	0.0069	6476.9	6477.9	1.0	1.23	1.23	1.23	73.9	93
21-Dec-15	9:00	Sunny	289.4	770.1	2.7970	2.7993	0.0023	6501.9	6502.9	1.0	1.24	1.24	1.24	74.6	31
21-Dec-15	10:00	Sunny	289.6	769.9	2.8176	2.8187	0.0011	6502.9	6503.9	1.0	1.24	1.24	1.24	74.6	15
21-Dec-15	11:00	Sunny	289.8	769.7	2.7928	2.7940	0.0012	6503.9	6504.9	1.0	1.24	1.24	1.24	74.5	16
25-Dec-15	9:00	Cloudy	289.4	769.4	2.7986	2.8032	0.0046	6528.9	6529.9	1.0	1.24	1.24	1.24	74.6	62
25-Dec-15	10:00	Cloudy	289.5	769.2	2.8077	2.8111	0.0034	6529.9	6530.9	1.0	1.24	1.24	1.24	74.6	46
25-Dec-15	11:00	Cloudy	289.7	769.0	2.8012	2.8041	0.0029	6530.9	6531.9	1.0	1.24	1.24	1.24	74.5	39
31-Dec-15	11:00	Sunny	288.4	771.3	2.7849	2.7895	0.0046	6555.9	6556.9	1.0	1.25	1.25	1.25	74.8	61
31-Dec-15	13:00	Sunny	288.9	770.7	2.8034	2.8056	0.0022	6556.9	6557.9	1.0	1.25	1.24	1.25	74.7	29
31-Dec-15	14:00	Sunny	289.1	770.5	2.8047	2.8070	0.0023	6557.9	6558.9	1.0	1.24	1.24	1.24	74.7	31
														Min	13
														Max	93
														Average	41

Location AMS4 - San Tau

Sampling Date	Start Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure, Pa (mmHg)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
					Initial	Final		Initial	Final		Initial	Final			
3-Dec-15	14:00	Sunny	291.4	766.7	2.8422	2.8440	0.0018	6070.0	6071.0	1.0	1.24	1.24	1.24	74.2	24
3-Dec-15	15:00	Sunny	291.6	766.5	2.8492	2.8514	0.0022	6071.0	6072.0	1.0	1.24	1.24	1.24	74.2	30
3-Dec-15	16:00	Sunny	291.9	766.3	2.8319	2.8344	0.0025	6072.0	6073.0	1.0	1.24	1.24	1.24	74.2	34
9-Dec-15	10:00	Cloudy	291.5	766.0	2.8263	2.8424	0.0161	6097.0	6098.0	1.0	1.24	1.24	1.24	74.2	217
9-Dec-15	13:00	Cloudy	291.7	765.8	2.8130	2.8157	0.0027	6098.0	6099.0	1.0	1.24	1.24	1.24	74.2	36
9-Dec-15	14:00	Cloudy	291.9	765.7	2.8036	2.8061	0.0025	6099.0	6100.0	1.0	1.24	1.24	1.24	74.1	34
15-Dec-15	8:50	Sunny	289.2	767.8	2.8283	2.8363	0.0080	6124.0	6125.0	1.0	1.24	1.24	1.24	74.5	107
15-Dec-15	9:52	Sunny	289.4	767.6	2.8451	2.8479	0.0028	6125.0	6126.0	1.0	1.24	1.24	1.24	74.5	38
15-Dec-15	10:55	Sunny	289.6	767.4	2.8272	2.8322	0.0050	6126.0	6127.0	1.0	1.24	1.24	1.24	74.5	67
21-Dec-15	13:00	Sunny	294.1	767.8	2.7980	2.7995	0.0015	6151.0	6152.0	1.0	1.23	1.23	1.23	74.0	20
21-Dec-15	14:00	Sunny	294.4	767.7	2.7938	2.7962	0.0024	6152.0	6153.0	1.0	1.23	1.23	1.23	73.9	32
21-Dec-15	15:00	Sunny	294.6	767.5	2.8123	2.8144	0.0021	6153.0	6154.0	1.0	1.23	1.23	1.23	73.9	28
25-Dec-15	13:00	Cloudy	290.9	767.8	2.8064	2.8120	0.0056	6178.0	6179.0	1.0	1.24	1.24	1.24	74.3	75
25-Dec-15	14:01	Cloudy	291.1	767.6	2.8074	2.8145	0.0071	6179.0	6180.0	1.0	1.24	1.24	1.24	74.3	96
25-Dec-15	15:02	Cloudy	291.5	767.4	2.7878	2.7950	0.0072	6180.0	6181.0	1.0	1.24	1.24	1.24	74.3	97
31-Dec-15	15:40	Sunny	291.7	770.5	2.8081	2.8115	0.0034	6205.0	6206.0	1.0	1.24	1.24	1.24	74.4	46
31-Dec-15	16:40	Sunny	291.9	770.3	2.8006	2.8041	0.0035	6206.0	6207.0	1.0	1.24	1.24	1.24	74.3	47
31-Dec-15	17:40	Sunny	292.1	770.1	2.8152	2.8208	0.0056	6207.0	6208.0	1.0	1.24	1.24	1.24	74.3	75
														Min	20
														Max	217
														Average	61

1-hour TSP Concentration Levels

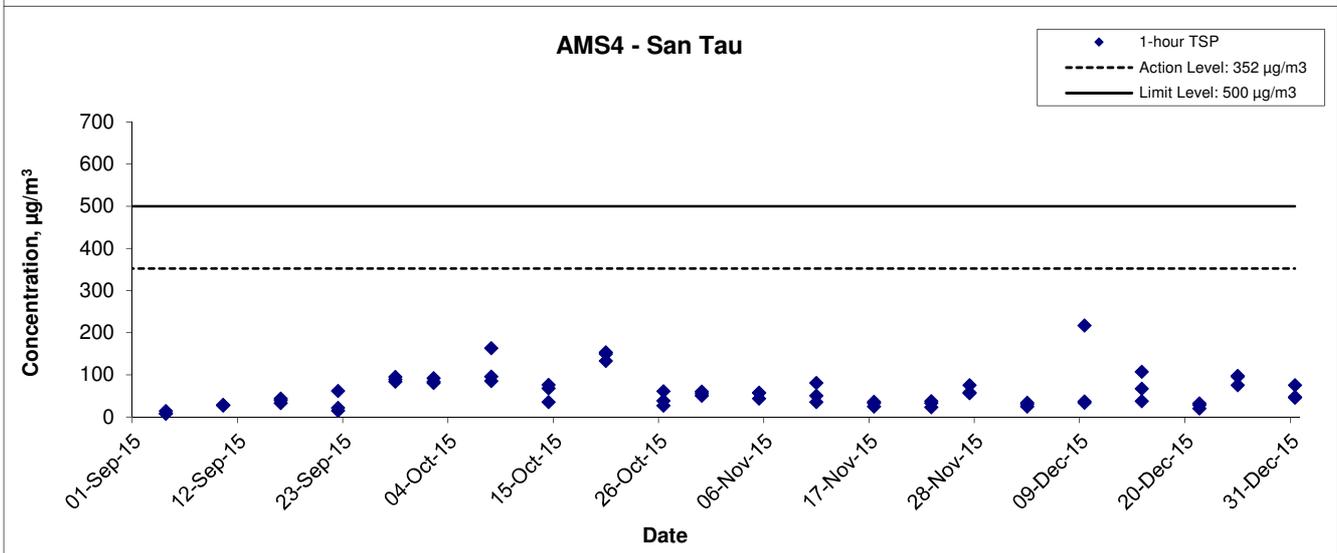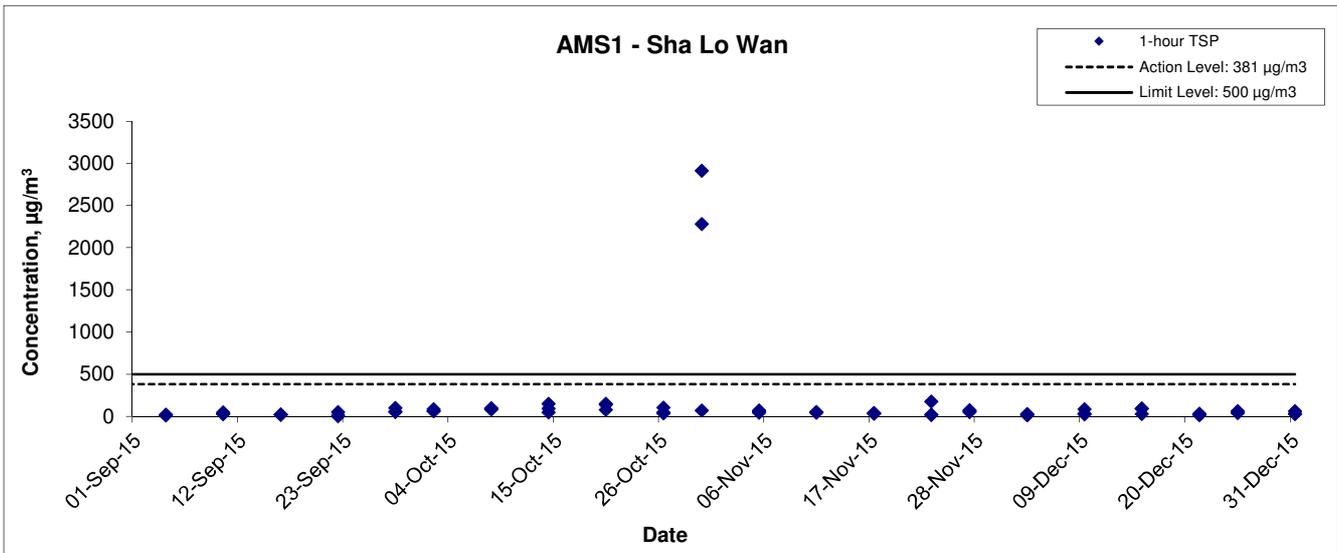

Remark: The 1-hour TSP concentration on 30 October 2015 (13:00-15:00) are considered invalid.

Title Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill Graphical Presentation of 1-hour TSP Monitoring Results	Scale N.T.S	Project No. MA12014	
	Date Dec 15	Appendix E	

**APPENDIX F
24-HOUR TSP MONITORING RESULTS
AND GRAPHICAL PRESENTATION**

Appendix F - 24-hour TSP Monitoring Results



Location AMS1 - Sha Lo Wan

Sampling Date	Start Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure, Pa (mmHg)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
					Initial	Final		Initial	Final		Initial	Final			
3-Dec-15	12:00	Sunny	292.7	767.3	2.8436	2.8879	0.0443	6423.9	6447.9	24.0	1.23	1.23	1.23	1776.9	25
9-Dec-15	15:00	Cloudy	290.7	766.1	2.7966	2.8520	0.0554	6450.9	6474.9	24.0	1.24	1.24	1.24	1781.7	31
15-Dec-15	16:07	Sunny	293.1	765.0	2.8244	3.0263	0.2019	6477.9	6501.9	24.0	1.23	1.23	1.23	1772.8	114
21-Dec-15	12:00	Sunny	290.0	769.5	2.8189	2.8983	0.0794	6504.9	6528.9	24.0	1.24	1.24	1.24	1788.0	44
25-Dec-15	12:05	Cloudy	289.9	768.8	2.8048	2.9234	0.1186	6531.9	6555.9	24.0	1.24	1.24	1.24	1787.5	66
31-Dec-15	15:00	Sunny	289.3	770.3	2.7913	2.8432	0.0519	6558.9	6582.9	24.0	1.24	1.24	1.24	1791.2	29
														Min	25
														Max	114
														Average	52

Location AMS4 - San Tau

Sampling Date	Start Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure, Pa (mmHg)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
					Initial	Final		Initial	Final		Initial	Final			
3-Dec-15	17:00	Sunny	292.1	766.1	2.8368	2.9406	0.1038	6073.0	6097.0	24.0	1.24	1.24	1.24	1778.9	58
9-Dec-15	15:00	Cloudy	292.1	765.5	2.8099	2.8888	0.0789	6100.0	6124.0	24.0	1.24	1.23	1.23	1778.3	44
15-Dec-15	12:10	Sunny	289.8	767.2	2.8023	2.9844	0.1821	6127.0	6151.0	24.0	1.24	1.24	1.24	1786.7	102
21-Dec-15	16:00	Sunny	294.8	767.3	2.8005	2.9252	0.1247	6154.0	6178.0	24.0	1.23	1.23	1.23	1772.6	70
25-Dec-15	16:02	Cloudy	291.5	767.2	2.8169	2.9300	0.1131	6181.0	6205.0	24.0	1.24	1.24	1.24	1781.8	63
31-Dec-15	18:40	Sunny	292.3	769.9	2.8236	3.0451	0.2215	6208.0	6232.0	24.0	1.24	1.24	1.24	1782.5	124
														Min	44
														Max	124
														Average	77

24-hour TSP Concentration Levels

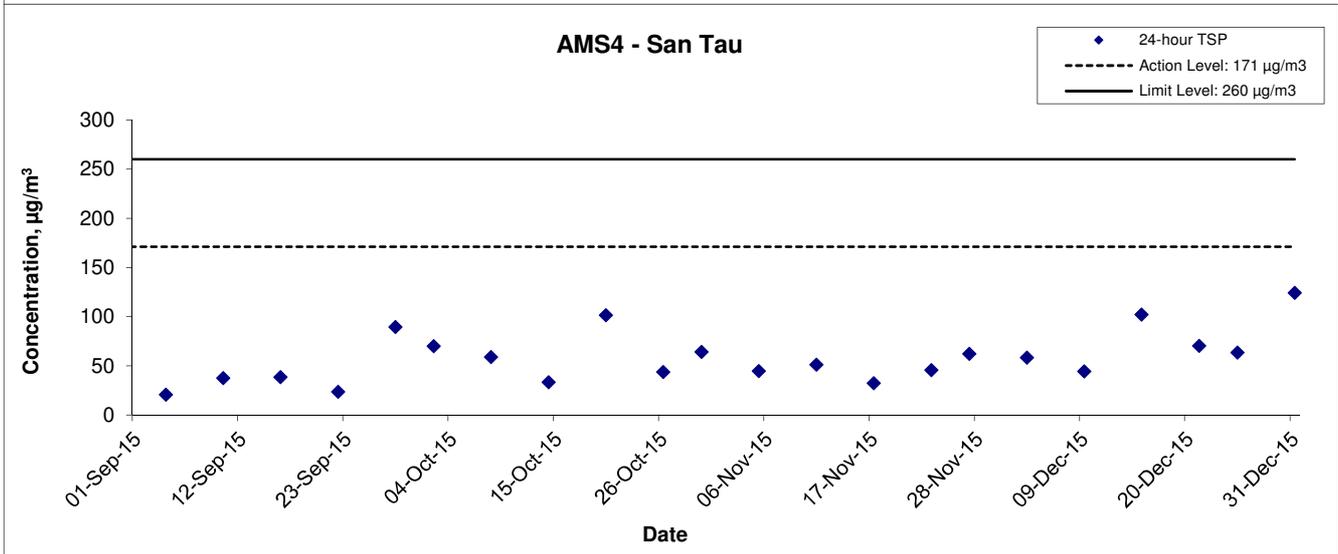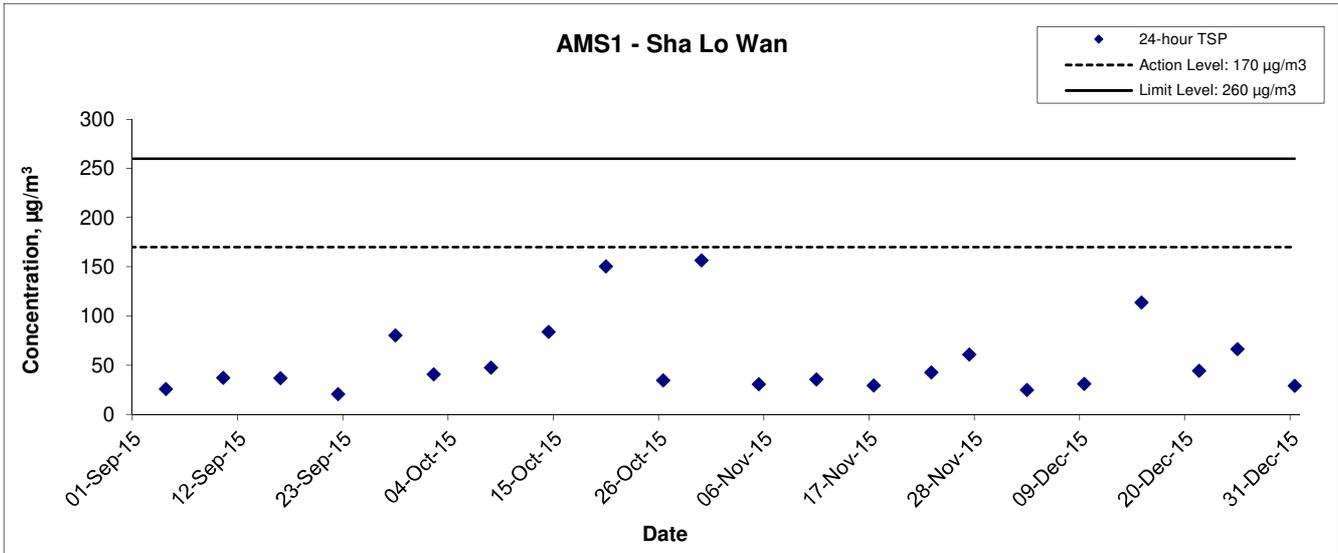

Title Contract No. 11/2011/03 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill Graphical Presentation of 24-hour TSP Monitoring Results	Scale N.T.S	Project No. MA12014	CINOTECH
	Date Dec 15	Appendix F	

**APPENDIX G
NOISE MONITORING RESULTS AND
GRAPHICAL PRESENTATION**

Appendix G - Noise Monitoring Results



Location NMS 1 - Sha Lo Wan								
Date	Weather	Time	Unit: dB (A) (5-min)			Average L _{eq}	Baseline Level L _{eq}	Construction Noise Level L _{eq}
			L _{eq}	L ₁₀	L ₉₀			
4-Dec-15	Sunny	14:50	64.8	67.5	56.2	65	66.9	65 Measured (i) Limit Level
		14:55	64.4	67.3	56.1			
		15:00	64.2	67.0	56.0			
		15:05	65.8	68.4	57.1			
		15:10	66.1	68.8	57.4			
10-Dec-15	Cloudy	15:15	66.2	68.8	57.5	68	66.9	61 Measured (i) Limit Level
		16:20	68.0	69.1	65.9			
		16:25	67.9	68.7	66.0			
		16:30	67.9	69.0	65.9			
		16:35	67.5	69.0	65.7			
16-Dec-15	Sunny	16:40	67.7	69.2	65.8	63	66.9	63 Measured (i) Limit Level
		16:45	67.8	69.0	65.9			
		14:00	63.1	65.3	49.9			
		14:05	63.5	65.2	50.1			
		14:10	63.2	65.3	49.8			
22-Dec-15	Cloudy	14:15	63.3	65.4	49.9	66	66.9	66 Measured (i) Limit Level
		14:20	63.1	65.2	49.8			
		14:25	63.2	65.3	49.7			
		13:00	65.8	69.1	62.4			
		13:05	65.6	68.7	62.2			
28-Dec-15	Sunny	13:10	65.7	68.8	62.2	61	66.9	61 Measured (i) Limit Level
		13:15	65.8	68.9	62.3			
		13:20	65.5	68.4	62.0			
		13:25	66.0	69.3	62.7			
		10:30	61.2	64.6	56.1			
		10:35	61.8	65.0	56.7	61	66.9	61 Measured (i) Limit Level
		10:40	59.5	63.1	55.7			
		10:45	60.5	64.2	56.1			
		10:50	62.1	65.7	57.2			
		10:55	61.4	64.2	56.8			

Remark: *+3dB(A) Façade correction included

Location NMS 4 - San Tau								
Date	Weather	Time	Unit: dB (A) (5-min)			Average L _{eq}	Baseline Level L _{eq}	Construction Noise Level L _{eq}
			L _{eq}	L ₁₀	L ₉₀			
4-Dec-15	Sunny	16:45	57.4	64.2	54.6	58	56.0	54 Measured (i) Limit Level
		16:50	57.4	64.2	54.8			
		16:55	57.9	64.5	54.9			
		17:00	58.3	65.0	55.3			
		17:05	57.7	64.8	54.9			
10-Dec-15	Cloudy	17:10	58.6	65.3	55.4	57	56.0	50 Measured (i) Limit Level
		15:00	56.7	58.1	55.8			
		15:05	57.0	58.2	56.0			
		15:10	56.9	58.1	56.0			
		15:15	56.8	58.2	55.9			
16-Dec-15	Sunny	15:20	56.8	58.3	55.9	55	56.0	55 Measured (i) Limit Level
		15:25	56.7	58.4	56.2			
		11:30	55.7	59.1	50.6			
		11:35	54.7	58.8	49.8			
		11:40	54.9	58.8	49.7			
22-Dec-15	Cloudy	11:45	54.5	58.5	49.2	56	56.0	56 Measured (i) Limit Level
		11:50	54.8	58.4	49.5			
		11:55	55.2	58.7	49.6			
		14:30	54.4	58.3	50.6			
		14:35	54.9	58.5	50.8			
28-Dec-15	Sunny	14:40	55.7	59.4	51.3	53	56.0	53 Measured (i) Limit Level
		14:45	57.2	59.2	51.0			
		14:50	55.4	59.2	51.2			
		14:55	55.3	59.3	51.2			
		14:30	52.8	55.2	48.5			
		14:35	53.2	55.8	49.1	53	56.0	53 Measured (i) Limit Level
		14:40	54.1	56.7	50.4			
		14:45	52.8	54.9	50.3			
		14:50	53.1	55.5	49.8			
		14:55	54.3	56.1	49.4			

Remark: *+3dB(A) Façade correction included

Noise Levels

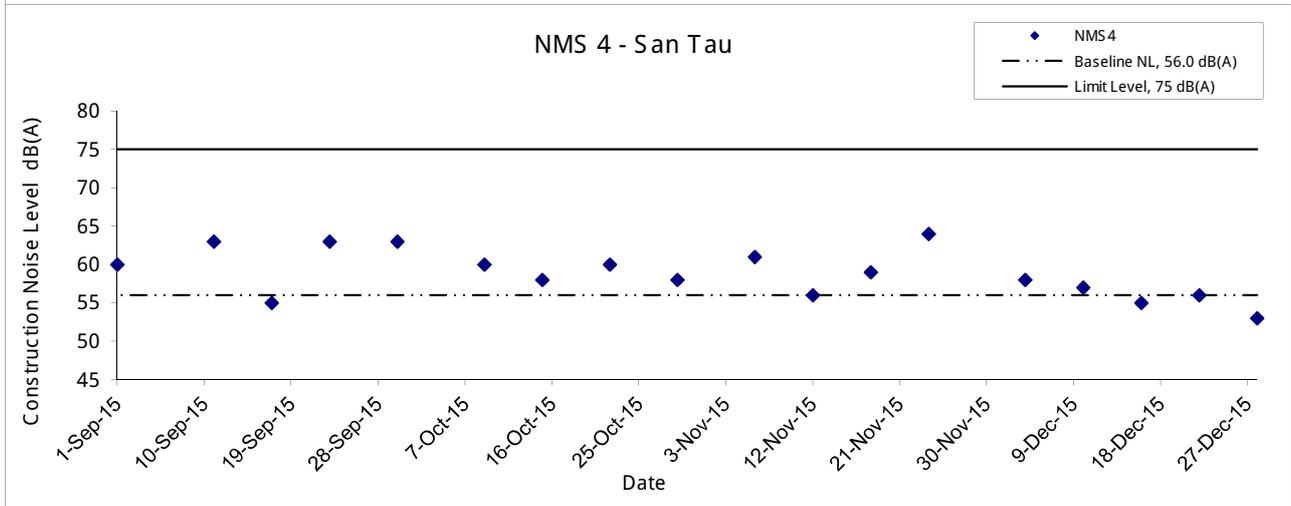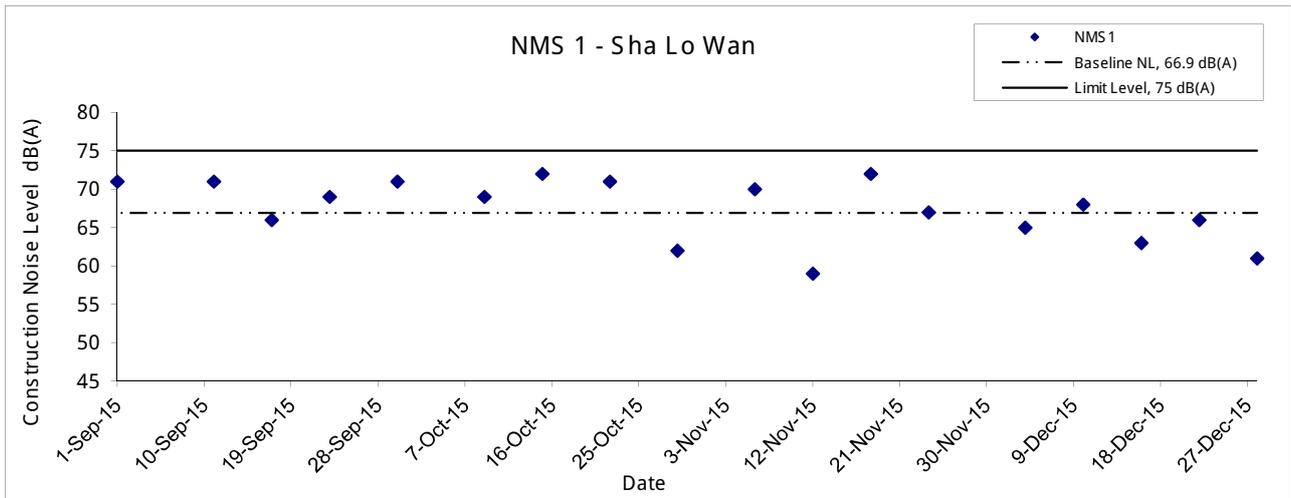

Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill Graphical Presentation of Construction Noise Monitoring Results	Scale N.T.S	Project No. MA12014	
	Date Dec 15	Appendix G	

**APPENDIX H
WATER QUALITY MONITORING
RESULTS AND GRAPHICAL
PRESENTATION**

Water Quality Monitoring Results at CS1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
2-Dec-15	Fine	Moderate	17:40	Surface	1	26.1	26.1	7.9	7.9	24.1	24.3	109.8	110.3	7.8	7.8	7.7	4.7	4.8	5.5	12.1	13.3	14.3			
						26.1		7.9		24.4		110.8		7.8			4.9			4.8			14.4		
				Middle	6.5	23.7	23.9	7.9	8.0	24.9	25.0	102.1	101.9	7.5	7.5		5.5	5.5		5.5	5.5		18.0	16.8	
				24.0		8.0		25.0		101.6		7.4	7.4	7.4	6.0	6.1		12.6	12.8						
				Bottom	12	22.7	22.8	7.9	7.9	26.0	25.9	99.3	99.5	7.4	7.4	7.4	6.2	6.1		12.9	12.8				
						22.8		7.9		25.8		99.6		7.4											
4-Dec-15	Fine	Moderate	20:00	Surface	1	26.0	26.0	7.8	7.8	28.1	28.1	102.8	103.1	7.2	7.2	7.1	4.7	4.6	8.2	11.7	12.8	16.9			
						26.0		7.7		28.1		103.4		7.2			4.4			4.6			13.8		
				Middle	6	25.9	25.9	7.9	8.0	28.9	29.0	99.2	99.0	6.9	6.9		7.9	8.0		8.2	30.4		27.0		
				25.9		8.0		29.0		98.7		6.9	6.9	6.8	6.8	8.1	8.0		23.6						
				Bottom	11	25.8	25.8	8.0	8.1	30.2	30.2	97.7	97.6	6.8	6.8	6.8	11.9	12.0		9.6	10.8				
						25.8		8.1		30.2		97.5		6.8		6.8	12.0	12.0		12.0	10.8				
7-Dec-15	Sunny	Moderate	09:19	Surface	1	21.1	21.1	8.1	8.1	26.9	27.0	91.8	91.4	7.0	7.0	6.9	5.4	5.4	7.6	27.0	22.9	19.3			
						21.1		8.1		27.0		91.0		6.9			5.4			5.4			18.8		
				Middle	6.5	21.1	21.1	8.1	8.1	29.8	29.8	90.9	90.9	6.8	6.8		8.1	8.2		7.6	18.1		19.9		
				21.1		8.1		29.8		90.8		6.8	6.8	6.7	6.7	9.4	9.3		21.6						
				Bottom	12	21.0	21.0	8.1	8.1	30.5	30.5	90.4	90.4	6.7	6.7	6.7	9.2	9.3		17.3	15.2				
						21.0		8.1		30.5		90.4		6.7		6.7	9.2	9.3		13.1	15.2				
9-Dec-15	Rainy	Moderate	11:28	Surface	1	24.2	24.3	8.2	8.2	24.4	23.6	86.5	83.8	6.3	6.1	5.9	6.8	6.3	8.4	11.5	14.0	13.2			
						24.4		8.2		22.7		81.0		5.9	6.1		5.9	6.3			6.3			16.4	
				Middle	6	24.2	24.3	8.2	8.2	26.1	24.1	78.1	76.5	5.6	5.6		8.9	8.5		8.4	11.5		13.0		
				24.4		8.2		22.1		74.9		5.5	5.6	5.4	5.4	10.5	10.5		14.5						
				Bottom	11	24.4	24.5	8.1	8.1	22.8	22.5	73.1	72.7	5.4	5.4	5.4	10.5	10.5		11.5	12.7				
						24.5		8.1		22.2		72.2		5.3		5.4	10.4	10.5		13.9	12.7				
11-Dec-15	Sunny	Moderate	12:52	Surface	1	21.5	21.5	8.1	8.1	29.0	29.0	99.3	99.1	7.4	7.4	7.4	9.1	9.0	11.8	23.2	21.0	18.6			
						21.5		8.1		29.0		98.8		7.4	7.4		8.9	9.0			18.7				
				Middle	6	21.4	21.4	8.1	8.1	29.1	29.1	98.3	98.1	7.3	7.3		10.8	11.2		11.8	20.7		21.9		
				21.4		8.1		29.1		97.8		7.3	7.3	7.3	7.3	11.5	11.2		23.0						
				Bottom	11	21.5	21.5	8.1	8.1	29.2	29.2	97.3	97.3	7.3	7.3	7.3	15.2	15.3		11.9	12.9				
						21.5		8.1		29.2		97.3		7.3		7.3	15.3	15.3		13.8	12.9				
						21.5		8.1		29.2		97.3		7.3		7.3	15.3	15.3		13.8	12.9				
14-Dec-15	Fine	Moderate	14:10	Surface	1	23.1	23.1	8.0	7.9	29.4	29.9	90.9	92.5	6.6	6.7	6.8	9.6	10.0	8.4	17.6	18.3	17.5			
						23.1		7.8		30.4		94.1		6.8	6.7		6.8	10.0			10.0			19.0	
				Middle	5.5	22.9	23.0	7.9	7.9	30.2	30.7	93.9	94.3	6.8	6.8		7.7	8.0		8.4	23.3		19.9		
				23.0		7.9		31.2		94.6		6.8	6.8	6.7	6.7	8.2	8.0		16.4						
				Bottom	10	23.1	23.0	8.0	8.0	30.5	31.2	92.7	92.9	6.7	6.7	6.7	7.1	7.1		13.8	14.3				
						22.8		7.9		31.9		93.1		6.7		6.7	7.1	7.1		14.7	14.3				
16-Dec-15	Sunny	Moderate	15:51	Surface	1	21.3	21.2	8.2	8.1	29.7	30.1	96.8	96.2	7.2	7.2	7.1	9.7	10.1	8.4	19.8	20.9	24.9			
						21.0		8.0		30.4		95.6		7.1	7.2		7.1	10.1			10.1			22.0	
				Middle	5.5	22.4	22.6	8.2	8.2	32.7	31.1	96.8	96.6	7.0	7.0		7.8	8.0		8.4	26.3		25.4		
				22.8		8.1		29.5		96.3		7.0	7.0	7.1	7.1	8.2	8.0		24.5						
				Bottom	10	21.1	21.8	8.2	8.2	29.4	30.1	91.3	95.7	6.8	7.1	7.1	7.1	7.1		33.2	28.3				
						22.4		8.2		30.8		100.0		7.3		7.1	7.1		23.4	28.3					
18-Dec-15	Fine	Moderate	18:25	Surface	1	21.4	21.7	8.1	8.1	30.7	31.2	89.3	88.0	6.6	6.5	6.6	9.6	10.0	8.2	17.9	17.3	19.8			
						22.0		8.1		31.6		86.7		6.3	6.5		6.6	10.0			10.0			16.6	
				Middle	6	21.6	21.8	8.1	8.2	29.2	30.5	92.6	90.7	6.9	6.7		7.7	8.0		8.2	8.0			15.6	19.5
				21.9		8.2		31.8		88.8		6.5	6.5	6.5	6.5	8.2	8.0		23.3						
				Bottom	11	21.7	21.7	8.1	8.1	30.8	31.0	89.0	88.8	6.5	6.5	6.5	6.5	6.7		23.6	22.5				
						21.7		8.1		31.1		88.6		6.5		6.5	6.8	6.7		21.3	22.5				

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Dec-15	Fine	Moderate	08:50	Surface	1	22.6 22.7	22.7	8.2 8.2	8.2	24.2 24.7	24.5	97.8 95.3	96.6	8.3 8.1	8.2	8.2	7.6 8.4	8.0	9.6	21.6 17.6	19.6	21.0
				Middle	6	22.5 22.6	22.6	8.2 8.2	8.2	24.0 23.4	23.7	95.6 95.3	95.5	8.1 8.1	8.1		9.0 10.4	9.7		25.8 24.2	25.0	
				Bottom	11	22.5 22.5	22.5	8.2 8.2	8.2	25.5 24.8	25.2	95.7 91.8	93.8	8.1 7.8	8.0		8.0	11.2 10.8		11.0	20.4 16.1	
23-Dec-15	Fine	Moderate	10:37	Surface	1	21.5 20.8	21.2	7.7 7.6	7.7	30.8 30.8	30.8	90.4 82.6	86.5	6.7 6.2	6.5	6.6	7.9 9.1	8.5	6.2	13.6 13.4	13.5	16.9
				Middle	6	20.9 21.5	21.2	7.6 7.5	7.6	30.3 29.3	29.8	89.2 89.5	89.4	6.7 6.7	6.7		5.9 6.0	6.0		20.4 16.6	18.5	
				Bottom	11	20.8 20.5	20.7	7.5 7.7	7.6	30.5 30.8	30.7	86.3 86.1	86.2	6.5 6.5	6.5		6.5	4.2 4.1		4.2	17.8 19.5	
25-Dec-15	Cloudy	Moderate	12:25	Surface	1	21.2 21.2	21.2	8.2 8.2	8.2	29.0 29.1	29.1	89.1 88.8	89.0	6.7 6.7	6.7	6.8	3.8 3.7	3.8	4.0	12.0 7.5	9.8	9.3
				Middle	6	21.2 21.2	21.2	8.2 8.2	8.2	24.4 24.6	24.5	87.9 87.7	87.8	6.8 6.8	6.8		3.3 3.1	3.2		9.7 7.5	8.6	
				Bottom	11	21.2 21.2	21.2	8.2 8.2	8.2	24.4 29.5	27.0	87.2 87.3	87.3	6.7 6.5	6.6		6.6	4.7 5.2		5.0	8.4 10.7	
28-Dec-15	Fine	Moderate	14:39	Surface	1	21.9 21.9	21.9	7.6 7.6	7.6	29.4 29.4	29.4	97.0 96.9	97.0	7.2 7.2	7.2	7.0	6.1 6.5	6.3	9.5	10.1 12.4	11.3	8.8
				Middle	6	22.1 22.1	22.1	7.8 7.8	7.8	30.3 30.1	30.2	92.6 92.3	92.5	6.8 6.8	6.8		10.1 10.3	10.2		7.9 5.4	6.7	
				Bottom	11	22.2 22.2	22.2	7.8 7.9	7.9	31.8 31.7	31.8	91.8 91.6	91.7	6.7 6.6	6.7		6.7	12.0 12.2		12.1	8.4 8.5	
30-Dec-15	Cloudy	Moderate	15:29	Surface	1	20.8 19.7	20.3	7.6 7.7	7.7	25.8 26.1	26.0	89.5 79.6	84.6	6.9 6.2	6.6	6.1	5.0 5.0	5.0	6.0	9.6 9.9	9.8	9.6
				Middle	6.5	19.9 20.3	20.1	7.6 7.9	7.8	27.1 27.0	27.1	72.0 71.2	71.6	5.6 5.5	5.6		5.2 6.5	5.9		9.6 7.8	8.7	
				Bottom	12	20.1 19.6	19.9	7.9 7.8	7.9	26.6 26.6	26.6	71.9 86.8	79.4	5.6 6.8	6.2		6.2	6.9 7.3		7.1	11.5 9.3	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Dec-15	Fine	Moderate	11:55	Surface	1	25.6 25.4	25.5	7.8 7.8	7.8	24.2 24.4	24.3	95.7 95.9	95.8	6.8 6.9	6.9	6.8	5.7 5.5	5.6	6.0	16.4 13.6	15.0	15.5
				Middle	6	25.1 25.1	25.1	7.8 7.8	7.8	24.9 25.0	25.0	91.9 91.5	91.7	6.6 6.6	6.6		6.0 6.0	6.0		17.2 16.7	17.0	
				Bottom	11	24.5 24.3	24.4	7.8 7.8	7.8	26.1 25.8	26.0	89.0 87.9	88.5	6.4 6.4	6.4		6.6 6.3	6.5		15.7 13.0	14.4	
4-Dec-15	Fine	Moderate	13:49	Surface	1	26.0 26.0	26.0	7.6 7.6	7.6	28.3 28.2	28.3	103.7 104.8	104.3	7.3 7.3	7.3	7.2	6.0 6.3	6.2	9.8	13.7 14.4	14.1	13.9
				Middle	5.5	25.9 25.9	25.9	7.7 7.7	7.7	29.4 29.4	29.4	100.3 100.6	100.5	7.0 7.0	7.0		9.4 9.6	9.5		14.1 12.9	13.5	
				Bottom	10	25.9 25.8	25.9	7.8 7.8	7.8	30.8 30.7	30.8	96.4 95.9	96.2	6.9 6.8	6.9		13.8 13.5	13.7		14.1 14.2	14.2	
7-Dec-15	Sunny	Moderate	15:04	Surface	1	23.6 23.6	23.6	8.1 8.1	8.1	27.8 27.8	27.8	106.2 105.9	106.1	7.7 7.7	7.7	7.7	4.7 5.0	4.9	5.7	17.5 20.2	18.9	19.2
				Middle	6	23.6 23.6	23.6	8.1 8.1	8.1	29.2 29.1	29.2	105.9 105.9	105.9	7.6 7.6	7.6		6.1 6.3	6.2		20.0 18.2	19.1	
				Bottom	11	23.6 23.6	23.6	8.1 8.1	8.1	31.3 31.2	31.3	106.2 106.1	106.2	7.5 7.5	7.5		6.2 5.9	6.1		21.5 17.9	19.7	
9-Dec-15	Rainy	Moderate	17:24	Surface	1	25.6 25.6	25.6	8.1 8.1	8.1	27.4 27.4	27.4	82.8 80.4	81.6	5.8 5.6	5.7	5.9	6.1 7.0	6.6	8.2	17.1 15.7	16.4	17.1
				Middle	5.5	25.4 25.4	25.4	8.1 8.1	8.1	26.6 26.7	26.7	80.9 91.9	86.4	5.7 6.5	6.1		7.6 7.7	7.7		16.2 16.1	16.2	
				Bottom	10	25.3 25.3	25.3	8.1 8.1	8.1	27.2 26.4	26.8	79.5 90.4	85.0	5.6 6.4	6.0		9.7 10.6	10.2		18.9 18.7	18.8	
11-Dec-15	Fine	Moderate	17:15	Surface	1	21.7 21.7	21.7	8.1 8.1	8.1	28.9 28.9	28.9	93.7 93.7	93.7	7.0 7.0	7.0	7.0	7.1 6.9	7.0	11.2	23.4 18.9	21.2	22.2
				Middle	6.5	21.4 21.4	21.4	8.1 8.1	8.1	29.0 29.1	29.1	92.6 91.9	92.3	6.9 6.9	6.9		11.6 13.4	12.5		31.9 22.8	27.4	
				Bottom	12	21.5 21.5	21.5	8.1 8.1	8.1	29.3 29.3	29.3	91.3 91.2	91.3	6.8 6.8	6.8		14.2 14.1	14.2		18.1 18.0	18.1	
14-Dec-15	Fine	Moderate	08:59	Surface	1	22.7 23.0	22.9	8.0 7.8	7.9	29.1 29.0	29.1	91.2 90.8	91.0	6.7 6.6	6.7	6.7	7.3 8.3	7.8	6.2	17.8 23.8	20.8	20.9
				Middle	6	23.0 22.8	22.9	7.9 7.9	7.9	32.5 32.2	32.4	92.9 95.0	94.0	6.6 6.8	6.7		5.6 6.0	5.8		26.6 19.1	22.9	
				Bottom	11	22.8 23.0	22.9	7.9 8.0	8.0	31.4 28.9	30.2	93.1 91.2	92.2	6.7 6.6	6.7		4.9 5.3	5.1		17.0 20.9	19.0	
16-Dec-15	Sunny	Moderate	10:15	Surface	1	22.2 21.4	21.8	8.0 8.2	8.1	31.7 30.0	30.9	92.8 94.8	93.8	6.7 7.0	6.9	7.1	7.4 8.3	7.9	6.3	29.6 22.8	26.2	24.7
				Middle	5.5	21.5 21.7	21.6	8.1 8.0	8.1	32.1 28.8	30.5	99.9 96.2	98.1	7.3 7.2	7.3		5.7 6.0	5.9		19.5 27.3	23.4	
				Bottom	10	22.1 21.7	21.9	8.1 8.1	8.1	30.9 29.2	30.1	100.5 90.6	95.6	7.3 6.7	7.0		5.0 5.1	5.1		25.6 23.6	24.6	
18-Dec-15	Sunny	Moderate	12:10	Surface	1	21.3 21.6	21.5	8.2 8.2	8.2	29.7 28.9	29.3	87.8 89.7	88.8	6.5 6.7	6.6	6.5	7.3 8.3	7.8	6.2	16.1 22.4	19.3	19.3
				Middle	6	21.2 21.4	21.3	8.2 8.2	8.2	30.9 30.7	30.8	87.0 84.3	85.7	6.5 6.2	6.4		5.6 6.0	5.8		19.0 17.0	18.0	
				Bottom	11	21.6 21.7	21.7	8.1 8.2	8.2	31.5 31.8	31.7	90.6 92.4	91.5	6.6 6.8	6.7		4.8 4.9	4.9		23.9 17.3	20.6	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Dec-15	Fine	Moderate	15:14	Surface	1	23.1	23.1	8.1	8.1	25.9	26.3	74.9	78.7	6.4	6.7	6.5	9.6	10.0	10.1	17.1	16.8	17.2
						23.1		8.1		26.7		82.4		7.0			10.4					
				Middle	6	23.1	23.1	8.2	8.2	25.9	25.3	72.0	74.0	6.1	6.3	9.3	9.4	13.7		16.0		
		23.1		8.1		24.7		76.0		6.5		6.3	9.5		18.2							
		23.0	23.0	8.1	8.1	25.6	25.6	79.3	76.9	6.7	6.5	6.5	11.5	10.9	16.9	18.9						
		23.0		8.1		25.5		74.5		6.3		6.5	10.2		20.9							
23-Dec-15	Fine	Moderate	16:12	Surface	1	20.4	21.0	7.5	7.6	30.4	30.1	83.0	82.1	6.3	6.2	6.5	9.6	10.6	8.7	24.9	23.4	21.4
						21.5		7.6		29.7		81.1		6.0			11.5					
				Middle	6.5	20.0	20.1	7.5	7.6	29.3	29.7	84.7	88.1	6.5	6.8	8.6	8.1	20.9		25.4		
		20.1		7.6		30.1		91.5		7.0		7.5		29.9								
		20.3	20.8	7.5	7.6	29.7	30.1	85.1	87.5	6.5	6.6	6.6	6.6	6.6	6.6	7.3	13.4	15.3				
		21.3		7.7		30.5		89.9		6.7		6.6	8.0		17.2							
25-Dec-15	Cloudy	Moderate	17:13	Surface	1	21.3	21.3	8.2	8.2	27.2	27.2	104.9	104.9	7.9	7.9	7.9	3.4	3.4	4.0	8.6	7.1	6.8
						21.3		8.2		27.2		104.9		7.9			3.4					
				Middle	6	21.3	21.3	8.2	8.2	27.8	27.9	104.3	104.1	7.9	7.9	3.9	3.9	5.7		7.0		
		21.3		8.2		27.9		103.9		7.8		7.9	3.9		8.3							
		21.2	21.2	8.1	8.1	28.9	28.9	98.6	98.4	7.4	7.4	7.4	4.6	4.7	8.0	6.4						
		21.2		8.1		28.9		98.1		7.4		7.4	4.7		4.8							
28-Dec-15	Fine	Moderate	09:14	Surface	1	22.0	22.0	7.7	7.8	29.1	29.1	98.4	98.1	7.3	7.3	7.2	6.0	5.9	8.7	11.8	10.9	10.3
						22.0		7.8		29.1		97.7		7.2			5.8					
				Middle	6	22.1	22.0	7.9	7.9	30.9	30.8	95.5	95.4	7.0	7.0	8.3	8.3	10.1		10.5		
		21.9		7.8		30.6		95.3		7.0		8.2		10.8								
		22.1	22.1	7.9	8.0	31.4	31.6	91.3	91.8	6.6	6.7	6.7	11.9	12.0	9.2	9.4						
		22.1		8.0		31.7		92.2		6.7		6.7	12.0		9.5							
30-Dec-15	Cloudy	Moderate	10:01	Surface	1	19.8	20.1	7.7	7.8	28.0	26.7	73.9	79.4	5.7	6.2	5.9	4.6	5.1	5.9	10.9	10.6	10.4
						20.3		7.8		25.3		84.8		6.6			5.6					
				Middle	6	20.0	19.8	7.8	7.8	26.6	26.7	75.1	70.1	5.8	5.5	6.0	6.4	10.3		10.6		
		19.6		7.8		26.8		65.1		5.1		5.5	6.8		10.9							
		20.2	20.1	7.6	7.7	26.5	27.0	87.1	83.6	6.8	6.5	6.5	6.3	6.3	11.0	10.0						
		20.0		7.8		27.5		80.0		6.2		6.5	6.2		8.9							

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Dec-15	Fine	Moderate	16:45	Surface	1	25.4 25.4	25.4	7.9 7.8	7.9	24.7 25.1	24.9	111.2 111.2	111.2	7.9 7.9	7.9	7.9	5.3 5.0	5.2	9.3	16.3 14.9	15.6	17.2
				Middle	4	25.4 25.4	25.4	7.9 7.8	7.9	26.6 26.6	26.6	111.3 110.5	110.9	7.9 7.8	7.9		10.5 10.5	10.5		24.8 25.0	22.4	
				Bottom	7	25.4 25.4	25.4	7.9 7.9	7.9	26.6 26.7	26.7	109.8 109.8	109.8	7.8 7.8	7.8		11.9 12.4	12.2		13.2 14.0	13.6	
4-Dec-15	Fine	Moderate	19:24	Surface	1	26.0 25.9	26.0	8.0 7.9	8.0	27.8 27.8	27.8	103.7 103.6	103.7	7.2 7.2	7.2	7.1	7.3 7.2	7.3	9.5	13.8 16.1	15.0	18.5
				Middle	4	25.9 25.9	25.9	8.0 7.9	8.0	29.0 28.9	29.0	101.9 101.9	101.9	7.0 7.0	7.0		8.9 8.6	8.8		24.8 28.1	26.5	
				Bottom	7	25.9 25.9	25.9	8.1 8.1	8.1	29.1 29.0	29.1	95.6 95.8	95.7	6.6 6.6	6.6		12.5 12.0	12.3		15.9 11.8	13.9	
7-Dec-15	Sunny	Moderate	09:44	Surface	1	21.1 21.1	21.1	8.1 8.1	8.1	28.2 28.2	28.2	100.0 100.6	100.3	7.5 7.6	7.6	7.6	6.4 6.4	6.4	7.1	18.6 23.3	21.0	20.1
				Middle	3.5	21.1 21.1	21.1	8.1 8.1	8.1	28.2 28.2	28.2	99.8 101.2	100.5	7.5 7.6	7.6		6.4 6.5	6.5		23.4 18.7	21.1	
				Bottom	6	21.1 21.1	21.1	8.1 8.2	8.2	28.2 28.2	28.2	100.5 102.4	101.5	7.6 7.7	7.7		8.3 8.4	8.4		20.3 16.1	18.2	
9-Dec-15	Rainy	Moderate	10:11	Surface	1	24.6 24.2	24.4	8.1 8.2	8.2	22.7 26.2	24.5	89.9 73.9	81.9	6.6 5.3	6.0	5.9	7.3 8.9	8.1	7.9	43.8 39.4	41.6	39.3
				Middle	4	24.6 24.4	24.5	8.2 8.1	8.2	24.4 22.8	23.6	86.1 69.0	77.6	6.2 5.1	5.7		9.3 9.4	9.4		39.2 37.6	38.4	
				Bottom	7	24.2 24.4	24.3	8.2 8.2	8.2	24.4 22.6	23.5	82.4 76.9	79.7	6.0 5.6	5.8		6.7 5.8	6.3		39.4 36.4	37.9	
11-Dec-15	Sunny	Moderate	12:20	Surface	1	21.5 21.5	21.5	8.1 8.0	8.1	28.4 28.5	28.5	99.3 100.2	99.8	7.4 7.5	7.5	7.5	5.0 4.9	5.0	8.4	14.6 17.1	15.9	17.5
				Middle	4	21.3 21.4	21.4	7.9 7.9	7.9	28.7 28.7	28.7	97.1 98.6	97.9	7.3 7.4	7.4		7.1 7.3	7.2		15.6 20.0	17.8	
				Bottom	7	21.2 21.1	21.2	8.0 8.0	8.0	29.7 29.4	29.6	91.5 91.7	91.6	6.8 6.9	6.9		13.1 13.1	13.1		18.9 18.9	18.9	
14-Dec-15	Fine	Moderate	13:50	Surface	1	25.0 25.0	25.0	7.8 7.8	7.8	24.3 24.2	24.3	95.8 95.6	95.7	6.9 6.9	6.9	6.8	4.1 3.7	3.9	5.5	19.0 25.4	22.2	22.9
				Middle	4	24.1 23.9	24.0	7.9 7.9	7.9	26.8 27.4	27.1	92.1 91.3	91.7	6.6 6.6	6.6		4.3 4.3	4.3		23.8 20.7	22.3	
				Bottom	7	22.1 22.1	22.1	7.8 7.8	7.8	31.9 32.0	32.0	87.7 86.4	87.1	6.4 6.3	6.4		7.9 8.9	8.4		21.3 26.8	24.1	
16-Dec-15	Sunny	Moderate	15:11	Surface	1	23.5 22.7	23.1	8.2 8.2	8.2	30.2 32.1	31.2	98.7 90.5	94.6	7.1 6.5	6.8	6.8	7.1 8.0	7.6	7.6	20.8 18.3	19.6	25.5
				Middle	3.5	23.5 22.7	23.1	8.2 8.2	8.2	30.2 32.2	31.2	92.7 93.2	93.0	6.6 6.7	6.7		7.4 7.7	7.6		32.6 22.8	27.7	
				Bottom	6	23.5 22.7	23.1	8.2 8.2	8.2	30.2 32.2	31.2	101.4 101.7	101.6	7.3 7.3	7.3		7.5 7.7	7.6		28.6 30.0	29.3	
18-Dec-15	Fine	Moderate	17:28	Surface	1	21.9 21.9	21.9	8.1 8.1	8.1	29.8 29.9	29.9	93.8 92.7	93.3	6.9 6.8	6.9	6.7	5.8 6.2	6.0	7.5	18.3 24.5	21.4	20.6
				Middle	4	21.7 21.6	21.7	8.1 8.2	8.2	30.6 30.9	30.8	85.1 87.2	86.2	6.3 6.4	6.4		6.4 6.5	6.5		23.0 22.1	22.6	
				Bottom	7	21.5 21.5	21.5	8.2 8.2	8.2	32.2 32.4	32.3	80.7 82.4	81.6	5.9 6.0	6.0		10.3 9.8	10.1		18.0 17.3	17.7	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Dec-15	Fine	Moderate	08:02	Surface	1	22.8 22.7	22.8	8.2 8.2	8.2	24.2 24.7	24.5	96.9 86.4	91.7	7.3 6.5	6.9	6.7	7.3 8.2	7.8	9.5	9.1 9.5	9.3	9.9
				Middle	4	22.8 22.8	22.8	8.2 8.2	8.2	24.0 23.4	23.7	91.6 81.4	86.5	6.9 6.1	6.5		8.9 10.6	9.8		12.2 7.9	10.1	
				Bottom	7	22.7 22.8	22.8	8.2 8.2	8.2	25.5 24.8	25.2	89.3 86.0	87.7	6.7 6.4	6.6		6.6	11.0 10.8		10.9	11.4 9.4	
23-Dec-15	Fine	Moderate	09:42	Surface	1	21.7 21.8	21.8	7.5 7.6	7.6	28.2 28.2	28.2	95.8 95.9	95.9	7.2 7.1	7.2	7.1	3.0 2.9	3.0	5.1	20.8 25.6	23.2	24.2
				Middle	4	20.6 20.4	20.5	7.6 7.6	7.6	29.1 29.1	29.1	91.5 90.3	90.9	6.9 6.9	6.9		6.5 6.9	6.7		20.1 21.4	20.8	
				Bottom	7	20.0 19.7	19.9	7.6 7.6	7.6	30.1 30.1	30.1	86.7 84.8	85.8	6.6 6.5	6.6		6.6	5.6 5.8		5.7	25.5 31.5	
25-Dec-15	Cloudy	Moderate	11:42	Surface	1	21.1 21.1	21.1	8.1 8.1	8.1	27.2 27.2	27.2	92.5 101.6	97.1	7.0 7.7	7.4	7.4	5.5 5.5	5.5	6.2	8.9 12.1	10.5	9.0
				Middle	3.5	21.1 22.0	21.6	8.1 8.1	8.1	27.2 27.2	27.2	91.6 103.2	97.4	7.0 7.7	7.4		5.5 5.6	5.6		9.1 9.7	9.4	
				Bottom	6	21.1 22.0	21.6	8.1 8.2	8.2	27.2 27.2	27.2	101.8 107.6	104.7	7.7 8.0	7.9		7.9	7.4 7.5		7.5	7.4 6.6	
28-Dec-15	Fine	Moderate	13:26	Surface	1	23.6 22.9	23.3	7.8 7.8	7.8	30.2 30.1	30.2	102.5 106.2	104.4	7.3 7.7	7.5	7.7	6.6 7.1	6.9	7.1	8.0 7.9	8.0	9.6
				Middle	3.5	23.6 22.8	23.2	7.7 7.8	7.8	30.2 30.2	30.2	112.4 104.9	108.7	8.0 7.6	7.8		6.9 7.2	7.1		10.5 11.6	11.1	
				Bottom	6	23.6 22.8	23.2	7.7 7.8	7.8	30.2 30.2	30.2	108.3 102.7	105.5	7.7 7.4	7.6		7.6	7.0 7.4		7.2	10.3 9.3	
30-Dec-15	Cloudy	Moderate	14:47	Surface	1	20.2 19.2	19.7	7.9 7.8	7.9	26.1 26.1	26.1	78.6 74.7	76.7	6.1 5.9	6.0	6.3	10.5 10.5	10.5	11.3	10.8 8.2	9.5	10.2
				Middle	4	19.2 20.2	19.7	7.8 7.9	7.9	27.0 27.0	27.0	82.2 83.0	82.6	6.5 6.4	6.5		13.2 13.5	13.4		11.3 9.9	10.6	
				Bottom	7	20.1 20.2	20.2	7.8 7.9	7.9	27.5 27.6	27.6	78.4 82.3	80.4	6.1 6.3	6.2		6.2	9.2 10.8		10.0	11.4 9.4	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
2-Dec-15	Fine	Moderate	11:02	Surface	1	25.6	25.6	7.9	7.9	23.3	23.3	97.7	97.7	7.0	7.0	6.9	4.1	4.2	7.7	13.6	15.0	15.8		
						25.6	25.6	7.9	7.9	23.3	23.3	97.6	97.6	7.0	7.0		4.2	4.2		16.4	17.0			
				Middle	4	25.6	25.6	7.9	7.9	25.3	25.3	95.3	95.2	6.8	6.8	6.2	6.8	6.2		6.8	19.2		14.7	
				25.6	25.6	7.9	7.9	25.3	25.3	95.1	95.2	6.7	6.8	6.7	6.7	6.7	6.7	11.9	12.1	14.6	15.4			
				Bottom	7	25.7	25.7	7.9	7.9	26.3	26.3	94.7	94.7	6.7	6.7	6.7	6.7	6.7	6.7	11.9	12.3	12.1	14.6	16.2
4-Dec-15	Fine	Moderate	13:04	Surface	1	26.0	26.0	7.9	7.9	28.0	27.9	102.7	102.7	7.1	7.1	7.1	4.9	4.9	7.7	9.5	10.7	12.0		
						26.0	26.0	7.9	7.9	27.7	27.7	102.6	102.6	7.1	7.1		4.8	4.8		11.8	10.7			
				Middle	4	26.0	26.0	7.8	7.8	28.5	28.6	102.0	102.1	7.1	7.1	7.0	7.2	7.0		7.2	16.4		14.7	
				26.0	26.0	7.8	7.8	28.6	28.6	102.2	102.1	7.1	7.1	7.3	7.2	7.3	7.2	12.9	14.7					
				Bottom	7	25.9	25.9	8.2	8.2	29.1	29.1	95.5	94.8	6.6	6.6	6.6	6.6	6.6	6.6	10.6	10.9	9.8	10.5	
				25.9	25.9	8.2	8.2	29.1	29.1	94.0	94.8	6.5	6.6	6.5	6.6	6.6	6.6	11.2	10.9	11.2	10.5			
7-Dec-15	Sunny	Moderate	14:43	Surface	1	24.0	23.6	8.2	8.2	28.1	28.3	97.9	97.2	7.0	7.0	7.5	6.9	6.4	8.0	11.7	12.4	16.6		
						23.1	23.6	8.1	8.2	28.5	28.3	96.4	97.2	7.0	7.0		5.8	6.4		13.1	12.4			
				Middle	3.5	24.0	23.6	8.2	8.3	27.8	28.2	110.8	108.4	8.0	7.9	8.3	8.2	8.1		8.2	20.1		17.3	
				23.1	23.6	8.3	8.3	28.5	28.2	106.0	108.4	7.7	7.9	8.1	8.2	8.1	8.2	14.4	17.3					
				Bottom	6	24.1	23.6	8.2	8.3	27.7	28.1	107.6	109.1	7.7	7.9	7.9	7.9	9.3	9.5	23.2	20.2			
				23.1	23.6	8.3	8.3	28.5	28.1	110.6	110.6	8.0	7.9	8.0	7.9	7.9	7.9	9.6	9.5	17.2	20.2			
9-Dec-15	Rainy	Moderate	15:58	Surface	1	25.3	25.3	8.2	8.2	22.7	24.7	82.3	85.9	6.0	6.2	6.2	7.3	7.4	7.0	24.2	25.4	26.1		
						25.3	25.3	8.2	8.2	26.7	24.7	89.4	85.9	6.3	6.2		7.4	7.4		26.6	25.4			
				Middle	4	25.2	25.2	8.2	8.2	23.4	25.2	82.0	85.5	5.9	6.1	8.2	8.3	8.2		8.3	27.2		27.8	
				25.2	25.2	8.1	8.2	27.0	25.2	88.9	85.5	6.3	6.1	8.3	8.3	8.3	8.3	28.4	27.8					
				Bottom	7	25.3	25.4	8.1	8.1	27.3	27.3	83.2	86.1	5.9	6.1	6.1	6.1	5.1	5.2	23.4	25.1			
				25.4	25.4	8.1	8.1	27.3	27.3	89.0	86.1	6.3	6.1	6.1	6.1	5.2	5.2	26.8	25.1					
11-Dec-15	Fine	Moderate	17:02	Surface	1	21.5	21.5	7.9	7.9	28.0	28.0	102.3	102.5	7.7	7.7	7.6	6.2	6.3	10.0	23.3	24.1	18.0		
						21.5	21.5	7.9	7.9	28.0	28.0	102.7	102.5	7.7	7.7		6.4	6.3		24.8	24.1			
				Middle	4	21.2	21.2	7.9	7.9	28.5	28.5	99.4	98.4	7.5	7.4	9.4	9.5	9.4		9.5	15.2		14.6	
				21.2	21.2	7.9	7.9	28.4	28.5	97.3	98.4	7.3	7.4	9.5	9.5	9.5	9.5	13.9	14.6					
				Bottom	7	21.1	21.1	8.1	8.1	29.8	29.8	93.2	94.1	7.0	7.1	7.1	7.1	14.0	14.1	17.7	15.2			
				21.1	21.1	8.1	8.1	29.8	29.8	95.0	94.1	7.1	7.1	7.1	7.1	14.2	14.1	12.7	15.2					
14-Dec-15	Fine	Moderate	08:08	Surface	1	24.9	24.9	7.9	7.9	25.0	25.0	99.1	99.3	7.1	7.1	6.8	4.8	4.8	7.9	18.0	17.3	17.8		
						24.9	24.9	7.9	7.9	25.0	25.0	99.4	99.3	7.1	7.1		4.8	4.8		16.5	17.3			
				Middle	4	22.9	22.9	7.8	7.8	28.3	28.3	89.1	88.7	6.5	6.5	7.2	7.4	7.2		7.4	18.7		21.4	
				22.9	22.9	7.8	7.8	28.3	28.3	88.3	88.7	6.5	6.5	7.5	7.4	7.5	7.4	24.1	21.4					
				Bottom	7	22.6	22.6	7.8	7.8	29.1	29.1	87.1	86.9	6.4	6.4	6.4	6.4	11.7	11.6	14.2	14.8			
				22.6	22.6	7.8	7.8	29.1	29.1	86.7	86.9	6.3	6.4	6.4	6.4	11.5	11.6	11.5	11.6	15.4	14.8			
16-Dec-15	Sunny	Moderate	09:42	Surface	1	22.6	22.5	8.2	8.2	29.0	29.1	100.0	102.4	7.3	7.5	7.7	7.0	7.2	7.3	27.3	33.7	27.4		
						22.4	22.5	8.2	8.2	29.1	29.1	104.8	102.4	7.7	7.5		7.3	7.2		40.0	33.7			
				Middle	3.5	22.5	21.9	8.2	8.2	29.1	29.7	109.5	105.9	8.0	7.8	7.4	7.4	7.4		7.4	19.5		20.1	
				21.3	21.9	8.2	8.2	30.3	29.7	102.2	105.9	7.6	7.8	7.4	7.4	7.4	7.4	20.7	20.1					
				Bottom	6	22.4	21.9	8.2	8.2	29.1	29.7	105.5	102.8	7.7	7.6	7.6	7.6	7.4	7.4	32.2	28.3			
				21.3	21.9	8.2	8.2	30.3	29.7	100.0	102.8	7.4	7.6	7.4	7.6	7.4	7.4	24.3	28.3					
18-Dec-15	Sunny	Moderate	11:20	Surface	1	22.2	22.2	8.0	8.1	28.7	28.7	93.5	94.0	6.9	7.0	6.8	5.8	5.7	8.5	20.3	20.5	22.9		
						22.2	22.2	8.1	8.1	28.6	28.7	94.5	94.0	7.0	7.0		5.6	5.7		20.6	20.5			
				Middle	4.5	21.7	21.7	8.1	8.2	29.9	30.1	86.0	86.7	6.4	6.5	8.9	8.9	8.9		8.9	24.4		23.4	
				21.7	21.7	8.2	8.2	30.2	30.1	87.4	86.7	6.5	6.5	8.8	8.9	8.8	8.9	22.4	23.4					
				Bottom	8	21.5	21.5	8.3	8.3	31.1	31.0	82.9	83.1	6.1	6.1	6.1	6.1	11.0	11.0	24.6	24.7			
				21.5	21.5	8.3	8.3	30.8	31.0	83.2	83.1	6.1	6.1	6.1	6.1	10.9	11.0	10.9	11.0	24.8	24.7			

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
21-Dec-15	Fine	Moderate	14:50	Surface	1	23.1	23.1	8.2	8.2	23.6	24.5	104.4	106.6	7.8	8.0	8.0	8.0	8.0	9.8	17.3	21.3	16.5			
						23.1		8.2		25.4		108.8		8.1						7.9				25.2	
				Middle	4	23.0	23.0	8.2	8.2	24.8	25.6	104.2	106.2	7.8	7.9			10.3		11.1			14.7	16.3	
				23.0		8.1		26.3		108.1		8.0				11.8			17.9						
				Bottom	7	23.1	23.1	8.2	8.2	26.4	26.7	103.9	106.0	7.6	7.8	7.8	10.2	10.4		10.6	12.0				
						23.1		8.2		26.9		108.1		7.9			10.5			13.4					
23-Dec-15	Fine	Moderate	15:33	Surface	1	20.7	20.2	7.6	7.6	27.3	27.4	89.5	88.9	6.8	6.9	6.7	10.8	10.8	10.9	14.9	15.0	21.2			
						19.7		7.5		27.4		88.2		6.9						10.7				15.0	
				Middle	4	19.7	20.2	7.5	7.6	28.4	28.4	83.7	84.0	6.5	6.5			11.8		11.7			23.6	22.6	
				20.7		7.6		28.4		84.2		6.4				11.6			21.5						
				Bottom	7	20.6	20.7	7.6	7.6	29.4	29.5	80.3	80.6	6.1	6.1	6.1	9.4	10.2		26.0	26.1				
						20.7		7.6		29.5		80.8		6.1			11.0			26.2					
25-Dec-15	Cloudy	Moderate	17:01	Surface	1	24.0	23.6	8.2	8.2	29.1	29.3	105.8	105.4	7.5	7.6	7.6	6.2	5.7	7.3	11.4	11.6	10.8			
						23.1		8.1		29.5		105.0		7.6						5.1				11.8	
				Middle	3.5	24.0	23.6	8.2	8.2	28.8	29.2	105.6	105.6	7.5	7.6			7.6		7.5			10.2	12.3	
				23.1		8.2		29.5		105.6		7.6				7.4			14.3						
				Bottom	6	24.1	23.7	8.2	8.2	28.8	29.2	106.2	106.6	7.6	7.7	7.7	8.6	8.8		7.7	8.6				
						23.2		8.2		29.5		107.0		7.7			8.9			9.5					
28-Dec-15	Fine	Moderate	09:11	Surface	1	22.7	22.6	7.8	7.8	29.0	29.1	96.8	92.7	7.1	6.8	6.8	6.2	6.4	6.6	10.5	11.8	11.9			
						22.5		7.8		29.1		88.6		6.5						6.5				13.0	
				Middle	3.5	22.6	22.0	7.8	7.8	29.1	29.2	90.7	90.2	6.6	6.7			6.6		6.7			12.1	12.8	
				21.4		7.8		29.3		89.7		6.7				6.7			13.5						
				Bottom	6	22.6	22.0	7.8	7.8	29.1	29.2	99.2	98.5	7.3	7.3	7.3	6.6	6.7		10.0	11.0				
						21.4		7.7		29.3		97.8		7.3			6.8			11.9					
30-Dec-15	Cloudy	Moderate	09:05	Surface	1	21.2	21.3	7.8	7.8	26.3	26.3	84.9	84.4	6.5	6.5	6.3	2.8	2.8	4.9	8.3	9.0	8.1			
						21.3		7.8		26.3		83.9		6.4						2.7				9.6	
				Middle	4	20.1	20.0	7.8	7.9	27.0	27.1	80.5	78.4	6.2	6.1			6.3		6.5			6.7	7.7	
				19.9		7.9		27.1		76.3		5.9				6.7			8.6						
				Bottom	7	19.5	19.4	7.9	7.9	27.9	27.9	70.3	69.5	5.5	5.5	5.5	5.4	5.5		7.0	7.7				
						19.2		7.8		27.8		68.6		5.4			5.6			8.3					

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Dec-15	Fine	Moderate	17:40	Surface	1	25.4 25.4	25.4	7.9 7.9	7.9	25.5 25.3	25.4	112.3 111.3	111.8	8.0 7.9	8.0	8.0	10.4 10.2	10.3	12.5	18.8 16.4	17.6	15.8
				Middle	5	25.4 25.3	25.4	7.9 7.9	7.9	26.2 26.4	26.3	111.2 110.6	110.9	7.9 7.8	7.9		12.3 12.5	12.4		19.4 12.8	16.1	
				Bottom	9	25.4 25.5	25.5	7.9 7.9	7.9	27.1 27.1	27.1	110.5 110.4	110.5	7.8 7.8	7.8		14.1 15.3	14.7		13.4 14.0	13.7	
4-Dec-15	Fine	Moderate	20:17	Surface	1	26.0 26.0	26.0	7.9 7.9	7.9	27.6 27.9	27.8	106.1 106.2	106.2	7.4 7.4	7.4	7.3	7.6 7.7	7.7	10.3	16.8 10.8	13.8	14.4
				Middle	5	25.8 25.8	25.8	7.9 8.0	8.0	28.7 28.9	28.8	103.2 105.0	104.1	7.1 7.3	7.2		9.1 9.3	9.2		13.5 11.3	12.4	
				Bottom	9	25.8 25.8	25.8	7.9 7.9	7.9	29.9 30.0	30.0	99.3 99.1	99.2	6.8 6.8	6.8		14.0 14.1	14.1		17.2 16.7	17.0	
7-Dec-15	Sunny	Moderate	10:43	Surface	1	22.0 21.2	21.6	8.2 8.2	8.2	29.6 29.1	29.4	101.4 93.3	97.4	7.5 7.0	7.3	7.2	5.3 5.8	5.6	6.8	11.4 17.6	14.5	17.7
				Middle	4.5	21.2 21.2	21.2	8.3 8.1	8.2	29.1 29.1	29.1	93.7 92.5	93.1	7.0 6.9	7.0		6.3 6.7	6.5		17.2 19.0	18.1	
				Bottom	8	21.2 21.2	21.2	8.2 8.2	8.2	29.1 29.1	29.1	92.7 91.3	92.0	7.0 6.8	6.9		8.4 8.2	8.3		21.6 19.2	20.4	
9-Dec-15	Rainy	Moderate	11:15	Surface	1	23.7 24.6	24.2	8.2 8.2	8.2	24.7 26.4	25.6	83.8 89.2	86.5	6.2 6.4	6.3	6.3	10.7 8.6	9.7	9.4	28.0 38.0	33.0	34.4
				Middle	5	23.7 24.6	24.2	8.2 8.2	8.2	26.5 22.5	24.5	89.4 82.4	85.9	6.5 6.0	6.3		8.2 8.3	8.3		31.6 40.0	35.8	
				Bottom	9	23.6 24.5	24.1	8.2 8.2	8.2	26.1 22.9	24.5	71.9 72.0	72.0	5.3 5.3	5.3		10.0 10.6	10.3		38.1 30.5	34.3	
11-Dec-15	Sunny	Moderate	13:13	Surface	1	21.5 21.5	21.5	7.8 7.8	7.8	27.4 27.3	27.4	99.9 101.2	100.6	7.5 7.6	7.6	7.6	7.9 7.7	7.8	11.1	21.2 19.1	20.2	20.1
				Middle	5	21.3 21.3	21.3	7.8 7.8	7.8	29.1 29.4	29.3	99.4 103.1	101.3	7.4 7.7	7.6		11.5 11.8	11.7		21.0 22.2	21.6	
				Bottom	9	21.0 21.0	21.0	8.2 8.1	8.2	29.8 29.7	29.8	93.7 98.0	95.9	7.0 7.3	7.2		13.8 14.0	13.9		15.2 21.7	18.5	
14-Dec-15	Fine	Moderate	14:53	Surface	1	24.5 24.5	24.5	7.9 7.9	7.9	25.2 25.2	25.2	93.8 91.4	92.6	6.8 6.6	6.7	6.7	7.5 7.5	7.5	8.9	22.4 14.6	18.5	18.5
				Middle	5	23.2 23.2	23.2	7.9 7.9	7.9	28.9 28.9	28.9	92.3 90.2	91.3	6.7 6.5	6.6		6.7 6.8	6.8		25.3 19.1	22.2	
				Bottom	9	22.1 22.1	22.1	7.8 7.8	7.8	31.8 31.7	31.8	88.9 88.6	88.8	6.5 6.4	6.5		12.1 12.5	12.3		13.4 15.9	14.7	
16-Dec-15	Sunny	Moderate	16:12	Surface	1	23.2 22.5	22.9	8.3 8.3	8.3	29.8 30.0	29.9	98.4 104.1	101.3	7.1 7.6	7.4	7.4	7.1 7.3	7.2	7.2	27.6 28.3	28.0	26.4
				Middle	4.5	23.2 22.5	22.9	8.3 8.3	8.3	29.8 30.1	30.0	100.4 104.6	102.5	7.2 7.6	7.4		7.0 7.3	7.2		23.0 27.7	25.4	
				Bottom	8	23.2 22.4	22.8	8.3 8.3	8.3	29.8 30.3	30.1	97.6 99.8	98.7	7.0 7.3	7.2		6.8 7.4	7.1		28.2 23.4	25.8	
18-Dec-15	Fine	Moderate	18:16	Surface	1	22.0 21.9	22.0	8.1 8.1	8.1	29.6 29.8	29.7	93.4 95.3	94.4	6.9 7.0	7.0	6.8	4.9 4.9	4.9	9.1	12.4 13.2	12.8	15.8
				Middle	5	21.8 21.8	21.8	8.2 8.2	8.2	31.2 30.9	31.1	88.9 89.8	89.4	6.5 6.6	6.6		10.9 10.7	10.8		17.2 16.8	17.0	
				Bottom	9	21.3 21.3	21.3	8.4 8.3	8.4	32.4 32.5	32.5	82.8 81.5	82.2	6.1 6.0	6.1		11.5 11.5	11.5		17.4 17.5	17.5	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Dec-15	Fine	Moderate	08:59	Surface	1	22.5 22.9	22.7	8.2 8.2	8.2	23.7 23.5	23.6	91.4 93.8	92.6	6.9 7.1	7.0	7.0	10.0 8.7	9.4	12.0	19.8 19.0	19.4	18.1
				Middle	5	22.5 22.8	22.7	8.2 8.2	8.2	25.1 25.4	25.3	93.7 90.4	92.1	7.0 6.7	6.9		11.3 13.1	12.2		15.9 13.7	14.8	
				Bottom	9	22.4 22.8	22.6	8.2 8.2	8.2	25.4 25.1	25.3	83.0 83.5	83.3	6.2 6.2	6.2		14.5 14.5	14.5		18.2 22.1	20.2	
23-Dec-15	Fine	Moderate	10:47	Surface	1	22.0 21.8	21.9	7.5 7.6	7.6	29.1 29.1	29.1	91.2 91.1	91.2	6.7 6.8	6.8	6.8	2.0 2.2	2.1	8.9	15.2 21.7	18.5	23.2
				Middle	5	21.1 21.3	21.2	7.5 7.5	7.5	30.3 30.4	30.4	90.2 91.1	90.7	6.7 6.8	6.8		11.0 11.9	11.5		22.7 18.0	20.4	
				Bottom	9	21.4 21.3	21.4	7.5 7.5	7.5	30.9 30.8	30.9	86.9 88.1	87.5	6.4 6.5	6.5		13.1 12.8	13.0		22.6 39.0	30.8	
25-Dec-15	Cloudy	Moderate	12:41	Surface	1	22.0 21.1	21.6	8.2 8.2	8.2	28.6 28.1	28.4	107.1 104.5	105.8	7.9 7.9	7.9	7.9	4.4 4.9	4.7	5.9	8.5 7.3	7.9	8.6
				Middle	4.5	22.0 21.1	21.6	8.2 8.2	8.2	28.0 28.1	28.1	106.0 104.5	105.3	7.9 7.9	7.9		5.4 5.8	5.6		9.7 9.0	9.4	
				Bottom	8	22.0 21.2	21.6	8.2 8.2	8.2	28.1 28.1	28.1	106.0 94.4	100.2	7.9 7.1	7.5		7.5 7.3	7.4		8.2 8.5	8.4	
28-Dec-15	Fine	Moderate	14:28	Surface	1	23.4 22.7	23.1	7.8 7.8	7.8	29.8 30.0	29.9	94.2 105.4	99.8	6.8 7.7	7.3	7.1	6.1 6.2	6.2	6.6	10.2 11.6	10.9	10.5
				Middle	4.5	23.4 22.6	23.0	7.7 7.8	7.8	29.8 30.1	30.0	89.0 101.2	95.1	6.4 7.4	6.9		6.5 6.8	6.7		9.5 9.6	9.6	
				Bottom	8	23.4 22.5	23.0	7.7 7.8	7.8	29.8 30.3	30.1	111.6 113.5	112.6	8.0 8.3	8.2		6.9 7.1	7.0		12.5 9.6	11.1	
30-Dec-15	Cloudy	Moderate	15:46	Surface	1	18.8 19.8	19.3	7.8 7.9	7.9	26.7 26.6	26.7	80.6 84.0	82.3	6.4 6.6	6.5	6.4	5.6 5.1	5.4	5.1	9.6 9.2	9.4	9.5
				Middle	5	21.3 18.8	20.1	7.9 7.8	7.9	27.5 27.4	27.5	81.5 77.4	79.5	6.2 6.1	6.2		5.2 4.9	5.1		7.2 11.8	9.5	
				Bottom	9	19.1 19.2	19.2	7.7 7.8	7.8	27.7 27.6	27.7	64.2 64.5	64.4	5.0 5.1	5.1		4.7 4.8	4.8		9.7 9.2	9.5	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
2-Dec-15	Fine	Moderate	11:59	Surface	1	25.7	25.7	7.9	7.9	24.4	24.4	97.2	97.1	6.9	6.9	6.9	6.0	5.7	11.0	16.8	15.7	16.7			
						25.7		7.9		24.3		97.0		6.9			6.0			11.0	16.8			15.7	
				Middle	5	25.6	25.6	7.9	7.9	26.0	26.0	96.0	95.8	6.8	6.8		12.4	12.2		11.0	21.0		21.1	16.7	
		25.6		7.9		26.0		95.6		6.7		6.8		6.8	11.0	12.4		21.0		16.7					
		25.6		7.9		26.2		95.3		6.7		6.7		6.7	11.0	15.4		13.5		16.7					
		25.6		7.9		26.3		95.0		6.7		6.7		6.7	11.0	14.8		13.1		16.7					
4-Dec-15	Fine	Moderate	13:55	Surface	1	26.0	26.0	8.1	8.1	27.8	27.8	102.7	102.4	7.1	7.1	7.2	7.9	7.8	11.3	13.5	13.1	14.4			
						26.0		8.1		27.7		102.1		7.1			7.2	7.8		11.3	13.5			13.1	
				Middle	5	25.8	25.8	8.0	8.0	28.3	28.3	103.1	103.3	7.2	7.2		12.0	12.1		11.3	10.9		12.0	14.4	
		25.8		7.9		28.2		103.4		7.2		7.2		7.2	11.3	12.1		12.0		14.4					
		25.8		8.0		30.4		100.9		6.9		6.9		6.9	11.3	14.0		17.8		14.4					
		25.8		8.1		30.5		100.0		6.9		6.9		6.9	11.3	14.2		18.1		14.4					
7-Dec-15	Sunny	Moderate	15:44	Surface	1	23.1	23.6	8.1	8.2	26.7	27.5	108.1	109.3	7.9	7.9	7.9	5.6	5.2	7.0	14.8	17.6	19.7			
						24.1		8.3		28.3		110.4		7.9			7.9	5.2		5.2	7.0		14.8		17.6
				Middle	4.5	24.1	24.1	8.3	8.3	28.3	28.3	110.2	110.3	7.9	7.9		7.3	7.2		7.0	21.2		20.6	19.7	
		24.1		8.2		28.3		110.4		7.9		7.9		7.9	7.0	7.1		19.9		19.7					
		24.1		8.3		28.3		110.2		7.9		7.9		7.9	7.0	8.6		24.3		19.7					
		24.1		8.2		28.2		109.4		7.8		7.9		7.9	7.0	8.6		17.6		19.7					
9-Dec-15	Rainy	Moderate	16:56	Surface	1	25.4	25.3	8.1	8.1	27.3	27.2	83.2	86.1	5.9	6.1	6.2	7.5	7.6	7.9	30.5	31.1	31.0			
						25.2		8.1		27.0		88.9		6.3			6.1	7.6		7.6	7.9		31.7	31.1	31.0
				Middle	5	25.3	25.4	8.2	8.2	26.7	27.0	89.4	89.2	6.3	6.3		6.1	6.2		7.9	6.1		6.2	31.0	31.1
		25.4		8.1		27.3		89.0		6.3		6.3		6.3	7.9	6.2		27.5		31.0					
		25.0		8.1		28.0		92.8		6.5		6.3		6.3	7.9	10.7		26.9		31.0					
		25.0		8.2		27.8		86.2		6.1		6.3		6.3	7.9	9.3		30.9		31.0					
11-Dec-15	Fine	Moderate	17:59	Surface	1	21.5	21.5	7.8	7.9	27.4	27.5	105.0	104.7	7.9	7.9	7.8	7.8	7.9	10.2	17.8	15.7	25.8			
						21.5		7.9		27.5		104.4		7.9			7.9	7.9		10.2	17.8			15.7	
				Middle	5	21.3	21.3	8.0	8.0	29.1	29.1	102.0	102.7	7.6	7.7		9.6	9.5		10.2	30.4		31.4	25.8	
		21.2		7.9		29.0		103.4		7.8		7.7		7.7	10.2	9.4		32.3		25.8					
		21.1		8.0		29.4		95.9		7.2		7.3		7.3	10.2	13.1		31.5		25.8					
		21.0		8.0		29.6		97.8		7.3		7.3		7.3	10.2	13.3		29.2		25.8					
14-Dec-15	Fine	Moderate	09:17	Surface	1	25.5	25.5	7.9	7.9	23.8	23.8	89.8	90.0	6.4	6.5	6.5	4.1	3.8	8.3	16.4	18.9	21.9			
						25.5		7.9		23.7		90.1		6.5			6.5	3.8		3.8	8.3		16.4		18.9
				Middle	4.5	22.0	22.0	7.8	7.8	30.9	31.0	86.5	87.4	6.3	6.4		6.6	6.4		8.3	29.0		27.2	21.9	
		21.9		7.8		31.1		88.3		6.5		6.4		6.4	8.3	6.1		25.4		21.9					
		21.5		7.8		31.9		85.2		6.3		6.3		6.3	8.3	14.6		17.0		21.9					
		21.5		7.8		31.9		85.6		6.3		6.3		6.3	8.3	14.8		22.1		21.9					
16-Dec-15	Sunny	Moderate	10:42	Surface	1	21.3	21.3	8.2	8.2	30.8	30.9	91.3	97.3	6.8	7.3	7.1	6.8	6.9	6.8	23.8	23.5	21.9			
						21.3		8.2		30.9		103.3		7.7			7.3	6.9		6.9	6.8		23.1	23.5	21.9
				Middle	4.5	21.3	21.3	8.2	8.2	30.9	30.9	86.3	92.8	6.4	6.9		6.8	6.8		6.8	6.8		6.8	21.1	22.3
		21.3		8.2		30.9		99.3		7.4		6.9		6.9	6.8	6.8		23.4		21.9					
		21.3		8.2		30.9		108.2		8.0		8.2		8.2	6.8	6.8		20.8		21.9					
		21.3		8.2		30.9		111.4		8.3		8.2		8.2	6.8	6.8		18.7		21.9					
18-Dec-15	Sunny	Moderate	12:06	Surface	1	22.1	22.1	7.8	7.8	29.0	28.9	94.6	94.6	7.0	7.0	6.8	6.1	6.0	9.0	11.2	11.9	18.3			
						22.1		7.8		28.8		94.6		7.0			7.0	6.0		6.0	9.0		11.2		11.9
				Middle	5	21.8	21.8	8.0	8.0	29.8	30.1	87.8	87.2	6.5	6.5		8.5	8.6		9.0	25.4		23.3	18.3	
		21.8		8.0		30.3		86.5		6.4		6.5		6.5	9.0	8.6		21.2		18.3					
		21.3		8.1		32.2		82.7		6.1		6.1		6.1	9.0	12.5		18.8		18.3					
		21.3		8.1		32.0		82.7		6.1		6.1		6.1	9.0	12.2		20.6		18.3					

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Dec-15	Fine	Moderate	15:45	Surface	1	23.1 23.0	23.1	8.2 8.2	8.2	25.9 25.6	25.8	105.3 108.6	107.0	7.8 8.0	7.9	8.0	9.9 11.4	10.7	12.0	11.4 14.3	12.9	15.4
				Middle	5	23.0 23.1	23.1	8.2 8.2	8.2	25.9 26.7	26.3	108.9 108.5	108.7	8.0 8.0	8.0		11.4 10.6	11.0		20.0 16.8	18.4	
				Bottom	9	23.0 23.0	23.0	8.2 8.2	8.2	26.9 27.4	27.2	110.7 106.4	108.6	8.1 7.8	8.0		14.2 14.1	14.2		16.5 13.5	15.0	
23-Dec-15	Fine	Moderate	16:32	Surface	1	19.3 20.3	19.8	7.5 7.6	7.6	29.1 29.1	29.1	82.7 84.6	83.7	6.4 6.4	6.4	6.4	5.8 5.3	5.6	5.3	20.5 22.9	21.7	23.5
				Middle	5	21.8 19.3	20.6	7.7 7.5	7.6	30.1 30.1	30.1	86.2 83.0	84.6	6.4 6.4	6.4		5.4 5.1	5.3		33.4 24.8	29.1	
				Bottom	9	19.6 19.7	19.7	7.5 7.5	7.5	30.4 30.5	30.5	80.0 79.7	79.9	6.1 6.1	6.1		4.9 5.0	5.0		22.7 16.8	19.8	
25-Dec-15	Cloudy	Moderate	18:02	Surface	1	23.1 24.1	23.6	8.1 8.1	8.1	27.8 29.3	28.6	102.3 98.4	100.4	7.5 7.0	7.3	7.2	4.9 4.0	4.5	6.3	11.1 9.1	10.1	10.2
				Middle	4.5	24.3 24.2	24.3	8.2 8.2	8.2	29.3 29.3	29.3	99.1 97.6	98.4	7.0 6.9	7.0		6.6 6.4	6.5		16.8 10.7	13.8	
				Bottom	8	24.1 24.1	24.1	8.2 8.2	8.2	29.3 29.2	29.3	97.8 96.2	97.0	7.0 6.8	6.9		7.9 7.9	7.9		5.9 7.2	6.6	
28-Dec-15	Fine	Moderate	10:10	Surface	1	21.4 21.4	21.4	7.8 7.7	7.8	29.8 29.9	29.9	95.3 101.9	98.6	7.1 7.6	7.4	7.4	6.0 6.2	6.1	6.5	15.3 15.3	15.3	13.0
				Middle	4.5	21.4 21.4	21.4	7.7 7.7	7.7	29.8 29.9	29.9	97.1 102.4	99.8	7.2 7.6	7.4		6.2 6.4	6.3		10.2 15.2	12.7	
				Bottom	8	21.4 21.4	21.4	7.7 7.7	7.7	29.9 29.9	29.9	94.5 97.8	96.2	7.0 7.3	7.2		6.9 7.2	7.1		11.4 10.8	11.1	
30-Dec-15	Cloudy	Moderate	10:10	Surface	1	21.5 21.3	21.4	7.8 7.8	7.8	26.2 26.2	26.2	92.0 90.4	91.2	7.0 6.9	7.0	6.4	2.5 2.5	2.5	8.9	11.2 14.0	12.6	12.1
				Middle	5	20.6 20.8	20.7	7.8 7.8	7.8	27.0 27.0	27.0	74.8 73.5	74.2	5.7 5.6	5.7		10.8 11.7	11.3		15.1 11.6	13.4	
				Bottom	9	20.9 20.8	20.9	7.8 7.8	7.8	27.5 27.5	27.5	70.5 67.9	69.2	5.4 5.2	5.3		12.9 12.6	12.8		11.5 8.9	10.2	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Dec-15	Fine	Moderate	17:50	Surface	1	25.4 25.4	25.4	7.8 7.8	7.8	24.6 24.6	24.6	112.1 111.5	111.8	8.0 8.0	8.0	8.0	6.1 6.6	6.4	9.6	13.1 13.1	13.1	14.9
				Middle	3.5	25.3 25.3	25.3	7.9 7.9	7.9	25.6 25.6	25.6	110.8 109.9	110.4	7.9 7.8	7.9		9.2 9.6	9.4		15.3 20.8	18.1	
				Bottom	6	25.3 25.3	25.3	7.9 8.0	8.0	25.8 25.8	25.8	109.9 109.5	109.7	7.8 7.8	7.8		12.8 13.4	13.1		15.3 11.4	13.4	
4-Dec-15	Fine	Moderate	20:31	Surface	1	26.0 26.0	26.0	7.9 7.9	7.9	27.7 27.3	27.5	101.1 100.5	100.8	7.0 7.0	7.0	7.0	6.4 6.3	6.4	10.0	16.1 19.0	17.6	15.4
				Middle	3.5	25.9 25.9	25.9	8.0 8.0	8.0	29.0 28.7	28.9	100.6 100.3	100.5	6.9 6.9	6.9		10.6 10.4	10.5		12.0 15.6	13.8	
				Bottom	6	25.8 25.8	25.8	8.0 8.1	8.1	30.0 30.0	30.0	97.0 97.7	97.4	6.7 6.7	6.7		13.0 13.2	13.1		14.6 15.1	14.9	
7-Dec-15	Sunny	Moderate	10:54	Surface	1	21.2 21.2	21.2	8.2 8.3	8.3	29.2 29.1	29.2	99.5 95.0	97.3	7.5 7.1	7.3	7.5	4.3 4.3	4.3	6.3	25.3 20.5	22.9	22.3
				Middle	3	21.2 21.2	21.2	8.2 8.2	8.2	29.1 29.1	29.1	99.5 101.9	100.7	7.5 7.6	7.6		6.6 6.5	6.6		16.1 18.9	17.5	
				Bottom	5	21.2 21.2	21.2	8.3 8.2	8.3	29.1 29.1	29.1	99.4 101.9	100.7	7.5 7.6	7.6		7.6 8.3	8.0		30.5 22.4	26.5	
9-Dec-15	Rainy	Moderate	11:29	Surface	1	23.7 24.6	24.2	8.2 8.2	8.2	24.7 26.5	25.6	83.9 89.2	86.6	6.2 6.4	6.3	6.3	9.8 9.7	9.8	9.8	35.8 37.0	36.4	35.7
				Middle	3.5	23.7 24.5	24.1	8.2 8.2	8.2	26.6 22.6	24.6	89.4 82.4	85.9	6.5 6.0	6.3		9.2 9.3	9.3		34.5 37.4	36.0	
				Bottom	6	23.6 24.5	24.1	8.2 8.2	8.2	26.1 22.9	24.5	71.9 72.0	72.0	5.3 5.3	5.3		10.4 10.2	10.3		36.8 32.6	34.7	
11-Dec-15	Sunny	Moderate	13:28	Surface	1	21.5 21.5	21.5	7.8 7.9	7.9	28.1 27.9	28.0	100.2 97.4	98.8	7.5 7.3	7.4	7.4	7.3 7.6	7.5	10.2	21.5 21.7	21.6	21.9
				Middle	3.5	21.3 21.3	21.3	8.2 8.2	8.2	28.1 28.2	28.2	95.0 97.5	96.3	7.2 7.3	7.3		9.7 9.6	9.7		23.3 25.3	24.3	
				Bottom	6	21.1 21.1	21.1	8.0 8.0	8.0	29.2 29.3	29.3	92.2 93.5	92.9	6.9 7.0	7.0		13.3 13.4	13.4		18.0 21.5	19.8	
14-Dec-15	Fine	Moderate	15:05	Surface	1	24.5 24.6	24.6	7.9 7.9	7.9	25.7 25.6	25.7	93.0 95.7	94.4	6.7 6.9	6.8	6.8	7.9 8.3	8.1	9.1	16.6 21.7	19.2	18.7
				Middle	3	23.2 23.2	23.2	7.9 7.9	7.9	29.0 29.0	29.0	91.5 94.1	92.8	6.6 6.8	6.7		6.0 5.9	6.0		18.9 17.7	18.3	
				Bottom	5	21.9 21.9	21.9	7.8 7.8	7.8	32.3 32.3	32.3	86.5 89.3	87.9	6.3 6.5	6.4		13.3 13.1	13.2		20.3 17.0	18.7	
16-Dec-15	Sunny	Moderate	16:23	Surface	1	22.3 22.2	22.3	8.3 8.2	8.3	30.3 30.5	30.4	95.6 106.9	101.3	7.0 7.8	7.4	7.4	7.4 7.6	7.5	7.5	28.1 29.1	28.6	26.3
				Middle	3	22.3 22.2	22.3	8.3 8.3	8.3	30.4 30.6	30.5	95.2 107.3	101.3	6.9 7.8	7.4		7.4 7.6	7.5		24.7 28.4	26.6	
				Bottom	5	22.2 22.2	22.2	8.3 8.3	8.3	30.5 30.6	30.6	96.2 106.0	101.1	7.0 7.7	7.4		7.5 7.7	7.6		20.8 26.6	23.7	
18-Dec-15	Fine	Moderate	18:26	Surface	1	22.2 22.2	22.2	8.1 8.1	8.1	28.7 28.9	28.8	96.6 94.6	95.6	7.1 7.0	7.1	6.7	5.8 5.5	5.7	9.1	16.7 21.4	19.1	17.0
				Middle	3.5	21.7 21.7	21.7	8.0 7.9	8.0	29.3 29.2	29.3	83.4 83.0	83.2	6.2 6.2	6.2		10.3 10.4	10.4		11.9 18.3	15.1	
				Bottom	6	21.3 21.4	21.4	8.1 8.1	8.1	30.9 30.9	30.9	81.1 81.4	81.3	6.0 6.0	6.0		11.2 10.9	11.1		16.4 17.3	16.9	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)						
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*				
21-Dec-15	Fine	Moderate	09:15	Surface	1	22.5	22.7	8.2	8.2	23.8	23.7	91.2	92.4	6.9	7.0	7.0	11.1	10.1	12.2	15.2	15.8	18.8				
						22.9		8.2		23.6		93.5		7.0			9.0			10.8			22.7		16.3	
				Middle	3	22.4	22.6	8.2	8.2	25.2	25.3	93.5	91.8	91.8	91.8		7.0	6.9		6.9	10.8		11.9	22.2	22.0	
		22.8		8.2		25.4		90.0		90.0		6.7	6.9	6.2	6.2	6.2	14.0	14.6	20.2	18.6						
		22.4	22.6	8.2	8.2	25.4	25.3	82.6	82.9	82.6	82.9	6.2	6.2	6.2	6.2	6.2	14.0	14.6	16.9	18.6						
		22.8		8.2		25.1		83.1		83.1		6.2	6.2	6.2	6.2	6.2	15.1	14.6	16.9	18.6						
23-Dec-15	Fine	Moderate	11:01	Surface	1	21.9	21.9	7.6	7.6	29.2	29.2	90.1	89.9	6.7	6.7	6.6	2.5	2.4	9.0	23.2	24.2	22.0				
						21.9		7.5		29.1		89.7		6.6			2.3			11.0			25.2			
				Middle	3.5	21.4	21.5	7.5	7.5	29.8	29.8	87.8	88.0	88.0	88.0		6.5	6.5		6.5	11.0		11.5	23.7	21.2	
		21.5		7.5		29.8		88.1		88.1		6.5	6.5	6.5	6.5	6.5	11.9	11.5	18.6	21.2						
		21.1	21.1	7.5	7.5	30.4	30.5	85.5	85.2	85.5	85.2	6.4	6.4	6.4	6.4	6.4	13.1	13.0	23.8	20.5						
		21.0		7.5		30.5		84.9		84.9		6.3	6.4	6.4	6.4	6.4	12.9	13.0	17.1	20.5						
25-Dec-15	Cloudy	Moderate	12:52	Surface	1	21.2	21.2	8.2	8.2	28.1	28.1	104.4	103.0	7.9	7.8	7.7	3.4	3.4	5.4	10.0	9.3	10.5				
						21.2		8.2		28.1		101.6		7.7			3.4			5.7			8.6			
				Middle	3	21.2	21.2	8.2	8.2	28.1	28.1	97.7	99.7	99.7	99.7		7.4	7.6		7.6	5.7		5.7	16.4	14.0	
		21.2		8.2		28.1		101.6		101.6		7.7	7.6	7.6	7.6	7.6	5.6	5.7	11.6	14.0						
		21.2	21.2	8.2	8.2	28.1	28.1	101.6	101.9	101.6	101.9	7.7	7.7	7.7	7.7	7.7	6.7	7.1	8.9	8.3						
		21.2		8.2		28.1		102.1		102.1		7.7	7.7	7.7	7.7	7.7	7.4	7.1	7.7	8.3						
28-Dec-15	Fine	Moderate	14:39	Surface	1	22.5	22.4	7.8	7.8	30.3	30.4	113.1	112.5	8.2	8.2	8.2	6.1	6.2	6.8	9.1	8.4	7.5				
						22.3		7.7		30.5		111.8		8.1			8.2			6.2			6.2			
				Middle	3	22.4	22.4	7.8	7.8	30.4	30.5	112.0	112.6	112.6	112.6		8.2	8.2		8.2	6.9		7.0	5.5	6.4	
		22.4		7.8		30.6		113.1		113.1		8.2	8.2	8.2	8.2	8.2	7.1	7.0	7.2	6.4						
		22.4	22.4	7.8	7.8	30.5	30.6	112.9	112.6	112.9	112.6	8.2	8.2	8.2	8.2	8.2	7.0	7.1	7.3	7.7						
		22.3		7.8		30.6		112.2		112.2		8.2	8.2	8.2	8.2	8.2	7.2	7.1	8.1	7.7						
30-Dec-15	Cloudy	Moderate	15:58	Surface	1	18.9	19.4	7.8	7.9	26.2	26.2	86.1	86.2	6.9	6.8	6.2	5.5	5.4	5.0	11.2	13.6	9.9				
						19.9		7.9		26.2		86.3		6.7			6.8			5.2			5.5			
				Middle	3	21.2	20.0	7.9	7.9	27.2	27.2	74.4	72.3	72.3	72.3		5.6	5.6		5.6	5.1		5.0	6.6	6.8	
		18.7		7.8		27.2		70.1		70.1		5.6	5.6	5.6	5.6	5.6	4.8	5.0	6.9	6.8						
		19.0	19.1	7.7	7.7	27.6	27.6	64.2	64.0	64.2	64.0	5.1	5.1	5.1	5.1	5.1	4.7	4.7	7.4	9.3						
		19.1		7.7		27.6		63.8		63.8		5.0	5.1	5.1	5.1	5.1	4.7	4.7	11.1	9.3						

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
2-Dec-15	Fine	Moderate	12:15	Surface	1	25.7	25.7	7.8	7.8	24.6	24.6	96.7	96.6	6.9	6.9	6.9	7.7	7.0	11.1	17.3	15.0	14.6			
						25.7		7.8		24.5		96.5		6.9			6.2								
				Middle	3	25.6	25.6	7.8	7.8	26.1	26.1	95.7	95.4	6.8	6.8		11.1	11.1		11.1	11.1		13.9	13.9	
		25.6		7.8		26.0		95.0		6.7		6.8		6.7		14.1	15.3		15.5	14.9					
		25.6	25.6	7.8	7.8	26.3	26.4	94.6	94.5	6.7	6.7	6.7	6.7	6.7	6.7	6.7	14.1	15.3		15.5	14.3	14.9			
4-Dec-15	Fine	Moderate	14:08	Surface	1	26.0	26.0	8.0	8.0	27.9	27.9	101.0	101.2	7.0	7.0	7.0	7.0	6.9	9.8	17.1	15.9	12.9			
						26.0		8.0		27.8		101.4		7.0			6.7								
				Middle	3.5	25.9	25.9	8.3	8.3	28.9	28.8	100.3	100.2	6.9	6.9		9.3	9.6		9.8	9.6		11.0	10.4	
		25.9		8.2		28.6		100.1		6.9		6.9		9.8		11.2	12.8		11.2	12.5					
		25.8	25.8	8.1	8.1	29.7	29.6	95.2	95.3	6.6	6.6	6.6	6.6	6.6	6.6	6.6	12.6	12.9		11.2	13.7	12.5			
		25.8		8.1		29.6		95.4		6.6		6.6		6.6		12.6	12.9		11.2	13.7	12.5				
7-Dec-15	Sunny	Moderate	15:56	Surface	1	24.1	24.2	8.2	8.2	28.2	28.2	110.1	108.7	7.9	7.8	7.7	5.5	5.7	6.5	21.5	19.8	21.5			
						24.2		8.2		28.1		107.2		7.7			5.9								
				Middle	3	24.2	24.2	8.3	8.3	28.2	28.2	103.1	105.2	7.4	7.6		6.0	6.3		6.6	6.3		6.6	6.3	16.3
		24.2		8.3		28.1		107.2		7.7		7.6		6.6		6.6	6.3		22.9	19.6					
		24.2	23.8	8.3	8.3	28.1	27.2	107.2	106.2	7.7	7.7	7.7	7.7	7.7	7.7	7.7	7.3	7.5		23.0	25.0				
		23.4		8.2		26.2		105.2		7.7		7.7		7.7		7.6	7.5		27.0	25.0					
9-Dec-15	Rainy	Moderate	17:08	Surface	1	25.4	25.3	8.1	8.1	27.4	27.2	83.2	86.1	5.9	6.1	6.2	7.5	7.6	7.9	34.1	36.1	33.4			
						25.2		8.1		27.0		89.0		6.3	6.1		7.6	7.6							
				Middle	3	25.2	25.3	8.2	8.2	26.7	27.0	89.4	89.2	6.3	6.3		6.2	6.3		6.3	6.3		6.3	6.3	36.3
		25.4		8.1		27.3		89.0		6.3		6.3		6.3		6.3	6.3		28.6	32.5					
		25.0	25.0	8.1	8.2	28.0	27.9	92.8	89.5	6.5	6.3	6.3	6.3	6.3	6.3	6.3	10.2	9.9		32.3	31.6				
		25.0		8.2		27.8		86.1		6.1		6.3		6.3		9.6	9.9		30.9	31.6					
11-Dec-15	Fine	Moderate	18:13	Surface	1	21.5	21.6	7.9	7.9	28.2	28.2	102.0	101.6	7.6	7.6	7.6	6.6	6.6	10.1	22.7	25.7	20.8			
						21.6		7.9		28.1		101.1		7.6			6.5								
				Middle	3.5	21.3	21.3	8.0	8.0	28.6	28.6	98.9	99.4	7.4	7.5		10.1	10.2		10.2	10.2		10.2	19.1	19.4
		21.3		8.0		28.6		99.9		7.5		7.5		10.2		10.2	10.2		19.7	19.4					
		21.2	21.2	8.1	8.1	30.0	30.1	97.4	97.8	7.3	7.3	7.3	7.3	7.3	7.3	13.6	13.4		16.5	17.3					
		21.1		8.1		30.1		98.1		7.3		7.3		7.3		13.2	13.4		18.1	17.3					
14-Dec-15	Fine	Moderate	09:28	Surface	1	24.9	24.9	7.9	7.9	25.0	25.0	93.8	93.9	6.7	6.8	6.7	8.9	8.5	11.7	20.9	23.8	18.9			
						24.9		7.9		25.0		94.0		6.8	6.8		8.1	8.5							
				Middle	3	24.1	24.0	7.9	7.9	27.7	27.9	90.3	90.1	6.5	6.5		12.8	13.0		13.0	13.0		12.7	12.9	
		23.9		7.9		28.0		89.8		6.5		6.5		13.1		13.0	13.0		13.0	12.9					
		22.4	22.4	7.8	7.8	32.9	33.0	88.5	90.0	6.4	6.5	6.5	6.5	6.5	6.5	13.9	13.6		17.1	20.0					
		22.3		7.8		33.0		91.4		6.6		6.5		13.3		13.6	13.6		22.9	20.0					
16-Dec-15	Sunny	Moderate	10:53	Surface	1	20.6	20.6	8.2	8.2	32.2	32.3	110.6	110.1	8.2	8.2	8.2	7.4	7.4	7.4	32.4	28.5	24.8			
						20.6		8.2		32.3		109.5		8.1	8.2		7.4	7.4							
				Middle	3	20.6	20.6	8.2	8.2	32.3	32.3	109.7	110.2	8.2	8.2		7.4	7.4		7.4	7.4		7.4	7.4	18.8
		20.6		8.2		32.3		110.6		8.2		8.2		7.3		7.4	7.4		20.4	19.6					
		20.6	20.6	8.2	8.2	32.3	32.3	110.6	110.3	8.2	8.2	8.2	8.2	8.2	8.2	7.7	7.5		24.7	26.2					
		20.6		8.2		32.3		109.9		8.2		8.2		7.2		7.5	7.5		27.6	26.2					
18-Dec-15	Sunny	Moderate	12:19	Surface	1	22.0	22.0	8.0	8.1	28.5	28.6	92.4	92.1	6.8	6.8	6.7	6.7	6.8	9.4	25.2	23.1	19.8			
						22.0		8.2		28.6		91.7		6.8	6.8		6.8	6.8							
				Middle	3.5	21.8	21.8	8.2	8.2	29.5	29.6	86.2	86.9	6.4	6.5		8.5	8.4		8.4	8.4		8.4	8.4	18.6
		21.8		8.2		29.6		87.5		6.5		6.5		8.3		8.4	8.4		17.3	18.0					
		21.5	21.5	8.3	8.3	30.6	30.6	84.3	83.8	6.2	6.2	6.2	6.2	6.2	6.2	13.0	12.9		16.6	18.3					
		21.4		8.3		30.5		83.2		6.2		6.2		12.8		12.9	12.9		20.0	18.3					

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Dec-15	Fine	Moderate	15:56	Surface	1	23.1 23.0	23.1	8.2 8.1	8.2	25.4 25.3	25.4	105.2 108.9	107.1	7.8 8.1	8.0	8.1	8.6 8.7	8.7	10.5	21.5 14.2	17.9	16.0
				Middle	3	23.0 23.1	23.1	8.2 8.2	8.2	25.6 26.4	26.0	108.8 108.3	108.6	8.1 8.0	8.1		9.9 9.0	9.5		14.8 12.7	13.8	
				Bottom	5	22.9 22.9	22.9	8.2 8.2	8.2	26.3 26.9	26.6	110.7 106.2	108.5	8.2 7.8	8.0		13.3 13.3	13.3		14.8 17.6	16.2	
23-Dec-15	Fine	Moderate	16:44	Surface	1	19.4 20.4	19.9	7.6 7.6	7.6	28.7 28.8	28.8	81.7 83.3	82.5	6.3 6.3	6.3	6.3	5.7 5.4	5.6	5.2	25.5 18.3	21.9	19.5
				Middle	3.5	21.7 19.2	20.5	7.6 7.6	7.6	29.4 29.4	29.4	84.8 81.1	83.0	6.3 6.3	6.3		5.3 5.0	5.2		13.7 15.9	14.8	
				Bottom	6	19.5 19.6	19.6	7.5 7.5	7.5	30.3 30.4	30.4	80.2 80.0	80.1	6.2 6.1	6.2		4.9 4.9	4.9		19.2 24.2	21.7	
25-Dec-15	Cloudy	Moderate	18:14	Surface	1	24.1 24.2	24.2	8.2 8.2	8.2	29.2 29.1	29.2	105.0 100.2	102.6	7.5 7.1	7.3	7.5	4.8 5.2	5.0	5.8	11.3 16.0	13.7	9.7
				Middle	3	24.2 24.2	24.2	8.2 8.2	8.2	29.2 29.1	29.2	105.0 107.5	106.3	7.5 7.6	7.6		5.3 5.9	5.6		5.6 7.6	6.6	
				Bottom	5	24.2 23.4	23.8	8.2 8.2	8.2	29.1 27.2	28.2	104.9 105.0	105.0	7.5 7.6	7.6		6.6 6.9	6.8		9.2 8.5	8.9	
28-Dec-15	Fine	Moderate	10:22	Surface	1	20.8 20.7	20.8	7.8 7.8	7.8	30.2 30.3	30.3	92.9 103.9	98.4	7.0 7.8	7.4	7.4	6.6 6.6	6.6	6.6	14.5 16.1	15.3	13.1
				Middle	3	20.8 20.7	20.8	7.8 7.8	7.8	30.2 30.3	30.3	92.5 104.3	98.4	6.9 7.8	7.4		6.6 6.5	6.6		11.1 15.0	13.1	
				Bottom	5	20.7 20.7	20.7	7.8 7.8	7.8	30.3 30.3	30.3	93.5 103.1	98.3	7.0 7.7	7.4		6.9 6.4	6.7		11.9 9.6	10.8	
30-Dec-15	Cloudy	Moderate	10:24	Surface	1	21.4 21.4	21.4	7.9 7.8	7.9	25.8 25.8	25.8	91.7 90.2	91.0	7.0 6.9	7.0	6.4	2.6 2.6	2.6	8.9	10.4 10.0	10.2	10.4
				Middle	3.5	20.9 21.0	21.0	7.8 7.8	7.8	26.8 26.9	26.9	75.0 73.6	74.3	5.7 5.6	5.7		10.8 11.7	11.3		9.3 12.3	10.8	
				Bottom	6	20.6 20.5	20.6	7.8 7.8	7.8	27.4 27.4	27.4	70.1 67.5	68.8	5.4 5.2	5.3		12.9 12.7	12.8		10.9 9.4	10.2	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
2-Dec-15	Fine	Moderate	17:27	Surface	1	26.1 26.0	26.1	7.9 7.9	7.9	25.3 25.2	25.3	104.2 104.9	104.6	7.3 7.4	7.4	7.4	6.2 6.4	6.3	8.7	22.4 15.2	18.8	18.9			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.1	23.4 23.5	23.5	8.0 8.0	8.0	24.5 24.1	24.3	99.2 101.7	100.5	7.3 7.5	7.4		7.4	10.9 11.2		11.1	17.6 20.3		19.0		
4-Dec-15	Fine	Moderate	19:48	Surface	1	25.9 26.0	26.0	8.0 7.9	8.0	27.5 27.5	27.5	103.0 101.5	102.3	7.2 7.1	7.2	7.2	7.9 7.8	7.9	9.2	19.1 14.7	16.9	31.5			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.3	25.9 25.9	25.9	8.1 8.1	8.1	28.3 28.3	28.3	99.7 99.6	99.7	7.0 6.9	7.0		7.0	10.3 10.7		10.5	42.0 50.2		46.1		
7-Dec-15	Sunny	Moderate	09:02	Surface	1	21.0 21.0	21.0	8.1 8.1	8.1	27.8 27.9	27.9	94.2 93.6	93.9	7.1 7.1	7.1	7.1	5.1 5.2	5.2	8.0	19.8 17.7	18.8	19.5			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.6	21.0 21.0	21.0	8.1 8.1	8.1	29.1 29.3	29.2	93.5 93.5	93.5	7.0 7.0	7.0		7.0	10.9 10.5		10.7	18.7 21.5		20.1		
9-Dec-15	Rainy	Moderate	10:56	Surface	1	23.7 24.6	24.2	8.2 8.2	8.2	24.7 26.4	25.6	87.9 93.4	90.7	6.5 6.7	6.6	6.6	9.6 9.7	9.7	9.5	12.4 14.6	13.5	16.4			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.5	23.7 24.6	24.2	8.2 8.2	8.2	26.5 22.5	24.5	93.5 86.5	90.0	6.8 6.3	6.6		6.6	9.1 9.2		9.2	22.4 16.1		19.3		
11-Dec-15	Sunny	Moderate	12:35	Surface	1	21.6 21.6	21.6	8.1 8.1	8.1	29.0 29.0	29.0	100.3 99.8	100.1	7.5 7.4	7.5	7.5	8.6 8.5	8.6	10.8	19.4 18.6	19.0	24.3			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.6	21.4 21.4	21.4	8.1 8.1	8.1	29.1 29.1	29.1	98.8 98.3	98.6	7.4 7.3	7.4		7.4	12.6 13.4		13.0	33.8 25.1		29.5		
14-Dec-15	Fine	Moderate	13:58	Surface	1	23.2 23.1	23.2	8.0 8.0	8.0	29.7 30.7	30.2	93.0 92.0	92.5	6.7 6.6	6.7	6.7	8.4 8.2	8.3	9.3	10.3 20.7	15.5	18.9			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	3.8	22.8 23.0	22.9	8.0 7.9	8.0	28.8 32.6	30.7	93.1 93.4	93.3	6.8 6.6	6.7		6.7	10.3 10.1		10.2	19.9 24.5		22.2		
16-Dec-15	Sunny	Moderate	15:41	Surface	1	21.2 22.4	21.8	8.0 8.1	8.1	32.4 29.5	31.0	100.4 101.8	101.1	7.4 7.5	7.5	7.5	8.5 8.2	8.4	9.3	28.4 27.3	27.9	25.9			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4	22.5 21.2	21.9	8.1 8.2	8.2	29.5 31.8	30.7	98.5 101.7	100.1	7.2 7.5	7.4		7.4	10.2 10.2		10.2	24.1 23.4		23.8		
18-Dec-15	Fine	Moderate	18:13	Surface	1	21.5 21.7	21.6	8.1 8.2	8.2	31.5 28.8	30.2	93.4 83.3	88.4	6.9 6.2	6.6	6.6	8.4 8.2	8.3	9.4	16.3 18.4	17.4	15.6			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4	21.9 22.0	22.0	8.1 8.2	8.2	29.6 31.2	30.4	88.2 84.1	86.2	6.5 6.1	6.3		6.3	10.3 10.5		10.4	12.9 14.7		13.8		

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
21-Dec-15	Fine	Moderate	08:37	Surface	1	22.4 22.5	22.5	8.2 8.2	8.2	23.7 23.4	23.6	89.8 93.5	91.7	7.6 7.9	7.8	7.8	8.6 8.1	8.4	8.4	15.1 13.1	14.1	17.0			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.5	22.5 22.5	22.5	8.2 8.2	8.2	25.1 25.4	25.3	94.6 93.1	93.9	8.0 7.9	8.0		8.0	8.0		8.2 8.4	8.3		8.2	18.5 21.0	19.8
23-Dec-15	Fine	Moderate	10:24	Surface	1	21.4 20.2	20.8	7.5 7.4	7.5	30.7 30.2	30.5	87.5 88.9	88.2	6.5 6.7	6.6	6.6	6.9 7.0	7.0	7.4	17.8 25.0	21.4	21.0			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4	21.3 20.2	20.8	7.5 7.4	7.5	30.8 29.7	30.3	88.9 89.8	89.4	6.6 6.8	6.7		6.7	6.7		7.6 7.8	7.7		7.6	18.5 22.4	20.5
25-Dec-15	Cloudy	Moderate	12:17	Surface	1	21.2 21.2	21.2	8.1 8.1	8.1	28.5 28.5	28.5	91.5 91.4	91.5	6.9 6.9	6.9	6.9	3.8 3.8	3.8	4.2	8.4 7.4	7.9	6.9			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	3.5	21.3 21.3	21.3	8.2 8.2	8.2	29.0 23.6	26.3	90.8 90.2	90.5	6.8 7.0	6.9		6.9	6.9		4.4 4.6	4.5		4.4	6.4 5.4	5.9
28-Dec-15	Fine	Moderate	14:27	Surface	1	21.8 21.8	21.8	7.8 7.8	7.8	29.9 29.9	29.9	97.2 96.6	96.9	7.2 7.1	7.2	7.2	7.8 7.4	7.6	8.4	8.5 8.0	8.3	8.4			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.4	21.9 21.8	21.9	7.9 7.9	7.9	30.6 30.9	30.8	93.2 93.7	93.5	6.8 6.9	6.9		6.9	6.9		9.3 9.0	9.2		9.3	9.3 7.7	8.5
30-Dec-15	Cloudy	Moderate	15:16	Surface	1	19.8 20.7	20.3	7.9 7.7	7.8	26.6 28.0	27.3	69.7 83.0	76.4	5.4 6.3	5.9	5.9	5.3 6.6	6.0	8.5	10.4 10.1	10.3	11.6			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.1	20.2 19.8	20.0	7.9 7.7	7.8	27.3 26.2	26.8	86.4 80.1	83.3	6.7 6.3	6.5		6.5	6.5		10.5 11.5	11.0		10.5	11.3 14.3	12.8

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
2-Dec-15	Fine	Moderate	11:42	Surface	1	25.5 25.6	25.6	7.8 7.8	7.8	25.4 25.3	25.4	99.8 101.0	100.4	7.1 7.2	7.2	7.2	6.1 6.1	6.1	8.6	12.4 10.2	11.3	13.7			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.1	25.4 25.4	25.4	7.9 7.9	7.9	24.5 24.1	24.3	95.3 94.5	94.9	6.8 6.8	6.8		6.8	10.5 11.5		11.0	18.2 14.0		16.1		
4-Dec-15	Fine	Moderate	13:38	Surface	1	25.9 25.9	25.9	7.9 7.9	7.9	28.0 28.0	28.0	103.0 104.0	103.5	7.2 7.3	7.3	7.3	4.1 4.2	4.2	6.0	10.5 12.8	11.7	12.6			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.2	25.9 25.8	25.9	8.0 8.0	8.0	28.7 28.7	28.7	99.7 99.2	99.5	7.0 7.0	7.0		7.0	7.8 7.6		7.7	11.6 15.4		13.5		
7-Dec-15	Sunny	Moderate	15:27	Surface	1	23.6 23.6	23.6	8.1 8.1	8.1	30.5 30.6	30.6	109.8 109.5	109.7	7.8 7.8	7.8	7.8	8.9 9.2	9.1	10.8	18.4 13.0	15.7	16.7			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.6	23.7 23.7	23.7	8.1 8.1	8.1	32.0 31.9	32.0	108.9 108.7	108.8	7.7 7.7	7.7		7.7	12.5 12.2		12.4	19.4 16.0		17.7		
9-Dec-15	Rainy	Moderate	16:45	Surface	1	25.4 25.2	25.3	8.1 8.1	8.1	27.3 27.0	27.2	78.6 84.4	81.5	5.5 6.0	5.8	5.8	7.6 7.7	7.7	7.0	14.6 11.7	13.2	16.7			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4	25.3 25.4	25.4	8.2 8.1	8.2	26.7 27.3	27.0	84.9 84.5	84.7	6.0 5.9	6.0		6.0	6.2 6.4		6.3	21.0 19.3		20.2		
11-Dec-15	Fine	Moderate	17:31	Surface	1	21.7 21.7	21.7	8.1 8.1	8.1	28.9 28.9	28.9	93.8 94.1	94.0	7.0 7.0	7.0	7.0	6.7 7.2	7.0	10.7	20.1 27.4	23.8	26.1			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.6	21.4 21.4	21.4	8.1 8.1	8.1	29.1 29.1	29.1	91.6 91.2	91.4	6.8 6.8	6.8		6.8	14.0 14.5		14.3	32.4 24.1		28.3		
14-Dec-15	Fine	Moderate	08:48	Surface	1	23.0 22.8	22.9	7.8 7.9	7.9	28.9 32.1	30.5	90.5 92.4	91.5	6.6 6.6	6.6	6.6	6.2 6.0	6.1	7.1	16.7 20.3	18.5	18.8			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	3.8	23.2 22.8	23.0	7.9 7.8	7.9	30.2 32.0	31.1	93.4 91.9	92.7	6.7 6.6	6.7		6.7	8.1 8.1		8.1	20.0 18.2		19.1		
16-Dec-15	Sunny	Moderate	10:04	Surface	1	22.5 22.9	22.7	8.0 8.1	8.1	32.1 29.5	30.8	98.7 93.0	95.9	7.1 6.7	6.9	6.9	6.3 6.0	6.2	7.2	27.6 25.8	26.7	28.8			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	3.7	21.1 22.7	21.9	8.1 8.1	8.1	32.1 31.5	31.8	99.3 104.6	102.0	7.3 7.5	7.4		7.4	8.1 8.1		8.1	34.0 27.6		30.8		
18-Dec-15	Sunny	Moderate	11:59	Surface	1	21.4 21.4	21.4	8.2 8.2	8.2	29.6 29.0	29.3	92.5 91.4	92.0	6.9 6.8	6.9	6.9	6.2 6.0	6.1	7.1	9.7 10.8	10.3	14.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4	21.4 21.5	21.5	8.2 8.1	8.2	32.6 30.4	31.5	91.0 87.7	89.4	6.7 6.5	6.6		6.6	8.1 8.1		8.1	19.4 16.6		18.0		

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
21-Dec-15	Fine	Moderate	15:03	Surface	1	23.1 23.1	23.1	8.1 8.1	8.1	26.5 26.3	26.4	81.1 82.8	82.0	6.9 7.0	7.0	7.0	10.2 11.4	10.8	10.2	12.2 9.8	11.0	12.3		
				Middle	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-
				Bottom	4.6	23.0 23.0	23.0	8.2 8.1	8.2	25.4 26.8	26.1	82.4 78.9	80.7	7.0 6.7	6.9	6.9	9.5 9.5	9.5		9.5	9.5		14.4 12.6	13.5
23-Dec-15	Fine	Moderate	16:01	Surface	1	20.2 20.9	20.6	7.5 7.6	7.6	29.5 29.8	29.7	80.8 84.4	82.6	6.2 6.3	6.3	6.3	8.6 9.3	9.0	10.0	20.2 20.1	20.2	20.0		
				Middle	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-
				Bottom	4.2	20.7 21.4	21.1	7.6 7.5	7.6	30.5 30.1	30.3	91.8 88.4	90.1	6.9 6.6	6.8	6.8	10.8 10.9	10.9		10.9	16.9 22.4		19.7	
25-Dec-15	Cloudy	Moderate	17:23	Surface	1	21.3 21.3	21.3	8.2 8.2	8.2	27.9 28.0	28.0	100.5 100.5	100.5	7.6 7.6	7.6	7.6	3.5 3.5	3.5	3.7	5.9 7.5	6.7	7.3		
				Middle	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-
				Bottom	3.5	21.3 21.3	21.3	8.2 8.2	8.2	28.5 28.3	28.4	100.9 101.0	101.0	7.6 7.6	7.6	7.6	3.8 3.8	3.8		3.8	9.1 6.6		7.9	
28-Dec-15	Fine	Moderate	09:03	Surface	1	21.8 21.8	21.8	7.7 7.7	7.7	30.1 30.1	30.1	96.8 96.5	96.7	7.1 7.1	7.1	7.1	6.3 6.6	6.5	8.0	9.1 10.9	10.0	10.4		
				Middle	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-
				Bottom	4.5	21.8 21.8	21.8	7.7 7.8	7.8	30.9 31.0	31.0	94.3 93.8	94.1	6.9 6.9	6.9	6.9	9.4 9.6	9.5		9.5	11.3 10.3		10.8	
30-Dec-15	Cloudy	Moderate	09:48	Surface	1	19.9 20.0	20.0	7.8 7.6	7.7	25.9 27.5	26.7	85.4 75.4	80.4	6.7 5.8	6.3	6.3	7.1 6.2	6.7	9.1	10.6 11.6	11.1	11.4		
				Middle	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-
				Bottom	4.1	19.6 20.1	19.9	7.7 7.8	7.8	26.4 26.1	26.3	80.9 72.8	76.9	6.3 5.7	6.0	6.0	10.7 12.2	11.5		11.5	10.1 13.0		11.6	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS4 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Dec-15	Fine	Moderate	18:00	Surface	1	25.5	25.5	7.9	7.9	23.3	23.3	113.7	113.2	8.2	8.2	8.1	5.2	5.3	7.5	11.4	10.9	11.7
						25.5	25.5	7.9	7.9	23.3	23.3	112.6	112.6	8.1	8.1		5.3	5.3		10.3	10.3	
				Middle	3.5	25.4	25.4	7.9	7.9	23.8	23.8	111.7	111.6	8.0	8.0		6.2	6.3		6.3	6.3	
				25.4	25.4	7.9	7.9	23.8	23.8	111.4	111.6	8.0	8.0	8.0	8.0	7.9	7.9	10.8	10.8	12.6	12.9	
				25.4	25.4	7.9	7.9	24.6	24.6	110.8	110.6	7.9	7.9	7.9	7.9	7.9	7.9	10.8	10.8	13.2	13.2	
4-Dec-15	Fine	Moderate	20:42	Surface	1	25.9	26.0	7.8	7.8	27.0	27.2	102.8	103.4	7.2	7.2	7.2	8.0	8.1	10.5	14.6	14.1	13.9
						26.0	26.0	7.8	7.8	27.3	27.3	103.9	103.9	7.2	7.2		8.2	8.1		13.5	13.5	
				Middle	3	25.8	25.8	8.0	8.0	28.3	28.4	102.0	102.1	7.1	7.1		9.6	9.7		9.7	9.7	
				25.8	25.8	8.0	8.0	28.5	28.4	102.1	102.1	7.1	7.1	7.1	7.1	9.8	9.7	15.4	15.4			
				25.8	25.8	8.1	8.1	29.5	29.6	102.2	102.0	7.1	7.1	7.1	7.1	13.8	13.7	13.0	13.1			
				25.8	25.8	8.1	8.1	29.7	29.6	101.7	102.0	7.0	7.1	7.1	7.1	13.6	13.7	13.2	13.2			
7-Dec-15	Sunny	Moderate	11:06	Surface	1	21.2	21.3	8.3	8.3	29.1	28.8	101.7	101.4	7.6	7.6	7.7	5.7	5.7	7.2	12.3	13.5	15.2
						21.3	21.3	8.2	8.2	28.5	28.8	101.0	101.4	7.6	7.6		5.7	5.7		14.6	14.6	
				Middle	3	21.2	21.3	8.2	8.2	29.0	28.7	101.4	102.1	7.6	7.7		7.4	7.3		7.1	7.3	
				21.4	21.3	8.2	8.2	28.3	28.7	102.8	102.8	7.7	7.7	7.7	7.7	7.1	7.3	12.5	12.5			
				21.3	21.5	8.2	8.2	28.6	28.2	101.3	102.0	7.6	7.7	7.7	7.7	8.4	8.6	20.6	20.6			
				21.7	21.5	8.2	8.2	27.8	28.2	102.7	102.7	7.7	7.7	7.7	7.7	8.8	8.6	19.3	19.3			
9-Dec-15	Rainy	Moderate	11:42	Surface	1	23.7	24.2	8.2	8.2	24.7	25.6	83.9	86.6	6.2	6.3	6.3	9.4	9.5	9.6	31.5	31.6	29.3
						24.6	24.2	8.2	8.2	26.4	25.6	89.2	86.6	6.4	6.3		9.6	9.5		31.7	31.7	
				Middle	3.5	23.7	24.2	8.2	8.2	26.5	24.5	89.4	85.9	6.5	6.3		8.9	9.1		9.1	9.1	
				24.6	24.2	8.2	8.2	22.5	24.5	82.4	85.9	6.0	6.3	9.2	9.1	9.2	9.1	26.6	26.6			
				23.6	24.1	8.2	8.2	26.1	24.5	71.8	71.9	5.3	5.3	5.3	5.3	10.1	10.3	31.8	32.4			
				24.5	24.1	8.2	8.2	22.9	24.5	72.0	71.9	5.3	5.3	5.3	5.3	10.4	10.3	32.9	32.9			
11-Dec-15	Sunny	Moderate	13:39	Surface	1	21.5	21.6	7.9	8.0	27.5	27.3	101.6	101.6	7.6	7.7	7.5	7.0	7.1	11.0	19.9	19.8	18.4
						21.6	21.6	8.0	8.0	27.0	27.3	101.6	101.6	7.7	7.7		7.1	7.1		19.6	19.6	
				Middle	3	21.3	21.3	8.1	8.1	28.2	28.2	95.6	96.2	7.2	7.3		11.5	11.7		11.7	11.7	
				21.3	21.3	8.1	8.1	28.1	28.2	96.8	96.2	7.3	7.3	11.8	11.7	11.7	11.7	14.6	14.6			
				21.1	21.1	8.1	8.2	29.6	29.6	94.5	93.7	7.1	7.1	14.3	14.3	14.3	14.3	20.3	22.0			
				21.1	21.1	8.2	8.2	29.5	29.6	92.9	92.9	7.0	7.1	7.0	7.1	14.3	14.3	23.6	23.6			
14-Dec-15	Fine	Moderate	15:16	Surface	1	24.5	24.4	7.9	7.9	26.4	26.6	92.4	92.5	6.6	6.7	6.6	6.9	7.0	10.3	16.2	14.5	15.9
						24.3	24.4	7.9	7.9	26.7	26.6	92.6	92.5	6.7	6.7		7.1	7.0		12.7	12.7	
				Middle	3	22.3	22.3	7.8	7.8	31.5	31.6	89.6	89.7	6.5	6.5		10.4	10.6		10.6	10.6	
				22.3	22.3	7.8	7.8	31.6	31.6	89.8	89.7	6.5	6.5	10.8	10.6	10.6	10.6	18.2	18.2			
				21.9	21.9	7.8	7.9	32.5	32.5	87.6	87.6	6.4	6.4	13.5	13.3	13.3	13.3	18.5	17.0			
				21.9	21.9	7.9	7.9	32.5	32.5	87.5	87.6	6.3	6.4	13.0	13.3	13.3	13.3	15.5	15.5			
16-Dec-15	Sunny	Moderate	16:38	Surface	1	22.2	22.4	8.3	8.2	30.6	31.3	107.2	107.9	7.8	7.8	7.8	7.8	7.8	7.8	26.4	25.0	26.8
						22.5	22.4	8.1	8.2	31.9	31.3	108.5	107.9	7.8	7.8		7.7	7.8		23.6	23.6	
				Middle	3	22.2	22.4	8.3	8.2	30.5	31.2	106.6	107.1	7.8	7.8		8.0	7.8		7.8	7.8	
				22.5	22.4	8.0	8.0	31.9	31.2	107.6	107.6	7.8	7.8	7.6	7.6	7.6	7.6	25.3	25.3			
				22.3	22.4	8.3	8.3	30.4	31.2	106.1	106.7	7.7	7.7	8.1	7.9	7.9	7.9	27.4	28.4			
				22.5	22.4	8.2	8.3	31.9	31.2	107.2	107.2	7.7	7.7	7.6	7.9	7.9	7.9	29.3	29.3			
18-Dec-15	Fine	Moderate	18:37	Surface	1	22.2	22.2	8.1	8.1	28.9	29.0	94.0	93.3	6.9	6.9	6.7	7.3	7.2	8.7	17.1	20.2	18.1
						22.2	22.2	8.0	8.1	29.0	29.0	92.5	93.3	6.8	6.8		7.1	7.2		23.2	23.2	
				Middle	3	21.8	21.9	8.2	8.2	30.3	30.3	87.2	86.9	6.4	6.4		7.9	8.1		8.1	8.1	
				21.9	21.9	8.1	8.1	30.2	30.3	86.5	86.5	6.4	6.4	8.2	8.1	8.1	8.1	16.3	16.3			
				21.5	21.6	8.4	8.4	30.9	30.9	85.6	85.8	6.3	6.3	10.6	10.7	10.7	10.7	17.4	19.2			
				21.6	21.6	8.4	8.4	30.8	30.9	86.0	86.0	6.3	6.3	10.7	10.7	10.7	10.7	21.0	21.0			

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS4 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Dec-15	Fine	Moderate	09:26	Surface	1	22.5 22.9	22.7	8.2 8.2	8.2	23.7 23.6	23.7	91.8 93.8	92.8	6.9 7.0	7.0	7.0	9.4 8.4	8.9	11.6	22.8 18.5	20.7	17.2
				Middle	3.5	22.4 22.8	22.6	8.2 8.2	8.2	25.2 25.5	25.4	93.1 90.0	91.6	7.0 6.7	6.9		10.0 11.7	10.9		12.8 12.3	12.6	
				Bottom	6	22.4 22.8	22.6	8.2 8.2	8.2	25.5 25.2	25.4	82.7 83.1	82.9	6.2 6.2	6.2		14.8 15.1	15.0		19.0 17.8	18.4	
23-Dec-15	Fine	Moderate	11:14	Surface	1	22.0 21.7	21.9	7.6 7.6	7.6	29.4 29.2	29.3	88.4 88.3	88.4	6.5 6.6	6.6	6.6	2.0 2.5	2.3	8.9	19.1 25.1	22.1	20.8
				Middle	3.5	21.6 21.3	21.5	7.5 7.5	7.5	29.7 29.7	29.7	87.4 87.4	87.4	6.5 6.5	6.5		10.8 11.9	11.4		17.0 17.7	17.4	
				Bottom	6	21.2 21.2	21.2	7.5 7.5	7.5	30.2 30.2	30.2	86.8 86.8	86.8	6.5 6.5	6.5		13.0 12.9	13.0		22.6 23.0	22.8	
25-Dec-15	Cloudy	Moderate	13:04	Surface	1	21.2 21.3	21.3	8.2 8.2	8.2	28.1 27.5	27.8	102.1 101.0	101.6	7.7 7.6	7.7	7.8	4.8 4.8	4.8	6.3	12.4 8.9	10.7	9.0
				Middle	3	21.2 21.4	21.3	8.2 8.2	8.2	28.0 27.3	27.7	105.1 100.3	102.7	7.9 7.6	7.8		6.5 6.2	6.4		8.7 12.5	10.6	
				Bottom	5	21.3 21.7	21.5	8.2 8.2	8.2	27.6 26.8	27.2	101.4 98.9	100.2	7.7 7.5	7.6		7.5 7.9	7.7		5.2 5.9	5.6	
28-Dec-15	Fine	Moderate	14:54	Surface	1	22.3 22.6	22.5	7.8 7.8	7.8	30.6 30.9	30.8	110.4 104.3	107.4	8.0 7.5	7.8	7.8	7.3 7.4	7.4	7.5	7.8 9.6	8.7	9.0
				Middle	3	22.3 22.6	22.5	7.8 7.8	7.8	30.5 30.9	30.7	110.4 101.7	106.1	8.0 7.4	7.7		7.5 7.1	7.3		9.8 9.3	9.6	
				Bottom	5	22.4 22.7	22.6	7.8 7.8	7.8	30.4 30.9	30.7	109.1 104.1	106.6	7.9 7.5	7.7		7.6 7.9	7.8		8.4 9.2	8.8	
30-Dec-15	Cloudy	Moderate	16:10	Surface	1	18.6 19.9	19.3	7.8 7.9	7.9	26.7 26.7	26.7	80.3 79.0	79.7	6.4 6.2	6.3	6.1	5.6 5.2	5.4	5.1	10.5 10.1	10.3	10.2
				Middle	3.5	21.3 18.7	20.0	7.9 7.8	7.9	27.3 27.3	27.3	80.0 68.4	74.2	6.1 5.4	5.8		5.2 5.0	5.1		13.3 12.2	12.8	
				Bottom	6	19.1 19.1	19.1	7.8 7.8	7.8	27.5 27.5	27.5	71.7 70.7	71.2	5.6 5.6	5.6		4.9 4.7	4.8		9.0 6.2	7.6	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS4 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
2-Dec-15	Fine	Moderate	12:26	Surface	1	25.7	25.7	7.8	7.8	24.5	24.5	97.8	97.5	7.0	7.0	6.9	4.9	5.0	10.2	11.8	11.8	13.8	
						25.7		7.8		24.5		97.1		6.9			5.0			11.4			12.0
				Middle	3.5	25.6	25.6	7.8	7.8	26.1	26.1	95.3	95.2	6.7	6.7		9.6	9.4		12.5	12.0		
		25.6		7.9	7.9	26.4	26.4	94.7	94.6	6.7	6.7	6.7	6.7	16.0	16.1	15.2	17.7						
		25.6		7.8		26.4		94.5		6.7		6.7	6.7	16.2	16.1	20.1	17.7						
4-Dec-15	Fine	Moderate	14:19	Surface	1	26.0	26.0	7.9	7.9	27.6	27.6	100.5	101.5	7.0	7.1	7.0	6.8	6.9	11.0	11.2	13.2	15.3	
						26.0		7.9		27.6		102.4		7.1			7.0			11.2			13.2
				Middle	3	25.8	25.8	8.1	8.1	28.9	28.9	98.9	98.6	6.8	6.8		11.8	11.8		16.8	20.6		
		25.8		8.1		28.8		98.3		6.8		6.8	11.7		14.2		12.1						
		25.8		8.1		29.9		94.3		6.5		6.6	14.5		14.2		9.9						
		25.8		8.2		29.8		95.2		6.6		6.6	14.3		14.4		14.4						
7-Dec-15	Sunny	Moderate	16:11	Surface	1	23.4	23.3	8.3	8.3	26.2	26.5	105.2	104.6	7.7	7.7	7.8	6.0	6.3	7.1	20.9	20.3	23.2	
						23.2		8.3		26.7		104.0		7.6			7.8			19.6			20.3
				Middle	3	23.4	23.3	8.2	8.3	26.2	26.5	108.3	105.8	7.9	7.8		6.7	6.6		20.6	20.1		
		23.2		8.3		26.7		103.3		7.6		7.8	6.5		19.6		20.1						
		23.4		8.3		26.2		104.5		7.7		7.6	8.7		27.4		29.2						
		23.2		8.3		26.7		101.6		7.5		7.6	8.3		31.0		29.2						
9-Dec-15	Rainy	Moderate	17:19	Surface	1	25.3	25.3	8.1	8.1	27.3	27.2	83.2	86.1	5.9	6.1	6.2	7.4	7.5	8.0	33.3	33.7	31.4	
						25.2		8.1		27.0		88.9		6.3			6.2			34.1			33.7
				Middle	3.5	25.3	25.3	8.2	8.2	26.7	27.0	89.4	89.2	6.3	6.3		6.3	6.4		32.7	32.3		
		25.3		8.1		27.3		89.0		6.3		6.3	6.4		31.9		32.3						
		25.0		8.1		28.0		92.8		6.5		6.3	10.2		27.2		28.2						
		25.0		8.2		27.8		86.1		6.1		6.3	9.7		29.1		28.2						
11-Dec-15	Fine	Moderate	18:26	Surface	1	21.5	21.6	7.8	7.9	28.0	28.1	106.7	106.4	8.0	8.0	7.8	8.4	8.0	10.9	26.8	33.3	24.1	
						21.6		7.9		28.1		106.1		7.9			7.8			39.7			33.3
				Middle	3	21.3	21.3	8.1	8.1	28.8	28.8	100.3	99.4	7.5	7.5		10.0	9.9		17.0	20.3		
		21.3		8.0		28.8		98.5		7.4		7.5	9.7		23.5		20.3						
		21.1		8.2		29.6		100.5		7.5		7.4	14.8		16.3		18.7						
		21.1		8.1		29.8		97.1		7.3		7.4	14.6		21.1		18.7						
14-Dec-15	Fine	Moderate	09:39	Surface	1	25.3	25.3	7.9	7.9	22.8	22.8	91.5	91.6	6.6	6.6	6.6	11.1	11.1	11.2	17.3	16.8	21.2	
						25.3		7.9		22.8		91.6		6.6			6.6			11.0			11.1
				Middle	3.5	25.2	25.2	7.9	7.9	23.0	23.0	92.0	91.3	6.7	6.6		11.2	11.5		16.4	19.6		
		25.2		7.9		22.9		90.5		6.5		6.6	11.7		22.7		19.6						
		25.1		7.9		23.1		89.4		6.5		6.4	11.2		25.0		27.1						
		25.1		7.9		23.2		87.3		6.3		6.4	10.8		29.1		27.1						
16-Dec-15	Sunny	Moderate	11:04	Surface	1	20.6	21.6	8.2	8.2	30.1	29.6	106.7	104.9	8.0	7.8	7.8	7.3	7.2	7.2	27.8	24.3	27.9	
						22.6		8.2		29.0		103.1		7.5			7.8			20.8			24.3
				Middle	3	20.6	21.6	8.2	8.2	30.0	29.5	106.7	103.6	8.0	7.7		7.3	7.2		28.0	30.7		
		22.6		8.1		29.0		100.5		7.4		7.7	7.1		33.3		30.7						
		22.6		8.1		29.0		108.6		7.9		7.7	7.1		32.0		28.7						
		22.6		8.2		29.1		102.8		7.5		7.7	7.1		25.4		28.7						
18-Dec-15	Sunny	Moderate	12:33	Surface	1	22.0	22.0	8.0	8.0	28.0	28.1	90.9	91.8	6.8	6.9	6.6	7.9	8.0	9.7	23.1	19.6	17.4	
						22.0		8.0		28.1		92.6		6.9			6.6			16.1			19.6
				Middle	3	21.8	21.8	8.1	8.1	29.0	29.1	86.3	85.3	6.4	6.3		8.8	8.9		17.2	17.4		
		21.8		8.0		29.2		84.2		6.2		6.3	8.9		17.6		17.4						
		21.6		8.1		31.1		83.3		6.1		6.1	12.4		13.4		15.1						
		21.7		8.1		30.9		82.5		6.1		6.1	12.2		16.7		15.1						

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS4 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
21-Dec-15	Fine	Moderate	16:05	Surface	1	23.1	23.1	8.2	8.2	24.8	24.7	106.0	107.7	7.9	8.0	8.1	7.9	8.0	9.4	11.4	12.2	12.3		
						23.1		8.2		24.6		109.3		8.1			8.0			8.0			11.2	12.3
				Middle	3.5	23.1	23.1	8.2	8.2	24.7	25.1	109.1	109.1	8.1	8.1		8.1	8.0		8.0	8.0		11.2	12.3
				23.1		8.2		25.5		109.0		8.1		8.1		7.4			11.6	12.5				
				Bottom	6	22.9	22.9	8.2	8.2	25.7	26.0	111.0	108.8	8.2	8.1	8.1	12.2	12.1		11.6	12.5			
						22.9		8.2		26.3		106.5		7.9		8.1	12.0	12.1		13.4	12.5			
23-Dec-15	Fine	Moderate	16:56	Surface	1	19.1	19.8	7.5	7.6	28.3	28.3	84.7	85.4	6.6	6.6	6.6	5.8	5.6	5.3	19.9	20.6	22.4		
						20.4		7.6		28.2		86.0		6.6			5.6			21.3	20.6			
				Middle	3.5	21.8	20.5	7.6	7.6	29.1	29.1	88.0	85.5	6.5	6.5		6.5	5.4		5.3			19.9	21.1
				19.2		7.6		29.1		83.0		6.5		6.5		5.2			22.3	21.1				
				Bottom	6	19.6	19.6	7.5	7.5	29.9	29.9	84.4	83.8	6.5	6.5	6.5	5.1	5.0		23.8	25.6			
						19.6		7.5		29.9		83.2		6.4		6.5	4.9	5.0		27.3	25.6			
25-Dec-15	Cloudy	Moderate	18:29	Surface	1	23.4	23.3	8.2	8.2	27.3	27.5	104.7	104.4	7.6	7.6	7.7	5.3	5.6	6.4	7.7	7.6	8.8		
						23.2		8.2		27.7		104.1		7.6			5.6			7.4	7.6			
				Middle	3	23.4	23.3	8.2	8.2	27.3	27.5	104.4	105.1	7.6	7.7		7.7	6.0		5.9			6.4	7.1
				23.2		8.2		27.7		105.8		7.7		7.7		5.8			7.7	7.1				
				Bottom	5	23.4	23.3	8.2	8.2	27.3	27.5	104.5	105.0	7.6	7.7	7.7	8.0	7.8		11.1	11.7			
						23.2		8.2		27.5		105.5		7.7		7.7	7.6	7.8		12.2	11.7			
						23.2		8.2		27.5		105.5		7.7		7.7	7.6	7.8		12.2	11.7			
28-Dec-15	Fine	Moderate	10:33	Surface	1	20.7	21.7	7.8	7.8	29.0	28.5	103.5	105.1	7.8	7.8	7.8	6.5	6.4	6.7	13.4	12.6	10.9		
						22.7		7.7		28.0		106.6		7.8			6.4			11.7	12.6			
				Middle	3	20.7	21.7	7.8	7.8	29.0	28.5	102.8	104.2	7.8	7.8		7.8	6.5		6.7			9.0	7.9
				22.7		7.7		28.0		105.6		7.8		7.8		6.8			6.7	7.9				
				Bottom	5	22.7	22.7	7.7	7.7	28.0	28.0	105.5	105.3	7.7	7.7	7.7	7.2	7.1		12.6	12.3			
						22.7		7.7		28.0		105.0		7.7		7.7	6.9	7.1		11.9	12.3			
						22.7		7.7		28.0		105.0		7.7		7.7	6.9	7.1		11.9	12.3			
30-Dec-15	Cloudy	Moderate	10:37	Surface	1	21.5	21.4	7.8	7.8	25.8	25.8	91.7	90.9	7.0	7.0	6.4	2.2	2.2	8.7	12.5	12.6	10.0		
						21.2		7.8		25.8		90.0		6.9			2.2			2.2			12.7	12.6
				Middle	3.5	21.1	21.0	7.8	7.8	26.6	26.6	75.2	74.3	5.7	5.7		5.7	10.6		11.2			9.2	7.8
				20.8		7.8		26.6		73.3		5.6		5.7		11.7			6.4	7.8				
				Bottom	6	20.7	20.7	7.8	7.8	27.0	27.1	70.1	68.9	5.4	5.3	5.3	12.8	12.8		11.1	9.7			
						20.7		7.8		27.1		67.6		5.2		5.3	12.7	12.8		8.2	9.7			
						20.7		7.8		27.1		67.6		5.2		5.3	12.7	12.8		8.2	9.7			

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
2-Dec-15	Fine	Moderate	18:08	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.1	25.5 25.4	25.5	7.7 7.7	7.7	24.0 24.2	24.1	105.9 105.2	105.6	7.6 7.5	7.6	7.6	7.6	5.2 4.7	5.0	5.0	21.5 16.3	18.9	18.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
4-Dec-15	Fine	Moderate	20:34	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1	25.9 25.9	25.9	7.9 7.9	7.9	28.1 28.1	28.1	99.8 99.5	99.7	6.9 6.9	6.9	6.9	6.9	8.1 7.9	8.0	8.0	18.9 25.7	22.3	22.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
7-Dec-15	Sunny	Moderate	09:44	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	0.9	21.1 21.1	21.1	8.1 8.1	8.1	26.6 26.6	26.6	90.3 90.2	90.3	6.9 6.9	6.9	6.9	6.9	4.8 5.0	4.9	4.9	16.6 22.0	19.3	19.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
9-Dec-15	Rainy	Moderate	11:23	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.4	24.6 24.6	24.6	8.1 8.2	8.2	22.7 24.4	23.6	94.1 90.2	92.2	6.9 6.5	6.7	6.7	7.4 8.3	7.9	7.9	21.0 17.7	19.4	19.4	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
11-Dec-15	Sunny	Moderate	13:19	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1	21.6 21.6	21.6	8.1 8.1	8.1	29.0 29.0	29.0	98.4 99.2	98.8	7.3 7.4	7.4	7.4	8.3 8.4	8.4	8.4	28.3 23.8	26.1	26.1	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
14-Dec-15	Fine	Moderate	14:44	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	0.9	22.8 23.0	22.9	7.8 7.9	7.9	31.0 29.4	30.2	93.3 93.6	93.5	6.7 6.8	6.8	6.8	11.7 10.5	11.1	11.1	20.1 17.0	18.6	18.6	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
16-Dec-15	Sunny	Moderate	16:09	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1	21.3 22.4	21.9	8.1 8.2	8.2	28.9 32.1	30.5	97.6 102.5	100.1	7.3 7.4	7.4	7.4	11.7 10.6	11.2	11.2	25.6 19.0	22.3	22.3	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
18-Dec-15	Fine	Moderate	19:00	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.1	21.9 21.8	21.9	8.3 8.2	8.3	31.9 29.2	30.6	84.3 83.2	83.8	6.1 6.2	6.2	6.2	11.7 10.5	11.1	11.1	20.5 23.7	22.1	22.1	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
21-Dec-15	Fine	Moderate	09:15	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.1	22.6 22.6	22.6	8.2 8.2	8.2	24.3 22.1	23.2	91.7 91.0	91.4	7.8 7.7	7.8	7.8	8.8 9.5	9.2	9.2	9.2	17.6 19.4	18.5	18.5
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
23-Dec-15	Fine	Moderate	11:01	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1	21.6 20.3	21.0	7.5 7.5	7.5	30.6 29.7	30.2	83.8 82.6	83.2	6.2 6.3	6.3	6.3	9.6 7.9	8.8	8.8	8.8	16.3 20.0	18.2	18.2
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
25-Dec-15	Cloudy	Moderate	12:43	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1	21.2 21.2	21.2	8.2 8.2	8.2	29.6 29.5	29.6	86.6 86.4	86.5	6.5 6.5	6.5	6.5	5.2 5.5	5.4	5.4	5.4	9.3 10.2	9.8	9.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
28-Dec-15	Fine	Moderate	15:13	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	0.9	22.0 22.0	22.0	7.8 7.7	7.8	29.2 29.4	29.3	96.9 97.6	97.3	7.2 7.2	7.2	7.2	4.8 4.7	4.8	4.8	4.8	7.8 8.6	8.2	8.2
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
30-Dec-15	Cloudy	Moderate	15:56	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1	20.8 19.6	20.2	7.9 7.6	7.8	26.3 25.7	26.0	77.1 67.7	72.4	5.9 5.3	5.6	5.6	5.5 5.5	5.5	5.5	5.5	10.5 10.6	10.6	10.6
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
2-Dec-15	Fine	Moderate	12:22	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.1	25.4 25.3	25.4	7.7 7.7	7.7	24.0 24.2	24.1	99.2 98.7	99.0	7.1 7.1	7.1	7.1	7.1	5.2 4.9	5.1	5.1	19.3 19.4	19.4	19.4
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
4-Dec-15	Fine	Moderate	14:18	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	0.9	25.8 25.8	25.8	7.9 7.9	7.9	28.5 28.4	28.5	98.6 99.8	99.2	7.0 7.0	7.0	7.0	6.8 6.8	6.8	6.8	6.8	10.0 8.8	9.4	9.4
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
7-Dec-15	Sunny	Moderate	14:39	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	0.9	23.7 23.6	23.7	8.1 8.1	8.1	27.4 27.4	27.4	106.3 106.3	106.3	7.7 7.7	7.7	7.7	4.5 4.6	4.6	4.6	4.6	30.5 20.0	25.3	25.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
9-Dec-15	Rainy	Moderate	17:17	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1	25.3 25.2	25.3	8.1 8.2	8.2	26.3 27.1	26.7	80.9 83.8	82.4	5.7 5.9	5.8	5.8	8.3 8.4	8.4	8.4	8.4	12.3 12.7	12.5	12.5
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
11-Dec-15	Fine	Moderate	16:53	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.1	22.1 22.1	22.1	8.1 8.1	8.1	29.1 29.1	29.1	97.3 94.9	96.1	7.2 7.0	7.1	7.1	5.3 6.4	5.9	5.9	5.9	15.7 20.8	18.3	18.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
14-Dec-15	Fine	Moderate	09:28	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	0.9	22.8 22.8	22.8	7.9 7.9	7.9	29.5 28.8	29.2	92.9 90.7	91.8	6.8 6.6	6.7	6.7	9.6 8.1	8.9	8.9	8.9	23.1 31.5	27.3	27.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
16-Dec-15	Sunny	Moderate	10:45	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1	22.3 22.0	22.2	8.1 8.2	8.2	32.1 30.7	31.4	100.6 92.4	96.5	7.3 6.8	7.1	7.1	9.7 8.2	9.0	9.0	9.0	25.7 33.8	29.8	29.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
18-Dec-15	Sunny	Moderate	12:39	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1	21.9 21.2	21.6	8.1 8.2	8.2	29.6 32.5	31.1	91.9 91.0	91.5	6.8 6.7	6.8	6.8	9.6 8.1	8.9	8.9	8.9	17.4 14.2	15.8	15.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged
 **Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
21-Dec-15	Fine	Moderate	15:39	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	23.1 23.1	23.1	8.1 8.1	8.1	24.7 25.5	25.1	78.0 77.5	77.8	6.6 6.6	6.6	6.6	6.6	6.6	8.7 8.8	8.8	8.8	8.1 11.1	9.6	9.6
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
23-Dec-15	Fine	Moderate	16:37	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	20.6 21.1	20.9	7.4 7.7	7.6	31.0 29.6	30.3	89.0 85.0	87.0	6.7 6.4	6.6	6.6	6.6	12.8 10.8	11.8	11.8	10.6 11.5	11.1	11.1	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
25-Dec-15	Cloudy	Moderate	17:06	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	21.3 21.3	21.3	8.2 8.2	8.2	28.9 28.6	28.8	103.8 104.0	103.9	7.8 7.8	7.8	7.8	7.8	3.7 3.7	3.7	3.7	6.4 10.1	8.3	8.3	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
28-Dec-15	Fine	Moderate	09:44	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	22.0 22.0	22.0	8.0 8.0	8.0	29.0 29.1	29.1	99.2 99.9	99.6	7.3 7.4	7.4	7.4	7.4	5.2 5.4	5.3	5.3	10.6 12.1	11.4	11.4	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
30-Dec-15	Cloudy	Moderate	10:28	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.2	20.3 20.2	20.3	7.8 7.6	7.7	25.4 26.2	25.8	64.6 78.8	71.7	5.0 6.1	5.6	5.6	5.6	5.3 5.2	5.3	5.3	12.6 11.5	12.1	12.1	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
2-Dec-15	Fine	Moderate	17:21	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	25.3	25.3	7.7	7.7	24.3	24.3	99.0	98.9	7.1	7.1	7.1	7.1	6.4	6.5	6.5	17.2	19.6	19.6	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
4-Dec-15	Fine	Moderate	19:40	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.9	26.0	26.0	7.9	7.9	28.9	28.4	95.1	94.9	6.7	6.7	6.7	6.7	7.2	7.4	7.4	19.8	20.5	20.5	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
7-Dec-15	Sunny	Moderate	08:55	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.9	21.1	21.1	8.1	8.1	30.2	30.1	97.8	96.0	7.3	7.3	7.3	7.2	7.3	11.7	11.4	11.4	18.5	17.2	17.2
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
9-Dec-15	Rainy	Moderate	10:49	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	24.1	24.1	8.2	8.2	23.0	23.9	93.6	93.0	6.9	6.9	6.9	6.8	6.9	6.7	6.8	6.8	20.6	19.8	19.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
11-Dec-15	Sunny	Moderate	12:27	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	21.5	21.5	8.1	8.1	29.0	29.0	98.3	96.6	7.3	7.3	7.3	7.2	7.3	10.2	10.4	10.4	23.9	21.4	21.4
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
14-Dec-15	Fine	Moderate	13:51	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.9	22.8	22.8	7.9	8.0	29.9	30.4	90.7	91.9	6.6	6.7	6.7	6.7	9.4	9.4	9.4	20.4	18.5	18.5	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
16-Dec-15	Sunny	Moderate	15:33	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	22.0	22.2	8.1	8.2	32.5	31.8	94.1	98.1	6.8	7.0	7.0	7.1	7.0	9.3	9.3	9.3	24.2	21.8	21.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
18-Dec-15	Fine	Moderate	18:06	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	21.8	21.9	8.2	8.2	31.9	31.5	94.8	90.0	6.9	6.8	6.8	6.6	6.8	9.4	9.4	9.4	20.2	20.3	20.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
21-Dec-15	Fine	Moderate	08:29	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	0.7	22.6	22.6	8.1	8.2	24.3	23.2	95.3	93.3	8.1	8.0	8.0	8.7	8.9	8.9	15.1	14.9	14.9	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
23-Dec-15	Fine	Moderate	10:16	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.1	20.2	20.2	7.4	7.5	30.6	30.2	88.8	88.5	6.7	6.7	6.7	7.3	7.5	7.5	21.4	24.1	24.1	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
25-Dec-15	Cloudy	Moderate	12:12	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.2	21.2	21.2	8.1	8.1	27.6	27.6	96.8	96.2	7.3	7.3	7.3	11.0	11.1	11.1	8.4	7.7	7.7	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
28-Dec-15	Fine	Moderate	14:20	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1	21.9	21.9	7.8	7.8	29.4	29.4	98.2	98.0	7.3	7.3	7.3	6.9	6.9	6.9	9.5	9.1	9.1	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
30-Dec-15	Cloudy	Moderate	15:06	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.2	20.5	20.1	7.7	7.7	27.1	27.4	72.3	77.4	5.6	6.0	6.0	6.3	5.9	5.9	9.9	10.6	10.6	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
2-Dec-15	Fine	Moderate	11:32	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	25.4	25.4	7.7	7.8	24.3	24.3	97.1	97.0	6.9	6.9	6.9	6.9	6.9	8.6	8.6	8.6	15.9	15.6	15.6
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
4-Dec-15	Fine	Moderate	13:30	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	26.0	26.0	7.9	7.9	27.9	27.9	96.5	96.9	6.8	6.8	6.8	6.8	6.8	7.5	7.6	7.6	10.6	13.4	13.4
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
7-Dec-15	Sunny	Moderate	15:36	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	23.7	23.7	8.1	8.1	31.1	31.1	108.4	107.5	7.7	7.6	7.7	7.7	7.7	11.3	11.7	11.7	14.1	12.8	12.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
9-Dec-15	Rainy	Moderate	16:35	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.4	25.3	25.3	8.2	8.2	22.7	23.4	77.9	77.6	5.6	5.6	5.6	5.6	5.6	7.1	7.0	7.0	26.1	22.7	22.7
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
11-Dec-15	Fine	Moderate	17:42	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	21.7	21.7	8.1	8.1	28.8	28.8	96.7	96.4	7.2	7.2	7.2	7.2	7.2	15.2	15.3	15.3	19.6	20.3	20.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
14-Dec-15	Fine	Moderate	08:40	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.9	23.2	23.0	8.0	8.0	28.8	29.9	92.7	93.3	6.7	6.8	6.8	6.8	6.8	7.1	7.2	7.2	12.5	11.0	11.0
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
16-Dec-15	Sunny	Moderate	09:56	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	22.9	22.2	8.1	8.2	29.4	31.0	101.7	101.2	7.4	7.4	7.4	7.4	7.4	7.2	7.3	7.3	25.8	23.8	23.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
18-Dec-15	Sunny	Moderate	11:51	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	21.3	21.5	8.1	8.1	30.6	30.4	83.4	89.5	6.2	6.4	6.4	6.4	6.4	7.1	7.2	7.2	15.7	15.5	15.5
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
21-Dec-15	Fine	Moderate	14:57	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.7	23.1 23.0	23.1	8.2 8.1	8.2	23.6 24.8	24.2	78.0 77.5	77.8	6.6 6.6	6.6	6.6	6.6	6.6	9.1 9.2	9.2	9.2	16.8 15.7	16.3	16.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
23-Dec-15	Fine	Moderate	15:56	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.3	21.5 21.0	21.3	7.6 7.4	7.5	30.9 29.5	30.2	81.8 92.1	87.0	6.0 6.9	6.5	6.5	6.5	9.0 9.9	9.5	9.5	19.3 23.7	21.5	21.5	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
25-Dec-15	Cloudy	Moderate	17:29	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.4	21.3 21.3	21.3	8.2 8.2	8.2	27.8 27.8	27.8	102.5 102.5	102.5	7.7 7.7	7.7	7.7	7.7	6.2 6.3	6.3	6.3	6.2 7.7	7.0	7.0	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
28-Dec-15	Fine	Moderate	08:56	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	22.0 22.0	22.0	7.8 7.8	7.8	29.8 29.9	29.9	101.0 101.0	101.0	7.4 7.4	7.4	7.4	7.4	7.3 7.8	7.6	7.6	10.7 12.3	11.5	11.5	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
30-Dec-15	Cloudy	Moderate	09:38	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	20.2 20.8	20.5	7.6 7.9	7.8	26.4 25.4	25.9	69.1 69.9	69.5	5.4 5.4	5.4	5.4	5.4	8.1 7.7	7.9	7.9	12.2 15.8	14.0	14.0	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
2-Dec-15	Fine	Moderate	17:01	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	26.0 26.3	26.2	7.7 7.7	7.7	24.7 24.7	24.7	111.5 112.3	111.9	7.9 7.9	7.9	7.9	7.9	7.9	6.0 5.9	6.0	6.0	13.0 10.3	11.7	11.7
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
4-Dec-15	Fine	Moderate	19:15	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	26.0 25.9	26.0	7.9 8.0	8.0	26.9 26.9	26.9	99.0 100.1	99.6	7.0 7.0	7.0	7.0	7.0	5.0 5.2	5.1	5.1	5.1	12.7 10.6	11.7	11.7
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
7-Dec-15	Sunny	Moderate	08:40	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	21.1 21.1	21.1	8.1 8.1	8.1	28.0 28.1	28.1	101.0 100.7	100.9	7.6 7.6	7.6	7.6	7.6	5.3 5.4	5.4	5.4	5.4	19.6 14.3	17.0	17.0
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
9-Dec-15	Rainy	Moderate	10:14	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	24.4 24.4	24.4	8.1 8.1	8.1	24.6 24.6	24.6	84.7 83.9	84.3	6.2 6.1	6.2	6.2	6.2	6.3 6.8	6.6	6.6	6.6	11.9 14.8	13.4	13.4
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
11-Dec-15	Sunny	Moderate	12:11	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.8	21.7 21.7	21.7	8.0 8.0	8.0	29.2 29.2	29.2	94.3 93.7	94.0	7.0 7.0	7.0	7.0	7.0	7.7 7.7	7.7	7.7	7.7	18.0 21.0	19.5	19.5
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
14-Dec-15	Fine	Moderate	13:25	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.9	22.9 22.7	22.8	8.0 7.9	8.0	31.1 30.6	30.9	93.6 92.7	93.2	6.7 6.7	6.7	6.7	6.7	6.5 6.3	6.4	6.4	6.4	19.0 13.4	16.2	16.2
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
16-Dec-15	Sunny	Moderate	15:15	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	22.3 22.7	22.5	8.2 8.1	8.2	28.7 32.4	30.6	91.3 101.2	96.3	6.7 7.2	7.0	7.0	7.0	6.6 6.4	6.5	6.5	6.5	21.6 27.1	24.4	24.4
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
18-Dec-15	Fine	Moderate	17:40	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	22.0 21.4	21.7	8.1 8.1	8.1	31.6 30.7	31.2	90.5 91.7	91.1	6.6 6.8	6.7	6.7	6.7	6.5 6.3	6.4	6.4	6.4	20.6 16.4	18.5	18.5
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
21-Dec-15	Fine	Moderate	08:09	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1	22.6	22.6	8.2	8.2	24.4	23.2	95.2	93.3	8.1	8.0	8.0	9.1	9.0	9.0	14.0	16.6	16.6	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
23-Dec-15	Fine	Moderate	09:56	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.1	20.2	20.4	7.5	7.6	29.5	29.6	83.2	87.1	6.3	6.6	6.6	4.2	4.2	4.2	18.0	19.2	19.2	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
25-Dec-15	Cloudy	Moderate	12:01	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1	21.1	21.1	8.0	8.0	28.8	28.8	105.9	105.5	8.0	8.0	8.0	7.2	7.2	7.2	8.6	8.3	8.3	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
28-Dec-15	Fine	Moderate	13:54	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1	21.9	21.9	7.8	7.8	28.5	28.5	98.9	99.1	7.3	7.4	7.4	5.9	5.9	5.9	10.7	9.9	9.9	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
30-Dec-15	Cloudy	Moderate	14:42	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.2	20.1	20.0	7.8	7.8	27.7	27.7	88.1	87.8	6.8	6.8	6.8	5.5	5.5	5.5	10.5	8.8	8.8	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
2-Dec-15	Fine	Moderate	11:08	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.1	25.6 25.9	25.8	7.8 7.7	7.8	24.6 24.7	24.7	98.8 99.4	99.1	7.0 7.0	7.0	7.0	7.0	5.5 5.9	5.7	5.7	11.1 11.9	11.5	11.5
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
4-Dec-15	Fine	Moderate	13:04	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	25.9 25.9	25.9	7.9 8.0	8.0	27.1 27.1	27.1	102.4 102.4	102.4	7.2 7.2	7.2	7.2	4.6 4.7	4.7	4.7	14.5 18.4	16.5	16.5	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
7-Dec-15	Sunny	Moderate	15:53	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	23.6 23.6	23.6	8.1 8.1	8.1	30.2 30.1	30.2	105.6 105.5	105.6	7.5 7.5	7.5	7.5	7.3 7.0	7.2	7.2	17.2 18.0	17.6	17.6	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
9-Dec-15	Rainy	Moderate	16:02	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	24.0 26.4	25.2	8.1 8.2	8.2	23.2 23.7	23.5	89.0 89.0	89.0	6.6 6.3	6.5	6.5	7.2 7.0	7.1	7.1	12.6 11.9	12.3	12.3	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
11-Dec-15	Fine	Moderate	17:56	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	22.1 22.1	22.1	8.1 8.1	8.1	29.1 29.1	29.1	95.5 95.1	95.3	7.0 7.0	7.0	7.0	6.9 6.9	6.9	6.9	14.8 16.5	15.7	15.7	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
14-Dec-15	Fine	Moderate	08:14	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.9	22.8 22.9	22.9	8.0 7.9	8.0	30.9 29.5	30.2	93.0 90.9	92.0	6.7 6.6	6.7	6.7	4.2 4.1	4.2	4.2	13.3 13.7	13.5	13.5	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
16-Dec-15	Sunny	Moderate	09:30	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	22.7 21.5	22.1	8.2 8.2	8.2	29.6 29.4	29.5	98.7 92.2	95.5	7.2 6.9	7.1	7.1	4.2 4.1	4.2	4.2	25.8 22.1	24.0	24.0	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
18-Dec-15	Sunny	Moderate	11:25	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	22.0 21.7	21.9	8.2 8.2	8.2	29.6 29.7	29.7	85.4 87.0	86.2	6.3 6.4	6.4	6.4	4.2 4.1	4.2	4.2	17.2 20.6	18.9	18.9	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
21-Dec-15	Fine	Moderate	14:40	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	23.0 23.1	23.1	8.1 8.1	8.1	24.7 25.5	25.1	77.9 77.5	77.7	6.6 6.6	6.6	6.6	6.6	6.6	8.8 8.7	8.8	8.8	15.1 22.2	18.7	18.7
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
23-Dec-15	Fine	Moderate	15:39	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.4	20.3 21.8	21.1	7.5 7.4	7.5	29.8 30.4	30.1	81.6 87.1	84.4	6.2 6.4	6.3	6.3	6.3	5.9 5.5	5.7	5.7	5.7	22.9 16.9	19.9	19.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
25-Dec-15	Cloudy	Moderate	17:40	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	21.4 21.4	21.4	8.1 8.1	8.1	28.3 28.3	28.3	91.3 90.9	91.1	6.9 6.8	6.9	6.9	6.9	7.7 7.5	7.6	7.6	7.6	10.9 9.0	10.0	10.0
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
28-Dec-15	Fine	Moderate	08:30	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	22.0 22.0	22.0	7.9 7.9	7.9	28.3 28.3	28.3	97.5 97.8	97.7	7.2 7.3	7.3	7.3	7.3	6.8 6.9	6.9	6.9	6.9	13.9 11.2	12.6	12.6
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
30-Dec-15	Cloudy	Moderate	09:14	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	20.8 19.7	20.3	7.9 7.8	7.9	26.5 25.5	26.0	88.4 84.9	86.7	6.8 6.7	6.8	6.8	6.8	5.2 5.6	5.4	5.4	5.4	9.0 9.7	9.4	9.4
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR6 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
2-Dec-15	Fine	Moderate	17:03	Surface	1	25.4 25.4	25.4	7.8 7.8	7.8	25.0 24.9	25.0	111.0 110.8	110.9	7.9 7.9	7.9	7.9	4.9 5.1	5.0	7.4	10.3 13.8	12.1	12.8			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	5	25.4 25.4	25.4	7.9 7.9	7.9	26.4 26.2	26.3	113.1 112.0	112.6	8.0 7.9	8.0		8.0	8.0		9.6 10.0	9.8		11.8 15.1	13.5	
4-Dec-15	Fine	Moderate	19:39	Surface	1	25.9 26.0	26.0	7.8 7.9	7.9	28.1 28.2	28.2	102.1 102.1	102.1	7.1 7.1	7.1	7.1	6.6 6.8	6.7	8.2	19.0 14.0	16.5	16.8			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.3	25.9 25.9	25.9	8.0 8.0	8.0	29.0 28.1	28.6	99.7 98.8	99.3	6.9 6.9	6.9		6.9	6.9		9.6 9.8	9.7		18.7 15.4	17.1	
7-Dec-15	Sunny	Moderate	10:02	Surface	1	21.1 21.1	21.1	8.1 8.1	8.1	28.2 28.2	28.2	101.8 101.8	101.8	7.7 7.7	7.7	7.7	6.4 6.4	6.4	7.5	14.6 14.5	14.6	15.3			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.1	21.1 21.1	21.1	8.1 8.1	8.1	28.2 28.2	28.2	101.7 102.0	101.9	7.7 7.7	7.7		7.7	7.7		8.5 8.4	8.5		15.3 16.5	15.9	
9-Dec-15	Rainy	Moderate	10:30	Surface	1	24.0 23.9	24.0	8.1 8.2	8.2	24.3 24.3	24.3	76.3 75.7	76.0	5.6 5.6	5.6	5.6	9.4 10.9	10.2	8.4	22.1 25.4	23.8	27.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.2	24.5 24.3	24.4	8.1 8.1	8.1	24.6 24.6	24.6	80.6 79.8	80.2	5.9 5.8	5.9		5.9	5.9		6.2 7.0	6.6		33.0 28.0	30.5	
11-Dec-15	Sunny	Moderate	12:32	Surface	1	21.5 21.6	21.6	8.0 8.0	8.0	28.1 28.1	28.1	102.3 103.2	102.8	7.7 7.7	7.7	7.7	6.6 6.5	6.6	8.6	18.3 20.4	19.4	24.3			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.5	21.3 21.3	21.3	7.9 7.9	7.9	29.0 29.0	29.0	99.4 99.2	99.3	7.4 7.4	7.4		7.4	7.4		10.6 10.3	10.5		29.0 29.4	29.2	
14-Dec-15	Fine	Moderate	14:11	Surface	1	25.0 25.0	25.0	7.9 7.9	7.9	24.6 24.6	24.6	92.2 92.2	92.2	6.6 6.6	6.6	6.6	4.1 4.2	4.2	4.9	16.7 18.8	17.8	17.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.2	23.3 23.2	23.3	7.9 7.9	7.9	28.8 29.0	28.9	91.6 91.8	91.7	6.6 6.6	6.6		6.6	6.6		5.5 5.5	5.5		16.3 16.6	16.5	
16-Dec-15	Sunny	Moderate	15:27	Surface	1	22.7 22.6	22.7	8.2 8.2	8.2	32.3 32.4	32.4	89.6 101.2	95.4	6.4 7.3	6.9	6.9	7.6 7.3	7.5	7.5	27.3 32.1	29.7	27.6			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4	22.6 22.6	22.6	8.2 8.2	8.2	32.3 32.4	32.4	93.2 109.3	101.3	6.7 7.8	7.3		7.3	7.3		7.5 7.2	7.4		25.7 25.1	25.4	
18-Dec-15	Fine	Moderate	17:38	Surface	1	21.9 21.9	21.9	8.0 8.0	8.0	29.4 29.0	29.2	89.6 90.4	90.0	6.6 6.7	6.7	6.7	6.1 5.8	6.0	7.1	17.9 22.1	20.0	17.5			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.1	21.7 21.7	21.7	8.2 8.2	8.2	30.3 30.3	30.3	84.9 85.3	85.1	6.3 6.3	6.3		6.3	6.3		8.2 8.0	8.1		16.0 14.0	15.0	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR6 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
21-Dec-15	Fine	Moderate	08:20	Surface	1	22.6 22.6	22.6	8.2 8.2	8.2	24.3 22.0	23.2	88.4 86.7	87.6	6.6 6.6	6.6	6.6	8.7 9.4	9.1	9.4	11.3 13.7	12.5	14.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.4	22.8 22.8	22.8	8.2 8.2	8.2	24.0 24.9	24.5	88.1 87.8	88.0	6.6 6.6	6.6		6.6	9.4 9.7		9.6	6.6		15.7 15.8	15.8	
23-Dec-15	Fine	Moderate	10:02	Surface	1	21.6 21.7	21.7	7.5 7.6	7.6	28.0 28.1	28.1	95.8 96.2	96.0	7.2 7.2	7.2	7.2	5.2 5.2	5.2	6.1	18.5 18.2	18.4	17.3			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.3	21.5 21.6	21.6	7.6 7.6	7.6	29.3 29.3	29.3	92.4 91.7	92.1	6.9 6.8	6.9		6.9	6.9 6.9		6.9	6.9		15.5 16.7	16.1	
25-Dec-15	Cloudy	Moderate	12:00	Surface	1	22.0 22.0	22.0	8.1 8.1	8.1	27.2 27.2	27.2	106.1 105.9	106.0	7.9 7.9	7.9	7.9	5.5 5.5	5.5	6.6	11.6 9.3	10.5	9.5			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.1	22.0 22.0	22.0	8.1 8.1	8.1	27.2 27.2	27.2	106.1 103.3	104.7	7.9 7.7	7.8		7.8	7.6 7.5		7.6	7.8		7.6 7.3	8.5	
28-Dec-15	Fine	Moderate	13:43	Surface	1	22.8 22.7	22.8	7.8 7.8	7.8	30.2 30.4	30.3	106.3 96.6	101.5	7.7 7.0	7.4	7.4	7.1 6.8	7.0	7.0	10.1 9.4	9.8	11.5			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4	22.8 22.7	22.8	7.8 7.8	7.8	30.3 30.4	30.4	93.7 110.7	102.2	6.8 8.0	7.4		7.4	7.0 6.7		6.9	7.4		13.2 12.9	13.1	
30-Dec-15	Cloudy	Moderate	15:07	Surface	1	21.2 21.1	21.2	8.1 8.1	8.1	26.7 26.7	26.7	93.5 91.6	92.6	7.1 7.0	7.1	7.1	4.2 4.4	4.3	4.5	13.3 7.9	10.6	10.6			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.4	21.2 21.4	21.3	7.9 7.9	7.9	27.1 27.2	27.2	95.7 93.7	94.7	7.3 7.1	7.2		7.2	4.5 4.6		4.6	7.2		10.0 11.1	10.6	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR6 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
2-Dec-15	Fine	Moderate	11:20	Surface	1	25.6 25.6	25.6	7.9 7.9	7.9	23.2 23.2	23.2	98.0 97.6	97.8	7.0 7.0	7.0	7.0	4.6 4.6	4.6	6.9	14.8 15.8	15.3	14.9			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.5	25.7 25.7	25.7	7.9 7.9	7.9	25.9 25.9	25.9	95.8 95.1	95.5	6.8 6.7	6.8		6.8	9.2 9.0		9.1	13.8 15.1		14.5		
4-Dec-15	Fine	Moderate	13:16	Surface	1	25.9 25.9	25.9	7.8 7.8	7.8	28.2 28.2	28.2	105.7 105.0	105.4	7.3 7.3	7.3	7.3	6.7 6.4	6.6	8.0	10.6 7.3	9.0	10.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.1	26.0 26.0	26.0	8.1 8.2	8.2	28.7 28.6	28.7	100.9 99.9	100.4	7.0 6.9	7.0		7.0	9.4 9.2		9.3	10.4 12.2		11.3		
7-Dec-15	Sunny	Moderate	15:00	Surface	1	23.1 23.1	23.1	8.1 8.3	8.2	28.5 28.5	28.5	109.1 108.8	109.0	7.9 7.9	7.9	7.9	5.2 5.3	5.3	5.7	13.6 16.4	15.0	14.1			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.1	23.1 23.1	23.1	8.3 8.3	8.3	28.5 28.5	28.5	109.1 106.2	107.7	7.9 7.7	7.8		7.8	6.0 5.9		6.0	12.5 13.7		13.1		
9-Dec-15	Rainy	Moderate	16:17	Surface	1	25.3 25.2	25.3	8.1 8.1	8.1	25.6 27.5	26.6	90.2 84.4	87.3	6.4 5.9	6.2	6.2	9.3 9.5	9.4	8.2	29.7 28.9	29.3	27.9			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.4	24.0 26.5	25.3	8.1 8.2	8.2	23.2 23.7	23.5	93.3 93.6	93.5	6.9 6.6	6.8		6.8	7.1 6.9		7.0	24.1 28.8		26.5		
11-Dec-15	Fine	Moderate	17:18	Surface	1	21.4 21.3	21.4	7.9 7.8	7.9	27.9 28.1	28.0	102.5 102.3	102.4	7.7 7.7	7.7	7.7	6.7 6.4	6.6	8.1	20.6 15.0	17.8	16.9			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.2	21.2 21.2	21.2	8.0 8.0	8.0	29.2 29.3	29.3	100.4 100.1	100.3	7.5 7.5	7.5		7.5	9.4 9.5		9.5	17.1 14.9		16.0		
14-Dec-15	Fine	Moderate	08:31	Surface	1	24.8 24.7	24.8	7.9 7.9	7.9	22.2 22.7	22.5	87.9 86.7	87.3	6.4 6.3	6.4	6.4	4.4 4.7	4.6	8.8	17.2 17.1	17.2	16.9			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.3	22.7 22.7	22.7	7.8 7.8	7.8	28.7 28.8	28.8	87.6 87.9	87.8	6.4 6.4	6.4		6.4	12.1 13.8		13.0	17.3 15.6		16.5		
16-Dec-15	Sunny	Moderate	10:01	Surface	1	21.3 20.4	20.9	8.2 8.2	8.2	30.3 31.8	31.1	103.5 93.4	98.5	7.7 7.0	7.4	7.4	8.6 8.4	8.5	9.0	20.7 25.3	23.0	24.7			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.1	21.3 20.4	20.9	8.2 8.2	8.2	30.4 31.5	31.0	91.3 106.9	99.1	6.8 8.0	7.4		7.4	9.3 9.6		9.5	25.7 27.1		26.4		
18-Dec-15	Sunny	Moderate	11:30	Surface	1	22.0 22.0	22.0	7.9 7.9	7.9	29.6 29.0	29.3	91.7 90.5	91.1	6.8 6.7	6.8	6.8	7.0 7.1	7.1	8.3	16.7 14.4	15.6	17.9			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4.6	21.7 21.7	21.7	8.1 8.1	8.1	30.7 30.2	30.5	89.2 86.4	87.8	6.6 6.4	6.5		6.5	9.5 9.4		9.5	19.4 20.7		20.1		

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR6 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Dec-15	Fine	Moderate	15:08	Surface	1	23.1	23.1	8.1	8.1	24.7	25.1	109.4	107.3	8.1	8.0	8.0	8.8	8.8	9.5	18.9	18.8	16.5
						23.1		8.1		25.5		105.2		7.8			8.8			18.7		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-	
				Bottom	4.3	22.5	23.1	8.1	8.2	25.4	25.1	113.7	113.0	8.5	8.4	8.4	10.0	10.1		16.4	14.1	
						23.6		8.2		24.8		112.3		8.3		8.4	10.1		11.8			
23-Dec-15	Fine	Moderate	15:53	Surface	1	21.7	21.7	7.8	7.8	27.3	27.4	90.2	90.3	6.8	6.8	6.8	4.4	4.5	4.7	19.1	17.5	17.9
						21.6		7.8		27.4		90.4		6.8			4.6			15.9		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-	
				Bottom	4.4	21.7	21.8	7.6	7.6	28.9	29.0	88.3	87.3	6.6	6.5	6.5	4.7	4.8		15.8	18.2	
						21.9		7.6		29.0		86.3		6.4		6.5	4.8		20.5			
25-Dec-15	Cloudy	Moderate	17:18	Surface	1	23.1	23.2	8.1	8.2	29.5	29.5	106.3	106.4	7.7	7.7	7.7	4.5	4.6	5.0	10.9	10.3	11.3
						23.2		8.2		29.5		106.5		7.7			4.6			9.6		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-	
				Bottom	4	23.1	23.1	8.2	8.2	29.5	29.5	106.1	106.3	7.7	7.7	7.7	5.3	5.3		11.4	12.3	
						23.1		8.1		29.5		106.4		7.7		7.7	5.2		13.1			
28-Dec-15	Fine	Moderate	09:30	Surface	1	21.4	21.0	7.7	7.8	29.3	30.1	86.1	91.4	6.4	6.9	6.9	6.7	6.8	6.8	10.2	10.7	10.9
						20.5		7.8		30.8		96.6		7.3			6.9			11.2		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-	
				Bottom	4.1	21.4	21.0	7.7	7.7	29.3	29.9	89.6	96.9	6.7	7.3	7.3	6.8	6.8		10.9	11.0	
						20.5		7.7		30.5		104.1		7.8		7.3	6.8		11.0			
30-Dec-15	Cloudy	Moderate	09:25	Surface	1	21.1	21.2	7.8	7.9	26.7	26.7	85.7	85.9	6.5	6.5	6.5	5.2	5.2	6.0	8.6	9.6	9.8
						21.2		7.9		26.7		86.0		6.5			5.2			10.6		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-	
				Bottom	4.2	21.0	21.1	7.9	7.9	27.3	27.3	80.5	80.0	6.1	6.1	6.1	6.7	6.7		9.4	10.0	
						21.1		7.9		27.2		79.4		6.0		6.1	6.7		10.5			

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SRA - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Dec-15	Fine	Moderate	17:09	Surface	1	26.1 26.0	26.1	7.8 7.8	7.8	24.4 24.5	24.5	108.6 104.6	106.6	7.7 7.4	7.6	7.7	5.2 4.9	5.1	7.1	14.5 15.7	15.1	15.5
				Middle	3	25.1 25.0	25.1	7.9 7.9	7.9	25.3 24.9	25.1	107.1 109.9	108.5	7.7 7.9	7.8		6.4 6.7	6.6		18.2 16.5	17.4	
				Bottom	5	23.7 23.8	23.8	7.9 7.9	7.9	25.4 25.3	25.4	98.5 97.3	97.9	7.2 7.1	7.2		9.8 9.4	9.6		15.7 12.5	14.1	
4-Dec-15	Fine	Moderate	19:24	Surface	1	25.9 25.9	25.9	7.7 7.9	7.8	27.1 27.2	27.2	99.3 98.6	99.0	7.0 6.9	7.0	6.9	6.1 5.9	6.0	8.4	18.4 15.5	17.0	20.5
				Middle	4	25.9 25.9	25.9	7.9 8.0	8.0	28.7 28.7	28.7	96.8 96.5	96.7	6.8 6.8	6.8		8.4 8.6	8.5		31.6 30.5	31.1	
				Bottom	7	25.8 25.8	25.8	7.8 8.1	8.0	29.6 29.7	29.7	96.8 97.1	97.0	6.7 6.8	6.8		10.9 10.4	10.7		13.7 13.1	13.4	
7-Dec-15	Sunny	Moderate	08:45	Surface	1	21.3 21.3	21.3	8.1 8.1	8.1	28.2 28.2	28.2	97.8 97.1	97.5	7.4 7.3	7.4	7.3	5.4 5.1	5.3	7.5	16.9 17.4	17.2	16.7
				Middle	3.5	21.1 21.1	21.1	8.1 8.1	8.1	29.3 29.3	29.3	96.0 95.6	95.8	7.2 7.2	7.2		5.5 5.3	5.4		16.6 16.7	16.7	
				Bottom	6	20.6 20.6	20.6	8.1 8.1	8.1	32.0 32.1	32.1	92.4 91.8	92.1	6.9 6.8	6.9		11.1 12.2	11.7		14.5 17.8	16.2	
9-Dec-15	Rainy	Moderate	10:21	Surface	1	24.0 23.6	23.8	8.1 8.2	8.2	23.4 22.1	22.8	92.6 89.7	91.2	6.8 6.7	6.8	6.4	8.4 7.7	8.1	9.3	19.3 19.8	19.6	16.3
				Middle	5	23.8 24.5	24.2	8.2 8.2	8.2	23.6 22.3	23.0	80.9 80.3	80.6	6.0 5.9	6.0		9.8 9.4	9.6		16.4 15.1	15.8	
				Bottom	9	23.6 24.5	24.1	8.2 8.2	8.2	26.1 22.9	24.5	76.0 76.1	76.1	5.6 5.6	5.6		10.1 10.3	10.2		13.1 13.9	13.5	
11-Dec-15	Sunny	Moderate	12:16	Surface	1	21.4 21.4	21.4	8.1 8.0	8.1	28.9 28.9	28.9	98.0 97.0	97.5	7.3 7.3	7.3	7.3	11.1 11.0	11.1	14.0	17.4 14.0	15.7	21.1
				Middle	4	21.4 21.4	21.4	8.1 8.1	8.1	28.9 28.9	28.9	95.7 95.4	95.6	7.2 7.1	7.2		14.9 14.8	14.9		30.7 22.6	26.7	
				Bottom	7	21.4 21.4	21.4	8.1 8.1	8.1	28.9 28.9	28.9	95.2 95.2	95.2	7.1 7.1	7.1		16.1 16.1	16.1		22.1 19.9	21.0	
14-Dec-15	Fine	Moderate	13:34	Surface	1	22.8 22.7	22.8	7.9 8.0	8.0	29.2 29.3	29.3	91.0 91.9	91.5	6.6 6.7	6.7	6.7	7.3 6.8	7.1	8.9	16.4 19.4	17.9	18.7
				Middle	3.5	23.0 22.9	23.0	8.0 7.8	7.9	29.8 30.1	30.0	93.3 92.2	92.8	6.7 6.7	6.7		8.3 8.8	8.6		20.3 20.2	20.3	
				Bottom	6	23.1 22.9	23.0	7.8 7.9	7.9	29.2 32.4	30.8	91.5 95.1	93.3	6.6 6.8	6.7		11.1 10.6	10.9		16.1 19.8	18.0	
16-Dec-15	Sunny	Moderate	15:24	Surface	1	21.1 21.0	21.1	8.2 8.1	8.2	30.7 31.1	30.9	95.2 98.8	97.0	7.1 7.3	7.2	7.2	7.3 6.8	7.1	8.8	23.8 21.6	22.7	22.8
				Middle	3.5	21.7 21.8	21.8	8.1 8.2	8.2	31.2 28.9	30.1	94.4 96.8	95.6	6.9 7.2	7.1		8.3 8.7	8.5		26.0 22.2	24.1	
				Bottom	6	22.8 22.1	22.5	8.2 8.2	8.2	30.9 29.8	30.4	94.2 95.5	94.9	6.8 7.0	6.9		11.0 10.7	10.9		20.6 22.7	21.7	
18-Dec-15	Fine	Moderate	17:49	Surface	1	22.0 21.8	21.9	8.2 8.1	8.2	31.3 29.2	30.3	86.1 87.4	86.8	6.3 6.5	6.4	6.6	7.3 6.8	7.1	8.9	18.8 26.1	22.5	20.1
				Middle	3.5	21.8 22.0	21.9	8.2 8.1	8.2	29.5 30.9	30.2	93.6 91.1	92.4	6.9 6.7	6.8		8.3 8.8	8.6		23.4 23.5	23.5	
				Bottom	6	21.4 21.9	21.7	8.1 8.1	8.1	31.1 31.3	31.2	87.2 86.6	86.9	6.4 6.3	6.4		11.1 10.6	10.9		11.5 17.1	14.3	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SRA - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
21-Dec-15	Fine	Moderate	08:17	Surface	1	22.6	22.6	8.1	8.2	24.3	24.0	91.2	92.4	7.7	7.8	8.0	8.2	8.1	10.4	16.4	15.3	14.9			
						22.6		8.2		23.6		93.5		7.9			8.0			8.1			10.9		15.2
				Middle	3.5	22.5	22.5	8.2	8.2	24.7	24.8	94.3	94.8	8.0	8.1		8.1	8.1		8.1	10.8		10.9	16.6	13.7
				Bottom	6	22.4	22.4	8.2	8.2	25.3	25.2	94.2	92.8	8.0	7.9	7.9	12.5	12.3		14.0	14.3	14.2			
						22.4		8.2		25.1		91.3		7.8		7.9	12.0	12.3		14.3	14.2				
23-Dec-15	Fine	Moderate	10:04	Surface	1	20.7	21.1	7.5	7.5	29.8	29.9	91.5	88.9	6.9	6.7	6.8	6.0	5.5	6.7	25.7	24.7	19.1			
						21.5		7.5		29.9		86.3		6.4			6.8			5.0			23.7		24.7
				Middle	3.5	21.6	20.9	7.5	7.6	29.4	29.6	93.3	90.7	6.9	6.8		6.8	6.8		6.8	5.5		5.6	14.3	13.4
						20.2		7.7		29.8		88.0		6.7		6.6		5.6		12.4		13.4			
				Bottom	6	20.0	20.4	7.4	7.5	30.1	30.5	88.4	87.1	6.7	6.6	6.6	9.0	8.9		20.4	19.3				
						20.8		7.5		30.9		85.7		6.4		6.6	8.8	8.9		18.1	19.3				
25-Dec-15	Cloudy	Moderate	12:05	Surface	1	21.1	21.1	8.1	8.1	26.3	26.3	95.0	93.8	7.3	7.2	7.1	8.2	8.2	8.5	8.0	8.1	9.7			
						21.1		8.1		26.3		92.6		7.1			7.1			8.2			8.2		8.1
				Middle	4.5	21.1	21.1	8.1	8.1	26.4	26.4	90.8	90.9	6.9	6.9		6.9	6.9		6.9	8.4		8.4	11.4	10.9
						21.1		8.1		26.3		91.0		6.9		7.0		8.4		10.3		10.9			
				Bottom	8	21.1	21.1	8.1	8.1	26.1	26.3	93.0	91.6	7.1	7.0	7.0	8.8	8.8		9.3	10.2				
						21.1		8.1		26.4		90.2		6.9		7.0	8.7	8.8		11.1	10.2				
28-Dec-15	Fine	Moderate	14:03	Surface	1	22.1	22.1	7.8	7.8	29.0	29.0	97.0	96.4	7.2	7.2	7.1	4.7	4.9	9.0	8.3	9.0	9.7			
						22.1		7.8		29.0		95.7		7.1			7.2			4.7			9.0		8.3
				Middle	4	22.2	22.2	7.8	7.9	29.7	29.7	93.5	93.0	6.9	6.9		6.9	6.9		6.9	9.3		9.5	8.7	10.0
						22.2		7.9		29.6		92.5		6.8		6.6		9.6		11.3		10.0			
				Bottom	7	22.2	22.2	7.9	8.0	30.9	31.0	90.7	90.9	6.6	6.6	6.6	12.6	12.5		9.6	10.1				
						22.2		8.0		31.0		91.0		6.6		6.6	12.3	12.5		10.6	10.1				
30-Dec-15	Cloudy	Moderate	14:53	Surface	1	19.9	19.9	7.7	7.7	25.6	25.9	73.8	73.0	5.8	5.7	5.5	6.5	6.5	7.9	4.3	5.3	8.5			
						19.8		7.6		26.1		72.1		5.6			5.7			6.5			6.5		6.2
				Middle	3	20.4	20.6	7.7	7.8	25.9	26.9	67.7	68.4	5.2	5.3		5.3	5.3		5.3	7.4		7.7	7.9	7.7
						20.8		7.8		27.9		69.1		5.3		6.4		7.9		12.2		10.1			
				Bottom	5	20.0	20.1	7.9	7.8	27.9	27.6	77.1	82.8	6.0	6.4	6.4	10.3	9.6		11.5	10.0				
						20.2		7.7		27.2		88.4		6.8		6.4	8.9	9.6		8.4	10.0				

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SRA - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Dec-15	Fine	Moderate	11:19	Surface	1	25.8 25.6	25.7	7.8 7.8	7.8	24.4 24.5	24.5	97.8 96.8	97.3	6.9 6.9	6.9	6.9	6.7 6.3	6.5	8.3	10.8 12.6	11.7	12.6
				Middle	3.5	25.7 25.7	25.7	7.8 7.8	7.8	25.2 24.8	25.0	94.6 95.5	95.1	6.7 6.8	6.8		7.8 8.1	8.0		11.6 14.1	12.9	
				Bottom	6	25.2 25.2	25.2	7.8 7.9	7.9	25.3 25.2	25.3	75.4 74.5	75.0	5.4 5.3	5.4		10.1 10.4	10.3		13.1 13.0	13.1	
4-Dec-15	Fine	Moderate	13:14	Surface	1	26.0 26.0	26.0	7.8 7.7	7.8	27.2 27.1	27.2	101.2 102.6	101.9	7.0 7.1	7.1	7.1	6.1 6.2	6.2	8.5	11.3 13.5	12.4	11.4
				Middle	4	25.9 25.9	25.9	7.8 7.8	7.8	28.8 28.8	28.8	97.6 99.1	98.4	6.9 7.0	7.0		8.5 8.9	8.7		9.0 6.7	7.9	
				Bottom	7	25.9 25.9	25.9	8.0 8.0	8.0	29.0 29.1	29.1	97.3 97.0	97.2	6.8 6.8	6.8		10.5 10.6	10.6		14.5 13.2	13.9	
7-Dec-15	Sunny	Moderate	15:42	Surface	1	23.6 23.6	23.6	8.1 8.1	8.1	30.2 30.2	30.2	107.8 107.4	107.6	7.7 7.7	7.7	7.6	6.7 6.7	6.7	8.8	14.6 15.7	15.2	15.7
				Middle	4	23.5 23.5	23.5	8.1 8.1	8.1	31.7 31.8	31.8	105.0 104.4	104.7	7.4 7.4	7.4		8.9 9.2	9.1		13.7 18.5	16.1	
				Bottom	7	23.5 23.5	23.5	8.1 8.1	8.1	32.8 32.5	32.7	103.6 103.0	103.3	7.3 7.3	7.3		10.6 10.7	10.7		15.9 15.8	15.9	
9-Dec-15	Rainy	Moderate	16:06	Surface	1	26.5 25.4	26.0	8.2 8.2	8.2	23.6 22.4	23.0	89.8 83.4	86.6	6.3 6.0	6.2	6.2	6.2 6.1	6.2	7.8	16.7 18.2	17.5	15.3
				Middle	4.5	25.1 25.1	25.1	8.1 8.2	8.2	26.4 26.4	26.4	85.6 86.1	85.9	6.1 6.1	6.1		7.1 6.9	7.0		11.0 11.3	11.2	
				Bottom	8	25.0 25.0	25.0	8.1 8.2	8.2	28.0 27.8	27.9	88.3 81.6	85.0	6.2 5.8	6.0		10.5 9.6	10.1		17.8 16.8	17.3	
11-Dec-15	Fine	Moderate	17:47	Surface	1	21.6 21.6	21.6	8.1 8.1	8.1	28.9 28.9	28.9	94.0 93.5	93.8	7.0 7.0	7.0	7.0	9.0 8.0	8.5	11.2	16.7 18.0	17.4	17.1
				Middle	3.5	21.4 21.4	21.4	8.1 8.1	8.1	29.0 29.0	29.0	93.3 92.5	92.9	7.0 6.9	7.0		10.5 10.8	10.7		13.3 14.5	13.9	
				Bottom	6	21.5 21.5	21.5	8.1 8.1	8.1	29.2 29.2	29.2	91.8 91.5	91.7	6.8 6.8	6.8		13.9 14.7	14.3		17.4 22.4	19.9	
14-Dec-15	Fine	Moderate	08:24	Surface	1	23.0 22.9	23.0	7.9 7.9	7.9	31.5 30.6	31.1	93.0 94.0	93.5	6.7 6.8	6.8	6.8	5.2 4.5	4.9	6.7	24.6 20.7	22.7	21.1
				Middle	3.5	23.0 23.1	23.1	8.0 7.9	8.0	31.6 31.6	31.6	92.3 93.6	93.0	6.6 6.7	6.7		6.1 6.6	6.4		18.5 15.6	17.1	
				Bottom	6	23.0 22.7	22.9	7.9 7.9	7.9	31.5 28.9	30.2	93.4 90.3	91.9	6.7 6.6	6.7		8.9 8.6	8.8		24.4 22.7	23.6	
16-Dec-15	Sunny	Moderate	09:40	Surface	1	21.7 22.2	22.0	8.1 8.2	8.2	32.2 30.3	31.3	102.3 96.9	99.6	7.5 7.1	7.3	7.3	5.3 4.4	4.9	6.7	43.2 37.7	40.5	30.6
				Middle	3.5	22.6 22.8	22.7	8.1 8.2	8.2	32.2 31.6	31.9	103.3 99.7	101.5	7.4 7.2	7.3		6.0 6.6	6.3		29.1 22.9	26.0	
				Bottom	6	22.8 21.6	22.2	8.1 8.0	8.1	28.8 30.7	29.8	94.6 95.7	95.2	6.9 7.1	7.0		8.9 8.6	8.8		25.0 25.5	25.3	
18-Dec-15	Sunny	Moderate	11:35	Surface	1	21.2 21.5	21.4	8.1 8.2	8.2	29.8 31.6	30.7	86.0 92.0	89.0	6.4 6.8	6.6	6.5	5.2 4.5	4.9	6.7	9.6 11.1	10.4	11.4
				Middle	3.5	21.5 21.8	21.7	8.1 8.2	8.2	30.1 29.6	29.9	85.7 87.3	86.5	6.3 6.5	6.4		6.1 6.6	6.4		12.5 18.9	15.7	
				Bottom	6	21.9 21.7	21.8	8.1 8.1	8.1	30.2 30.3	30.3	86.2 83.3	84.8	6.3 6.1	6.2		8.9 8.6	8.8		10.2 6.1	8.2	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SRA - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Dec-15	Fine	Moderate	14:47	Surface	1	23.1 23.0	23.1	8.1 8.1	8.1	25.3 24.6	25.0	85.3 84.1	84.7	7.2 7.1	7.2	6.9	7.9 8.3	8.1	9.6	20.8 17.8	19.3	17.7
				Middle	6	23.0 23.0	23.0	8.2 8.1	8.2	26.0 25.7	25.9	77.3 76.2	76.8	6.6 6.5	6.6		10.9 12.0	11.5		13.6 13.5	13.6	
				Bottom	11	22.9 23.0	23.0	8.1 8.1	8.1	25.3 25.5	25.4	73.4 73.3	73.4	6.2 6.2	6.2		9.1 9.3	9.2		22.9 17.2	20.1	
23-Dec-15	Fine	Moderate	15:45	Surface	1	20.8 21.1	21.0	7.4 7.4	7.4	30.5 29.7	30.1	80.9 86.4	83.7	6.1 6.5	6.3	6.4	7.2 7.8	7.5	8.8	19.6 22.4	21.0	21.1
				Middle	3	21.6 20.2	20.9	7.6 7.6	7.6	30.3 30.4	30.4	81.9 87.0	84.5	6.1 6.6	6.4		8.3 8.1	8.2		21.0 23.4	22.2	
				Bottom	5	20.2 20.1	20.2	7.5 7.5	7.5	29.9 30.3	30.1	81.6 87.7	84.7	6.2 6.7	6.5		11.1 10.3	10.7		19.8 20.2	20.0	
25-Dec-15	Cloudy	Moderate	17:34	Surface	1	21.4 21.4	21.4	8.2 8.2	8.2	28.0 28.0	28.0	98.4 97.4	97.9	7.4 7.3	7.4	7.3	6.9 7.0	7.0	7.6	7.0 9.2	8.1	8.1
				Middle	4.5	21.4 21.4	21.4	8.1 8.1	8.1	28.2 28.2	28.2	94.9 94.9	94.9	7.1 7.1	7.1		7.2 7.3	7.3		8.6 6.2	7.4	
				Bottom	8	21.4 21.4	21.4	8.1 8.1	8.1	28.3 28.3	28.3	93.1 93.1	93.1	7.0 7.0	7.0		8.5 8.3	8.4		10.4 7.0	8.7	
28-Dec-15	Fine	Moderate	08:39	Surface	1	22.0 22.0	22.0	7.8 7.8	7.8	28.8 28.7	28.8	95.2 95.8	95.5	7.0 7.1	7.1	7.0	5.0 5.3	5.2	8.6	9.3 11.2	10.3	10.4
				Middle	4	22.1 22.0	22.1	7.9 7.8	7.9	29.4 29.5	29.5	92.3 93.0	92.7	6.8 6.9	6.9		8.6 8.5	8.6		12.0 10.2	11.1	
				Bottom	7	22.1 22.2	22.2	7.9 7.9	7.9	30.7 30.7	30.7	90.7 91.5	91.1	6.6 6.7	6.7		11.9 11.9	11.9		9.6 9.7	9.7	
30-Dec-15	Cloudy	Moderate	09:25	Surface	1	19.8 20.6	20.2	7.7 7.8	7.8	27.3 27.2	27.3	82.5 81.7	82.1	6.4 6.3	6.4	5.8	6.8 6.9	6.9	9.0	8.4 9.6	9.0	11.2
				Middle	3.5	20.1 20.3	20.2	7.7 7.7	7.7	26.5 25.4	26.0	65.4 65.5	65.5	5.1 5.1	5.1		8.8 9.0	8.9		14.9 13.1	14.0	
				Bottom	6	20.6 19.9	20.3	7.9 7.6	7.8	25.3 25.5	25.4	66.8 67.6	67.2	5.2 5.3	5.3		11.1 11.4	11.3		10.1 11.1	10.6	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Dec-15	Fine	Moderate	17:28	Surface	1	25.4 25.4	25.4	7.9 7.9	7.9	25.3 25.2	25.3	112.6 112.3	112.5	8.0 8.0	8.0	8.0	5.2 6.0	5.6	11.3	15.2 21.8	18.5	18.0
				Middle	5	25.4 25.4	25.4	7.9 7.9	7.9	26.8 26.8	26.8	113.0 111.7	112.4	8.0 7.9	8.0		14.8 15.6	15.2		14.8 12.6	14.3	
				Bottom	9	25.5 25.5	25.5	7.9 7.9	7.9	27.2 27.1	27.2	111.4 111.0	111.2	7.8 7.8	7.8		12.7 13.2	13.0		19.0 23.1	21.1	
4-Dec-15	Fine	Moderate	20:03	Surface	1	25.9 25.9	25.9	8.0 7.9	8.0	28.3 28.2	28.3	104.3 104.7	104.5	7.2 7.3	7.3	7.2	6.9 7.1	7.0	9.7	18.2 14.9	16.6	15.1
				Middle	5	25.9 25.8	25.9	8.1 8.1	8.1	28.3 28.2	28.3	100.7 100.5	100.6	7.0 7.0	7.0		10.0 9.7	9.9		14.8 15.3	15.1	
				Bottom	9	25.8 25.8	25.8	8.0 8.0	8.0	29.9 29.7	29.8	95.2 94.3	94.8	6.6 6.5	6.6		12.1 12.5	12.3		10.9 16.3	13.6	
7-Dec-15	Sunny	Moderate	10:27	Surface	1	22.0 22.0	22.0	8.2 8.2	8.2	29.6 29.6	29.6	101.3 101.4	101.4	7.5 7.5	7.5	7.5	5.3 5.1	5.2	6.3	15.5 14.9	15.2	16.1
				Middle	4.5	22.0 22.0	22.0	8.2 8.2	8.2	29.6 29.6	29.6	101.3 101.4	101.4	7.5 7.5	7.5		5.1 5.4	5.3		15.9 17.2	16.6	
				Bottom	8	22.0 22.0	22.0	8.2 8.2	8.2	29.6 29.6	29.6	101.4 101.4	101.4	7.5 7.5	7.5		8.1 8.4	8.3		18.2 14.9	16.6	
9-Dec-15	Rainy	Moderate	11:01	Surface	1	24.0 23.6	23.8	8.1 8.2	8.2	23.4 22.1	22.8	88.5 85.6	87.1	6.5 6.4	6.5	6.1	8.2 7.7	8.0	9.3	32.0 35.6	33.8	35.3
				Middle	5	23.8 24.5	24.2	8.2 8.2	8.2	23.6 22.3	23.0	76.8 76.2	76.5	5.7 5.6	5.7		10.1 9.5	9.8		31.9 35.9	33.9	
				Bottom	9	23.6 24.5	24.1	8.2 8.2	8.2	26.1 22.9	24.5	71.8 72.0	71.9	5.3 5.3	5.3		9.9 10.3	10.1		37.4 39.1	38.3	
11-Dec-15	Sunny	Moderate	12:56	Surface	1	21.5 21.5	21.5	7.9 7.9	7.9	28.3 28.2	28.3	101.1 100.9	101.0	7.6 7.6	7.6	7.5	8.2 7.9	8.1	10.8	26.4 21.3	23.9	19.9
				Middle	5	21.2 21.1	21.2	8.0 8.0	8.0	29.3 29.2	29.3	97.0 99.2	98.1	7.3 7.4	7.4		11.8 11.5	11.7		15.2 19.4	17.3	
				Bottom	9	21.0 21.1	21.1	8.1 8.1	8.1	30.2 30.3	30.3	91.7 90.7	91.2	6.9 6.8	6.9		12.4 12.5	12.5		16.8 20.1	18.5	
14-Dec-15	Fine	Moderate	14:39	Surface	1	25.3 25.3	25.3	7.9 7.9	7.9	25.0 25.0	25.0	93.9 93.9	93.9	6.7 6.7	6.7	6.7	3.5 3.3	3.4	4.4	20.0 19.9	20.0	21.8
				Middle	5.5	23.4 23.4	23.4	7.9 7.9	7.9	29.1 29.1	29.1	91.9 91.7	91.8	6.6 6.6	6.6		4.7 4.6	4.7		21.2 17.0	19.1	
				Bottom	10	21.7 21.7	21.7	7.9 7.9	7.9	33.1 33.1	33.1	89.6 89.2	89.4	6.5 6.5	6.5		4.9 5.0	5.0		28.8 23.6	26.2	
16-Dec-15	Sunny	Moderate	15:57	Surface	1	23.2 23.2	23.2	8.2 8.3	8.3	29.9 29.9	29.9	106.0 105.8	105.9	7.6 7.6	7.6	7.7	7.3 6.9	7.1	7.1	17.0 24.3	20.7	27.5
				Middle	4.5	23.2 23.2	23.2	8.1 8.0	8.1	29.9 29.9	29.9	106.0 106.9	106.5	7.6 7.7	7.7		7.0 7.3	7.2		22.1 32.7	27.4	
				Bottom	8	23.2 23.2	23.2	8.2 8.3	8.3	29.9 29.8	29.9	104.8 102.4	103.6	7.5 7.4	7.5		7.0 7.2	7.1		39.2 29.3	34.3	
18-Dec-15	Fine	Moderate	18:02	Surface	1	22.1 22.1	22.1	8.0 8.0	8.0	28.3 28.6	28.5	91.5 93.6	92.6	6.8 6.9	6.9	6.8	4.6 4.5	4.6	7.8	13.6 17.4	15.5	17.1
				Middle	5	21.6 21.6	21.6	8.2 8.1	8.2	29.5 29.6	29.6	87.0 88.4	87.7	6.5 6.6	6.6		8.6 8.8	8.7		20.1 15.0	17.6	
				Bottom	9	21.3 21.3	21.3	8.3 8.2	8.3	31.6 31.4	31.5	84.0 84.7	84.4	6.2 6.3	6.3		10.0 10.0	10.0		16.9 19.7	18.3	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
21-Dec-15	Fine	Moderate	08:45	Surface	1	22.6 22.4	22.5	8.2 8.2	8.2	24.3 23.6	24.0	96.6 94.6	95.6	7.3 7.2	7.3	7.0	8.0 7.9	8.0	10.3	11.8 13.9	12.9	17.2		
				Middle	5	22.5 22.8	22.7	8.2 8.2	8.2	24.7 24.9	24.8	87.6 87.0	87.3	6.6 6.5	6.6		11.1 10.6			10.9			15.8 20.0	17.9
				Bottom	9	22.4 22.8	22.6	8.2 8.2	8.2	25.3 25.1	25.2	83.4 83.7	83.6	6.3 6.2	6.3		11.9 12.1			12.0			24.0 17.8	20.9
23-Dec-15	Fine	Moderate	10:33	Surface	1	22.2 22.1	22.2	7.6 7.6	7.6	28.6 28.6	28.6	93.2 93.5	93.4	6.9 6.9	6.9	6.9	5.9 6.1	6.0	10.0	16.0 23.3	19.7	23.9		
				Middle	5	21.7 21.7	21.7	7.6 7.6	7.6	30.2 30.2	30.2	91.4 90.6	91.0	6.8 6.7	6.8		10.7 10.8			10.8			32.2 22.1	27.2
				Bottom	9	21.3 21.3	21.3	7.5 7.5	7.5	31.0 31.0	31.0	86.1 84.3	85.2	6.4 6.2	6.3		13.2 13.0			13.1			24.2 25.3	24.8
25-Dec-15	Cloudy	Moderate	12:25	Surface	1	22.0 21.2	21.6	8.2 8.2	8.2	28.6 28.6	28.6	115.5 113.8	114.7	8.6 8.6	8.6	8.3	4.4 4.2	4.3	5.4	10.0 10.7	10.4	13.2		
				Middle	4.5	21.2 21.2	21.2	8.2 8.2	8.2	28.6 28.6	28.6	105.3 105.0	105.2	7.9 7.9	7.9		4.2 4.5			4.4			18.5 13.5	16.0
				Bottom	8	21.2 22.0	21.6	8.2 8.2	8.2	28.6 28.6	28.6	91.0 106.7	98.9	6.8 7.9	7.4		7.4			7.2 7.5			7.4	11.7 14.8
28-Dec-15	Fine	Moderate	14:12	Surface	1	23.3 23.3	23.3	7.8 7.8	7.8	29.9 29.9	29.9	103.5 95.0	99.3	7.4 6.8	7.1	6.9	6.1 6.2	6.2	6.5	9.5 9.3	9.4	9.4		
				Middle	4.5	23.3 23.3	23.3	7.7 7.7	7.7	29.9 29.9	29.9	97.2 89.0	93.1	7.0 6.4	6.7		6.5 6.8			6.7			7.4 12.2	9.8
				Bottom	8	23.3 23.4	23.4	7.8 7.7	7.8	29.9 29.8	29.9	106.3 106.9	106.6	7.6 7.7	7.7		7.7			6.5 6.7			6.6	8.1 9.7
30-Dec-15	Cloudy	Moderate	15:33	Surface	1	21.4 21.4	21.4	7.9 7.9	7.9	27.0 26.9	27.0	93.4 95.3	94.4	7.1 7.2	7.2	6.9	4.8 4.9	4.9	5.1	6.1 9.8	8.0	8.8		
				Middle	5	20.2 20.3	20.3	7.8 7.8	7.8	27.8 27.8	27.8	84.6 84.2	84.4	6.5 6.5	6.5		5.5 5.6			5.6			10.1 9.8	10.0
				Bottom	9	19.2 19.1	19.2	7.7 7.7	7.7	28.0 28.0	28.0	67.0 65.8	66.4	5.2 5.2	5.2		5.2			4.9 4.6			4.8	10.2 6.6

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
2-Dec-15	Fine	Moderate	11:45	Surface	1	25.7	25.7	7.9	7.9	24.3	24.3	100.2	99.8	7.1	7.1	7.0	4.5	4.6	7.8	13.3	15.4	15.0	
						25.7		7.9		24.2		99.3		7.1			4.7			7.8	17.4		
				Middle	5.5	25.6	25.6	7.9	7.9	26.1	26.1	97.9	97.4	6.9	6.9		8.6	8.4		13.9	16.6		
		25.6		7.9		26.1		96.8		6.8		6.9	8.2		7.8	19.3							
		25.6	25.6	7.9	7.9	26.2	26.3	95.9	95.7	6.8	6.8	6.8	10.4	10.4	7.8	12.6	13.1						
		25.6		7.9		26.3		95.4		6.7		6.8	10.4		7.8	13.5		13.1					
4-Dec-15	Fine	Moderate	13:39	Surface	1	25.9	25.9	7.8	7.8	27.1	27.2	105.4	105.2	7.4	7.4	7.2	8.1	8.0	10.6	16.7	15.1	12.8	
						25.9		7.8		27.3		104.9		7.3			7.2	7.9			10.6		9.9
				Middle	5	25.8	25.8	7.9	7.9	28.4	28.5	99.0	99.4	6.9	6.9		11.5	11.5		10.6	9.2		9.9
		25.8		7.9		28.5		99.7		6.9		6.9	11.5		10.6	9.2	9.9						
		25.8	25.8	8.1	8.1	29.6	29.6	94.2	94.1	6.5	6.5	6.5	12.2	12.4	10.6	12.9	13.4						
		25.8		8.0		29.6		93.9		6.5		6.5	12.5		10.6	13.9		13.4					
7-Dec-15	Sunny	Moderate	15:29	Surface	1	23.1	23.1	8.1	8.1	25.8	26.3	106.1	106.9	7.8	7.9	8.0	5.9	5.8	7.0	17.0	16.2	21.1	
						23.1		8.1		26.7		107.7		7.9			8.0	5.7		5.8	17.0		15.3
				Middle	4.5	23.1	23.1	8.3	8.3	26.8	26.8	108.4	108.1	8.0	8.0		6.8	6.8		7.0	18.7		21.7
		23.1		8.3		26.7		107.7		7.9		8.0	6.7		7.0	24.6	21.7						
		23.1	23.1	8.3	8.3	26.8	26.3	107.0	107.0	7.9	7.9	7.9	8.5	8.3	7.0	24.8	25.4						
		23.1		8.3		25.8		107.0		7.9		7.9	8.1		7.0	25.9	25.4						
9-Dec-15	Rainy	Moderate	16:43	Surface	1	26.4	25.9	8.2	8.2	23.6	23.0	94.4	91.1	6.7	6.6	6.5	6.1	6.1	7.7	31.6	30.2	32.0	
						25.4		8.2		22.4		87.8		6.4			6.5	6.0		6.1	31.6		28.8
				Middle	5	25.1	25.1	8.1	8.2	26.4	26.4	90.1	90.4	6.4	6.4		7.1	7.0		7.7	29.7		31.1
		25.1		8.2		26.4		90.6		6.4		6.4	6.9		7.7	32.4	31.1						
		25.0	25.0	8.1	8.2	28.0	27.9	92.8	89.5	6.5	6.3	6.3	10.7	10.0	7.7	37.4	34.6						
		25.0		8.2		27.8		86.1		6.1		6.3	9.2		7.7	31.7	34.6						
11-Dec-15	Fine	Moderate	17:44	Surface	1	21.4	21.5	8.0	8.0	28.8	28.8	105.1	104.9	7.9	7.9	7.7	7.2	7.3	10.1	23.3	20.6	21.6	
						21.5		7.9		28.7		104.7		7.8			7.7	7.3		7.3	23.3		17.8
				Middle	5	21.3	21.3	8.0	8.0	29.9	29.8	99.9	100.3	7.4	7.5		10.2	10.0		10.1	22.0		22.8
		21.3		8.0		29.6		100.6		7.5		7.5	9.7		10.1	23.5	22.8						
		21.0	21.0	8.2	8.2	30.7	30.6	93.8	93.6	7.0	7.0	7.0	13.0	13.1	10.1	22.8	21.5						
		21.0		8.2		30.4		93.4		7.0		7.0	13.1		10.1	20.2	21.5						
14-Dec-15	Fine	Moderate	08:58	Surface	1	24.3	24.3	7.8	7.8	23.1	23.2	92.2	92.4	6.8	6.8	6.8	4.2	4.2	7.7	20.1	18.9	24.3	
						24.3		7.8		23.2		92.5		6.8			6.8	4.2		4.2	20.1		17.6
				Middle	5	22.9	22.9	7.8	7.8	28.3	28.3	92.5	92.2	6.8	6.8		7.9	7.8		7.7	21.1		19.9
		22.9		7.8		28.2		91.9		6.7		6.8	7.7		7.7	18.6	19.9						
		22.8	22.8	7.8	7.8	28.6	28.6	91.6	91.7	6.7	6.7	6.7	11.7	11.1	7.7	35.8	34.0						
		22.8		7.8		28.6		91.7		6.7		6.7	10.5		7.7	32.1	34.0						
16-Dec-15	Sunny	Moderate	10:25	Surface	1	21.8	21.8	8.3	8.3	29.2	29.3	100.2	96.1	7.4	7.1	6.9	7.5	7.5	7.4	15.5	17.4	19.6	
						21.7		8.3		29.3		91.9		6.8			6.9	7.4		7.5	15.5		19.3
				Middle	4.5	21.7	21.5	8.3	8.3	29.2	30.0	94.1	90.2	7.0	6.7		7.5	7.3		7.4	22.7		23.6
		21.3		8.2		30.8		86.3		6.4		7.1		6.9	7.1	24.5	23.6						
		21.7	21.5	8.3	8.3	29.3	30.1	102.8	103.2	7.6	7.7	7.7	7.5	7.3	7.4	17.3	17.7						
		21.3		8.2		30.8		103.6		7.7		7.7	7.0		7.4	18.0	17.7						
18-Dec-15	Sunny	Moderate	11:53	Surface	1	22.1	22.1	7.8	7.8	28.7	28.6	92.8	92.2	6.9	6.9	6.5	7.1	7.1	8.1	15.9	15.8	18.2	
						22.0		7.8		28.4		91.6		6.8			6.5	7.0		7.1	15.9		15.6
				Middle	5	21.6	21.6	7.9	7.9	30.4	30.3	82.7	82.2	6.1	6.1		7.6	7.5		8.1	26.4		25.6
		21.6		7.9		30.2		81.6		6.0		6.1	7.4		8.1	24.8	25.6						
		21.4	21.4	8.1	8.1	32.1	32.0	82.1	81.6	6.0	6.0	6.0	9.7	9.6	8.1	12.3	13.1						
		21.4		8.1		31.9		81.0		6.0		6.0	9.5		8.1	13.8	13.1						

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Dec-15	Fine	Moderate	15:33	Surface	1	23.6 23.1	23.4	8.2 8.2	8.2	23.5 23.3	23.4	112.6 108.5	110.6	8.3 8.1	8.2	8.2	7.3 7.7	7.5	11.2	16.2 14.2	15.2	15.6
				Middle	5	23.0 23.0	23.0	8.2 8.2	8.2	26.0 26.3	26.2	110.4 110.2	110.3	8.2 8.1	8.2		12.7 13.0	12.9		18.5 18.8	18.7	
				Bottom	9	23.0 22.9	23.0	8.2 8.2	8.2	26.9 27.4	27.2	111.0 106.7	108.9	8.2 7.8	8.0		13.5 13.0	13.3		10.4 15.6	13.0	
23-Dec-15	Fine	Moderate	16:19	Surface	1	21.9 21.9	21.9	7.6 7.6	7.6	28.2 28.2	28.2	87.8 88.4	88.1	6.5 6.6	6.6	6.6	5.0 5.1	5.1	5.3	12.3 11.8	12.1	18.4
				Middle	5	20.7 20.8	20.8	7.6 7.5	7.6	29.5 29.4	29.5	85.7 84.9	85.3	6.5 6.4	6.5		5.7 5.8	5.8		23.9 24.5	24.2	
				Bottom	9	19.7 19.6	19.7	7.5 7.5	7.5	30.3 30.2	30.3	79.7 78.6	79.2	6.1 6.0	6.1		5.1 4.8	5.0		20.1 17.5	18.8	
25-Dec-15	Cloudy	Moderate	17:47	Surface	1	23.2 23.2	23.2	8.1 8.1	8.1	26.8 27.8	27.3	101.8 102.5	102.2	7.5 7.5	7.5	7.5	5.2 5.0	5.1	6.3	10.0 10.0	10.0	10.0
				Middle	4.5	23.3 23.3	23.3	8.2 8.2	8.2	27.8 27.8	27.8	102.5 102.7	102.6	7.5 7.5	7.5		6.1 6.0	6.1		8.0 7.5	7.8	
				Bottom	8	23.1 23.2	23.2	8.2 8.2	8.2	27.8 26.8	27.3	102.4 102.0	102.2	7.5 7.5	7.5		7.8 7.4	7.6		14.2 9.9	12.1	
28-Dec-15	Fine	Moderate	09:54	Surface	1	21.9 21.8	21.9	7.7 7.7	7.7	28.2 28.3	28.3	102.5 102.2	102.4	7.6 7.6	7.6	7.7	6.2 6.1	6.2	6.3	12.7 13.0	12.9	12.6
				Middle	4.5	21.8 21.4	21.6	7.7 7.7	7.7	28.2 29.8	29.0	102.5 103.5	103.0	7.6 7.7	7.7		6.3 6.3	6.3		9.5 10.6	10.1	
				Bottom	8	21.8 21.4	21.6	7.7 7.7	7.7	28.3 29.8	29.1	101.3 99.2	100.3	7.5 7.4	7.5		6.7 6.2	6.5		11.5 17.8	14.7	
30-Dec-15	Cloudy	Moderate	09:56	Surface	1	21.7 21.6	21.7	7.9 7.9	7.9	26.1 26.1	26.1	94.9 92.9	93.9	7.2 7.0	7.1	7.0	5.7 5.9	5.8	9.8	9.7 11.1	10.4	10.1
				Middle	5	21.2 21.2	21.2	7.9 7.9	7.9	26.8 26.8	26.8	89.2 88.3	88.8	6.8 6.7	6.8		10.5 10.6	10.6		8.7 7.0	7.9	
				Bottom	9	20.8 20.8	20.8	7.8 7.8	7.8	27.2 27.2	27.2	70.3 67.7	69.0	5.4 5.2	5.3		13.0 12.8	12.9		12.7 11.4	12.1	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Dec-15	Fine	Moderate	17:16	Surface	1	25.4	25.4	7.9	7.9	25.2	25.2	116.3	115.9	8.3	8.3	8.2	4.2	4.4	7.5	15.4	13.7	14.0
						25.4	25.4	7.8	7.9	25.2	26.8	115.4	114.0	8.2	8.0		4.5	8.2		11.5	12.2	
				Middle	4	25.4	25.4	7.9	7.9	26.8	26.8	112.9	113.5	8.0	8.0		7.8	8.6		8.2	12.9	
				25.4	25.4	7.9	7.9	26.9	26.9	112.3	112.2	7.9	7.9	7.9	10.0	9.9		14.2	16.0			
				25.4	25.4	7.9	7.9	26.9	26.9	112.0	112.2	7.9	7.9	7.9	9.8	9.9		17.8	16.0			
4-Dec-15	Fine	Moderate	19:48	Surface	1	26.0	26.0	7.9	7.9	27.9	27.9	101.5	101.9	7.0	7.1	6.9	7.3	7.2	9.4	14.2	13.6	14.2
						26.0	26.0	7.9	7.9	27.9	27.9	102.2	101.9	7.1	7.1		7.0	7.2		12.9	13.6	
				Middle	4	25.9	25.9	8.1	8.1	28.6	28.7	94.7	95.3	6.6	6.6		9.4	9.5		12.5	13.9	
				25.9	25.9	8.1	8.1	28.7	28.7	95.9	95.3	6.6	6.6	6.6	9.6	9.5		15.3	13.9			
				25.9	25.9	8.3	8.3	29.5	29.5	93.1	93.8	6.4	6.5	6.5	11.3	11.6		14.0	15.0			
				25.9	25.9	8.3	8.3	29.5	29.5	94.4	93.8	6.5	6.5	6.5	11.8	11.6		15.9	15.0			
7-Dec-15	Sunny	Moderate	10:14	Surface	1	22.0	22.0	8.2	8.2	29.6	29.6	104.0	102.2	7.7	7.6	7.4	5.4	5.4	6.1	15.1	15.4	16.3
						22.0	22.0	8.2	8.2	29.6	29.6	100.3	102.2	7.4	7.6		5.3	5.4		15.7	15.4	
				Middle	3.5	22.0	22.0	8.2	8.2	29.6	29.6	100.2	97.3	7.0	7.2		5.6	5.5		17.4	15.9	
				22.0	22.0	8.2	8.2	29.6	29.6	100.2	97.3	7.4	7.2	7.2	7.5	7.4		16.2	17.7			
				22.0	22.0	8.3	8.3	29.6	29.6	93.5	96.8	6.9	7.2	7.2	7.2	7.4		19.1	17.7			
				22.0	22.0	8.2	8.2	29.6	29.6	100.1	100.1	7.4	7.2	7.2	7.2	7.4		19.1	17.7			
9-Dec-15	Rainy	Moderate	10:46	Surface	1	24.4	24.3	8.2	8.2	22.1	23.1	70.8	78.1	5.2	5.8	5.6	8.1	8.3	7.9	36.3	37.1	38.1
						24.2	24.3	8.1	8.2	24.0	23.1	85.4	78.1	6.3	5.8		8.5	8.3		37.8	37.1	
				Middle	4	24.5	24.6	8.1	8.2	22.2	22.3	68.1	72.6	5.0	5.3		10.3	10.6		39.0	37.7	
				24.7	24.6	8.2	8.2	22.3	22.3	77.0	72.6	5.6	5.3	5.6	5.3	10.8	10.6	36.4	37.7			
				24.3	24.5	8.2	8.2	23.8	23.1	84.8	80.2	6.2	5.9	5.9	4.7	4.8		39.6	39.4			
				24.7	24.5	8.1	8.2	22.3	22.3	75.5	75.5	5.5	5.5	5.5	4.8	4.8		39.1	39.4			
11-Dec-15	Sunny	Moderate	12:44	Surface	1	21.6	21.6	7.7	7.7	27.3	28.1	96.6	97.5	7.3	7.3	7.5	5.5	5.5	8.6	15.9	18.7	19.5
						21.6	21.6	7.7	7.7	28.9	28.1	98.3	97.5	7.3	7.3		5.4	5.5		21.5	18.7	
				Middle	4	21.3	21.3	8.1	8.1	29.1	29.1	95.6	102.0	7.2	7.7		8.2	8.3		14.1	17.3	
				21.3	21.3	8.1	8.1	29.1	29.1	108.4	102.0	8.1	7.7	7.7	8.3	8.3		20.5	17.3			
				21.2	21.2	8.2	8.2	29.6	29.5	88.9	89.3	6.6	6.7	6.7	12.0	12.0		24.5	22.4			
				21.2	21.2	8.2	8.2	29.4	29.5	89.7	89.3	6.7	6.7	6.7	12.0	12.0		20.2	22.4			
14-Dec-15	Fine	Moderate	14:29	Surface	1	25.0	25.0	7.9	7.9	24.5	24.6	91.8	91.9	6.6	6.6	6.6	4.2	4.2	5.4	23.1	20.7	17.8
						25.0	25.0	7.9	7.9	24.6	24.6	92.0	91.9	6.6	6.6		4.1	4.2		18.2	20.7	
				Middle	4	23.5	23.6	7.9	7.9	28.4	28.3	89.8	90.0	6.5	6.5		4.1	4.3		20.4	19.5	
				23.6	23.6	7.9	7.9	28.2	28.3	90.1	90.0	6.5	6.5	6.5	6.5		14.1	13.1				
				22.2	22.2	7.8	7.8	31.6	31.7	84.9	85.1	6.2	6.2	6.2	7.4	7.7		12.1	13.1			
				22.2	22.2	7.8	7.8	31.7	31.7	85.2	85.1	6.2	6.2	6.2	8.0	7.7		12.1	13.1			
16-Dec-15	Sunny	Moderate	15:39	Surface	1	22.6	22.6	8.2	8.2	32.5	32.5	108.9	108.4	7.8	7.8	7.8	7.1	7.1	7.2	25.1	25.3	25.1
						22.6	22.6	8.2	8.2	32.5	32.5	107.9	108.4	7.7	7.8		7.1	7.1		25.4	25.3	
				Middle	3.5	22.6	22.6	8.2	8.2	32.5	32.5	108.0	108.5	7.7	7.8		7.2	7.2		24.2	26.7	
				22.6	22.6	8.2	8.2	32.5	32.5	108.9	108.5	7.8	7.8	7.8	7.2	7.2		29.2	26.7			
				22.6	22.6	8.2	8.2	32.5	32.5	108.7	108.5	7.8	7.8	7.8	7.2	7.2		21.4	23.4			
				22.6	22.6	8.2	8.2	32.5	32.5	108.3	108.5	7.8	7.8	7.8	7.2	7.2		25.3	23.4			
18-Dec-15	Fine	Moderate	17:50	Surface	1	21.8	21.8	7.8	7.9	30.5	30.6	93.9	94.1	6.9	6.9	6.7	6.5	6.6	7.2	20.7	19.4	18.3
						21.8	21.8	7.9	7.9	30.6	30.6	94.3	94.1	6.9	6.9		6.7	6.6		18.1	19.4	
				Middle	4	21.6	21.6	7.9	7.9	30.9	31.2	87.8	87.4	6.5	6.5		7.0	6.9		19.1	21.2	
				21.6	21.6	7.9	7.9	31.5	31.2	86.9	87.4	6.4	6.5	6.8	6.9		23.3	21.2				
				21.6	21.6	8.0	8.1	32.0	32.0	84.0	84.1	6.1	6.2	7.9	8.1		15.0	14.4				
				21.6	21.6	8.1	8.1	32.0	32.0	84.2	84.1	6.2	6.2	6.2	8.2	8.1		13.7	14.4			

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Dec-15	Fine	Moderate	08:31	Surface	1	22.8 22.7	22.8	8.2 8.2	8.2	21.8 24.4	23.1	84.0 93.6	88.8	6.4 7.0	6.7	6.5	8.0 8.1	8.1	9.8	17.5 17.6	17.6	15.5
				Middle	4	22.8 22.9	22.9	8.2 8.2	8.2	23.1 23.1	23.1	81.3 86.1	83.7	6.1 6.5	6.3		10.2 11.4	10.8		19.1 15.5	17.3	
				Bottom	7	22.7 22.9	22.8	8.2 8.2	8.2	24.4 22.9	23.7	90.1 84.2	87.2	6.8 6.3	6.6		10.5 10.2	10.4		10.7 12.2	11.5	
23-Dec-15	Fine	Moderate	10:18	Surface	1	21.6 21.7	21.7	7.6 7.6	7.6	28.0 28.5	28.3	95.3 96.4	95.9	7.1 7.2	7.2	7.2	2.5 2.5	2.5	4.7	27.3 26.4	26.9	22.2
				Middle	4	20.8 20.4	20.6	7.6 7.6	7.6	29.5 29.5	29.5	94.3 95.9	95.1	7.1 7.3	7.2		5.9 6.6	6.3		26.9 13.2	20.1	
				Bottom	7	19.8 20.0	19.9	7.6 7.5	7.6	30.5 30.4	30.5	85.7 84.8	85.3	6.5 6.5	6.5		4.9 5.5	5.2		12.4 26.6	19.5	
25-Dec-15	Cloudy	Moderate	12:12	Surface	1	22.0 21.1	21.6	8.2 8.2	8.2	28.6 28.6	28.6	115.5 113.8	114.7	8.6 8.6	8.6	7.8	4.5 4.4	4.5	5.2	8.2 9.2	8.7	8.8
				Middle	3.5	21.1 21.1	21.1	8.2 8.2	8.2	28.6 28.6	28.6	90.9 92.4	91.7	6.8 7.0	6.9		4.4 4.7	4.6		7.3 8.3	7.8	
				Bottom	6	21.1 22.0	21.6	8.2 8.2	8.2	28.6 28.6	28.6	91.6 93.0	92.3	6.9 6.9	6.9		6.6 6.3	6.5		9.4 10.5	10.0	
28-Dec-15	Fine	Moderate	13:54	Surface	1	22.7 22.7	22.7	7.8 7.8	7.8	30.4 30.4	30.4	93.6 93.6	93.6	6.8 6.8	6.8	6.6	6.6 6.6	6.6	6.8	8.8 8.2	8.5	8.3
				Middle	3.5	22.7 22.7	22.7	7.8 7.8	7.8	30.4 30.4	30.4	88.5 88.3	88.4	6.4 6.4	6.4		6.7 6.7	6.7		8.1 9.5	8.8	
				Bottom	6	22.7 22.7	22.7	7.8 7.8	7.8	30.4 30.2	30.3	105.7 104.8	105.3	7.6 7.6	7.6		6.9 7.2	7.1		8.3 7.1	7.7	
30-Dec-15	Cloudy	Moderate	15:20	Surface	1	20.4 20.7	20.6	7.9 7.9	7.9	27.0 27.0	27.0	82.1 81.0	81.6	6.3 6.2	6.3	6.0	5.9 5.7	5.8	7.9	12.2 11.1	11.7	8.3
				Middle	4	19.8 19.8	19.8	7.8 7.8	7.8	27.6 27.6	27.6	73.5 71.1	72.3	5.7 5.5	5.6		7.5 7.6	7.6		7.0 10.1	8.6	
				Bottom	7	19.3 19.2	19.3	7.8 7.8	7.8	28.1 28.1	28.1	65.2 65.0	65.1	5.1 5.1	5.1		10.3 10.3	10.3		5.5 3.7	4.6	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
2-Dec-15	Fine	Moderate	11:31	Surface	1	25.6	25.6	7.9	7.9	23.2	23.3	97.2	97.2	7.0	7.0	6.9	4.5	4.4	8.2	16.4	16.2	13.2		
						25.6	25.6	7.9	7.9	23.3	23.3	97.2	97.2	7.0	7.0		4.3	4.4		16.0	16.2			
				Middle	4	25.6	25.6	7.9	7.9	25.2	25.3	95.8	95.4	6.8	6.8		7.6	7.7		7.7	7.7		11.9	11.5
				25.6	25.6	7.9	7.9	25.3	25.3	95.0	95.4	6.7	6.8					11.1	11.5					
				Bottom	7	25.7	25.7	7.9	7.9	26.2	26.2	94.2	94.3	6.6	6.6	6.6	12.9	12.6		10.5	11.8			
						25.7	25.7	7.9	7.9	26.2	26.2	94.4	94.3	6.6	6.6		12.2	12.6		13.1	11.8			
4-Dec-15	Fine	Moderate	13:27	Surface	1	26.1	26.1	7.8	7.8	27.5	27.6	100.4	100.6	7.0	7.0	7.0	6.3	6.3	9.5	12.2	13.3	14.0		
						26.1	26.1	7.8	7.8	27.6	27.6	100.7	100.7	7.0	7.0		6.2	6.3		14.4	13.3			
				Middle	4	25.9	25.9	8.0	8.0	28.1	28.2	100.3	100.4	7.0	7.0		8.1	8.2		8.2	8.2		16.5	16.1
						25.9	25.9	8.0	8.0	28.2	28.2	100.5	100.4	7.0	7.0					15.7	16.1			
				Bottom	7	25.8	25.9	8.2	8.2	29.3	29.4	91.1	91.3	6.3	6.3	6.3	14.0	14.1		14.2	12.7			
						25.9	25.9	8.2	8.2	29.4	29.4	91.4	91.3	6.3	6.3		14.2	14.1		11.1	12.7			
7-Dec-15	Sunny	Moderate	15:11	Surface	1	23.1	23.1	8.3	8.3	28.5	27.6	108.1	107.4	7.9	7.9	7.3	5.8	5.9	7.2	14.9	16.3	18.2		
						23.1	23.1	8.3	8.3	26.7	27.6	106.7	107.4	7.8	7.9		6.0	5.9		17.6	16.3			
				Middle	3.5	23.1	23.1	8.1	8.2	28.5	27.7	90.2	89.0	6.6	6.6		6.4	6.7		6.7	6.7		20.3	21.4
						23.1	23.1	8.3	8.3	26.8	27.7	87.8	89.0	6.5	6.6					22.4	21.4			
				Bottom	6	23.1	23.1	8.3	8.3	28.5	27.6	94.8	94.3	6.9	6.9	6.9	8.7	8.9		16.3	17.0			
						23.1	23.1	8.3	8.3	26.7	27.6	93.8	94.3	6.9	6.9	6.9	9.1	8.9		17.7	17.0			
9-Dec-15	Rainy	Moderate	16:30	Surface	1	25.4	25.4	8.2	8.2	26.7	25.9	96.5	94.0	6.8	6.7	6.6	7.6	8.2	8.1	45.4	38.0	31.2		
						25.3	25.4	8.1	8.2	25.0	25.9	91.4	94.0	6.5	6.7		8.8	8.2		30.6	38.0			
				Middle	4	25.3	25.3	8.1	8.1	26.4	26.1	94.9	89.9	6.7	6.4		10.6	10.8		10.8	10.8		26.5	26.2
						25.2	25.3	8.1	8.1	25.8	26.1	84.8	89.9	6.0	6.4					25.8	26.2			
				Bottom	7	25.7	25.7	8.1	8.1	24.6	24.9	92.9	93.3	6.6	6.6	6.6	5.4	5.2		31.0	29.3			
						25.6	25.7	8.1	8.1	25.1	24.9	93.7	93.3	6.6	6.6	6.6	5.0	5.2		27.5	29.3			
11-Dec-15	Fine	Moderate	17:28	Surface	1	21.6	21.6	7.9	7.9	27.5	27.4	99.1	99.0	7.4	7.4	7.3	7.2	7.2	9.8	25.4	24.6	24.7		
						21.6	21.6	7.9	7.9	27.2	27.4	98.8	99.0	7.4	7.4		7.2	7.2		7.2	7.2		23.7	24.6
				Middle	4	21.2	21.2	8.1	8.1	28.5	28.5	95.4	94.9	7.2	7.2		9.8	10.0		10.0	10.0		27.5	26.1
						21.2	21.2	8.1	8.1	28.4	28.5	94.4	94.9	7.1	7.2					24.6	26.1			
				Bottom	7	21.1	21.1	8.2	8.2	29.4	29.4	92.9	93.1	7.0	7.0	7.0	12.0	12.2		23.8	23.3			
						21.1	21.1	8.2	8.2	29.4	29.4	93.2	93.1	7.0	7.0		12.4	12.2		22.8	23.3			
14-Dec-15	Fine	Moderate	08:46	Surface	1	24.9	24.9	7.9	7.9	21.9	22.0	87.4	89.1	6.4	6.5	6.7	4.6	4.5	9.1	18.2	18.2	17.4		
						24.8	24.9	7.9	7.9	22.1	22.0	90.7	89.1	6.6	6.5		4.3	4.5		18.1	18.2			
				Middle	4	22.7	22.8	7.8	7.8	28.7	28.6	93.1	92.4	6.8	6.8		9.1	9.1		9.1	9.1		22.6	21.2
						22.8	22.8	7.8	7.8	28.4	28.6	91.7	92.4	6.7	6.8					19.8	21.2			
				Bottom	7	22.7	22.7	7.8	7.8	29.0	29.1	91.1	89.1	6.7	6.6	6.6	13.7	13.8		13.1	12.7			
						22.6	22.7	7.8	7.8	29.1	29.1	87.1	89.1	6.4	6.6	6.6	13.8	13.8		12.3	12.7			
16-Dec-15	Sunny	Moderate	10:13	Surface	1	20.4	21.1	8.2	8.3	31.8	30.5	90.5	90.9	6.8	6.8	6.6	8.2	8.4	8.0	17.5	17.5	24.0		
						21.7	21.1	8.3	8.3	29.1	30.5	91.2	90.9	6.8	6.8		8.6	8.4		17.4	17.5			
				Middle	3.5	20.4	21.1	8.2	8.3	31.8	30.5	85.6	85.9	6.4	6.4		8.3	8.4		8.4	8.4		25.2	22.9
						21.8	21.1	8.3	8.3	29.1	30.5	86.2	85.9	6.4	6.4					20.6	22.9			
				Bottom	6	21.7	21.8	8.3	8.3	29.1	29.2	103.0	102.7	7.6	7.6	7.6	6.9	7.1		37.6	31.5			
						21.8	21.8	8.3	8.3	29.2	29.2	102.4	102.7	7.6	7.6	7.6	7.2	7.1		25.4	31.5			
18-Dec-15	Sunny	Moderate	11:41	Surface	1	21.9	21.9	7.9	7.9	28.6	28.8	91.8	91.6	6.8	6.8	6.7	6.2	6.2	8.5	21.8	21.5	18.0		
						21.9	21.9	7.9	7.9	29.0	28.8	91.4	91.6	6.8	6.8		6.2	6.2		6.2	6.2		21.1	21.5
				Middle	4	21.7	21.7	8.0	8.1	29.6	29.5	90.8	89.0	6.7	6.6		8.6	8.6		8.6	8.6		14.4	15.2
						21.7	21.7	8.1	8.1	29.4	29.5	87.1	89.0	6.5	6.6					16.0	15.2			
				Bottom	7	21.4	21.4	8.2	8.2	32.1	32.2	85.0	84.7	6.2	6.2	6.2	10.4	10.6		19.3	17.3			
						21.4	21.4	8.2	8.2	32.2	32.2	84.4	84.7	6.2	6.2	6.2	10.7	10.6		15.2	17.3			

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
21-Dec-15	Fine	Moderate	15:21	Surface	1	23.1	23.1	8.2	8.2	25.3	25.0	116.3	114.4	8.6	8.5	8.4	7.5	7.9	9.5	15.8	16.2	12.8		
						23.1		8.2		24.6		112.5		8.4			8.3			10.9	11.2		12.4	11.8
				Middle	4	23.0	23.1	8.2	8.2	26.0	25.9	114.2	110.4	8.4	8.2		7.9	8.2		10.9	11.5		11.2	11.1
				23.2	23.2	8.2	8.2	25.3	25.4	111.8	112.0	8.3	8.3	8.3	8.3	9.4	9.3		12.1	10.3				
				23.2		8.2		25.5		112.2		8.3		8.3		9.1	9.3		8.4	10.3				
23-Dec-15	Fine	Moderate	16:06	Surface	1	20.9	21.1	7.6	7.6	27.3	27.3	83.2	83.9	6.3	6.4	6.3	6.3	6.3	8.2	14.6	16.1	16.7		
						21.2		7.6		27.2		84.5		6.4			6.3			7.7	7.8		14.7	15.2
				Middle	4	20.3	20.3	7.5	7.5	28.5	28.5	81.9	81.1	6.3	6.2		6.1	6.2		7.7	7.8		7.8	15.6
				19.8	19.8	7.6	7.6	29.6	29.6	77.6	77.6	6.0	6.0	6.0	6.0	10.5	10.5		17.7	18.9				
				19.7		7.5		29.6		77.6		6.0		6.0		10.5	10.5		20.0	18.9				
25-Dec-15	Cloudy	Moderate	17:29	Surface	1	23.2	23.2	8.2	8.2	29.5	28.7	106.3	103.9	7.7	7.6	7.4	5.1	5.2	6.5	3.5	3.1	7.4		
						23.2		8.2		27.8		101.4		7.4			5.3			5.7	6.0		7.8	8.8
				Middle	3.5	23.1	23.2	8.1	8.2	29.5	28.7	96.2	98.8	7.0	7.2		7.4	7.2		5.7	6.0		6.2	9.7
				23.3	23.2	8.2	8.2	29.5	28.7	95.8	98.5	6.9	7.2	7.2	7.2	8.0	8.2		8.2	10.3				
				23.1		8.2		27.8		101.1		7.4		7.2		8.4	8.2		12.4	10.3				
28-Dec-15	Fine	Moderate	09:41	Surface	1	20.5	21.2	7.7	7.8	30.8	29.5	103.9	103.9	7.8	7.8	7.8	5.8	6.0	6.2	10.8	10.8	11.2		
						21.8		7.8		28.1		103.8		7.7			6.1	6.2		6.2	10.1		9.7	
				Middle	3.5	20.5	21.2	7.7	7.8	30.8	29.5	103.1	104.0	7.7	7.8		7.8	7.8		6.1	6.2		6.2	10.1
				21.8	21.9	7.8	7.8	28.1	28.1	104.6	104.5	7.8	7.8	7.8	7.8	6.1	6.3		11.9	13.1				
				21.9		7.8		28.1		104.3		7.8		7.8		6.4	6.3		14.2	13.1				
30-Dec-15	Cloudy	Moderate	09:41	Surface	1	21.1	21.2	7.9	7.9	26.7	26.7	89.9	89.2	6.8	6.8	6.5	3.4	3.4	4.8	9.9	9.4	9.6		
						21.2		7.8		26.7		88.5		6.7			3.4	3.4		3.4	8.8		9.4	
				Middle	4	20.3	20.1	7.8	7.9	27.1	27.1	79.9	79.6	6.2	6.2		6.2	6.2		5.7	6.1		6.1	8.9
				19.9		7.9		27.1		79.2		6.2		6.2		6.4	6.1		7.9	8.4				
				19.3	19.4	7.8	7.8	27.7	27.7	69.4	69.8	5.4	5.5	5.5	5.5	4.7	5.0		12.3	11.1				
				19.5		7.8		27.7		70.1		5.5		5.5		5.3	5.0		9.8	11.1				

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
2-Dec-15	Fine	Moderate	17:52	Surface	1	26.0 26.1	26.1	7.9 7.9	7.9	25.2 25.5	25.4	116.1 115.7	115.9	8.2 8.1	8.2	8.0	4.8 5.3	5.1	8.3	11.4 14.0	12.7	13.7
				Middle	6.5	23.9 23.8	23.9	8.0 8.0	8.0	24.9 25.2	25.1	104.7 105.2	105.0	7.7 7.7	7.7		8.4 9.1	8.8		16.1 14.3	15.2	
				Bottom	12	22.7 22.8	22.8	8.0 8.0	8.0	24.6 24.7	24.7	101.5 102.3	101.9	7.6 7.6	7.6		10.6 11.2	10.9		14.9 11.7	13.3	
4-Dec-15	Fine	Moderate	20:16	Surface	1	26.0 26.0	26.0	7.6 7.6	7.6	27.9 27.8	27.9	100.2 101.8	101.0	7.0 7.1	7.1	7.0	5.9 6.1	6.0	10.0	14.1 15.7	14.9	14.1
				Middle	6.5	25.9 25.9	25.9	7.8 7.9	7.9	28.4 28.3	28.4	99.2 97.8	98.5	6.9 6.8	6.9		10.5 10.7	10.6		11.8 11.6	11.7	
				Bottom	12	25.9 25.8	25.9	8.0 8.0	8.0	29.6 29.7	29.7	96.5 96.2	96.4	6.7 6.7	6.7		13.5 13.3	13.4		17.5 13.6	15.6	
7-Dec-15	Sunny	Moderate	09:34	Surface	1	21.1 21.1	21.1	8.1 8.1	8.1	26.9 27.0	27.0	91.7 90.9	91.3	7.0 6.9	7.0	6.9	7.9 6.8	7.4	7.5	15.5 17.5	16.5	17.8
				Middle	6	21.1 21.1	21.1	8.1 8.1	8.1	29.4 29.3	29.4	90.4 90.2	90.3	6.8 6.8	6.8		8.4 8.6	8.5		19.4 19.5	19.5	
				Bottom	11	21.0 21.0	21.0	8.1 8.1	8.1	30.3 30.3	30.3	90.1 90.0	90.1	6.7 6.7	6.7		6.8 6.5	6.7		15.8 19.0	17.4	
9-Dec-15	Rainy	Moderate	12:06	Surface	1	24.3 24.7	24.5	8.2 8.1	8.2	23.8 22.3	23.1	88.9 79.6	84.3	6.5 5.8	6.2	6.3	4.9 4.8	4.9	8.2	13.6 13.0	13.3	16.0
				Middle	6	24.2 24.0	24.1	8.1 8.1	8.1	24.0 24.3	24.2	89.5 80.4	85.0	6.6 5.9	6.3		8.6 9.1	8.9		17.5 22.4	20.0	
				Bottom	11	24.7 23.9	24.3	8.2 8.2	8.2	22.3 24.3	23.3	81.1 79.8	80.5	5.9 5.9	5.9		10.4 11.0	10.7		14.5 14.8	14.7	
11-Dec-15	Sunny	Moderate	13:07	Surface	1	21.6 21.6	21.6	8.1 8.1	8.1	29.0 29.0	29.0	99.9 99.8	99.9	7.4 7.4	7.4	7.4	8.9 8.5	8.7	11.8	17.0 18.7	17.9	20.2
				Middle	6.5	21.5 21.5	21.5	8.1 8.1	8.1	29.0 29.0	29.0	98.6 98.2	98.4	7.4 7.3	7.4		12.1 11.2	11.7		26.2 22.9	24.6	
				Bottom	12	21.5 21.5	21.5	8.1 8.1	8.1	29.3 29.4	29.4	97.3 96.8	97.1	7.2 7.2	7.2		14.9 15.2	15.1		18.0 18.1	18.1	
14-Dec-15	Fine	Moderate	14:26	Surface	1	23.2 22.7	23.0	7.9 7.8	7.9	32.6 31.4	32.0	93.5 94.2	93.9	6.6 6.8	6.7	6.7	11.4 9.6	10.5	9.5	16.0 17.1	16.6	18.3
				Middle	6	23.0 23.1	23.1	8.0 7.9	8.0	31.4 29.4	30.4	93.0 92.4	92.7	6.7 6.7	6.7		10.3 9.8	10.1		20.7 18.6	19.7	
				Bottom	11	23.1 22.7	22.9	7.9 7.9	7.9	32.5 30.4	31.5	95.0 91.7	93.4	6.7 6.6	6.7		7.4 8.1	7.8		20.2 16.8	18.5	
16-Dec-15	Sunny	Moderate	15:59	Surface	1	22.8 21.1	22.0	8.1 8.1	8.1	29.5 29.7	29.6	101.8 96.4	99.1	7.4 7.2	7.3	7.2	11.4 9.7	10.6	9.5	16.8 21.5	19.2	23.2
				Middle	5	21.5 21.1	21.3	8.1 8.1	8.1	29.7 32.6	31.2	97.8 92.6	95.2	7.3 6.8	7.1		10.3 9.9	10.1		27.2 22.0	24.6	
				Bottom	9	23.0 21.3	22.2	8.0 8.1	8.1	31.8 31.0	31.4	96.2 92.1	94.2	6.9 6.8	6.9		7.3 8.1	7.7		27.7 24.1	25.9	
18-Dec-15	Fine	Moderate	18:42	Surface	1	21.4 21.7	21.6	8.1 8.2	8.2	29.0 31.9	30.5	86.4 88.2	87.3	6.5 6.4	6.5	6.6	11.4 9.6	10.5	9.5	19.6 17.2	18.4	17.4
				Middle	6	21.6 21.6	21.6	8.1 8.1	8.1	31.8 31.4	31.6	88.7 93.7	91.2	6.5 6.9	6.7		10.3 9.8	10.1		22.8 15.8	19.3	
				Bottom	11	21.4 21.5	21.5	8.2 8.1	8.2	30.9 31.9	31.4	90.6 92.7	91.7	6.7 6.8	6.8		7.4 8.1	7.8		13.0 16.0	14.5	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
21-Dec-15	Fine	Moderate	09:01	Surface	1	22.6	22.6	8.2	8.2	21.8	23.1	100.9	99.5	8.6	8.5	8.4	8.0	7.9	9.7	21.8	21.3	19.4
						22.6	22.6	8.2	8.2	24.4	23.2	98.1	95.7	8.3	8.2		7.8	10.6		20.8	21.4	
				Middle	6	22.6	22.6	8.2	8.2	23.1	23.2	98.9	92.5	8.4	7.9		10.0	11.2		10.6	18.5	
				Bottom	11	22.4	22.4	8.2	8.2	24.4	23.7	96.9	97.0	8.2	8.2	8.2	10.7	10.7	17.7	15.6		
						22.4	22.4	8.2	8.2	22.9	23.7	97.1	97.0	8.2	8.2	8.2	10.6	10.7	13.5	15.6		
23-Dec-15	Fine	Moderate	10:48	Surface	1	21.5	20.9	7.6	7.6	29.6	29.7	90.3	86.4	6.7	6.5	6.4	8.3	8.4	7.2	19.7	18.9	21.7
						20.3	20.9	7.6	7.6	29.8	29.7	82.5	86.3	6.3	6.5		8.4	7.7		18.1	24.2	
				Middle	6	20.7	21.0	7.4	7.4	29.7	29.9	86.3	81.9	6.5	6.1		6.3	7.5		7.7	26.2	
						21.3	21.0	7.4	7.4	30.0	29.9	81.9	84.1	6.1	6.3	6.3	7.8	7.7	22.1	21.9		
				Bottom	11	20.9	20.6	7.6	7.6	29.5	29.8	88.3	89.1	6.6	6.7	6.7	5.5	5.6	21.7	21.9		
						20.2	20.6	7.5	7.6	30.1	29.8	89.9	89.1	6.8	6.7	6.7	5.6	5.6	22.1	21.9		
25-Dec-15	Cloudy	Moderate	12:34	Surface	1	21.2	21.2	8.2	8.2	29.1	29.2	86.9	87.0	6.5	6.5	6.5	4.3	4.2	3.7	12.7	16.3	10.7
						21.2	21.2	8.2	8.2	29.2	29.2	87.0	87.0	6.5	6.5		4.1	4.2		19.8	6.6	
				Middle	6	21.2	21.2	8.2	8.2	28.8	28.8	87.1	87.0	6.5	6.5		6.5	3.4		3.4	4.8	
						21.2	21.2	8.2	8.2	28.7	28.8	87.0	87.1	6.5	6.5	6.5	3.4	3.4	8.3	6.6		
				Bottom	11	21.2	21.2	8.2	8.2	29.3	29.3	86.8	86.8	6.5	6.5	6.5	3.8	3.6	8.1	9.1		
						21.2	21.2	8.2	8.2	29.3	29.3	86.8	86.8	6.5	6.5	6.5	3.4	3.6	10.1	9.1		
28-Dec-15	Fine	Moderate	14:55	Surface	1	21.9	21.9	7.7	7.7	29.8	29.9	97.9	97.3	7.2	7.2	7.0	4.4	4.3	8.8	9.1	10.0	9.4
						21.9	21.9	7.7	7.7	29.9	29.9	96.6	97.3	7.1	7.2		4.2	4.3		10.8	10.0	
				Middle	6	21.9	21.9	7.7	7.7	30.2	30.3	92.3	92.8	6.8	6.8		6.8	8.0		8.0	7.5	
						21.9	21.9	7.7	7.7	30.3	30.3	93.2	92.8	6.8	6.8	6.8	7.9	8.0	11.0	9.3		
				Bottom	11	22.0	22.0	7.8	7.9	31.9	32.0	93.9	93.4	6.8	6.8	6.8	13.9	14.0	10.1	8.9		
						22.0	22.0	7.9	7.9	32.1	32.0	92.9	93.4	6.7	6.8	6.8	14.1	14.0	7.7	8.9		
30-Dec-15	Cloudy	Moderate	15:40	Surface	1	20.4	20.0	7.8	7.8	27.1	26.7	83.5	75.7	6.4	5.9	6.2	4.9	5.0	8.3	10.4	9.0	9.2
						19.6	20.0	7.8	7.8	26.2	26.7	67.8	75.7	5.3	5.9		5.0	5.0		7.6	9.0	
				Middle	6.5	19.8	19.7	7.8	7.8	27.6	27.4	89.2	83.2	6.9	6.5		6.5	9.4		9.3	11.5	
						19.5	19.7	7.7	7.8	27.2	27.4	77.1	83.2	6.0	6.5	6.5	9.1	9.3	10.5	11.0		
				Bottom	12	20.3	20.3	7.9	7.8	26.4	25.9	67.5	68.2	5.2	5.3	5.3	10.7	10.7	6.1	7.5		
						20.2	20.3	7.7	7.8	25.3	25.9	68.8	68.2	5.4	5.3	5.3	10.7	10.7	8.8	7.5		

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
2-Dec-15	Fine	Moderate	12:05	Surface	1	25.4 25.3	25.4	7.8 7.8	7.8	25.3 25.5	25.4	103.4 102.6	103.0	7.4 7.3	7.4	7.1	5.5 5.9	5.7	8.1	11.8 15.2	12.3	12.9	
				Middle	6	24.1 24.1	24.1	7.8 7.8	7.8	24.9 25.2	25.1	92.3 92.8	92.6	6.7 6.8	6.8		7.8 7.9			7.9			10.4 10.5
				Bottom	11	23.6 23.5	23.6	7.8 7.8	7.8	24.7 24.7	24.7	83.6 84.2	83.9	6.2 6.2	6.2		10.4 10.9			10.7			10.7 15.1
4-Dec-15	Fine	Moderate	14:05	Surface	1	25.9 25.9	25.9	7.6 7.6	7.6	28.0 28.1	28.1	100.4 99.4	99.9	7.1 7.0	7.1	7.0	7.9 7.9	7.9	10.2	13.1 13.2	15.6	14.4	
				Middle	6	25.9 25.9	25.9	7.8 7.9	7.9	29.1 28.2	28.7	99.4 97.7	98.6	6.9 6.9	6.9		9.1 9.2			9.2			18.7 12.5
				Bottom	11	25.9 25.9	25.9	7.9 8.0	8.0	29.8 29.8	29.8	94.0 94.6	94.3	6.7 6.7	6.7		13.3 13.4			13.4			16.4 12.4
7-Dec-15	Sunny	Moderate	14:47	Surface	1	23.6 23.6	23.6	8.1 8.1	8.1	27.7 27.7	27.7	106.5 106.2	106.4	7.7 7.7	7.7	7.7	5.0 5.1	5.1	5.7	21.0 18.9	20.0	17.3	
				Middle	5.5	23.6 23.6	23.6	8.1 8.1	8.1	29.5 29.5	29.5	106.2 106.2	106.2	7.6 7.6	7.6		6.8 7.0			6.9			15.6 19.9
				Bottom	10	23.6 23.6	23.6	8.1 8.1	8.1	31.1 31.1	31.1	106.0 105.9	106.0	7.5 7.5	7.5		5.2 5.1			5.2			12.2 15.7
9-Dec-15	Rainy	Moderate	17:49	Surface	1	25.6 25.6	25.6	8.1 8.1	8.1	24.6 25.1	24.9	88.4 89.2	88.8	6.3 6.3	6.3	6.3	5.2 5.1	5.2	8.1	12.0 11.2	11.6	14.3	
				Middle	5.5	25.3 25.3	25.3	8.1 8.1	8.1	25.0 25.6	25.3	86.9 85.7	86.3	6.2 6.1	6.2		8.6 7.4			8.0			18.2 13.9
				Bottom	10	25.2 25.2	25.2	8.1 8.1	8.1	25.8 27.5	26.7	80.3 79.8	80.1	5.7 5.6	5.7		10.7 11.4			11.1			15.7 14.4
11-Dec-15	Fine	Moderate	17:01	Surface	1	21.6 21.6	21.6	8.1 8.1	8.1	28.9 28.9	28.9	93.4 93.0	93.2	7.0 6.9	7.0	7.0	10.3 11.0	10.7	12.1	30.4 26.6	28.5	23.7	
				Middle	6.5	21.6 21.5	21.6	8.1 8.1	8.1	28.9 28.9	28.9	92.6 92.3	92.5	6.9 6.9	6.9		12.0 12.3			12.2			21.6 23.2
				Bottom	12	21.6 21.5	21.6	8.1 8.1	8.1	28.9 28.9	28.9	92.1 91.9	92.0	6.9 6.9	6.9		13.6 13.4			13.5			18.6 21.9
14-Dec-15	Fine	Moderate	09:15	Surface	1	23.2 22.9	23.1	8.0 7.9	8.0	31.3 32.4	31.9	94.9 92.6	93.8	6.8 6.6	6.7	6.8	9.1 7.4	8.3	7.2	14.0 13.6	13.8	19.1	
				Middle	6	23.0 22.7	22.9	7.9 8.0	8.0	30.2 30.8	30.5	93.4 94.0	93.7	6.7 6.8	6.8		8.1 7.5			7.8			26.2 20.1
				Bottom	11	22.9 23.0	23.0	7.9 7.9	7.9	29.3 31.9	30.6	90.7 94.6	92.7	6.6 6.8	6.7		5.3 5.9			5.6			18.9 21.6
16-Dec-15	Sunny	Moderate	10:31	Surface	1	21.4 21.8	21.6	8.1 8.1	8.1	29.3 31.8	30.6	99.1 96.8	98.0	7.4 7.1	7.3	7.4	9.1 7.3	8.2	7.2	37.4 25.2	31.3	27.2	
				Middle	5	22.0 22.5	22.3	8.0 8.2	8.1	29.5 29.0	29.3	101.0 99.8	100.4	7.4 7.3	7.4		8.0 7.6			7.8			22.4 23.9
				Bottom	9	21.8 22.2	22.0	8.2 8.0	8.1	32.7 30.6	31.7	101.6 97.1	99.4	7.4 7.1	7.3		5.3 5.9			5.6			26.2 28.0
18-Dec-15	Sunny	Moderate	12:26	Surface	1	21.8 21.6	21.7	8.2 8.2	8.2	31.6 32.2	31.9	88.0 90.8	89.4	6.4 6.6	6.5	6.5	9.1 7.4	8.3	7.2	21.2 15.1	18.2	20.7	
				Middle	6	21.7 21.4	21.6	8.2 8.2	8.2	31.2 31.7	31.5	88.7 87.1	87.9	6.5 6.4	6.5		8.1 7.5			7.8			18.6 23.5
				Bottom	11	21.4 21.3	21.4	8.2 8.2	8.2	29.6 30.1	29.9	87.4 84.8	86.1	6.5 6.3	6.4		5.3 5.9			5.6			19.5 26.3

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.


Water Quality Monitoring Results at ST3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
21-Dec-15	Fine	Moderate	15:26	Surface	1	23.0	23.0	8.2	8.2	23.5	23.4	85.1	80.6	7.2	6.9	6.7	7.4	7.4	11.2	16.8	19.6	16.1		
						23.0		8.2		23.3		76.0		6.5			7.3			12.7	12.8		13.9	13.0
				Middle	5.5	23.0	23.0	8.2	8.2	26.0	26.2	80.6	76.3	6.8	6.5		6.1	6.5		12.9	12.9		12.1	12.1
				Bottom	10	23.0	23.0	8.2	8.2	26.9	27.2	78.1	76.8	6.6	6.5	6.5	14.1	13.4		13.3	15.8			
						23.0		8.2		27.4		75.4		6.4	6.5	6.5	12.6	13.4		18.2	15.8			
23-Dec-15	Fine	Moderate	16:24	Surface	1	20.1	20.7	7.7	7.7	30.9	31.0	88.0	90.3	6.7	6.8	6.7	10.2	10.2	8.8	16.1	17.8	19.0		
						21.3		7.6		31.0		92.5		6.8			10.1			9.7	10.1		14.8	18.5
				Middle	6.5	21.4	21.5	7.6	7.6	30.3	30.5	88.2	87.2	6.5	6.5		6.4	6.5		8.9	9.3		8.9	8.9
						21.5		7.6		30.7		86.1		6.4		6.7			21.2					
				Bottom	12	21.4	21.0	7.4	7.4	29.3	29.7	85.4	85.0	6.4	6.4	6.4	6.7	6.9		21.2	20.6			
						20.6		7.4		30.0		84.5		6.4	6.4	6.4	7.0	6.9		19.9	20.6			
25-Dec-15	Cloudy	Moderate	16:53	Surface	1	21.4	21.4	8.2	8.2	29.7	29.7	115.5	114.9	8.6	8.6	8.4	2.9	2.9	3.9	7.0	7.4	8.3		
						21.4		8.2		29.7		114.3		8.5			2.9			3.8	3.8		8.0	8.1
				Middle	6	21.3	21.3	8.2	8.2	30.4	30.4	110.3	109.9	8.2	8.2		8.1	8.2		3.8	3.8		8.1	8.1
						21.3		8.2		30.4		109.5		8.1		5.0			8.7	9.3				
				Bottom	11	21.2	21.2	8.2	8.2	31.0	31.0	103.4	103.4	7.7	7.7	7.7	5.0	5.0		9.8	9.3			
						21.2		8.2		31.0		103.4		7.7		5.0			9.8	9.3				
28-Dec-15	Fine	Moderate	09:30	Surface	1	21.8	21.9	7.8	7.8	29.3	29.3	96.5	96.1	7.1	7.1	7.0	5.9	5.9	8.8	11.3	11.5	10.9		
						21.9		7.8		29.3		95.7		7.1			5.8			7.3	7.4		9.4	10.8
				Middle	6	22.0	22.0	7.9	7.9	30.1	30.2	93.4	94.0	6.9	6.9		6.9	6.9		7.4	7.4		10.2	10.5
						21.9		7.9		30.3		94.5		6.9		13.0			10.2					
				Bottom	11	22.1	22.1	7.9	7.9	32.0	32.0	93.5	92.6	6.8	6.7	6.7	13.0	13.2		10.2	10.5			
						22.1		7.9		32.0		91.6		6.6		13.3			10.8	10.8				
30-Dec-15	Cloudy	Moderate	10:12	Surface	1	19.9	20.1	7.9	7.9	27.8	26.7	88.4	86.5	6.8	6.7	6.7	5.0	5.1	7.4	10.1	8.7	9.7		
						20.3		7.9		25.6		84.5		6.6			5.2			6.8	7.0		12.2	10.8
				Middle	6	20.1	20.1	7.7	7.7	27.1	26.6	88.1	86.2	6.8	6.7		6.6	6.7		7.2	7.0		9.3	10.8
						20.0		7.7		26.0		84.2		6.6		10.2			7.7	9.6				
				Bottom	11	20.6	20.4	7.8	7.8	25.6	26.5	73.2	71.1	5.7	5.5	5.5	10.2	10.1		7.7	9.6			
						20.2		7.8		27.3		68.9		5.3		9.9	10.1		11.4	9.6				

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

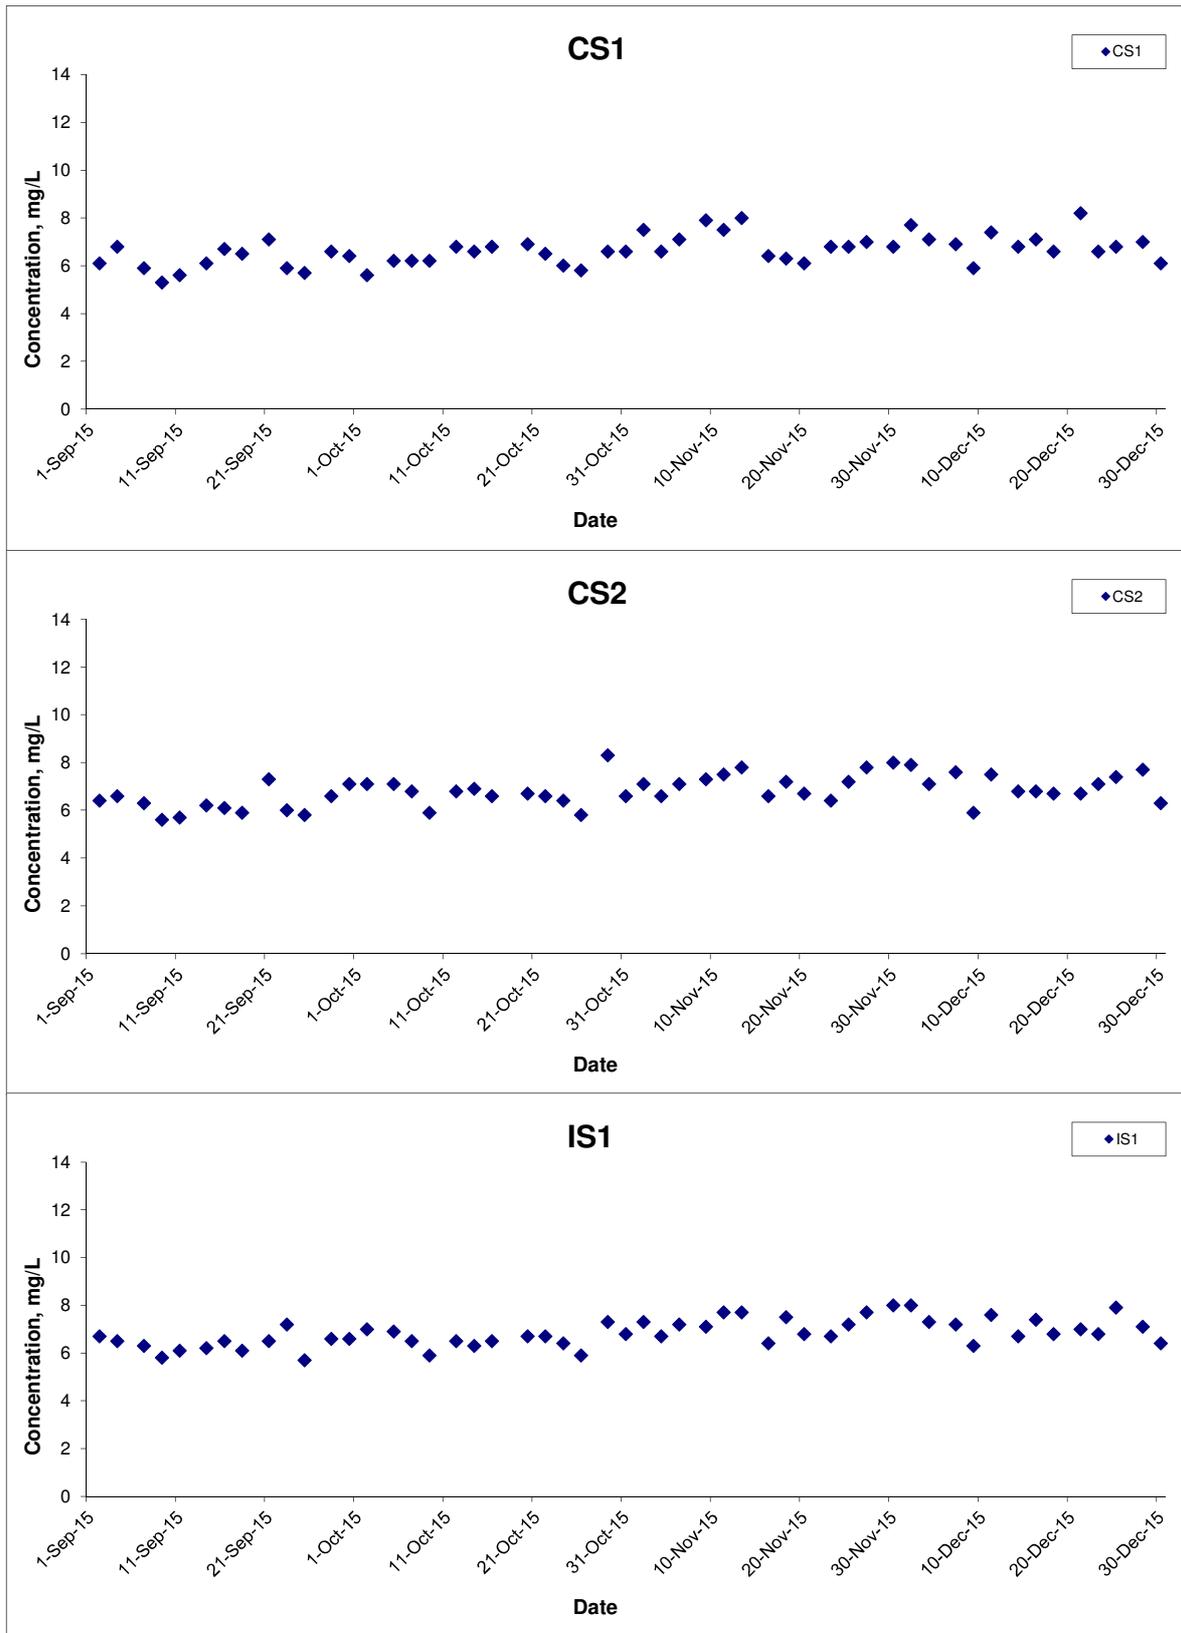


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

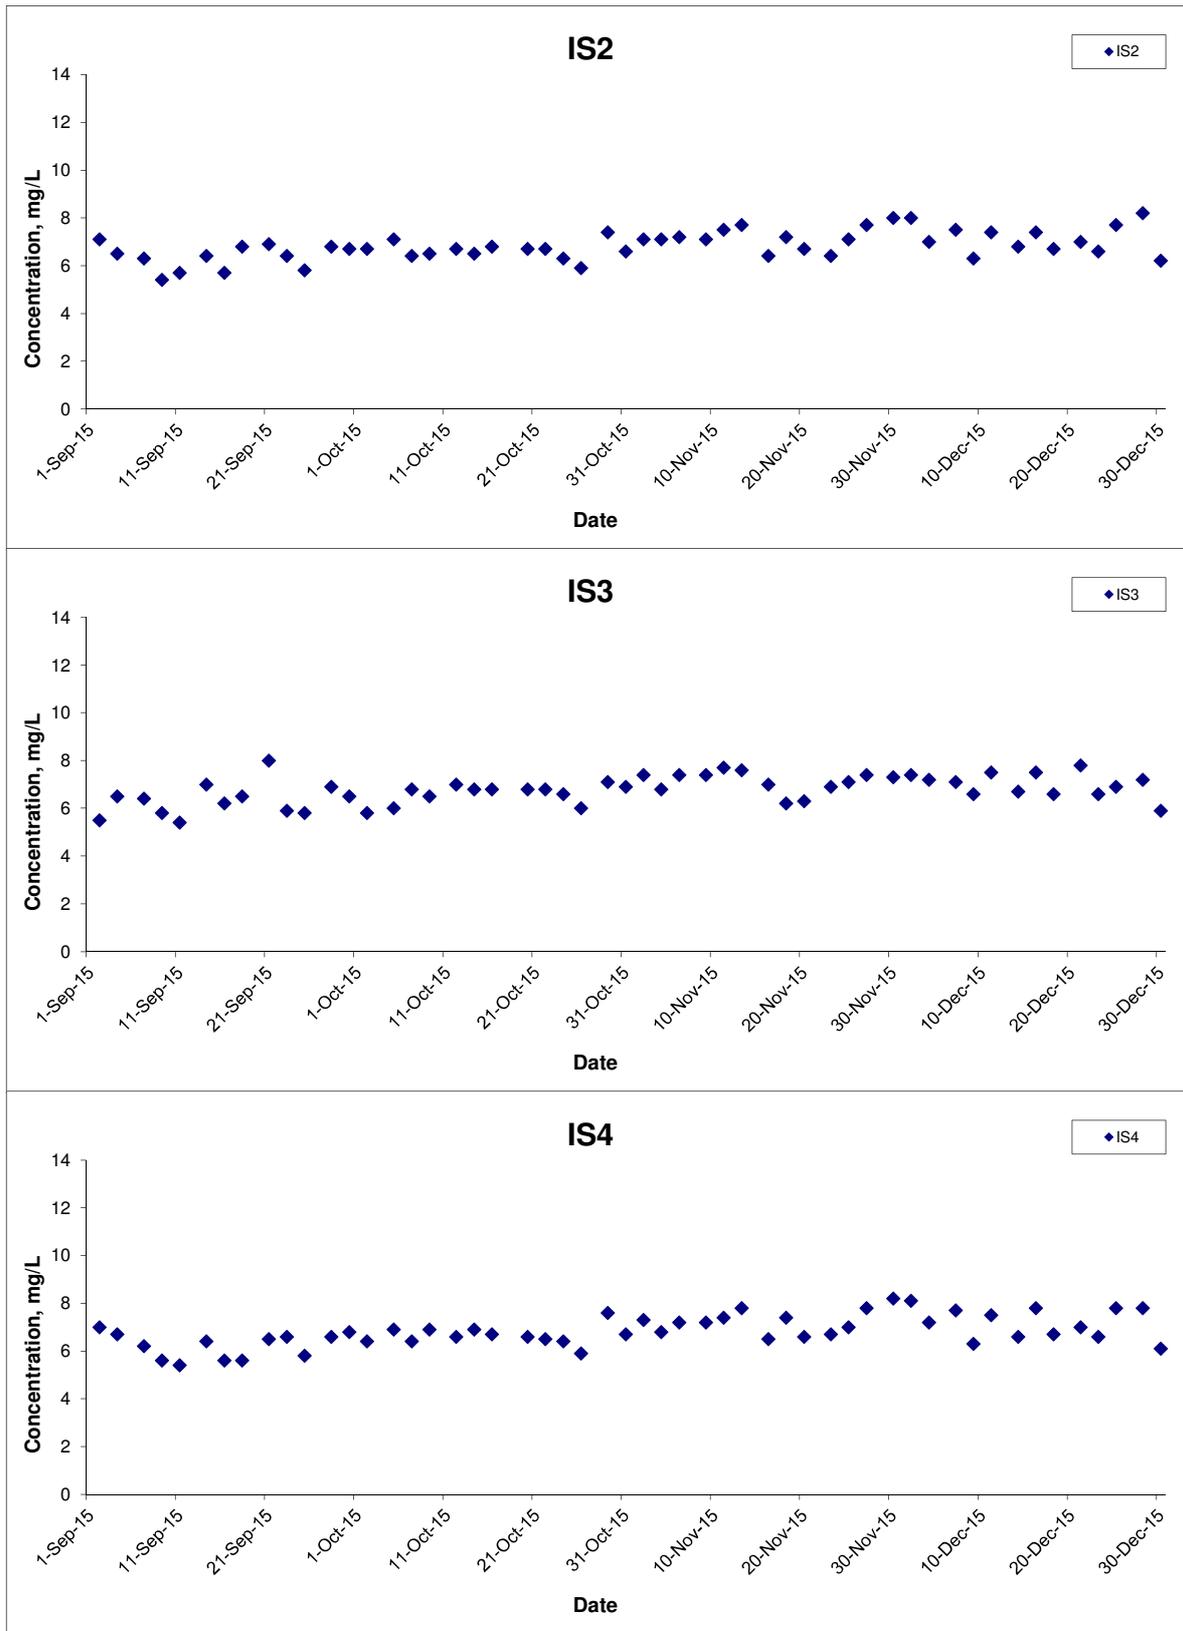


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

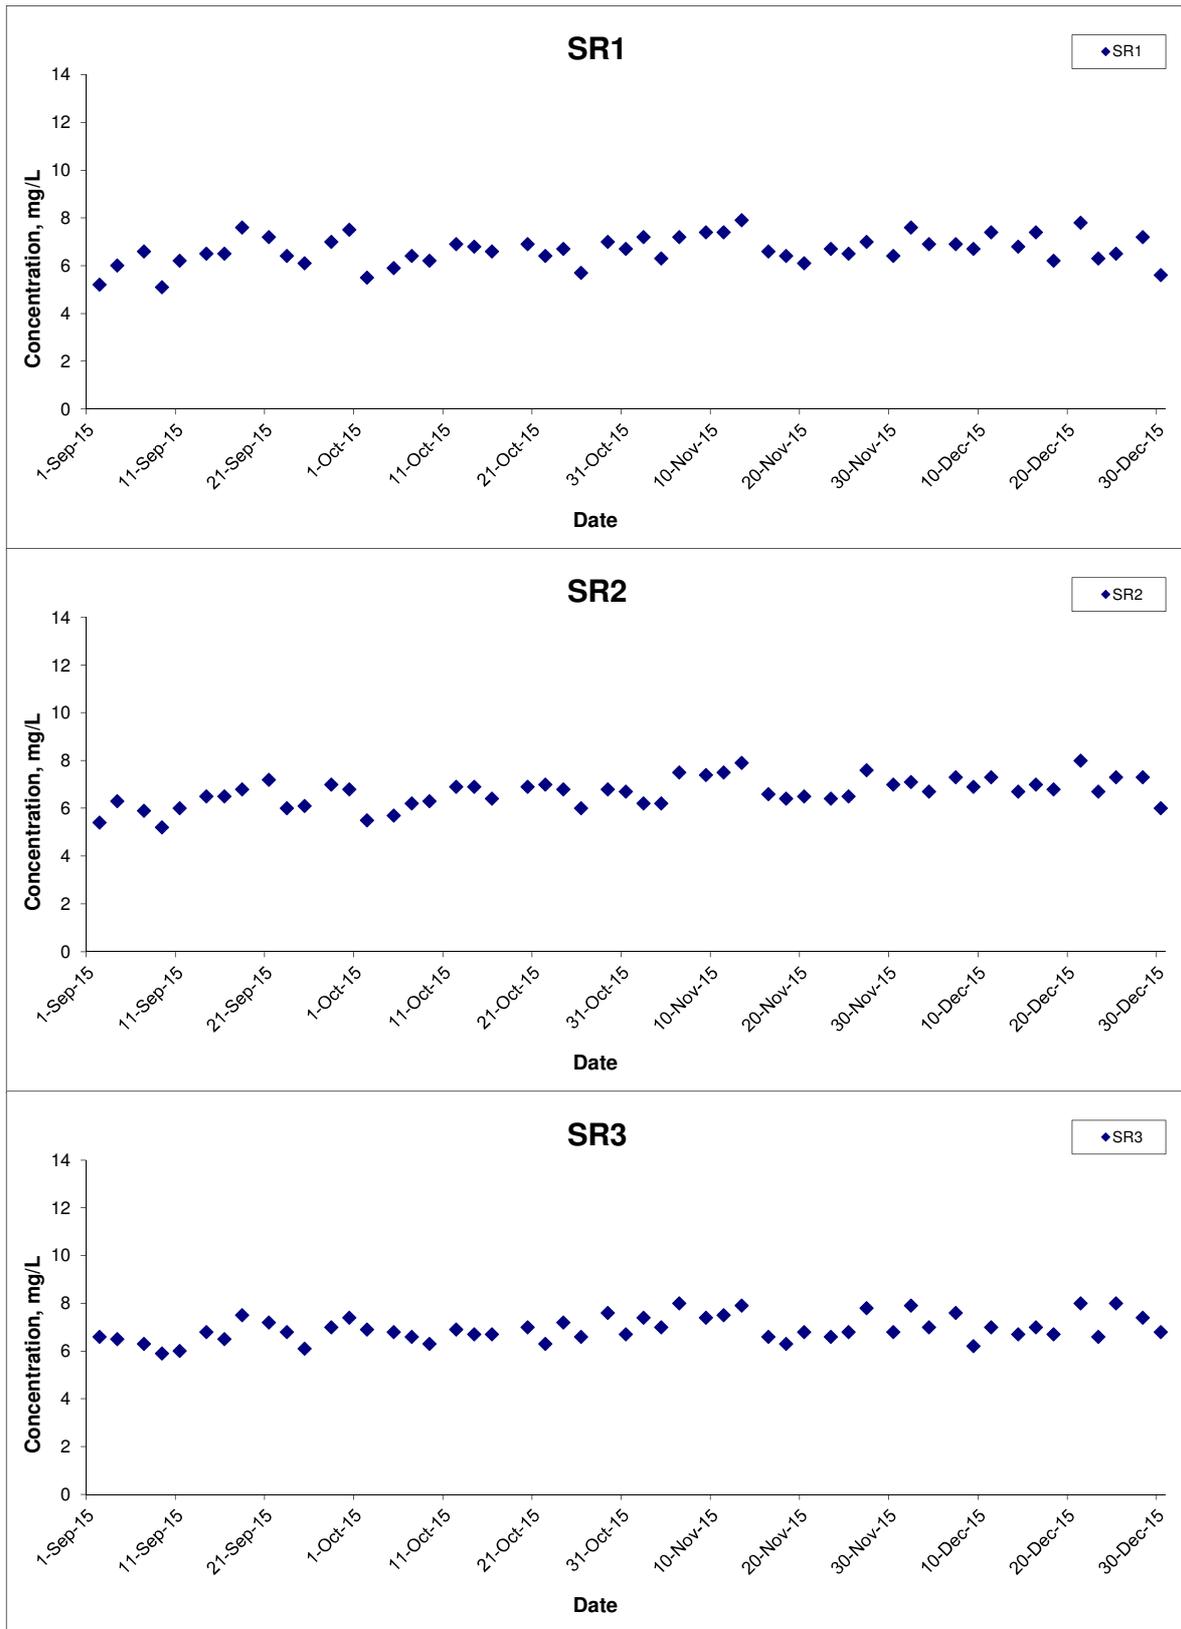


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

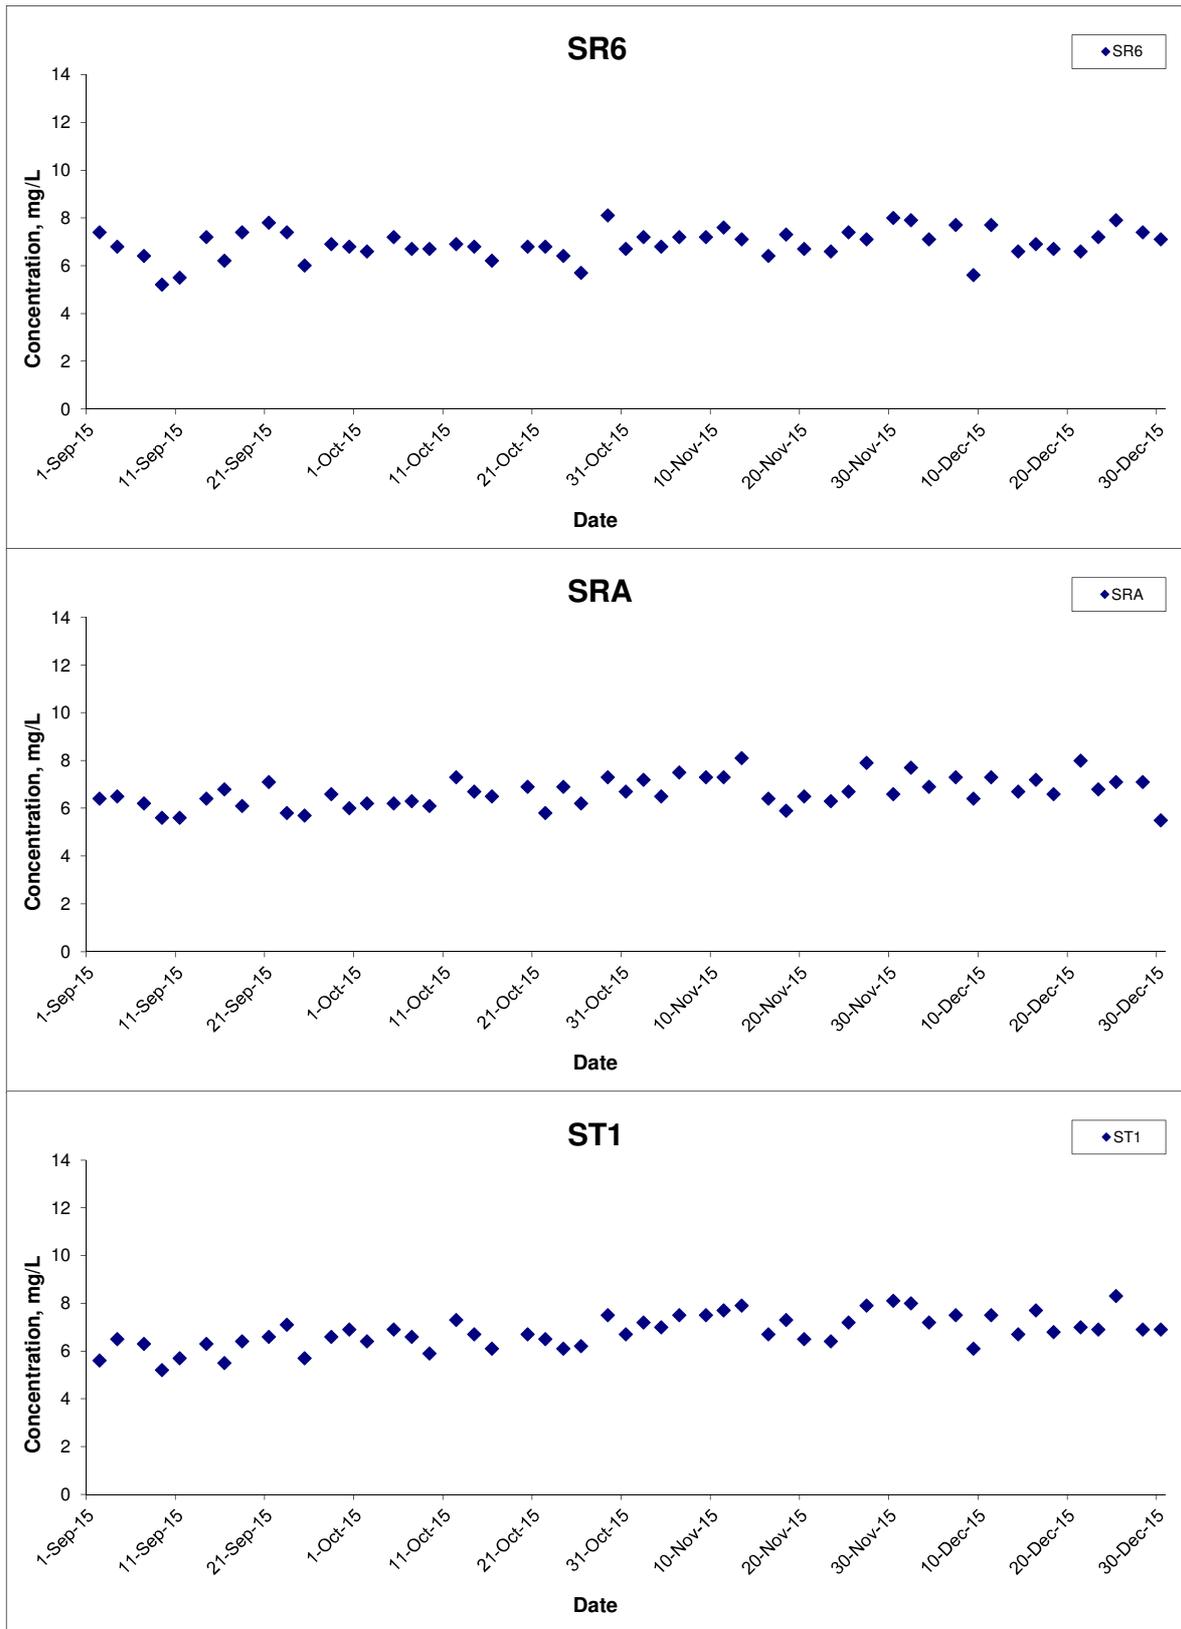


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H




Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

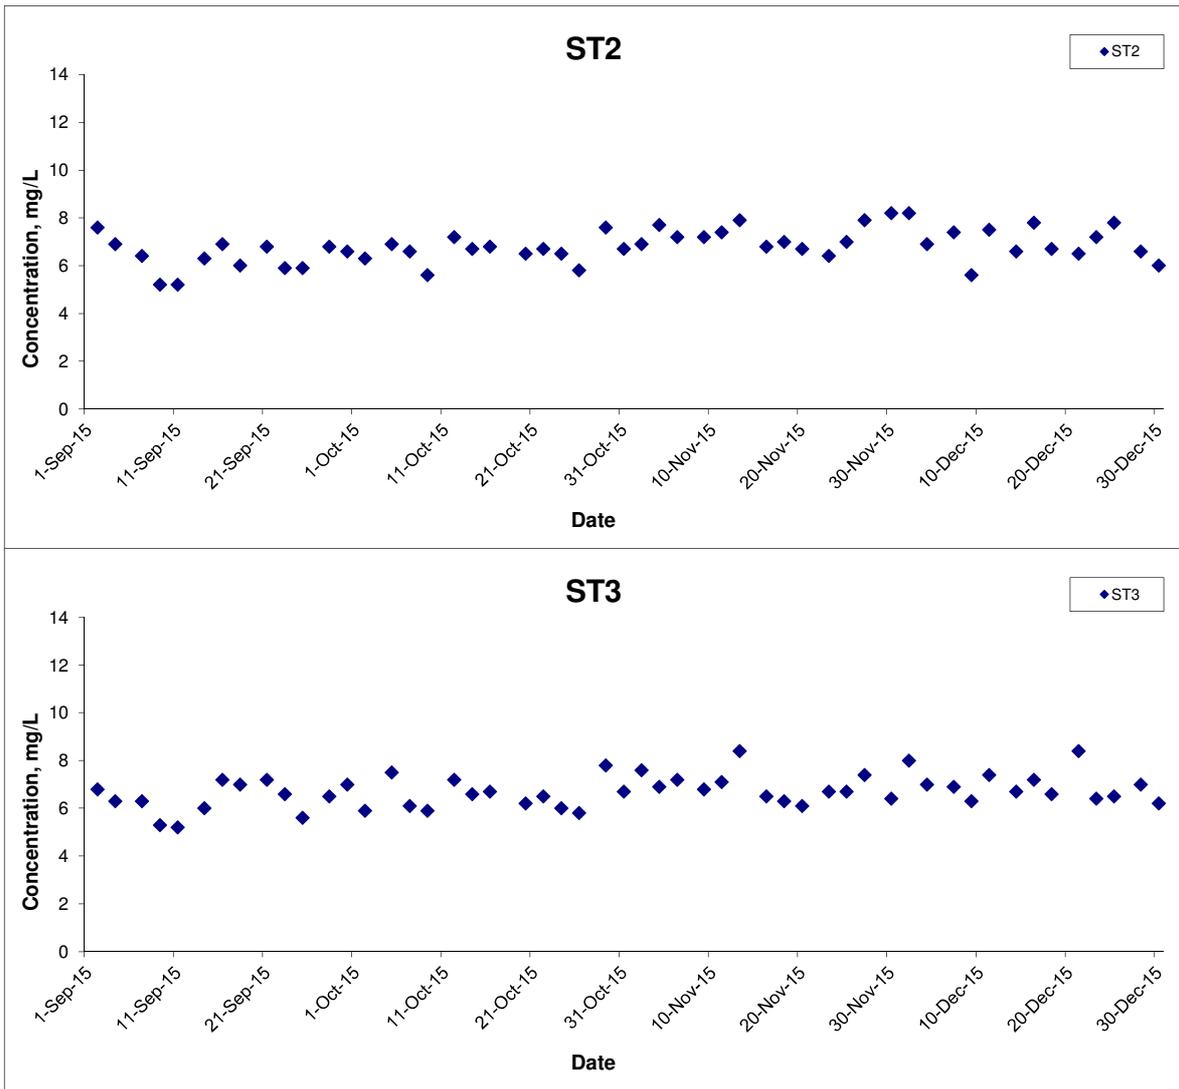

Title	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill	Scale	N.T.S	Project No.	MA12014	CINOTECH
	Graphical Presentation of Water Quality Monitoring Results	Date	Dec 15	Appendix	H	

Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

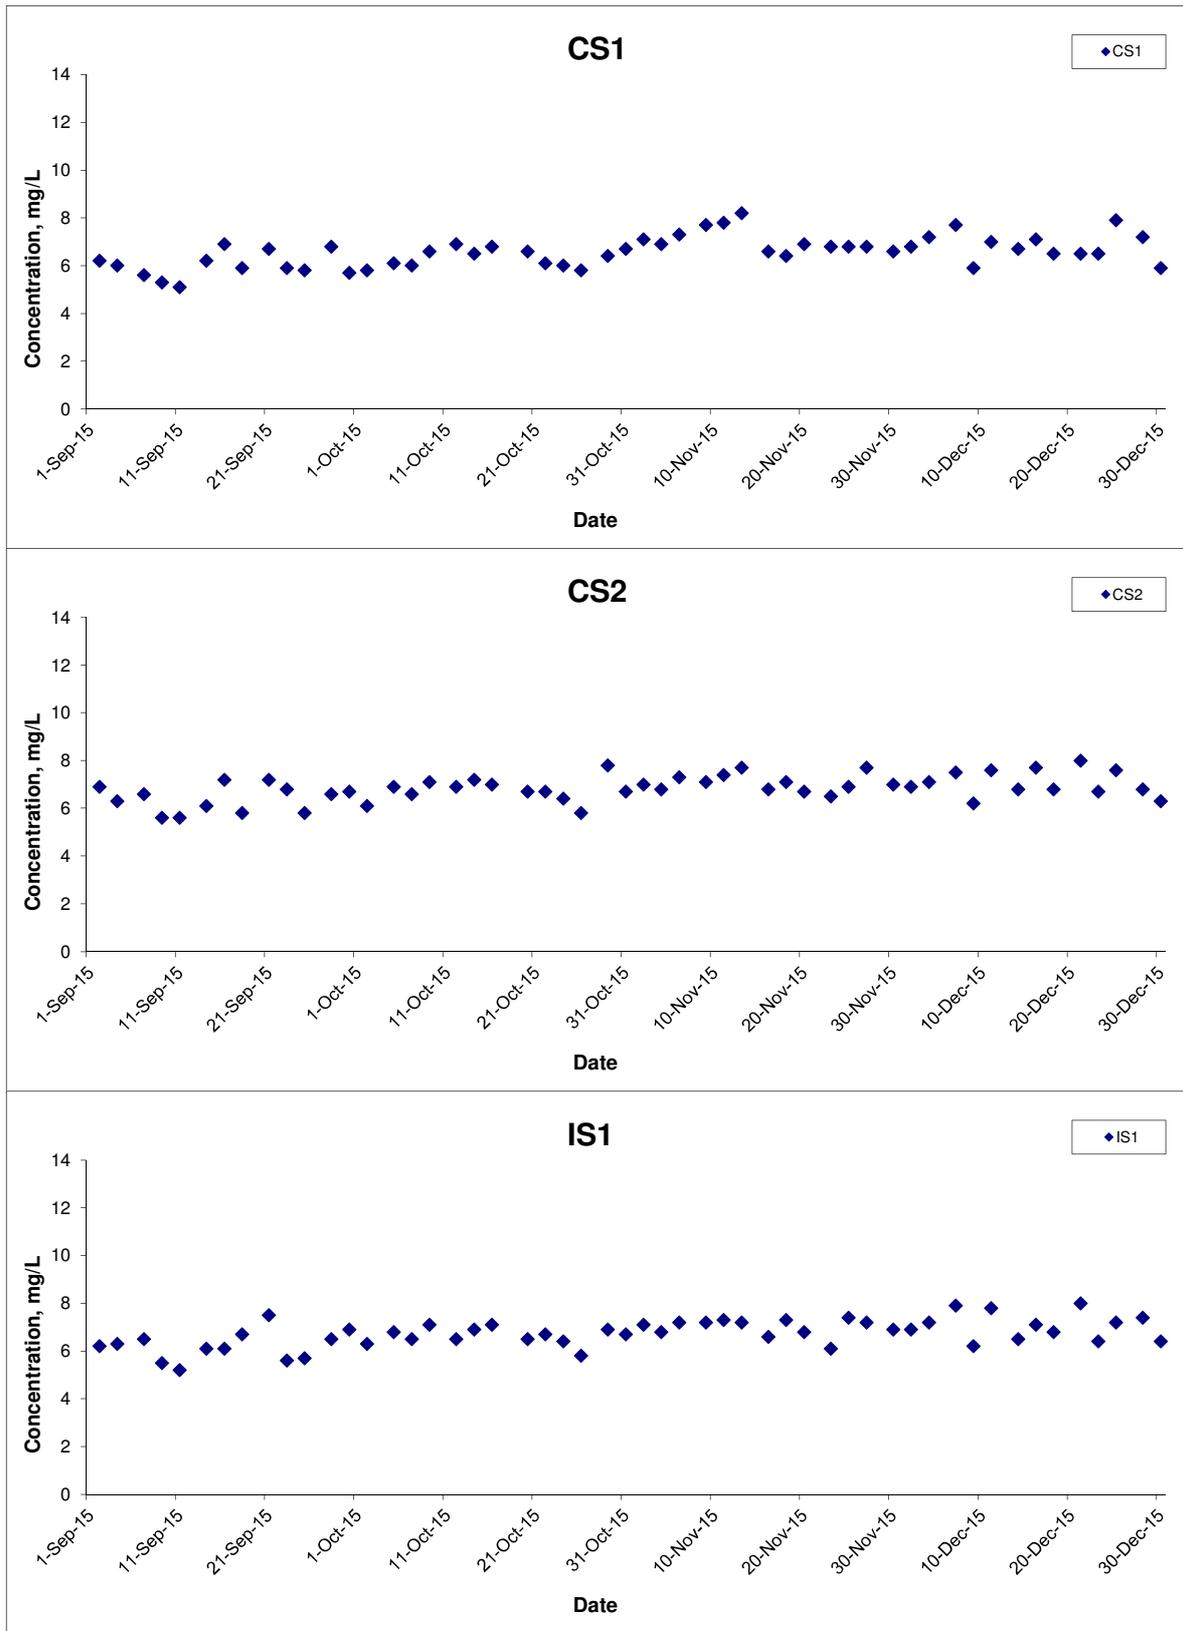


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H




Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

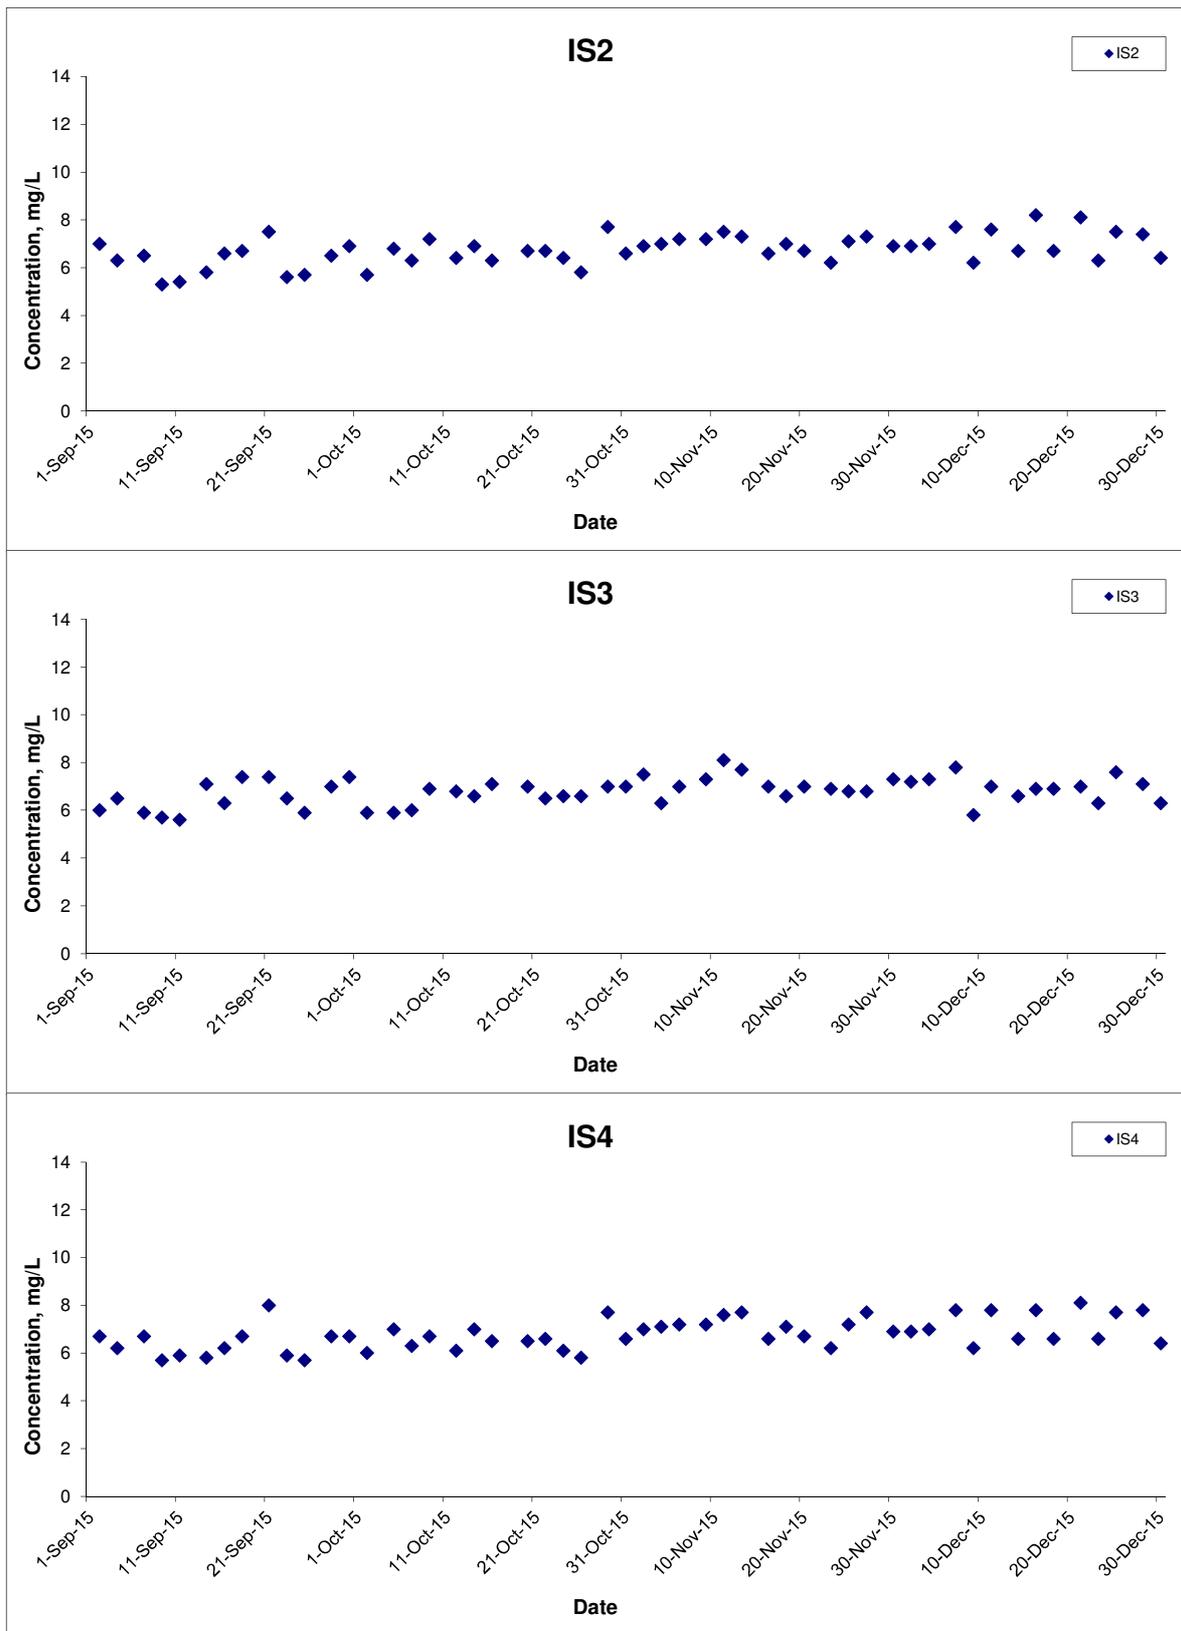

Title	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill	Scale	N.T.S	Project No.	MA12014	CINOTECH
	Graphical Presentation of Water Quality Monitoring Results	Date	Dec 15	Appendix	H	

Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

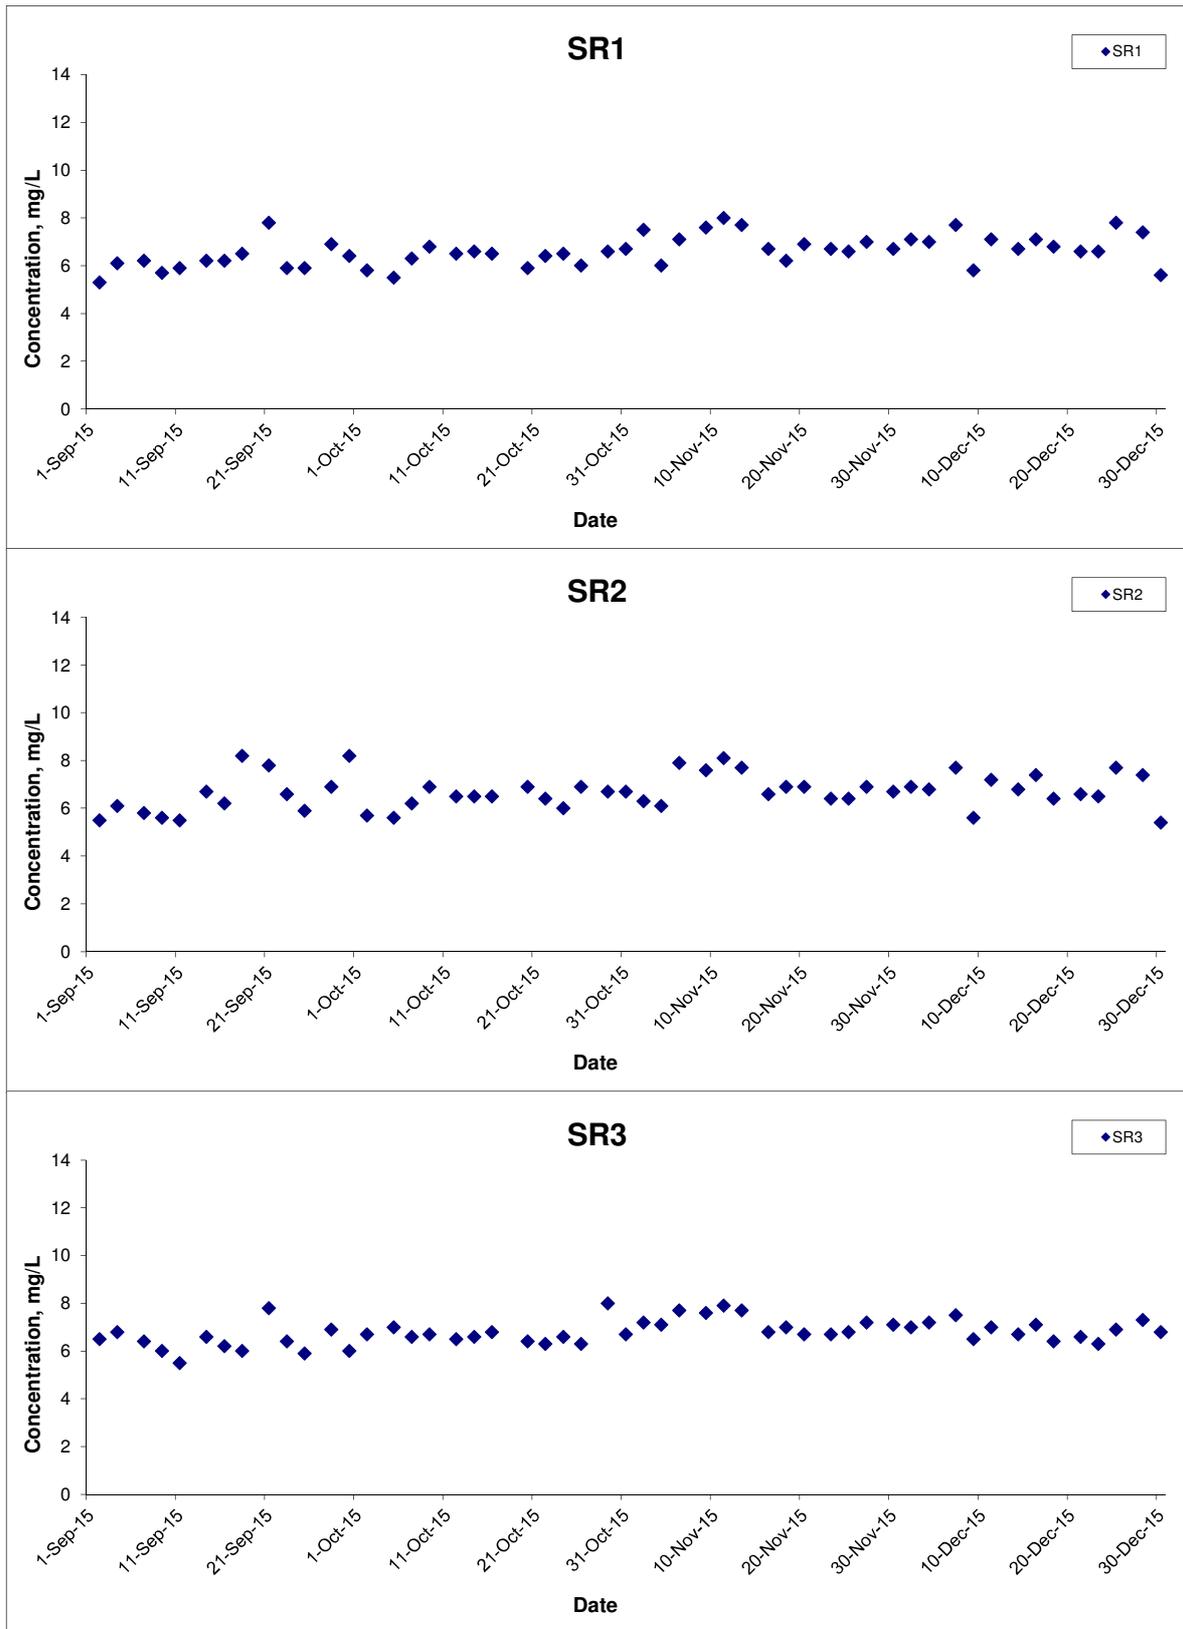


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

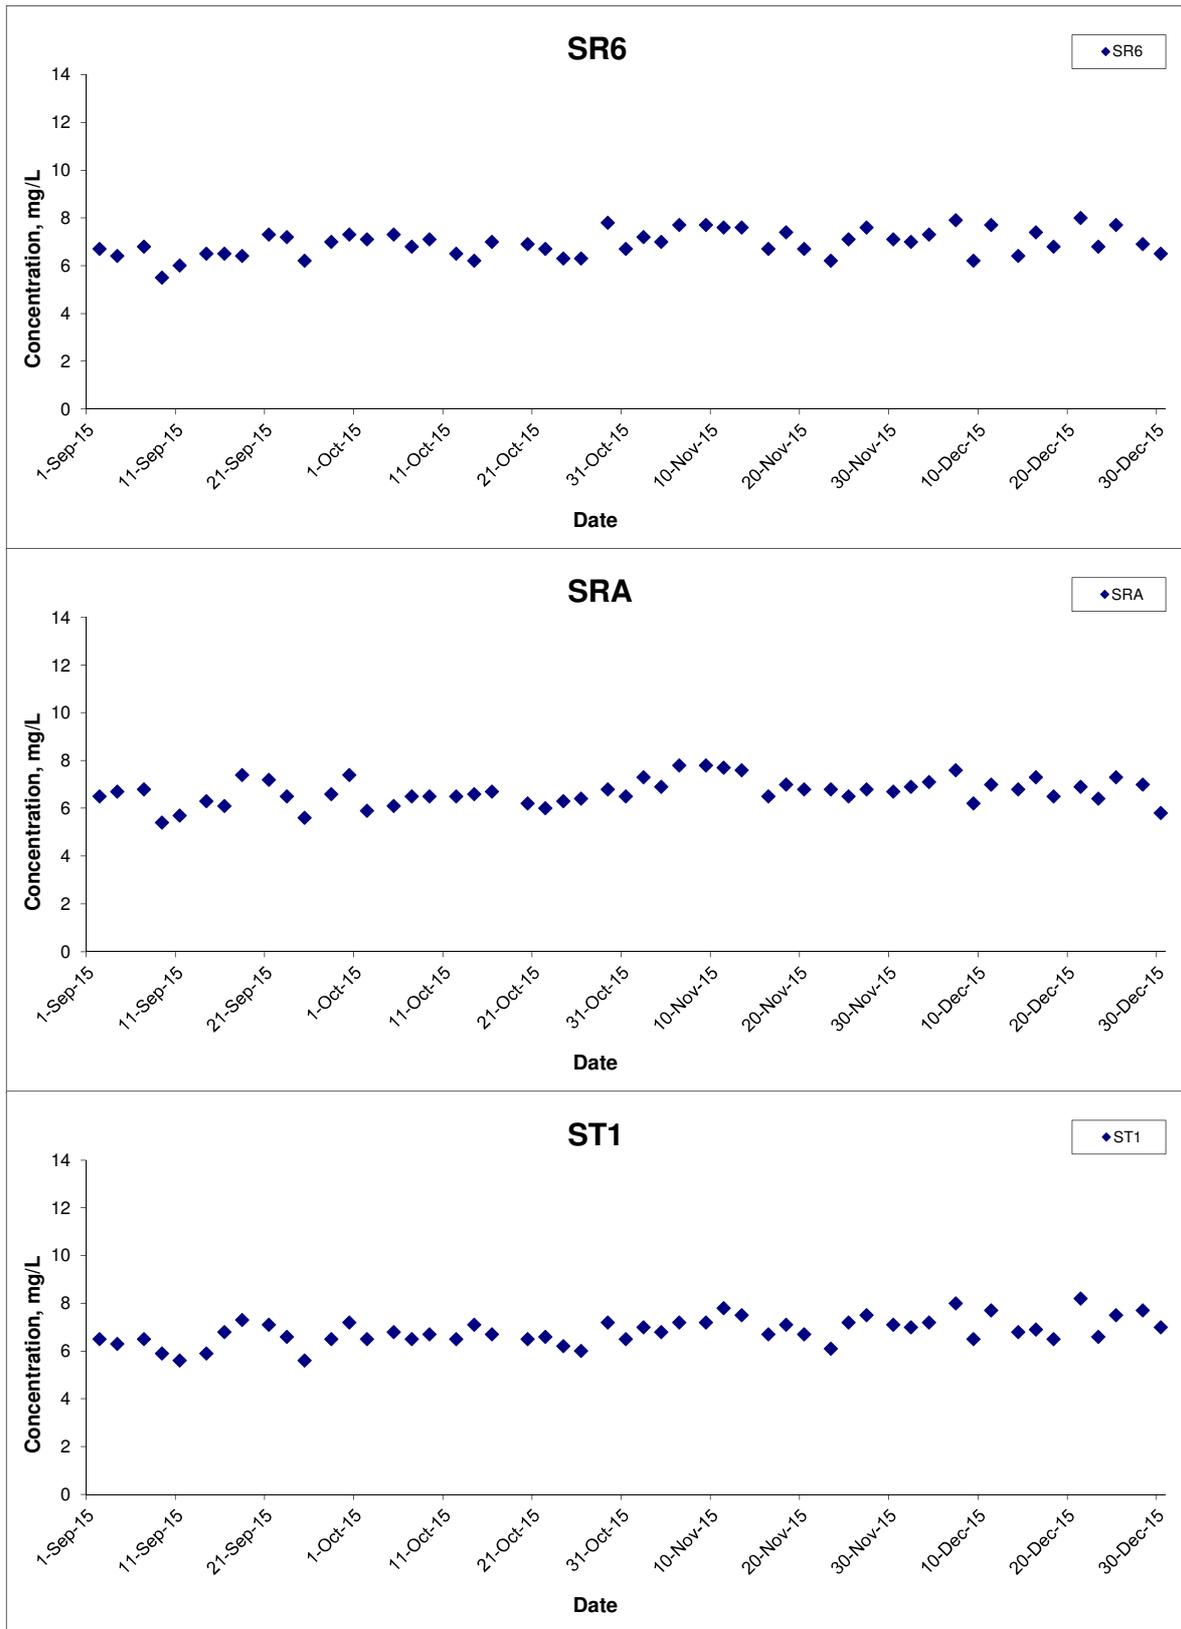


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H




Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

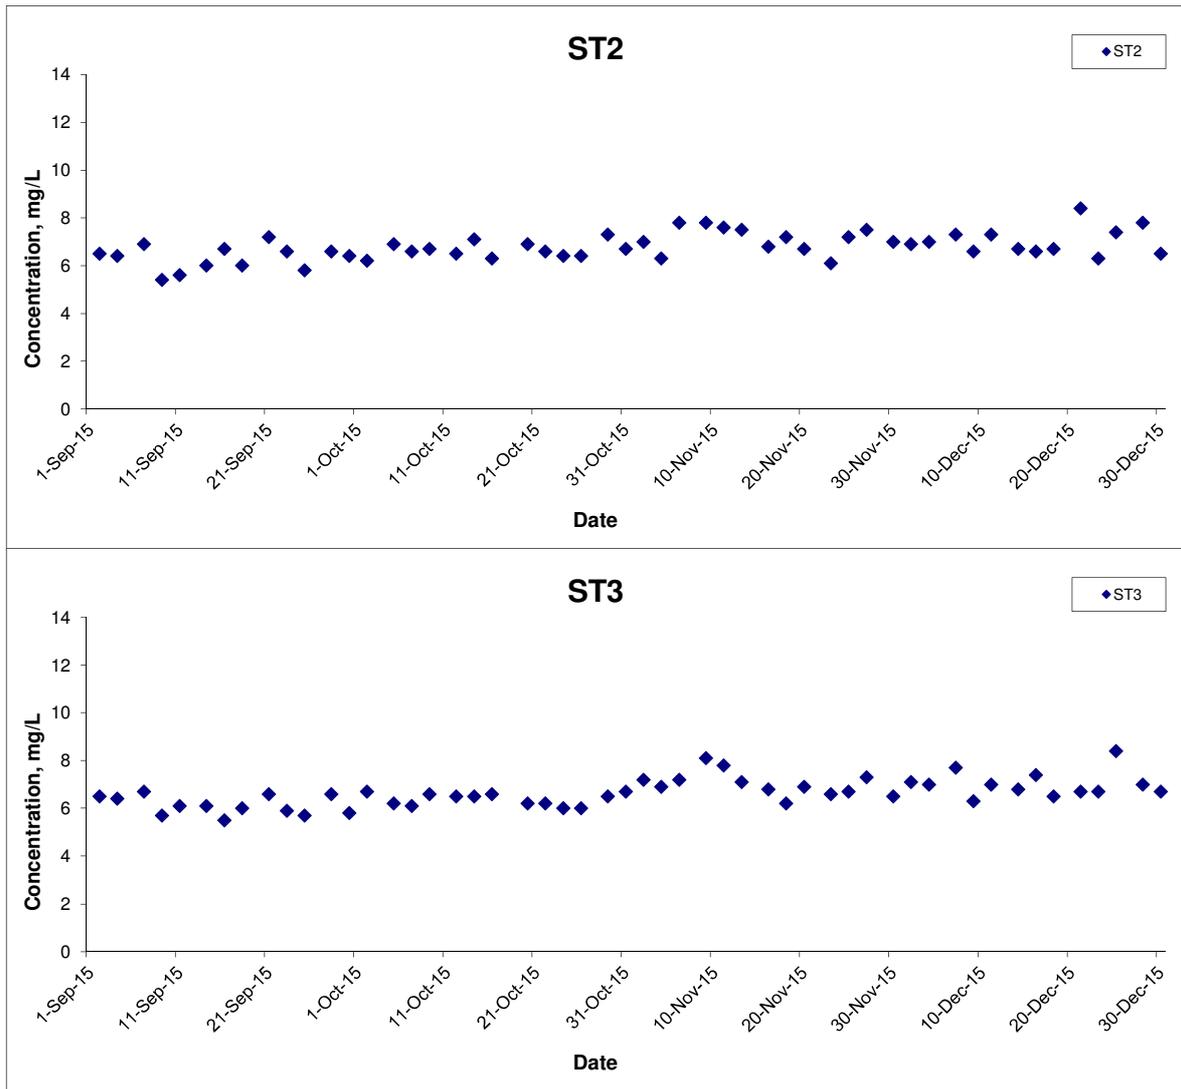

Title	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill	Scale	N.T.S	Project No.	MA12014	CINOTECH
	Graphical Presentation of Water Quality Monitoring Results	Date	Dec 15	Appendix	H	

Dissolved Oxygen (Bottom) at Mid-Ebb Tide

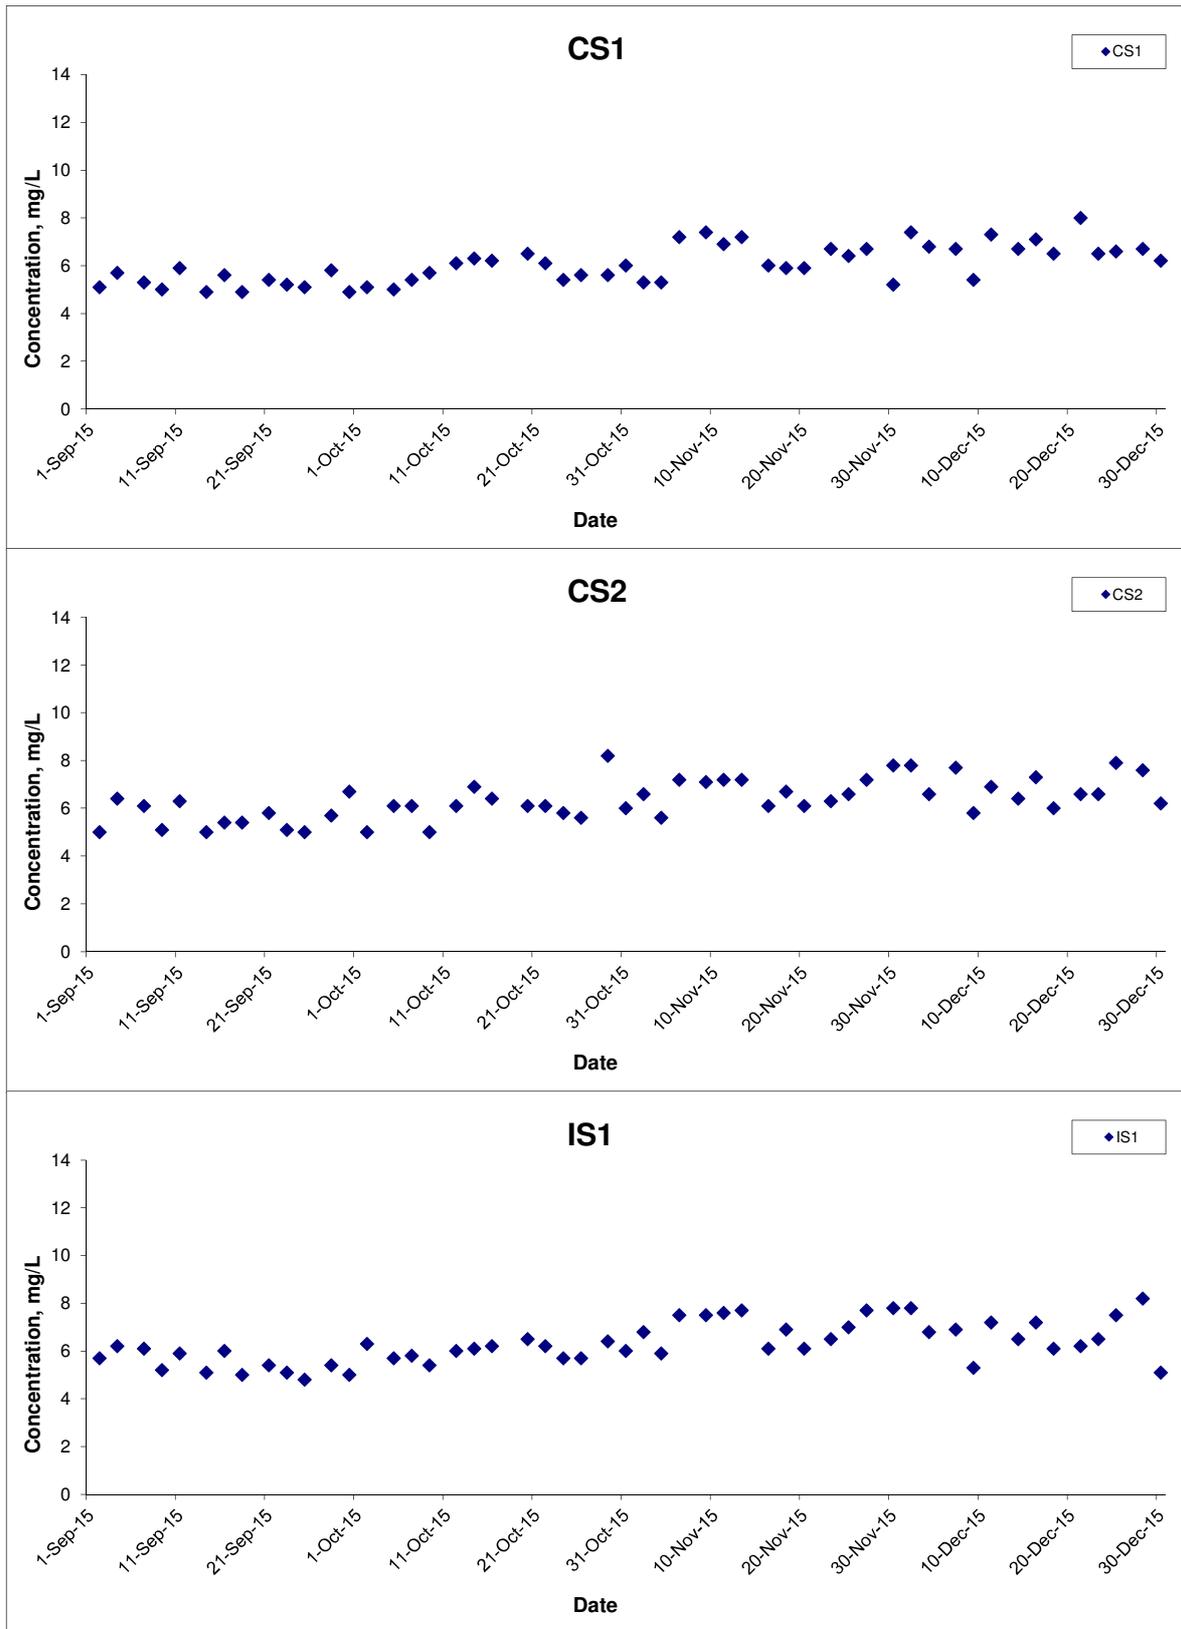


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Ebb Tide

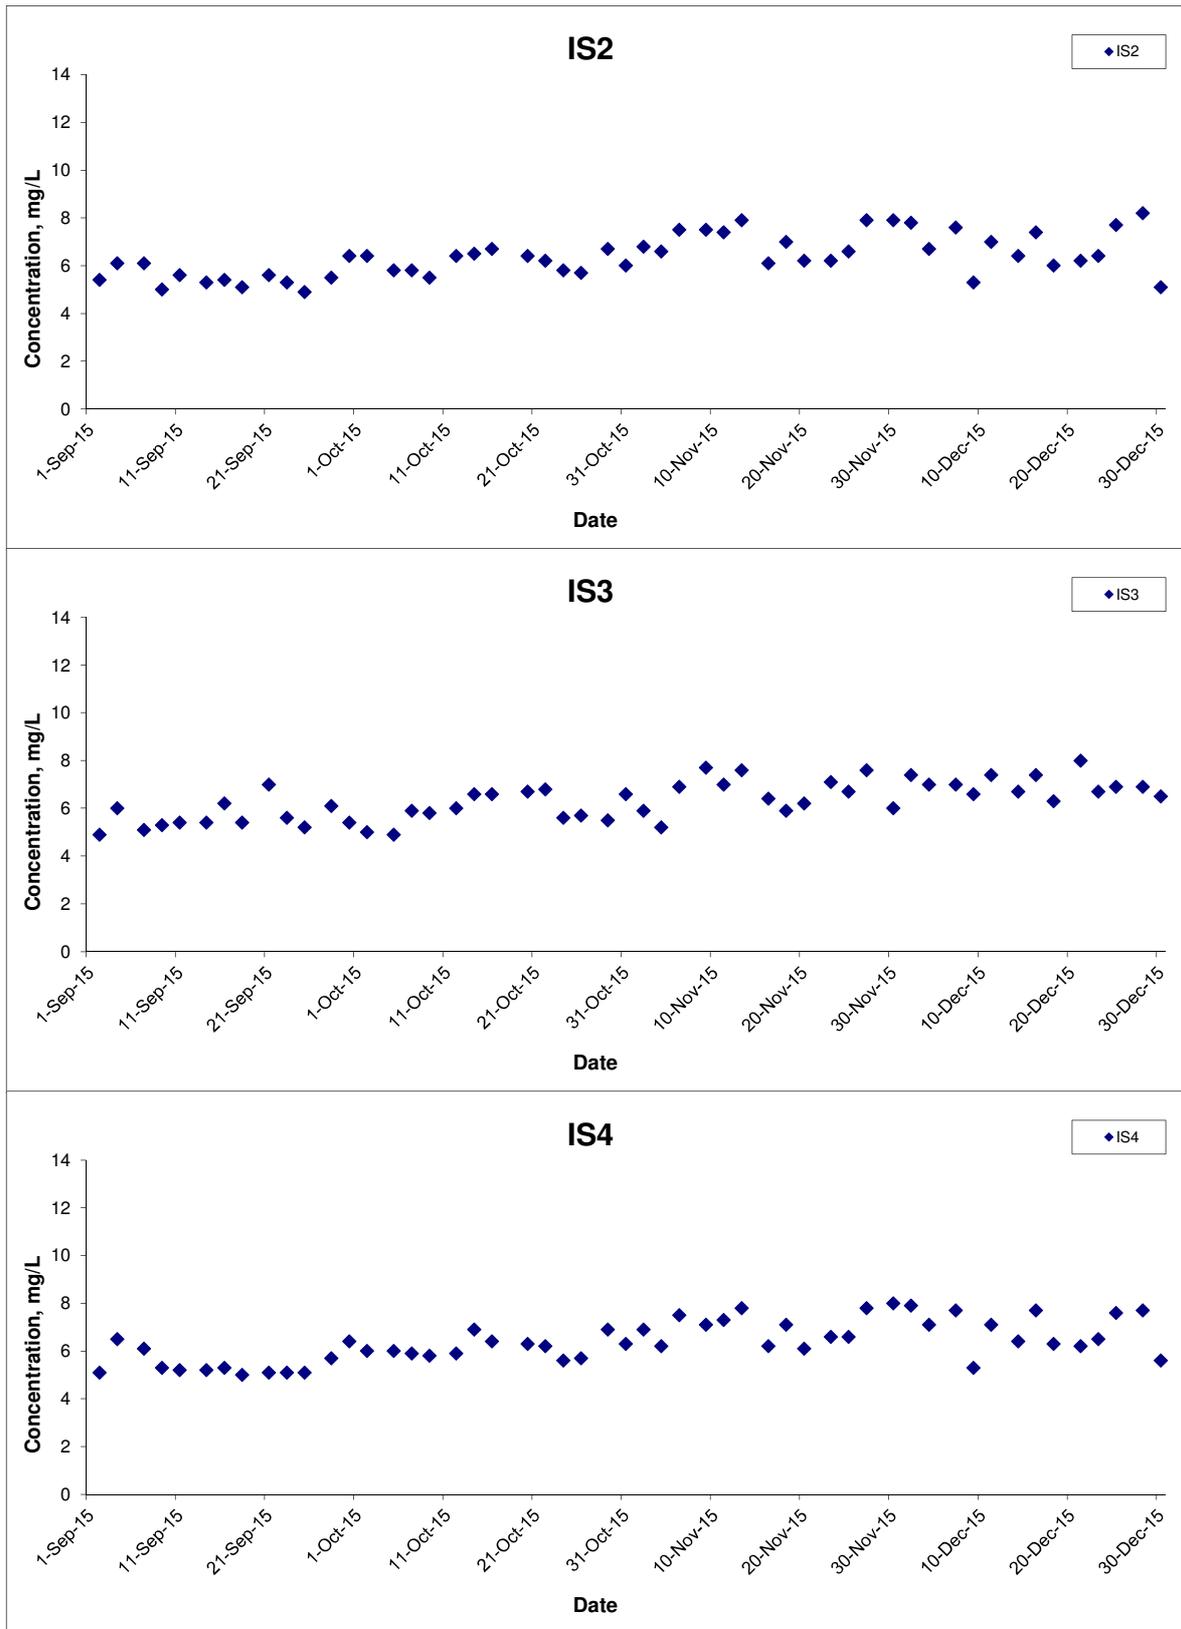


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Ebb Tide

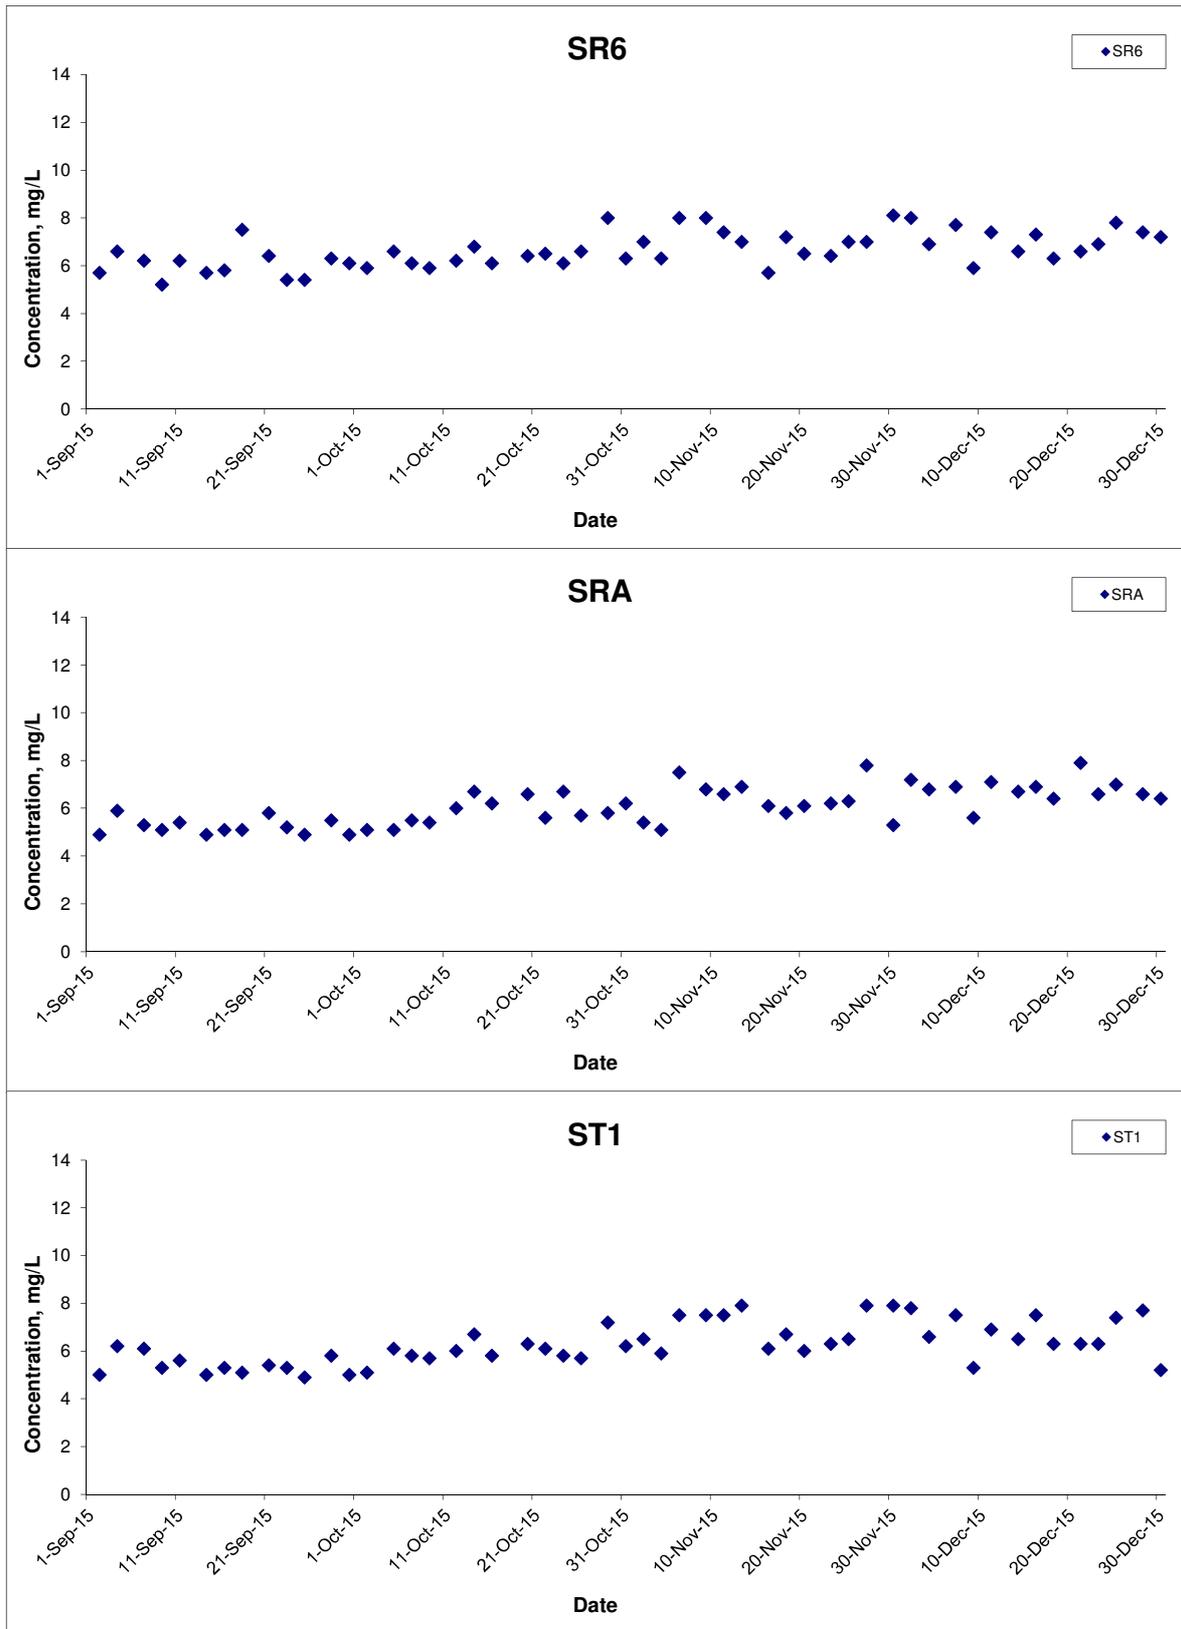


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Ebb Tide

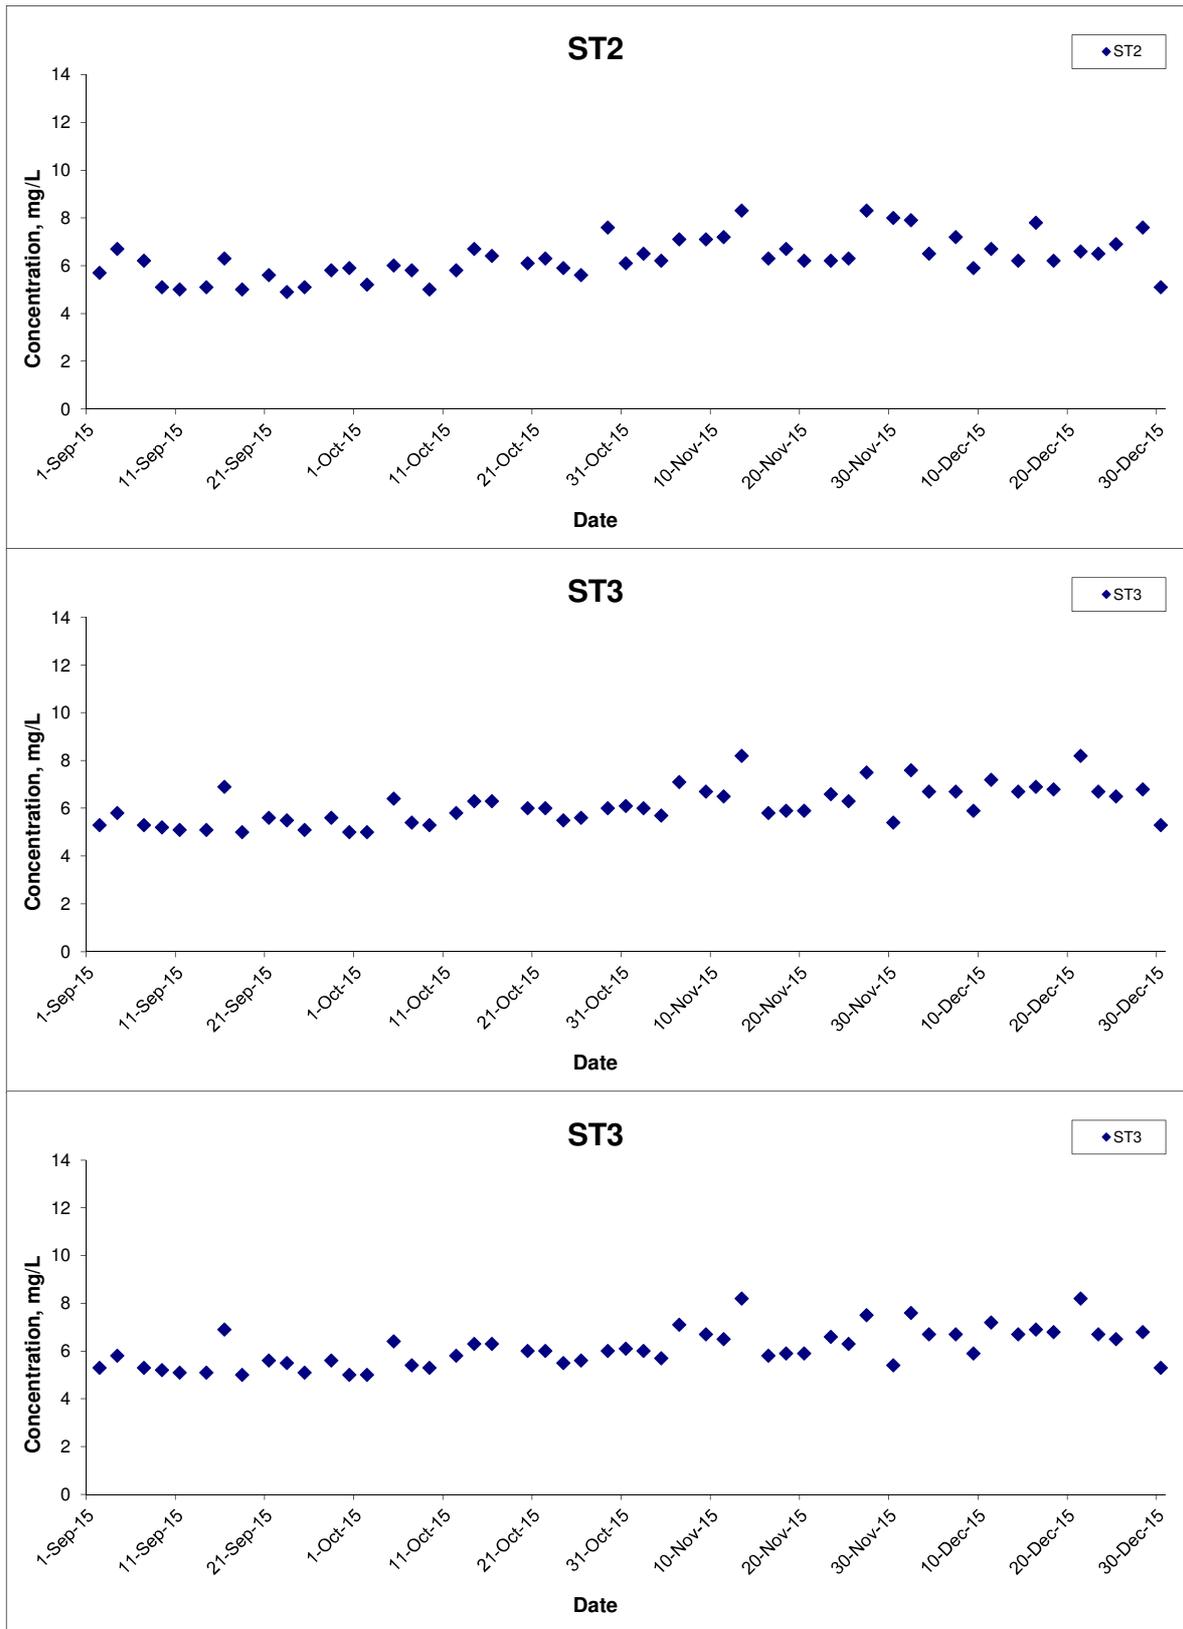


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Flood Tide

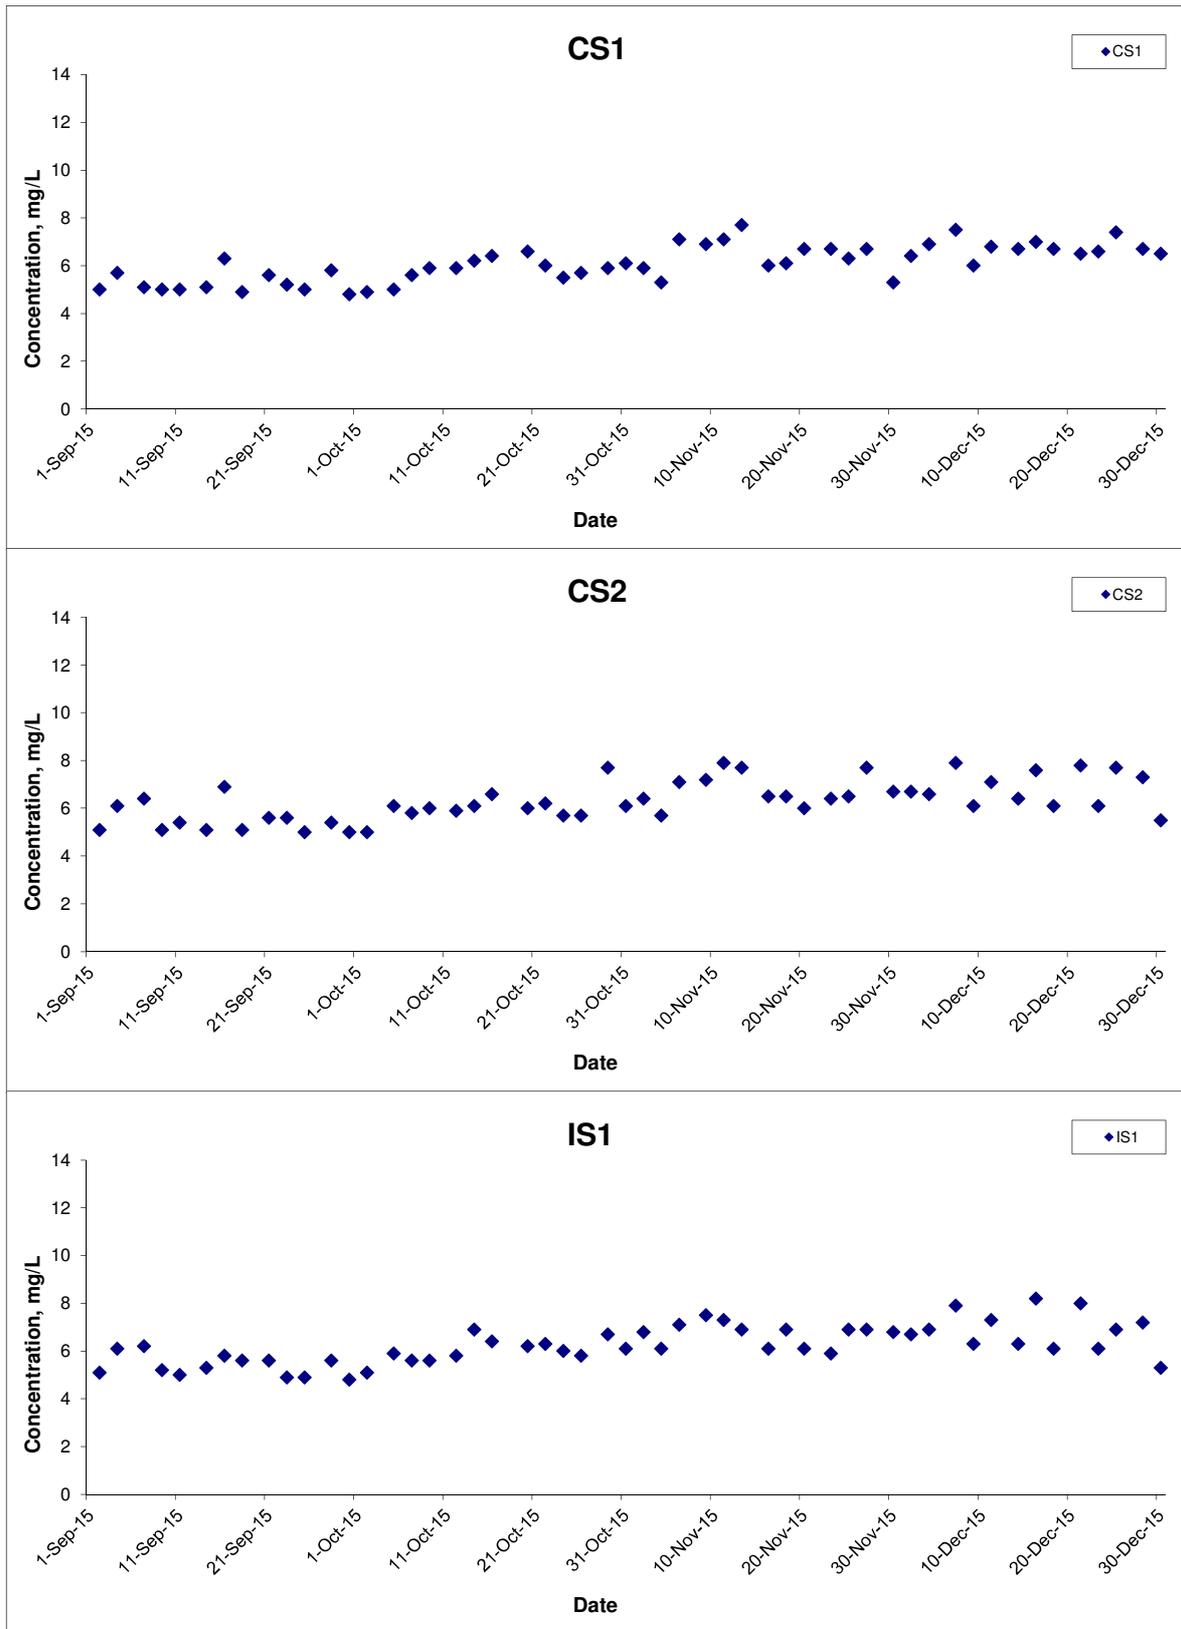


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Flood Tide

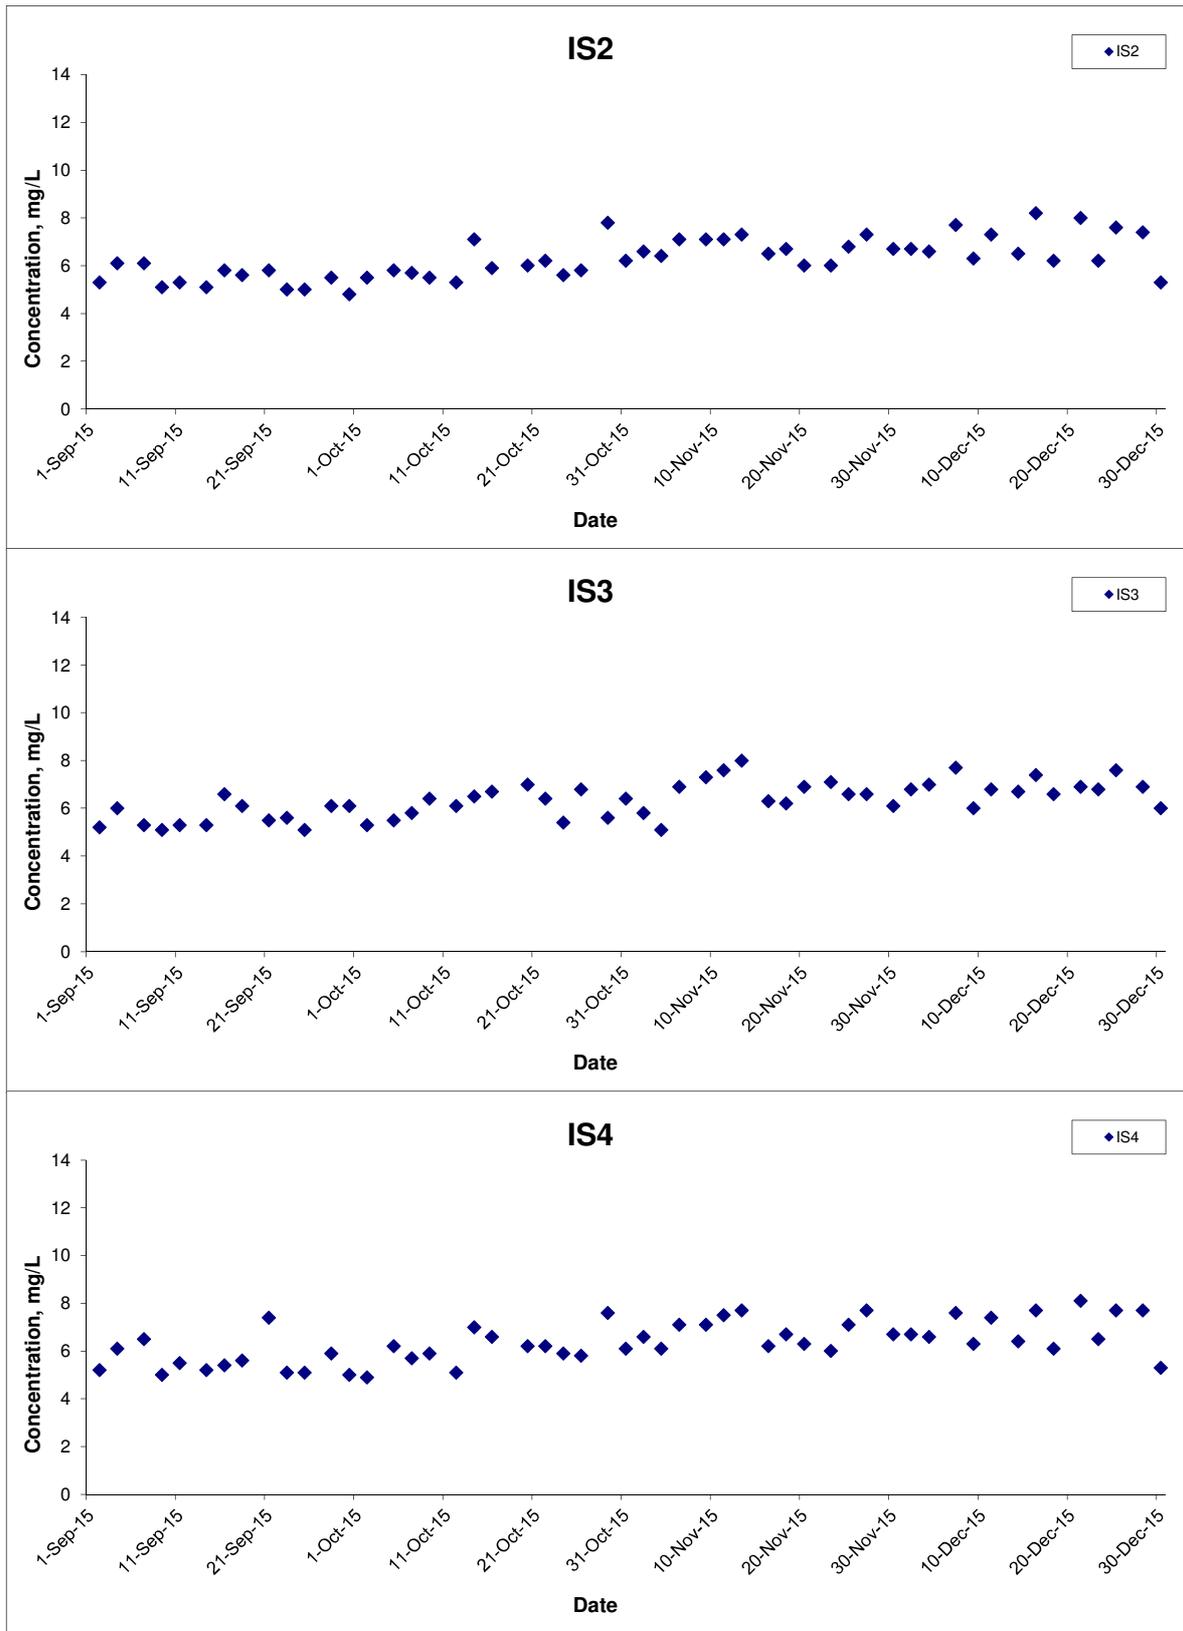


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Flood Tide

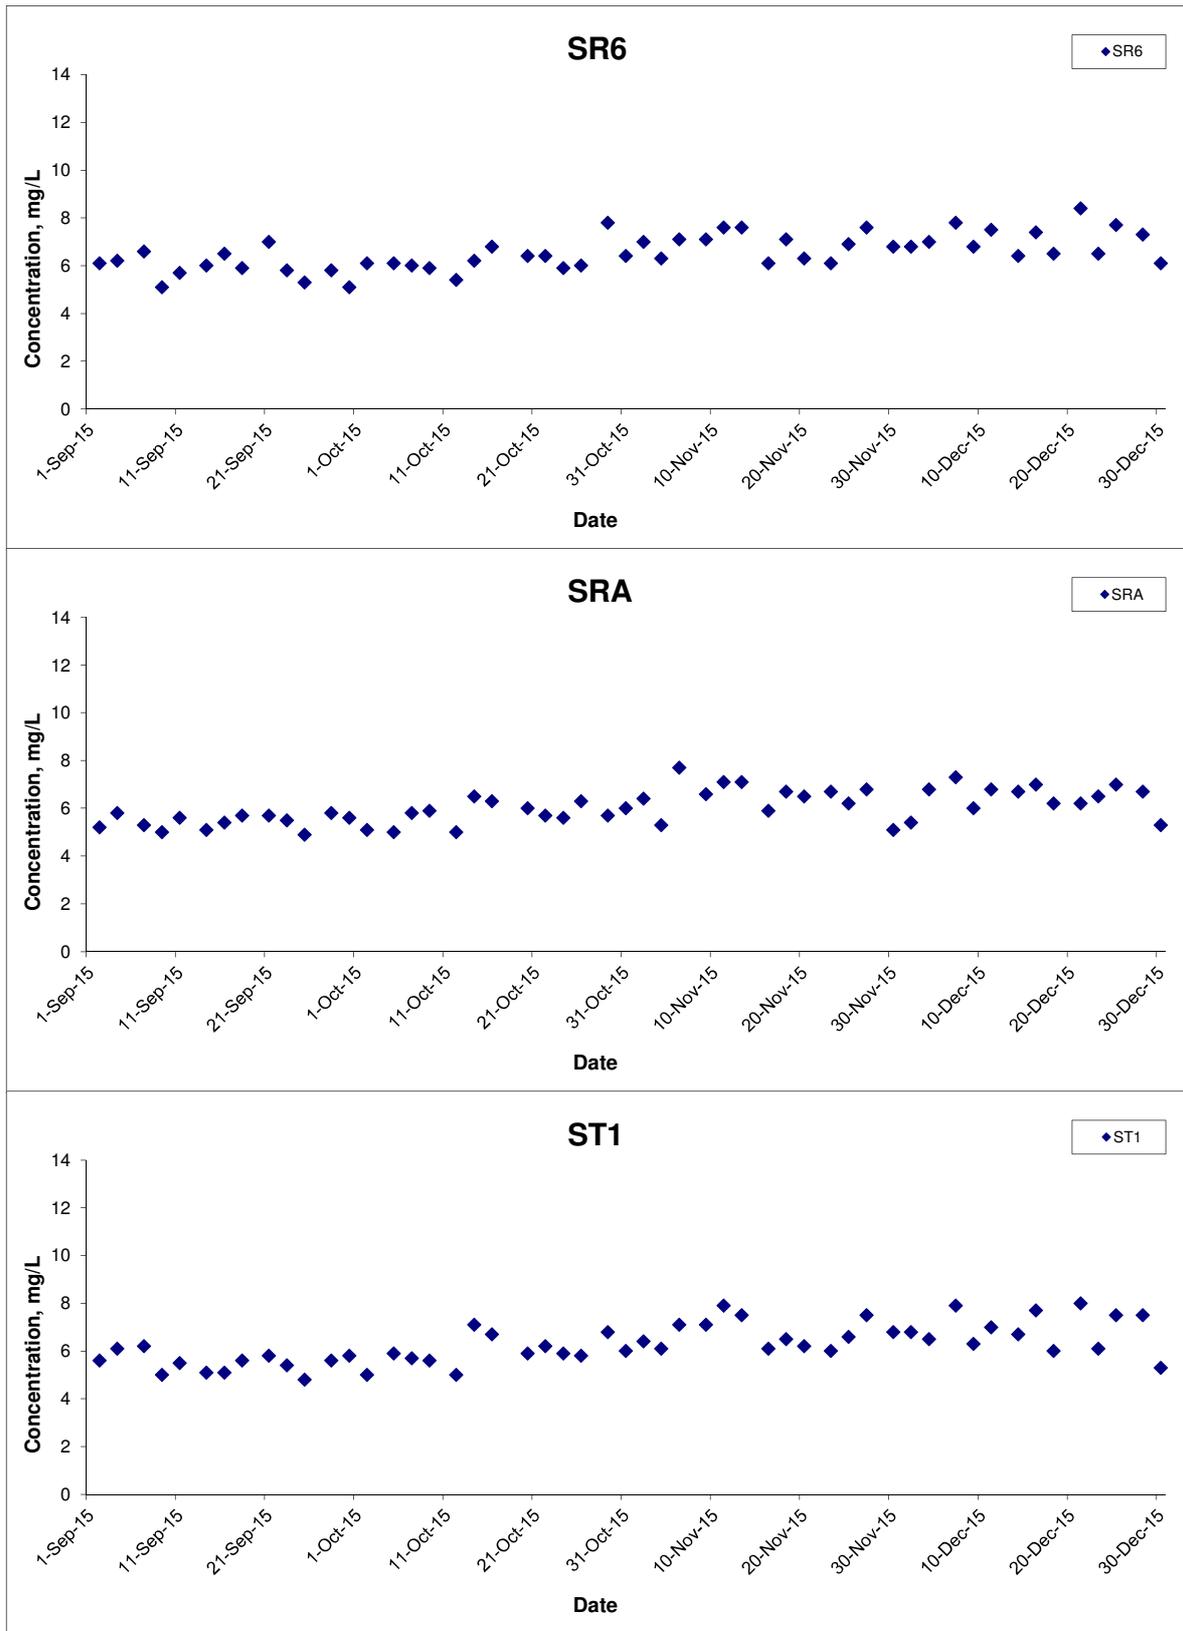


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H




Dissolved Oxygen (Bottom) at Mid-Flood Tide

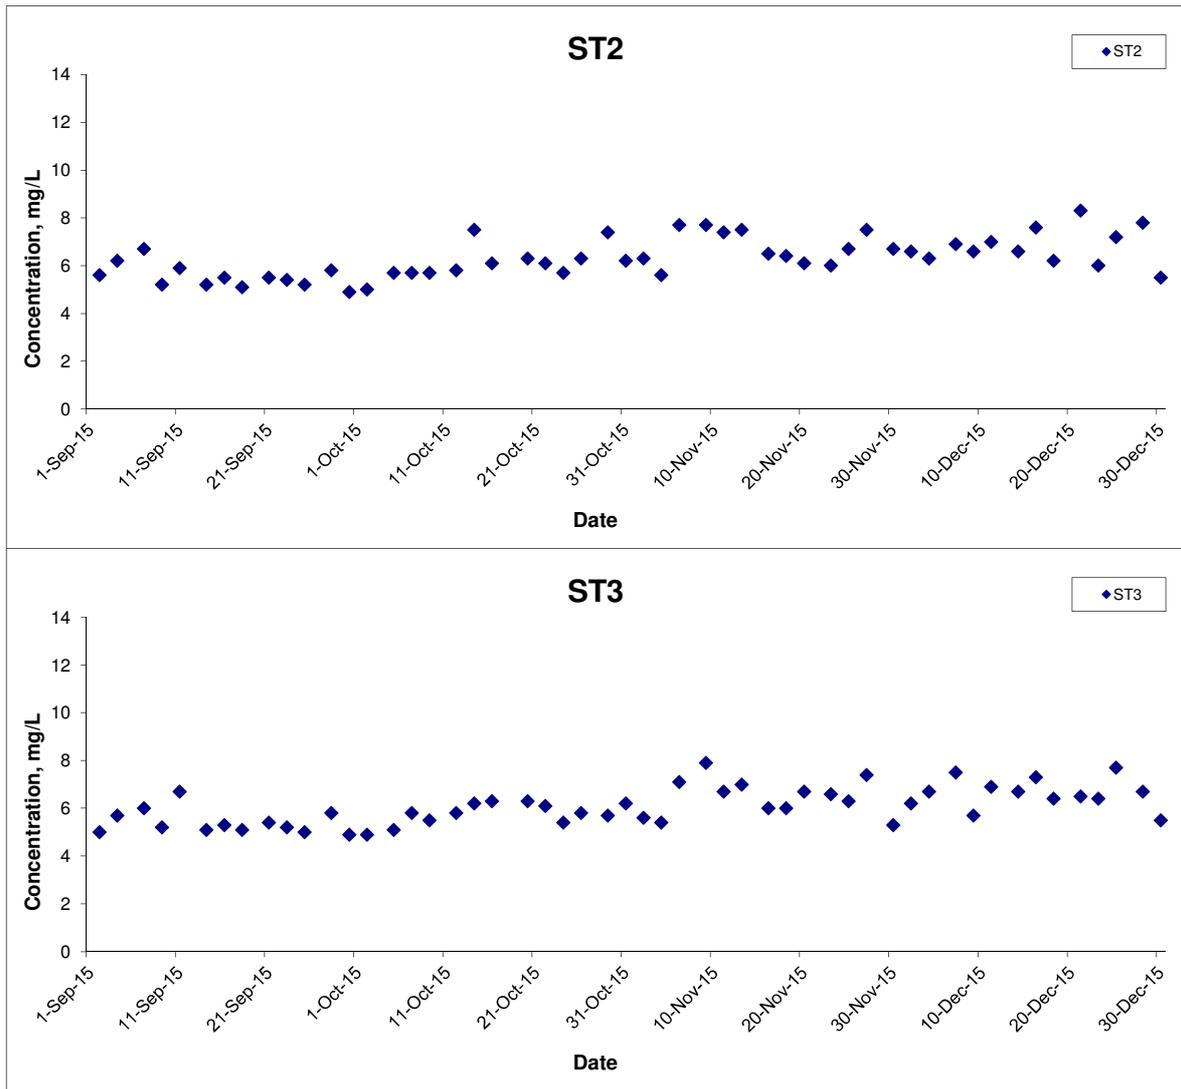

Title	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill	Scale	N.T.S	Project No.	MA12014	CINOTECH
	Graphical Presentation of Water Quality Monitoring Results	Date	Dec 15	Appendix	H	

Turbidity (Depth-averaged) at Mid-Ebb Tide

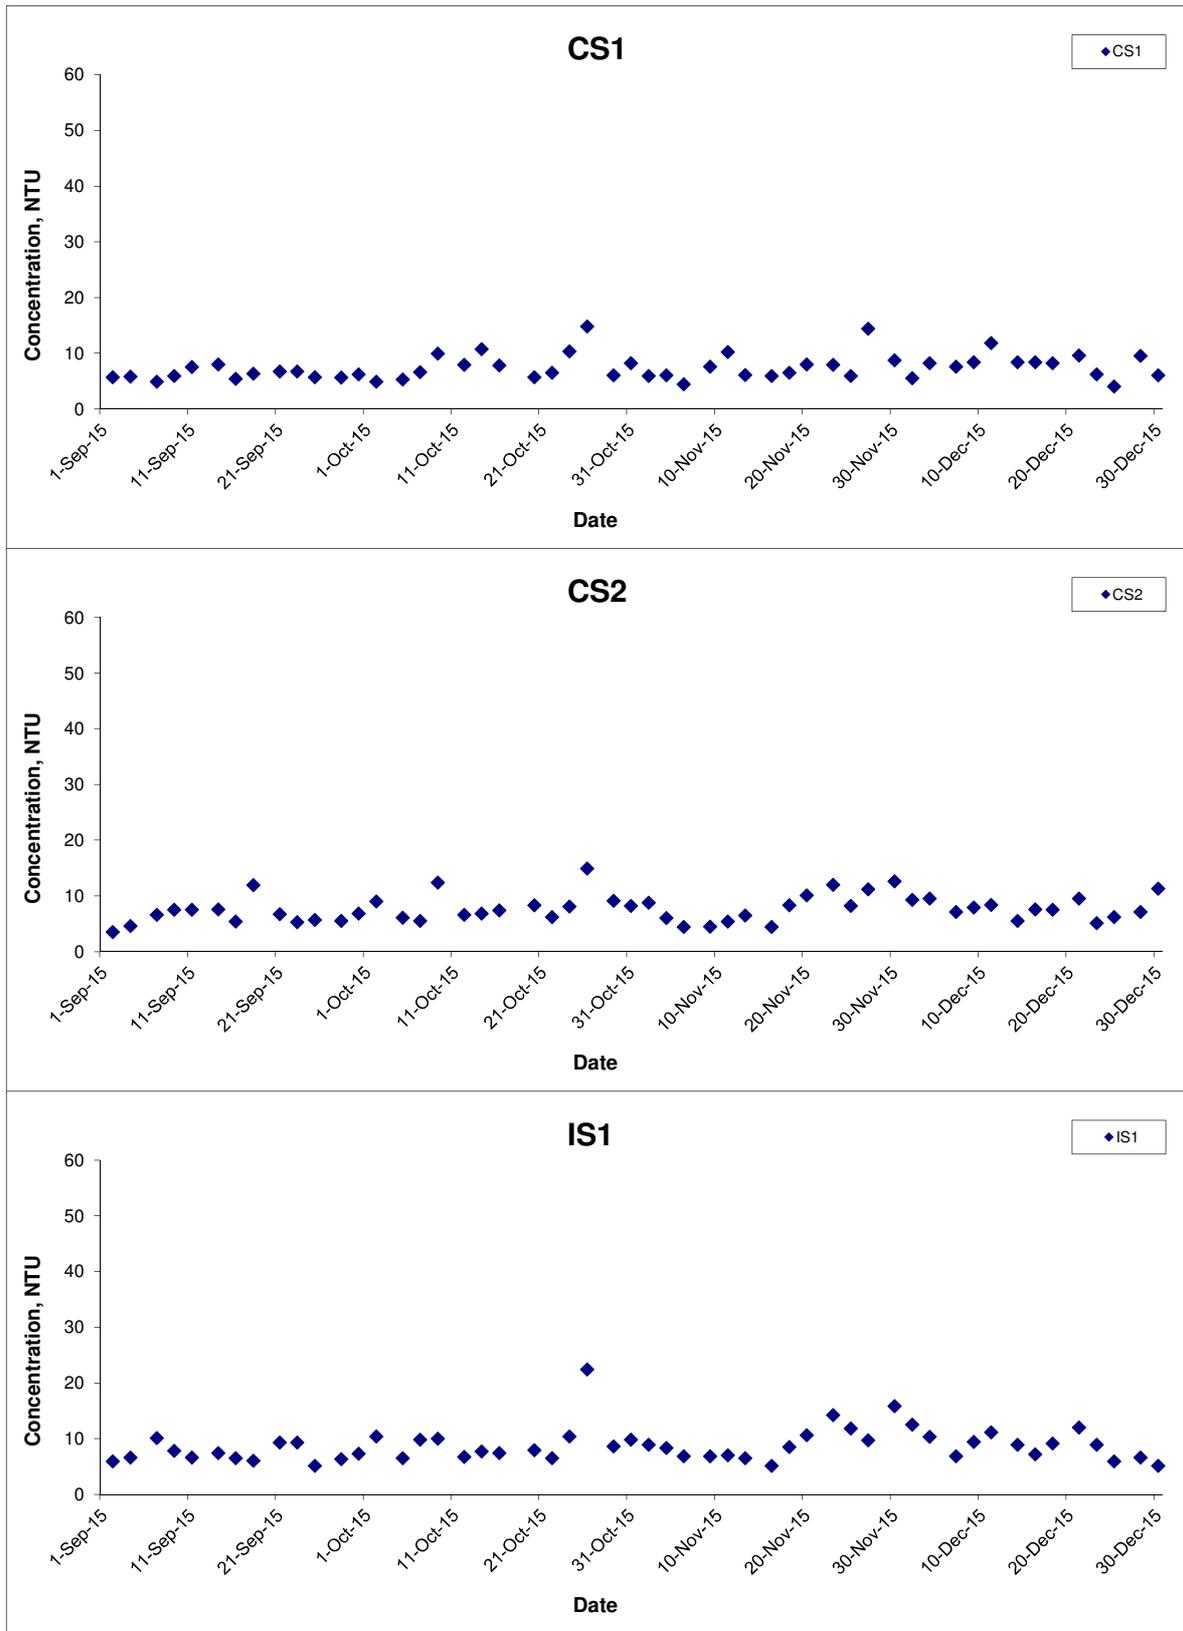


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Ebb Tide

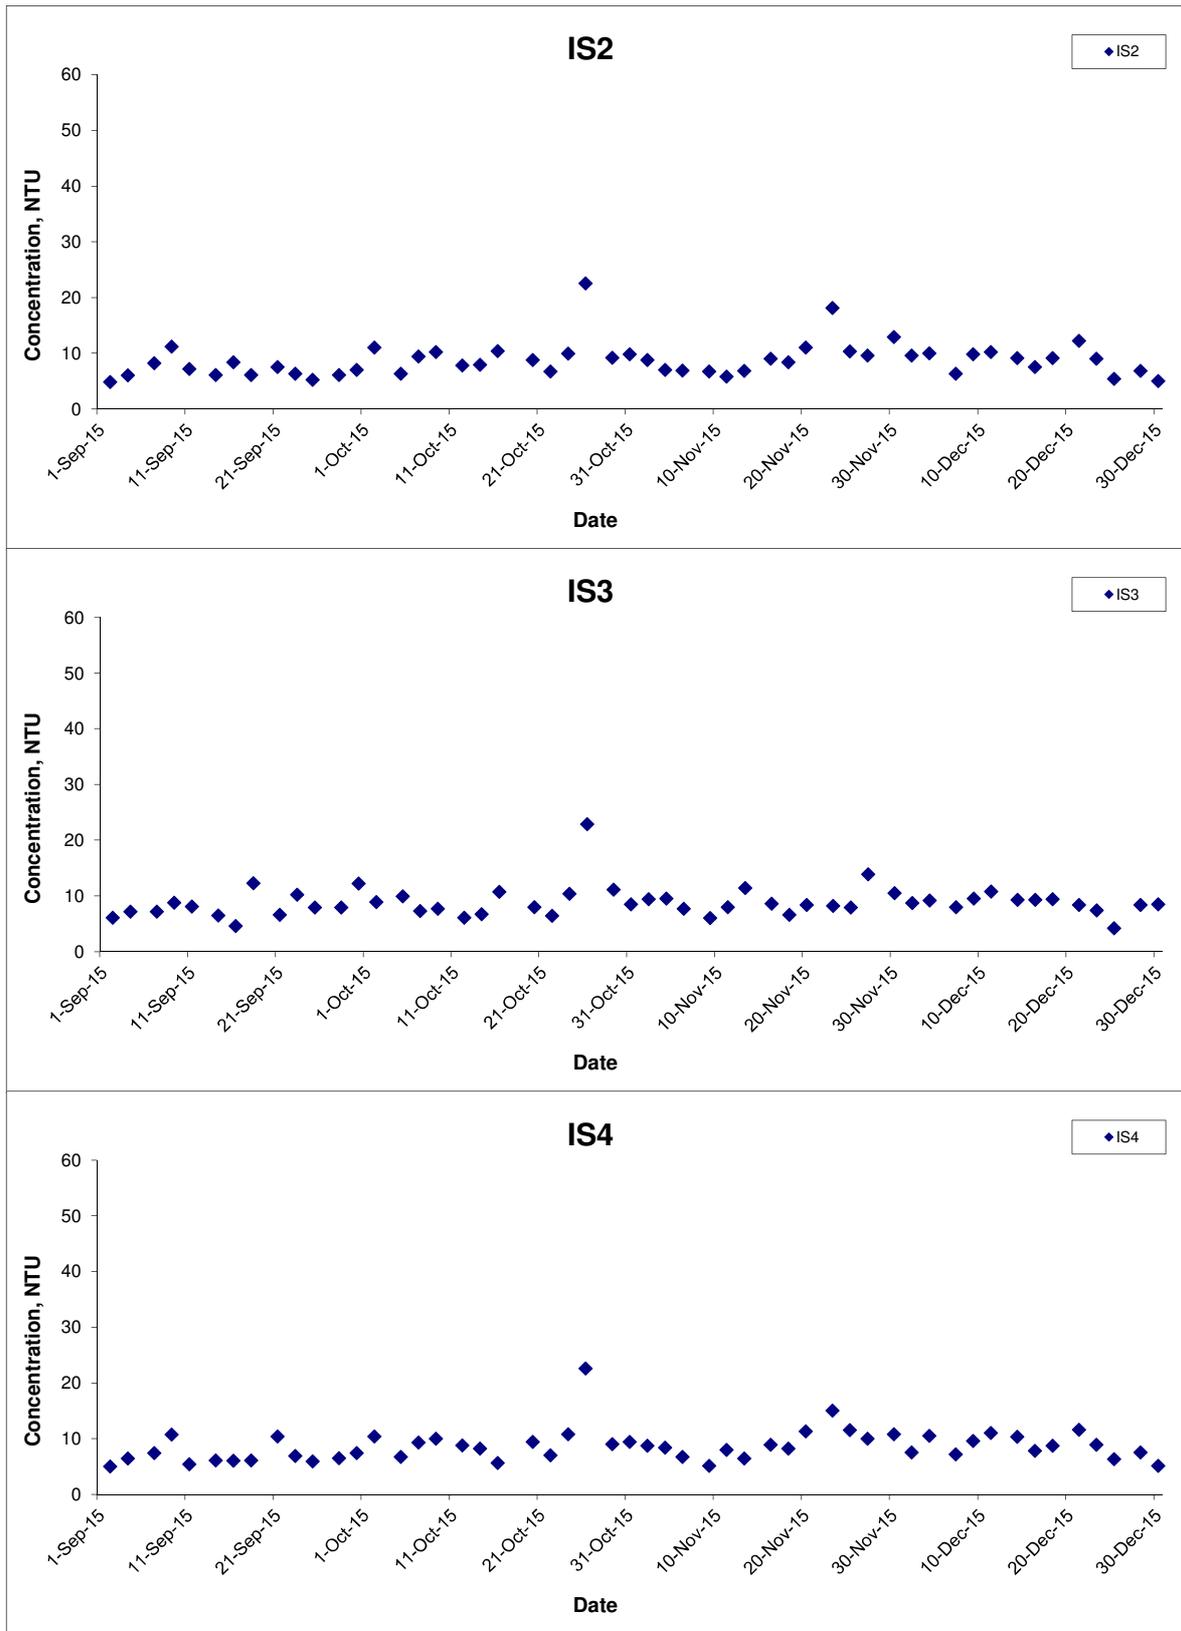


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Ebb Tide

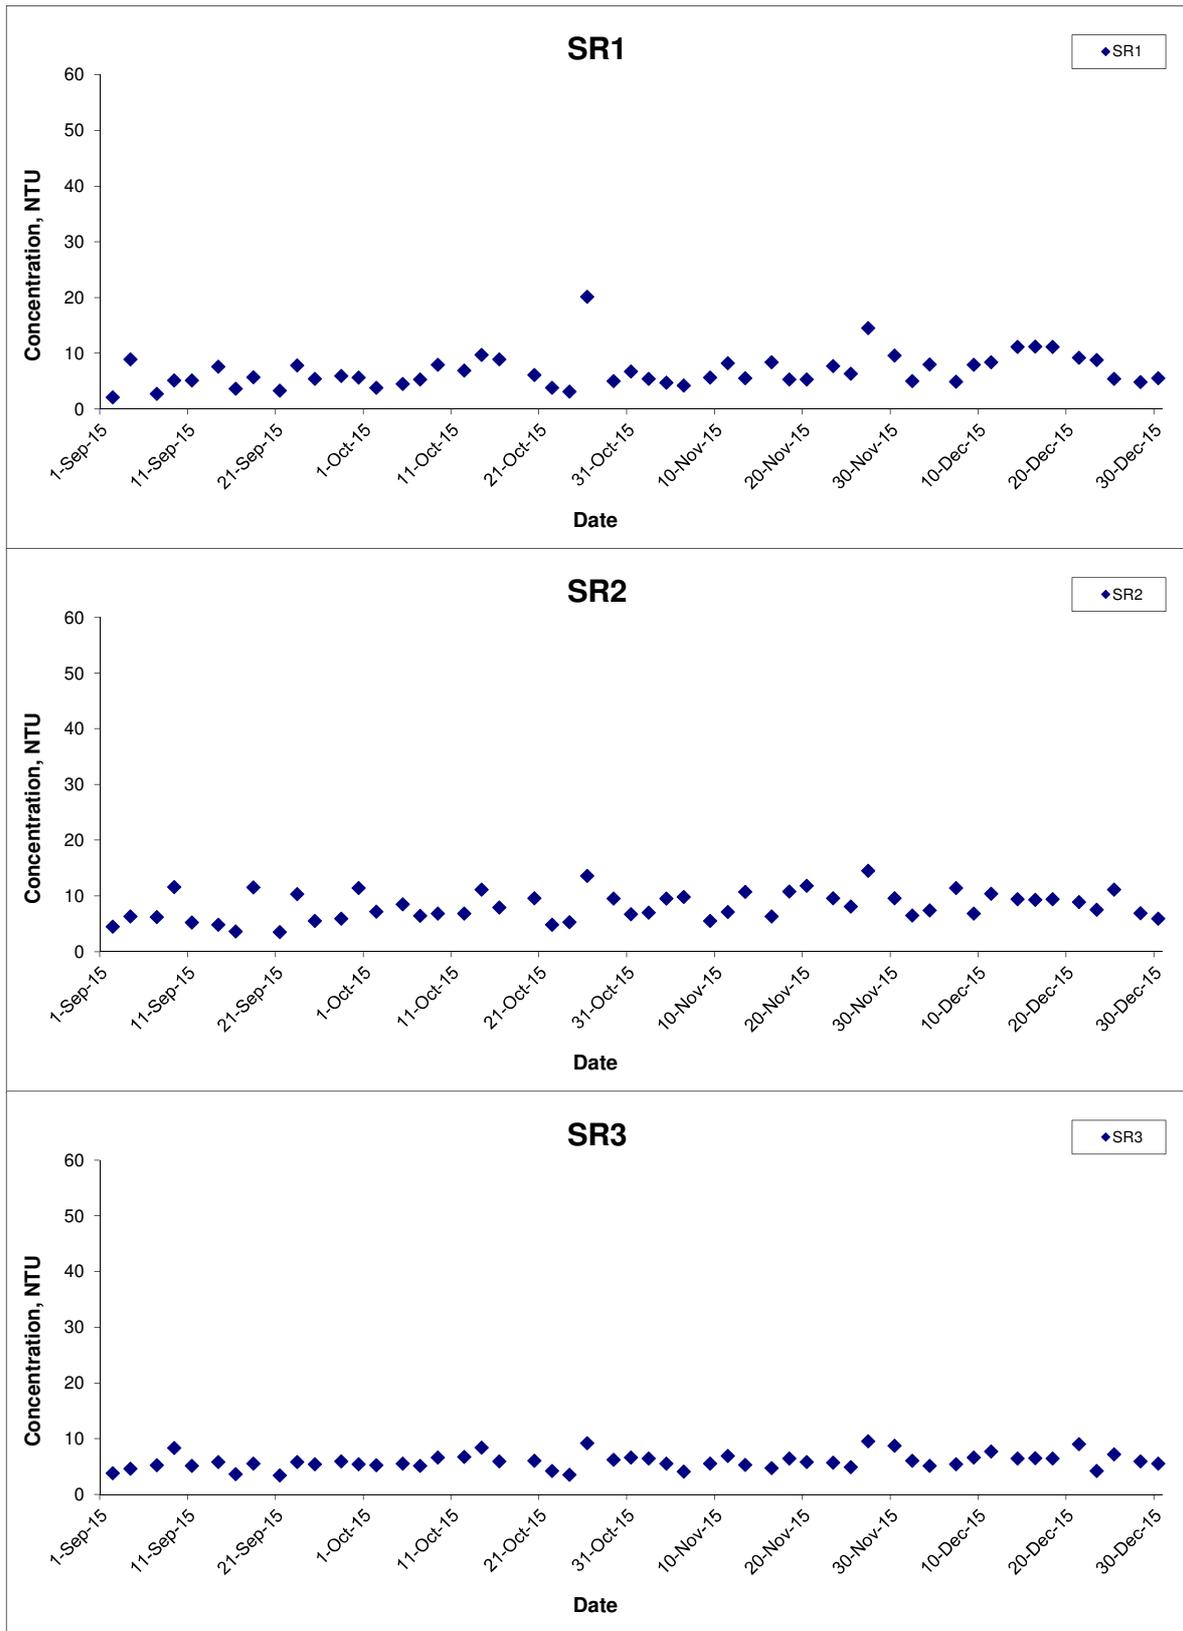


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Ebb Tide

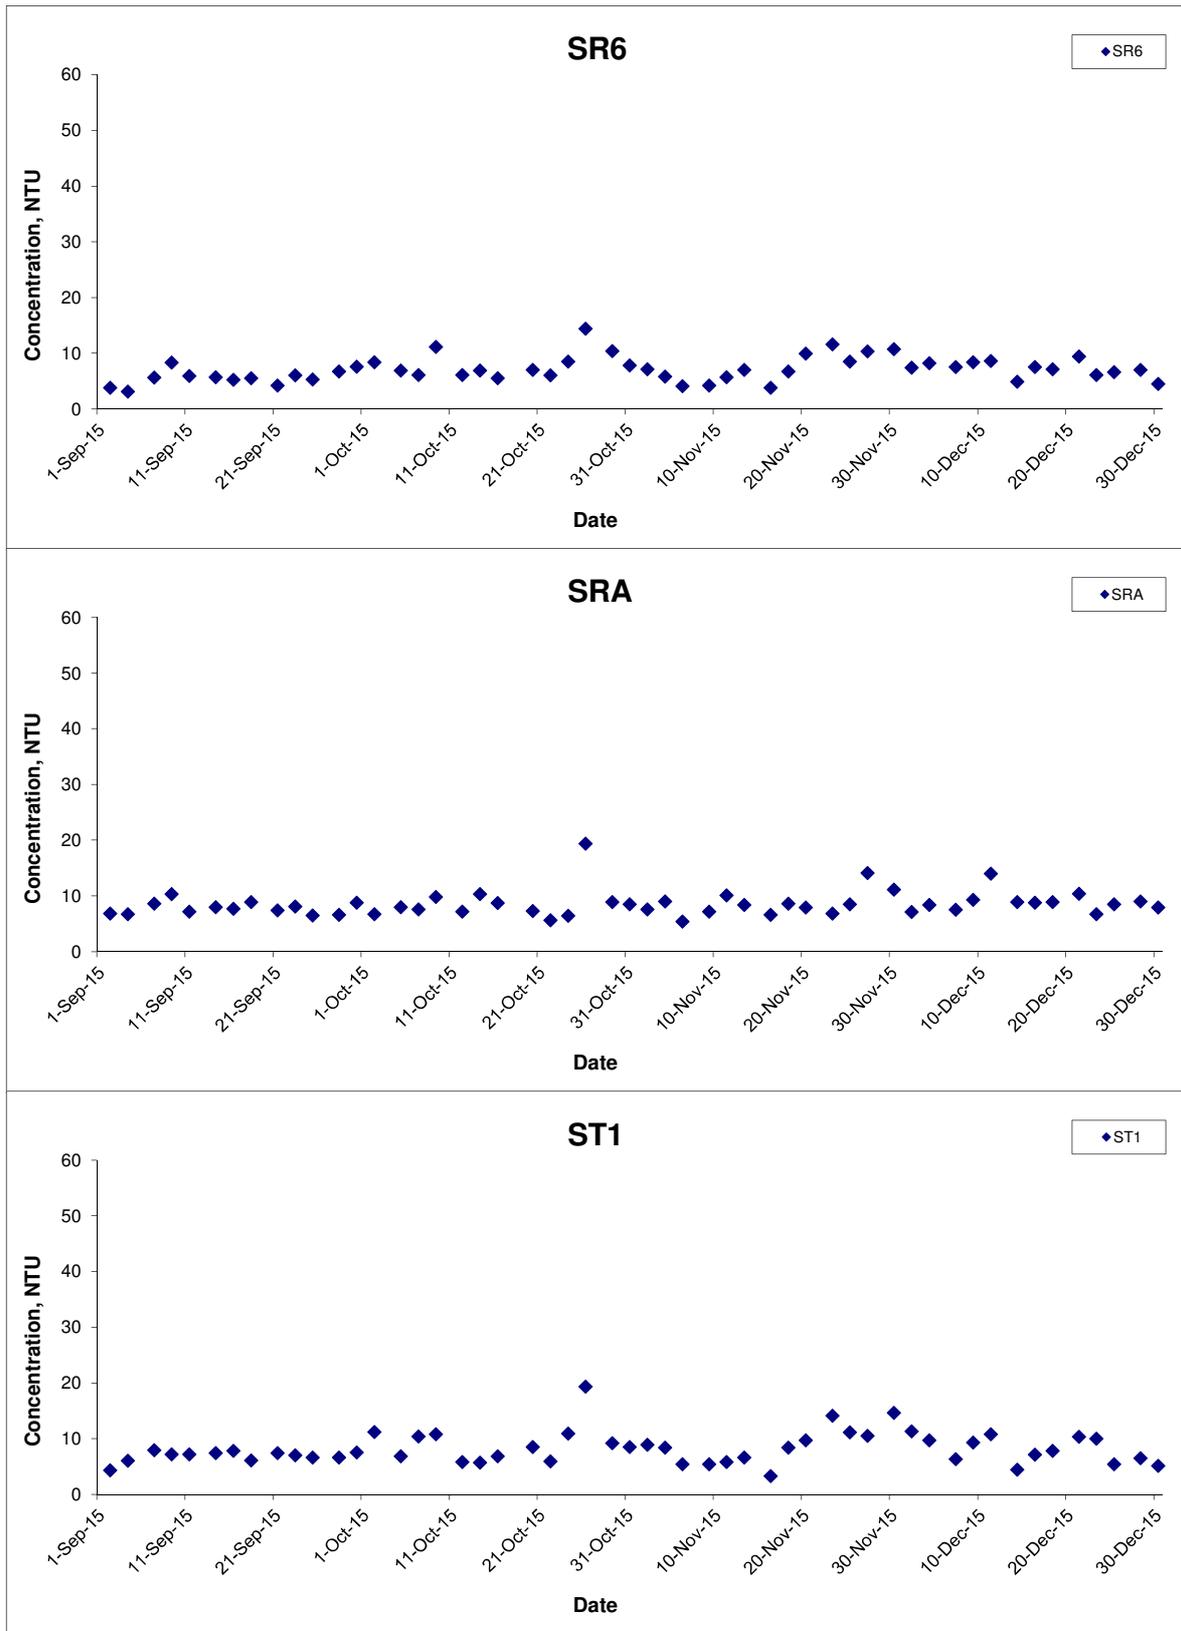


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H




Turbidity (Depth-averaged) at Mid-Ebb Tide

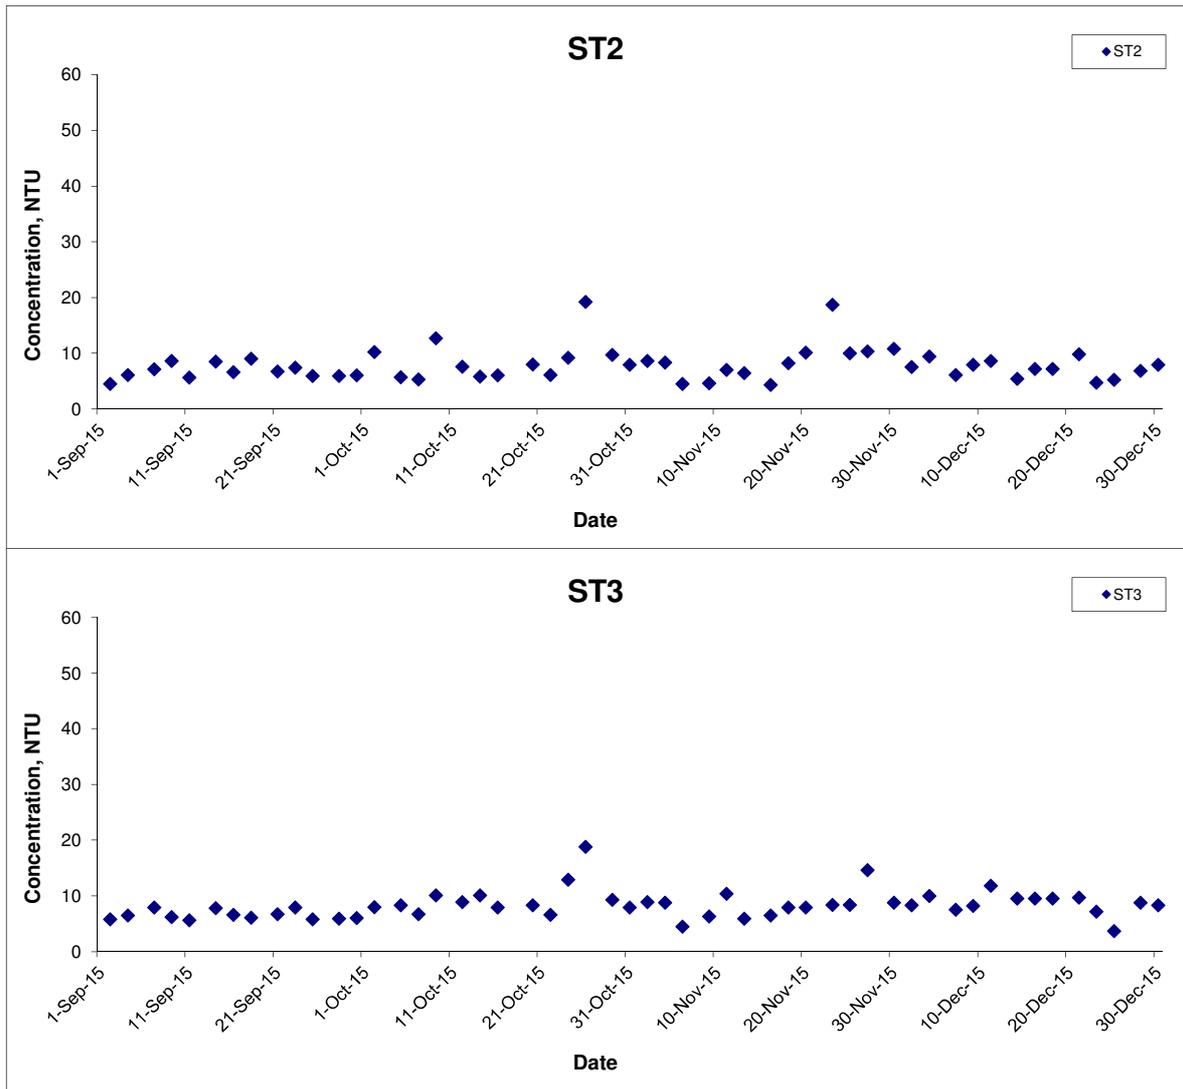

Title	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill	Scale	N.T.S	Project No.	MA12014	CINOTECH
	Graphical Presentation of Water Quality Monitoring Results	Date	Dec 15	Appendix	H	

Turbidity (Depth-averaged) at Mid-Flood Tide

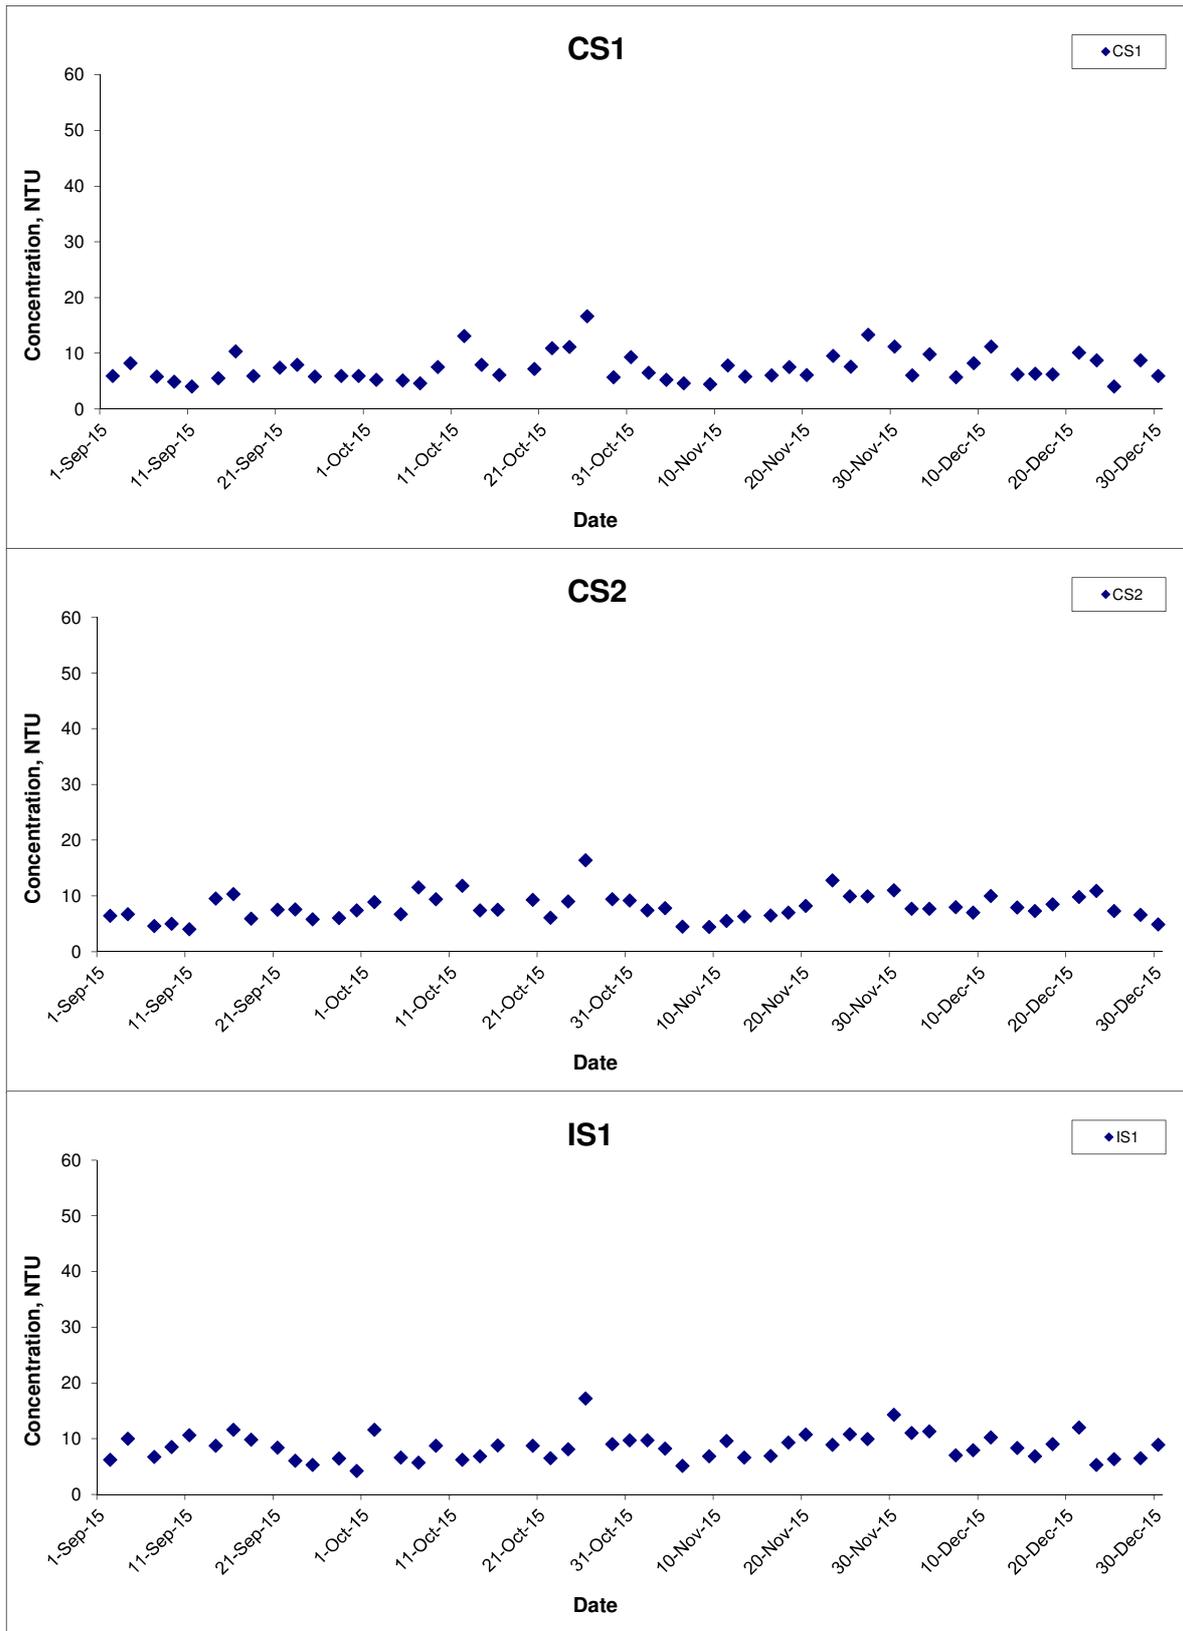


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Flood Tide

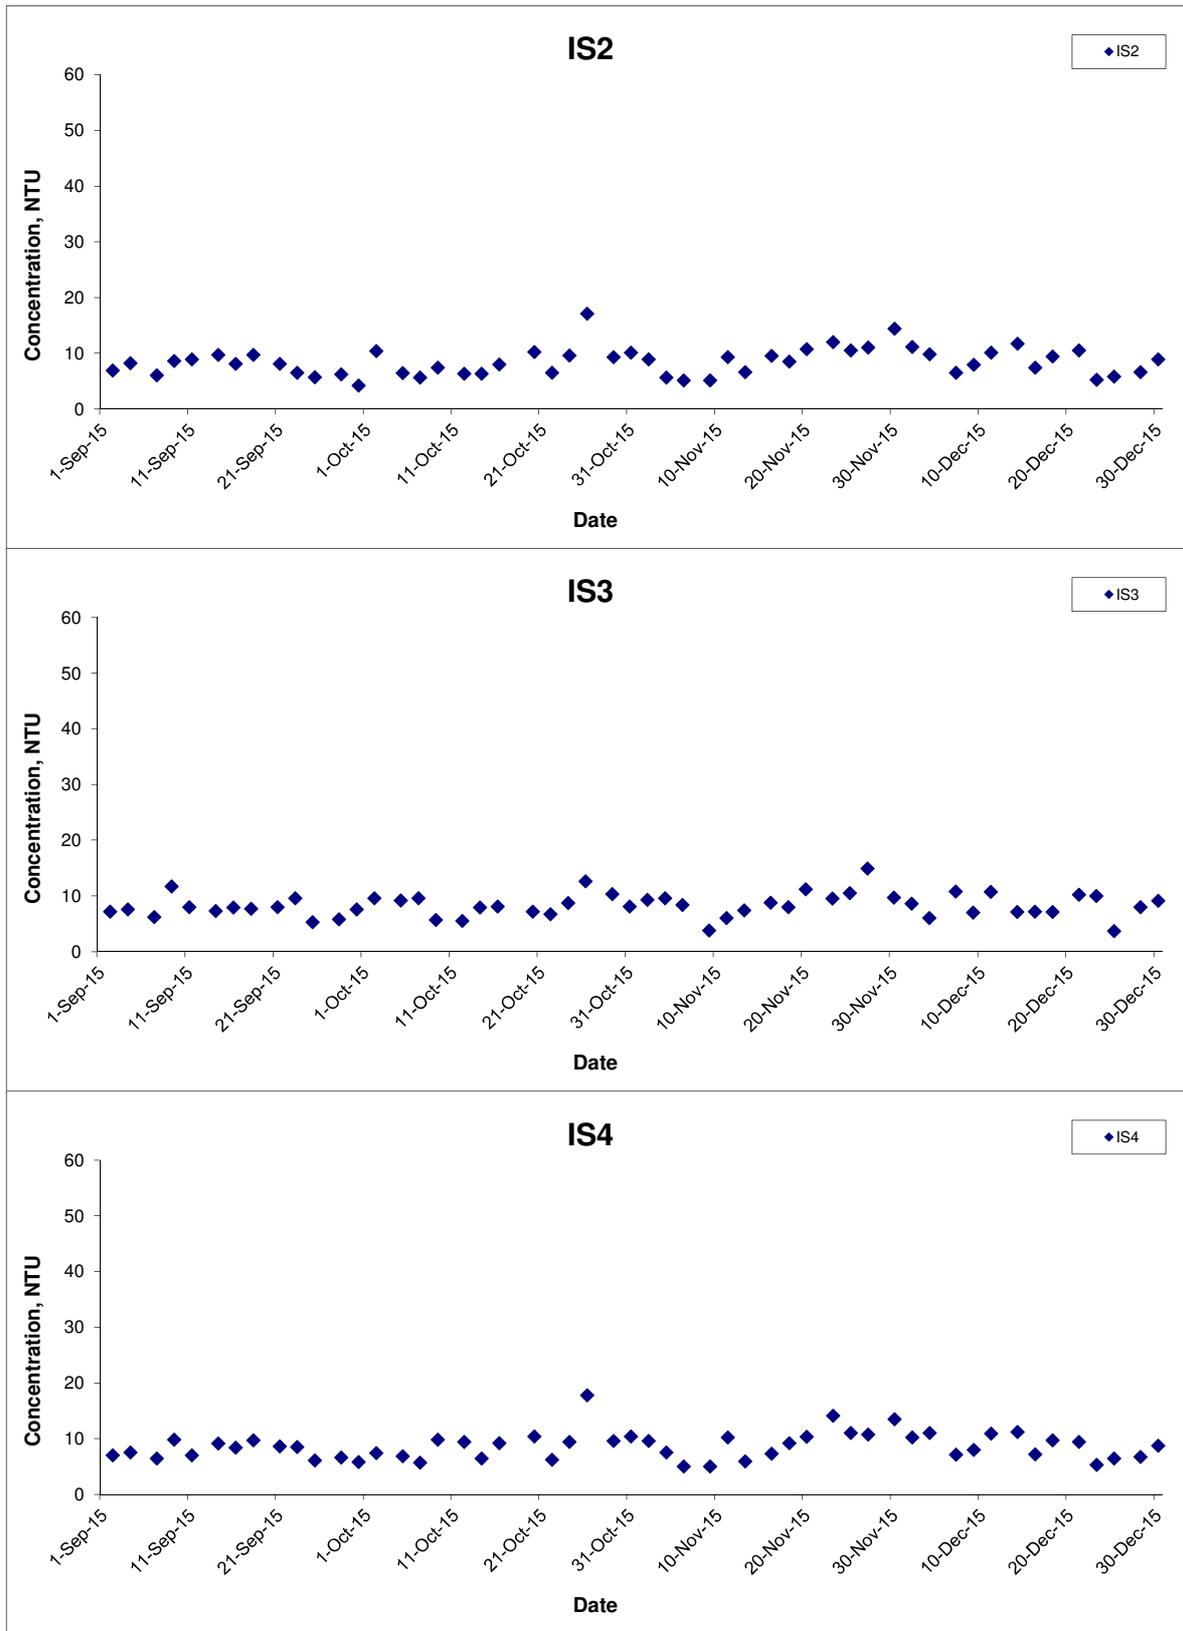


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Flood Tide

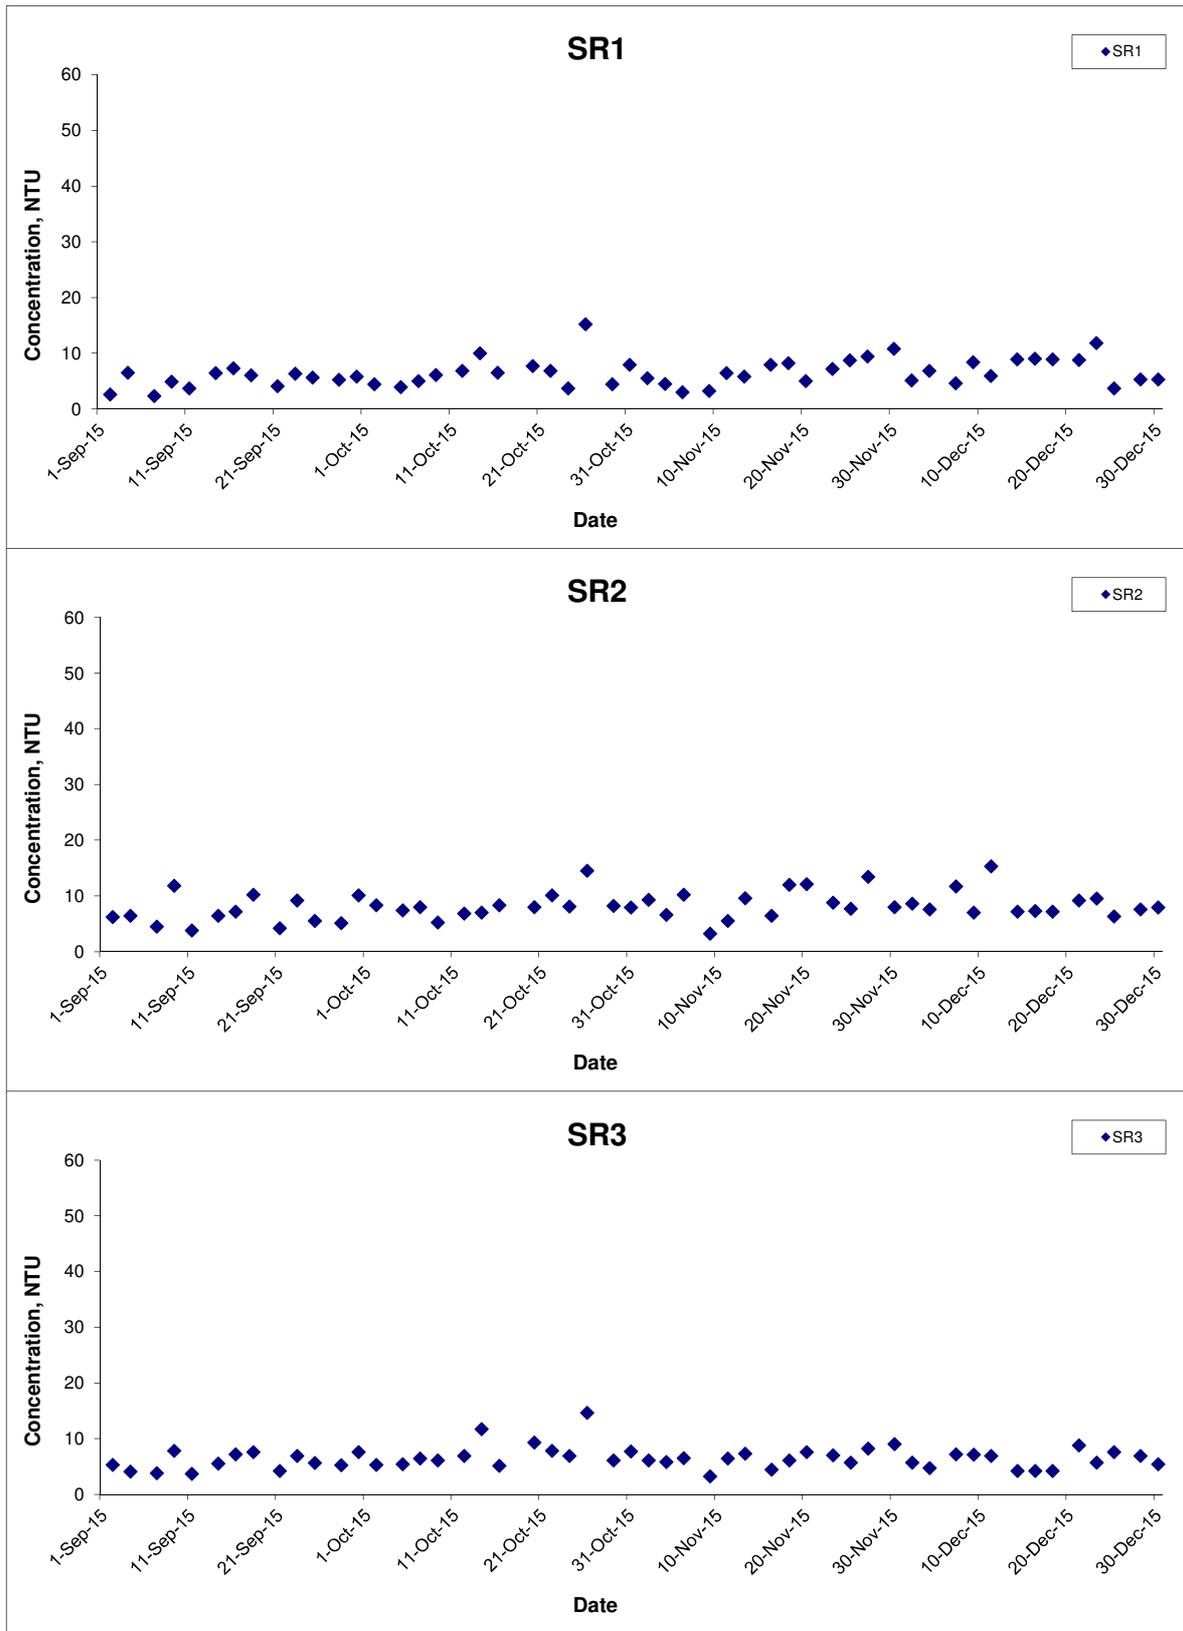


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Flood Tide

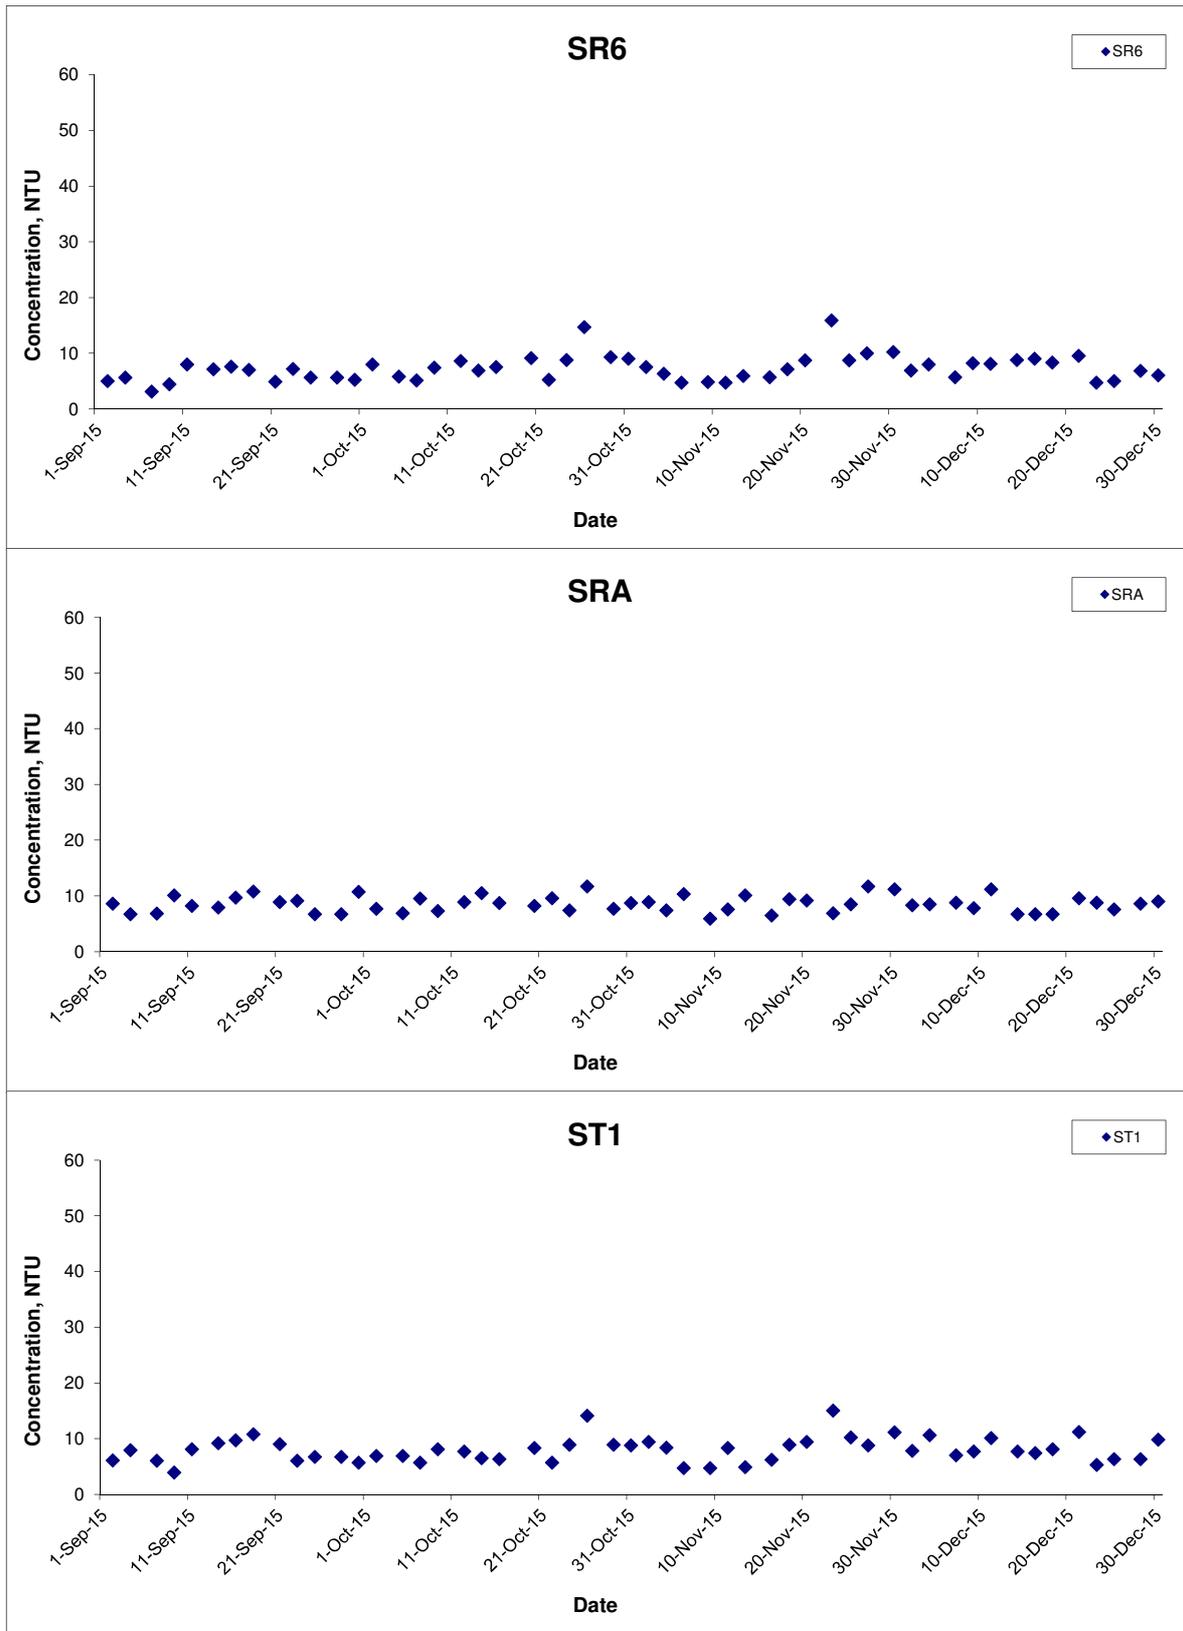


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Flood Tide

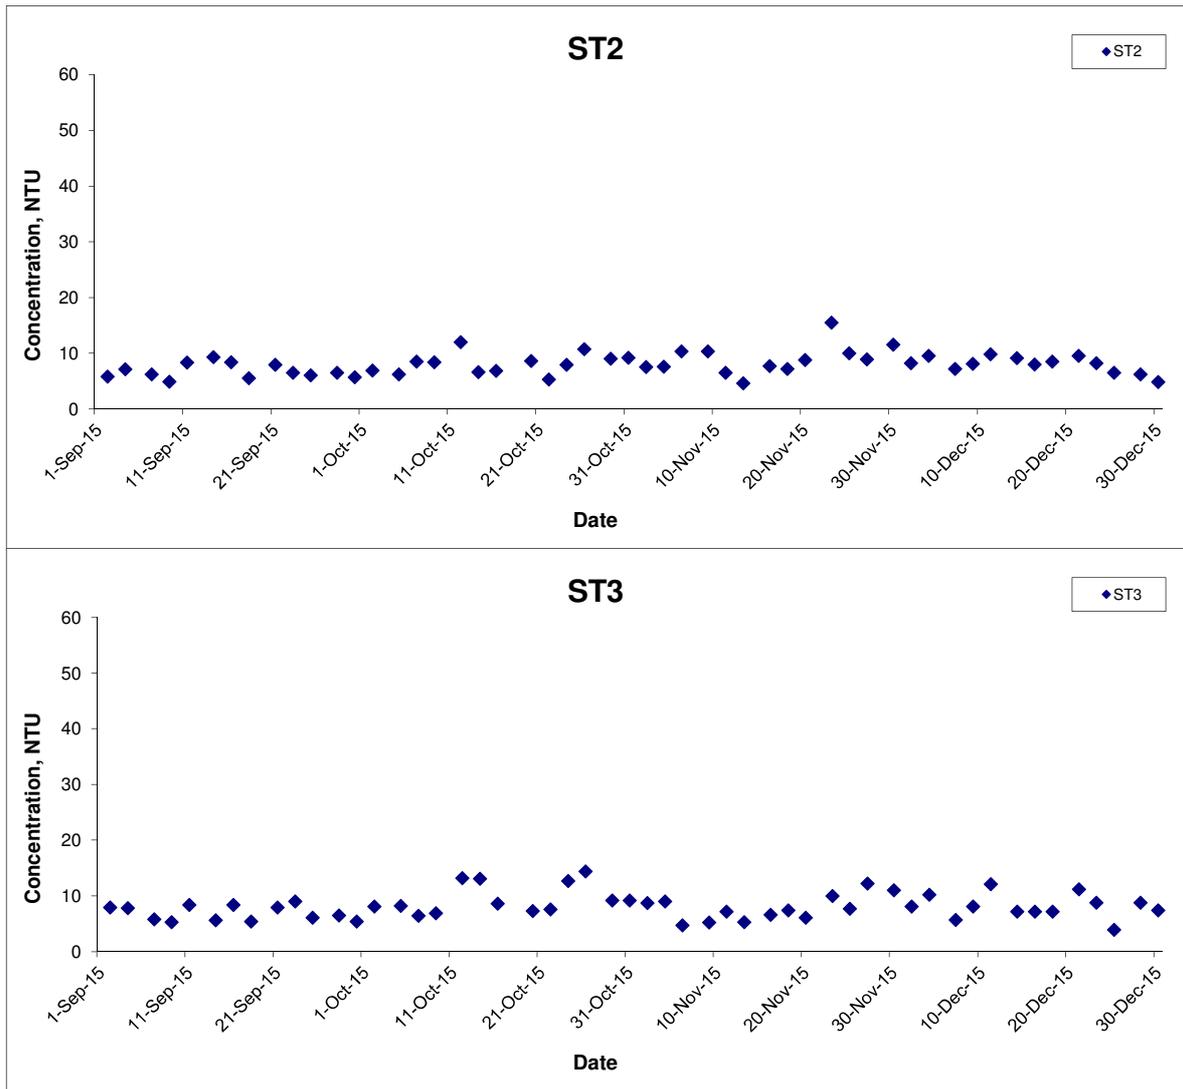


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Ebb Tide

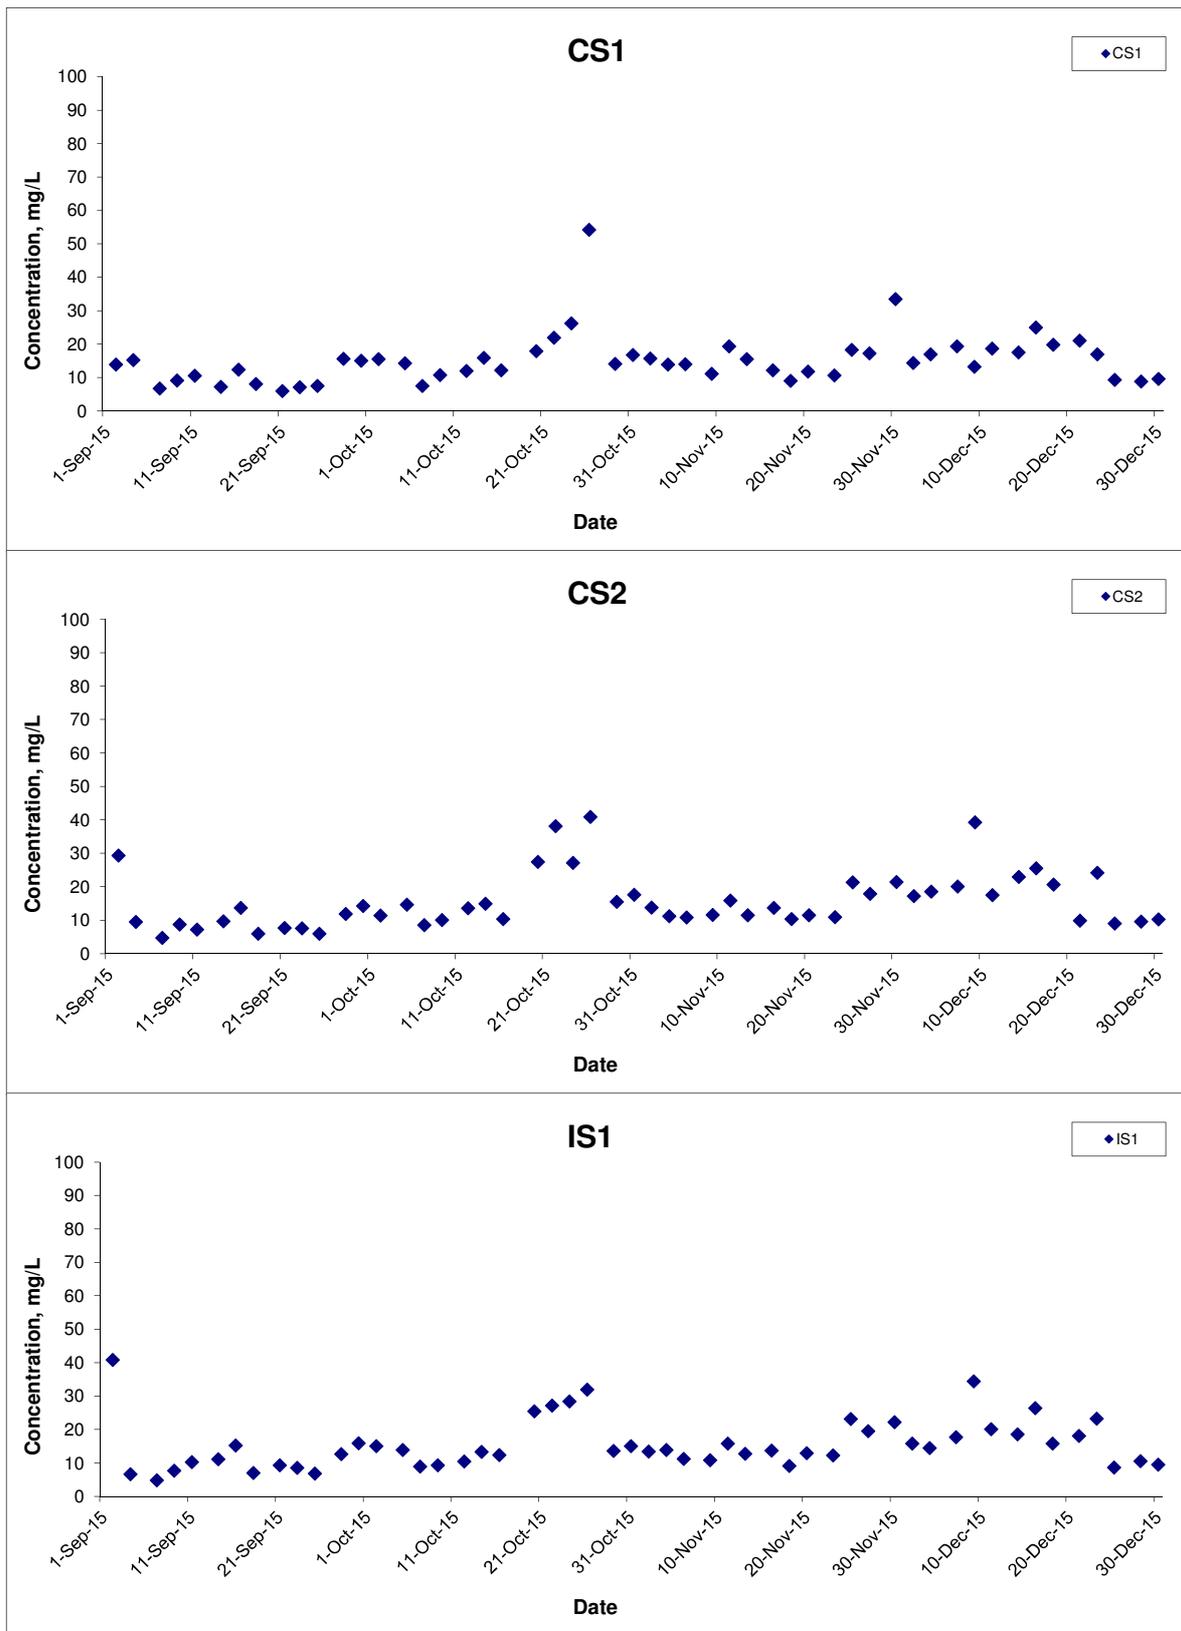


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Ebb Tide

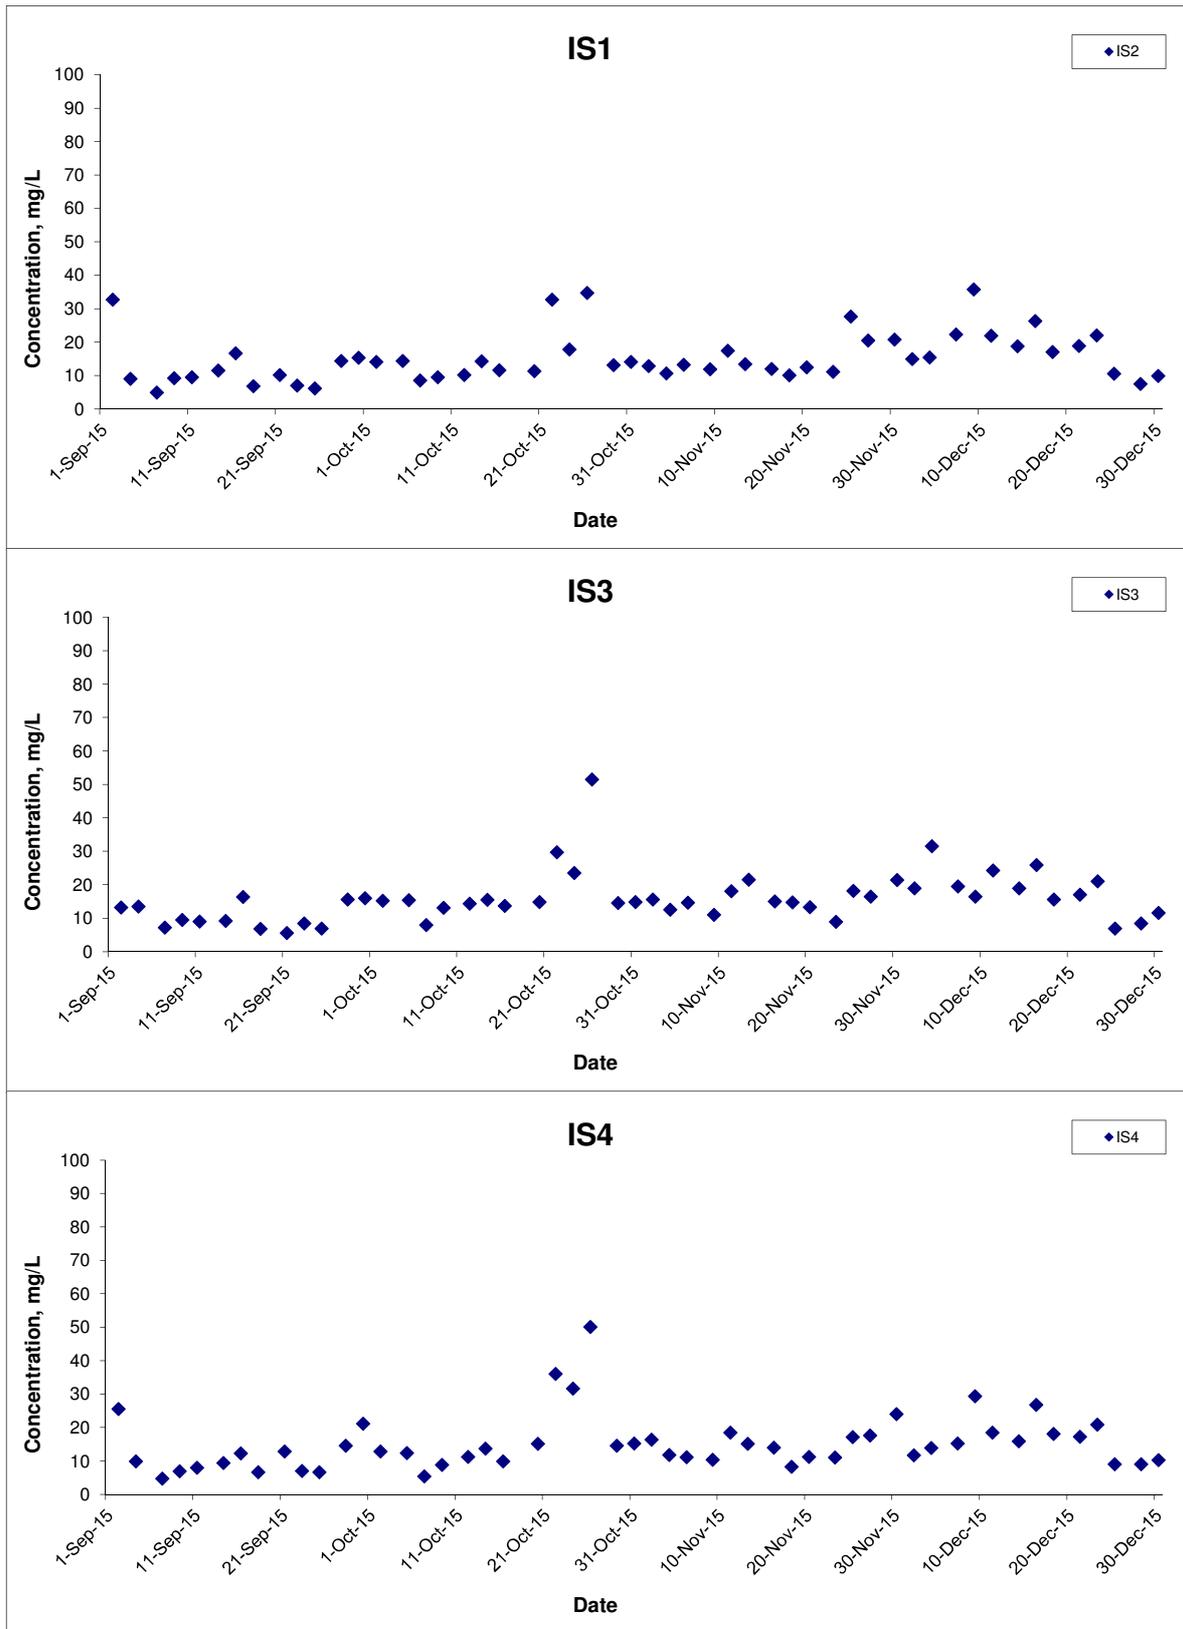


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Ebb Tide

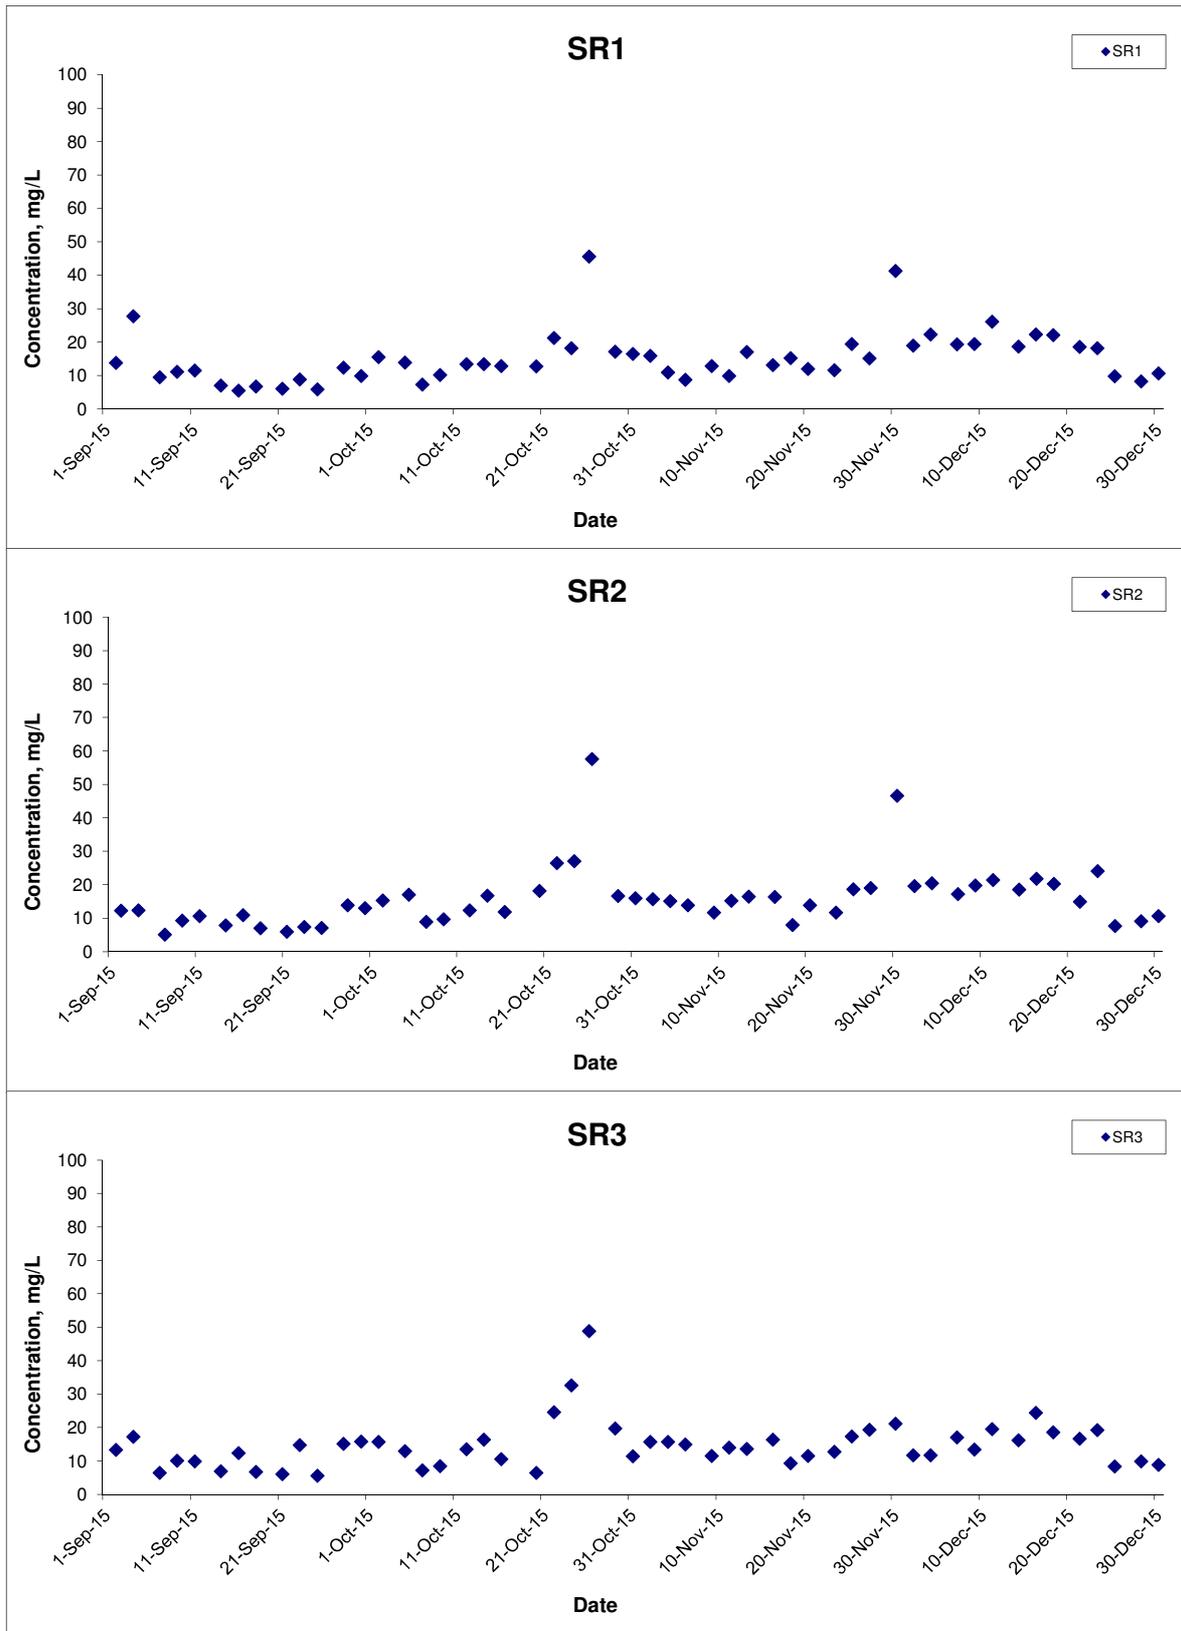


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Ebb Tide

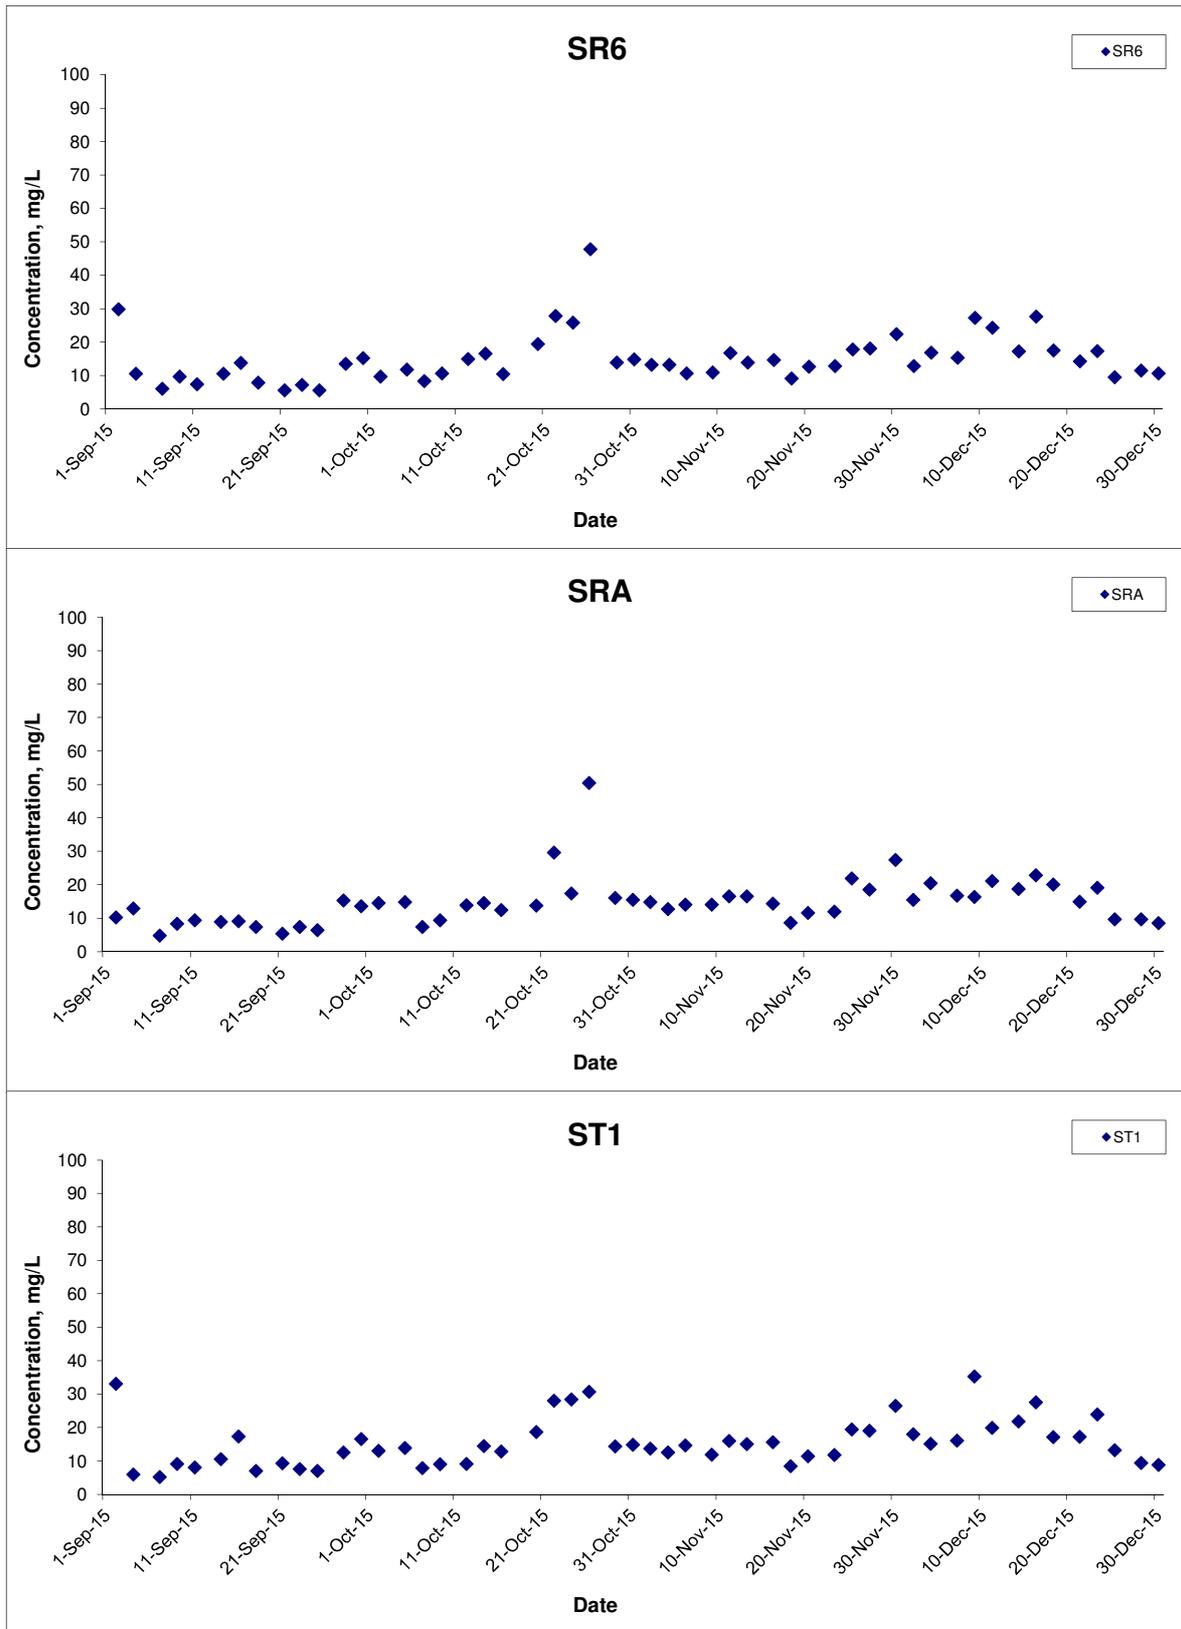


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Ebb Tide

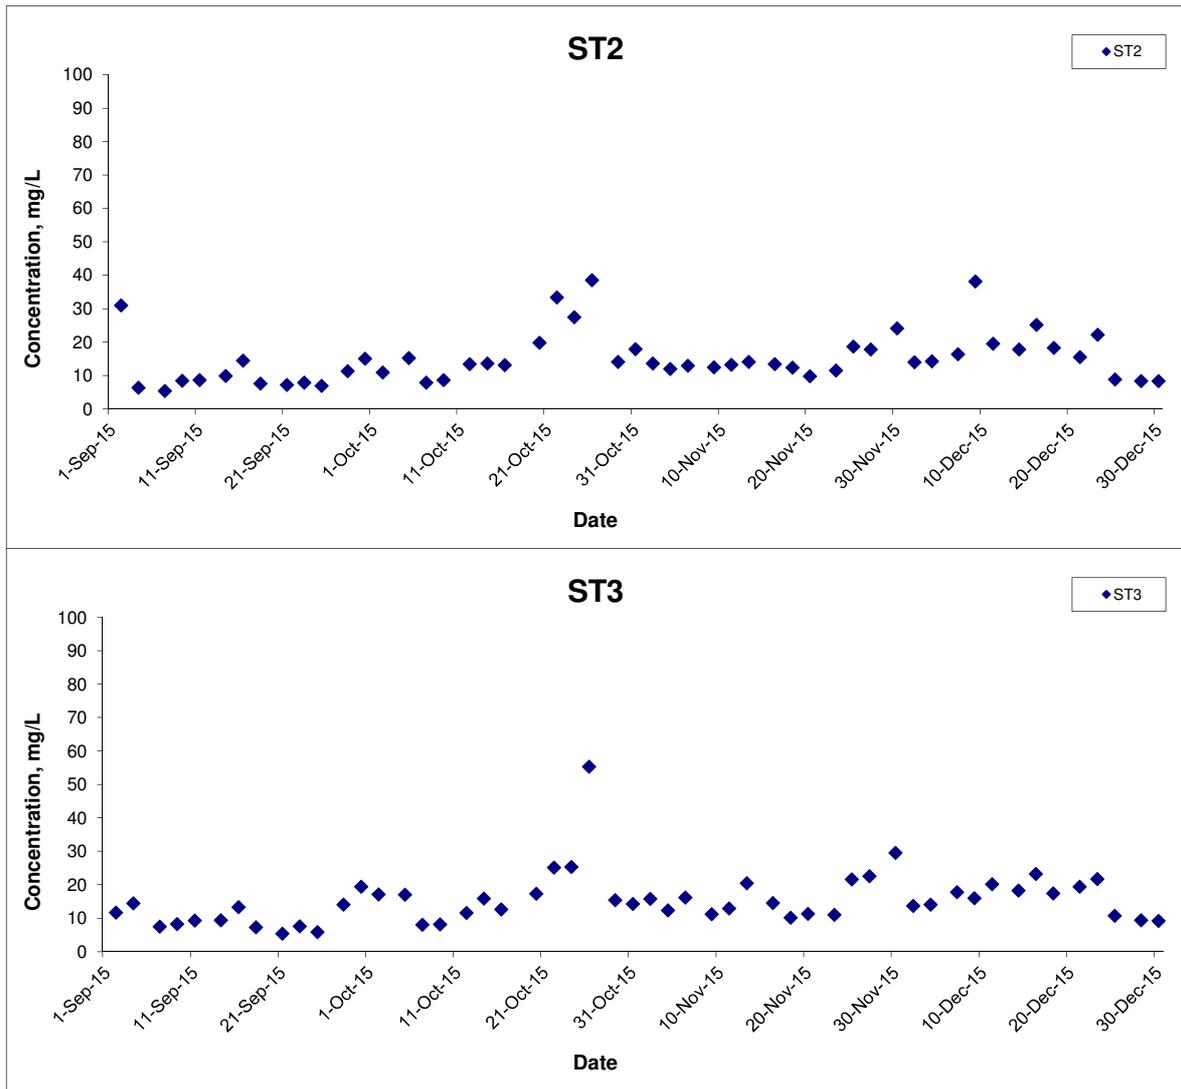


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Flood Tide

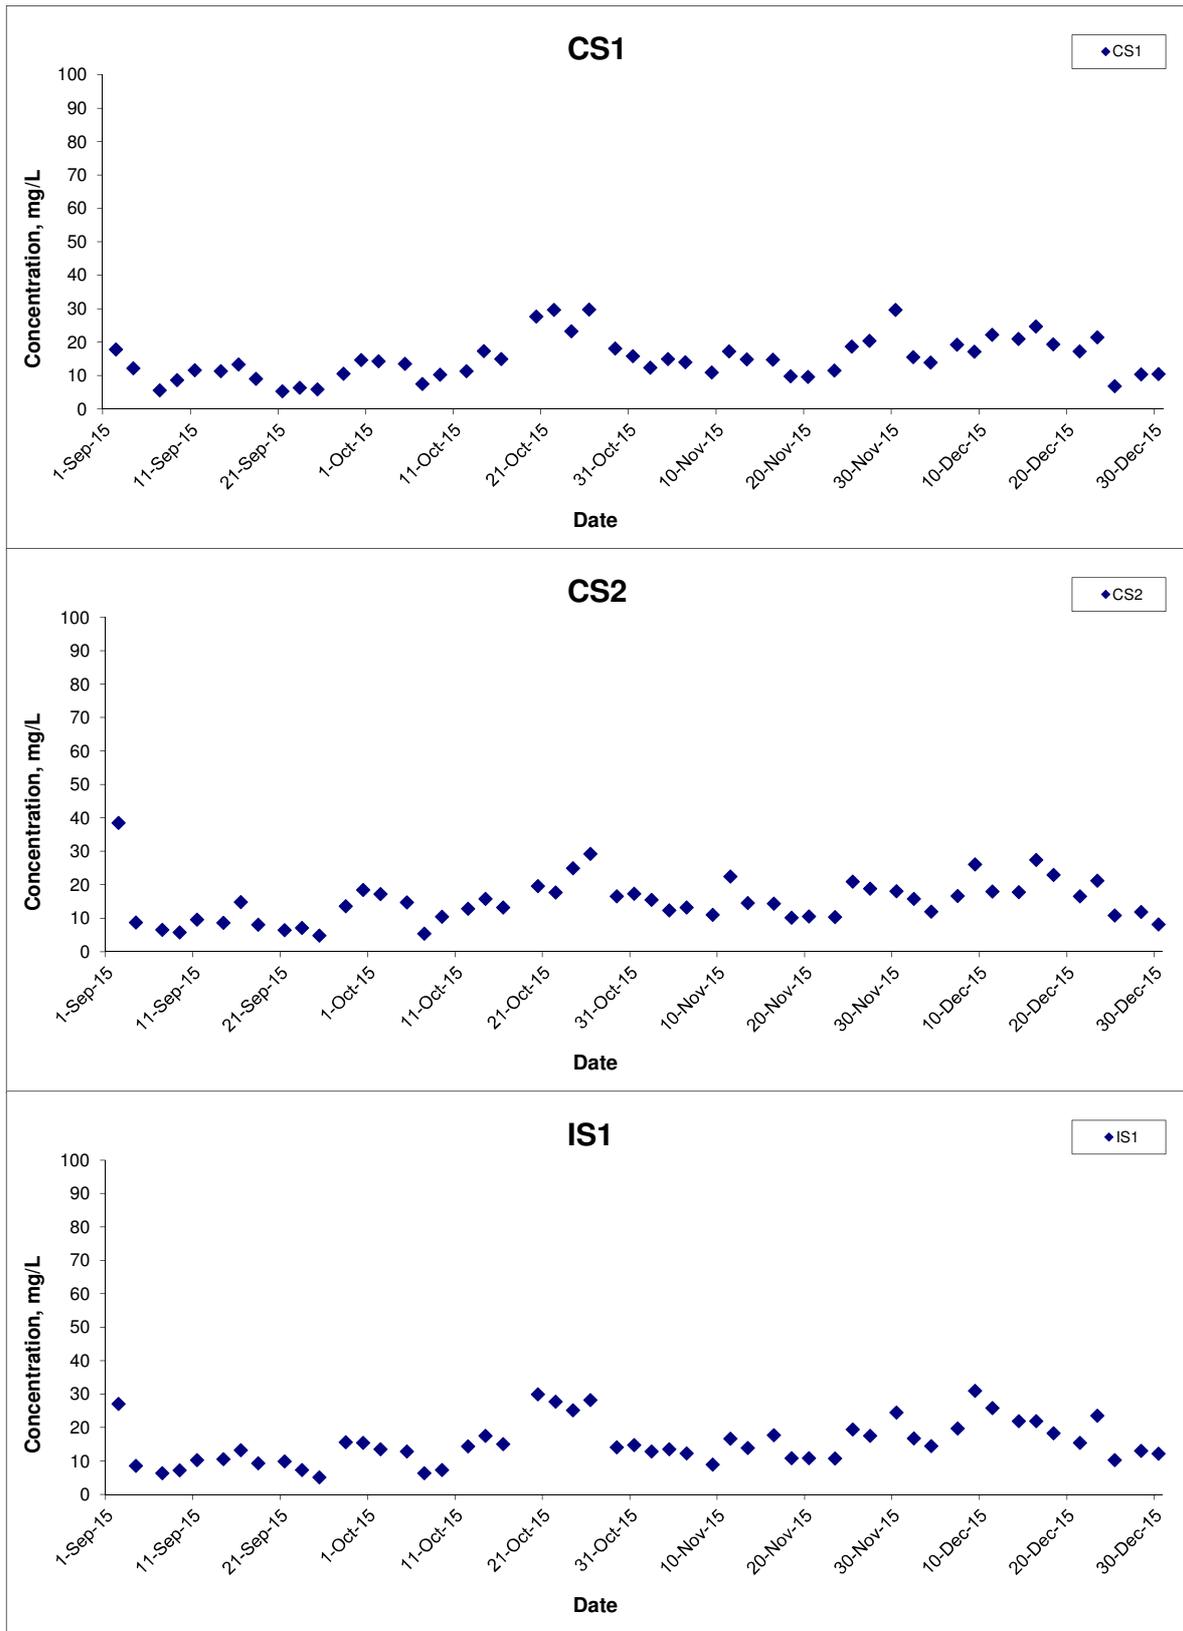


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Flood Tide

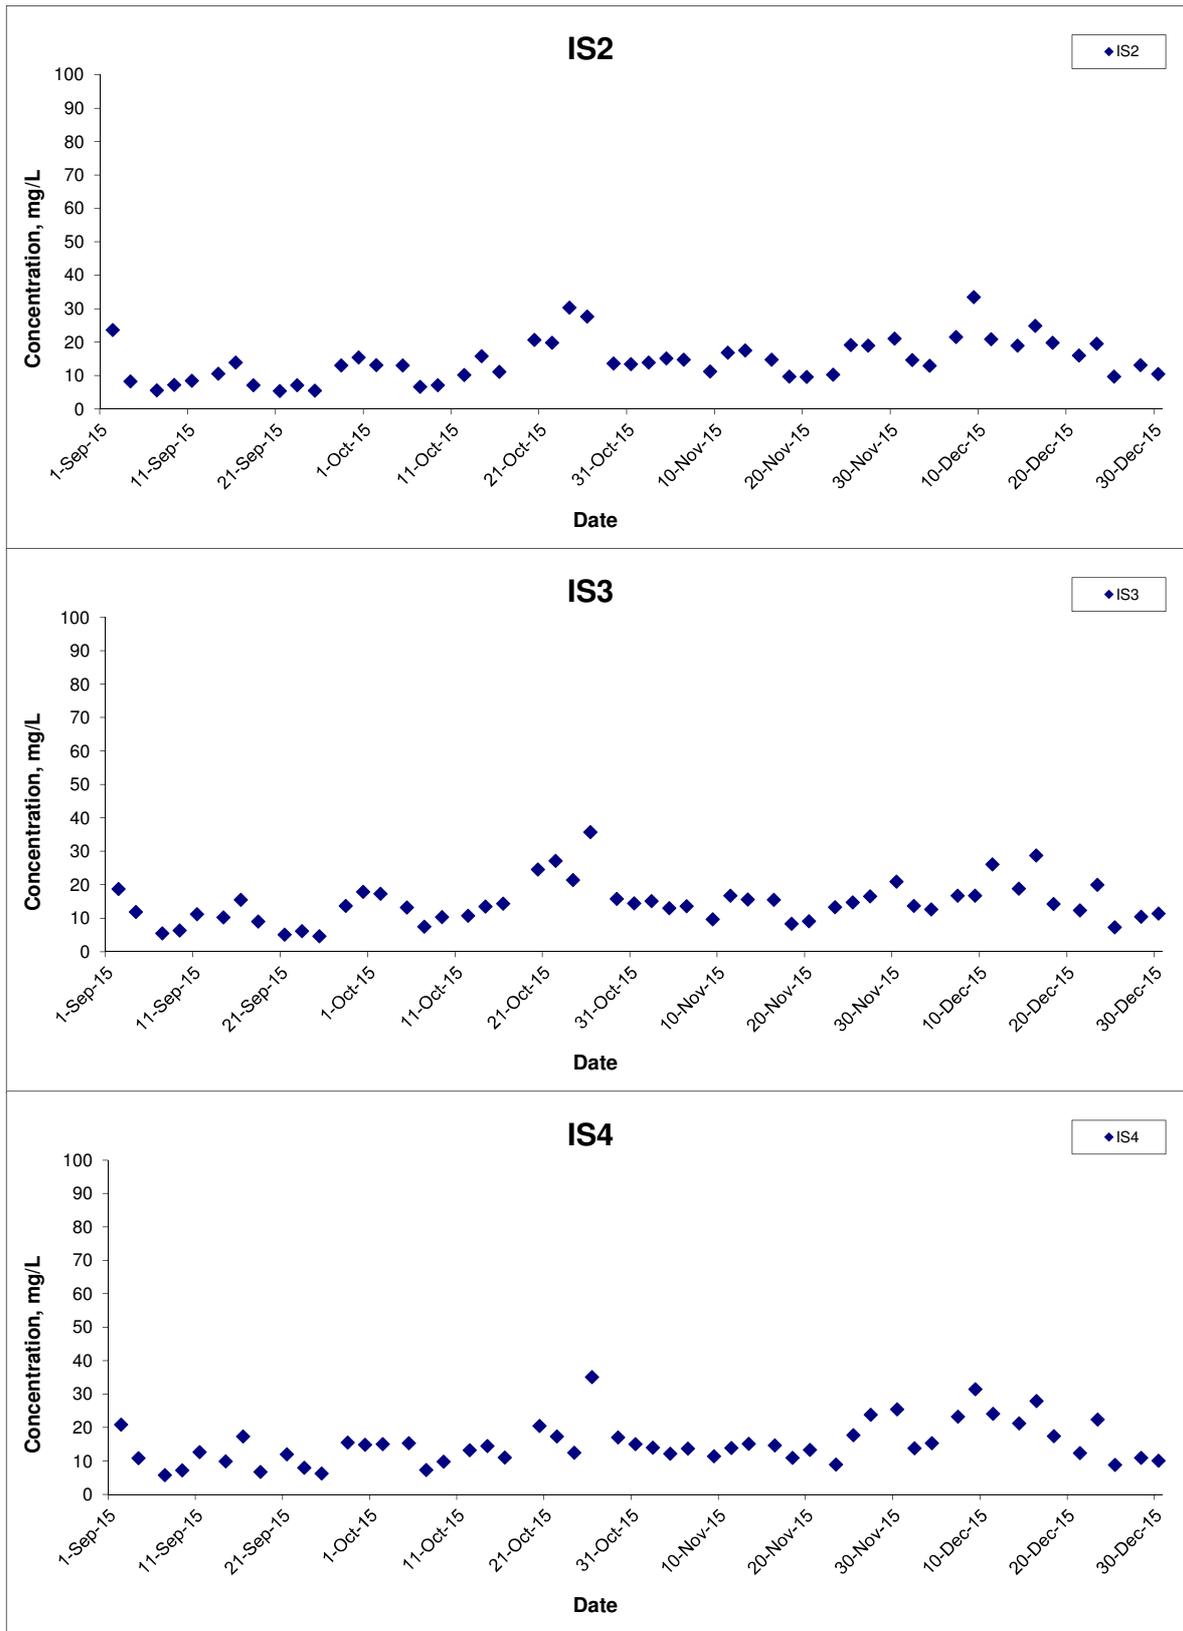


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Flood Tide

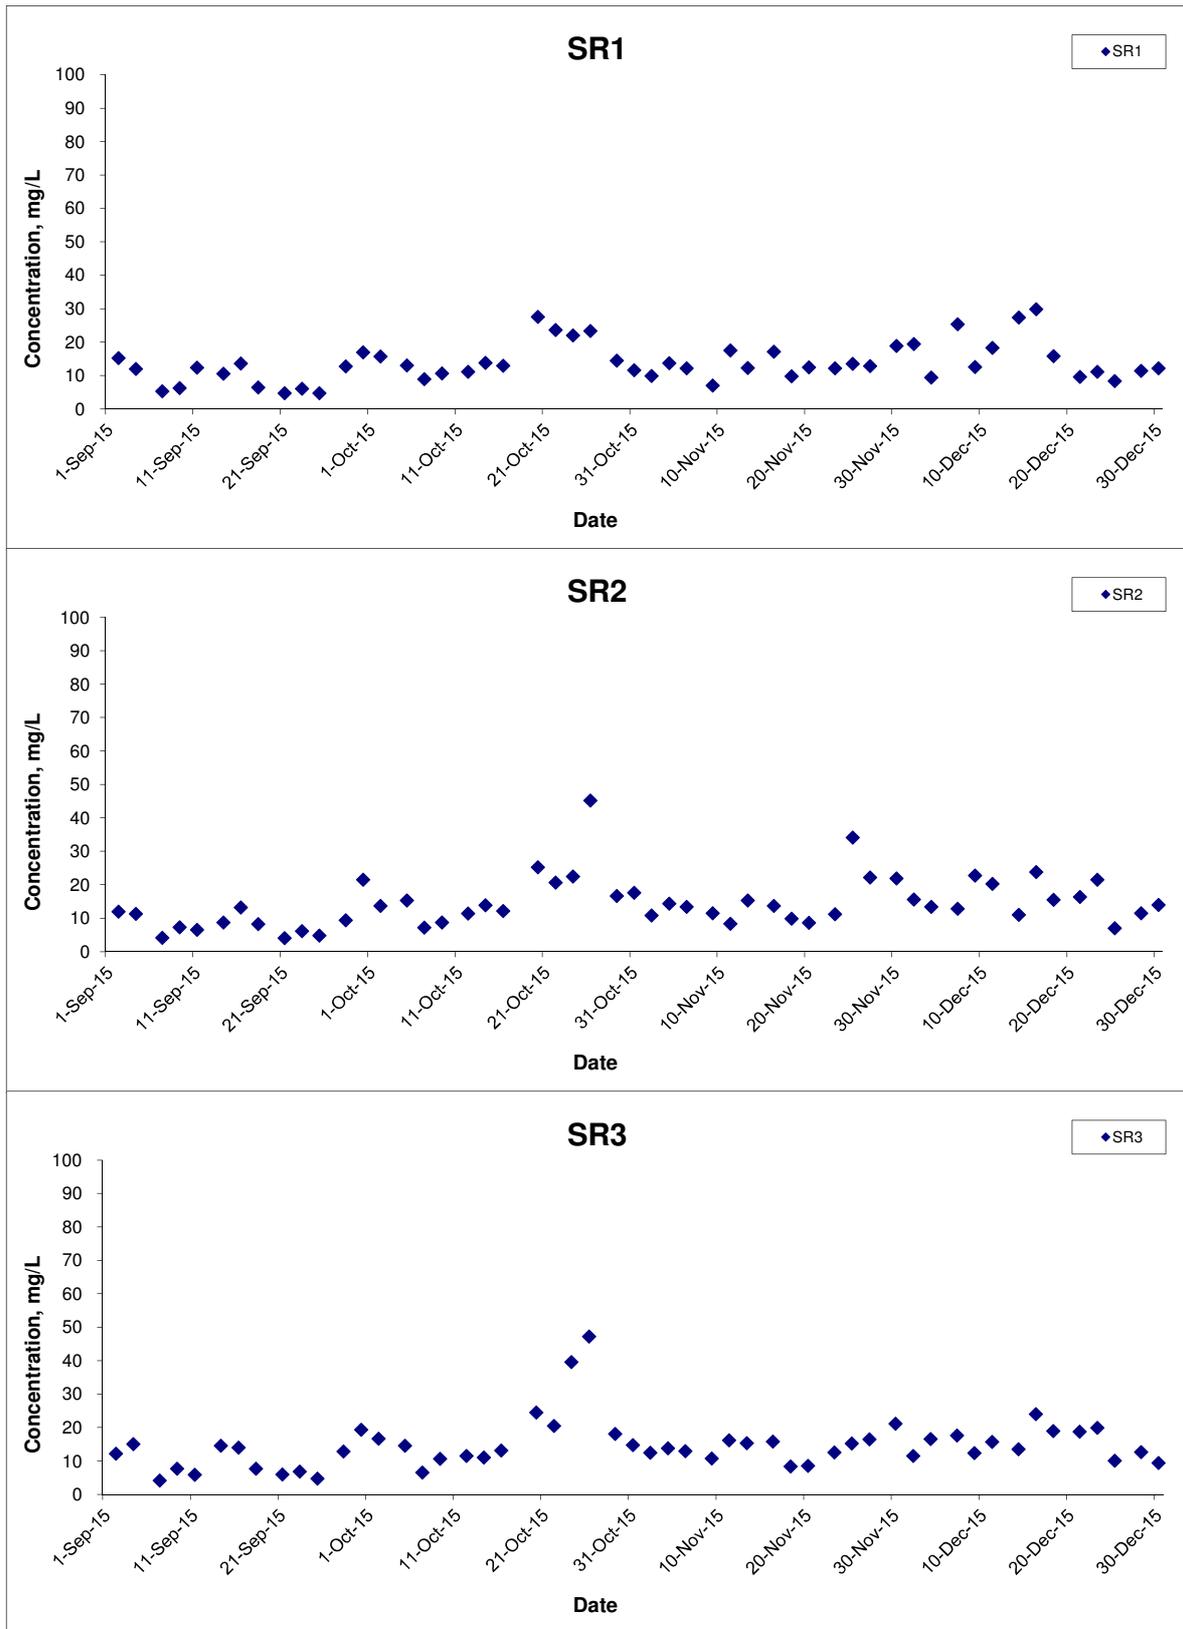


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Flood Tide

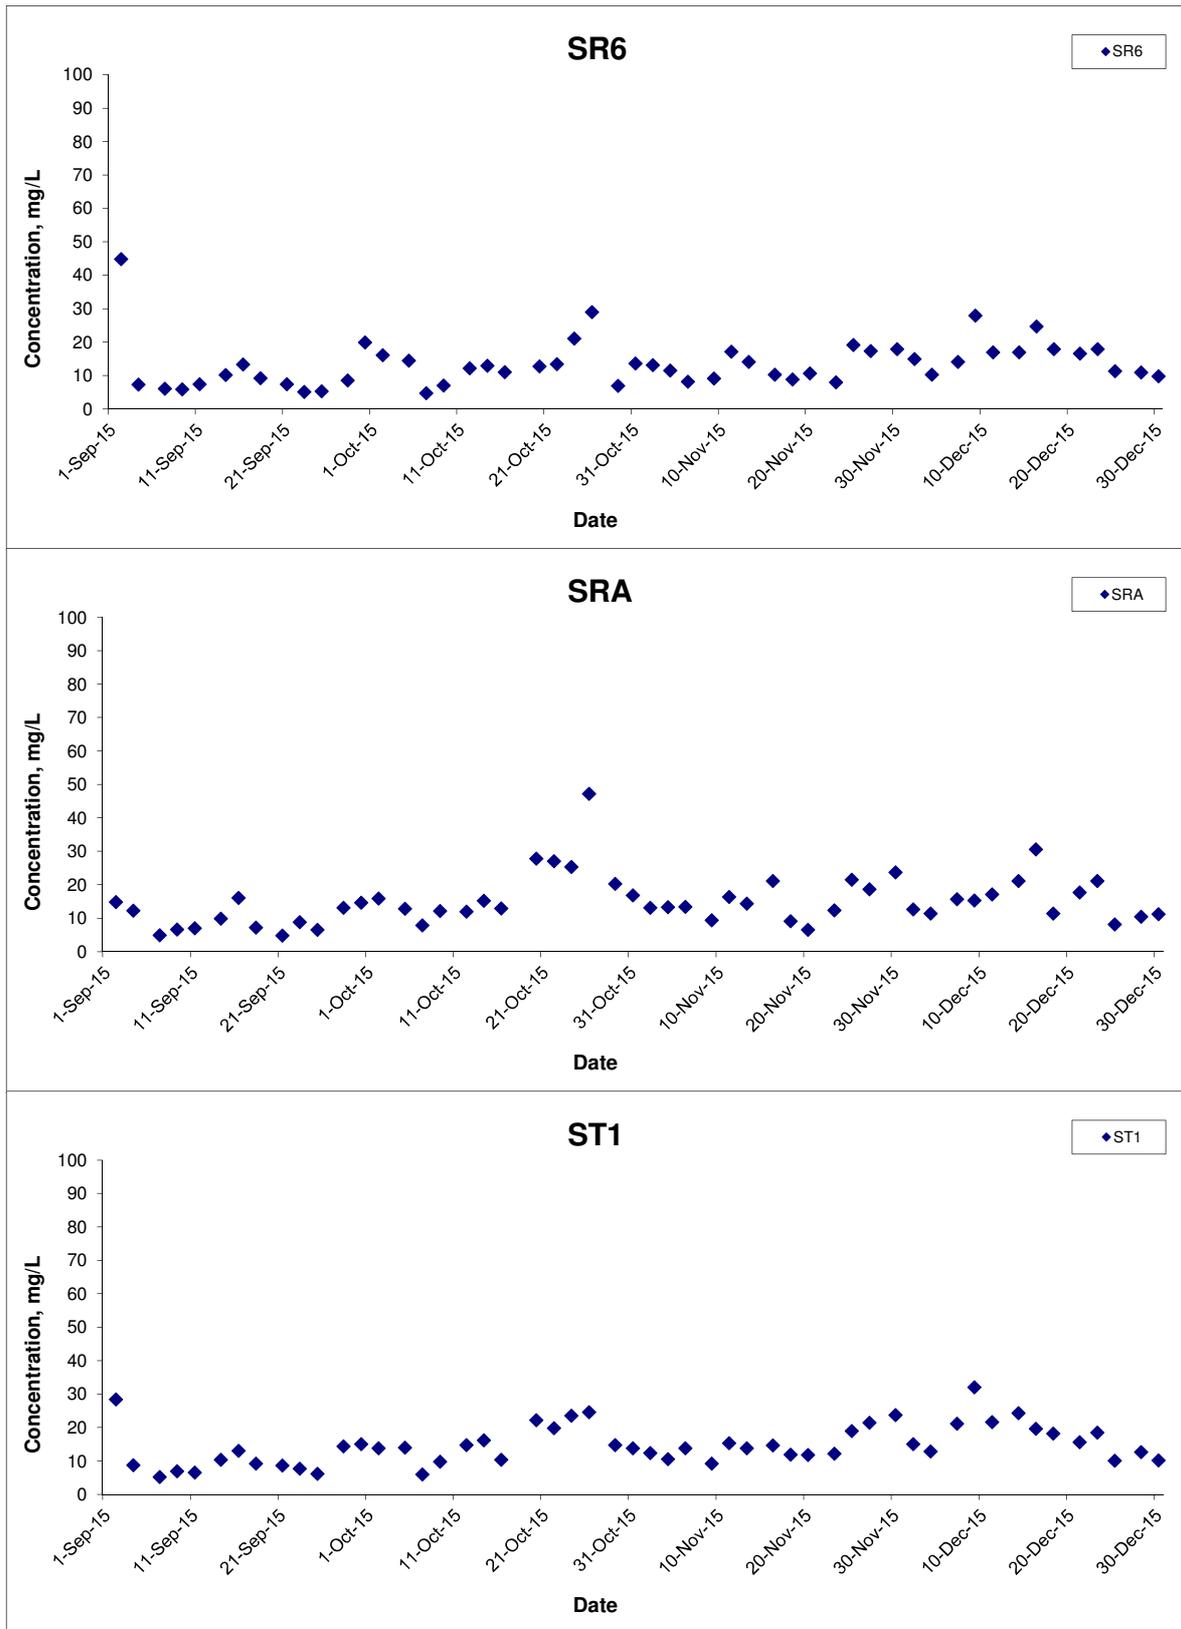


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Dec 15

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Flood Tide

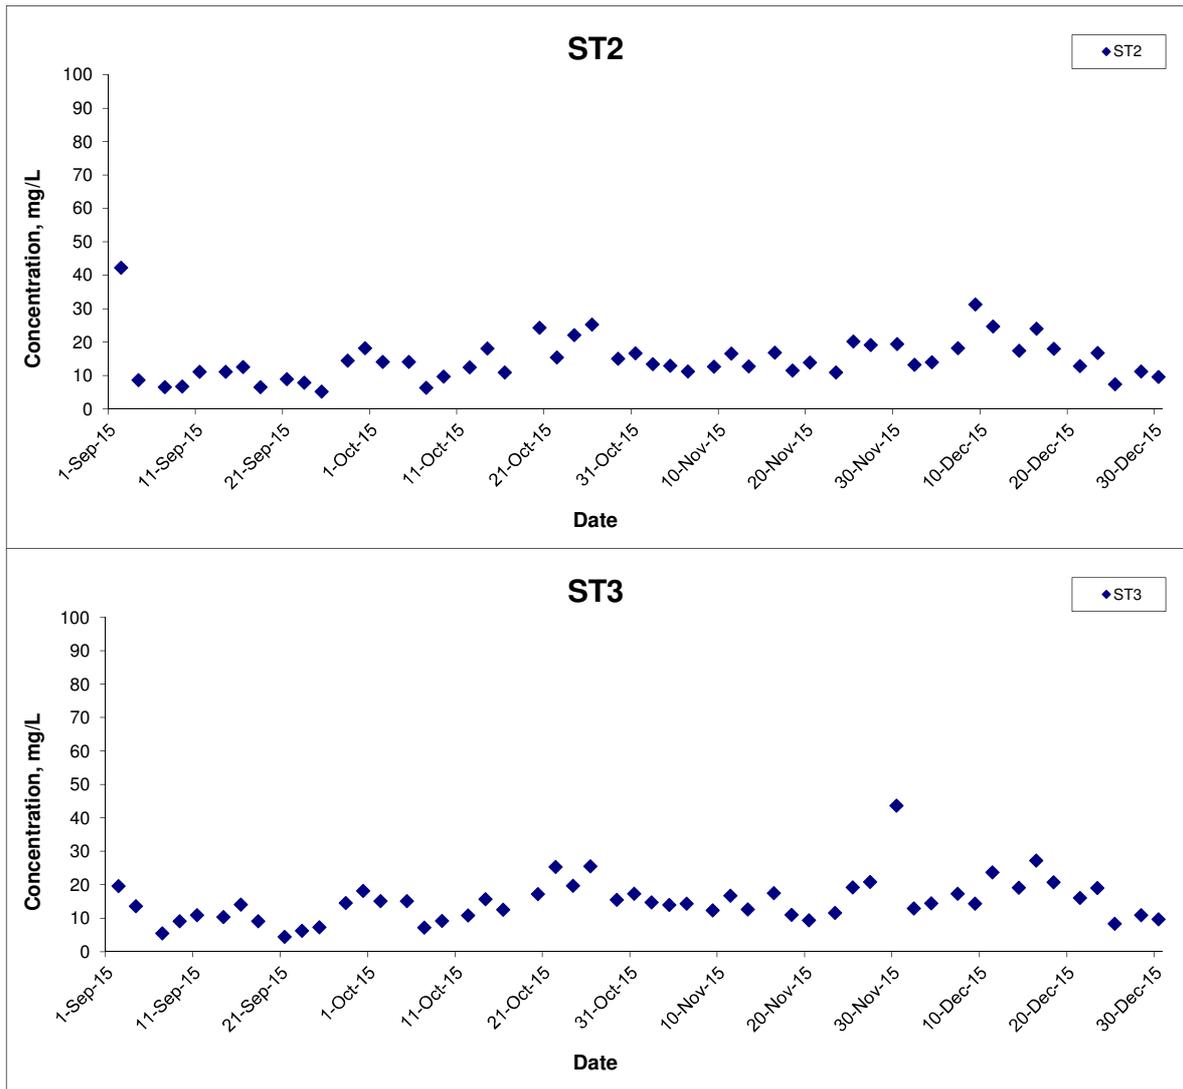

Title	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill	Scale	N.T.S	Project No.	MA12014	CINOTECH
	Graphical Presentation of Water Quality Monitoring Results	Date	Dec 15	Appendix	H	

**APPENDIX I
DOLPHIN MONITORING REPORT
(LINE TRANSECT)**

Contract No. HY/2011/09
Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road –
Section between HKSAR Boundary and Scenic Hill Dolphin
Monthly Monitoring

35th Monthly Progress Report (December 2015)

Submitted by

Samuel K.Y. Hung, Ph.D., Hong Kong Cetacean Research Project

18 December 2015

1. Introduction

- 1.1. The Hong Kong Link Road (HKLR) serves to connect the Hong Kong-Zhuhai-Macao Bridge (HZMB) Main Bridge at the Hong Kong Special Administrative Region (HKSAR) Boundary and the HZMB Hong Kong Boundary Crossing Facilities (HKBCF) located at the northeastern waters of the Hong Kong International Airport.
- 1.2. According to the updated Environmental Monitoring and Audit (EM&A) Manual (for HKLR), monthly line-transect vessel surveys for Chinese White Dolphin should be conducted to cover the West Lantau survey area as in AFCD annual marine mammal monitoring programme.
- 1.3. Since November 2012, Hong Kong Cetacean Research Project (HKCRP) has been commissioned by Dragages – China Harbour – VSL JV to conduct this 34-month dolphin monitoring study in order to collect data on Chinese White Dolphins during the construction phase (i.e. impact period) of the HKLR09 project in West Lantau (WL) survey area, and to analyze the collected survey data to monitor distribution, encounter rate, abundance, activities and occurrence of dolphin calves. Photo-identification will also be collected from individual Chinese White Dolphins to examine their individual range patterns and core area use.
- 1.4. From the monitoring results, any changes in dolphin occurrence within the study area will be examined for possible causes, and appropriate actions and additional mitigation measures will be recommended as necessary.

1.5. This report is the 35th monthly progress report under the HKLR09 construction phase dolphin monitoring programme, summarizing the results of the survey findings during the month of December 2015.

2. Monitoring Methodology

2.1. Vessel-based Line-transect Survey

2.1.1. According to the requirement of the updated EM&A manual, dolphin monitoring programme should cover all transect lines in WL survey area (see Figure 1) twice per month throughout the entire construction period. The co-ordinates of all transect lines are shown in Table 1.

Table 1. Co-ordinates of transect lines in WL survey area

Line No.		Easting	Northing		Line No.		Easting	Northing
1	Start Point	803750	818500		7	Start Point	800200	810450
1	End Point	803750	815500		7	End Point	801400	810450
2	Start Point	803750	815500		8	Start Point	801300	809450
2	End Point	802940	815500		8	End Point	799750	809450
3	Start Point	802550	814500		9	Start Point	799400	808450
3	End Point	803700	814500		9	End Point	801430	808450
4	Start Point	803120	813600		10	Start Point	801500	807450
4	End Point	801640	813600		10	End Point	799600	807450
5	Start Point	801100	812450		11	Start Point	800300	806500
5	End Point	802900	812450		11	End Point	801750	806500
6	Start Point	802400	811500		12	Start Point	801760	805450
6	End Point	800660	811500		12	End Point	800700	805450

2.1.2. The survey team used standard line-transect methods (Buckland et al. 2001) to conduct the systematic vessel surveys, and followed the same technique of data collection that has been adopted over the last 16 years of marine mammal monitoring surveys in Hong Kong developed by HKCRP (see Hung

2012). For each monitoring vessel survey, a 15-m inboard vessel with an open upper deck (about 4.5 m above water surface) was used to make observations from the flying bridge area.

- 2.1.3. Two experienced observers (a data recorder and a primary observer) made up the on-effort survey team, and the survey vessel transited different transect lines at a constant speed of 13-15 km per hour. The data recorder searched with unaided eyes and filled out the datasheets, while the primary observer searched for dolphins and porpoises continuously through 7 x 50 *Fujinon* marine binoculars. Both observers searched the sea ahead of the vessel, between 270° and 90° (in relation to the bow, which is defined as 0°). One to two additional experienced observers were available on the boat to work in shift (i.e. rotate every 30 minutes) in order to minimize fatigue of the survey team members. All observers were experienced in small cetacean survey techniques and identifying local cetacean species.
- 2.1.4. During on-effort survey periods, the survey team recorded effort data including time, position (latitude and longitude), weather conditions (Beaufort sea state and visibility), and distance traveled in each series (a continuous period of search effort) with the assistance of a handheld GPS.
- 2.1.5. Data including time, position and vessel speed were also automatically and continuously logged by handheld GPS throughout the entire survey for subsequent review.
- 2.1.6. When dolphins were sighted, the survey team would end the survey effort, and immediately record the initial sighting distance and angle of the dolphin group from the survey vessel, as well as the sighting time and position. Then the research vessel was diverted from its course to approach the animals for species identification, group size estimation, assessment of group composition, and behavioural observations. The perpendicular distance (PSD) of the dolphin group to the transect line was later calculated from the initial sighting distance and angle.
- 2.1.7. Survey effort being conducted along the parallel transect lines that were perpendicular to the coastlines (as indicated in Figure 1) was labeled as “primary” survey effort, while the survey effort being conducted along the connecting lines between parallel lines was labeled as “secondary” survey

effort. According to HKCRP long-term dolphin monitoring data, encounter rates of Chinese white dolphins deduced from effort and sighting data collected along primary and secondary lines were similar in survey areas around Lantau Island. Therefore, primary and secondary survey effort were both presented as on-effort survey effort in this report.

- 2.1.8. Encounter rates of Chinese white dolphins (number of on-effort sightings per 100 km of survey effort) were calculated in WL survey area in relation to the amount of survey effort conducted during each month of monitoring survey. Only data collected under Beaufort 3 or below condition would be used for encounter rate analysis. Dolphin encounter rates were calculated using primary survey effort alone, as well as the combined survey effort from both primary and secondary lines.

2.2. *Photo-identification Work*

- 2.2.1. When a group of Chinese White Dolphins were sighted during the line-transect survey, the survey team would end effort and approach the group slowly from the side and behind to take photographs of them. Every attempt was made to photograph every dolphin in the group, and even photograph both sides of the dolphins, since the colouration and markings on both sides may not be symmetrical.
- 2.2.2. A professional digital camera (*Canon* EOS 7D or 60D model) equipped with long telephoto lenses (100-400 mm zoom) were available on board for researchers to take sharp, close-up photographs of dolphins as they surfaced. The images were shot at the highest available resolution and stored on Compact Flash memory cards for downloading onto a computer.
- 2.2.3. All digital images taken in the field were first examined, and those containing potentially identifiable individuals were sorted out. These photographs would then be examined in greater detail, and were carefully compared to the existing Chinese White Dolphin photo-identification catalogue maintained by HKCRP since 1995.
- 2.2.4. Chinese White Dolphins can be identified by their natural markings, such as nicks, cuts, scars and deformities on their dorsal fin and body, and their unique spotting patterns were also used as secondary identifying features (Jefferson 2000).

- 2.2.5. All photographs of each individual were then compiled and arranged in chronological order, with data including the date and location first identified (initial sighting), re-sightings, associated dolphins, distinctive features, and age classes entered into a computer database.

3. Monitoring Results

3.1. Vessel-based Line-transect Survey

- 3.1.1. During the monitoring month of December 2015, two complete sets of systematic line-transect vessel surveys were conducted on the 3rd and 10th, to cover all transect lines in WL survey area twice. The survey routes of each survey day are presented in Figures 2-3.
- 3.1.2. From these surveys, a total of 66.61 km of survey effort was collected, with 82.8% of the total survey effort being conducted under favourable weather conditions (i.e. Beaufort Sea State 3 or below with good visibility) (Appendix I).
- 3.1.3. Moreover, the total survey effort conducted on primary lines (the horizontal lines perpendicular to the coastlines) was 45.11 km, while the effort on secondary lines (the lines connecting the primary lines) was 21.50 km.
- 3.1.4. During the monitoring surveys conducted in December 2015, seven groups of 21 Chinese White Dolphins were sighted. All dolphin sightings were made during on-effort search, and six of the seven on-effort sightings were made on primary lines (Appendix II). None of the dolphin groups was associated with an operating fishing vessel.
- 3.1.5. Distribution of the seven dolphin sightings made during December's surveys is shown in Figure 4. These sightings were scattered from Tai O Peninsula to Fan Lau with no particular concentration, and it appeared that more sightings were made at the offshore waters than inshore waters. None of the dolphin sightings were made near the HKLR09 alignment during this monitoring month (Figure 4).
- 3.1.6. During the December's surveys, encounter rates of Chinese White Dolphins deduced from the survey effort and on-effort sighting data made under favourable conditions (Beaufort 3 or below) are shown in Tables 2 & 3.

Table 2. Dolphin encounter rates (sightings per 100 km of survey effort) per set during December's surveys in West Lantau (WL)

		Encounter rate (STG) (no. of on-effort dolphin sightings per 100 km of survey effort)	Encounter rate (ANI) (no. of dolphins from all on-effort sightings per 100 km of survey effort)
		Primary Lines Only	Primary Lines Only
West Lantau	Set 1: December 3 rd	12.4	62.2
	Set 2: December 10 th	14.1	33.0

Table 3. Overall dolphin encounter rates (sightings per 100 km of survey effort) in December's surveys on primary lines only as well as both primary lines and secondary lines in West Lantau (WL)

	Encounter rate (STG) (no. of on-effort dolphin sightings per 100 km of survey effort)		Encounter rate (ANI) (no. of dolphins from all on-effort sightings per 100 km of survey effort)	
	Primary Lines Only	Both Primary and Secondary Lines	Primary Lines Only	Both Primary and Secondary Lines
West Lantau	13.4	10.9	45.5	34.5

3.1.7. The average group size of Chinese White Dolphins was 3.0 individuals per group during December's surveys, which was slightly lower than the ones in previous months of monitoring surveys.

3.1.8. Five of the seven dolphin groups were composed of only 1-2 animals, while the other two dolphin groups were moderate in size with five and eight animals respectively.

3.2. Photo-identification Work

3.2.1. A total of nine different individual Chinese White Dolphins were identified nine times during December's surveys (Appendices III and IV). All were sighted within their normal ranges as in the past.

3.2.2. Notably, none of these identified individuals were accompanied by their young calves during their re-sightings.

3.3. Conclusion

3.3.1. During this month of dolphin monitoring, marine construction activities have continued under this contract. However, no adverse impact on Chinese white dolphins was noticeable from general observations.

3.3.2. Due to the monthly variation in dolphin occurrence within the study area, it would be more appropriate to draw conclusion on whether any impacts on dolphins have been detected related to the construction activities of this project in the quarterly EM&A report, where comparison on distribution, group size and encounter rates of dolphins between the quarterly impact monitoring period (i.e. December 2015 to February 2016) and baseline monitoring period will be made.

4. References

- Buckland, S. T., Anderson, D. R., Burnham, K. P., Laake, J. L., Borchers, D. L., and Thomas, L. 2001. Introduction to distance sampling: estimating abundance of biological populations. Oxford University Press, London.
- Hung, S. K. 2012. Monitoring of marine mammals in Hong Kong waters – data collection: final report (2011-12). An unpublished report submitted to the Agriculture, Fisheries and Conservation Department of Hong Kong SAR Government, 120 pp.
- Hung, S. K. 2013. Monitoring of marine mammals in Hong Kong waters – data collection: inception report (2013-14). An unpublished report submitted to the Agriculture, Fisheries and Conservation Department of Hong Kong SAR Government.
- Jefferson, T. A. 2000. Population biology of the Indo-Pacific hump-backed dolphin in Hong Kong waters. Wildlife Monographs 144:1-65.

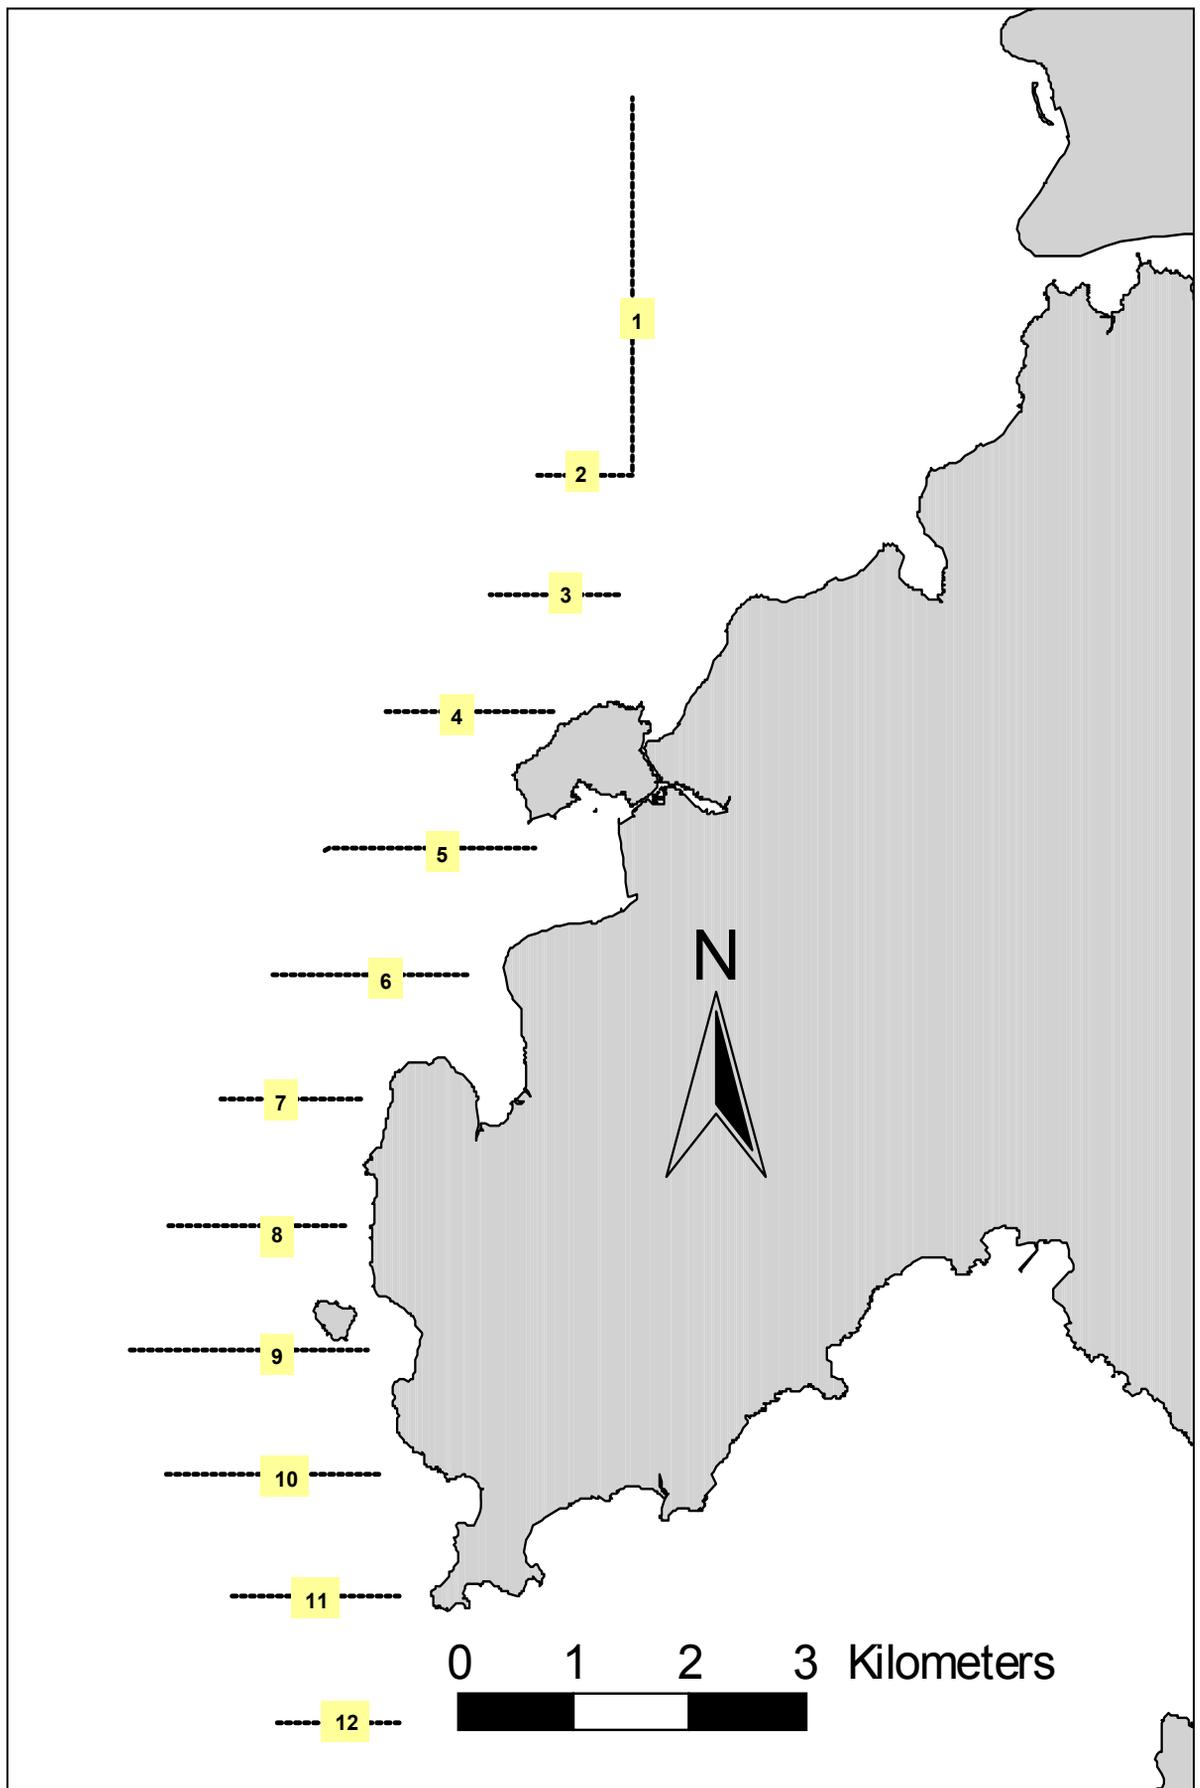


Figure 1. Transect Line Layout in West Lantau Survey Areas

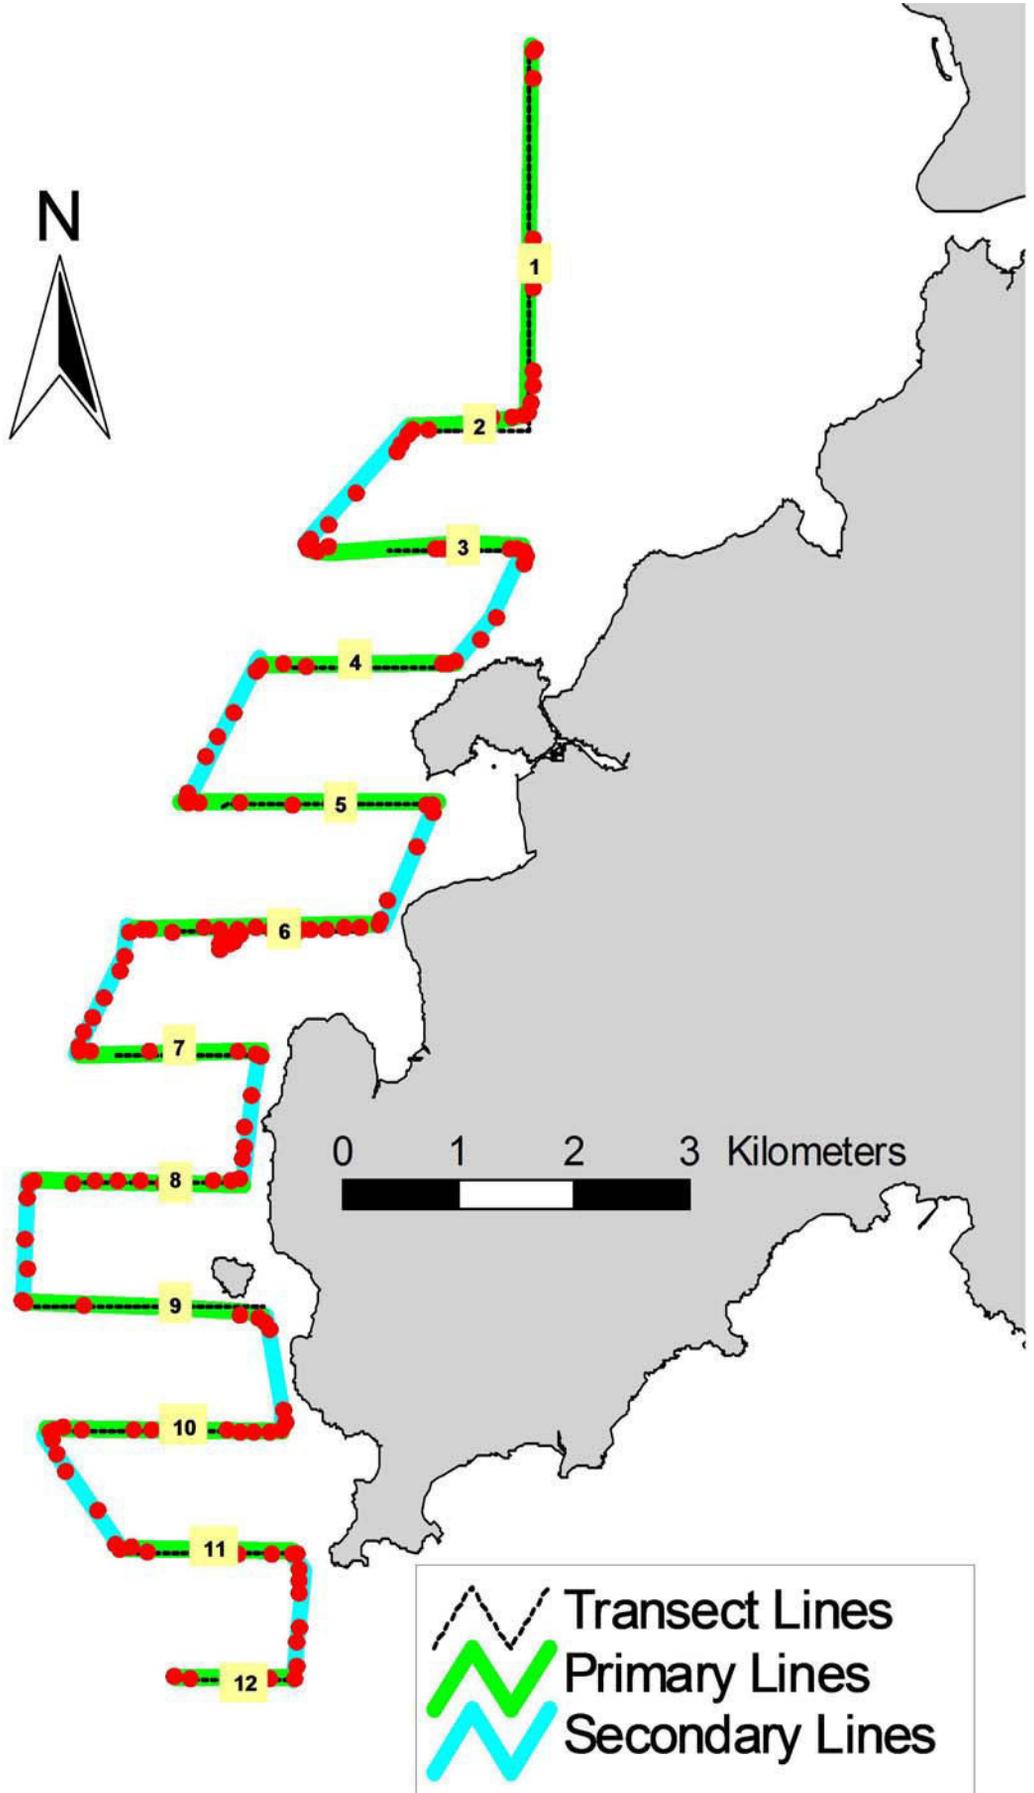


Figure 2. Survey Route on December 3rd, 2015 (note: red dots represent the tracked positions of survey boat logged continuously by GPS throughout the course of the survey)

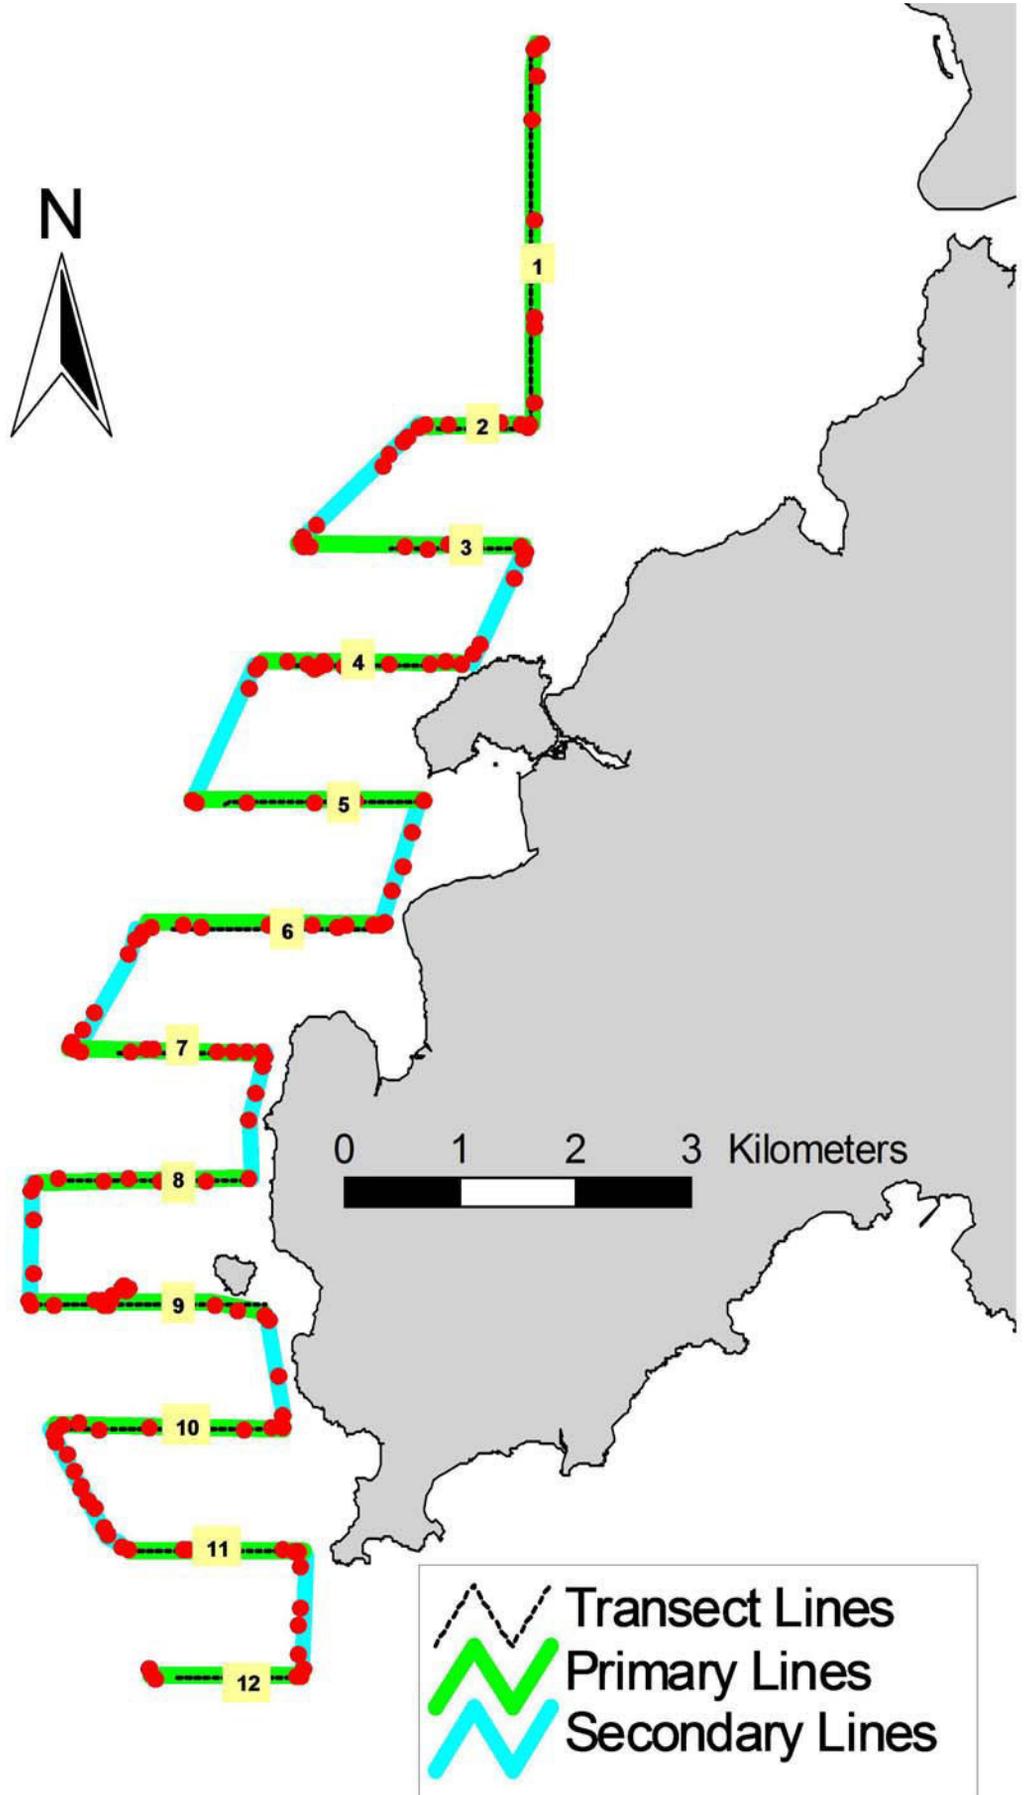


Figure 3. Survey Route on December 10th, 2015 (note: red dots represent the tracked positions of survey boat logged continuously by GPS throughout the course of the survey)

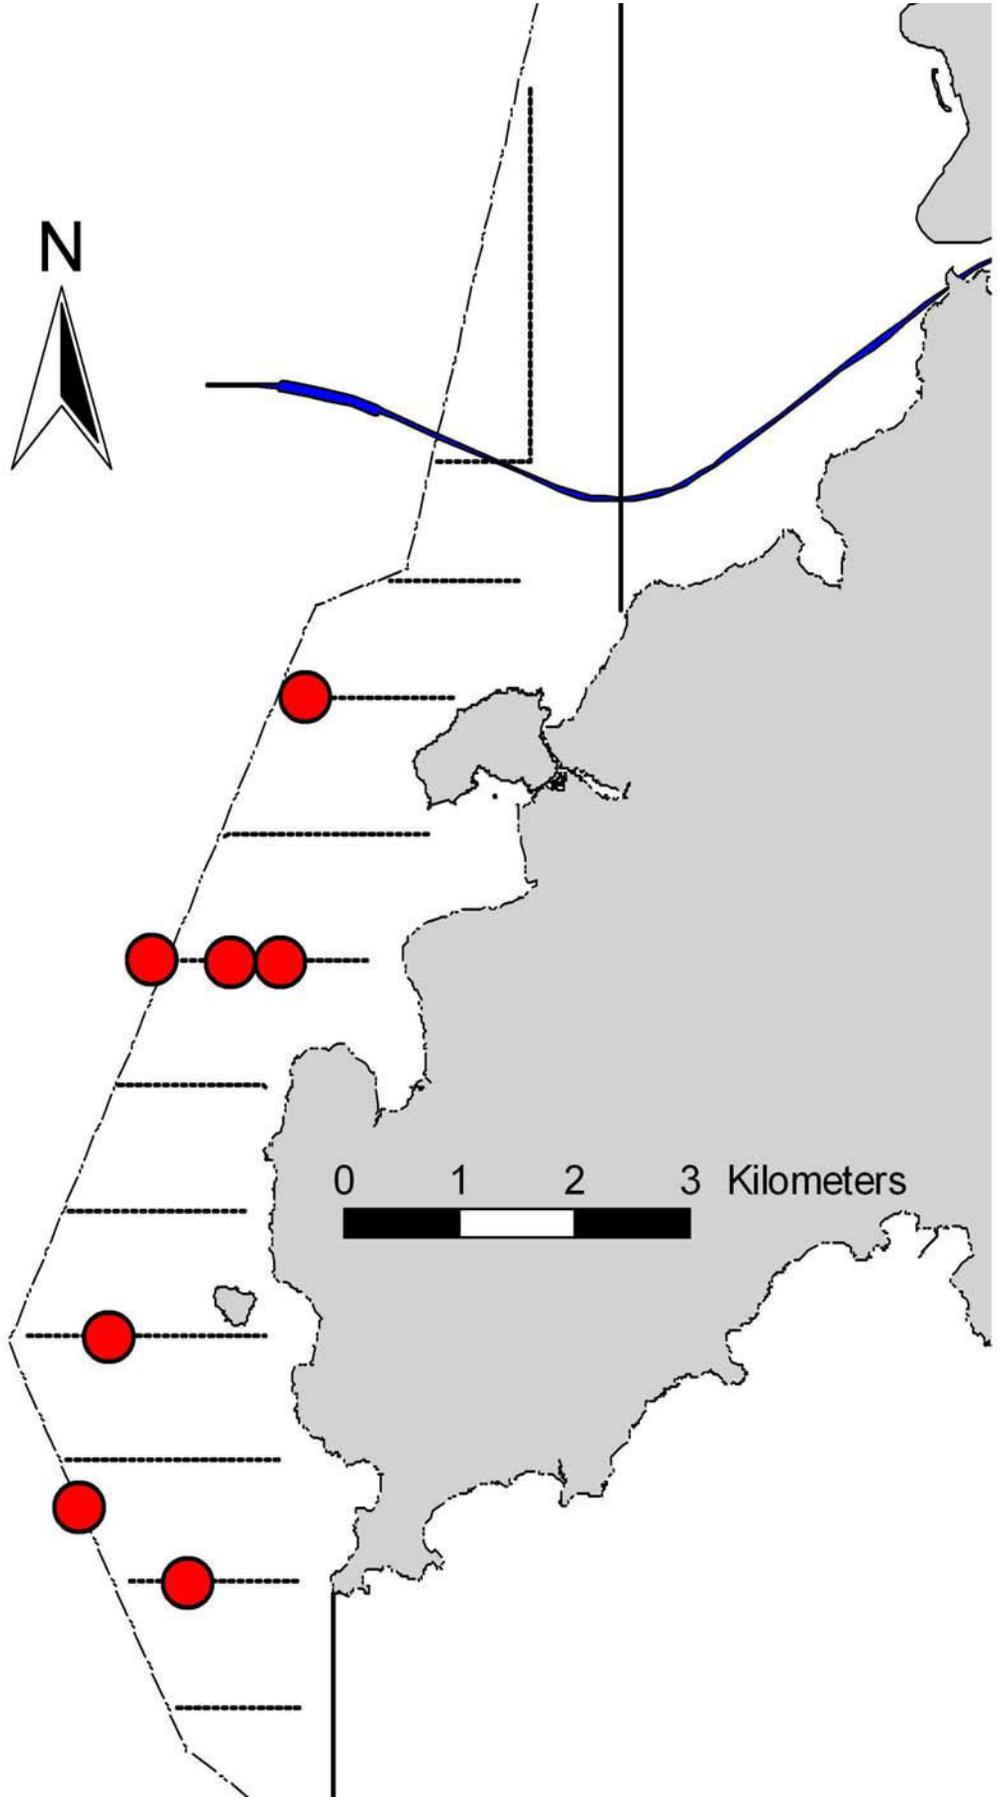


Figure 4. Distribution of Chinese White Dolphin Sighting during December 2015 HKLR09 Monitoring Surveys

Appendix I. HKLR09 Survey Effort Database (December 2015)

(Abbreviations: BEAU = Beaufort Sea State; P = Primary Line Effort; S = Secondary Line Effort)

DATE	AREA	BEAU	EFFORT	SEASON	VESSEL	TYPE	P/S
3-Dec-15	W LANTAU	2	2.33	WINTER	STANDARD31516	HKLR	P
3-Dec-15	W LANTAU	3	13.76	WINTER	STANDARD31516	HKLR	P
3-Dec-15	W LANTAU	4	5.40	WINTER	STANDARD31516	HKLR	P
3-Dec-15	W LANTAU	5	1.11	WINTER	STANDARD31516	HKLR	P
3-Dec-15	W LANTAU	2	2.16	WINTER	STANDARD31516	HKLR	S
3-Dec-15	W LANTAU	3	6.07	WINTER	STANDARD31516	HKLR	S
3-Dec-15	W LANTAU	4	1.90	WINTER	STANDARD31516	HKLR	S
3-Dec-15	W LANTAU	5	0.78	WINTER	STANDARD31516	HKLR	S
10-Dec-15	W LANTAU	2	9.55	WINTER	STANDARD31516	HKLR	P
10-Dec-15	W LANTAU	3	11.69	WINTER	STANDARD31516	HKLR	P
10-Dec-15	W LANTAU	4	1.27	WINTER	STANDARD31516	HKLR	P
10-Dec-15	W LANTAU	2	5.65	WINTER	STANDARD31516	HKLR	S
10-Dec-15	W LANTAU	3	3.91	WINTER	STANDARD31516	HKLR	S
10-Dec-15	W LANTAU	4	1.03	WINTER	STANDARD31516	HKLR	S

Appendix II. HKLR09 Chinese White Dolphin Sighting Database (December 2015)

(Abbreviations: STG# = Sighting Number; HRD SZ = Dolphin Herd Size; BEAU = Beaufort Sea State; PSD = Perpendicular Distance; ND = Not Determined; BOAT ASSOC. = Fishing Boat Association; P/S: Sighting Made on Primary/Secondary Line)

DATE	STG #	TIME	HRD SZ	AREA	BEAU	PSD	EFFORT	TYPE	NORTHING	EASTING	SEASON	BOAT ASSOC.	P/S
03-Dec-15	1	1116	8	W LANTAU	3	130	ON	HKLR	811445	801581	WINTER	NONE	P
03-Dec-15	2	1143	2	W LANTAU	3	483	ON	HKLR	811435	801148	WINTER	NONE	P
03-Dec-15	3	1249	2	W LANTAU	4	169	ON	HKLR	806453	800786	WINTER	NONE	P
10-Dec-15	1	1309	5	W LANTAU	2	548	ON	HKLR	813560	801802	WINTER	NONE	P
10-Dec-15	2	1424	1	W LANTAU	2	70	ON	HKLR	811448	800468	WINTER	NONE	P
10-Dec-15	3	1457	1	W LANTAU	3	166	ON	HKLR	808426	800089	WINTER	NONE	P
10-Dec-15	4	1523	2	W LANTAU	3	1048	ON	HKLR	807064	799839	WINTER	NONE	S

Appendix III. Individual dolphins identified during HKLR09 monitoring surveys in December 2015

ID#	DATE	STG#	AREA
NL49	03/12/15	1	W LANTAU
NL145	03/12/15	1	W LANTAU
NL295	10/12/15	1	W LANTAU
NL316	03/12/15	1	W LANTAU
WL05	03/12/15	1	W LANTAU
WL11	03/12/15	1	W LANTAU
WL191	10/12/15	1	W LANTAU
WL198	10/12/15	1	W LANTAU
WL206	10/12/15	1	W LANTAU

NL49_20151203_1



NL145_20151203_1



NL316_20151203_1



WL05_20151203_1



WL11_20151203_1



NL295_20151210_1



WL191_20151210_1



WL198_20151210_1



WL206_20151210_1



APPENDIX J
WIND DATA

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
1-Dec-2015	0:00	1.5	NE
1-Dec-2015	1:00	1.6	WSW
1-Dec-2015	2:00	1.7	SSW
1-Dec-2015	3:00	2	WSW
1-Dec-2015	4:00	1.6	WNW
1-Dec-2015	5:00	1.4	WNW
1-Dec-2015	6:00	1.2	ENE
1-Dec-2015	7:00	1.3	NE
1-Dec-2015	8:00	1.5	ENE
1-Dec-2015	9:00	1.5	WNW
1-Dec-2015	10:00	1.5	WSW
1-Dec-2015	11:00	1.7	WNW
1-Dec-2015	12:00	1.9	NNE
1-Dec-2015	13:00	1.8	W
1-Dec-2015	14:00	1.9	ENE
1-Dec-2015	15:00	2	NNE
1-Dec-2015	16:00	2.1	ESE
1-Dec-2015	17:00	1.8	ESE
1-Dec-2015	18:00	1.8	WNW
1-Dec-2015	19:00	1.8	WNW
1-Dec-2015	20:00	1.7	S
1-Dec-2015	21:00	2	WSW
1-Dec-2015	22:00	2	WNW
1-Dec-2015	23:00	2.1	SSW
2-Dec-2015	0:00	2.1	ENE
2-Dec-2015	1:00	1.9	ENE
2-Dec-2015	2:00	2	SE
2-Dec-2015	3:00	1.6	NNE
2-Dec-2015	4:00	1.5	NE
2-Dec-2015	5:00	1.6	ENE
2-Dec-2015	6:00	1.6	SSE
2-Dec-2015	7:00	1.7	SSE
2-Dec-2015	8:00	1.7	ESE
2-Dec-2015	9:00	1.7	NNE
2-Dec-2015	10:00	1.9	E
2-Dec-2015	11:00	2	NE
2-Dec-2015	12:00	2	NE
2-Dec-2015	13:00	1.9	NNE
2-Dec-2015	14:00	1.9	NNE
2-Dec-2015	15:00	1.7	NE
2-Dec-2015	16:00	1.7	ENE
2-Dec-2015	17:00	1.8	SE
2-Dec-2015	18:00	1.8	NE
2-Dec-2015	19:00	1.7	NE
2-Dec-2015	20:00	1.8	ENE
2-Dec-2015	21:00	2	ENE
2-Dec-2015	22:00	2	NE
2-Dec-2015	23:00	2.1	NNE
3-Dec-2015	0:00	2.2	ESE
3-Dec-2015	1:00	1.8	ESE
3-Dec-2015	2:00	1.9	ENE
3-Dec-2015	3:00	2	NE
3-Dec-2015	4:00	1.8	E
3-Dec-2015	5:00	1.7	ESE
3-Dec-2015	6:00	1	SE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
3-Dec-2015	7:00	0.9	NE
3-Dec-2015	8:00	1.1	SE
3-Dec-2015	9:00	1.2	ENE
3-Dec-2015	10:00	1.3	ENE
3-Dec-2015	11:00	1.5	ENE
3-Dec-2015	12:00	1.5	ESE
3-Dec-2015	13:00	1.6	ESE
3-Dec-2015	14:00	1.5	E
3-Dec-2015	15:00	1.5	ENE
3-Dec-2015	16:00	1.4	SE
3-Dec-2015	17:00	1.5	SE
3-Dec-2015	18:00	1.4	SSE
3-Dec-2015	19:00	1.2	SE
3-Dec-2015	20:00	1.2	E
3-Dec-2015	21:00	1.6	ENE
3-Dec-2015	22:00	1.6	NE
3-Dec-2015	23:00	1.8	ENE
4-Dec-2015	0:00	1.9	ENE
4-Dec-2015	1:00	1.9	ESE
4-Dec-2015	2:00	2	NE
4-Dec-2015	3:00	2	N
4-Dec-2015	4:00	1.4	NE
4-Dec-2015	5:00	1.5	W
4-Dec-2015	6:00	1.6	SE
4-Dec-2015	7:00	1.5	SSE
4-Dec-2015	8:00	1.6	ENE
4-Dec-2015	9:00	1.6	NE
4-Dec-2015	10:00	1.9	ESE
4-Dec-2015	11:00	2	ESE
4-Dec-2015	12:00	2.1	ENE
4-Dec-2015	13:00	2.2	NNE
4-Dec-2015	14:00	2.1	ENE
4-Dec-2015	15:00	2.2	ENE
4-Dec-2015	16:00	2	E
4-Dec-2015	17:00	1.8	E
4-Dec-2015	18:00	1.6	ENE
4-Dec-2015	19:00	1.6	NE
4-Dec-2015	20:00	2.2	SW
4-Dec-2015	21:00	1.5	SSE
4-Dec-2015	22:00	2	ENE
4-Dec-2015	23:00	1.7	SE
5-Dec-2015	0:00	1.5	ENE
5-Dec-2015	1:00	1.4	ENE
5-Dec-2015	2:00	1.6	ENE
5-Dec-2015	3:00	1.5	E
5-Dec-2015	4:00	1.4	SSE
5-Dec-2015	5:00	1.3	SSE
5-Dec-2015	6:00	1.2	S
5-Dec-2015	7:00	1.1	ESE
5-Dec-2015	8:00	1.3	ESE
5-Dec-2015	9:00	1.7	ENE
5-Dec-2015	10:00	1.9	ENE
5-Dec-2015	11:00	1.9	NE
5-Dec-2015	12:00	2.4	NNE
5-Dec-2015	13:00	2.3	NE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
5-Dec-2015	14:00	2.4	NE
5-Dec-2015	15:00	2.4	NE
5-Dec-2015	16:00	2.1	ENE
5-Dec-2015	17:00	1.9	ENE
5-Dec-2015	18:00	1.9	ENE
5-Dec-2015	19:00	1.6	SSE
5-Dec-2015	20:00	1.7	SE
5-Dec-2015	21:00	1.6	SE
5-Dec-2015	22:00	1.6	SSE
5-Dec-2015	23:00	1.6	SE
6-Dec-2015	0:00	1.9	ENE
6-Dec-2015	1:00	1.9	ESE
6-Dec-2015	2:00	1.7	NE
6-Dec-2015	3:00	1.6	ENE
6-Dec-2015	4:00	1.6	ENE
6-Dec-2015	5:00	1.5	ENE
6-Dec-2015	6:00	1.4	ESE
6-Dec-2015	7:00	1.4	ENE
6-Dec-2015	8:00	1.5	SSE
6-Dec-2015	9:00	1.6	E
6-Dec-2015	10:00	2	SE
6-Dec-2015	11:00	2.3	SE
6-Dec-2015	12:00	2.1	SSE
6-Dec-2015	13:00	2.3	SE
6-Dec-2015	14:00	2	SE
6-Dec-2015	15:00	2	SE
6-Dec-2015	16:00	2	E
6-Dec-2015	17:00	1.8	E
6-Dec-2015	18:00	1.6	NE
6-Dec-2015	19:00	1.6	SSE
6-Dec-2015	20:00	1.6	NNE
6-Dec-2015	21:00	1.5	N
6-Dec-2015	22:00	1.5	N
6-Dec-2015	23:00	1.6	NE
7-Dec-2015	0:00	1.6	NE
7-Dec-2015	1:00	1.6	NNE
7-Dec-2015	2:00	1.4	NE
7-Dec-2015	3:00	1.4	NNE
7-Dec-2015	4:00	1.3	ESE
7-Dec-2015	5:00	1.4	NE
7-Dec-2015	6:00	1.4	NE
7-Dec-2015	7:00	1.5	ENE
7-Dec-2015	8:00	1.5	ENE
7-Dec-2015	9:00	1.9	N
7-Dec-2015	10:00	2	N
7-Dec-2015	11:00	1.9	NNW
7-Dec-2015	12:00	2.4	NNW
7-Dec-2015	13:00	1.8	WSW
7-Dec-2015	14:00	1.9	SW
7-Dec-2015	15:00	2.1	W
7-Dec-2015	16:00	1.6	W
7-Dec-2015	17:00	1.7	E
7-Dec-2015	18:00	1.6	ENE
7-Dec-2015	19:00	1.7	NNE
7-Dec-2015	20:00	1.8	W

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
7-Dec-2015	21:00	1.7	WNW
7-Dec-2015	22:00	1.6	NNE
7-Dec-2015	23:00	1.6	NE
8-Dec-2015	0:00	1.1	NNE
8-Dec-2015	1:00	1.2	ENE
8-Dec-2015	2:00	1.1	ENE
8-Dec-2015	3:00	1.1	S
8-Dec-2015	4:00	1.2	S
8-Dec-2015	5:00	1.2	WSW
8-Dec-2015	6:00	1.1	NE
8-Dec-2015	7:00	1.1	W
8-Dec-2015	8:00	1.2	S
8-Dec-2015	9:00	1.4	NE
8-Dec-2015	10:00	1.8	E
8-Dec-2015	11:00	2	NE
8-Dec-2015	12:00	2.1	NE
8-Dec-2015	13:00	1.8	S
8-Dec-2015	14:00	1.5	NE
8-Dec-2015	15:00	1.4	ENE
8-Dec-2015	16:00	1.1	ESE
8-Dec-2015	17:00	1.1	NE
8-Dec-2015	18:00	0.9	ESE
8-Dec-2015	19:00	1.1	NE
8-Dec-2015	20:00	1	NNE
8-Dec-2015	21:00	1	ENE
8-Dec-2015	22:00	1	NNE
8-Dec-2015	23:00	1.1	NNE
9-Dec-2015	0:00	1	SSE
9-Dec-2015	1:00	1	SSE
9-Dec-2015	2:00	1.1	ESE
9-Dec-2015	3:00	1.3	NNE
9-Dec-2015	4:00	1.1	SSE
9-Dec-2015	5:00	1.1	NNE
9-Dec-2015	6:00	1.2	SE
9-Dec-2015	7:00	1.2	SE
9-Dec-2015	8:00	1.6	NE
9-Dec-2015	9:00	1.6	SE
9-Dec-2015	10:00	1.9	ESE
9-Dec-2015	11:00	2.2	ESE
9-Dec-2015	12:00	2.1	SE
9-Dec-2015	13:00	2.1	SSE
9-Dec-2015	14:00	1.7	SSE
9-Dec-2015	15:00	1.9	ESE
9-Dec-2015	16:00	1.8	SSE
9-Dec-2015	17:00	1.7	SSE
9-Dec-2015	18:00	1.5	SSE
9-Dec-2015	19:00	1.5	ESE
9-Dec-2015	20:00	1.3	ESE
9-Dec-2015	21:00	1.1	ESE
9-Dec-2015	22:00	1.1	ESE
9-Dec-2015	23:00	1.1	SE
10-Dec-2015	0:00	1.1	SE
10-Dec-2015	1:00	1.3	SSE
10-Dec-2015	2:00	1.4	SSE
10-Dec-2015	3:00	1.4	ESE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
10-Dec-2015	4:00	1.3	SE
10-Dec-2015	5:00	1.2	ESE
10-Dec-2015	6:00	1.3	SSE
10-Dec-2015	7:00	1.2	SE
10-Dec-2015	8:00	1.2	SSE
10-Dec-2015	9:00	1.6	SE
10-Dec-2015	10:00	1.5	SSE
10-Dec-2015	11:00	1.7	ESE
10-Dec-2015	12:00	1.9	ENE
10-Dec-2015	13:00	1.9	SSE
10-Dec-2015	14:00	1.7	SE
10-Dec-2015	15:00	1.6	SE
10-Dec-2015	16:00	1.5	SSE
10-Dec-2015	17:00	1.6	SSE
10-Dec-2015	18:00	1.5	ESE
10-Dec-2015	19:00	1.2	ESE
10-Dec-2015	20:00	1	SSE
10-Dec-2015	21:00	1	SSE
10-Dec-2015	22:00	0.8	SSE
10-Dec-2015	23:00	0.8	E
11-Dec-2015	0:00	0.9	SW
11-Dec-2015	1:00	0.9	SSE
11-Dec-2015	2:00	0.9	SE
11-Dec-2015	3:00	1	SSE
11-Dec-2015	4:00	1	ESE
11-Dec-2015	5:00	1	ESE
11-Dec-2015	6:00	1.1	SSE
11-Dec-2015	7:00	1.1	ENE
11-Dec-2015	8:00	1.3	NE
11-Dec-2015	9:00	1.4	ESE
11-Dec-2015	10:00	1.7	ESE
11-Dec-2015	11:00	1.5	ESE
11-Dec-2015	12:00	1.5	SSE
11-Dec-2015	13:00	1.8	NE
11-Dec-2015	14:00	2	NNE
11-Dec-2015	15:00	1.9	WSW
11-Dec-2015	16:00	1.7	WNW
11-Dec-2015	17:00	1.6	NNE
11-Dec-2015	18:00	1.3	NNE
11-Dec-2015	19:00	1.2	NE
11-Dec-2015	20:00	1.2	ENE
11-Dec-2015	21:00	1.1	ENE
11-Dec-2015	22:00	1.1	NNW
11-Dec-2015	23:00	1.1	ENE
12-Dec-2015	0:00	1.1	NE
12-Dec-2015	1:00	1	NNE
12-Dec-2015	2:00	1.1	NNE
12-Dec-2015	3:00	1.1	N
12-Dec-2015	4:00	1.1	N
12-Dec-2015	5:00	1.2	N
12-Dec-2015	6:00	0.9	N
12-Dec-2015	7:00	1.4	WNW
12-Dec-2015	8:00	1.6	WNW
12-Dec-2015	9:00	1.8	E
12-Dec-2015	10:00	2	N

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
12-Dec-2015	11:00	2	SE
12-Dec-2015	12:00	2	WSW
12-Dec-2015	13:00	1.9	W
12-Dec-2015	14:00	1.9	ENE
12-Dec-2015	15:00	1.8	SSW
12-Dec-2015	16:00	1.9	W
12-Dec-2015	17:00	1.8	WNW
12-Dec-2015	18:00	1.9	W
12-Dec-2015	19:00	1.8	W
12-Dec-2015	20:00	1.6	WSW
12-Dec-2015	21:00	1.5	WSW
12-Dec-2015	22:00	1.6	W
12-Dec-2015	23:00	1.6	WNW
13-Dec-2015	0:00	1.4	W
13-Dec-2015	1:00	1.4	NW
13-Dec-2015	2:00	1.2	N
13-Dec-2015	3:00	1.6	N
13-Dec-2015	4:00	1.6	SW
13-Dec-2015	5:00	1.6	W
13-Dec-2015	6:00	1.6	W
13-Dec-2015	7:00	1.6	W
13-Dec-2015	8:00	1.7	WNW
13-Dec-2015	9:00	1.8	WNW
13-Dec-2015	10:00	2	SW
13-Dec-2015	11:00	2.1	WNW
13-Dec-2015	12:00	2.2	NW
13-Dec-2015	13:00	2.1	WNW
13-Dec-2015	14:00	2.2	NW
13-Dec-2015	15:00	2.1	ENE
13-Dec-2015	16:00	2.2	NNE
13-Dec-2015	17:00	2.4	NE
13-Dec-2015	18:00	2.1	NE
13-Dec-2015	19:00	1.2	N
13-Dec-2015	20:00	1	WNW
13-Dec-2015	21:00	1.2	WNW
13-Dec-2015	22:00	1.2	WNW
13-Dec-2015	23:00	1.1	WNW
14-Dec-2015	0:00	1.1	SW
14-Dec-2015	1:00	1.1	SW
14-Dec-2015	2:00	1.1	W
14-Dec-2015	3:00	1.1	W
14-Dec-2015	4:00	1.1	SW
14-Dec-2015	5:00	1	SW
14-Dec-2015	6:00	1.1	N
14-Dec-2015	7:00	1	NE
14-Dec-2015	8:00	1.2	NE
14-Dec-2015	9:00	1.5	ENE
14-Dec-2015	10:00	1.7	E
14-Dec-2015	11:00	1.8	ENE
14-Dec-2015	12:00	2	E
14-Dec-2015	13:00	1.9	NNW
14-Dec-2015	14:00	1.8	NE
14-Dec-2015	15:00	1.5	WNW
14-Dec-2015	16:00	1.4	SW
14-Dec-2015	17:00	1.4	SW

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
14-Dec-2015	18:00	1.2	SSW
14-Dec-2015	19:00	1.1	SSE
14-Dec-2015	20:00	1.1	SW
14-Dec-2015	21:00	1.1	SW
14-Dec-2015	22:00	1.2	SSW
14-Dec-2015	23:00	1.1	E
15-Dec-2015	0:00	1.2	SW
15-Dec-2015	1:00	1.1	W
15-Dec-2015	2:00	1.1	SW
15-Dec-2015	3:00	1.1	E
15-Dec-2015	4:00	1.2	ENE
15-Dec-2015	5:00	1.1	ESE
15-Dec-2015	6:00	1.1	N
15-Dec-2015	7:00	1.1	WNW
15-Dec-2015	8:00	1	N
15-Dec-2015	9:00	1.5	ENE
15-Dec-2015	10:00	1.7	NE
15-Dec-2015	11:00	1.8	WNW
15-Dec-2015	12:00	2	WSW
15-Dec-2015	13:00	2	SSW
15-Dec-2015	14:00	2	W
15-Dec-2015	15:00	2	E
15-Dec-2015	16:00	1.8	N
15-Dec-2015	17:00	1.5	SW
15-Dec-2015	18:00	1.2	SW
15-Dec-2015	19:00	1.1	ESE
15-Dec-2015	20:00	1	N
15-Dec-2015	21:00	1.1	N
15-Dec-2015	22:00	1	NNE
15-Dec-2015	23:00	1	ESE
16-Dec-2015	0:00	0.9	WNW
16-Dec-2015	1:00	1	WNW
16-Dec-2015	2:00	1	N
16-Dec-2015	3:00	1	N
16-Dec-2015	4:00	1	N
16-Dec-2015	5:00	1	ENE
16-Dec-2015	6:00	0.9	NE
16-Dec-2015	7:00	0.9	NNW
16-Dec-2015	8:00	1.1	WNW
16-Dec-2015	9:00	1.4	N
16-Dec-2015	10:00	1.6	NE
16-Dec-2015	11:00	1.6	SSW
16-Dec-2015	12:00	2	SSW
16-Dec-2015	13:00	2	SW
16-Dec-2015	14:00	1.7	NNE
16-Dec-2015	15:00	1.6	SSW
16-Dec-2015	16:00	1.5	SW
16-Dec-2015	17:00	1.6	SW
16-Dec-2015	18:00	1.3	SW
16-Dec-2015	19:00	1.2	WNW
16-Dec-2015	20:00	1	WSW
16-Dec-2015	21:00	1	W
16-Dec-2015	22:00	0.8	W
16-Dec-2015	23:00	1	SSW
17-Dec-2015	0:00	1.1	SSE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
17-Dec-2015	1:00	1.2	SW
17-Dec-2015	2:00	1.2	SW
17-Dec-2015	3:00	1.1	SW
17-Dec-2015	4:00	0.9	WSW
17-Dec-2015	5:00	1.1	W
17-Dec-2015	6:00	1.2	W
17-Dec-2015	7:00	1.2	NE
17-Dec-2015	8:00	1.3	NNE
17-Dec-2015	9:00	1.3	W
17-Dec-2015	10:00	1.7	W
17-Dec-2015	11:00	2.3	WNW
17-Dec-2015	12:00	2.5	WSW
17-Dec-2015	13:00	2.4	SW
17-Dec-2015	14:00	2.1	NE
17-Dec-2015	15:00	2.5	ESE
17-Dec-2015	16:00	2.2	NNE
17-Dec-2015	17:00	1.6	NE
17-Dec-2015	18:00	1.5	ESE
17-Dec-2015	19:00	1.3	ENE
17-Dec-2015	20:00	1.2	NE
17-Dec-2015	21:00	1	W
17-Dec-2015	22:00	1.1	W
17-Dec-2015	23:00	1.1	WSW
18-Dec-2015	0:00	1.2	W
18-Dec-2015	1:00	1.1	W
18-Dec-2015	2:00	1.1	WNW
18-Dec-2015	3:00	1	SSW
18-Dec-2015	4:00	1	ESE
18-Dec-2015	5:00	1	NE
18-Dec-2015	6:00	1	NE
18-Dec-2015	7:00	1	NW
18-Dec-2015	8:00	1.1	N
18-Dec-2015	9:00	1.5	W
18-Dec-2015	10:00	2	WSW
18-Dec-2015	11:00	2.1	S
18-Dec-2015	12:00	2.1	SE
18-Dec-2015	13:00	2.2	SE
18-Dec-2015	14:00	2.2	S
18-Dec-2015	15:00	1.9	SSE
18-Dec-2015	16:00	2	ESE
18-Dec-2015	17:00	1.7	SSE
18-Dec-2015	18:00	1.8	NNE
18-Dec-2015	19:00	1.4	NNE
18-Dec-2015	20:00	1.2	E
18-Dec-2015	21:00	1.1	ENE
18-Dec-2015	22:00	1.1	ENE
18-Dec-2015	23:00	1.2	E
19-Dec-2015	0:00	1.3	ENE
19-Dec-2015	1:00	1.2	E
19-Dec-2015	2:00	1.3	SE
19-Dec-2015	3:00	1.3	NE
19-Dec-2015	4:00	1.2	NNE
19-Dec-2015	5:00	1.2	N
19-Dec-2015	6:00	1	NNE
19-Dec-2015	7:00	1.1	NE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
19-Dec-2015	8:00	1.4	ENE
19-Dec-2015	9:00	1.6	NE
19-Dec-2015	10:00	1.6	SSE
19-Dec-2015	11:00	1.9	ESE
19-Dec-2015	12:00	2.1	SE
19-Dec-2015	13:00	2	ESE
19-Dec-2015	14:00	1.9	ENE
19-Dec-2015	15:00	1.9	SE
19-Dec-2015	16:00	1.9	SSW
19-Dec-2015	17:00	2	SW
19-Dec-2015	18:00	2.1	S
19-Dec-2015	19:00	1.4	ESE
19-Dec-2015	20:00	1.3	WSW
19-Dec-2015	21:00	1.4	SW
19-Dec-2015	22:00	1.2	WNW
19-Dec-2015	23:00	1.3	E
20-Dec-2015	0:00	1.4	ENE
20-Dec-2015	1:00	1.6	SSW
20-Dec-2015	2:00	1.8	SW
20-Dec-2015	3:00	1.6	SSW
20-Dec-2015	4:00	1.5	SSW
20-Dec-2015	5:00	1.3	NNE
20-Dec-2015	6:00	1.5	ENE
20-Dec-2015	7:00	1.5	SSW
20-Dec-2015	8:00	1.8	E
20-Dec-2015	9:00	2	ENE
20-Dec-2015	10:00	2.6	NE
20-Dec-2015	11:00	3	ESE
20-Dec-2015	12:00	2.8	SE
20-Dec-2015	13:00	2.5	SE
20-Dec-2015	14:00	1.8	SSE
20-Dec-2015	15:00	1.7	SSE
20-Dec-2015	16:00	1.5	SSE
20-Dec-2015	17:00	2	SSE
20-Dec-2015	18:00	1.6	SSE
20-Dec-2015	19:00	1.6	ENE
20-Dec-2015	20:00	1.1	ENE
20-Dec-2015	21:00	1.5	SSE
20-Dec-2015	22:00	1.6	SE
20-Dec-2015	23:00	1.8	SSE
21-Dec-2015	0:00	2.2	SSE
21-Dec-2015	1:00	1.6	ENE
21-Dec-2015	2:00	1.5	ENE
21-Dec-2015	3:00	1.8	S
21-Dec-2015	4:00	1.8	SSE
21-Dec-2015	5:00	1.3	SSE
21-Dec-2015	6:00	1.1	E
21-Dec-2015	7:00	1.5	SSE
21-Dec-2015	8:00	1.7	ENE
21-Dec-2015	9:00	1.9	NE
21-Dec-2015	10:00	1.5	NE
21-Dec-2015	11:00	1.4	NE
21-Dec-2015	12:00	1.6	NE
21-Dec-2015	13:00	1.6	ENE
21-Dec-2015	14:00	1.5	ENE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
21-Dec-2015	15:00	1.5	ENE
21-Dec-2015	16:00	1.6	E
21-Dec-2015	17:00	1.6	ENE
21-Dec-2015	18:00	1.4	NNE
21-Dec-2015	19:00	1.5	WSW
21-Dec-2015	20:00	1.5	WNW
21-Dec-2015	21:00	1.4	WSW
21-Dec-2015	22:00	1.6	W
21-Dec-2015	23:00	1.5	NNW
22-Dec-2015	0:00	1.5	SSW
22-Dec-2015	1:00	1.6	N
22-Dec-2015	2:00	1.6	SE
22-Dec-2015	3:00	1.4	NE
22-Dec-2015	4:00	1.6	NE
22-Dec-2015	5:00	1.3	ESE
22-Dec-2015	6:00	1.1	ESE
22-Dec-2015	7:00	1.3	NE
22-Dec-2015	8:00	1.4	ENE
22-Dec-2015	9:00	1.6	NE
22-Dec-2015	10:00	1.6	N
22-Dec-2015	11:00	1.6	ESE
22-Dec-2015	12:00	1.6	SE
22-Dec-2015	13:00	1.6	NNE
22-Dec-2015	14:00	1.7	NNE
22-Dec-2015	15:00	2	SE
22-Dec-2015	16:00	2.3	SE
22-Dec-2015	17:00	1.7	SSE
22-Dec-2015	18:00	1	SE
22-Dec-2015	19:00	1.1	ESE
22-Dec-2015	20:00	1.8	ESE
22-Dec-2015	21:00	1.9	ESE
22-Dec-2015	22:00	1.5	ENE
22-Dec-2015	23:00	1.4	ENE
23-Dec-2015	0:00	1.4	SE
23-Dec-2015	1:00	1.4	SE
23-Dec-2015	2:00	1.4	SSE
23-Dec-2015	3:00	1.3	ESE
23-Dec-2015	4:00	1.3	ESE
23-Dec-2015	5:00	1.3	SE
23-Dec-2015	6:00	1.2	SSE
23-Dec-2015	7:00	1.3	SE
23-Dec-2015	8:00	1.2	SE
23-Dec-2015	9:00	1.5	SE
23-Dec-2015	10:00	1.8	NE
23-Dec-2015	11:00	2	SE
23-Dec-2015	12:00	1.9	E
23-Dec-2015	13:00	2.3	ESE
23-Dec-2015	14:00	2.4	NE
23-Dec-2015	15:00	2.2	NE
23-Dec-2015	16:00	2.3	E
23-Dec-2015	17:00	2.1	SE
23-Dec-2015	18:00	2.4	E
23-Dec-2015	19:00	2.5	ESE
23-Dec-2015	20:00	2.7	NE
23-Dec-2015	21:00	2.6	NE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
23-Dec-2015	22:00	2.8	SE
23-Dec-2015	23:00	2.9	ESE
24-Dec-2015	0:00	3.3	S
24-Dec-2015	1:00	2.3	N
24-Dec-2015	2:00	2.4	ESE
24-Dec-2015	3:00	2.1	ENE
24-Dec-2015	4:00	1.6	E
24-Dec-2015	5:00	2.2	WNW
24-Dec-2015	6:00	2	W
24-Dec-2015	7:00	2.1	NW
24-Dec-2015	8:00	2.5	NE
24-Dec-2015	9:00	2.9	SE
24-Dec-2015	10:00	3.1	ENE
24-Dec-2015	11:00	3.2	NNE
24-Dec-2015	12:00	3.3	NE
24-Dec-2015	13:00	3.8	NE
24-Dec-2015	14:00	3.8	SE
24-Dec-2015	15:00	3.4	NE
24-Dec-2015	16:00	3.4	S
24-Dec-2015	17:00	3.6	SE
24-Dec-2015	18:00	2.7	SE
24-Dec-2015	19:00	2.9	N
24-Dec-2015	20:00	2.3	ENE
24-Dec-2015	21:00	2.3	E
24-Dec-2015	22:00	2.1	NW
24-Dec-2015	23:00	2.6	W
25-Dec-2015	0:00	2	WNW
25-Dec-2015	1:00	1.7	W
25-Dec-2015	2:00	2.2	ESE
25-Dec-2015	3:00	1.9	SE
25-Dec-2015	4:00	1.9	SE
25-Dec-2015	5:00	2.1	SE
25-Dec-2015	6:00	2	ESE
25-Dec-2015	7:00	2	SE
25-Dec-2015	8:00	1.9	SSW
25-Dec-2015	9:00	2.1	SE
25-Dec-2015	10:00	2.5	N
25-Dec-2015	11:00	2.3	NE
25-Dec-2015	12:00	2.3	ENE
25-Dec-2015	13:00	2	NE
25-Dec-2015	14:00	2	NE
25-Dec-2015	15:00	1.6	NE
25-Dec-2015	16:00	1.7	ESE
25-Dec-2015	17:00	1.6	SE
25-Dec-2015	18:00	1.6	SE
25-Dec-2015	19:00	1.5	E
25-Dec-2015	20:00	1.4	ESE
25-Dec-2015	21:00	1.3	NE
25-Dec-2015	22:00	1.4	NNE
25-Dec-2015	23:00	1.4	NE
26-Dec-2015	0:00	1.3	NNE
26-Dec-2015	1:00	1.2	WNW
26-Dec-2015	2:00	1.3	WSW
26-Dec-2015	3:00	1.1	W
26-Dec-2015	4:00	1.1	NE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
26-Dec-2015	5:00	1	SSE
26-Dec-2015	6:00	1	N
26-Dec-2015	7:00	1.1	NNE
26-Dec-2015	8:00	1.3	ENE
26-Dec-2015	9:00	1.2	N
26-Dec-2015	10:00	1.6	NNE
26-Dec-2015	11:00	1.9	W
26-Dec-2015	12:00	1.9	SW
26-Dec-2015	13:00	2.3	SE
26-Dec-2015	14:00	2.1	WNW
26-Dec-2015	15:00	1.9	WNW
26-Dec-2015	16:00	2	N
26-Dec-2015	17:00	1.8	ENE
26-Dec-2015	18:00	1.4	ENE
26-Dec-2015	19:00	1.2	WNW
26-Dec-2015	20:00	1.1	W
26-Dec-2015	21:00	1.1	SSW
26-Dec-2015	22:00	0.9	E
26-Dec-2015	23:00	1	WSW
27-Dec-2015	0:00	1	ENE
27-Dec-2015	1:00	0.9	SSE
27-Dec-2015	2:00	0.9	N
27-Dec-2015	3:00	0.9	ENE
27-Dec-2015	4:00	0.9	SW
27-Dec-2015	5:00	1	SW
27-Dec-2015	6:00	0.9	W
27-Dec-2015	7:00	0.8	W
27-Dec-2015	8:00	0.9	NNE
27-Dec-2015	9:00	1.2	W
27-Dec-2015	10:00	1.3	WNW
27-Dec-2015	11:00	1.5	S
27-Dec-2015	12:00	1.7	SSW
27-Dec-2015	13:00	2	W
27-Dec-2015	14:00	2	W
27-Dec-2015	15:00	1.9	NE
27-Dec-2015	16:00	1.9	ENE
27-Dec-2015	17:00	1.5	ENE
27-Dec-2015	18:00	1.4	NE
27-Dec-2015	19:00	1.2	ENE
27-Dec-2015	20:00	1.2	WSW
27-Dec-2015	21:00	1.5	SW
27-Dec-2015	22:00	1.1	SSE
27-Dec-2015	23:00	1.2	WSW
28-Dec-2015	0:00	1.1	W
28-Dec-2015	1:00	1	W
28-Dec-2015	2:00	1	ENE
28-Dec-2015	3:00	1	E
28-Dec-2015	4:00	1	NNE
28-Dec-2015	5:00	0.9	SSW
28-Dec-2015	6:00	1	SSW
28-Dec-2015	7:00	0.9	NE
28-Dec-2015	8:00	1.1	ENE
28-Dec-2015	9:00	1.1	NE
28-Dec-2015	10:00	1.2	ENE
28-Dec-2015	11:00	1.4	ENE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
28-Dec-2015	12:00	1.4	N
28-Dec-2015	13:00	1.5	SSW
28-Dec-2015	14:00	1.3	E
28-Dec-2015	15:00	1.2	ESE
28-Dec-2015	16:00	1.3	NE
28-Dec-2015	17:00	1.3	ENE
28-Dec-2015	18:00	1.1	NE
28-Dec-2015	19:00	1	ENE
28-Dec-2015	20:00	1.1	ENE
28-Dec-2015	21:00	1.2	NNE
28-Dec-2015	22:00	1.4	NNE
28-Dec-2015	23:00	1.4	NE
29-Dec-2015	0:00	1.5	ENE
29-Dec-2015	1:00	1.5	ESE
29-Dec-2015	2:00	1.5	SE
29-Dec-2015	3:00	1.5	SSE
29-Dec-2015	4:00	1.4	WSW
29-Dec-2015	5:00	1.6	NNE
29-Dec-2015	6:00	1.6	WNW
29-Dec-2015	7:00	1.5	N
29-Dec-2015	8:00	1.5	SE
29-Dec-2015	9:00	1.4	NNE
29-Dec-2015	10:00	1.8	WNW
29-Dec-2015	11:00	1.8	WNW
29-Dec-2015	12:00	1.7	ENE
29-Dec-2015	13:00	1.7	SW
29-Dec-2015	14:00	1.7	ESE
29-Dec-2015	15:00	1.7	ENE
29-Dec-2015	16:00	1.6	ENE
29-Dec-2015	17:00	1.5	ESE
29-Dec-2015	18:00	1.3	NE
29-Dec-2015	19:00	1.1	NE
29-Dec-2015	20:00	1.1	NNE
29-Dec-2015	21:00	1	NNE
29-Dec-2015	22:00	1.5	NE
29-Dec-2015	23:00	1.2	ESE
30-Dec-2015	0:00	1.2	NE
30-Dec-2015	1:00	1.2	NE
30-Dec-2015	2:00	1.3	NE
30-Dec-2015	3:00	1.4	NNE
30-Dec-2015	4:00	1.5	NE
30-Dec-2015	5:00	1.3	SSE
30-Dec-2015	6:00	1.3	NNE
30-Dec-2015	7:00	1.2	SSE
30-Dec-2015	8:00	1.2	ESE
30-Dec-2015	9:00	1.5	ESE
30-Dec-2015	10:00	1.4	ESE
30-Dec-2015	11:00	1.6	ENE
30-Dec-2015	12:00	1.6	NNE
30-Dec-2015	13:00	1.7	WNW
30-Dec-2015	14:00	1.6	ESE
30-Dec-2015	15:00	1.7	ESE
30-Dec-2015	16:00	1.6	WNW
30-Dec-2015	17:00	1.3	WNW
30-Dec-2015	18:00	1.1	NE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
30-Dec-2015	19:00	1.1	NE
30-Dec-2015	20:00	1.1	ENE
30-Dec-2015	21:00	1	ESE
30-Dec-2015	22:00	1.1	SSW
30-Dec-2015	23:00	1.4	SW
31-Dec-2015	0:00	1.8	ENE
31-Dec-2015	1:00	2	ESE
31-Dec-2015	2:00	2	NE
31-Dec-2015	3:00	2	NE
31-Dec-2015	4:00	2	ENE
31-Dec-2015	5:00	2.3	NE
31-Dec-2015	6:00	2.3	NE
31-Dec-2015	7:00	2.5	SE
31-Dec-2015	8:00	2.5	ENE
31-Dec-2015	9:00	2.5	ENE
31-Dec-2015	10:00	2.6	NNE
31-Dec-2015	11:00	2.6	NE
31-Dec-2015	12:00	2.4	WNW
31-Dec-2015	13:00	2.4	ENE
31-Dec-2015	14:00	2.2	SSW
31-Dec-2015	15:00	2.3	NW
31-Dec-2015	16:00	2.2	WNW
31-Dec-2015	17:00	2.2	NE
31-Dec-2015	18:00	2	NE
31-Dec-2015	19:00	2	NNE
31-Dec-2015	20:00	1.7	SSE
31-Dec-2015	21:00	1.9	ESE
31-Dec-2015	22:00	2	ENE
31-Dec-2015	23:00	1.9	SW

**APPENDIX K
EVENT ACTION PLANS**

Event / Action Plan for Air Quality

EVENT	ACTION			
	ET	IEC	SO	CONTRACTOR
ACTION LEVEL				
1. Exceedance for one sample	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Inform IEC and SO; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET; 2. Check Contractor's working method. 	<ol style="list-style-type: none"> 1. Notify Contractor. 	<ol style="list-style-type: none"> 1. Rectify any unacceptable practice; 2. Amend working methods if appropriate.
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> 1. Identify source; 2. Inform IEC and SO; 3. Advise the SO on the effectiveness of the proposed remedial measures; 4. Repeat measurements to confirm findings; 5. Increase monitoring frequency to daily; 6. Discuss with IEC and Contractor on remedial actions required; 7. If exceedance continues, arrange meeting with IEC and SO; 8. If exceedance stops, cease additional monitoring. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ET on the effectiveness of the proposed remedial measures; 5. Supervise Implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 	<ol style="list-style-type: none"> 1. Submit proposals for remedial to SO within 3 working days of notification; 2. Implement the agreed proposals; 3. Amend proposal if appropriate.

LIMIT LEVEL

<p>1.Exceedance for one sample</p>	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Inform SO, Contractor and EPD; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily; 5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and SO informed of the results. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the SO on the effectiveness of the proposed remedial measures; 5. Supervise implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Ensure remedial measures properly implemented. 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Amend proposal if appropriate.
<p>2.Exceedance for two or more consecutive samples</p>	<ol style="list-style-type: none"> 1. Notify IEC, SO, Contractor and EPD; 2. Identify source; 3. Repeat measurement to confirm findings; 4. Increase monitoring frequency to daily; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; 6. Arrange meeting with IEC and SO to discuss the remedial actions to 	<ol style="list-style-type: none"> 1. Discuss amongst SO, ET, and Contractor on the potential remedial actions; 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the SO accordingly; 3. Supervise the implementation of remedial 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Ensure remedial measures properly implemented; 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control; 5. Stop the relevant portion of works as determined by the SO until the exceedance is

	<p>be taken;</p> <p>7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and SO informed of the results;</p> <p>8. If exceedance stops, cease additional monitoring.</p>	<p>measures.</p>	<p>5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</p>	<p>abated.</p>
--	--	------------------	--	----------------

Abbreviations: ET – Environmental Team, IEC – Independent Environmental Checker, SO – Supervising Office

Event / Action Plan for Construction Noise

EVENT	ACTION			
	ET	IEC	SO	CONTRACTOR
Action Level	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Notify IEC and Contractor; 3. Report the results of investigation to the IEC, SO and Contractor; 4. Discuss with the Contractor and formulate remedial measures; 5. Increase monitoring frequency to check mitigation effectiveness. 	<ol style="list-style-type: none"> 1. Review the analysed results submitted by the ET; 2. Review the proposed remedial measures by the Contractor and advise the SO accordingly; 3. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Require Contractor to propose remedial measures for the analysed noise problem; 4. Ensure remedial measures are properly implemented 	<ol style="list-style-type: none"> 1. Submit noise mitigation proposals to IEC; 2. Implement noise mitigation proposals.
Limit Level	<ol style="list-style-type: none"> 1. Identify source; 2. Inform IEC, SO, EPD and Contractor; 3. Repeat measurements to confirm findings; 4. Increase monitoring frequency; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; 6. Inform IEC, SO and EPD 	<ol style="list-style-type: none"> 1. Discuss amongst SO, ET, and Contractor on the potential remedial actions; 2. Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the SO accordingly; 3. Supervise the implementation of 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Require Contractor to propose remedial measures for the analysed noise 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control;

EVENT	ACTION			
	ET	IEC	SO	CONTRACTOR
	<p>the causes and actions taken for the exceedances;</p> <p>7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and SO informed of the results;</p> <p>8. If exceedance stops, cease additional monitoring.</p>	<p>remedial measures.</p>	<p>problem;</p> <p>4. Ensure remedial measures properly implemented;</p> <p>5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</p>	<p>5. Stop the relevant portion of works as determined by the SO until the exceedance is abated.</p>

Event and Action Plan for Water Quality

Event	ET Leader	IEC	SO	Contractor
Action level being exceeded by one sampling day	<p>Repeat <i>in situ</i> measurement on next day of exceedance to confirm findings;</p> <p>Identify source(s) of impact;</p> <p>Inform IEC, contractor and SO;</p> <p>Check monitoring data, all plant, equipment and Contractor's working methods.</p>	<p>Check monitoring data submitted by ET and Contractor's working methods.</p>	<p>Confirm receipt of notification of non-compliance in writing;</p> <p>Notify Contractor.</p>	<p>Inform the SO and confirm notification of the non-compliance in writing;</p> <p>Rectify unacceptable practice;</p> <p>Amend working methods if appropriate.</p>
Action level being exceeded by two or more consecutive sampling days	<p>Repeat measurement on next day of exceedance to confirm findings;</p> <p>Identify source(s) of impact;</p> <p>Inform IEC, contractor, SO and EPD;</p> <p>Check monitoring data, all plant, equipment and Contractor's working methods;</p> <p>Ensure mitigation measures are implemented;</p> <p>Increase the monitoring frequency to daily until no exceedance of Action level;</p>	<p>Check monitoring data submitted by ET and Contractor's working method;</p> <p>Discuss with ET and Contractor on possible remedial actions;</p> <p>Review the proposed mitigation measures submitted by Contractor and advise the SO accordingly;</p> <p>Supervise the implementation of mitigation measures.</p>	<p>Discuss with IEC on the proposed mitigation measures;</p> <p>Ensure mitigation measures are properly implemented;</p> <p>Assess the effectiveness of the implemented mitigation measures.</p>	<p>Inform the Supervising Officer and confirm notification of the non-compliance in writing;</p> <p>Rectify unacceptable practice;</p> <p>Check all plant and equipment and consider changes of working methods;</p> <p>Submit proposal of additional mitigation measures to SO within 3 working days of notification and discuss with ET, IEC and SO;</p> <p>Implement the agreed mitigation measures.</p>
Limit level being exceeded by one sampling day	<p>Repeat measurement on next day of exceedance to confirm findings;</p> <p>Identify source(s) of impact;</p> <p>Inform IEC, contractor, SO and EPD;</p> <p>Check monitoring data, all plant, equipment and Contractor's working methods;</p> <p>Discuss mitigation measures with IEC, SO and Contractor;</p>	<p>Check monitoring data submitted by ET and Contractor's working method;</p> <p>Discuss with ET and Contractor on possible remedial actions;</p> <p>Review the proposed mitigation measures submitted by Contractor and advise the SO accordingly.</p>	<p>Confirm receipt of notification of failure in writing;</p> <p>Discuss with IEC, ET and Contractor on the proposed mitigation measures;</p> <p>Request Contractor to review the working methods.</p>	<p>Inform the SO and confirm notification of the non-compliance in writing;</p> <p>Rectify unacceptable practice;</p> <p>Check all plant and equipment and consider changes of working methods;</p> <p>Submit proposal of mitigation measures to SO within 3 working days of notification and discuss with ET, IEC and SO.</p>

Event	ET Leader	IEC	SO	Contractor
<p>Limit level being exceeded by two or more consecutive sampling days</p>	<p>Repeat measurement on next day of exceedance to confirm findings;</p> <p>Identify source(s) of impact;</p> <p>Inform IEC, contractor, SO and EPD;</p> <p>Check monitoring data, all plant, equipment and Contractor's working methods;</p> <p>Discuss mitigation measures with IEC, SO and Contractor;</p> <p>Ensure mitigation measures are implemented;</p>	<p>Check monitoring data submitted by ET and Contractor's working method;</p> <p>Discuss with ET and Contractor on possible remedial actions;</p> <p>Review the Contractor's mitigation measures whenever necessary to assure their effectiveness and advise the SO accordingly;</p> <p>Supervise the implementation of mitigation measures.</p>	<p>Discuss with IEC, ET and Contractor on the proposed mitigation measures;</p> <p>Request Contractor to critically review the working methods;</p> <p>Make agreement on the mitigation measures to be implemented;</p> <p>Ensure mitigation measures are properly implemented;</p> <p>Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the construction activities until no exceedance of Limit level.</p>	<p>Take immediate action to avoid further exceedance;</p> <p>Submit proposal of mitigation measures to SO within 3 working days of notification and discuss with ET, IEC and SO;</p> <p>Implement the agreed mitigation measures;</p> <p>Resubmit proposals of mitigation measures if problem still not under control;</p> <p>As directed by the Supervising Officer, to slow down or to stop all or part of the construction activities until no exceedance of Limit level.</p>

APPENDIX L
SUMMARY OF EXCEEDANCE

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road –
Section between HKSAR Boundary and Scenic Hill**

Exceedance Report

(A) Exceedance Report for Air Quality

Environmental Monitoring	Parameter	No. of Exceedance		No. of Exceedance related to the Construction Activities of this Contract	
		Action Level	Limit Level	Action Level	Limit Level
Air Quality	1-hr TSP	0	0	0	0
	24-hr TSP	0	0	0	0

**(B) Exceedance Report for Construction Noise
(NIL in the reporting period)**

(C) Exceedance Report for Water Quality

Environmental Monitoring	Parameter	No. of Exceedance		No. of Exceedance related to the Construction Activities of this Contract	
		Action Level	Limit Level	Action Level	Limit Level
Water Quality	Dissolved Oxygen (DO) (Surface & Middle)	0	0	0	0
	Dissolved Oxygen (DO) (Bottom)	0	0	0	0
	Turbidity	0	0	0	0
	Suspended Solids (SS)	14	0	0	0

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Date of Water Quality Monitoring: 4 December 2015

Part A – Exceedance Summary Tables

Table I: Parameter(s) – ~~Dissolved Oxygen (DO)~~ / ~~Turbidity (TURB)~~ / Suspended Solids (SS)

Station(s)	Tide	Baseline Action Level (mg/L)	Baseline Limit Level (mg/L)	Control Station(s)	Depth-average Value at Control Stations (mg/L)	120% of Control Station Action Level (mg/L)	130% of Control Station Limit Level (mg/L)	Depth-average Measured Value (mg/L)	Justification*	Validity (Yes/No)
IS3	Mid-ebb	23.5	34.4	CS2	18.5	22.2	24.1	31.5	(2) and (4)	No

Note: ***Bold Italic*** means Action Level exceedance
Bold Italic with underline means Limit Level exceedance

- *Remarks
- (1) – No major marine construction activity was conducted.
 - (2) – No pollution discharge from construction activity was observed.
 - (3) – Control Station value already exceeded either the Baseline Action or Limit Levels.
 - (4) – The exceeded results were similar or within the ranges baseline monitoring results. (Please refer to Table I)
 - (5) – Monitoring station is situated at the upstream of the construction sites.
 - (6) – Other(s): Please specify – _____

Table I – Summary of Baseline Water Quality Monitoring Results during Mid-Ebb Tide

Station(s)	Suspended Solids (mg/L)	
	Min	Max
IS3	10.0	28.3

Part B – Conclusion: No direct evidence that the exceedances were due to the Contract, therefore the exceedances are considered due to the other external factors rather than the contract works.

Part C – Recommendation: As the exceedances were not related to the contract works, no further action to be required.

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Location Plan:



Reviewed by: Dr. Priscilla Choy

Title: Environmental Team Leader

Date: 8 January 2016

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Date of Water Quality Monitoring: 7 December 2015

Part A – Exceedance Summary Tables

Table I: Parameter(s) – ~~Dissolved Oxygen (DO)~~ / ~~Turbidity (TURB)~~ / Suspended Solids (SS)

Station(s)	Tide	Baseline Action Level (mg/L)	Baseline Limit Level (mg/L)	Control Station(s)	Depth-average Value at Control Stations (mg/L)	120% of Control Station Action Level (mg/L)	130% of Control Station Limit Level (mg/L)	Depth-average Measured Value (mg/L)	Justification*	Validity (Yes/No)
SR1	Mid-flood	23.5	34.4	CS1	19.2	23.0	25.0	25.3	(2) and (5)	No

Note: ***Bold Italic*** means Action Level exceedance
Bold Italic with underline means Limit Level exceedance

- *Remarks
- (1) – No major marine construction activity was conducted.
 - (2) – No pollution discharge from construction activity was observed.
 - (3) – Control Station value already exceeded either the Baseline Action or Limit Levels.
 - (4) – The exceeded results were similar or within the ranges baseline monitoring results.
 - (5) – Monitoring station is situated at the upstream of the construction sites.
 - (6) – Other(s): Please specify – _____

Part B – Conclusion: No direct evidence that the exceedances were due to the Contract, therefore the exceedances are considered due to the other external factors rather than the contract works.

Part C – Recommendation: As the exceedances were not related to the contract works, no further action to be required.


Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Location Plan:



Reviewed by: Dr. Priscilla Choy

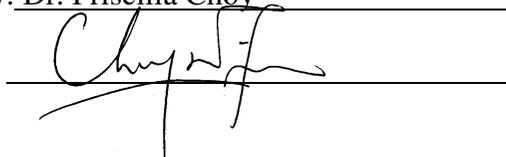

Title: Environmental Team Leader

Date: 8 January 2016

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Date of Water Quality Monitoring: 9 December 2015

Part A – Exceedance Summary Tables

Table I: Parameter(s) – ~~Dissolved Oxygen (DO)~~ / ~~Turbidity (TURB)~~ / Suspended Solids (SS)

Station(s)	Tide	Baseline Action Level (mg/L)	Baseline Limit Level (mg/L)	Control Station(s)	Depth-average Value at Control Stations (mg/L)	120% of Control Station Action Level (mg/L)	130% of Control Station Limit Level (mg/L)	Depth-average Measured Value (mg/L)	Justification*	Validity (Yes/No)
IS1	Mid-flood	23.5	34.4	CS1	17.1	20.5	22.2	31.0	(2) and (6)	No
IS2								33.4	(2) and (6)	No
IS4								31.4	(2) and (6)	No
SR6								27.9	(2) and (6)	No
ST1								32.0	(2) and (6)	No
ST2								31.2	(2) and (6)	No

Note: ***Bold Italic*** means Action Level exceedance
Bold Italic with underline means Limit Level exceedance

*Remarks

- (1) – No major marine construction activity was conducted.
- (2) – No pollution discharge from construction activity was observed.
- (3) – Control Station value already exceeded either the Baseline Action or Limit Levels.
- (4) – The exceeded results were similar or within the ranges baseline monitoring results.
- (5) – Monitoring station is situated at the upstream of the construction sites.
- (6) – Other(s): Please specify – Adverse water quality outside the site boundary was observed. Dispersion of sediment plume to the monitoring stations from the area outside the site boundary (i.e. works area not under and related to HY/2011/09) was also observed.

Part B – Conclusion: No direct evidence that the exceedances were due to the Contract, therefore the exceedances are considered due to the other external factors rather than the contract works.

Part C – Recommendation: As the exceedances were not related to the contract works, no further action to be required.

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Location Plan:



Reviewed by: Dr. Priscilla Choy

Title: Environmental Team Leader

Date: 8 January 2016

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Date of Water Quality Monitoring: 11 December 2015

Part A – Exceedance Summary Tables

Table I: Parameter(s) – ~~Dissolved Oxygen (DO)~~ / ~~Turbidity (TURB)~~ / Suspended Solids (SS)

Station(s)	Tide	Baseline Action Level (mg/L)	Baseline Limit Level (mg/L)	Control Station(s)	Depth-average Value at Control Stations (mg/L)	120% of Control Station Action Level (mg/L)	130% of Control Station Limit Level (mg/L)	Depth-average Measured Value (mg/L)	Justification*	Validity (Yes/No)
IS3	Mid-ebb	23.5	34.4	CS2	17.5	21.0	22.8	<i>24.3</i>	(2) and (4)	No
SR1								<i>26.1</i>	(2) and (4)	No
SR6								<i>24.3</i>	(2) and (5)	No

Note: ***Bold Italic*** means Action Level exceedance
Bold Italic with underline means Limit Level exceedance

- *Remarks
- (1) – No major marine construction activity was conducted.
 - (2) – No pollution discharge from construction activity was observed.
 - (3) – Control Station value already exceeded either the Baseline Action or Limit Levels.
 - (4) – The exceeded results were similar or within the ranges baseline monitoring results. (Please refer to Table I)
 - (5) – Monitoring station is situated at the upstream of the construction sites.
 - (6) – Other(s): Please specify – _____

Table I – Summary of Baseline Water Quality Monitoring Results during Mid-Ebb Tide

Station(s)	Suspended Solids (mg/L)	
	Min	Max
IS3	10.0	28.3
SR1	6.5	39.5

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Part B – Conclusion: No direct evidence that the exceedances were due to the Contract, therefore the exceedances are considered due to the other external factors rather than the contract works.

Part C – Recommendation: As the exceedances were not related to the contract works, no further action to be required.

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Location Plan:



Reviewed by: Dr. Priscilla Choy

Title: Environmental Team Leader

Date: 8 January 2016

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Date of Water Quality Monitoring: 14 December 2015

Part A – Exceedance Summary Tables

Table I: Parameter(s) – ~~Dissolved Oxygen (DO)~~ / ~~Turbidity (TURB)~~ / Suspended Solids (SS)

Station(s)	Tide	Baseline Action Level (mg/L)	Baseline Limit Level (mg/L)	Control Station(s)	Depth-average Value at Control Stations (mg/L)	120% of Control Station Action Level (mg/L)	130% of Control Station Limit Level (mg/L)	Depth-average Measured Value (mg/L)	Justification*	Validity (Yes/No)
SR1	Mid-flood	23.5	34.4	CS1	20.9	25.1	27.2	27.3	(2) and (5)	No

Note: ***Bold Italic*** means Action Level exceedance
Bold Italic with underline means Limit Level exceedance

*Remarks
 (1) – No major marine construction activity was conducted.
 (2) – No pollution discharge from construction activity was observed.
 (3) – Control Station value already exceeded either the Baseline Action or Limit Levels.
 (4) – The exceeded results were similar or within the ranges baseline monitoring results.
 (5) – Monitoring station is situated at the upstream of the construction sites.
 (6) – Other(s): Please specify – _____

Part B – Conclusion: No direct evidence that the exceedances were due to the Contract, therefore the exceedances are considered due to the other external factors rather than the contract works.

Part C – Recommendation: As the exceedances were not related to the contract works, no further action to be required.

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Location Plan:



Reviewed by: Dr. Priscilla Choy

Title: Environmental Team Leader

Date: 8 January 2016

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Date of Water Quality Monitoring: 16 December 2015

Part A – Exceedance Summary Tables

Table I: Parameter(s) – ~~Dissolved Oxygen (DO)~~ / ~~Turbidity (TURB)~~ / Suspended Solids (SS)

Station(s)	Tide	Baseline Action Level (mg/L)	Baseline Limit Level (mg/L)	Control Station(s)	Depth-average Value at Control Stations (mg/L)	120% of Control Station Action Level (mg/L)	130% of Control Station Limit Level (mg/L)	Depth-average Measured Value (mg/L)	Justification*	Validity (Yes/No)
SR1	Mid-flood	23.5	34.4	CS1	24.7	29.6	32.1	<i>29.8</i>	(2) and (5)	No
SRA								<i><u>30.6</u></i>	(2) and (6)	No

Note: ***Bold Italic*** means Action Level exceedance
Bold Italic with underline means Limit Level exceedance

- *Remarks
- (1) – No major marine construction activity was conducted.
 - (2) – No pollution discharge from construction activity was observed.
 - (3) – Control Station value already exceeded either the Baseline Action or Limit Levels.
 - (4) – The exceeded results were similar or within the ranges baseline monitoring results.
 - (5) – Monitoring station is situated at the upstream of the construction sites.
 - (6) – Other(s): Please specify – Dispersion of sediment plume to the monitoring stations from the area outside the site boundary (i.e. works area not under and related to HY/2011/09) was observed.

Part B – Conclusion: No direct evidence that the exceedances were due to the Contract, therefore the exceedances are considered due to the other external factors rather than the contract works.

Part C – Recommendation: As the exceedances were not related to the contract works, no further action to be required.

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
- Notification of Environmental Quality Limit Exceedances**

Location Plan:



Reviewed by: Dr. Priscilla Choy

Title: Environmental Team Leader

Date: 8 January 2016

APPENDIX M
SITE AUDIT SUMMARY

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge


Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Weekly Site Inspection Record Summary

Inspection Information

Checklist Reference Number	151201
Date	1 December 2015 (Tuesday)
Time	13:30 – 15:30

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-
Ref. No.	Remarks/Observations	Related Item No.
	A. Water Quality	
151201-R01	• Properly deploy the silt curtain at P81 and P83.	B25
151201-R04	• Clear the floating rubbish and damaged silt curtain at P91.	B21
	B. Ecology	
151201-R07	• Properly erect the fencing to protect the trees at P98.	C31
	C. Air Quality	
151201-R03	• Properly cover the stockpile of excavated materials at P88.	D7
	D. Noise	
	• No environmental deficiency was identified during site inspection.	
	E. Waste / Chemical Management	
151201-R02	• Provide waste sorting for the accumulated construction waste at P86.	F1i. & F4ii.
151201-R05	• Clear the rubbish at near the wetsep at Portion C (P110).	F1iii.
151201-R06	• Clear the U-Channel at P102 and Portion C (P111).	F6
	F. Permits/Licences	
	• No environmental deficiency was identified during site inspection.	
	G. Others	
	• Follow-up on previous site audit session (Ref. No. 151125), all environmental deficiencies were improved/rectified by contractor during the site inspection..	

	Name	Signature	Date
Recorded by	Ivy Tam		1 December 2015
Checked by	Dr. Priscilla Choy		1 December 2015

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Environmental Observations Identified during the Environmental Site Inspection
(1 December 2015)



P81



P83



Ref No: 1501201-R01

Impact:
Water Quality (B25)

Details:
Properly deploy the silt curtain at P81 and P83.

Ref No: 1501201-R02

Impact:
Waste / Chemical Management (F1i. & F4ii.)

Details:
Provide waste sorting for the accumulated construction waste at P86.

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 1501201-R03</p> <p>Impact: Air Quality (D7)</p> <p>Details: Properly cover the stockpile of excavated materials at P88.</p>
	<p>Ref No: 1501201-R04</p> <p>Impact: Water Quality (B21)</p> <p>Details: Clear the floating rubbish and damaged silt curtain at P91.</p>
	<p>Ref No: 1501201-R05</p> <p>Impact: Waste / Chemical Management (F1iii.)</p> <p>Details: Clear the rubbish at near the wetsep at Portion C (P110).</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill



P111

Ref No: 1501201-R06

Impact:
Waste / Chemical Management (F6)

Details:
Clear the U-Channel at P102 and Portion C (P111).



P102

Ref No: 1501201-R07

Impact:
Ecology (C31)

Details:
Properly erect the fencing to protect the trees at P98.



Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

**Rectification Actions taken by the Contractor for Environmental Deficiencies
Identified during Previous Audit Session**



P63



P64

Ref No: 1501125-R01

Impact:

Waste / Chemical Management (F9)

Details:

Provide drip tray for the chemical containers and air compressor and clean the oil spillage, if any at P63 & P64 (bridge-deck).

Follow Up:

The chemical containers and air compressor were removed and the oil spillage was also cleared.

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge


Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Weekly Site Inspection Record Summary

Inspection Information

Checklist Reference Number	151210
Date	10 December 2015 (Thursday)
Time	9:30 – 11:50 and 13:30 – 15:30

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-
Ref. No.	Remarks/Observations	Related Item No.
	A. Water Quality	
151210-R01	• Properly deploy the silt curtain at P68.	B25
151210-R05	• Ensure adequate capacity of sedimentation facilities at Portion C (P110).	B3iii.
151210-R07	• Clear the floating rubbish and damaged silt curtain at P91.	B21
	B. Ecology	
151210-R08	• Properly erect the fencing to protect the trees at P98.	C31
	C. Air Quality	
151210-R02	• Provide NRMM label and noise emission label for the air compressor and excavator which will be used on site at P68.	D26
	D. Noise	
151210-R02	• Provide NRMM label and noise emission label for the air compressor and excavator which will be used on site at P68.	E8
	E. Waste / Chemical Management	
151210-R03	• Clear the rubbish at near the wetsep at Portion C (P110).	F1iii.
151210-R04	• Clear the U-Channel at P102 and Portion C (P111).	F6
151210-R06	• Clear the oil containers and oil leakage at near the discharging point at P106 (Portion C).	F8
151210-R09	• Provide proper area for the equipment (segment carrier) maintenance works to avoid soil contamination at P102.	F8 & F9
	F. Permits/Licences	
	• No environmental deficiency was identified during site inspection.	
	G. Others	
	• Follow-up on previous site audit session (Ref. No. 151201), follow up action is required for the item(s) 151201-R04 to R07.	

	Name	Signature	Date
Recorded by	Ivy Tam		10 December 2015
Checked by	Dr. Priscilla Choy		10 December 2015

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Environmental Observations Identified during the Environmental Site Inspection
(10 December 2015)

	<p>Ref No: 1501210-R01</p> <p>Impact: Water Quality (B25)</p> <p>Details: Properly deploy the silt curtain at P68.</p>
	<p>Ref No: 1501210-R02</p> <p>Impact: Air Quality (D26) Noise (E8)</p> <p>Details: Provide NRMM label and noise emission label for the air compressor and excavator which will be used on site at P68.</p>
	<p>Ref No: 1501210-R03</p> <p>Impact: Waste / Chemical Management (F1iii.)</p> <p>Details: Clear the rubbish at near the wetset at Portion C (P110).</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill



P102



P111

Ref No: 1501210-R04

Impact:
Waste / Chemical Management (F6)

Details:
Clear the U-Channel at P102 and Portion C (P111).



Ref No: 1501210-R05

Impact:
Water Quality (B3iii.)

Details:
Ensure adequate capacity of sedimentation facilities at Portion C (P110).

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 1501210-R06</p> <p>Impact: Waste / Chemical Management (F8)</p> <p>Details: Clear the oil containers and oil leakage at near the discharging point at P106 (Portion C).</p>
	<p>Ref No: 1501210-R07</p> <p>Impact: Water Quality (B21)</p> <p>Details: Clear the floating rubbish and damaged silt curtain at P91.</p>
	<p>Ref No: 1501210-R08</p> <p>Impact: Ecology (C31)</p> <p>Details: Properly erect the fencing to protect the trees at P98.</p>

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill



Ref No: 1501210-R09

Impact:

Waste / Chemical Management (F8 & F9)

Details:

Provide proper area for the equipment (segment carrier) maintenance works to avoid soil contamination at P102.

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

**Rectification Actions taken by the Contractor for Environmental Deficiencies
Identified during Previous Audit Session**

	<p>Ref No: 1501201-R01</p> <p>Impact: Water Quality (B25)</p> <p>Details: Properly deploy the silt curtain at P81 and P83.</p> <p>Follow Up: The silt curtain was properly deployed.</p>
	
	<p>Ref No: 1501201-R02</p> <p>Impact: Waste / Chemical Management (F1i. & F4ii.)</p> <p>Details: Provide waste sorting for the accumulated construction waste at P86.</p> <p>Follow Up: The accumulated construction wastes were cleared.</p>

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 1501201-R03</p> <p>Impact: Air Quality (D7)</p> <p>Details: Properly cover the stockpile of excavated materials at P88.</p> <p>Follow Up: The stockpile of excavated materials were cleared.</p>
---	---

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Weekly Site Inspection Record Summary

Inspection Information

Checklist Reference Number	151215
Date	15 December 2015 (Tuesday)
Time	9:30 – 11:50 and 13:30 – 15:30

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-
Ref. No.	Remarks/Observations	Related Item No.
	A. Water Quality	
151215-O01	• Minor sediment plume was observed outside the silt curtain at P69. The Contractor was reminded to rectify this deficiency accordingly.	B26
151215-O02	• Floating rubbish was observed within the silt curtain at P69. The Contractor was reminded to clear it ASAP.	B21
151215-R03	• Properly deploy the silt curtain at P68.	B25
151215-R07	• Clear the floating rubbish and damage silt curtain at P91.	B21 & B25
151215-R12	• Provide proper sedimentation facilities at P68 to ensure the discharge comply with WPCO license.	B3i.
	B. Ecology	
151215-R08	• Properly erect the fencing to protect the trees at P98.	C31
	C. Air Quality	
151215-R04	• Provide NRMM label for the air compressor at P68.	D26
	D. Noise	
	• No environmental deficiency was identified during site inspection.	
	E. Waste / Chemical Management	
151215-R05	• Clear the rubbish at near the wetsep at Portion C (P110).	F1i. & iii.
151215-R06	• Clear the oil containers and oil leakage at near the discharging point at P106 (Portion C).	F3i. & F8
151215-R09	• Provide proper area for the equipment (segment carrier / lift equipment) maintenance works to avoid soil contamination at P102 and P109.	F8
151215-R10	• Provide drip tray for the oil containers at P70.	F9
151215-R11	• Clear the oil spillage at near the air compressor at P68.	F8
	F. Permits/Licences	
	• No environmental deficiency was identified during site inspection.	
	G. Others	
	• Follow-up on previous site audit session (Ref. No. 151210), follow up action is required for the item(s) 151210-R01 to R03 and R06 to R09.	

	Name	Signature	Date
Recorded by	Ivy Tam		15 December 2015
Checked by	Dr. Priscilla Choy		15 December 2015

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Environmental Observations Identified during the Environmental Site Inspection
(15 December 2015)

	<p>Ref No: 1501215-O01</p> <p>Impact: Water Quality (B26)</p> <p>Details: Minor sediment plume was observed outside the silt curtain at P69. The Contractor was reminded to rectify this deficiency accordingly.</p>
	<p>Ref No: 1501215-O02</p> <p>Impact: Water Quality (B21)</p> <p>Details: Floating rubbish was observed within the silt curtain at P69. The Contractor was reminded to clear it ASAP.</p>
	<p>Ref No: 1501215-R03</p> <p>Impact: Water Quality (B25)</p> <p>Details: Properly deploy the silt curtain at P68.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 1501215-R04</p> <p>Impact: Air Quality (D26)</p> <p>Details: Provide NRMM label for the air compressor at P68.</p>
	<p>Ref No: 1501215-R05</p> <p>Impact: Waste / Chemical Management (F1i. & iii.)</p> <p>Details: Clear the rubbish at near the wetsep at Portion C (P110).</p>
	<p>Ref No: 1501215-R06</p> <p>Impact: Waste / Chemical Management (F3i. & F8)</p> <p>Details: Clear the oil containers and oil leakage at near the discharging point at P106 (Portion C).</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 1501215-R07</p> <p>Impact: Water Quality (B21 & B25)</p> <p>Details: Clear the floating rubbish and damage silt curtain at P91.</p>
	<p>Ref No: 1501215-R08</p> <p>Impact: Ecology (C31)</p> <p>Details: Properly erect the fencing to protect the trees at P98.</p>
 <p>P102</p> <p>P109</p>	<p>Ref No: 1501215-R09</p> <p>Impact: Waste / Chemical Management (F8)</p> <p>Details: Provide proper area for the equipment (segment carrier / lift equipment) maintenance works to avoid soil contamination at P102 and P109.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 1501215-R10</p> <p>Impact: Waste / Chemical Management (F9)</p> <p>Details: Provide drip tray for the oil containers at P70.</p>
	<p>Ref No: 1501215-R11</p> <p>Impact: Waste / Chemical Management (F8)</p> <p>Details: Clear the oil spillage at near the air compressor at P68.</p>
	<p>Ref No: 1501215-R12</p> <p>Impact: Water Quality (B3i.)</p> <p>Details: Provide proper sedimentation facilities at P68 to ensure the discharge comply with WPCO license.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Rectification Actions taken by the Contractor for Environmental Deficiencies Identified during Previous Audit Session

	<p>Ref No: 1501210-R02</p> <p>Impact: Air Quality (D26) Noise (E8)</p> <p>Details: Provide NRMM label and noise emission label for the air compressor and excavator which will be used on site at P68.</p> <p>Follow Up: The noise emission label and NRMM label were provided for the air compressor and excavator respectively.</p>
 <p style="text-align: center;">P102</p> <p style="text-align: center;">P111</p>	<p>Ref No: 1501210-R04</p> <p>Impact: Waste / Chemical Management (F6)</p> <p>Details: Clear the U-Channel at P102 and Portion C (P111).</p> <p>Follow Up: The U-Channel at P102 and Portion C were cleared.</p>

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill



Ref No: 1501210-R05

Impact:
Water Quality (B3iii.)

Details:
Ensure adequate capacity of sedimentation facilities at Portion C (P110).

Follow Up:
The sedimentation facilities at Portion C were cleared regularly to ensure it can function properly.

Contract HY/2011/09


Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Weekly Site Inspection Record Summary
Inspection Information

Checklist Reference Number	151223
Date	23 December 2015 (Wednesday)
Time	9:30 – 11:50

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-
Ref. No.	Remarks/Observations	Related Item No.
	A. Water Quality	
151223-R04	• Properly deploy the silt curtain at P78.	B25
	B. Ecology	
	• No environmental deficiency was identified during site inspection.	
	C. Air Quality	
	• No environmental deficiency was identified during site inspection.	
	D. Noise	
	• No environmental deficiency was identified during site inspection.	
	E. Waste / Chemical Management	
151223-R01	• Provide drip tray for the chemical containers at P63, P64 and P78.	F9
151223-R02	• Clear the oily water at the drip tray as chemical waste at P64.	F9
151223-R03	• Clear the accumulated rubbish at P64 regularly.	F1i.
	F. Permits/Licences	
	• No environmental deficiency was identified during site inspection.	
	G. Others	
	• Follow-up on previous site audit session (Ref. No. 151215), follow up action is required for the item(s) 151215-R07, R08 & R12.	

	Name	Signature	Date
Recorded by	Ivy Tam		23 December 2015
Checked by	Dr. Priscilla Choy		23 December 2015

Environmental Observations Identified during the Environmental Site Inspection
(23 December 2015)



P64



P63



P78

Ref No: 1501223-R01

Impact:
Waste / Chemical Management (F9)

Details:
Provide drip tray for the chemical containers at P63, P64 and P78.

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 1501223-R02</p> <p>Impact: Waste / Chemical Management (F9)</p> <p>Details: Clear the oily water at the drip tray as chemical waste at P64.</p>
	<p>Ref No: 1501223-R03</p> <p>Impact: Waste / Chemical Management (F1i.)</p> <p>Details: Clear the accumulated rubbish at P64 regularly.</p>
	<p>Ref No: 1501223-R04</p> <p>Impact: Water Quality (B25)</p> <p>Details: Properly deploy the silt curtain at P78.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Rectification Actions taken by the Contractor for Environmental Deficiencies Identified during Previous Audit Session

	<p>Ref No: 1501215-O01</p> <p>Impact: Water Quality (B26)</p> <p>Details: Minor sediment plume was observed outside the silt curtain at P69. The Contractor was reminded to rectify this deficiency accordingly.</p> <p>Follow Up: The silt curtain was deployed again and no further sediment plume was observed outside the silt curtain.</p>
	<p>Ref No: 1501215-O02</p> <p>Impact: Water Quality (B21)</p> <p>Details: Floating rubbish was observed within the silt curtain at P69. The Contractor was reminded to clear it ASAP.</p> <p>Follow Up: The floating rubbish within the silt curtain was cleared by the workers.</p>
	<p>Ref No: 1501215-R03</p> <p>Impact: Water Quality (B25)</p> <p>Details: Properly deploy the silt curtain at P68.</p> <p>Follow Up: The silt curtain at P68 was deployed regularly to ensure it can function properly.</p>

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 1501215-R04</p> <p>Impact: Air Quality (D26)</p> <p>Details: Provide NRMM label for the air compressor at P68.</p> <p>Follow Up: The application of NRMM label was submitted and waiting EPD to issue the label.</p>
	<p>Ref No: 1501215-R05</p> <p>Impact: Waste / Chemical Management (F1i. & iii.)</p> <p>Details: Clear the rubbish at near the wetsep at Portion C (P110).</p> <p>Follow Up: The rubbish at near the wetsep was cleared.</p>
	<p>Ref No: 1501215-R06</p> <p>Impact: Waste / Chemical Management (F3i. & F8)</p> <p>Details: Clear the oil containers and oil leakage at near the discharging point at P106 (Portion C).</p> <p>Follow Up: The oil containers and oil leakage were cleared.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill



P102



P109

Ref No: 1501215-R09

Impact:

Waste / Chemical Management (F8)

Details:

Provide proper area for the equipment (segment carrier / lift equipment) maintenance works to avoid soil contamination at P102 and P109.

Follow Up:

No further maintenance works of equipment were conducted at P102 and P109.



Ref No: 1501215-R10

Impact:

Waste / Chemical Management (F9)

Details:

Provide drip tray for the oil containers at P70.

Follow Up:

The oil containers were removed.

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill



Ref No: 1501215-R11

Impact:

Waste / Chemical Management (F8)

Details:

Clear the oil spillage at near the air compressor at P68.

Follow Up:

The oil spillage at near the air compressor was cleared.

Hong Kong-Zhuhai-Macao Bridge


Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Weekly Site Inspection Record Summary

Inspection Information

Checklist Reference Number	151229
Date	29 December 2015 (Tuesday)
Time	9:30 – 11:50

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-
Ref. No.	Remarks/Observations	Related Item No.
	A. Water Quality	
151229-R01	• Clear the sand and debris at the platform at P69.	B20
151229-R03	• Provide wastewater treatment facilities at P69, if necessary.	B22
	B. Ecology	
	• No environmental deficiency was identified during site inspection.	
	C. Air Quality	
	• No environmental deficiency was identified during site inspection.	
	D. Noise	
	• No environmental deficiency was identified during site inspection.	
	E. Waste / Chemical Management	
151229-R02	• Ensure the valves at the drip tray are closed to avoid the leakage of oily water at P69 & P70.	F9
151229-R04	• Provide drip tray for the chemical containers at P80.	F9
	F. Permits/Licences	
	• No environmental deficiency was identified during site inspection.	
	G. Others	
	• Follow-up on previous site audit session (Ref. No. 151223), all environmental deficiencies were improved/rectified by contractor during the site inspection.	

	Name	Signature	Date
Recorded by	Ivy Tam		29 December 2015
Checked by	Dr. Priscilla Choy		29 December 2015

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Environmental Observations Identified during the Environmental Site Inspection
(29 December 2015)

	<p>Ref No: 1501229-R01</p> <p>Impact: Water Quality (B20)</p> <p>Details: Clear the sand and debris at the platform at P69.</p>
	<p>Ref No: 1501229-R02</p> <p>Impact: Waste / Chemical Management (F9)</p> <p>Details: Ensure the valves at the drip tray are closed to avoid the leakage of oily water at P69 & P70.</p>
	

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 1501229-R03</p> <p>Impact: Water Quality (B22)</p> <p>Details: Provide wastewater treatment facilities at P69, if necessary.</p>
	<p>Ref No: 1501229-R04</p> <p>Impact: Waste / Chemical Management (F9)</p> <p>Details: Provide drip tray for the chemical containers at P80.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

**Rectification Actions taken by the Contractor for Environmental Deficiencies
Identified during Previous Audit Session**



P64



P63



P78

Ref No: 1501223-R01

Impact:
Waste / Chemical Management (F9)

Details:
Provide drip tray for the chemical containers at P63, P64 and P78.

Follow Up:
The chemical container at P64 & P63 were removed and drip tray was provided the chemical container at P78.

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 1501223-R02</p> <p>Impact: Waste / Chemical Management (F9)</p> <p>Details: Clear the oily water at the drip tray as chemical waste at P64.</p> <p>Follow Up: The drip tray for chemical container was removed.</p>
	<p>Ref No: 1501223-R03</p> <p>Impact: Waste / Chemical Management (F1i.)</p> <p>Details: Clear the accumulated rubbish at P64 regularly.</p> <p>Follow Up: The skip with full rubbish was replaced</p>
	<p>Ref No: 1501223-R04</p> <p>Impact: Water Quality (B25)</p> <p>Details: Properly deploy the silt curtain at P78.</p> <p>Follow Up: Silt curtain was properly deployed.</p>

**APPENDIX N
UPDATED ENVIRONMENTAL
MITIGATION IMPLEMENTATION
SCHEDULE (EMIS)**

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
Air Quality							
S5.5.6.1	A1	1) The contractor shall follow the procedures and requirements given in the Air Pollution Control (Construction Dust) Regulation	Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.	Contractor	All construction sites	Construction stage	^
S5.5.6.2	A2	2) Proper watering of exposed spoil should be undertaken throughout the construction phase: <ul style="list-style-type: none"> • Any excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading; • Any dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads; • A stockpile of dusty material should not be extend beyond the pedestrian barriers, fencing or traffic cones. • The load of dusty materials on a vehicle leaving a construction site should be covered entirely by impervious sheeting to ensure that the dusty materials do not leak from the vehicle; • Where practicable, vehicle washing facilities with high pressure water jet should be provided at every discernible or designated vehicle exit point. The area where vehicle washing takes place and the road section between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores; 	Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.	Contractor	All construction sites	Construction stage	* ^ ^ ^ ^
S5.5.6.2	A2	<ul style="list-style-type: none"> • When there are open excavation and reinstatement works, hoarding 	Good construction site	Contractor	All construction	Construction	^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>of not less than 2.4m high should be provided as far as practicable along the site boundary with provision for public crossing. Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period;</p> <ul style="list-style-type: none"> • The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials; • Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical continuously; • Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities so as to maintain the entire surface wet; • Where a scaffolding is erected around the perimeter of a building under construction, effective dust screens, sheeting or netting should be provided to enclose the scaffolding from the ground floor level of the building, or a canopy should be provided from the first floor level up to the highest level of the scaffolding; • Any skip hoist for material transport should be totally enclosed by impervious sheeting; • Every stock of more than 20 bags of cement or dry pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides; 	<p>practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.</p>		sites	stage	<p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">N/A</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>materials should be carried out in totally enclosed system;</p> <ul style="list-style-type: none"> All dust-laden air or waste gas generated by the process operations should be properly extracted and vented to fabric filtering system to meet the emission limits for TSP; Vents for all silos and cement/pulverised fuel ash (PFA) weighing scale should be fitted with fabric filtering system; The materials which may generate airborne dusty emissions should be wetted by water spray system; All receiving hoppers should be enclosed on three sides up to 3m above unloading point; All conveyor transfer points should be totally enclosed; All access and route roads within the premises should be paved and wetted; and Vehicle cleaning facilities should be provided and used by all concrete trucks before leaving the premises to wash off any dust on the wheels and/or body. 	monitoring stations to ensure compliance with relevant criteria throughout the construction period.		monitoring station		<p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p>
S5.5.2.7	A7	<p>The following mitigation measures should be adopted to prevent fugitive dust emissions at barging point:</p> <ul style="list-style-type: none"> All road surface within the barging facilities will be paved; Dust enclosures will be provided for the loading ramp; Vehicles will be required to pass through designated wheels wash facilities; and Continuous water spray at the loading points. 	Control construction dust	Contractor	All construction sites	Construction stage	<p>N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p>
Construction Noise (Air borne)							
S6.4.10	N1	1) Use of good site practices to limit noise emissions by considering the	Control construction airborne	Contractor	All construction	Construction	

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>following:</p> <ul style="list-style-type: none"> only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme; machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs; silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works; mobile plant should be sited as far away from NSRs as possible and practicable; material stockpiles, mobile container site officer and other structures should be effectively utilised, where practicable, to screen noise from on-site construction activities. 	noise by means of good site practices		sites	stage	^ ^ ^ ^ ^
S6.4.11	N2	2) Install temporary hoarding located on the site boundaries between noisy construction activities and NSRs. The conditions of the hoardings shall be properly maintained throughout the construction period.	Reduce the construction noise levels at low-level zone of NSRs through partial screening.	Contractor	All construction sites	Construction stage	^
S6.4.12	N3	3) Install movable noise barriers (typically density @14kg/m ²), acoustic mat or full enclosure close to noisy plants including air compressor, generators, saw.	Screen the noisy plant items to be used at all construction sites	Contractor	For plant items listed in Appendix 6D of the EIA report at all construction sites	Construction stage	^
S6.4.13	N4	4) Select "Quiet plants" which comply with the BS 5228 Part 1 or TM	Reduce the noise levels of	Contractor	For plant items	Construction	^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		standards.	plant items		listed in Appendix 6D of the EIA report at all construction sites	stage	
S6.4.14	N5	5) Sequencing operation of construction plants where practicable.	Operate sequentially within the same work site to reduce the construction airborne noise	Contractor	All construction sites where practicable	Construction stage	^
	N6	6) Implement a noise monitoring under EM&A programme.	Monitor the construction noise levels at the selected representative locations	Contractor	Selected representative noise monitoring station	Construction stage	^
Waste Management (Construction Waste)							
S8.3.8	WM1	<u>Construction and Demolition Material</u> The following mitigation measures should be implemented in handling the waste: <ul style="list-style-type: none"> Maintain temporary stockpiles and reuse excavated fill material for backfilling and reinstatement; Carry out on-site sorting; Make provisions in the Contract documents to allow and promote the use of recycled aggregates where appropriate; Adopt 'Selective Demolition' technique to demolish the existing structures and facilities with a view to recovering broken concrete effectively for recycling purpose, where possible; Implement a trip-ticket system for each works contract to ensure that 	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal	Contractor	All construction sites	Construction stage	^ ^ ^ N/A ^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>the disposal of C&D materials are properly documented and verified; and</p> <ul style="list-style-type: none"> Implement an enhanced Waste Management Plan similar to ETWBTC (Works) No. 19/2005 – “Environmental Management on Construction Sites” to encourage on-site sorting of C&D materials and to minimize their generation during the course of construction. In addition, disposal of the C&D materials onto any sensitive locations such as agricultural lands, etc. should be avoided. The Contractor shall propose the final disposal sites to the Project Proponent and get its approval before implementation 					<p style="text-align: center;">*</p> <p style="text-align: center;">*</p>
S8.3.9 - S8.3.11	WM2	<p><u>C&D Waste</u></p> <ul style="list-style-type: none"> Standard formwork or pre-fabrication should be used as far as practicable in order to minimise the arising of C&D materials. The use of more durable formwork or plastic facing for the construction works should be considered. Use of wooden hoardings should not be used, as in other projects. Metal hoarding should be used to enhance the possibility of recycling. The purchasing of construction materials will be carefully planned in order to avoid over ordering and wastage. The Contractor should recycle as much of the C&D materials as possible on-site. Public fill and C&D waste should be segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal. Where practicable, concrete and masonry can be crushed and used as fill. Steel reinforcement bar can be used by scrap steel mills. Different 	<p>Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal</p>	Contractor	All construction sites	Construction stage	<p style="text-align: center;">^</p> <p style="text-align: center;">^</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		waste collection service and can supply the necessary storage containers; or be to a reuser of the waste, under approval from the EPD.					
S8.3.16	WM4	<u>Sewage</u> <ul style="list-style-type: none"> • Adequate numbers of portable toilets should be provided for the workers. The portable toilets should be maintained in a state, which will not deter the workers from utilizing these portable toilets. Night soil should be collected by licensed collectors regularly. 	Proper handling of sewage from worker to avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	^
S8.3.17	WM5	<u>General Refuse</u> <ul style="list-style-type: none"> • General refuse generated on-site should be stored in enclosed bins or compaction units separately from construction and chemical wastes. • A reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from construction and chemical wastes, on a daily basis to minimize odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law. • Aluminium cans are often recovered from the waste stream by individual collectors if they are segregated and made easily accessible. Separate labelled bins for their deposit should be provided if feasible. • Office wastes can be reduced through the recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered by the Contractor. In addition, waste separation facilities for paper, aluminum cans, 	Minimize production of the general refuse and avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	* ^ ^ ^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>plastic bottles etc., should be provided.</p> <ul style="list-style-type: none"> • Training should be provided to workers about the concepts of site cleanliness and appropriate waste management procedure, including reduction, reuse and recycling of wastes. 					*
Water Quality (Construction Phase)							
S9.11.1 – S9.11.1.2	W1	<ul style="list-style-type: none"> • Mitigation during the marine works to reduce impacts to within acceptable levels have been recommended and will comprise a series of measures that restrict the method and sequencing of dredging/backfilling, as well as protection measures. Details of the measures are provided below and summarised in the Environmental Mitigation Implementation Schedule in EM&A Manual. • Export for dredged spoils from NWWCZ avoiding exerting high demand on the disposal facilities in the NWWCZ and, hence, minimise potential cumulative impacts; • For the marine viaducts of HKLR, the bored piling will be undertaken within a metal casing; • where public fill is proposed for filling below -2.5mPD, the fine content in the public fill will be controlled to 25%; • single layer silt curtains will be applied around all works; • during the first two months of dredging work for HKLR, the silt-removal efficiency of the silt-curtains shall be verified by examining the results of water quality monitoring points. The water quality monitoring points to be selected for the above shall be those close to the locations of the initial period of dredging work. Details in this regard shall be determined by the ENPO to be established, 	To control construction water quality	Contractor	During seawall dredging and filling	Construction stage	^ ^ ^ N/A ^ N/A

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<ul style="list-style-type: none"> all vessels shall be sized such that adequate clearance is maintained between vessels and the sea bed at all states of the tide to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash; and the works shall not cause foam, oil, grease, litter or other objectionable matter to be present in the water within and adjacent to the works site. 					<p>^</p> <p>^</p>
S9.11.1.3	W2	<p><u>Land Works</u></p> <p>General construction activities on land should also be governed by standard good working practice. Specific measures to be written into the works contracts should include:</p> <ul style="list-style-type: none"> wastewater from temporary site facilities should be controlled to prevent direct discharge to surface or marine waters; sewage effluent and discharges from on-site kitchen facilities shall be directed to Government sewer in accordance with the requirements of the WPCO or collected for disposal offsite. The use of soakaways shall be avoided; storm drainage shall be directed to storm drains via adequately designed sand/silt removal facilities such as sand traps, silt traps and sediment basins. Channels, earth bunds or sand bag barriers should be provided on site to properly direct stormwater to such silt removal facilities. Catchpits and perimeter channels should be constructed in advance of site formation works and earthworks; silt removal facilities, channels and manholes shall be maintained and any deposited silt and grit shall be removed regularly, including 	To control construction water quality	Contractor	During seawall dredging and filling	Construction stage	<p>^</p> <p>N/A</p> <p>*</p> <p>*</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>specifically at the onset of and after each rainstorm;</p> <ul style="list-style-type: none"> • temporary access roads should be surfaced with crushed stone or gravel; • rainwater pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities; • measures should be taken to prevent the washout of construction materials, soil, silt or debris into any drainage system; • open stockpiles of construction materials (e.g. aggregates and sand) on site should be covered with tarpaulin or similar fabric during rainstorms; • manholes (including any newly constructed ones) should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris from getting into the drainage system, and to prevent storm run-off from getting into foul sewers; • discharges of surface run-off into foul sewers must always be prevented in order not to unduly overload the foul sewerage system; • all vehicles and plant should be cleaned before they leave the construction site to ensure that no earth, mud or debris is deposited by them on roads. A wheel washing bay should be provided at every site exit; • wheel wash overflow shall be directed to silt removal facilities before being discharged to the storm drain; • the section of construction road between the wheel washing bay and the public road should be surfaced with crushed stone or coarse gravel; 					<p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">*</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<ul style="list-style-type: none"> wastewater generated from concreting, plastering, internal decoration, cleaning work and other similar activities, shall be screened to remove large objects; vehicle and plant servicing areas, vehicle wash bays and lubrication facilities shall be located under roofed areas. The drainage in these covered areas shall be connected to foul sewers via a petrol interceptor in accordance with the requirements of the WPCO or collected for off site disposal; the contractors shall prepare an oil / chemical cleanup plan and ensure that leakages or spillages are contained and cleaned up immediately; waste oil should be collected and stored for recycling or disposal, in accordance with the Waste Disposal Ordinance; all fuel tanks and chemical storage areas should be provided with locks and be sited on sealed areas. The storage areas should be surrounded by bunds with a capacity equal to 110% of the storage capacity of the largest tank; and surface run-off from bunded areas should pass through oil/grease traps prior to discharge to the stormwater system. 					<p>^</p> <p>N/A</p> <p>*</p> <p>^</p> <p>^</p> <p>^</p>
S9.14	W3	Implement a water quality monitoring programme	Control water quality	Contractor	At identified monitoring location	During construction period	^
Ecology (Construction Phase)							
S10.7	E1	<ul style="list-style-type: none"> Good site practices to avoid runoff entering woodland habitats in Scenic Hill 	Avoid potential disturbance on habitat of Romer's Tree	Designer; Contractor	Scenic Hill	During construction	^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<ul style="list-style-type: none"> Reinstate works areas in Scenic Hill Avoid stream modification in Scenic Hill 	Frog in Scenic Hill				N/A ^
S10.7	E2	<ul style="list-style-type: none"> Use closed grab in dredging works. Install silt curtain during the construction. Limit dredging and works fronts. Good site practices Strict enforcement of no marine dumping. Site runoff control Spill response plan 	Minimise marine water quality impacts	Contractor	Seawall,	During construction	^ ^ ^ ^ ^ ^
S10.7	E3	<ul style="list-style-type: none"> Reprovision of replacement Artificial Reefs (of the same volume as the existing ARs inside Marine Exclusion Zone) 	Mitigate water quality impacts on the existing ARs	Project proponent	To be determined	Construction phase or operation phase	N/A
S10.7	E4	Watering to reduce dust generation; prevention of siltation of freshwater habitats; Site runoff should be desilted, to reduce the potential for suspended sediments, organics and other contaminants to enter streams and standing freshwater	Prevent Sedimentation from Land-based works areas	Contractor	Land-based works areas	During construction	^
S10.7	E5	Good site practices, including strictly following the permitted works hours, using quieter machines where practicable, and avoiding excessive lightings during night time	Prevent disturbance to terrestrial fauna and habitats	Contractor	Land-based works areas	During construction	^
S10.7	E6	<ul style="list-style-type: none"> Dolphin Exclusion Zone; Dolphin watching plan 	Minimize temporary marine habitat loss impact to dolphins	Contractor	Marine works	During marine works	^ ^
S10.7	E7	<ul style="list-style-type: none"> Decouple compressors and other equipment on working vessels Avoidance of percussive piling Marine underwater noise monitoring 	Minimise marine noise impacts on dolphins	Contractor	Marine works	During marine works	^ ^ ^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<ul style="list-style-type: none"> Temporal suspension of drilling bored pile casing in rock during peak dolphin calving season in May and June 					N/A
S10.7	E8	<ul style="list-style-type: none"> Control vessel speed Skipper training. Predefined and regular routes for working vessels; avoid Brothers Islands. 	Minimise marine traffic disturbance on dolphins	Contractor	Marine traffic	During marine works	^ ^ ^
S10.10	E9	<ul style="list-style-type: none"> Dolphin vessel monitoring 	Minimise marine traffic disturbance on dolphins	Contractor	North Lantau and West Lantau	Prior to construction, during construction, and 1 year after operation	^
Fisheries							
S11.7	F1	<ul style="list-style-type: none"> Reprovision of replacement Artificial Reefs(of the same volume as the existing ARs inside Marine Exclusion Zone) 	Mitigate water quality impacts on the existing ARs	Project proponent	To be determined	Construction phase or operation phase	N/A
S11.7	F2	<ul style="list-style-type: none"> Reduce re-suspension of sediments Limit dredging and works fronts. Good site practices Strict enforcement of no marine dumping Spill response plan 	Minimise marine water quality impacts	Contractor	Seawall,	During construction	^ ^ ^ ^ ^
Landscape & Visual (Construction Phase)							
S14.3.3.3	LV2	<p>Mitigate both Landscape and Visual Impacts</p> <ul style="list-style-type: none"> G1. Grass-hydroseed bare soil surface and stock pile areas. 	Minimise visual & landscape impact	Contractor	HKLR	Construction stage	N/A

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<ul style="list-style-type: none"> • G2. Add planting strip and automatic irrigation system if appropriate at some portions of bridge or footbridge to screen bridge and traffic. • G3. For HKLR, providing aesthetic design on the viaduct, tunnel portals, at-grade roads (e.g. subtle colour tone and slim form for viaduct, featured form of tunnel portals, roadside planting along at-grade roads and landscape berm on) to beautify the HKLR alignment. • G5. Vegetation reinstatement and upgrading to disturbed areas. • G6. Maximize new tree, shrub and other vegetation planting to compensate tree felled and vegetation removed. • G7. Provide planting area around peripheral of and within HKLR for tree screening buffer effect. • G8. Plant salt tolerant native tree and shrubs etc along the planter strip at affected seawall. • G9. Reserve of loose natural granite rocks for re-use. Provide new coastline to adopt “natural-look” by means of using armour rocks in the form of natural rock materials and planting strip area accommodating screen buffer to enhance “natural-look” of the new coastline (see Figure 14.4.2 for example). 					<p>N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p>
S14.3.3.3	LV3	<p><u>Mitigate Visual Impacts</u></p> <ul style="list-style-type: none"> • V1.Minimize time for construction activities during construction period. • V2.Provide screen hoarding at the portion of the project site / works areas / storage areas near VSRs who have close low-level views to the Project during HKLR construction. 					<p>^</p> <p>^</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
EM&A							
S15.2.2	EM1	An Independent Environmental Checker needs to be employed as per the EM&A Manual.	Control EM&A Performance	Project Proponent	All construction sites	Construction stage	^
S15.5 - S15.6	EM2	1) An Environmental Team needs to be employed as per the EM&A Manual. 2) Prepare a systematic Environmental Management Plan to ensure effective implementation of the mitigation measures. 3) An environmental impact monitoring needs to be implementing by the Environmental Team to ensure all the requirements given in the EM&A Manual are fully complied with.	Perform environmental monitoring & auditing	Contractor	All construction sites	Construction stage	^ ^ ^

Remarks: ^ Compliance of mitigation measure
 * Recommendation was made during site audit but improved/rectified by the contractor
 N/A Not Applicable at this stage as no such site activities were conducted in the reporting month (e.g. concrete batching plan, barging point, seawall dredging and filling, bored piling, landscaping works etc)

**APPENDIX O
WASTE GENERATION IN THE
REPORTING MONTH**



Appendix: C6 Monthly Summary Waste Flow Table

Name of Department: HyD

Contract No.: HY/2011/09

Monthly Summary Waste Flow Table for 2015 (Year)

Month	Actual Quantities of Inert C&D Materials Generated Monthly						Actual Quantities of C&D Wastes Generated Monthly				
	Total Quantity Generated ¹¹	Hard Rock and Large Broken Concrete ⁶	Reused in the Contract ^{8,9}	Reused in other Projects ^{5,8,9}	Disposed as Public Fill ⁷	Imported Fill ^{6,7,8,9}	Metals ¹²	Paper/ cardboard packaging	Plastics ³	Chemical Waste	Others, e.g. general refuse ^{8,9}
	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 kg)	(in '000 kg)	(in '000 kg)	(in '000 m ³)
Jan	4.101	0.000	0.000	0.000	4.101	0.000	0.070	0.485	0.000	0.000	0.566
Feb	3.823	0.000	0.000	0.000	3.823	0.000	0.000	0.550	0.000	0.000	0.241
Mar	0.681	0.000	0.000	0.000	0.681	0.000	0.096	0.729	0.000	0.793	0.299
Apr	0.406	0.000	0.000	0.000	0.406	0.000	0.049	0.909	0.000	0.000	0.202
May	0.176	0.000	0.000	0.000	0.176	0.000	0.005	1.096	0.000	0.000	0.267
Jun	0.287	0.000	0.000	0.000	0.287	0.000	0.095	1.146	0.000	0.000	0.234
Sub-Total	9.472	0.000	0.000	0.000	9.472	0.000	0.314	4.915	0.000	0.793	1.807
Jul	0.293	0.000	0.000	0.000	0.293	0.000	0.071	1.064	0.000	2.378	0.280
Aug	0.764	0.000	0.000	0.000	0.764	0.000	0.020	1.031	0.000	0.000	0.273
Sep	0.555	0.000	0.000	0.000	0.555	0.000	0.144	1.650	0.000	0.000	0.267
Oct	0.382	0.000	0.000	0.000	0.382	0.000	0.013	1.041	0.000	0.882	0.371
Nov	3.224	0.000	0.000	0.000	3.224	0.000	0.064	1.024	0.000	2.378	0.280
Dec	5.619	0.000	0.000	0.000	4.274	1.345	0.129	1.041	0.000	0.991	0.293
Total	20.310	0.000	0.000	0.000	18.965	1.345	0.756	11.766	0.000	7.423	3.569



Forecast of Total Quantities of C&D Materials to be Generated from the Contract ¹⁰										
Total Quantity Generated ¹¹	Hard Rock and Large Broken Concrete ⁶	Reused in the Contract ^{8,9}	Reused in other Projects ^{5,8,9}	Disposed as Public Fill ⁷	Imported Fill ^{6,7,8,9}	Metals	Paper/ cardboard packaging	Plastics ³	Chemical Waste	Others, e.g. general refuse ^{8,9}
(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 kg)	(in '000 kg)	(in '000 kg)	(in '000 m ³)
229.311	0.000	3.200	73.111	100.000	53.000	4.400	40.000	0.000	15.000	10.000

- Notes:
- (1) The performance targets are given in ER Appendix 8J Clause 14 and the EM&A Manual.
 - (2) The waste flow table shall also include C&D materials to be imported for use at the Site.
 - (3) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material.
 - (4) The Contractor shall also submit the latest forecast of the total amount of C&D materials expected to be generated from the Works, together with a breakdown of the nature where the total amount of C&D materials expected to be generated from the Works is equal to or exceeding 50,000 m³. (ER Part 8 Clause 8.8.5 (d) (ii) refers).
 - (5) The materials reused in other Project shall not be treated as waste under the Waste Disposal Ordinance (CAP354).
 - (6) According to the EIA Appendix 8B, the density of rock (bulked) is 2.0 tonnes/m³.
 - (7) According to the EIA Appendix 8B, the density of soil (bulked) is 1.8 tonnes/m³.
 - (8) Assuming the loading quantities of a 30-tonne truck is 8.0m³.
 - (9) Assuming the loading quantities of a 24-tonne truck is 6.5m³.
 - (10) The forecast of C&D materials to be generated from the Contract is sourced from the works program in December 2014.
 - (11) The volume of Total Quantity Generated means the volume of Hard Rock and Large Broken Concrete+Disposed as Public Fill+Imported Fill-Reused in the Contract-Reused in other Projects.
 - (12) The density of metal is 7,850 kg/m³.

**APPENDIX P
COMPLAINT LOG**

Appendix P - Complaint Log

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
Com-2013-04-001	Near Tung Chung New Development Pier	8 April 2013	EPD received the complaint on 8 April 2013. The complainant complained about oil was dumped from various vessels operating for Hong Kong-Zhuhai-Macao Bridge Hong Kong (HZMB HK) Projects near Tung Chung New Development Pier over the past few months.	1) The vessels photos in the complainant's photo are not the working vessels under Contract No. HK/2011/09. 2) No oil dumped from Contract No. HK/2011/09's working vessels was observed according to ET's site inspection conducted on 9 April 2013 at near Tung Chung New Development Ferry Pier. 3) Joint site inspection (DCVJV and ARUP) was conducted on 10 April 2013 and confirmed that Contract No. HY/2011/09's vessels are not involved the complaint case. 4) DCVJV will keep remind their boat crews not discharging contaminated effluent directly into the sea.	Closed
Com-2013-05-001	WA6	2 May 2013	ARUP received the complaint on 2 May 2013. The complainant alleged the noise nuisance was generated from the Works Area WA6 at around 13:00 on 1 May 2013 (Wednesday).	The site diary report was reviewed and confirmed that no works were carried out at WA6 on 1 May 2013. In addition, no noise was heard from WA6 according to the security guard who on duty at WA6 on 1 May 2013. Based on the information provided, the complaint regarding the construction noise at WA6 is not considered justifiable.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
Com-2013-05-002	WA6	18 May 2013	ARUP received the complaint on 18 May 2013. The complainant advised that the noise nuisance due to loading of metal parts at barge near the seawall of Works Area WA6 early morning (around 8:45a.m) on 18 May 2013 (Saturday).	Based on the record of site activities at WA6 on 18 May 2013, 4 metal plates and 2 oxygen-acetylene set were lifted onto a derrick boat “Chiu Kee” by a crane near seawall at WA6 in the morning on that day. Such operation was commenced around 8:40a.m and completed in 10 minutes during the normal construction working hour (0700 – 1900 Monday to Saturday). However, the duration of aforesaid activities is very short and infrequent. Nevertheless, the Contractor was reminded to strengthen their site supervision and provide training for the workers regularly to increase awareness of their environmental responsibilities to minimize the noise impact to the nearby residents and the specific mitigation measures for the complaint including but not limited to:- <ul style="list-style-type: none"> •To place wooden planks or rubber mats on ground for loading and unloading heavy or metal objects; and •To deploy professional personnel to supervise the works. 	Closed
Com-2013-05-003	Near Tung Chung New Development Pier	18 May 2013	EPD received the public complaint on 18 May 2013. This complaint was a follow-up of a previous complaint received by EPD on 8	After receiving the complaint, additional site inspection was conducted at near Tung Chung New Development Pier on 30 May 2013 to investigate whether oil	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
			<p>April 2013 (Com-2013-04-001).</p> <p>The complainant complained again about the oil was dumped from various vessels operating for Hong Kong-Zhuhai-Macao Bridge Hong Kong (HZMB HK) Projects near Tung Chung New Development Pier over the past months.</p>	<p>dumped was due to Contract No. HY/2011/09's vessels. During the site inspection, three working vessels under Contract No.HY/2011/09 was anchored off near Tung Chung New Development Pier. No oil dumped from Contract No. HY/2011/09's vessels were observed and the water around the vessels was clear.</p> <p>The following mitigation measures have been implemented by DCVJV:</p> <ul style="list-style-type: none"> • DCVJV has sent the letter to the shipping agent to remind them to ensure the vessels under Contract No. HY/2011/09 are in good condition and any oil dumped to sea should be avoided to prevent water pollution. • Provide training to the vessel skippers for prevention of pollution from ships. • DCVJV requested vessel skippers to provide engine oil disposal records The vessel skippers assured to us that all waste lubricants were sent to waste collectors regularly and no oil discharge into seawater. 	
Com-2013-07-001	Southeast Quay of Chek Lap Kok near the junction of Chek Lap Kok South Road and Scenic Road	17 July 2013	The complaint was received by EPD on 17 th July 2013. According to the EPD's letter, the complainant was concerned for the noise nuisance generated from the	In response to the complaint, ET conducted two times site inspections at Southeast Quay at Chek Lap Kok between 18:45 and 20:30 hours on 23 July 2013 and 20:30 to 22:30 hours on 30 July 2013.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
			<p>operation of concrete lorry mixers during evening and night-time period at Southeast Quay of Chek Lap Kok.</p>	<p>During the inspections, the Ro-Ro barge was observed anchored off Southeast Quay at Chek Lap Kok but no concrete lorry mixer was observed throughout the inspection.</p> <p>On 23 July 2013, at about 19:35, one tug boat was observed travelling to Southeast Quay, Chek Lap Kok and left at about 19:40.</p> <p>On 30 July 2013, no tug boat and concrete lorry mixers were observed during the inspection.</p> <p>According to the Contractor, there was no concreting works for the pier sites on 23 July 2013 and therefore no loading and unloading operation at Southeast Quay at Chek Lap Kok.</p> <p>Concreting works were performed at Pier 0 on 30 July 2013. As the Contractor anticipated the arrival time of tug boat and flap-top barge at Southeast Quay will exceed 23:00 hours after the concreting works, they decided to arrange the tug boat and flap-top barge with concrete</p>	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<p>lorry mixers anchored off around Pier 66 after 23:00 hours. So, no loading and unloading operation at Southeast Quay at Chek Lap Kok was observed.</p> <p>Further night time site inspection was conducted on 22 August 2013 during the loading and unloading operation at Southeast Quay of Chek Lap Kok, the construction works conducted under Contract No. HY/2011/09 complied with the conditions in the CNP No. GW-RS0895-13.</p>	
Com-2013-11-001	Chek Lap Kok (CLK) South Road	16 November 2013	The complaint was received by project customer services on 16 th November 2013 regarding the dust problem at Chek Lap Kok (CLK) South Road.	<p>After receiving the complaint, ET conducted the site inspection on 19 and 29 November 2013 to check the appropriate environmental protection and pollution control measures which are properly implemented by the Contractor under HY/2011/09 (DCVJV). The observation are summarized as below:-</p> <ul style="list-style-type: none"> • Dust generation works was conducted by the other Contractor at South East Quay • Proper watering of haul road to avoid dust generation during vehicle / plant equipment movement. • Vehicle washing facilities provided 	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<p>at every site exit at CLK South Road and South Perimeter Road.</p> <ul style="list-style-type: none"> No dark smoke was observed emitting from the plant equipments. <p>Based on the information collected, the complaint of dust problem at Check Lap Kok South Road is considered not related to Contract No. HY/2011/09 as dust suppression measures has been properly implemented by the Contractor on site to prevent dust nuisance from the construction activities.</p>	
Com-2014-01-001	Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill (Contract No. HY/2011/09)	3 January 2014	The complaint was received by EPD on 3 rd January 2014. According to the EPD’s letter, a resident in Tai O District was concerned for the noise nuisance occasionally arising from the hammering or hitting of metals from Contract No. HY/2011/09.	<p>In response to the complaint, ET conducted an ad hoc night time site inspection at P0, P18 and P19 on 14 January 2014 between around 23:00 and 00:30 hours of 15 January 2014.</p> <p>In accordance with the site activities record and site inspections, the construction works conducted under Contract No. HY/2011/09 complied with the conditions in the CNP No. GW-RS1108-13.</p> <p>Nevertheless, the Contractor was advised to strictly follow the conditions of the permit because any deviation from the</p>	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<p>conditions may lead to cancellation of the permit, subsequent prosecution action and the Authority's refusal to issue further permit.</p> <p>In addition, the following environmental mitigation measures were recommended:</p> <ul style="list-style-type: none"> • Review and adjust the lighting directions of the barge, under safety consideration, to avoid potential visual impacts to residents in vicinities; • To ensure the equipment are maintaining in good operation condition; and • To strengthen site supervision and provide training for the workers regularly to increase awareness of their environmental responsibilities to minimize the noise impact to the nearby residents and the specific mitigation measures. 	
Com-2014-01-002	Hong Kong-Zhuhai-Macao Bridge	16 January 2014	The complaint was received by HyD's PR Team on 16 January 2014 that the complainant advised that the heavy exhaust fume affecting Tung Chung Crescent.	After receiving the complaint, ET conducted the site inspection on 21 January 2014 to check all the plant equipments which were operated for the construction works and air quality	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<p>mitigation measures.</p> <p>Based on the information collected, the complaint of heavy exhausts affecting Tung Chung Crescent is considered not related to Contract No. HY/2011/09 due to the following reason(s):-</p> <ol style="list-style-type: none"> 1) The work sites at Portion C and South East Quay at Portion A under Contract No. HY/2011/09 are approximately 800m from Tung Chung Crescent. Any unpleasant smell of exhaust fume would not be anticipated. 2) No heavy smoke was observed emitting from plants / equipment during the site inspection on 21 January 2014. 3) The vehicles and equipments were switched off while not in use. 4) All plant and equipment were well maintained and in good operating condition. 5) Air quality mitigation measures has been properly implemented by the Contractor on site to prevent dust nuisance from the construction activities. 	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
Com-2014-03-001	Oil Spillage at near Sha Lo Wan	5 March 2014	The complaint was received by EPD on 5 March 2014. The complainant suspected the oil leakage from the works area of Contract No. HY/2011/09 near Sha Lo Wan	Based on ET site inspection, no oil spillage from the works area under Contract No. HY/2011/09 at near Sha Lo Wan was observed. In addition, spill kits are ready on site in order to dealing with spillage cases promptly. Nevertheless, DCVJV was also recommended the mitigation measures as below: <ul style="list-style-type: none"> • Provide training for the workers regularly regarding the mitigation measures on waste / chemical management. • Provide sufficient chemical spillage kit (e.g. oil absorbent) to all vessels and working platform. • Regular check the condition of vessels and plant equipments to ensure no leakage of oil. 	Closed
Com-2014-03-002	Construction Noise in the vicinity of the waters outside Sha Lo Wan	11 March 2014	The complaint was received by EPD on 11 March 2014. According to the EPD's letter, the complainant was concerned for the mobile crane which operating in the vicinity of the waters outside Sha Lo Wan after 23:00.	In accordance with an ad hoc site inspection on 18 March 2014, no construction works were conducted during the restricted hours. The 1 st investigation report has been submitted to EPD on 21 March 2014 and the 2 nd investigation report was submitted to EPD on 26 June 2014. The Contractor was advised to strictly	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<p>follow the conditions of the permit because any deviation from the conditions may lead to cancellation of the permit, subsequent prosecution action and the Authority’s refusal to issue further permit. Nevertheless, the Contractor was reminded to take sufficient noise mitigation measures to minimize the environmental impact on the nearby community:</p> <ul style="list-style-type: none"> · To space out noisy equipment and position it as far away as possible from the sensitive receivers; · To avoid concurrent uses of noisy equipment near the sensitive area; · To ensure the equipment are maintaining in good operation condition; · To turned off any idle equipment on site; and · To enclose the noisy part of the machine by acoustic insulation material if feasible. · To arrange tailor-made training for the Production Team including the management and foremen to explain to them the conditions and requirements listed on the CNP. · To delegate one Engineer for ensuring that all construction activities and PMEs used are in full compliance with the CNP 	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				and legislative requirements.	
Com-2014-04-001	Construction marine works by the company Bauer Hong Kong in Tung Chung	14 April 2014	The complaint was received by Agriculture, Fisheries and Conservation Department (AFCD) on 14 April 2014, the complainant complained that the dead dolphin was found under a platform at construction marine works by the company Bauer Hong Kong in Tung Chung (Macau Bridge Piling Works)	<p>In accordance with the photos showing a date of 27 November 2013 (08:00 – 08:25a.m.) which provided by the complainant, the dolphin was observed has been dead for some time and shows signs of decomposition. It was difficult to determine the cause of death of the deceased dolphin based on the photographs and the dead dolphin was found a few months ago. By examining the photos, it is found that the body was beside a barge, not under a working platform.</p> <p>In addition, the dead dolphin was found in the early morning in which the marine construction works have not been commenced. Therefore, from the above information the dead dolphin is considered to be washed to the work site. However, there is no significant increase of cetacean stranding were found in Hong Kong since the commencement of Contact No. HY/2011/09.</p> <p>In regard to the complaint, the following recommendations were made:</p>	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<ul style="list-style-type: none"> ➤ In case stranded cetaceans are found, the AFCD shall be contacted immediately and provide the following information to facilitate AFCD’s investigation: <ol style="list-style-type: none"> 1. Name and telephone number; 2. Date and time of discovery; 3. Location (as specific as possible); 4. Status of the stranded animal (i.e. alive, freshly dead, slightly decomposed, rotten, mummified); 5. Type and size of the stranded animal. ➤ To implement Dolphin Exclusion Zone during the installation of bored pile casing located in the waters to the west of Airport. ➤ To implement Dolphin Watching Plan after the bored piling casing is installed. 	
Com-2014-05-001	At the shore of Sha Lo Wan	13 May 2014	The complaint was received by EPD on 13 May 2014. According to the EPD’s email, the complainant was concerned about the sand material that was excavated on the shore of Sha Lo Wan for the construction of Hong Kong -	After receiving the complaint from a Sha Lo Wan’s village resident, the sub-contractor was instructed to stop the sand excavation and leave immediately. In addition, all sands excavated from the shore of Sha Lo Wan were returned back to the original area on 13 May 2014.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
			Zhuhai - Macao Bridge (HZMB) Project on 11 May 2014.	<p>Nevertheless, the Contractor was advised to arrange tailor-made training for Production Team including the management and foremen to explain to them the conditions and requirements listed on the Environmental Permit.</p> <p>In addition, indicative poles and flags are recommended to put within the site boundary to identify the extent of land areas in Sha Lo Wan / Sha Lo Wan (West) Archaeological site.</p>	
Com-2014-05-002	At the shore of Sha Lo Wan	27 May 2014	The complaint was received by EPD on 27 May 2014. According to the EPD's email, the complainant was concerned about the dumping rubbles along the shore area of Sha Lo Wan on 27 May 2014.	<p>The complaint investigation report for the complaint of dumping rubbles along the shore area of Sha Lo Wan was submitted to EPD on 4 June 2014.</p> <p>EPD and AFCD provided their comments on 5 and 9 June 2014 respectively.</p> <p>A meeting among DCVJV, ARUP, IEC, ET, EPD and AFCD was held on 17 June 2014. According to the meeting, further information is required to include in the complaint investigation report and the report was submitted to EPD on 4 March 2015.</p>	Complaint investigation report is under review by EPD

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
Com-2014-05-003	Pier 39 to 50	29 May 2014	ARUP received the complaint on 29 May 2013. The complainant advised that the workers disposed hundreds of kg of waste spoils (concrete and earth) into the sea every day in the existing locations of HZMB site area.	Based on the investigation findings, the waste spoils (concrete and earth) were disposed to HY/2010/02 Project according to approved WMP. The following recommendations were made: <ul style="list-style-type: none"> • To check for any accumulation of waste spoils (concrete and earth) on site. • To cover the wastes skip with waste spoils before removing from site. • To carry out inspection of pier(s) regularly to ensure the frontline staff loads inert materials to approved barge properly. • To clean the waste storage areas regularly and do not cause dust nuisance. 	Closed
Com-2014-08-001	Near Sha Lo Wan	27 August 2014	ARUP received the complaint on 27 August 2013. The complainant was concerned about the dust on the surface of the roro-barge.	Based on the investigation findings, dusty materials at the ro-ro barge at P63 and dust generation when vehicles passing by at the roro-barge at Southeast Quay were observed. The following recommendations were made: <ul style="list-style-type: none"> • To check for any accumulation of dusty materials at roro-barge. • To cover the stockpile of dusty materials before removing from site. • To clean the surface of roro-barge 	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				regularly and do not cause dust and water quality nuisance. <ul style="list-style-type: none"> • To maintain the surface of ro-ro-barge wet especially during the vehicle movements. Water misting is considered an acceptable measure to control dust emissions. • To check and replace the worn sand bags at the surface of ro-ro-barge to prevent the turbid water from entering to the sea when watering the barge surface. 	
Com-2014-11-001	HZMB-HKLR – Section between HKSAR Boundary and Scenic Hill (Contract No. HY/2011/09)	11 November 2014	The complaint was received by EPD on 11 November 2014. According to the EPD’s email, the complaint was received from one of the green groups Sea Shepherd. They complained that the residual concrete had been washed off from the deck surface of a flat-top barge into the sea, and marine littering had been spotted by a worker of HZMB-HKLR – Section between HKSAR Boundary and Scenic Hill (Contract No. HY/2011/09)	Based on the investigation findings, residue concrete or wastewater contaminated with concrete overflowing/spilling into the sea from the ro-ro barge and marine littering were suspected. The following recommendations were made: <ul style="list-style-type: none"> ➤ Properly clear the concrete stains on the three ro-ro barges (e.g. hand-held equipments such as shovel etc). Tarpaulin sheet is also recommended to provide when clearing the concrete stains at the edge of ro-ro barge to prevent these removed materials from getting into the sea. 	Closed
Com-2014-11-002	HZMB-HKLR – Section between HKSAR Boundary and Scenic Hill	18 November 2014	The complaint was received by EPD on 18 November 2014. According to the EPD’s email, it was alleged that residual concrete	The worker should also pay special care to remove the concrete stains to	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
	(Contract No. HY/2011/09)		had been poured out directly from the concrete lorry mixers on a ro-ro barge into the sea during night-time by the workers of HZMB-HKLR – Section between HKSAR Boundary and Scenic Hill (Contract No. HY/2011/09)	minimize the water quality nuisance. ➤ Keep cleanliness of the surface of ro-ro-barge and do not cause water quality nuisance. ➤ To check and reinforce the concrete / sand bag bund between baffles erected near the edge of the three ro-ro barges to avoid accidental leakage of wastewater from the deck regularly. ➤ Keep all debris/ aggregate away from the edge of ro-ro barge to prevent them from falling into the sea. ➤ Provide sufficient skips for temporary storage of concrete residue/wastewater. ➤ To check for any accumulation of residual waste concrete at the waste skip on ro-ro-barge. ➤ Provide spare and sufficient sand bags at each ro-ro barges to confine the concerned area in the event of accidental spillage of concrete when discharge the concrete from the concrete lorry mixers to pump truck. ➤ Provide absorptive materials to absorb the wastewater in case of accidental spillage of wastewater	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				during washing concrete lorry mixers or other equipments. ➤ Assign trained staff to ensure proper management of environmental matters on each of the ro-ro barges in particular the handling of concrete residue/wastewater generated during operation. ➤ Keep record for collection of skip or temporary storage tank for wastewater and excess concrete. ➤ Ensure sufficient garbage bag / rubbish bin are provided at working barge / pier site. ➤ Provide training for the workers regularly regarding the water quality mitigation measures and waste management to increase their awareness of environmental protection.	
Com-2014-11-003	Floating Concrete Batching Plant (FCBP)	28 November 2014	The complaint was received by EPD on 28 November 2014. The complaint was received from one of the green groups Green Lantau Association. They complained about the hauling of the floating concrete batching plant (FCBP) by the tug boat to the site of Contract No. HY/2011/09 from the north-	Based on the information collected, the following conclusions were drawn: 1) It is suspected that the wake following the FCBP was resulted from disturbance to the bottom sediment when it was traveling during the lowest tide on that day. 2) The FCBP was traveling within the	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
			<p>east side had disturbed the seabed causing an increase of turbidity in marine waters at around noon of 15 November 2014.</p>	<p>site area and the maximum number of movement of a floating plant (and therefore tug boat) is two times per day. Average duration of each movement is around 1 hour/day. Therefore, the disturbance to the bottom sediment is considered temporary, localized and infrequent.</p> <p>3) No illegally discharge of wastewater or domestic wastewater to the sea from FCBP.</p> <p>4) Relevant environmental mitigation measures as shown in EP-352/2009/C were properly implemented.</p> <p>5) No deterioration of marine water quality based on the marine water quality monitoring results on 15 November 2014.</p> <p>Nevertheless, DCVJV was also recommended the mitigation measures as below:</p> <ul style="list-style-type: none"> • The vessel skipper should pay special care about the movement of deep draught vessel to avoid seabed disturbance. (e.g. speed restrictions) • In case of sediment plume was found behind vessel, the vessel skipper 	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				should further reduce vessel speed. • Minimum clearance of 0.6m should be maintained between vessels and the seabed in all tide conditions, to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash. (Reference: EIA-081/2002 - Construction of Lung Kwu Chau Jetty)	
Com-2014-12-001	Shores of Po Chue Tam and Shek Tsai Po, Tai O	7 December 2014	The complaint was received from one of the green groups Green Lantau Association. They complained about some waste materials (including a number of grey plastic mats and buoys) suspected in relation to the HZMB works have recently washed up on the shores of Po Chue Tam and Shek Tsai Po, Tai O	The owner of objects found on the shores could not be identified. DCVJV has taken initiative to remove these materials after receiving the complaint. Nevertheless, DCVJV was also recommended the mitigation measures as below: • Gather up and remove debris to keep the work site orderly. • Maintain site housekeeping. Designate areas for waste materials and provide containers. • Secure loose or light material that is stored on open floors. • Do not permit rubbish to fall freely from any level of the pier sites. • Provide training for the workers	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				regularly regarding the water quality mitigation measures and waste management to increase their awareness of environmental protection.	
Com-2014-12-002	Site Office of HZMB-HKLR – Section between HKSAR Boundary and Scenic Hill	2 December 2014	Highways Department (HyD) received a public complaint from a resident of Le Bleu Duex on 2 December 2014. According to the email from ARUP dated 3 December 2014, the complainant advised that the noise nuisance due to the metal parts were dropped onto the ground by people repetitively and loading or unloading a boat at the pier. The complaint was quoted, “A resident living in Le Bleu Duex addressed a complaint to CE of HyD at about 20:04 hrs last night. He complained about the noise nuisance coming from site office since 19:30 hrs last night. Repetitively metal parts had been dropped on the ground by people who seem to	Based on the information collected, the noise generated is considered due to the metal parts were dropped onto the ground at the seashore area near Le Bleu Duex. The metal pipe was unloaded at non-designated area and no powered mechanical equipment was used for unloading works at WA6 during restricted hour. The Contractor was reminded to take sufficient noise mitigation measures to minimize the environmental impact on the nearby community as recommended in the approved EIA report and the specific mitigation measures for the complaint including but not limited to:- <ul style="list-style-type: none"> • To place wooden planks or rubber mats on ground for loading and unloading heavy or metal objects; and • To deploy professional personnel to 	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
			<i>be loading or unloading a boat at the pier. Noise was still going on right now at 20:04.”</i>	supervise the works.	
Com-2014-12-003	Along the shore from Yat Tung to Tai O	24 December 2014	The complainant was concerned about the increase of marine refuse (water bottles and debris) along the shore from Yat Tung to Tai O suspected in relation to the HZMB works.	<p>The owner of marine refuse found on the shores could not be identified. DCVJV has taken initiative to remove these wastes after receiving the complaint. DCVJV will also take the initiative to clear the marine refuse along the shore from Yat Tung to Tai O, if necessary.</p> <p>Nevertheless, DCVJV was also recommended the mitigation measures as below:</p> <ul style="list-style-type: none"> • Gather up and remove debris to keep the work site orderly. • Maintain site housekeeping. Designate areas for waste materials and provide containers. • Secure loose or light material that is stored on open floors. • Do not permit rubbish to fall freely from any level of the pier sites. • Provide training for the workers regularly regarding the water quality mitigation measures and waste management to increase their awareness of environmental 	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				protection.	
Com-2015-06-001	The sea side at WA6 vertical seawall	6 June 2015	A resident living in Le Bleu Duex complained about noise from a barge which unloading materials at about 21:00 hrs last Saturday i.e. 6 June 2015	<p>Based on the information collected, the noise generated is considered due to the unloading of steel casings to the seashore area opposite to the China State Site Office.</p> <p>The person-in-charge of the barge has been reprimanded by the Contractor for causing noise nuisance to resident nearby. In addition, the Contractor had also reminded their subcontractors to avoid unloading of materials during restricted hours (i.e. 19:00 to 07:00 hours on any day and any time on public holidays including Sundays) without Construction Noise Permit (CNP).</p> <p>The Contractor was reminded to obtain Construction Noise Permit (CNP) for PME use in restricted hours.</p> <p>The Contractor was reminded again to take sufficient noise mitigation measures to minimize the environmental impact on the nearby community as recommended in the approved EIA report and the specific mitigation measures for the complaint including but not limited to:-</p> <ul style="list-style-type: none"> • To place wooden planks or rubber 	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				mats on ground for loading and unloading heavy or metal objects; and <ul style="list-style-type: none"> • To deploy professional personnel to supervise the works. 	

**APPENDIX Q
SUMMARY OF SUCCESSFUL
PROSECUTION**

Appendix Q - Summary of Successful Prosecution

Date of Successful Prosecution	Details of the Successful Prosecution	Status	Follow Up
20 October 2014	The non-compliance of construction noise permit (CNP) numbered GW-RS1217-13 that use of powered mechanical equipment not permitted in the CNP on 15 March 2014 between the hours of 7p.m. and 7a.m. at Pier 72.	The subcontractor was fined.	To ensure the construction works would comply with the CNP during restricted hours, a Permit-to-work system was formulated to control daily operation of the CNPs.