

Your ref -
Our ref 214487/(HY/2011/09)/M45/630/B 21715

ARUP

BY HAND

Environmental Protection Department
Environmental Assessment Division
27th floor, Southorn Centre
130 Hennessy Road
Wan Chai
Hong Kong



Level 5 Festival Walk
80 Tat Chee Avenue
Kowloon Tong
Kowloon
Hong Kong
t +852 3767 5800
f +852 3767 5922

www.arup.com

For the attention of Ms HO Yuen Han, Marlene

14 September 2016

Dear Madam


Contract No. HY/2011/09
Hong Kong-Zhuhai-Macao Bridge
Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill

Submission under Environmental Permit (EP-352/2009/D – Condition 4.4)
Monthly EM&A Report – August 2016

On behalf of HyD/HZMB Project Management Office (the Permit Holder) of the captioned Environmental Permit (EP), I submit herewith three hard copies and one electronic copy (two hard copies and one electronic copy to EPD Wanchai, one hard copy to EPD Quarry Bay) of the Monthly EM&A Report for August 2016 as per Condition 4.4 of EP-352/2009/D.

I confirm that this submission package has been certified by Environmental Team Leader and verified by Independent Environmental Checker.

Yours faithfully

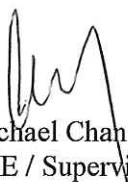
Michael Chan
CRE / Supervising Officer's Representative

cc	HyD/HZMBHKPMO	- Mr K Y Yung	w/e – CD only
	EPD	- Mr Alfred Lo	w/e – One hard copy
	AFCDD	- Mr C P Lam	w/e – One hard copy
	ENPO	- Mr Y H Hui	w/e – One hard copy and one CD
	IEC	- Mr Antony Wong	w/o – By fax only
	Arup	- Mr Eric Chan	w/e – CD only

Response required : No, thank you
Date required : -
Attachments : Yes

KHW/DS/JC/mw

13 September 2016

By Fax (3767 5922) and By Post

ARUP
Level 5, Festival Walk
80 Tat Chee Avenue
Kowloon Tong, Kowloon

Attention: Mr. Colin Meadows / Mr. Michael Chan

Dear Sirs,

**Re: Agreement No. CE 48/2011 (EP)
Environmental Project Office for the
HZMB Hong Kong Link Road, HZMB Hong Kong Boundary Crossing
Facilities, and Tuen Mun-Chek Lap Kok Link – Investigation**

**Contract No. HY/2011/09 HZMB Hong Kong Link Road –
Section between HKSAR Boundary and Scenic Hill
Revised Monthly EM&A Report for August 2016 (EP-352/2009/D)**

Reference is made to the captioned Report (Version 2.0) certified by the Environmental Team Leader (ETL) received on 12 September 2016.

We have no adverse comments on the captioned Report and verify it in accordance with Condition 4.4 of EP-352/2009/D.

Thank you for your kind attention. Please do not hesitate to contact the undersigned or the ENPO Leader, Mr. Y H Hui, should you have any queries.

Yours sincerely,
For and on behalf of
Ramboll Environ Hong Kong Limited



Antony Wong
Independent Environmental Checker
Hong Kong Link Road

c.c.	HyD	Mr. Vico Cheung	(By Fax: 3188 6614)
	HyD	Mr. K Y Yung	(By Fax: 3188 6614)
	ARUP	Mr. Eric Chan	(By Fax: 2268 3970)
	Cinotech	Dr. Priscilla Choy	(By Fax: 3107 1388)
	DCVJV	Mr. Chu Chung Sing	(By Fax: 3121 6688)

Internal: DY, YH, ENPO Site


Q:\Projects\HYDZHMBEEM00\02_Proj_Mgt\02_Corr\HYDZHMBEEM00_0_4565L.16.doc

Dragages -China Harbour-VSL JV

Contract HY/2011/09
Hong Kong-Zhuhai-Macao Bridge
Hong Kong Link Road-Section between
HKSAR Boundary and Scenic Hill

Monthly EM&A Report

August 2016
(Version 1.0)

Certified By 
Dr. Priscilla Choy
Environmental Team Leader
(Date: 12 September 2016)

REMARKS:

The information supplied and contained within this report is, to the best of our knowledge, correct at the time of printing.

CINOTECH accepts no responsibility for changes made to this report by third parties

CINOTECH CONSULTANTS LTD
Room 1710, Technology Park,
18 On Lai Street,
Shatin, NT, Hong Kong
Tel: (852) 2151 2083 Fax: (852) 3107 1388
Email: info@cinotech.com.hk

TABLE OF CONTENTS

	Page
EXECUTIVE SUMMARY	1
Introduction	1
Environmental Monitoring and Audit Progress	1
Breaches of Action and Limit Levels	2
Future Key Issues	3
1 INTRODUCTION	5
Purpose of the report	5
Structure of the report.....	5
2 CONTRACT INFORMATION	7
Background	7
Contract Organisation.....	8
Construction Programme.....	9
Summary of Construction Works Undertaken During Reporting Month	9
Status of Environmental Licences, Notification and Permits.....	12
3 AIR QUALITY MONITORING	14
Monitoring Requirements.....	14
Monitoring Location.....	14
Monitoring Equipment	14
Monitoring Parameters, Frequency and Duration	14
Monitoring Methodology and QA/QC Procedure.....	15
1-hour and 24-hour TSP Air Quality Monitoring	15
<i>Instrumentation</i>	15
<i>HVS Installation</i>	15
<i>Filters Preparation</i>	15
<i>Operating/Analytical Procedures</i>	15
Results and Observations	16
Event and Action Plan.....	17
4 NOISE MONITORING	18
Monitoring Requirements.....	18
Monitoring Location.....	18
Monitoring Equipment	18
Monitoring Parameters, Frequency and Duration	18
Monitoring Methodology and QA/QC Procedures	19
<i>Maintenance and Calibration</i>	19
Results and Observations	19
Event and Action Plan.....	20
5 WATER QUALITY MONITORING.....	21
Monitoring Requirements.....	21
Monitoring Locations	21
Monitoring Equipment	22
Monitoring Parameters, Frequency	24
Monitoring Methodology	24
<i>Instrumentation</i>	24
<i>Operating/Analytical Procedures</i>	24
<i>Laboratory Analytical Methods</i>	25

<i>QA/QC Requirements</i>	25
<i>Maintenance and Calibration</i>	26
Results and Observations	26
Event and Action Plan	26
6 DOLPHIN-RELATED MONITORING	27
Monitoring Requirements.....	27
DOLPHIN MONITORING (LINE-TRANSECT VESSEL SURVEY)	27
Monitoring Requirements.....	27
Monitoring Location.....	27
Monitoring Frequency	28
Monitoring Day	28
Monitoring Results	28
ADDITIONAL LAND-BASED DOLPHIN BEHAVIOUR AND MOVEMENT MONITORING	29
7 ENVIRONMENTAL SITE INSPECTION	30
Site Audits	30
Implementation Status of Environmental Mitigation Measures.....	30
Advice on the Solid and Liquid Waste Management Status	32
8 ENVIRONMENTAL NON-CONFORMANCE (EXCEEDANCES)	33
Summary of Exceedances	33
Summary of Notification of Summons and Successful Prosecution.....	33
9 FUTURE KEY ISSUES	34
Key Issues in the Coming Month	34
Monitoring Schedule for the Next Month	34
Construction Programme for the Next Month.....	34
10 CONCLUSIONS AND RECOMMENDATIONS	35
Conclusions	35
Recommendations	36

LIST OF TABLES

Table I	Summary Table for Monitoring Activities in the Reporting Month
Table II	Summary Table for Events Recorded in the Reporting Month
Table 2.1	Key Contacts of the Contract
Table 2.2	Status of Environmental Licences, Notification and Permits
Table 3.1	Location for Air Quality Monitoring Locations
Table 3.2	Air Quality Monitoring Equipment
Table 3.3	Impact Dust Monitoring Parameters, Frequency and Duration
Table 3.4	Summary Table of 1-hour TSP Monitoring Results during the Reporting Month
Table 3.5	Summary Table of 24-hour TSP Monitoring Results during the Reporting Month
Table 3.6	Observation at Dust Monitoring Stations
Table 4.1	Location for Noise Monitoring Locations
Table 4.2	Noise Monitoring Equipment
Table 4.3	Noise Monitoring Parameters, Frequency and Duration
Table 4.4	Summary Table of Noise Monitoring Results during the Reporting Month
Table 4.5	Observation at Noise Monitoring Stations
Table 5.1	Location for Marine Water Quality Monitoring Locations
Table 5.2	Water Quality Monitoring Equipment
Table 5.3	Water Quality Monitoring Parameters and Frequency
Table 5.4	Methods for Laboratory Analysis for Water Samples
Table 6.1	Co-ordinates of transect lines in WL survey area
Table 6.2	Dolphin encounter rates (sightings per 100 km of survey effort) in August's surveys
Table 6.3	Progress Record of Additional Land-based Dolphin Behaviour and Movement Monitoring in August 2016
Table 7.1	Observations and Recommendations of Site Audit

LIST OF FIGURE

Figure 1a-d	Site Layout Plan
Figure 2	Project Organisation for Environmental Works
Figure 3	Locations of Air Quality, Noise and Wind Monitoring Stations
Figure 4	Locations of Water Quality Monitoring Stations

LIST OF APPENDICES

Appendix A	Construction Programme
Appendix B	Action and Limit Levels
Appendix C	Copies of Calibration Certificates
Appendix D	Environmental Monitoring Schedules
Appendix E	1-hour TSP Monitoring Results
Appendix F	24-hour TSP Monitoring Results
Appendix G	Noise Monitoring Results
Appendix H	Water Quality Monitoring Results
Appendix I	Dolphin Monitoring Report (Line Transect)
Appendix J	Wind Data
Appendix K	Event Action Plans
Appendix L	Summary of Exceedance
Appendix M	Site Audit Summary
Appendix N	Updated Environmental Mitigation Implementation Schedule
Appendix O	Waste Generation in the Reporting Month
Appendix P	Complaint Log
Appendix Q	Summary of Successful Prosecutions

EXECUTIVE SUMMARY

Introduction

1. This is the 43rd monthly Environmental Monitoring and Audit (EM&A) Report prepared by Cinotech Consultants Limited for the project “Contract No. HY/2011/09 – Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill” (hereinafter called the “Contract”). This report documents the findings of EM&A Works conducted in August 2016.

Environmental Monitoring and Audit Progress

2. A summary of the monitoring activities in this reporting month is listed in **Table I** below:

Table I Summary Table for Monitoring Activities in the Reporting Month

Parameter(s)	Date(s)
1-hr TSP Monitoring	1 st , 5 th , 11 th , 17 th , 23 rd and 29 th August 2016
24-hr TSP Monitoring	1 st , 5 th , 11 th , 17 th , 23 rd and 29 th August 2016
Noise Monitoring	3 rd , 12 th , 18 th , 24 th and 30 th August 2016
Water Quality Monitoring	1 st , 3 rd , 5 th , 8 th , 10 th , 12 th , 15 th , 17 th , 19 th , 22 nd , 24 th , 26 th , 29 th and 31 st August 2016
Dolphin Monitoring (Line-transect Vessel Surveys)	9 th and 16 th August 2016
Additional Land-based Dolphin Behaviour and Movement Monitoring	11 th and 25 th August 2016
Environmental Site Inspection	3 rd , 9 th , 16 th , 23 rd and 30 th August 2016
Archaeological Site Inspection	⁽¹⁾ N/A

Remark: ⁽¹⁾ No archaeological site inspection was conducted in the reporting month.

Breaches of Action and Limit Levels

3. Summary of the environmental exceedances of the reporting month is tabulated in **Table II**.

Table II Summary Table for Events Recorded in the Reporting Month

Environmental Monitoring	Parameter	No. of Exceedance		Total No. of Exceedance	No. of Exceedance related to the Construction Activities of this Contract		Total No. of Exceedance related to the Construction Activities of this Contract
		Action Level	Limit Level		Action Level	Limit Level	
Air Quality	1-hr TSP	0	0	0	0	0	0
	24-hr TSP	0	0	0	0	0	0
Noise	Leq(30min)	0	0	0	0	0	0
Water Quality	Dissolved Oxygen (DO) (Surface & Middle)	0	0	0	0	0	0
	Dissolved Oxygen (DO) (Bottom)	0	0	0	0	0	0
	Turbidity	0	0	0	0	0	0
	Suspended Solids (SS)	0	0	0	0	0	0

1-hour TSP Monitoring

4. All 1-hour TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

24-hour TSP Monitoring

5. All 24-hour TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Construction Noise

6. All construction noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Water Quality

7. All water quality monitoring was conducted as scheduled in the reporting month except water quality monitoring during mid-flood tide on 1st August 2016 which was cancelled due to adverse weather condition (Strong Wind Signal No.3). No Action/Limit Level exceedance was recorded.

Complaint Log

8. No environmental complaint was received in the reporting month.

Notification of Summons and Successful Prosecutions

9. No notification of summons and successful prosecution was received in the reporting month.

Reporting Changes

10. This report has been developed in compliance with the reporting requirements for the subsequent monthly EM&A Report as required by the EM&A Manual for Hong Kong Link Road (EM&A Manual).

Future Key Issues

11. Major site activities for the coming reporting month will include:

WA4

- Cross Beam Precast Shell construction

Ancillary and Associated Facilities

- E&M installation
- E&M ducting installation
- Construction of Lad Centre (CL1)
- Installation of carrier drains
- Installation of precast parapet skins
- Erection of Radar Platform
- Construction of median and side barriers
- Construction of longitudinal stitching
- Erection of gantry posts for Sign gantry
- Reinstatement of slope area and drainage works

Marine Viaduct (P0 to P80)

Deck Erection

- Segment erection
- Erection of SOP segments
- Dismantling of LG1

- Erection of cantilever
- Construction of cross beam precast shell
- In-situ RC works
- Erection of precast SOP unit to Turnaround

External Prestressing Tendon Installation

Internal Prestressing Grouting

1 INTRODUCTION

- 1.1 Cinotech Consultants Limited (Cinotech) was appointed by Dragages -China Harbour-VSL JV (hereinafter called “the Contractor”) as the Environmental Team (ET) to undertake the Environmental Monitoring and Audit (EM&A) programme during construction phase of the Contract No. HY/2011/09 – Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill” (hereinafter called the “Contract”) in accordance with EP Conditions 2.1.

Purpose of the report

- 1.2 This is the 43rd EM&A report which summarises the impact monitoring results and audit findings for the EM&A programme in August 2016.

Structure of the report

- 1.3 The structure of the report is as follows:

Section 1: **Introduction** - purpose and structure of the report.

Section 2: **Contract Information** - summarises background and scope of the Contract, site description, project organization and contact details, construction programme, the construction works undertaken and the status of Environmental Permits/Licenses during the reporting month.

Section 3: **Air Quality Monitoring** - summarises the monitoring parameters, monitoring programmes, monitoring methodologies, monitoring frequency, monitoring locations, Action and Limit Levels, monitoring results and Event / Action Plans.

Section 4: **Noise Monitoring** - summarises the monitoring parameters, monitoring programmes, monitoring methodologies, monitoring frequency, monitoring locations, Action and Limit Levels, monitoring results and Event / Action Plans.

Section 5: **Water Quality Monitoring** - summarises the monitoring parameters, monitoring programmes, monitoring methodologies, monitoring frequency, monitoring locations, Action and Limit Levels, monitoring results and Event / Action Plans.

Section 6: **Dolphin-Related Monitoring** - summarises the monitoring parameters, monitoring programmes, monitoring methodologies, monitoring frequency, monitoring locations and monitoring results.

Section 7: **Environmental Site Inspection** - summarises the audit findings of the weekly site inspections undertaken within the reporting month.

Section 8: **Environmental Non-conformance** - summarises any monitoring exceedance, environmental complaints, environmental summons and successful prosecutions within the reporting month.

Section 9: **Future Key Issues** - summarises the impact forecast and monitoring schedule for the next three months.

Section 10: **Conclusions and Recommendation**

2 CONTRACT INFORMATION

Background

- 2.1 The proposed Hong Kong - Zhuhai - Macao Bridge Hong Kong Link Road (HKLR) is 12km long connecting the Hong Kong-Zhuhai-Macao Bridge (HZMB) at the HKSAR Boundary with the Hong Kong Boundary Crossing Facilities (HKBCF) situated at the north eastern waters of the Hong Kong International Airport, opening a new and direct connection route between Hong Kong, Macao and the Western Pearl River Delta.
- 2.2 The HKLR comprises a 9.4km long viaduct section from the HKSAR boundary to Scenic Hill on the Airport Island; a 1km tunnel section to the reclamation formed along the east coast of the Airport Island and a 1.6km long at-grade road section on the reclamation connecting to the HKBCF. The tunnel section of HKLR will pass under Scenic Hill, Airport Road and Airport Railway to minimize the environmental and visual impacts to Tung Chung residents.
- 2.3 An application (No ESB-110/2003) for an Environmental Impact Assessment (EIA) Study Brief under Section 5(1) of the Environmental Impact Assessment Ordinance (EIAO) was submitted by Highways Department (the Project Proponent) on 8 October 2003 with a Project Profile (No. No. PP-201/2003) for the Hong Kong - Zhuhai - Macao Bridge Hong Kong Section and North Lantau Highway Connection. The Hong Kong - Zhuhai - Macao Bridge Hong Kong Section and North Lantau Highway Connection has subsequently been renamed as HKLR. EPD issued an EIA Study Brief (No: ESB-110/2003) in November 2003 to the Project Proponent to carry out an EIA study.
- 2.4 An EIA Study (Reg. No. AEIAR-144/2009) has been undertaken to provide information on nature and extent of environmental impacts arising from the construction and operation of HKLR. The Environmental Permit was issued on 4 November 2009 (Permit No. EP-352/2009). Pursuant to Section 13 of the EIAO, the Director of Environmental Protection amends the Environmental Permit (No. EP-352/2009) based on the Application No. VEP-339/2011 and the environmental Permit (Permit No. EP-352/2009/A) was issued on 9 November 2011 for HKLR to the Highways Department as the Permit Holder. Subsequently, the Director of Environmental Protection amends the Environmental Permits (No. EP-352/2009/A, EP-352/2009/B, EP-352/2009/C) based on the Application No. VEP-409/2013, VEP-411/2013 and VEP-459/2014 respectively. The environmental Permit (Permit No. EP-352/2009/D) was then issued on 22 December 2014.
- 2.5 **Figure 1a-d** shows the layout of the Contract and the scope of the Contract works comprises the following major items:
 - a dual 3-lane carriageway in the form of viaduct from the HKSAR boundary (connecting with the HZMB Main Bridge) to the Scenic Hill (connecting with the tunnel under separate Contract No. HY/2011/03), of approximately 9.4km in length with a hard shoulder for each bound of carriageway and a utilities trough on the outer edge of each bound of viaducts;
 - a grade-separated turnaround facility located near San Shek Wan, composed of sliproads in the form of viaduct with single-lane carriageway bifurcated from the HKLR mainline with an elevated junction above the mainline;

- provision of ancillary facilities including, but not limited to, meteorological enhancement measures including the provisioning of anemometers and modification of the wind profiler station at hillside of Sha Lo Wan, provisioning of a compensatory marine radar, and provisioning of security systems; and
- associated civil, structural, geotechnical, marine, environmental protection, landscaping, drainage and highways electrical and mechanical (E&M) works, street lightings, traffic aids and sign gantries, marine navigational aids, ship impact protection system, water mains and fire hydrants, lightning protection system, structural health monitoring and maintenance management system (SHM&MMS), supervisory control and data acquisition (SCADA) system, as well as operation and maintenance provisions of viaducts, provisioning of facilities for installation of traffic control and surveillance system (TCSS), provisioning of facilities for installation of telecommunication cables/equipments and reprovisioning works of affected existing facilities/utilities.

Contract Organisation

2.6 Different parties with different levels of involvement in the Contract organization include:

- Supervising Officer’s Representative (SOR) – Ove Arup & Partners Hong Kong Limited (ARUP)
- Contractor –Dragages -China Harbour-VSL JV (DCVJV)
- Environmental Team (ET) – Cinotech Consultants Ltd. (Cinotech)

2.7 The proposed project organization and lines of communication with respect to the on-site environmental management structure are shown in **Figure 2**. The key personnel contact names and numbers are summarized in **Table 2.1**.

Table 2.1 Key Contacts of the Contract

Party	Position	Position	Phone No.	Fax No.
SOR (ARUP)	CRE	Mr. Michael Chan	3767 5803	3767 5922
		Mr. Colin Meadows	3767 5801	
ENPO/IEC (Ramboll Environ)	Environmental Project Office Leader	Mr. Y. H Hui	3465 2888	3465 2899
	Independent Environmental Checker	Mr. Antony Wong	3465 2888	3465 2899
Contractor (DCVJV)	Deputy Project Director	Mr. W.K Poon	3121 6638	3121 6688
	Environmental Officer	Mr. CHU Chung Sing	3121 6672	
	24-hour Hotline	--	6898 6161	--
ET (Cinotech)	Environmental Team Leader	Dr. Priscilla Choy	2151 2089	3107 1388

2.8 Ramboll Environ Hong Kong Limited (Ramboll Environ) is employed by the Highways Department as the Independent Environmental Checker (IEC) and Environmental Project Office (ENPO) for the Project.

Construction Programme

2.9 A copy of Contractor's construction programme is provided in **Appendix A**.

Summary of Construction Works Undertaken During Reporting Month

2.10 The major site activities undertaken in the reporting month included:

Ancillary and Associated Facilities

- (a) P115 & P114 interface area - Reinstatement of slope area temporarily on-hold pending for drainage and reinstatement detailing.
- (b) Installation of precast parapet skins between P109 to P96 is in progress. The Progress is as follows.

Item	Number in this month	Cumulative No. of Precast Parapet Completed (up to end of month)
Parapet Casting	349	1177
Parapet Installation	211	620

- (c) Construction of side barriers from P112 to P113 is in progress, currently total 75m side barriers were cast.
- (d) Construction of median barriers from P109 to P105 is in progress, currently total 96m of median barriers were cast.
- (e) Construction of longitudinal stitching between P114 to P102 (concrete planking) is in progress.
- (f) E&M installation at ML6 continues.
- (g) E&M ducting installation at ML15 to ML17.
- (h) Construction of Load Centre 1 (LC1) commence.
- (i) Installation of carrier drains from P113 to P109 is in progress.
- (j) LHS gantry posts for Sign gantry GE15 & GW13 were erected.
- (k) Erection of Radar Platform at P20 is in progress.

Deck Erection

(a) Segment erection in August 2016:

Type	Location of Segments erected in this reporting period	Number of Segments erected in this reporting period	Cumulative No. of Segments erected (up to 28th of each month)
Launching Gantry 1 (LG1)*	P84	6	1020 (Completed)
Launching Gantry 2 (LG2)	P16 and P15	74	1196
Lifting Frames 1 (LF1) and Hanger Beam (HB)	P71, P72, P73 and P76	122	570

Type	Location of Segments erected in this reporting period	Number of Segments erected in this reporting period	Cumulative No. of Segments erected (up to 28th of each month)
Lifting Frames 3 (LF3) and Hanger Beam (HB)	P52R&L, P59R&L	55	653
Typical Span SOP	P12, P10 and P09	12	208
Long Span SOP	NA	0	72
Movement Joint (MJ) SOP Airport Channel	P70	4	8
Short Span (SS) SOP type B	P53 and P55	6	8

External Prestressing Tendon Installation

Viaduct	Activities	Quantities	Unit	Done %
ML19C	Threading	47.55	T	100%
	Stressing	12	U	100%
	Grouting	9.42	M3	100%
ML19R	Threading	48.65	T	100%
	Stressing	12	U	100%
	Grouting	9.64	M3	100%
ML19L	Threading	46.91	T	100%
	Stressing	12	U	100%
	Grouting	9.29	M3	100%
ML18R	Threading	77.90	T	100%
	Stressing	18	U	100%
	Grouting	15.38	M3	100%
ML18L	Threading	76.40	T	100%
	Stressing	18	U	100%
	Grouting	15.08	M3	100%
ML17R	Threading	63.09	T	100%
	Stressing	16	U	100%
	Grouting	12.44	M3	100%
ML17L	Threading	62.86	T	100%
	Stressing	16	U	100%
	Grouting	12.39	M3	100%
ML16R	Threading	56.69	T	100%
	Stressing	15	U	100%
	Grouting	9.91	M3	78%
ML16L	Threading	87.34	T	100%
	Stressing	18	U	100%
	Grouting	17.2	M3	70%
ML07R	Threading	129.58	T	26%
	Stressing	32	U	17%
	Grouting	25.59	M3	0%
ML07L	Threading	140.43	T	24%
	Stressing	32	U	16%
	Grouting	27.76	M3	0%
ML06R	Threading	113.04	T	100%
	Stressing	24	U	100%
	Grouting	22.35	M3	100%
ML06L	Threading	113.04	T	100%
	Stressing	24	U	100%
	Grouting	22.35	M3	100%
ML05R	Threading	113.68	T	100%
	Stressing	24	U	100%

Viaduct	Activities	Quantities	Unit	Done %
	Grouting	22.48	M3	70%
ML05L	Threading	112.39	T	100%
	Stressing	24	U	100%
	Grouting	22.22	M3	70%
ML04R	Threading	113.04	T	30%
	Stressing	24	U	30%
	Grouting	22.35	M3	0%
ML04L	Threading	113.04	T	30%
	Stressing	24	U	30%
	Grouting	22.35	M3	0%

Internal Prestressing Grouting Progress

Viaduct	Activities	Quantities	Unit	Done %
ML19C	Air test & Grouting	14.09	M3	100%
ML19R	Air test & Grouting	14.90	M3	99%
ML19L	Air test & Grouting	13.90	M3	100%
ML18R	Air test & Grouting	25.24	M3	100%
ML18L	Air test & Grouting	24.76	M3	96%
ML17R	Air test & Grouting	23.47	M3	100%
ML17L	Air test & Grouting	23.46	M3	100%
ML16R	Air test & Grouting	36.54	M3	99%
ML16L	Air test & Grouting	35.46	M3	99%
ML15R	Air test & Grouting	39.34	M3	45%
ML15L	Air test & Grouting	39.69	M3	44%
ML09R	Air test & Grouting	63.27	M3	24%
ML09L	Air test & Grouting	57.86	M3	32%
ML08R	Air test & Grouting	36.58	M3	31%
ML08L	Air test & Grouting	36.56	M3	31%
ML07R	Air test & Grouting	59.61	M3	46%
ML07L	Air test & Grouting	60.05	M3	55%
ML06R	Air test & Grouting	58.31	M3	87%
ML06L	Air test & Grouting	58.31	M3	82%
ML05R	Air test & Grouting	58.62	M3	51%
ML05L	Air test & Grouting	58.01	M3	55%
ML04R	Air test & Grouting	57.64	M3	24%
ML04L	Air test & Grouting	57.69	M3	41%

Precast Segment

(a) Segment Casting:

- Production affected by inclement weather: 7.75 days.
- The last new mould no. 41 (CH5) commenced production in early Aug 2016. All new moulds are under full operation.
- Mould no. 20 has been modified from Type C production to Type A after casting P74.

Item	Number in this reporting period	Cumulative No. of Precast Segment Completed (up to 28th of each month)
Segment Cast	236	4922

Remarks: Cumulative no. excludes the 7 nos. recast following damages to segments due to toppled incident at the casting yard.

(b) Off-site Storage:

Area	No. in Off-site Storage
A1	0
A2	0
A3	76
A4	0

Delivery for Precast Concrete Elements (by barge)

(a) Precast Deck Segments:

- Number of barges engaged in this period: 19.
- Number of deck segment deliveries in this period: 46 trips.
- Cumulative number of deck segment deliveries: 769 trips.

Segment Types	Segment Delivered in this reporting period	Cumulative No. of Precast Segment Delivered (up to 28th of each month)
A	101	1864
B	15	28
C	102	702
D	9	192
E	0	1014

Status of Environmental Licences, Notification and Permits

2.11 A summary of the relevant permits, licences, and/or notifications on environmental protection for this Contract is presented in **Table 2.2**.

Table 2.2 Status of Environmental Licences, Notification and Permits

Permit / License No.	Valid Period		Status
	From	To	
Environmental Permit (EP)			
EP-352/2009/D	22/12/2014	N/A	Valid
Construction Noise Permit (CNP)			
Portion A: GW-RS0108-16	23/02/2016 (19:00)	22/08/2016 (23:00)	Expired
P101 – P114 & Southeast Quay: GW-RS0536-16	01/06/2016 (19:00)	30/11/2016 (05:30)	Valid
P0 – P68 GW-RS0560-16	10/06/2016 (00:00)	09/12/2016 (24:00)	Cancelled on 13 Aug 2016

Permit / License No.	Valid Period		Status
	From	To	
<u>P68 – P69 & P79 – P83:</u> GW-RS0604-16	17/06/2016 (01:30)	16/09/2016 (07:00)	Valid
<u>P84 – P115:</u> GW-RS0627-16	17/06/2016 (19:00)	16/12/2016 (24:00)	Valid
<u>P69 – P83:</u> GW-RS0649-16	20/06/2016 (19:00)	19/12/2016 (24:00)	Cancelled on 12 Aug 2016
<u>P69 – P83:</u> GW-RS0859-16	12/08/2016 (19:00)	11/02/2017 (24:00)	Valid
<u>P0 – P68:</u> GW-RS0866-16	13/08/2016 (19:00)	12/02/2017 (24:00)	Valid
<u>Portion A:</u> GW-RS0870-16	23/08/2016 (19:00)	21/02/2017 (23:00)	Valid
<u>P101 – P114:</u> GW-RS0899-16	29/08/2016 (19:00)	31/08/2016 (05:30)	Valid
Notification pursuant to Air Pollution Control (Construction Dust) Regulation			
345773	04/06/2012	N/A	Receipt acknowledged by EPD
Billing Account for Construction Waste Disposal			
A/C# 7015341 (Construction Site)	11/06/2012	N/A	Valid
Registration of Chemical Waste Producer			
WPN 5213-951-D2499-01	18/07/2012	N/A	Valid
Effluent Discharge License under Water Pollution Control Ordinance			
<u>WA6A(DCVJV site office):</u> WT00014053-2012	12/09/2012	30/09/2017	Valid
<u>WA6B (SOR site office):</u> WT00014447-2012	30/10/2012	31/10/2017	Valid
<u>WA3:</u> WT00015118-2013	30/01/2013	31/01/2018	Valid
<u>Portion C:</u> WT00023624-2016	17/02/2016	28/02/2018	Valid
<u>Portion A:</u> WT00016076-2013	21/05/2013	31/05/2018	Valid
<u>WA4B:</u> WT00014750-2012	12/08/2013	31/08/2018	Valid
<u>WA7:</u> WT00015722-2013	16/01/2013	31/01/2019	Valid
<u>P0 – P80:</u> WT00018203-2014	30/01/2013	31/01/2019	Valid
<u>P114:</u> WT00018631-2014	31/03/2014	31/03/2019	Valid
<u>P81-P83:</u> WT00023608-2016	01/04/2016	31/07/2020	Valid

3 AIR QUALITY MONITORING

Monitoring Requirements

- 3.1 In accordance with the EM&A Manual, impact 1-hour TSP and 24-hour TSP monitoring were conducted to monitor the air quality for the Contract. **Appendix B** shows the established Action/Limit Levels for the air quality monitoring works.
- 3.2 Impact 1-hour TSP monitoring was conducted for at least three times every 6 days, while impact 24-hour TSP monitoring was conducted for at least once every 6 days at 2 air quality monitoring stations.

Monitoring Location

- 3.3 Impact air quality monitoring was conducted at the 2 monitoring stations under the Contract, as shown in **Figure 3**. **Table 3.1** describes the locations of the air quality monitoring stations.

Table 3.1 Location for Air Quality Monitoring Locations

Monitoring Stations	Location
AMS1	Sha Lo Wan
AMS4	San Tau

Monitoring Equipment

- 3.4 **Table 3.2** summarizes the equipment used in the impact air monitoring programme. Copies of calibration certificates are attached in **Appendix C**.

Table 3.2 Air Quality Monitoring Equipment

Equipment	Model and Make	Quantity
HVS Sampler	TISCH Model: TE-5170	2
Calibrator	TISCH Model: TE-5025A	1
Wind Anemometer	DAVIS Model: Vantage PRO2 6152CUK	1

Monitoring Parameters, Frequency and Duration

- 3.5 **Table 3.3** summarizes the monitoring parameters and frequencies of impact dust monitoring during the course of the Contract activities. The air quality monitoring schedule for the reporting month is shown in **Appendix D**.

Table 3.3 Impact Dust Monitoring Parameters, Frequency and Duration

Parameters	Frequency
1-hr TSP	Three times / 6 days
24-hr TSP	Once / 6 days

Monitoring Methodology and QA/QC Procedure

1-hour and 24-hour TSP Air Quality Monitoring

Instrumentation

- 3.6 High Volume Samplers (HVS) completed with appropriate sampling inlets were employed for air quality monitoring. Each sampler was composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complies with that required by USEPA Standard Title 40, Code of Federation Regulations Chapter 1 (Part 50).

HVS Installation

- 3.7 The following guidelines were adopted during the installation of HVS:
- Sufficient support was provided to secure the sampler against gusty wind.
 - No two samplers were placed less than 2 meters apart.
 - The distance between the sampler and an obstacle, such as buildings, was at least twice the height that the obstacle protrudes above the sampler.
 - A minimum of 2 meters of separation from walls, parapets and penthouses was required for rooftop samples.
 - A minimum of 2 meters separation from any supporting structure, measured horizontally was required.
 - No furnaces or incineration flues were nearby.
 - Airflow around the sampler was unrestricted.
 - The samplers were more than 20 meters from the drip line.
 - Any wire fence and gate, to protect the sampler, should not cause any obstruction during monitoring.
 - Permission must be obtained to set up the samples and to obtain access to the monitoring stations; and
 - A secured supply of electricity is needed to operate the samplers.

Filters Preparation

- 3.8 Filter paper of size 8" X 10" was used. A HOKLAS accredited laboratory, ETS – Testconsult Limited (ETS), was responsible for the preparation of 24-hr conditioned and pre-weighed filter papers for Cinotech's monitoring team.
- 3.9 All filters, which were prepared by ETS, were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25 °C and not variable by more than ± 3 °C; the relative humidity (RH) was < 50% and not variable by more than ± 5 %. A convenient working RH was 40%.
- 3.10 ETS has comprehensive quality assurance and quality control programmes.

Operating/Analytical Procedures

- 3.11 Operating/analytical procedures for the air quality monitoring were highlighted as follows:

- Prior to the commencement of the dust sampling, the flow rate of the HVS was properly set (between 1.1 m³/min. and 1.4 m³/min.) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard Title 40, CFR Part 50.
- The power supply was checked to ensure the sampler worked properly.
- On sampling, the sampler was operated for 5 minutes to establish thermal equilibrium before placing any filter media at the designated air quality monitoring station.
- The filter holding frame was then removed by loosening the four nuts and carefully a weighted and conditioned filter was centered with the stamped number upwards, on a supporting screen.
- The filter was aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter. Then the filter holding frame was tightened to the filter holder with swing bolts. The applied pressure should be sufficient to avoid air leakage at the edges.
- The shelter lid was closed and secured with the aluminum strip.
- The timer was then programmed. Information was recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number).
- After sampling, the filter was removed and sent to the ETS for weighing. The elapsed time was also recorded.
- Before weighing, all filters were equilibrated in a conditioning environment for 24 hours. The conditioning environment temperature should be between 25°C and 30°C and not vary by more than ±3°C; the relative humidity (RH) should be < 50% and not vary by more than ±5%. A convenient working RH is 40%. Weighing results were returned to Cinotech for further analysis of TSP concentrations collected by each filter.

Maintenance/Calibration

3.12 The following maintenance/calibration was required for the HVS:

- The high volume motors and their accessories were properly maintained. Appropriate maintenance such as routine motor brushes replacement and electrical wiring checking were made to ensure that the equipment and necessary power supply are in good working condition.
- All HVS were calibrated (five point calibration) using Calibration Kit prior to the commencement of the baseline monitoring and thereafter at bi-monthly intervals.

Results and Observations

3.13 The monitoring results for 1-hour TSP and 24-hour TSP are summarized in **Table 3.4 and 3.5** respectively. Detailed monitoring results and graphical presentations of 1-hour and 24-hour TSP monitoring results are shown in **Appendices E and F** respectively.

Table 3.4 Summary Table of 1-hour TSP Monitoring Results during the Reporting Month

Monitoring Station	Concentration (µg/m ³)		Action Level, µg/m ³	Limit Level, µg/m ³
	Average	Range		
AMS1	28	3 – 86	381	500
AMS4	37	5 – 125	352	

Table 3.5 Summary Table of 24-hour TSP Monitoring Results during the Reporting Month

Monitoring Station	Concentration (µg/m ³)		Action Level, µg/m ³	Limit Level, µg/m ³
	Average	Range		
AMS1	25	9 – 42	170	260
AMS4	36	9 – 50	171	

- 3.14 All 1-hour TSP monitoring was conducted as scheduled in the reporting. No Action/Limit Level exceedances were recorded.
- 3.15 All 24-hour TSP monitoring was conducted as scheduled in the reporting. No Action/Limit Level exceedances were recorded.
- 3.16 According to our field observations, the major dust source identified at the designated air quality monitoring stations in the reporting month are as follows:

Table 3.6 Observation at Dust Monitoring Stations

Monitoring Station	Major Dust Source
AMS1	Exhaust from marine traffic
AMS4	N/A

- 3.17 The wind speed and wind direction were recorded by the installed Wind Anemometer set at AMS4. The location is shown in **Figure 3**.
- 3.18 The wind data for the reporting month is summarized in **Appendix J**.

Event and Action Plan

- 3.19 Should non-compliance of the criteria occur, action in accordance with the Action Plan in **Appendix K** shall be carried out.

4 NOISE MONITORING

Monitoring Requirements

- 4.1 In accordance with EM&A Manual, two noise monitoring stations, namely NMS1 and NMS4 were selected for impact monitoring for the Contract. Impact noise monitoring was conducted for at least once per week during the construction phase of the Contract. **Appendix B** shows the established Action and Limit Levels for the noise monitoring works.

Monitoring Location

- 4.2 Impact noise monitoring was conducted at the 2 monitoring stations under the Contract, as shown in **Figure 3**. **Table 4.1** describes the locations of the noise monitoring stations.

Table 4.1 Location for Noise Monitoring Stations

Monitoring Stations	Location
NMS1	Sha Lo Wan
NMS4	San Tau

Monitoring Equipment

- 4.3 **Table 4.2** summarizes the noise monitoring equipment. Copies of calibration certificates are provided in **Appendix C**.

Table 4.2 Noise Monitoring Equipment

Equipment	Model and Make	Qty.
Integrating Sound Level Meter	BSWA 801	1
Calibrator	SV 30A	1

Monitoring Parameters, Frequency and Duration

- 4.4 **Table 4.3** summarizes the monitoring parameters, frequency and total duration of monitoring. The noise monitoring schedule is shown in **Appendix D**.

Table 4.3 Noise Monitoring Parameters, Frequency and Duration

Monitoring Stations	Parameter	Period	Frequency
NMS1 NMS4	L ₁₀ (30 min.) dB(A) L ₉₀ (30 min.) dB(A) L _{eq} (30 min.) dB(A) (as six consecutive L _{eq, 5min} readings)	0700-1900 hrs on normal weekdays	Once per week

Monitoring Methodology and QA/QC Procedures

- The microphone head of the sound level meter was positioned 1m exterior of the noise sensitive facade and lowered sufficiently so that the building's external wall acts as a reflecting surface.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
 - frequency weighting : A
 - time weighting : Fast
 - time measurement : $L_{eq}(30 \text{ min.}) \text{ dB(A)}$ (as six consecutive $L_{eq, 5\text{min}}$ readings) during non-restricted hours (i.e. 0700-1900 hrs on normal weekdays)
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94.0 dB at 1000 Hz. If the difference in the calibration level before and after measurement was more than 1.0 dB, the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
- During the monitoring period, the L_{eq} , L_{90} and L_{10} were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- Noise measurement was paused temporarily during periods of high intrusive noise (e.g. dog barking, helicopter noise) if possible and observation was recorded when intrusive noise was not avoided.
- Noise monitoring was cancelled in the presence of fog, rain, and wind with a steady speed exceeding 5 m/s, or wind with gusts exceeding 10 m/s. The wind speed shall be checked with a portable wind speed meter capable of measuring the wind speed in m/s.

Maintenance and Calibration

- 4.5 The microphone head of the sound level meter and calibrator were cleaned with a soft cloth at quarterly intervals.
- 4.6 The sound level meter and calibrator were checked and calibrated at yearly intervals.
- 4.7 Immediately prior to and following each noise measurement the accuracy of the sound level meter shall be checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Measurements may be accepted as valid only if the calibration levels from before and after the noise measurement agree to within 1.0 dB.

Results and Observations

- 4.8 The noise monitoring results are summarized in **Table 4.4**. Detailed monitoring results and graphical presentations of noise monitoring are shown in **Appendices G**.

Table 4.4 Summary Table of Noise Monitoring Results during the Reporting Month

Monitoring Station	Noise Level, $L_{eq(30min)}$ dB(A)		Limit Level
	Average	Range	
NMS1	66	57 – 71	75 dB(A)
NMS4	58	54 – 59	

Remark: +3dB(A) Façade correction included

- 4.9 All noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.
- 4.10 According to our field observations, the major noise source identified at the designated noise monitoring stations in the reporting month are as follows:

Table 4.5 Observation at Noise Monitoring Stations

Monitoring Station	Major Noise Source
NMS1	Air traffic & marine traffic noise
NMS4	Air traffic & marine traffic noise

Event and Action Plan

- 4.11 Should non-compliance of the criteria occur, action in accordance with the Action Plan in **Appendix K** shall be carried out.

5 WATER QUALITY MONITORING

Monitoring Requirements

- 5.1 According to EM&A Manual, impact water quality monitoring shall be carried out three days per week during the construction period. The interval between two sets of monitoring will not be less than 36 hours.
- 5.2 Replicate in-situ measurements and samples collected from each independent sampling event shall be collected to ensure a robust statistically interpretable database.
- 5.3 Impact water quality monitoring was conducted two times per monitoring day during mid ebb (within ± 1.75 hours of the predicted time) and mid flood tides (within ± 1.75 hours of the predicted time) at three depths (i.e. 1m below surface, mid-depth and 1m above seabed, except where the water depth less than 6m, mid-depth station may be omitted. Should the water depth be less than 3m, only the mid-depth station was monitored) Dissolved oxygen, Suspended solids (SS), turbidity, pH, salinity and temperature were monitored in accordance with the requirements set out in the EM&A Manual.
- 5.4 The proposal for changing Action and Limit Levels for water quality monitoring was submitted to EPD on 15 March 2013. No objection was received from EPD according to the letter (ref. (10) in Ax(3) to EP2/G/A/129pt.4) dated 25 March 2013. Therefore, the updated Action and Limit Levels for water quality monitoring was used for comparison starting from 25 March 2013.
- 5.5 **Appendix B** shows the established Action/Limit Levels for the water quality monitoring works.

Monitoring Locations

- 5.6 Impact water quality monitoring was conducted at 14 monitoring stations under the Contract which are summarized in **Table 5.1**. The monitoring station is also shown in **Figure 4**.

Table 5.1 Location for Marine Water Quality Monitoring Locations

Monitoring Stations	Coordinates	
	Easting	Northing
IS1	803474	815060
IS2	804851	815715
IS3	806502	815743
IS4	807008	816986
CS1	801784	812711
CS2	805849	818780
SR1	803126	812379
SR2	807856	816953
SR3	810525	816456
SR6	805837	821818
ST1	802677	816006
ST2	804055	818840

Monitoring Stations	Coordinates	
	Easting	Northing
ST3	800667	810126
SRA	809872	817152

Monitoring Equipment

Instrumentation

- 5.7 A multi-parameter meters (Model YSI 6820-C-M) were used to measure DO, turbidity, salinity, pH and temperature.

Dissolved Oxygen (DO) and Temperature Measuring Equipment

- 5.8 The instrument for measuring dissolved oxygen and temperature was portable and weatherproof complete with cable, sensor, comprehensive operation manuals and use DC power source. It was capable of measuring:

- a dissolved oxygen level in the range of 0-20 mg/L and 0-200% saturation; and
- a temperature of 0-45 degree Celsius.

- 5.9 It has a membrane electrode with automatic temperature compensation complete with a cable.
- 5.10 Sufficient stocks of spare electrodes and cables were available for replacement where necessary.
- 5.11 Salinity compensation was built-in in the DO equipment.

Turbidity

- 5.12 Turbidity was measured in situ by the nephelometric method. The instrument was portable and weatherproof using a DC power source complete with cable, sensor and comprehensive operation manuals. The equipment was capable of measuring turbidity between 0-1000 NTU. The probe cable was not less than 25m in length. The meter was calibrated in order to establish the relationship between NTU units and the levels of suspended solids. The turbidity measurement was carried out on split water sample collected from the same depths of suspended solids samples.

Sampler

- 5.13 A water sampler, consisting of a transparent PVC or glass cylinder of a capacity of not less than two litres which can be effectively sealed with cups at both ends was used. The water sampler has a positive latching system to keep it open and prevent premature closure until released by a messenger when the sampler was at the selected water depth.

Water Depth Detector

- 5.14 A portable, battery-operated echo sounder was used for the determination of water depth

at each designated monitoring station.

pH

- 5.15 The instrument was consisting of a potentiometer, a glass electrode, a reference electrode and a temperature-compensating device. It was readable to 0.1pH in a range of 0 to 14. Standard buffer solutions of at least pH 7 and pH 10 were used for calibration of the instrument before and after use.

Salinity

- 5.16 A portable salinometer capable of recording salinity within the range of 0-40 ppt was used for salinity measurements.

Monitoring Position Equipment

- 5.17 A hand held Differential Global Positioning System (DGPS) was used during water quality monitoring to ensure the monitoring vessel is at the correct location before taking measurements.

Sample Container and Storage

- 5.18 Following collection, water samples for laboratory analysis were stored in high density polythene bottles (250ml/1L) with no preservatives added, packed in ice (cooled to 4°C without being frozen) and kept in dark during both on-site temporary storage and shipment to the testing laboratory. The samples were delivered to the laboratory as soon as possible and the laboratory determination works were started within 24 hours after collection of the water samples. Sufficient volume of samples was collected to achieve the detection limit.

Calibration of In Situ Instruments

- 5.19 All in situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or other international accreditation scheme before use, and subsequently re-calibrated at 3 monthly intervals throughout all stages of the water quality monitoring programme. Responses of sensors and electrodes were checked with certified standard solutions before each use. Wet bulb calibration for a DO meter was carried out before measurement at each monitoring event.
- 5.20 For the on site calibration of field equipment (Multi-parameter Water Quality System), the BS 1427:2009, "Guide to on-site test methods for the analysis of waters" was observed.
- 5.21 Sufficient stocks of spare parts were maintained for replacements when necessary. Backup monitoring equipment was also being made available so that monitoring can proceed uninterrupted even when some equipment was under maintenance, calibration, etc.
- 5.22 The equipment used for impact water quality monitoring is shown in **Table 5.2** and copies of the calibration certificates are shown in **Appendix C**. All the monitoring

equipment complied with the requirements set out in the EM&A Manual.

Table 5.2 Water Quality Monitoring Equipment

Equipment	Model and Make	Qty
Sonar Water Depth Detector	Garmin Fishfinder 140	2
Monitoring Position Equipment	KODEN DGPS (KGP913MKIID, GA-08 & BA-03)	2
Multi-parameter Water Quality System	YSI 6820-C-M and YSI 6920-M	2
Water Sampler	Kahlsico Water-Bottle Model 135DW 150	2

Monitoring Parameters, Frequency

5.23 **Table 5.3** summarizes the monitoring parameters, monitoring period and frequencies of the water quality monitoring. The water quality monitoring schedule for the reporting month is shown in **Appendix D**.

Table 5.3 Water Quality Monitoring Parameters and Frequency

Monitoring Stations	Parameters, unit	Depth	Frequency
IS1, IS2, IS3 IS4, CS1, CS2, SR1, SR2, SR3, SR6, ST1, ST2, ST3, SRA	<ul style="list-style-type: none"> • Temperature(°C) • pH(pH unit) • turbidity (NTU) • water depth (m) • salinity (ppt) • dissolved oxygen (DO) (mg/L and % of saturation) • suspended solids (SS) (mg/L) 	<ul style="list-style-type: none"> • 3 water depths: 1m below sea surface, mid-depth and 1m above sea bed. • If the water depth is less than 3m, mid-depth sampling only. • If water depth less than 6m, mid-depth may be omitted. 	<ul style="list-style-type: none"> • Impact monitoring: 3 days per week, at mid-flood and mid-ebb tides during the construction period of the Contract

5.24 Monitoring location/position, time, water depth, sampling depth, pH, salinity, DO saturation, water temperature, tidal stages, weather conditions and any special phenomena or work underway nearby were recorded.

Monitoring Methodology

Instrumentation

5.25 A multi-parameter meters (Model YSI 6820-C-M) were used to measure DO, turbidity, salinity, pH and temperature.

Operating/Analytical Procedures

5.26 The monitoring stations were accessed by the guide of a hand-held Differential Global Positioning System (DGPS) during water quality monitoring in accordance with the EM&A Manual. The depth of the monitoring location was measured using depth meter

in order to determine the sampling depths. Afterwards, the probes of the in-situ measurement equipment were lowered to the predetermined depths (1 m below water surface, mid-depth and 1 m above seabed) and the measurements were carried out accordingly.

- 5.27 At each measurement, two consecutive measurements of DO concentration, DO saturation, salinity, turbidity, pH and temperature were taken. The probes were retrieved out of the water after the first measurement and then re-deployed for the second measurement. Where the difference in the value between the first and second readings of each set was more than 25% of the value of the first reading, the reading was discarded and further readings were taken.
- 5.28 Water sampler was lowered into the water to the required depths of sampling. Upon reaching the pre-determined depth, a messenger to activate the sampler was then released to travel down the wire. The water sample was sealed within the sampler before retrieving. At each station, water samples at three depths (1 m below water surface, mid-depth and 1 m above seabed) were collected accordingly. Water samples were stored in a cool box and kept at less than 4°C but without frozen and sent to the laboratory as soon as possible. In addition, field information as described in Section 5.23 was also recorded.

Laboratory Analytical Methods

- 5.29 The testing of all parameters was conducted by CMA Testing and Certification Laboratories (HOKLAS Registration No.004) and comprehensive quality assurance and control procedures in place in order to ensure quality and consistency in results. The testing method, reporting limit and detection limit are provided in **Table 5.4**.

Table 5.4 Methods for Laboratory Analysis for Water Samples

Determinant	Instrumentation	Analytical Method	Detection Limit
Suspended Solid (SS)	Weighing	APHA 21e 2540D	0.5 mg/L

QA/QC Requirements

Decontamination Procedures

- 5.30 Water sampling equipment used during the course of the monitoring programme was decontaminated by manual washing and rinsed clean seawater/distilled water after each sampling event. All disposal equipment was discarded after sampling.

Sampling Management and Supervision

- 5.31 All sampling bottles were labelled with the sample I.D (including the indication of sampling station and tidal stage e.g. IS1_me_a), laboratory number and sampling date. Water samples were dispatched to the testing laboratory for analysis as soon as possible after the sampling. All samples were stored in a cool box and kept at less than 4°C but without frozen. All water samples were handled under chain of custody protocols and relinquished to the laboratory representatives at locations specified by the laboratory.

5.32 The laboratory determination works were started within 24 hours after collection of the water samples.

Quality Control Measures for Sample Testing

5.33 The samples testing were performed by CMA Testing and Certification Laboratories.

5.34 The following quality control programme was performed by the CMA Testing and Certification Laboratories for every batch of 20 samples:

- ✧ One set of quality control (QC) samples.

Maintenance and Calibration

5.35 All in situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or other international accreditation scheme before use, and subsequently re-calibrated at 3 monthly intervals throughout all stages of the water quality monitoring programme.

Results and Observations

5.36 The monitoring results and graphical presentation of water quality at the monitoring stations is shown in **Appendix H**.

5.37 The summary of exceedance record in reporting month is shown in **Appendix L**.

5.38 All water quality monitoring was conducted as scheduled in the reporting month except water quality monitoring during mid-flood tide on 1st August 2016 which was cancelled due to adverse weather condition (Strong Wind Signal No.3). No Action/Limit Level exceedance was recorded.

Event and Action Plan

5.39 Should non-compliance of the criteria occur, action in accordance with the Action Plan in **Appendix K** shall be carried out.

6 DOLPHIN-RELATED MONITORING

Monitoring Requirements

- 6.1 According to Section 10 of the EM&A Manual, four kinds of ecological monitoring works are required during the construction phase, namely dolphin monitoring, construction-phase underwater noise monitoring, dolphin behavior monitoring and land-based dolphin behavior and movement monitoring. The 30 days of construction-phase underwater noise monitoring, dolphin behavior monitoring and land-based dolphin behavior and movement monitoring were completed in July 2013.
- 6.2 The monitoring work shall be undertaken by suitably qualified specialist(s), (i.e. dolphin specialist and bio-acoustician), who shall have sufficient (at least 5-10 years) relevant post-graduate experience and publication in the respective aspects. They should be approved by Agriculture, Fisheries and Conservation Department (AFCD) and Environmental Protection Department (EPD).

Dolphin Monitoring (Line-transect Vessel Survey)

Monitoring Requirements

- 6.3 According to EM&A Manual Section 10.3.2, a dolphin monitoring programme should be set up to verify the predictions of impacts and to ensure that there are no unforeseen impacts on the dolphin population during construction phase.
- 6.4 Following the requirement in the EM&A Manual Section 10.4.1, the dolphin monitoring should adopt line-transect vessel survey method, and cover the following line-transect survey areas as in AFCD annual marine mammal monitoring programme.

Monitoring Location

- 6.5 For this contract, dolphin monitoring will be carried out in the West Lantau (WL) along the line transect as depicted in **Figure 1** of **Appendix I**. The co-ordinates of all transect lines are shown in **Table 6.1**.

Table 6.1 Co-ordinates of transect lines in WL survey area

Line No.		Easting	Northing	Line No.		Easting	Northing
1	Start Point	803750	818500	7	Start Point	800200	810450
1	End Point	803750	815500	7	End Point	801400	810450
2	Start Point	803750	815500	8	Start Point	801300	809450
2	End Point	802940	815500	8	End Point	799750	809450
3	Start Point	802550	814500	9	Start Point	799400	808450
3	End Point	803700	814500	9	End Point	801430	808450
4	Start Point	803120	813600	10	Start Point	801500	807450
4	End Point	801640	813600	10	End Point	799600	807450

Line No.		Easting	Northing	Line No.		Easting	Northing
5	Start Point	801100	812450	11	Start Point	800300	806500
5	End Point	802900	812450	11	End Point	801750	806500
6	Start Point	802400	811500	12	Start Point	801760	805450
6	End Point	800660	811500	12	End Point	800700	805450

Monitoring Frequency

6.6 Dolphin transect survey was carried out at least twice a month (i.e. complete all the transect lines of West Lantau survey area twice per month) throughout the construction period.

Monitoring Day

6.7 Dolphin monitoring was carried out on 9th and 16th August 2016. The dolphin monitoring schedule for the reporting period is shown in **Appendix D**.

Monitoring Results

6.8 From these surveys, a total of 64.90 km of survey effort was collected, with 100% of the total survey effort being conducted under favorable weather conditions (i.e. Beaufort Sea State 3 or below with good visibility) Out of the 64.90 km of survey effort, the total survey effort conducted on primary lines (the horizontal lines perpendicular to the coastlines) was 44.42 km.

6.9 4 groups of 9 Chinese White Dolphins were sighted from primary lines. None of the dolphin groups was associated with an operating fishing vessel. Distribution of the 9 dolphin sightings made during August’s surveys is shown in **Figure 4 of Appendix I**. The sightings were evenly distributed from Tai O Peninsula to Fan Lau, with no apparent concentration. As in the past monitoring months, dolphins were rarely sighted in the northern portion of the study area, especially in the area near the HKLR09 alignment (**Figure 4 of Appendix I**).

6.10 Dolphin encounter rates deduced from the survey effort and on-effort sighting data made under favourable conditions (Beaufort 3 or below) are shown in **Table 6.2**.

Table 6.2 Dolphin encounter rates (sightings per 100 km of survey effort) in August’s surveys

		Encounter rate (STG) (no. of on-effort dolphin sightings per 100 km of survey effort)	Encounter rate (ANI) (no. of dolphins from all on-effort sightings per 100 km of survey effort)
		Primary Lines Only	Primary Lines Only
WL	Set 1: August 9 th	4.6	4.6
	Set 2: August 16 th	13.1	34.9

6.11 The average group size of Chinese White Dolphins was 2.9 individuals per group during August’s surveys, which was lower than the averages in previous months of monitoring surveys.

- 6.12 Most dolphin groups were small in size with 1-3 animals, but there were also two medium-sized groups with 5 and 8 animals respectively.
- 6.13 During this month of dolphin monitoring, marine construction activities have continued under this contract. However, no adverse impact on Chinese white dolphins was noticeable from general observations.
- 6.14 Evaluation of impacts on dolphins due to construction work will be conducted in the quarterly EM&A report.
- 6.15 Detailed monitoring methodology and results can be found in **Appendix I**.

Additional Land-based Dolphin Behaviour and Movement Monitoring

- 6.16 Additional land-based dolphin behavior and movement monitoring was conducted on 11th and 25th August 2016 in the reporting month. The progress of the monitoring is summarized in the **Table 6.3**.

Table 6.3 Progress Record of Additional Land-based Dolphin Behaviour and Movement Monitoring in August 2016

Date	Time	Weather		Number of Staff	Number of Dolphin Sighting
		Beaufort	Visibility		
11/08/16	09:57 - 14:34	2	2-3	3	0
25/08/16	09:15 - 14:15	2	2.5	3	2

- 6.17 The last two additional land-based dolphin behavior and movement monitoring were conducted in August 2016 and therefore a total of 64 days of additional monitoring according to the Proposal for Land-based Dolphin Behaviour and Movement Monitoring had been completed in August 2016.
- 6.18 Detailed monitoring methodology and results will be provided in a separate report.

7 ENVIRONMENTAL SITE INSPECTION

Site Audits

- 7.1 Site audits were carried out by ET on weekly basis to monitor the timely implementation of proper environmental management practices and mitigation measures in the Contract site. The summaries of site audits are attached in **Appendix M**.
- 7.2 Site audits were conducted on 3rd, 9th, 16th, 23rd and 30th August 2016 by ET after the commencement of construction works for the Contract. A joint site audit with the representative with IEC, SOR, the Contractor and the ET was carried out on 23rd August 2016. The details of observations during site audit can refer to **Table 7.1**.
- 7.3 According to EP condition 4.7 and EM&A Manual, periodic monitoring (every three months) of construction works shall be conducted to ensure the avoidance of any impacts on Sha Lo Wan (West) Archaeological Site. Access to Sha Lo Wan (West) Archaeological site for works areas and storage of construction equipment is not allowed. The 14th inspection to the Sha Lo Wan (West) Archaeological Site was conducted on 28th June 2016 and next inspection will be conducted in September 2016.

Implementation Status of Environmental Mitigation Measures

- 7.4 According to the EIA Study Report, Environmental Permit and the EM&A Manual, the mitigation measures detailed in the documents are recommended to be implemented during the construction phase. An updated summary of the EMIS is provided in **Appendix N**.
- 7.5 Regular marine travel route for marine vessels were implemented properly in accordance with the submitted plan and relevant records were kept properly.
- 7.6 Acoustic decoupling measures for the stationary equipment (generators, winch generators and air compressors) mounted on boards were adopted according to EP Condition 3.7 and EM&A Manual, Section 10.2.18.
- 7.7 Dolphin exclusion zone and dolphin watching plan according to EM&A Manual, Section 10.2.12 and EP Condition 3.5 was implemented by DCVJV's trained dolphin watcher.
- 7.8 Spill kits and booms are ready on site for the event of accidental spillage of oil or other hazardous chemicals from construction activities including vessels operating for the Contract.
- 7.9 During site inspections in the reporting month, no non-conformance was identified. The observations and recommendations made during the audit sessions are summarized in **Table 7.1**.

Table 7.1 Observations and Recommendations of Site Audit

Parameters	Date	Observations and Recommendations	Follow-up
<i>Water Quality</i>	03/08/2016	Muddy water was observed discharge from site to the gullies during heavy rainstorm at P114. The Contractor was reminded to enhance the water quality mitigation measures (e.g. direct muddy water to appropriate sedimentation facilities, adequate maintenance of drainage, earth bunds or sand bag barriers to protect the gullies) to avoid flooding and untreated site runoff entering the public drainage directly.	Rectification/improvement was observed during the follow-up audit session on 9 August 2016.
	03/08/2016	Clear the floating rubbish within the site curtain after the typhoon at Portion A.	Rectification/improvement was observed during the follow-up audit session on 23 August 2016.
	03/08/2016	Provide earth bunds or sand bag barrier at the site boundary at P101 to prevent the site runoff discharging to the sea.	Rectification/improvement was observed during the follow-up audit session on 9 August 2016.
	16/08/2016	To repair the damaged silt curtain near P68.	Rectification/improvement was observed during the follow-up audit session on 23 August 2016.
<i>Ecology</i>	N/A ⁽¹⁾	N/A ⁽¹⁾	N/A ⁽¹⁾
<i>Air Quality</i>	N/A ⁽¹⁾	N/A ⁽¹⁾	N/A ⁽¹⁾
<i>Noise</i>	N/A ⁽¹⁾	N/A ⁽¹⁾	N/A ⁽¹⁾
<i>Waste / Chemical Management</i>	09/08/2016	To maintain a good house-keeping at works area of P77.	Rectification/improvement was observed during the follow-up audit session on 16 August 2016.
	09/08/2016	To clear the wastewater properly as chemical waste at the skip at P77.	Rectification/improvement was observed during the follow-up audit session on 16 August 2016.
	09/08/2016	To properly repair the drip tray at Portion A.	Rectification/improvement was observed during the follow-up audit session on 23 August 2016.
	16/08/2016	To properly repair the drip tray near P83 and clear the oil stain.	Rectification/improvement was observed during the follow-up audit session on 23 August 2016.
	16/08/2016	To clear the waste materials floating within the silt curtain near P91.	Rectification/improvement was observed during the follow-up audit session on 26 July 2016.
	16/08/2016	To clear the accumulated waste material near P68.	Rectification/improvement was observed during the follow-up audit session on 23 August 2016.
	23/08/2016	Clear the accumulated waste materials at the waste skip at P58.	Rectification/improvement was observed during the follow-up audit session on 30 August 2016.
	23/08/2016	To close the opening of drip tray for the generator at P71.	Rectification/improvement was observed during the

Parameters	Date	Observations and Recommendations	Follow-up
			follow-up audit session on 30 August 2016.
	30/08/2016	To provide a drip tray for oil drums and label it properly at P60 and LF3.	Rectification/improvement was observed during the follow-up audit session on 6 September 2016.
	30/08/2016	To properly store the chemical containers or remove it near P60.	Rectification/improvement was observed during the follow-up audit session on 6 September 2016.
	30/08/2016	Chemical material should be properly stored in chemical storage area at Portion C.	Rectification/improvement was observed during the follow-up audit session on 6 September 2016.
	30/08/2016	Waste water should be cleared from waste skip near P83.	Rectification/improvement was observed during the follow-up audit session on 6 September 2016.
Landscape & Visual Impact	N/A ⁽¹⁾	N/A ⁽¹⁾	N/A ⁽¹⁾
Permits/Licences	N/A ⁽¹⁾	N/A ⁽¹⁾	N/A ⁽¹⁾
Other	N/A ⁽¹⁾	N/A ⁽¹⁾	N/A ⁽¹⁾
Cultural Heritage (Sha Lo Wan (West) Archaeological Site)	N/A ⁽²⁾	N/A ⁽²⁾	N/A ⁽²⁾

Remark: N/A⁽¹⁾ No major environmental deficiency was identified during the site inspection in the reporting month.

N/A⁽²⁾ No archaeological site inspection was conducted in the reporting month.

Advice on the Solid and Liquid Waste Management Status

- 7.10 According to the Contractor, 1,366m³ inert C&D materials were generated during the reporting month.
- 7.11 The Contractor was advised to minimize the wastes generated through the recycling or reusing. All mitigation measures stipulated in approved waste management plan shall be fully implemented.
- 7.12 The amount of wastes generated by the activities of the Contract during the reporting month is shown in **Appendix O**.

8 ENVIRONMENTAL NON-CONFORMANCE (EXCEEDANCES)

Summary of Exceedances

- 8.1 Summary of exceedance is provided in **Appendix L**.
- 8.2 No Action/Limit Level exceedance was recorded for air quality, construction noise and water quality.

Summary of Environmental Complaint

- 8.3 No environmental related complaint was received in the reporting month. The Complaint Log is attached in **Appendix P**.

Summary of Notification of Summons and Successful Prosecution

- 8.4 There was one prosecution or notification of summons received since the Contract commencement. Summary of successful prosecution as attached in **Appendix Q**.

9 FUTURE KEY ISSUES

Key Issues in the Coming Month

9.1 Major site activities for the coming reporting month will include:

WA4

- Cross Beam Precast Shell construction

Ancillary and Associated Facilities

- E&M installation
- E&M ducting installation
- Construction of Lad Centre (CL1)
- Installation of carrier drains
- Installation of precast parapet skins
- Erection of Radar Platform
- Construction of median and side barriers
- Construction of longitudinal stitching
- Erection of gantry posts for Sign gantry
- Reinstatement of slope area and drainage works

Marine Viaduct (P0 to P80)

Deck Erection

- Segment erection
- Erection of SOP segments
- Dismantling of LG1
- Erection of cantilever
- Construction of cross beam precast shell
- In-situ RC works
- Erection of precast SOP unit to Turnaround

External Prestressing Tendon Installation

Internal Trestressing Grouting

Monitoring Schedule for the Next Month

9.2 The tentative environmental monitoring schedule for the next month is shown in **Appendix D**.

Construction Programme for the Next Month

9.3 A tentative construction programme is provided in **Appendix A**.

10 CONCLUSIONS AND RECOMMENDATIONS

Conclusions

- 10.1 The Environmental Monitoring and Audit (EM&A) Report presents the EM&A works undertaken in August 2016 in accordance with EM&A Manual.
- 10.2 No Action/Limit Level exceedance was recorded for air quality, construction noise and water quality.
- 10.3 Dolphin transect survey was carried out on 9th and 16th August 2016. No adverse impact on Chinese White Dolphins was noticeable from general observations.
- 10.4 Two days of additional Land-based Dolphin Behaviour and Movement Monitoring were conducted on 11th and 25th August 2016.
- 10.5 Environmental site inspection was conducted on 3rd, 9th, 16th, 23rd, and 30th August 2016 by ET in the reporting month. All deficiencies identified during the site inspection have already rectified / improved during the follow-up audit session.
- 10.6 No inspection to the Sha Lo Wan (West) Archaeological Site was conducted in the reporting month.
- 10.7 There was no environmental complaint, no notification of summons and successful prosecution received in the reporting month.
- 10.8 The ET will keep track on the EM&A programme to ensure compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

Recommendations

10.9 According to the environmental audit performed in the reporting month, the following recommendations were made:

Air Quality Impact

- To regularly maintain the quality of machinery and vehicles on site.
- To implement dust suppression measures on all haul roads, stockpiles, dry surfaces and excavation works.
- To provide hoarding along the entire length of that portion of the site boundary.

Noise Impact

- To inspect the noise sources inside the site.
- To space out noisy equipment and position the equipment as far away as possible from sensitive receivers.
- To provide temporary noise barriers for operations of noisy equipment near the noise sensitive receivers, if necessary.

Water Impact

- To prevent any surface runoff discharge into any stream course and sea.
- To review and implement temporary drainage system.
- To identify any wastewater discharges from site.
- To ensure properly maintenance for de-silting facilities.
- To clear the silt and sediment in the sedimentation tanks.
- To review the capacity of de-silting facilities for discharge.
- To divert all the water generated from construction site to de-silting facilities with enough handling capacity before discharge.
- To avoid accumulation of stagnant and ponding water on site.

Ecology Impact


- To implement Spill Response Plan in the event of accidental spillage of or other hazardous chemicals.
- To implement Dolphin Exclusion Zone during the installation of bored pile casing located in the waters to the west of Airport.
- To implement Dolphin Watching Plan after the bored piling casing is installed.
- To ensure the acoustically-decoupled measures were implemented for air compressors and other noisy equipment mounted on construction vessels according

to acoustic decoupling measures plan.



Waste/Chemical Management

- To check for any accumulation of waste materials or rubbish on site.
- To ensure the performance of sorting of C&D materials at source (during generation);
- To carry out inspection of dump truck at site exit to ensure inert and non-inert C&D materials are properly segregated before removing off site.
- To avoid any discharge or accidental spillage of chemical waste or oil directly from the site.
- To avoid improper handling or storage of oil drum on site.

FIGURE(S)

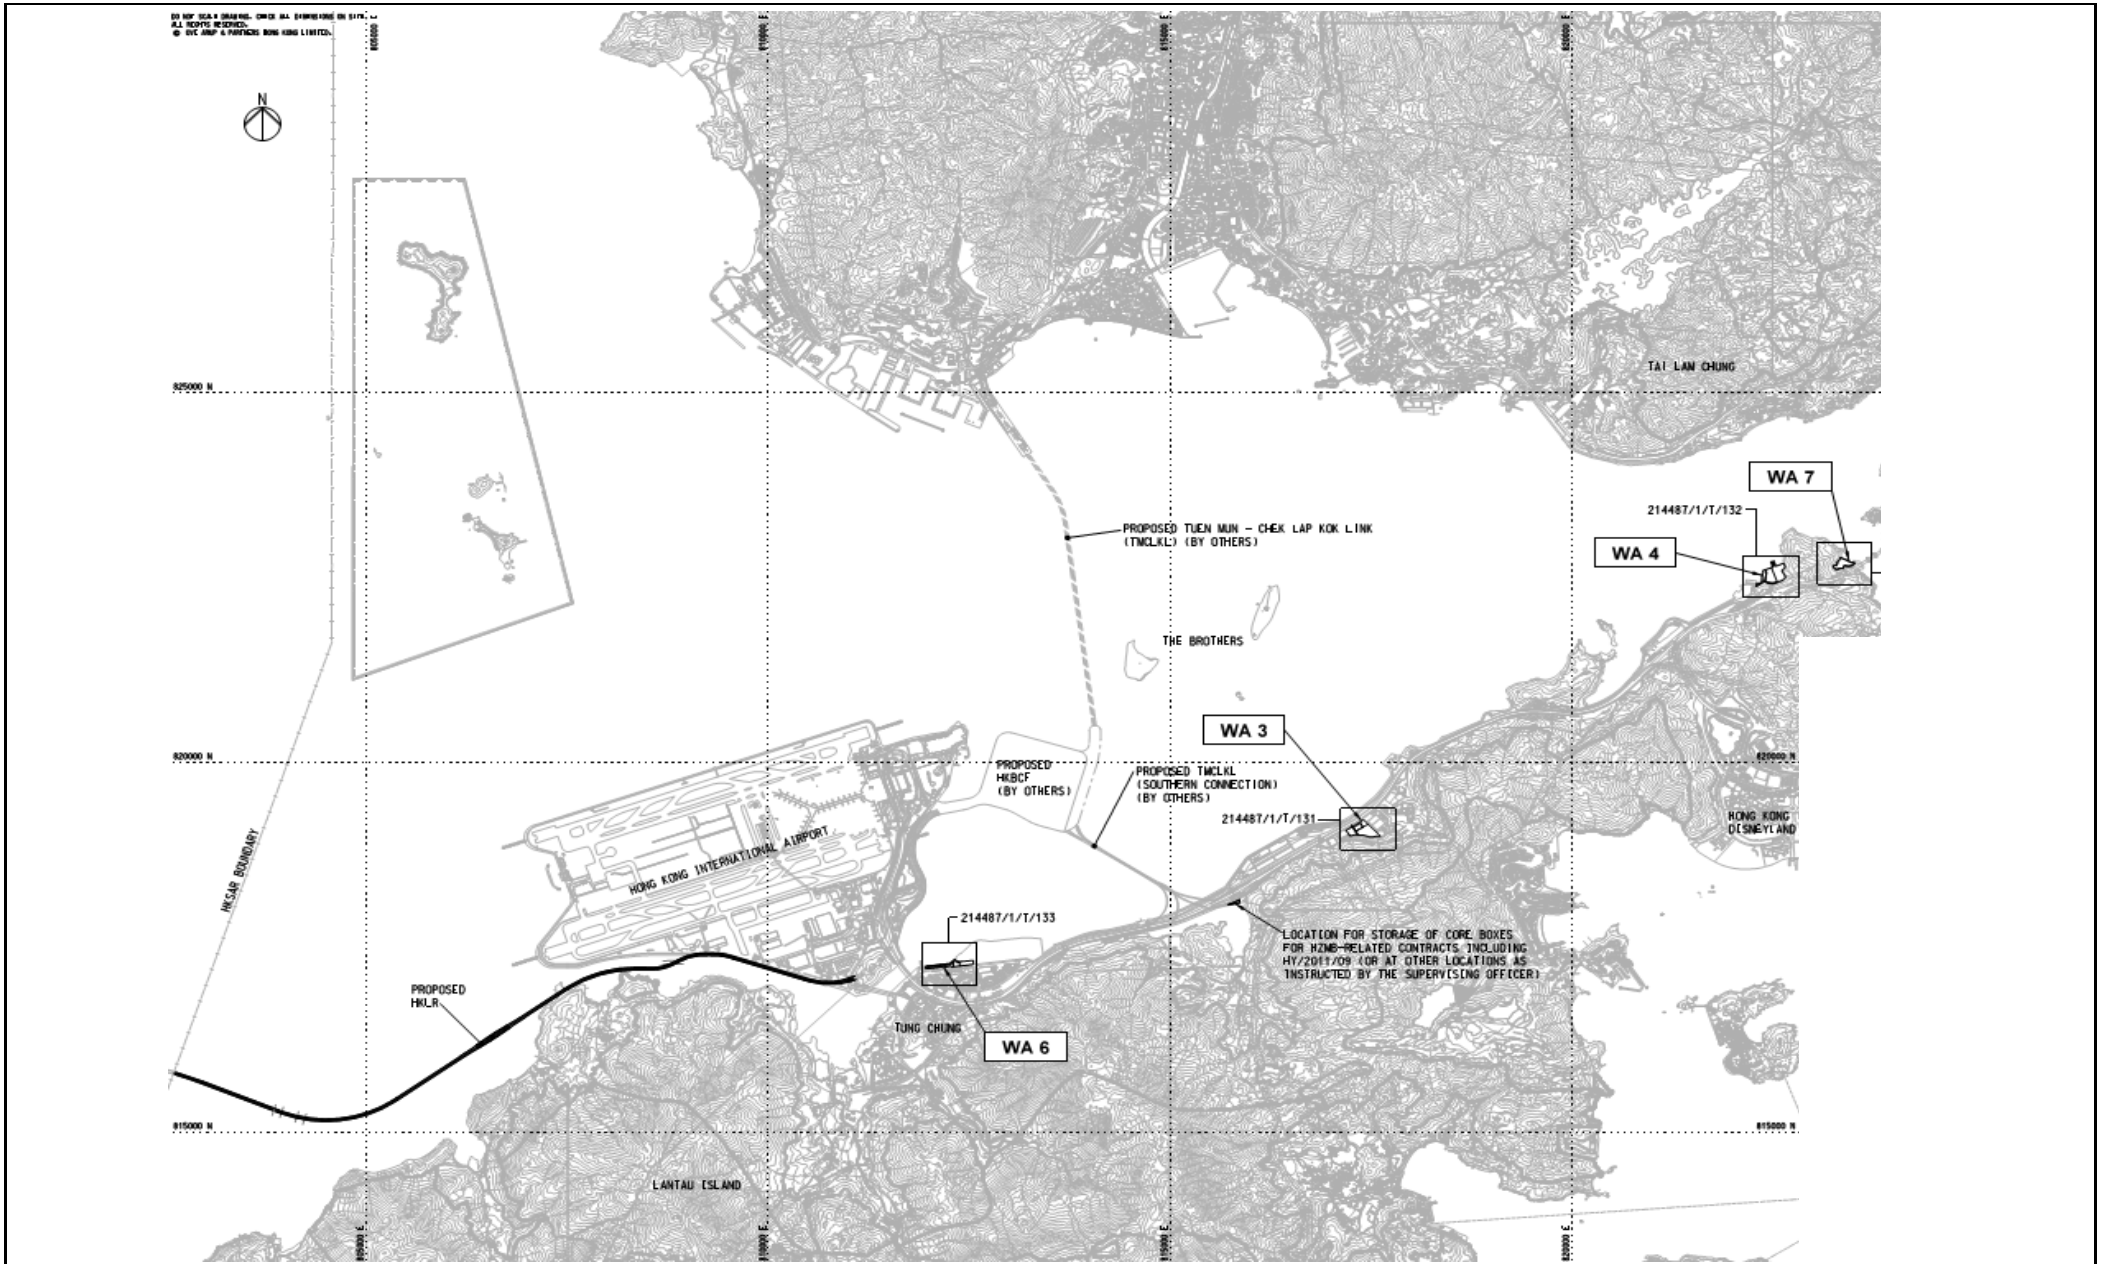


Title	Contract No. HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill Site Layout Plan (WA3, WA4, WA6 and WA7)		Scale	N.T.S	Propose	No. MA12014 Figure 1a	CINOTECH
	Date	Oct-15					

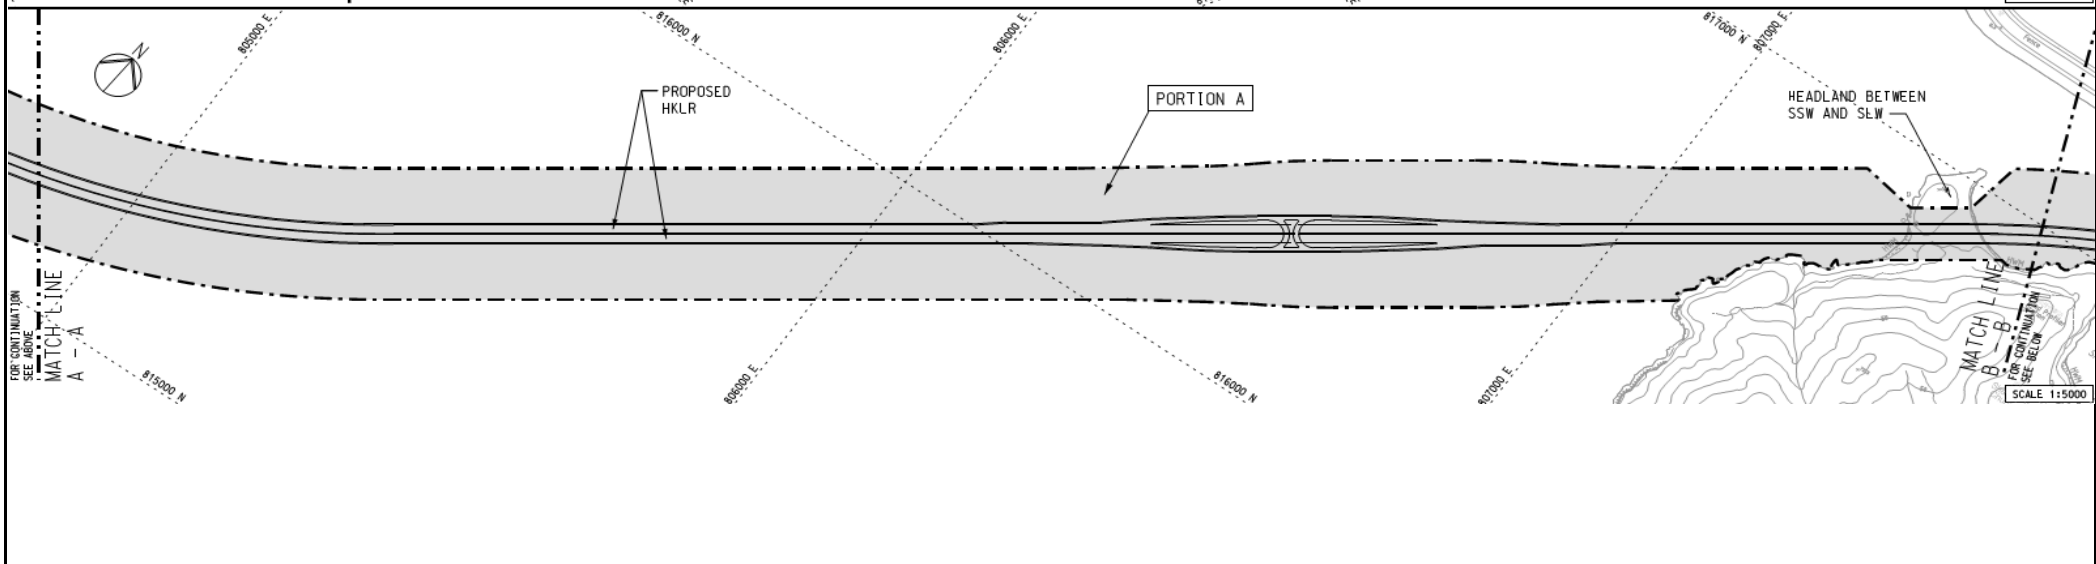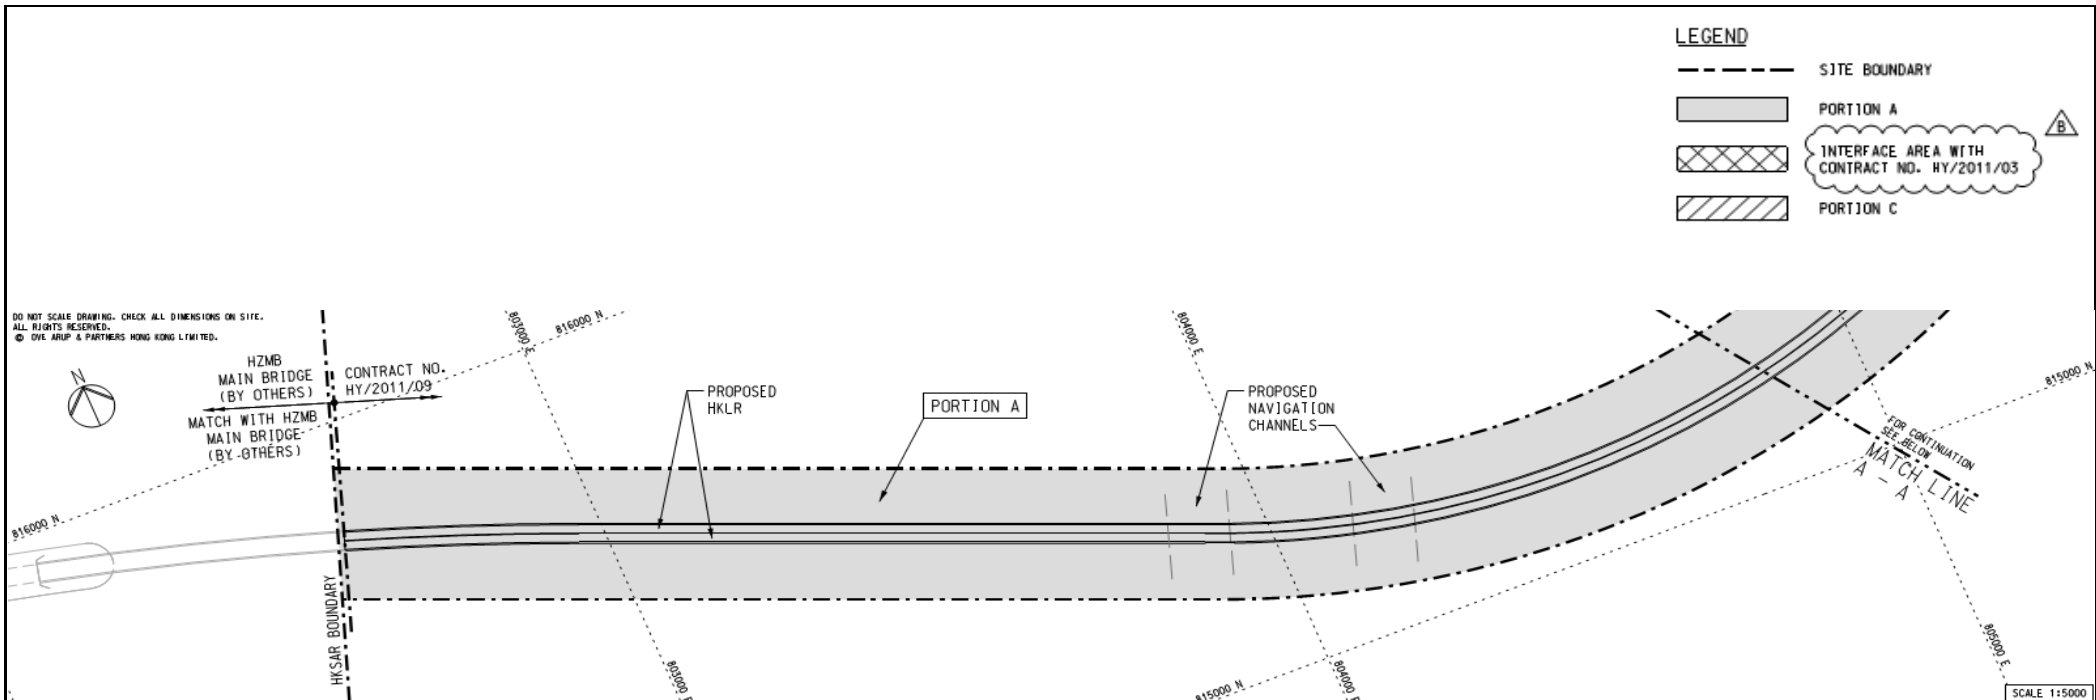


Title	Contract No. HY/2011/09		Scale	Proposed
	Hong Kong-Zhuhai-Macao Bridge		N.T.S	No. MA12014
Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill			Date	Figure
Site Layout Plan (Portion A)			Oct-15	1b




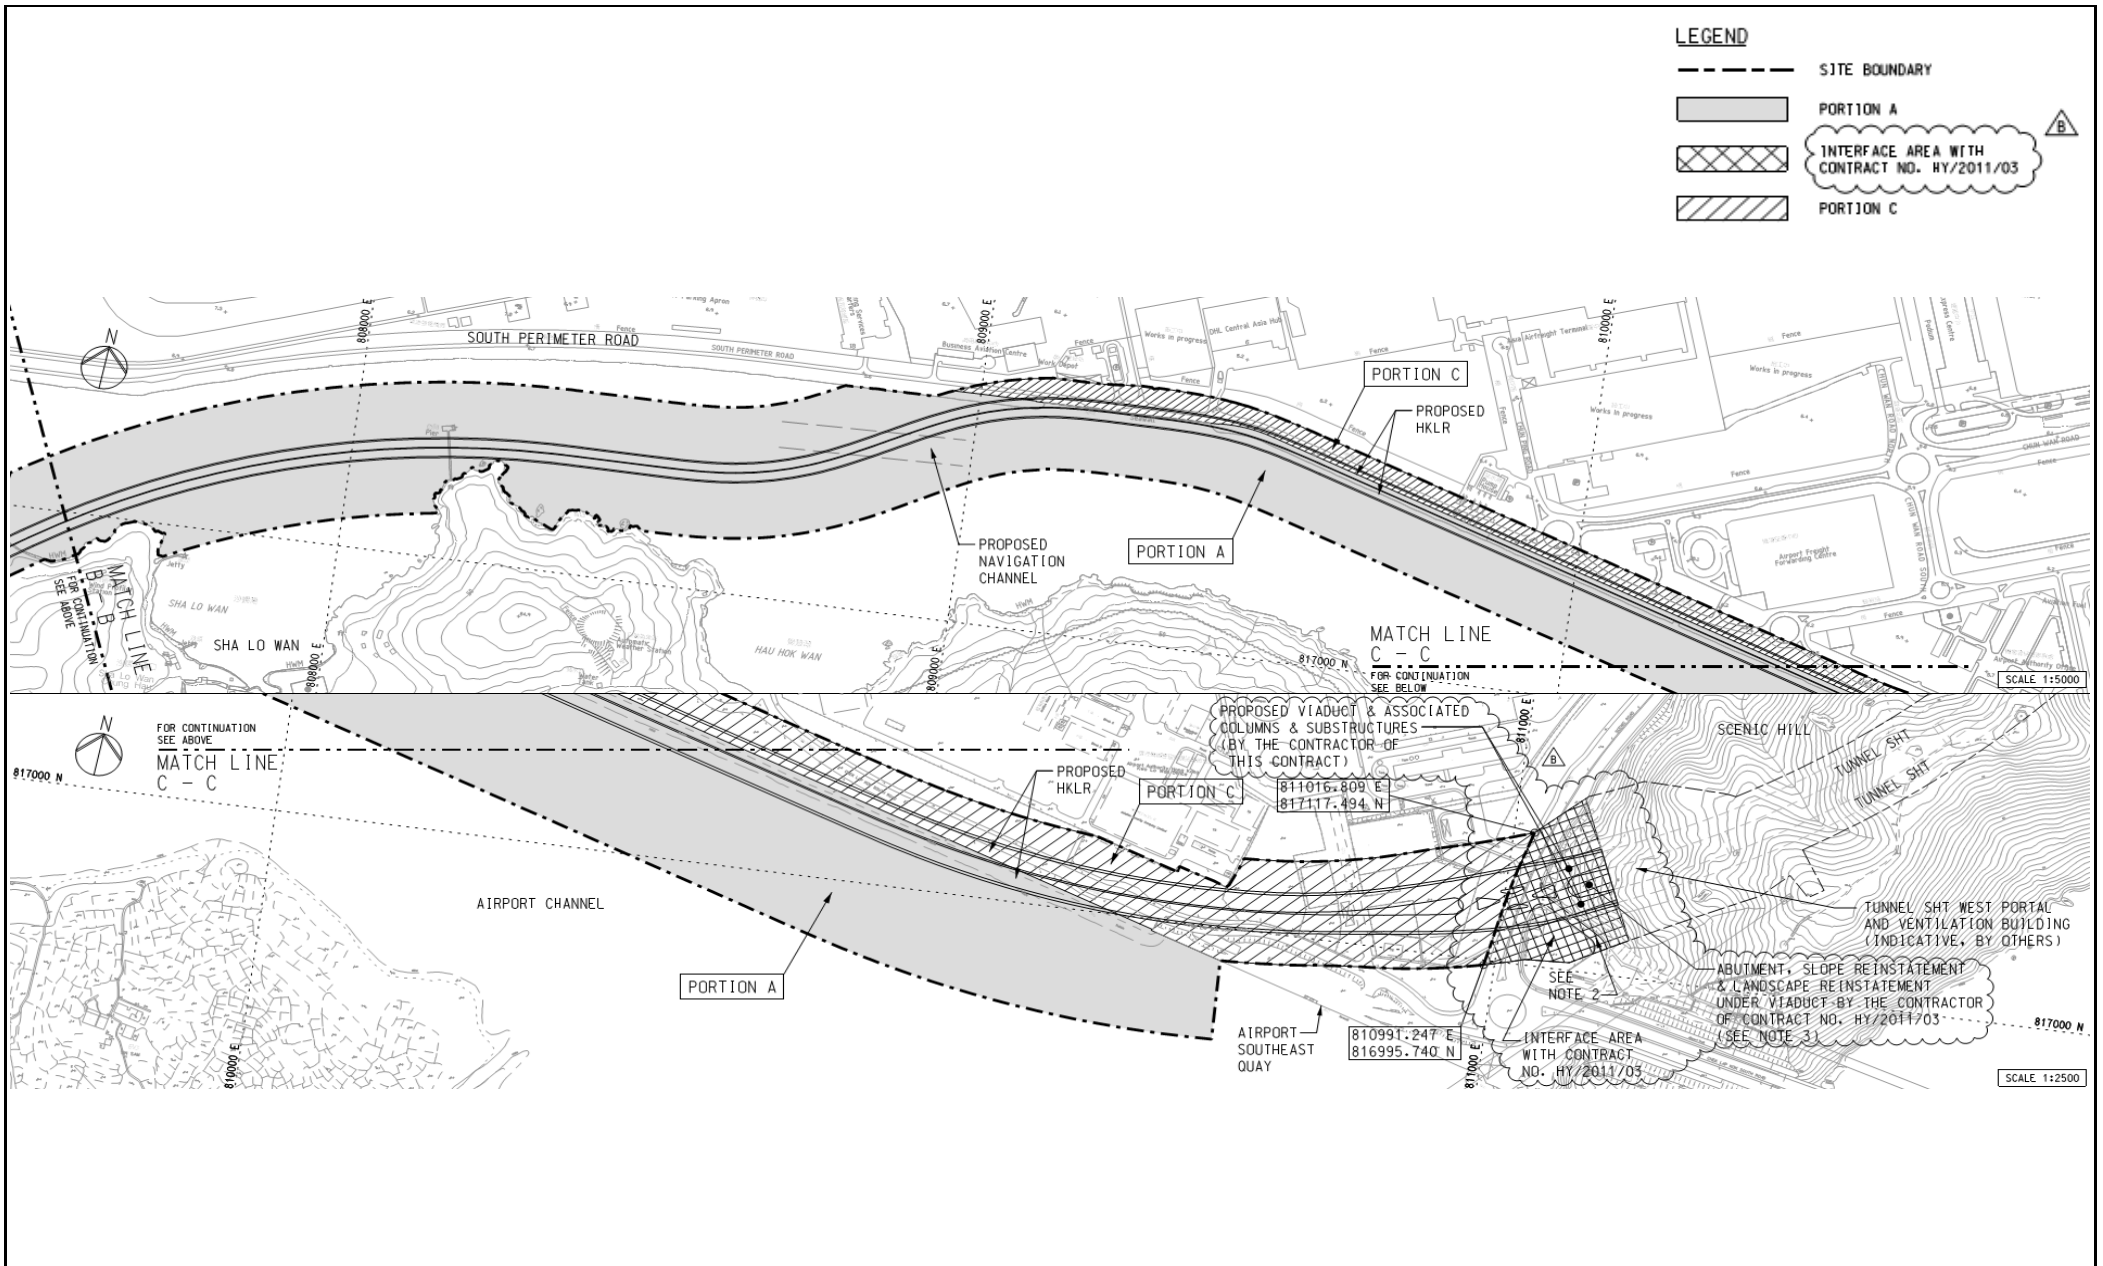

Title	Contract No. HY/2011/09		Scale	Propose	CINOTECH
	Hong Kong-Zhuhai-Macao Bridge		N.T.S	No. MA12014	
	Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill		Date	Figure	
	Site Layout Plan (Portion A and C)		五月-13	1c	

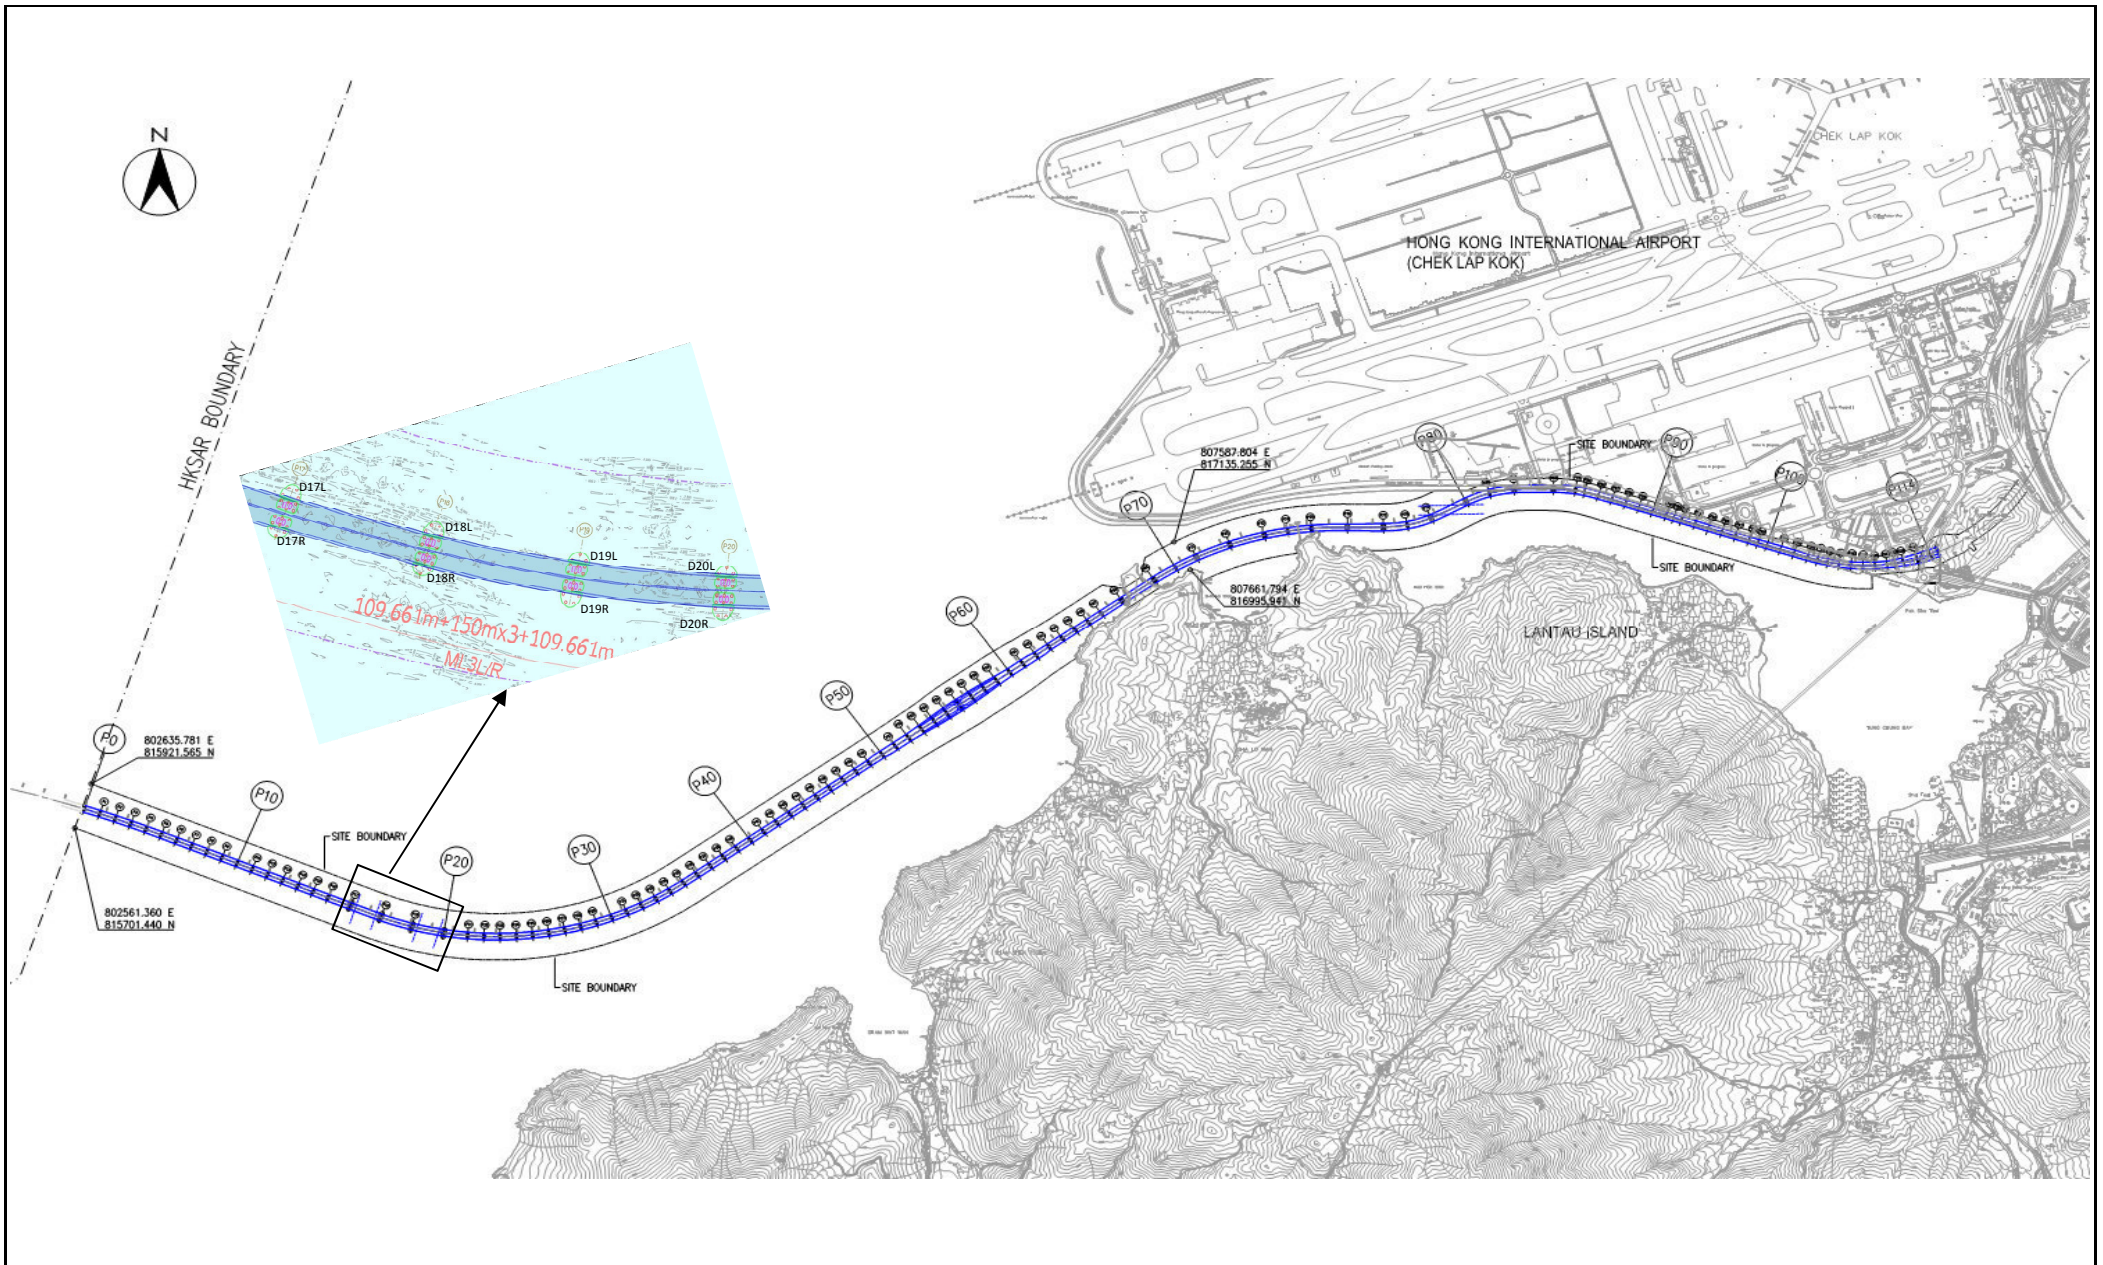

Title	Contract No. HY/2011/09		Scale	Propose	CINOTECH
	Hong Kong-Zhuhai-Macao Bridge		N.T.S	No. MA12014	
	Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill		Date	Figure	
	Site Layout Plan (Pier(s) Site)		Oct-15	1d	

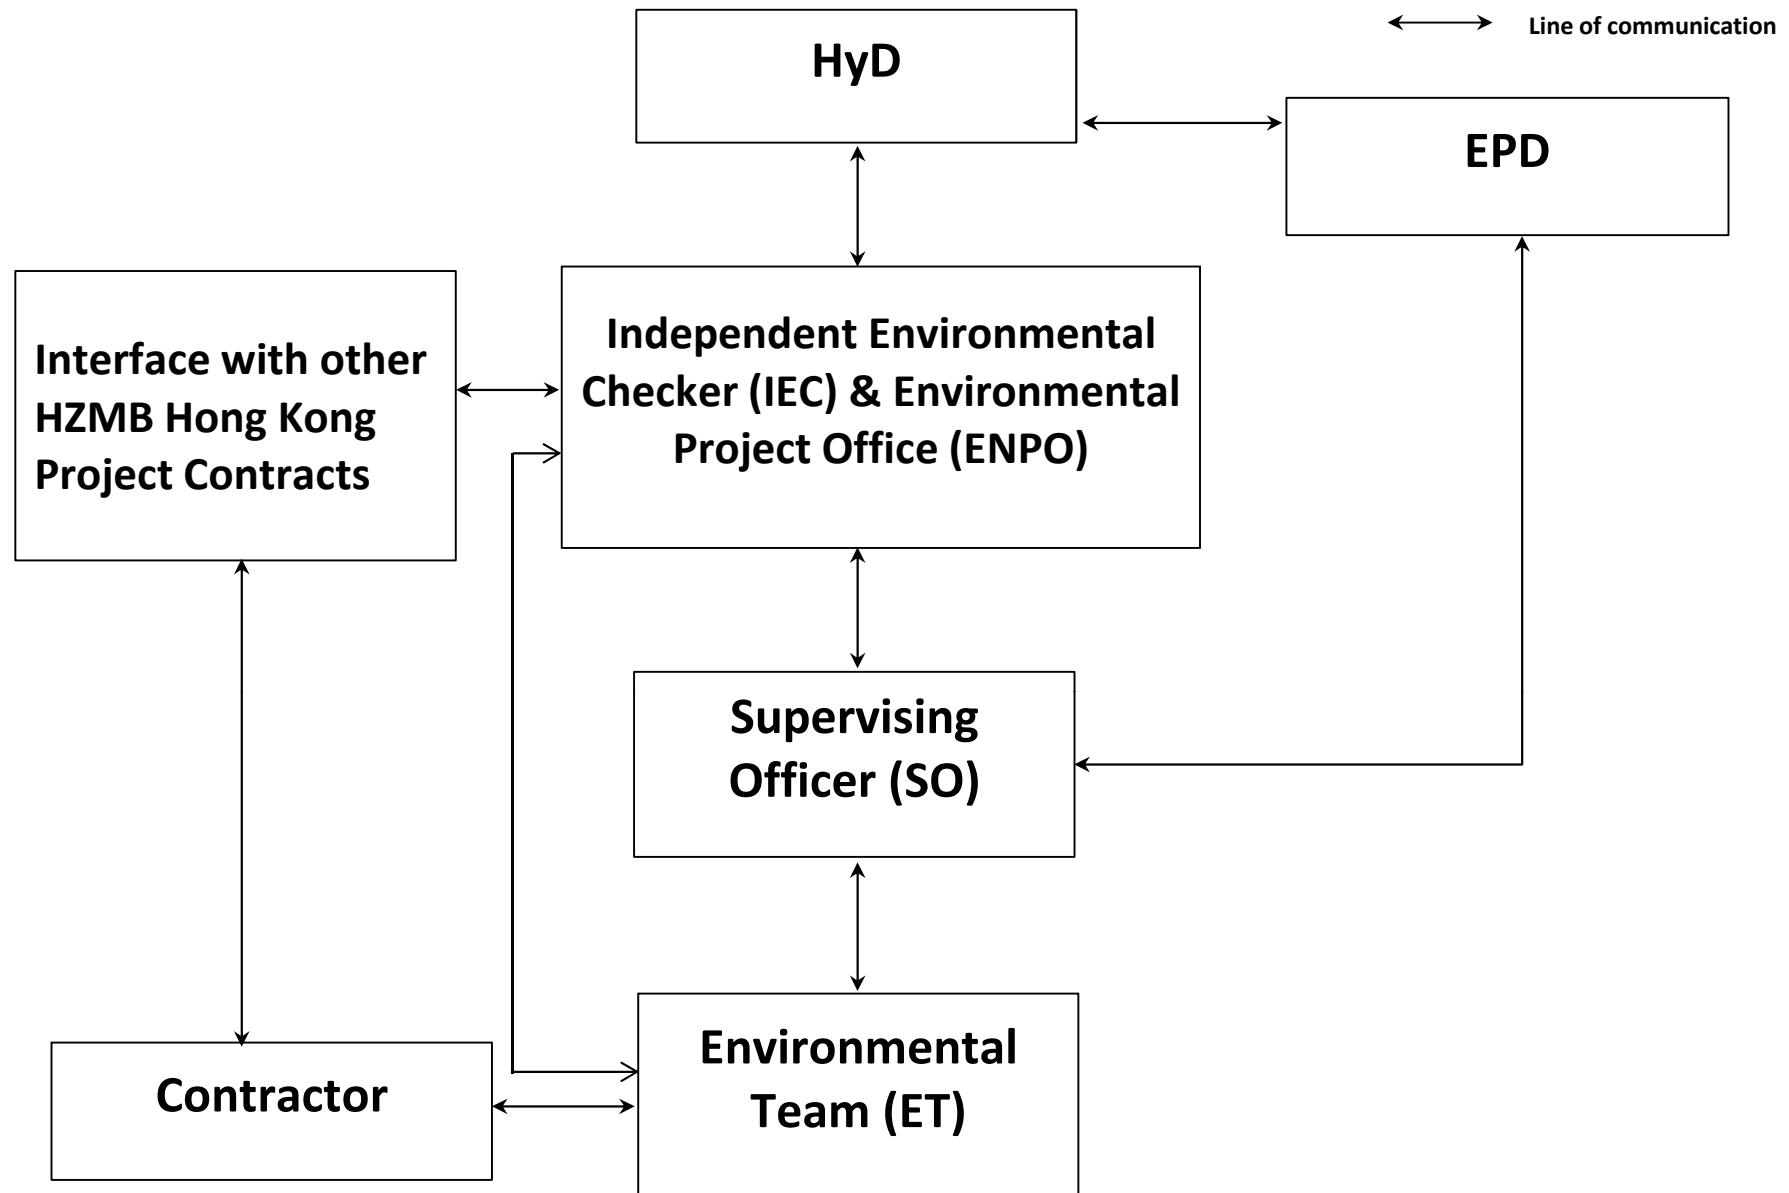


Title Contract No. HY/2011/09
 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between
 HKSAR Boundary and Scenic Hill
 Project Organisation for Environmental Works


Scale N.T.S
 Date Feb-13

Propose No. MA12014
 Figure 2



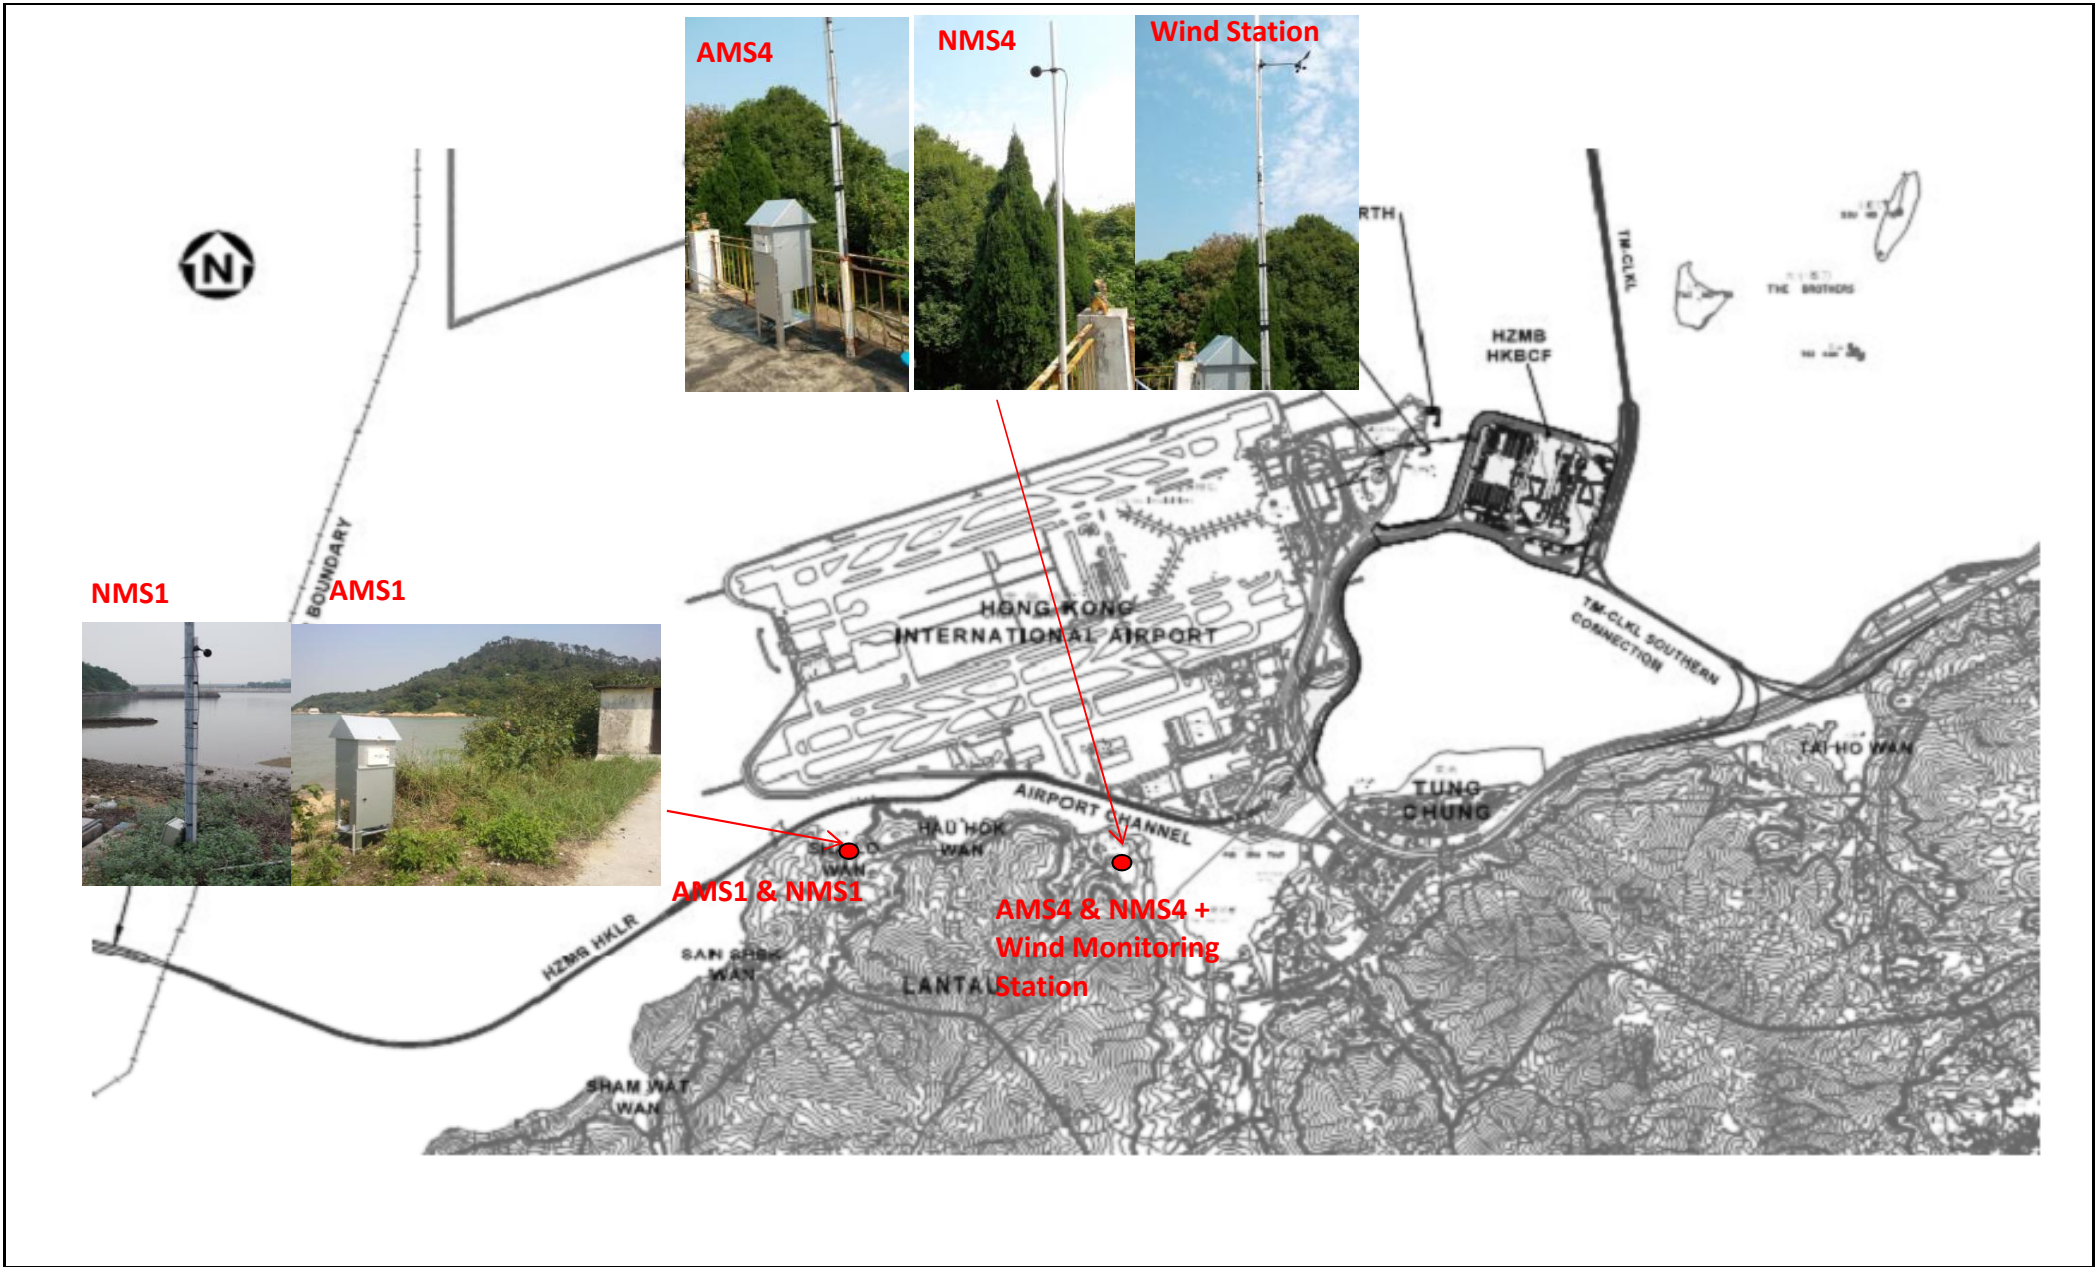

Title	Contract No. HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill	Scale	N.T.S	Propose No.	MA12014	CINOTECH
		Date	Feb-13	Figure	3	
Locations of Air Quality and Noise Monitoring Stations						

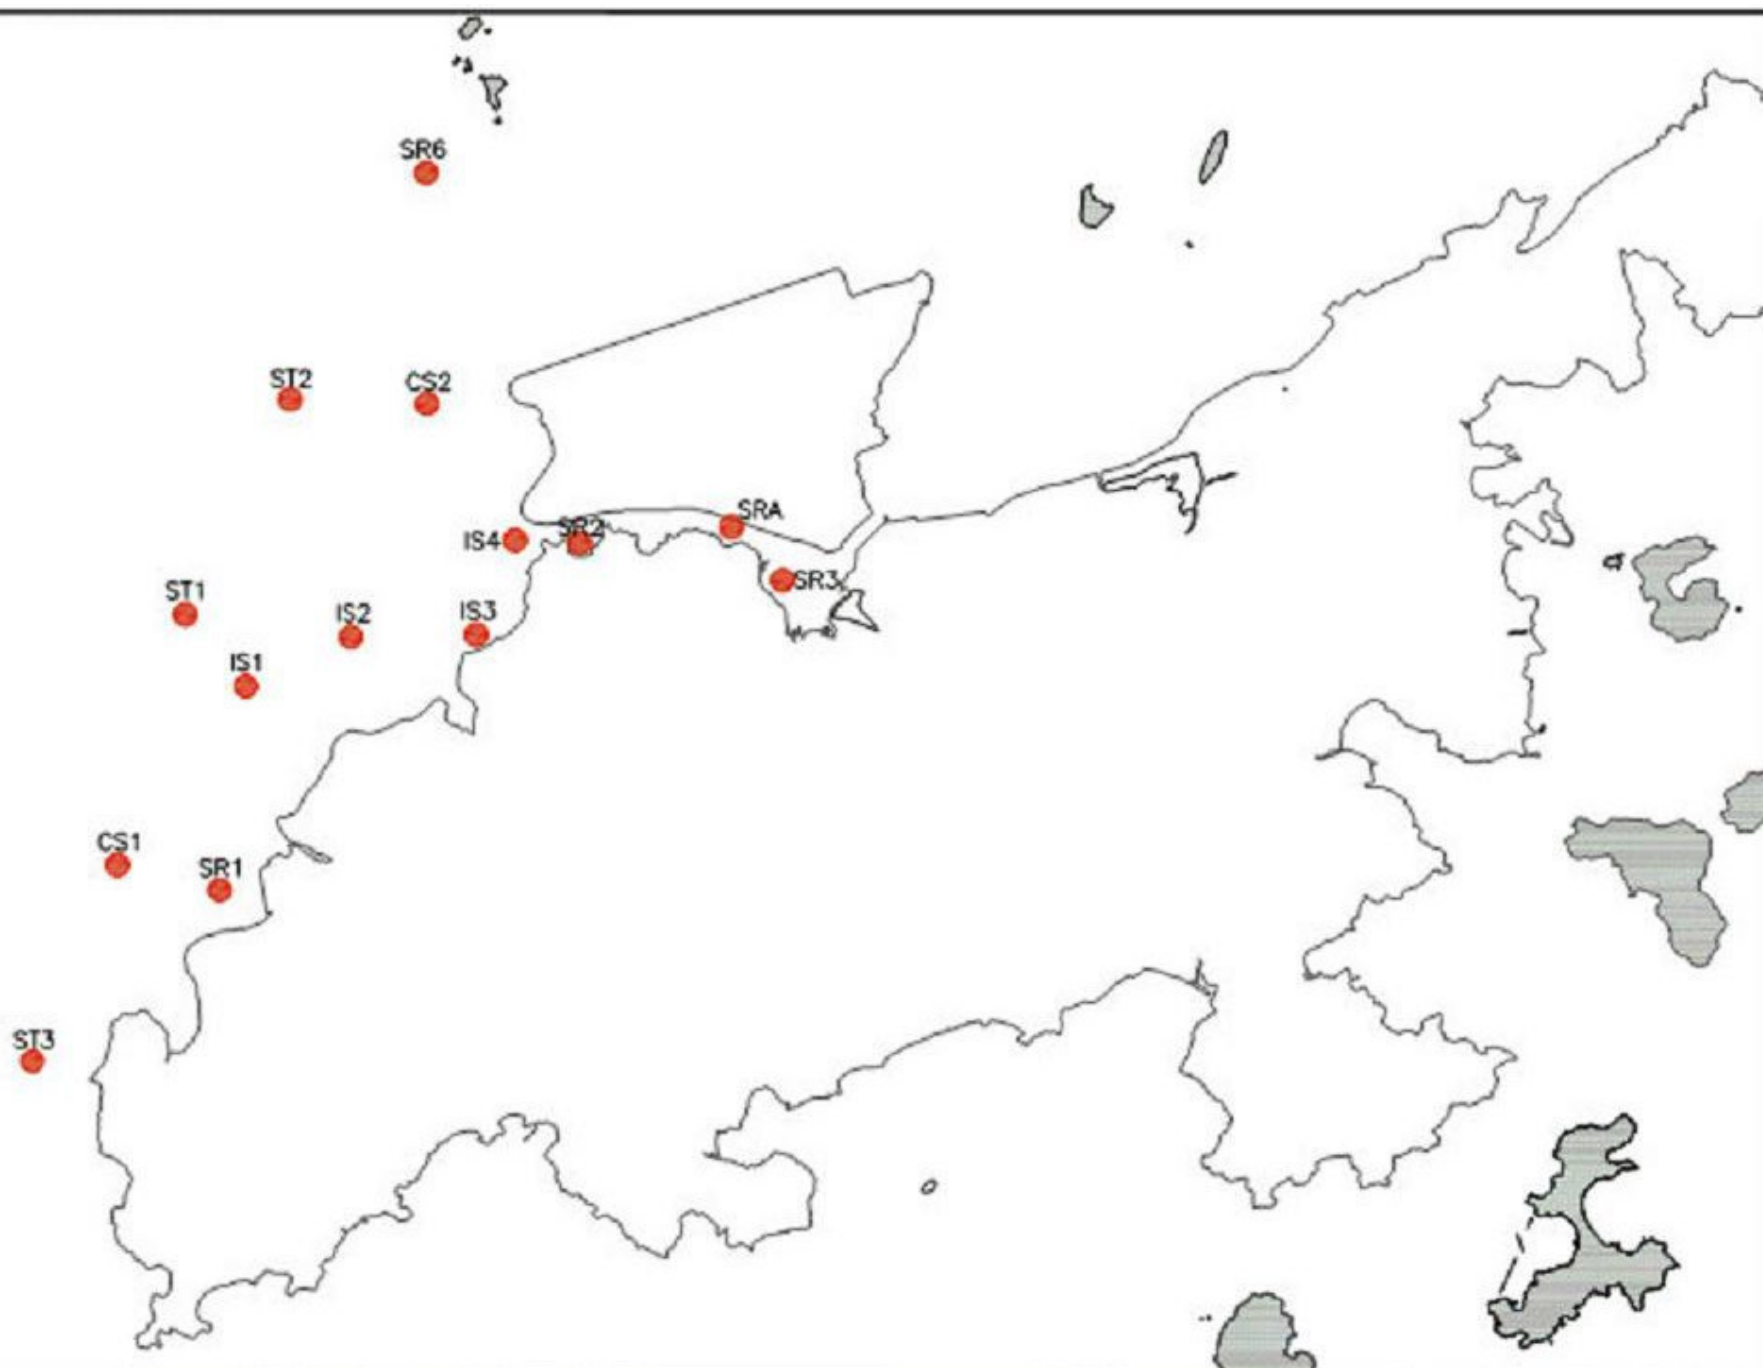


SCALE	N.T.S	DATE	28 Jan 2013
CHECK	PC	DRAWN	IT
PROJECT NO.	MA12014	FIGURE NO.	4
		REV	-

**APPENDIX A
CONSTRUCTION PROGRAMME**



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1608 Start	1608 Finish	DWP01g Start	DWP01g Finish
HKZB Hong Kong Link Road - 3 Months Rolling Programme 1608 (based on DWP01g Programme)								
Project General Submission								
MTTA for existing navigation channel								
PGS1620	Divert marine traffic to permanent navigation channel (P17 to P20)	0	0	0%		29/8/16		25/6/16
PROCUREMENT								
PR1045	Fabrication and delivery the new CH5 x 2nos.	120	1	99%	21/4/16 A	29/8/16*	21/4/16	18/8/16
PR1050	Design Straddle Carriers	150	19	87.33%	8/2/16 A	15/9/16	29/2/16	27/7/16
PR1060	Fabrication Straddle Carriers	90	34	62.22%	13/5/16 A	30/9/16	13/5/16	10/8/16
PR1090	Delivery Straddle Carriers	49	49	0%	28/8/16	15/10/16	16/7/16	14/9/16
PR1100	Assemble Straddle Carriers	30	30	0%	25/10/16	23/11/16	14/9/16	14/10/16

Segment Casting								
Type A Segment								
Segment on Pier (SOP)								
SCA1000	Segment Casting for P0 SOP	12	6	50%	19/8/16 A	20/9/16	1/8/16	12/8/16
SCA1040	Segment Casting for P2 SOP	24	18	25%	22/8/16 A	14/9/16	8/7/16	31/7/16
SCA1060	Segment Casting for P3 SOP	12	6	50%	13/8/16 A	5/9/16	28/7/16	8/8/16
SCA1080	Segment Casting for P4 SOP	12	3	75%	31/7/16 A	30/8/16	16/7/16	27/7/16
Field Segment								
SCA1050	Segment Casting for P2 field segment	25	25	0%	1/11/16	26/11/16	31/10/16	25/11/16
SCA1070	Segment Casting for P3 field segment	25	25	0%	1/11/16	26/11/16	16/10/16	10/11/16
SCA1090	Segment Casting for P4 field segment	25	25	0%	7/10/16	1/11/16	6/10/16	31/10/16
SCA1110	Segment Casting for P5 field segment	25	25	0%	7/10/16	1/11/16	21/9/16	16/10/16
SCA1130	Segment Casting for P6 field segment	25	21	15%	19/8/16 A	7/10/16	11/9/16	6/10/16
SCA1150	Segment Casting for P7 field segment	25	22	12.5%	21/8/16 A	7/10/16	27/8/16	21/9/16
SCA1170	Segment Casting for P8 field segment	25	19	25%	29/7/16 A	16/9/16	17/8/16	11/9/16
SCA1190	Segment Casting for P9 field segment	25	12	52.5%	25/7/16 A	15/9/16	2/8/16	27/8/16
SCA1210	Segment Casting for P10 field segment	25	1	97.5%	18/7/16 A	28/8/16	23/7/16	17/8/16
SCA1230	Segment Casting for P11 field segment	25	7	72.5%	5/7/16 A	3/9/16	8/7/16	2/8/16
SCA2210	Segment Casting for P67 field segment	25	25	0%	29/9/16	24/10/16	15/7/16	8/8/16
Type B Segment								
Field Segment								
SCB1040	Segment Casting for P54 field segment	72	22	69.5%	8/6/16 A	18/9/16	31/5/16	11/8/16
SCB1060	Segment Casting for P55 field segment	72	32	55.6%	7/7/14 A	20/10/16	14/5/15	24/7/15
SCB1080	Segment Casting for P56 special segment	60	42	30.6%	9/7/16 A	14/11/16	4/9/16	2/11/16
Type C Segment								
Field Segment								
SCC1050	Segment Casting for P67 field segment	18	12	33.3%	16/7/16 A	29/9/16	27/6/16	14/7/16
SCC1090	Segment Casting for P74 field segment	36	21	41.7%	13/6/16 A	17/9/16	22/5/16	26/6/16
Type CV Segment								

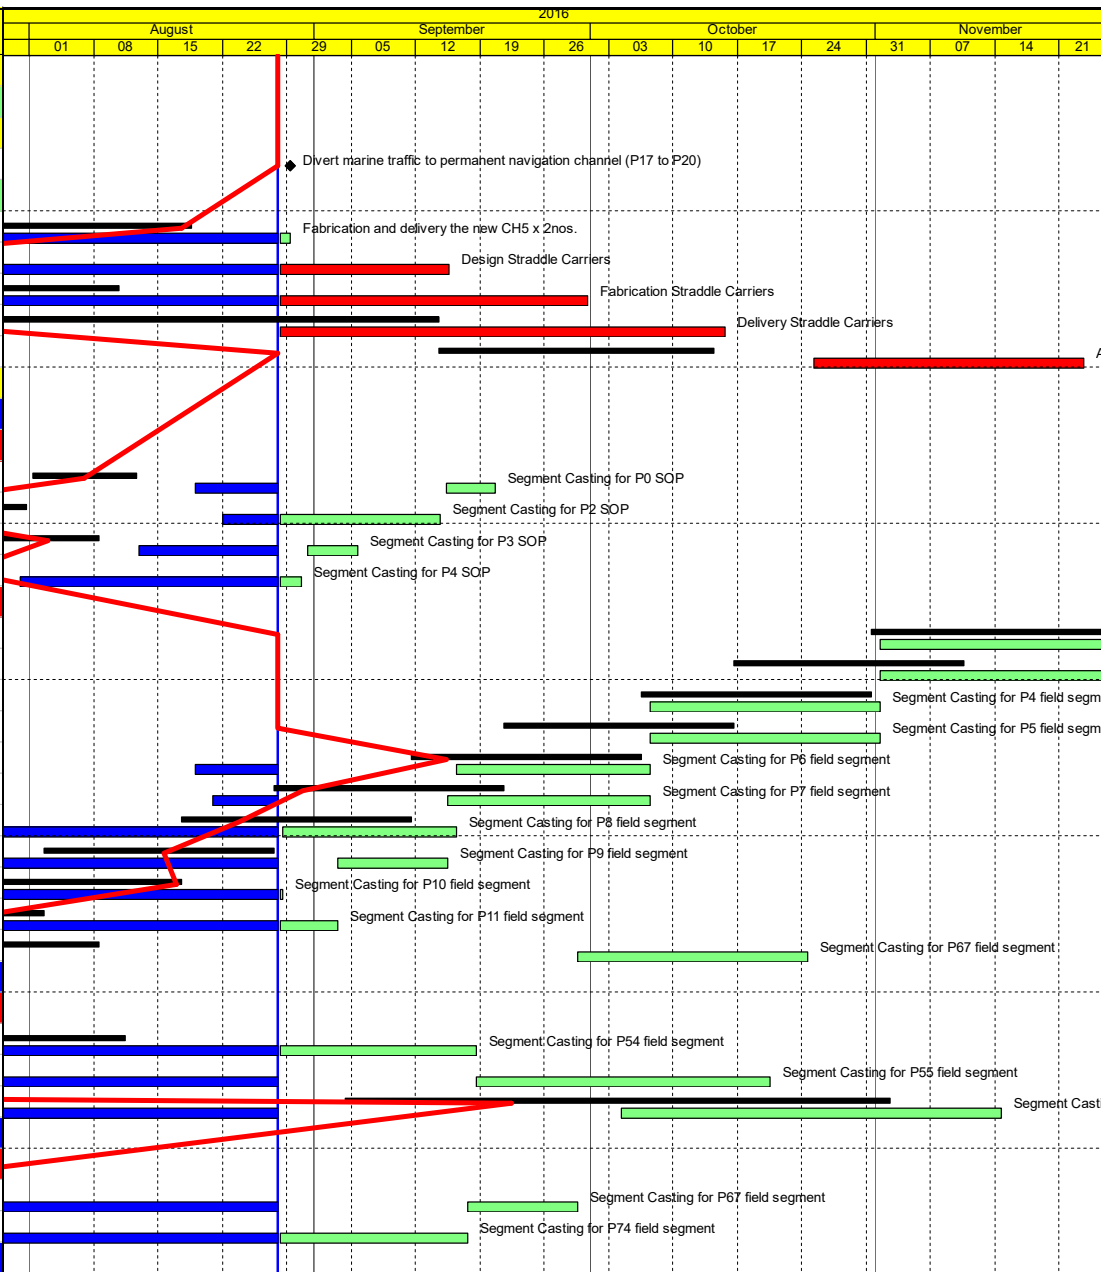

■ Actual Work ■ Critical Remaining Work ■ Remaining Work ◆ Milestone
◆ DWP_01g Milestone ■ DWP_01g Programme

3MRP DWP_01g 1608
 Page 1 of 15

Date	Revision	Checked	Approved
2/9/16	1608 rolling based on DWP01g	Tim	




Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1608 Start	1608 Finish	DWP01g Start	DWP01g Finish	2016																	
									August				September				October				November					
									01	08	15	22	29	05	12	19	26	03	10	17	24	31	07	14	21	
Field Segment																										
SCC1130	Segment Casting for P81 field segment (CV)	60	50	16.7%	6/6/16 A	16/10/16	29/4/16	27/6/16	Segment Casting for P81 field segment (CV)																	
Type CH Segment																										
Segment on Pier (SOP) CPA & CPB																										
ML10 (P68 & P69) 180m span																										
SCH2500	Segment Casting for P69 CPB (MSOP)	14	14	0%	28/8/16	10/9/16	31/5/16	13/6/16	Segment Casting for P69 CPB (MSOP)																	
Type CH1 Segment (CH1 to CH6)																										
ML10 (P68 & P69) 180m span																										
SCH2390	Segment Casting for P69L CH1 to CH6 (MCH1)	24	12	50%	15/8/16 A	8/9/16	21/7/16	13/8/16	Segment Casting for P69L CH1 to CH6 (MCH1)																	
SCH2440	Segment Casting for P69R CH1' to CH6' (MCH1)	24	24	0%	9/9/16	2/10/16	14/8/16	6/9/16	Segment Casting for P69R CH1' to CH6' (MCH1)																	
SCH2510	Segment Casting for P69R CH1 to CH6 (MCH1)	24	24	0%	1/9/16	25/9/16	21/7/16	13/8/16	Segment Casting for P69R CH1 to CH6 (MCH1)																	
SCH2560	Segment Casting for P69L CH1' to CH6' (MCH1)	24	24	0%	25/9/16	19/10/16	14/8/16	6/9/16	Segment Casting for P69L CH1' to CH6' (MCH1)																	
SCH2790	Segment Casting for P68L CH1' to CH6' (MCH1)	24	4	83.3%	8/8/16 A	1/9/16	27/6/16	20/7/16	Segment Casting for P68L CH1' to CH6' (MCH1)																	
Type CH2 Segment (CH7 to CH10)																										
ML10 (P68 & P69) 180m span																										
SCH2400	Segment Casting for P69L CH7 to CH10 (MCH2)	20	20	0%	17/10/16	5/11/16	19/9/16	8/10/16	Segment Casting for P69L CH7 to CH10 (MCH2)																	
SCH2450	Segment Casting for P69R CH7' to CH10' (MCH2)	20	20	0%	6/11/16	25/11/16	9/10/16	28/10/16	Segment Casting for P69R CH7' to CH10' (MCH2)																	
SCH2630	Segment Casting for P68L CH7 to CH10 (MCH2)	20	20	0%	28/8/16	16/9/16	27/6/16	16/7/16	Segment Casting for P68L CH7 to CH10 (MCH2)																	
SCH2750	Segment Casting for P68R CH7 to CH10 (MCH2)	20	10	50%	24/8/16 A	26/9/16	10/8/16	29/8/16	Segment Casting for P68R CH7 to CH10 (MCH2)																	
SCH2800	Segment Casting for P68L CH7' to CH10' (MCH2)	20	20	0%	27/9/16	16/10/16	30/8/16	18/9/16	Segment Casting for P68L CH7' to CH10' (MCH2)																	
Type CH3 Segment (CH11 to CH15)																										
ML10 (P68 & P69) 180m span																										
SCH2640	Segment Casting for P68L CH11 to CH15 (MCH3)	20	20	0%	17/9/16	6/10/16	19/7/16	7/8/16	Segment Casting for P68L CH11 to CH15 (MCH3)																	
SCH2690	Segment Casting for P68R CH11' to CH15' (MCH3)	20	20	0%	7/10/16	26/10/16	10/8/16	29/8/16	Segment Casting for P68R CH11' to CH15' (MCH3)																	
SCH2760	Segment Casting for P68R CH11 to CH15 (MCH3)	20	20	0%	27/10/16	15/11/16	30/8/16	18/9/16	Segment Casting for P68R CH11 to CH15 (MCH3)																	
SCH2810	Segment Casting for P68L CH11' to CH15' (MCH3)	20	20	0%	16/11/16	5/12/16	19/9/16	8/10/16	Segment Casting for P68L CH11' to CH15' (MCH3)																	
Type CH4 Segment (CH16 to CH19)																										
ML10 (P68 & P69) 180m span																										
SCH2420	Segment Casting for P69L CH16 to CH19 (MCH4)	20	5	75%	17/8/16 A	21/9/16	26/10/16	14/11/16	Segment Casting for P69L CH16 to CH19 (MCH4)																	
SCH2470	Segment Casting for P69R CH16' to CH19' (MCH4)	20	20	0%	22/9/16	11/10/16	15/11/16	4/12/16	Segment Casting for P69R CH16' to CH19' (MCH4)																	
SCH2540	Segment Casting for P69R CH16 to CH19 (MCH4)	20	20	0%	7/10/16	26/10/16	26/10/16	14/11/16	Segment Casting for P69R CH16 to CH19 (MCH4)																	
SCH2590	Segment Casting for P69L CH16' to CH19' (MCH4)	20	20	0%	27/10/16	15/11/16	15/11/16	4/12/16	Segment Casting for P69L CH16' to CH19' (MCH4)																	
SCH2820	Segment Casting for P68L CH16' to CH19' (MCH4)	20	20	0%	28/8/16	16/9/16	27/8/16	15/9/16	Segment Casting for P68L CH16' to CH19' (MCH4)																	
ML12 (P75 to P77) 165m span																										
SCH2930	Segment Casting for P75R CH13' to CH16' (MCH4)	20	20	0%	28/8/16	16/9/16	6/10/16	25/10/16	Segment Casting for P75R CH13' to CH16' (MCH4)																	
SCH3040	Segment Casting for P75L CH13' to CH16' (MCH4)	20	20	0%	17/9/16	6/10/16	6/10/16	25/10/16	Segment Casting for P75L CH13' to CH16' (MCH4)																	
Type CH5 Segment (CH20 to CH25)																										
ML10 (P68 & P69) 180m span																										
SCH2430	Segment Casting for P69L CH20 to CH25 (MCH5)	21	21	0%	7/11/16	28/11/16	19/11/16	9/12/16	Segment Casting for P69L CH20 to CH25 (MCH5)																	

- █ Actual Work
- █ Critical Remaining Work
- █ Remaining Work
- ◆ Milestone
- ◆ Milestone
- ◇ DWP_01g Milestone
- ◆ Milestone
- █ DWP_01g Programme

3MRP DWP_01g 1608

Date	Revision	Checked	Approved
2/9/16	1608 rolling based on DWP01g	Tim	

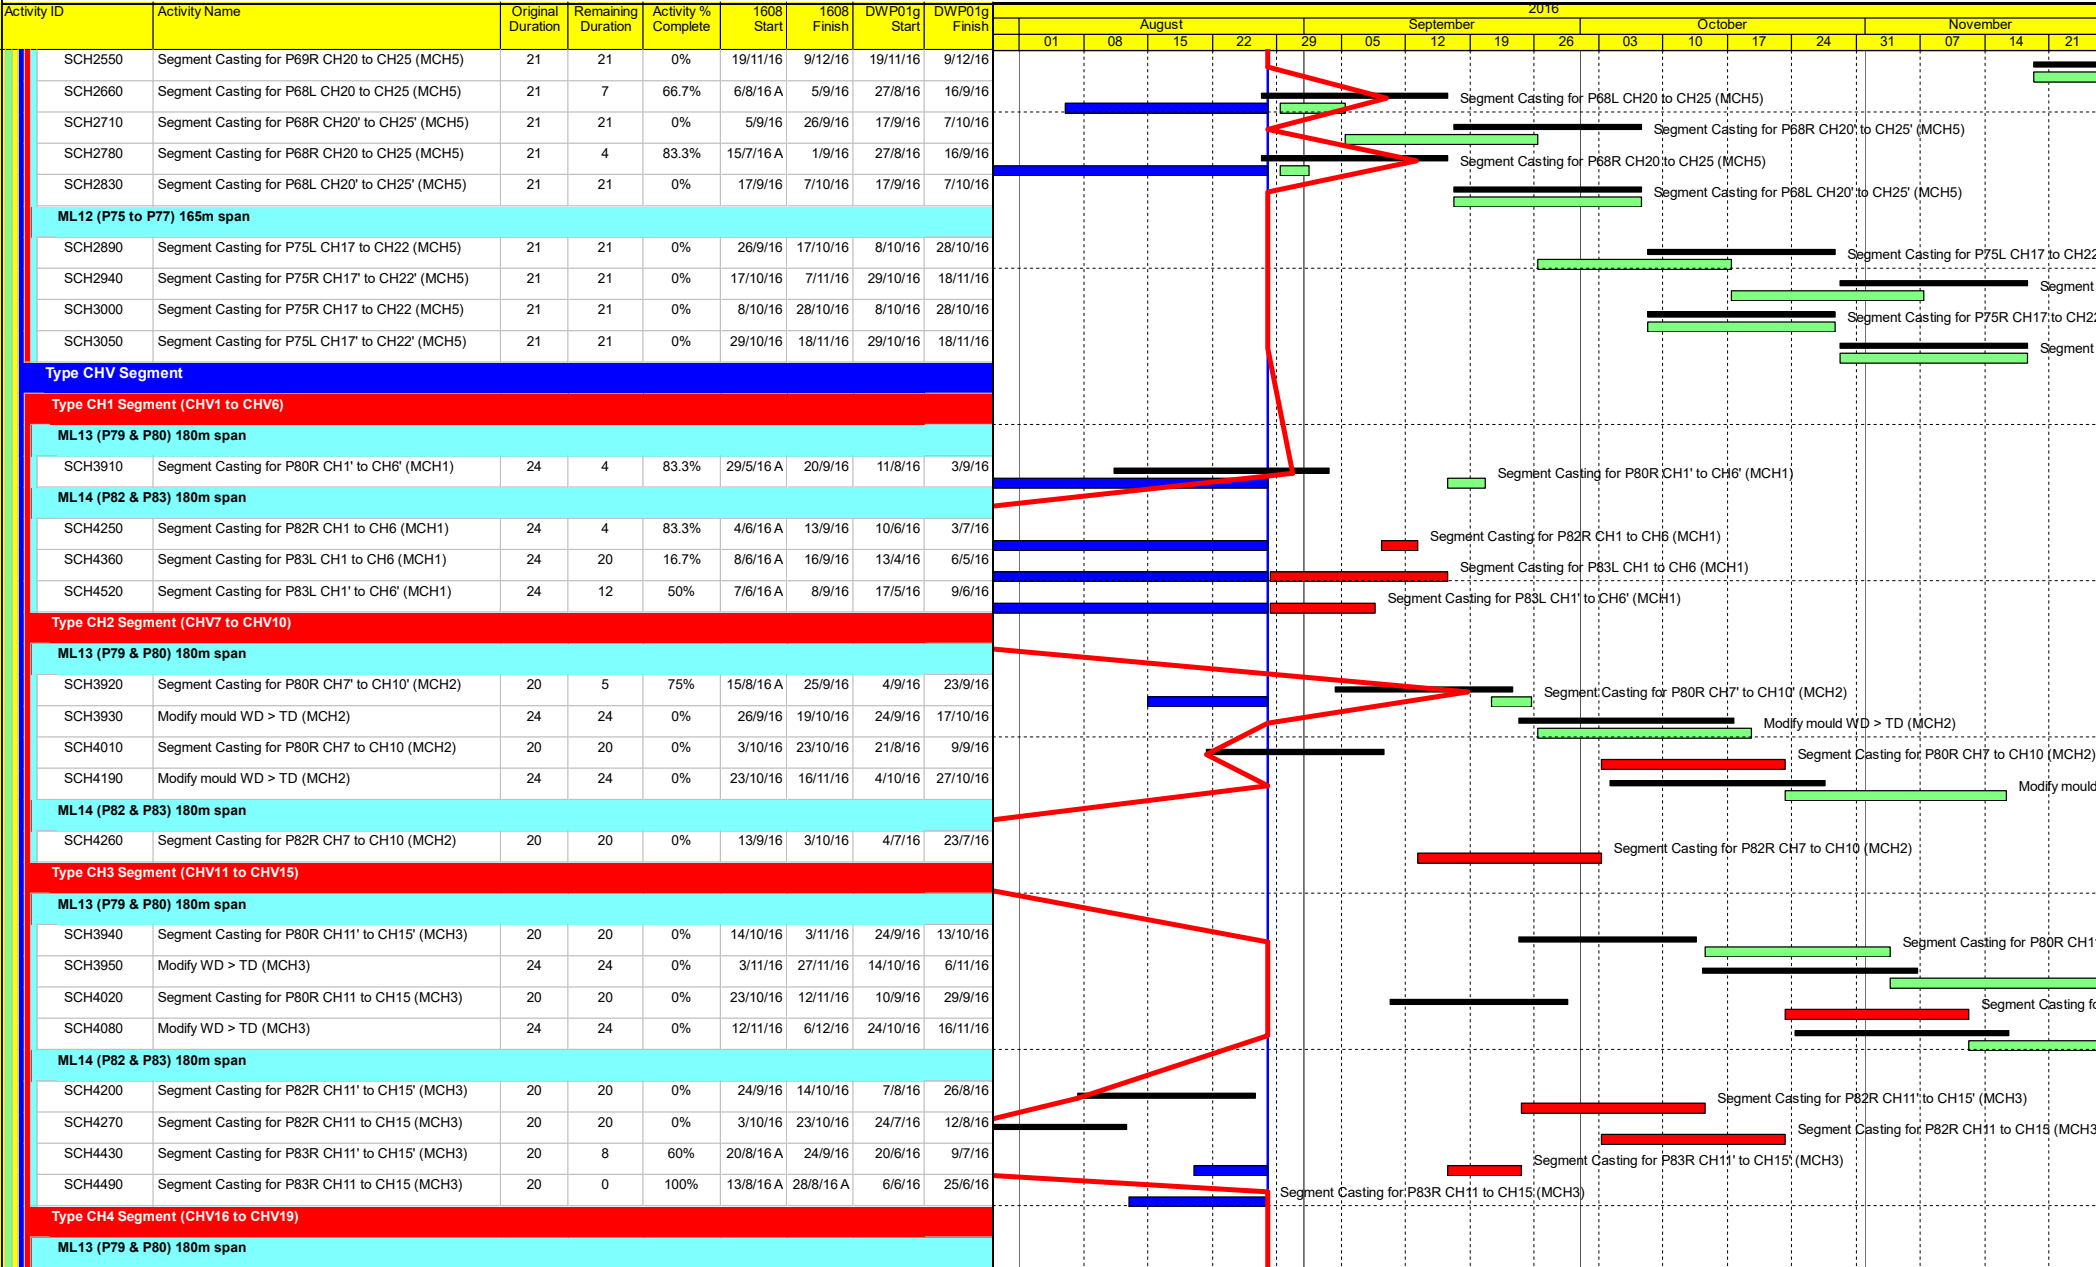

Actual Work	Critical Remaining Work	DWP_01g Milestone	3MRP DWP_01g 1608			Date	Revision	Checked	Approved
Remaining Work	Milestone	DWP_01g Programme	Page 3 of 15			2/9/16	1608 rolling based on DWP01g	Tim	




Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1608 Start	1608 Finish	DWP01g Start	DWP01g Finish	2016																				
									August				September				October				November								
									01	08	15	22	29	05	12	19	26	03	10	17	24	31	07	14	21				
SCH3960	Segment Casting for P80R CH16' to CH19' (MCH4)	20	20	0%	8/11/16	28/11/16	14/10/16	2/11/16																					
SCH4030	Segment Casting for P80R CH16' to CH19' (MCH4)	20	20	0%	12/11/16	2/12/16	23/10/16	11/11/16																					
ML14 (P82 & P83) 180m span																													
SCH4150	Segment Casting for P82L CH16' to CH19' (MCH4)	20	5	75%	4/8/16 A	19/10/16	3/8/16	22/8/16																					
SCH4210	Segment Casting for P82R CH16' to CH19' (MCH4)	20	20	0%	19/10/16	8/11/16	27/8/16	15/9/16																					
SCH4280	Segment Casting for P82R CH16' to CH19' (MCH4)	20	20	0%	23/10/16	12/11/16	13/9/16	2/10/16																					
SCH4440	Segment Casting for P83R CH16' to CH19' (MCH4)	20	20	0%	24/9/16	14/10/16	10/7/16	29/7/16																					
SCH4500	Segment Casting for P83R CH16' to CH19' (MCH4)	20	20	0%	28/8/16	16/9/16	4/8/16	23/8/16																					
SCH4550	Segment Casting for P83L CH16' to CH19' (MCH4)	20	10	50%	23/8/16 A	26/9/16	24/8/16	12/9/16																					
Type CH5 Segment (CHV20 to CHV25)																													
ML13 (P79 & P80) 180m span																													
SCH3720	Segment Casting for P79R CH20' to CH25' (MCH5)	21	21	0%	28/8/16	17/9/16	3/8/16	23/8/16																					
SCH3840	Segment Casting for P79L CH20' to CH25' (MCH5)	21	4	83.3%	17/8/16 A	3/18/16	5/8/16	25/8/16																					
SCH3900	Segment Casting for P80L CH20 to CH25 (MCH5)	21	21	0%	8/11/16	29/11/16	10/10/16	30/10/16																					
ML14 (P82 & P83) 180m span																													
SCH4160	Segment Casting for P82L CH20 to CH25 (MCH5)	21	21	0%	19/10/16	9/11/16	24/8/16	13/9/16																					
SCH4220	Segment Casting for P82R CH20' to CH25' (MCH5)	21	21	0%	9/11/16	30/11/16	16/9/16	6/10/16																					
SCH4290	Segment Casting for P82R CH20 to CH25 (MCH5)	21	21	0%	12/11/16	3/12/16	3/10/16	23/10/16																					
SCH4400	Segment Casting for P83L CH20 to CH25 (MCH5)	21	21	0%	16/9/16	7/10/16	24/8/16	14/9/16																					
SCH4450	Segment Casting for P83R CH20' to CH25' (MCH5)	21	21	0%	14/10/16	4/11/16	14/9/16	5/10/16																					
SCH4510	Segment Casting for P83R CH20 to CH25 (MCH5)	21	21	0%	17/9/16	7/10/16	24/8/16	13/9/16																					
SCH4560	Segment Casting for P83L CH20' to CH25' (MCH5)	21	21	0%	8/10/16	28/10/16	14/9/16	4/10/16																					
LAND VIADUCT																													
ML19																													
DECK FINISHING WORKS																													
UTILITY TROUGH & ROAD BARRIER																													
M19F_1020	Utility trough, road barrier and firemain installation for ML19	29	17	40%	14/6/16 A	23/9/16	23/5/16	29/6/16																					
CIVIL PROVISION FOR TCSS																													
M19F_1060	Install sign gantry GW13	10	8	25%	12/8/16 A	5/10/16	30/6/16	14/7/16																					
M19F_1070	Install sign gantry GE15	10	8	25%	12/8/16 A	17/10/16	15/7/16	28/7/16																					
M19F_1080	Install pole for vehicle detector VD/73/D	3	3	0%	17/10/16	21/10/16	29/7/16	1/8/16																					
M19F_1090	Remain civil provisions for TCSS ML19	29	20	30%	22/8/16 A	24/10/16	30/6/16	10/8/16																					
E&M AND ROAD FINISHING WORKS																													
M19L_2020	Drainage works for ML19	19	19	0%	23/9/16	22/10/16	30/6/16	27/7/16																					
M19L_2030	Road surface ML19L/C/R	21	21	0%	24/10/16*	17/11/16	3/10/16	31/10/16																					
ML18																													
DECK FINISHING WORKS																													
UTILITY TROUGH & ROAD BARRIER																													
ML18F_1020	Utility trough, road barrier and firemain installation for ML18	30	16	48%	28/6/16 A	17/10/16	30/6/16	11/8/16																					

- Actual Work
- Critical Remaining Work
- Remaining Work
- Milestone
- DWP_01g Milestone
- DWP_01g Programme

3MRP DWP_01g 1608


Date	Revision	Checked	Approved
2/9/16	1608 rolling based on DWP01g	Tim	

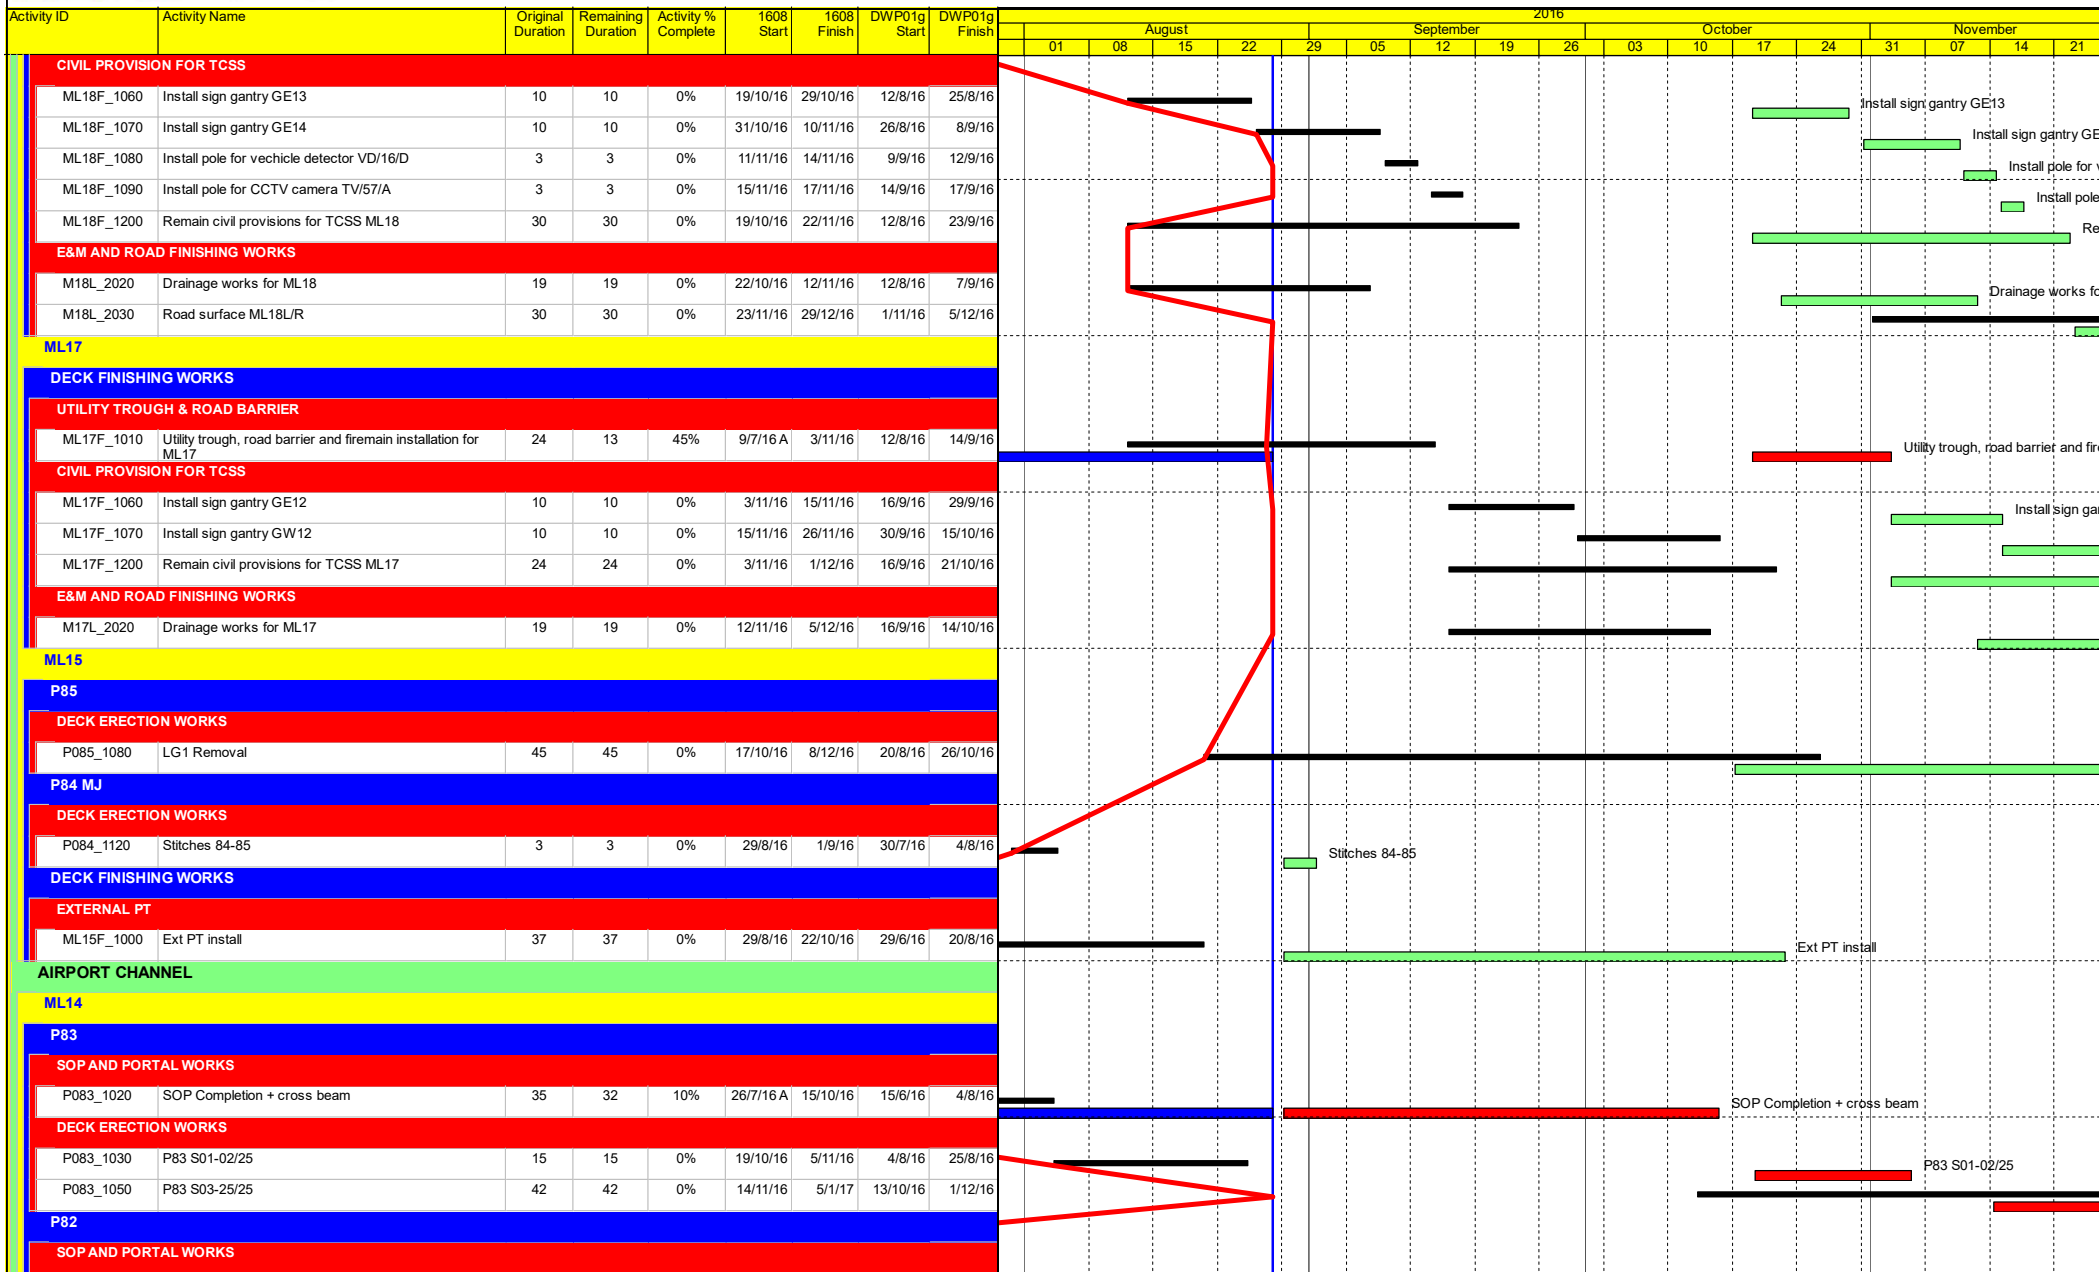

█ Actual Work █ Critical Remaining Work █ Remaining Work
◆ Milestone ◆ Milestone ◆ Milestone
◇ DWP_01g Milestone ◇ DWP_01g Programme

3MRP DWP_01g 1608

Date	Revision	Checked	Approved
2/9/16	1608 rolling based on DWP01g	Tim	

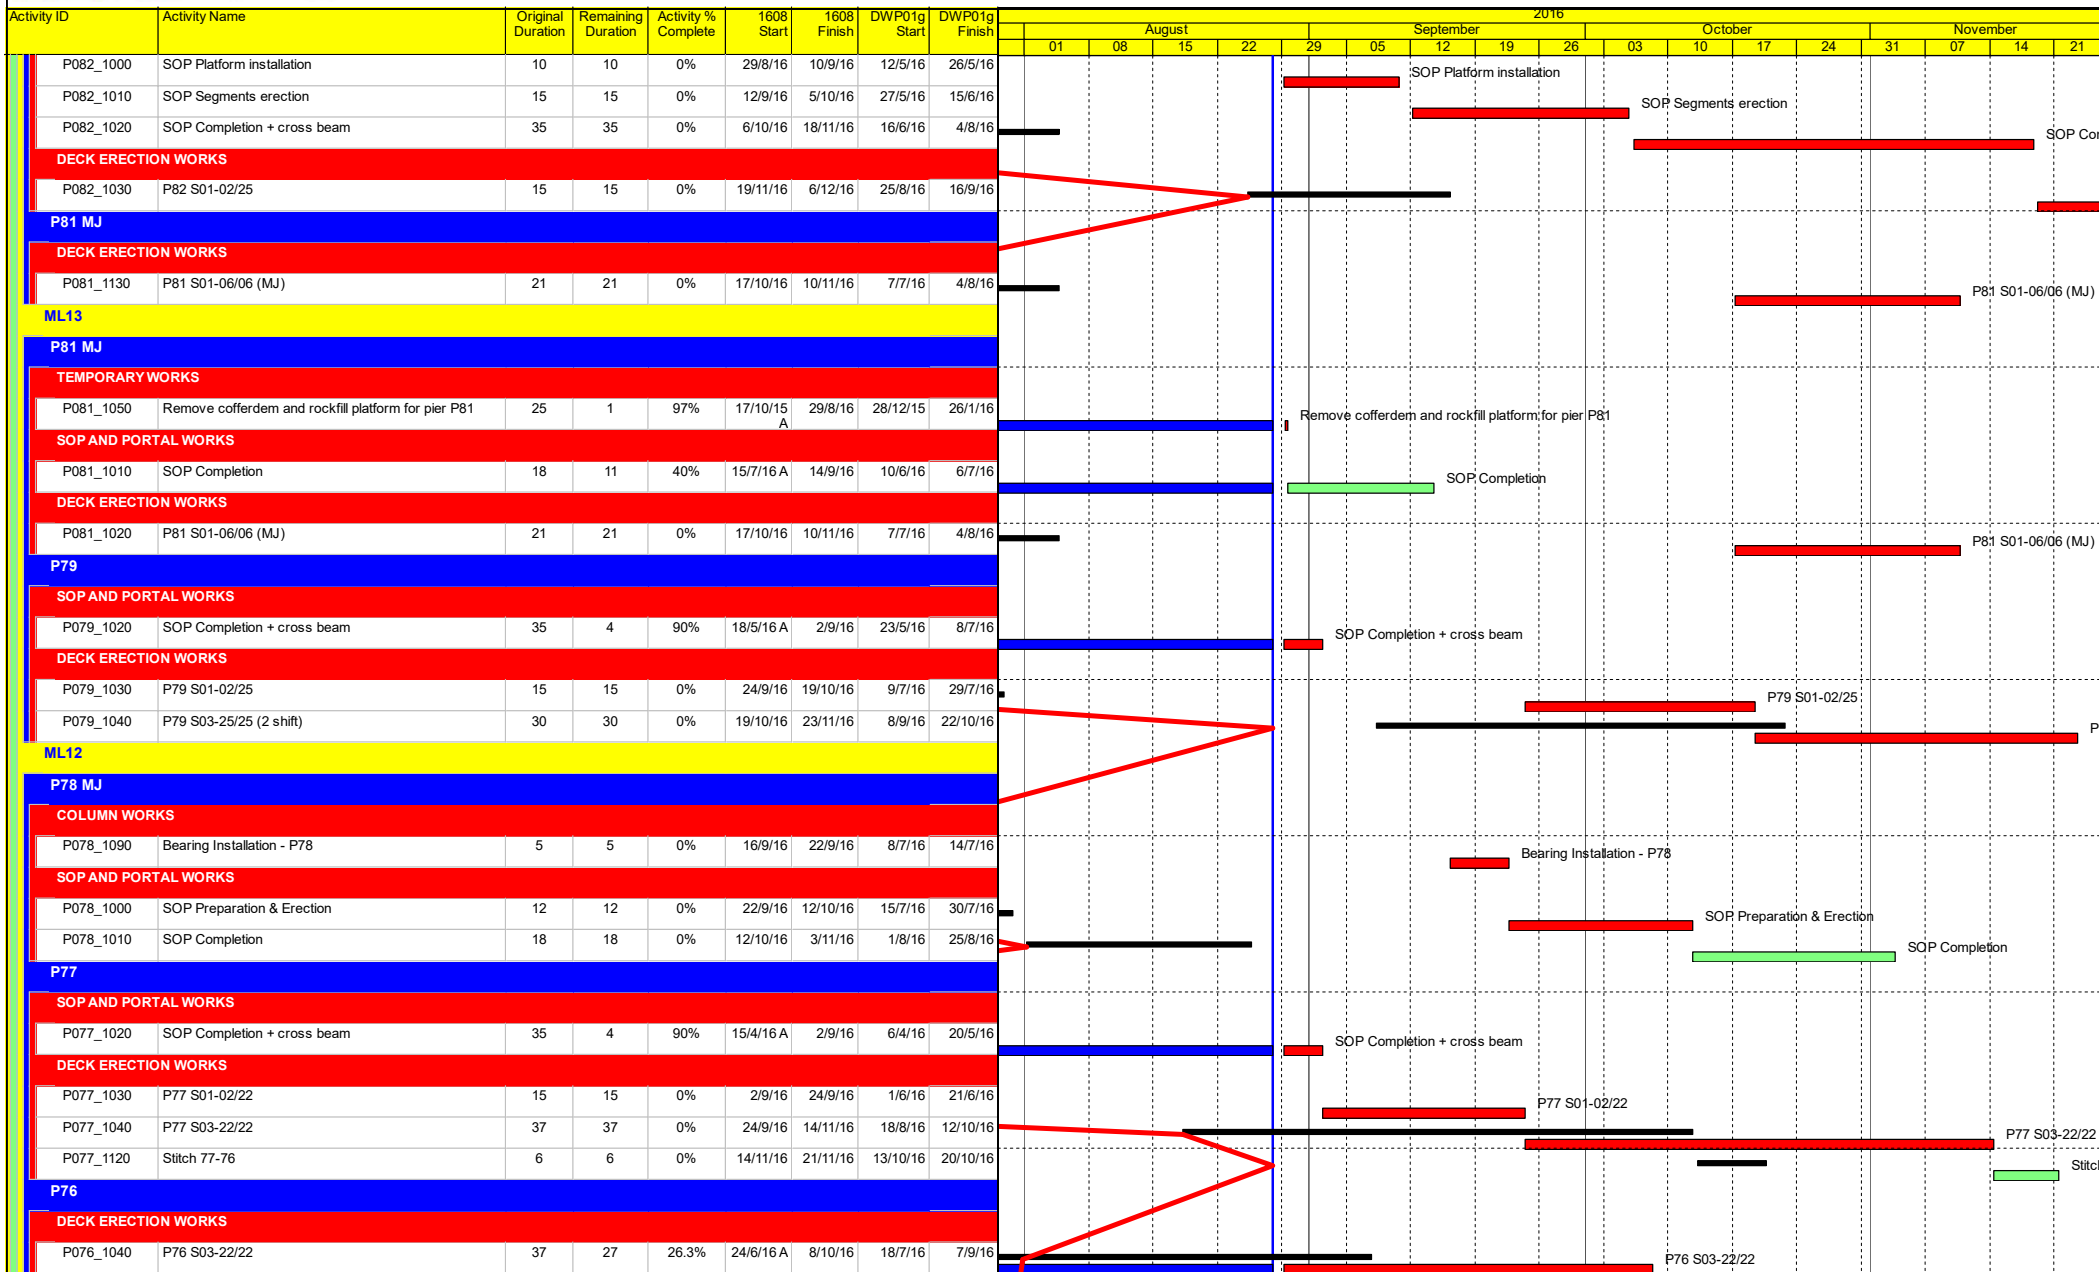

█ Actual Work
 █ Critical Remaining Work
 ◆ ◆ DWP_01g Milestone
 ■ ■ DWP_01g Programme

█ Remaining Work
 ◆ Milestone

3MRP DWP_01g 1608

Date	Revision	Checked	Approved
2/9/16	1608 rolling based on DWP01g	Tim	

Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1608 Start	1608 Finish	DWP01g Start	DWP01g Finish	2016																				
									August				September				October				November								
									01	08	15	22	29	05	12	19	26	03	10	17	24	31	07	14	21				
P75									TEMPORARY WORKS																				
P075_1060	Remove cofferdem for pier P75	18	18	0%	29/8/16	23/9/16	30/7/16	24/8/16	Remove cofferdem for pier P75																				
SOP AND PORTAL WORKS																													
P075_1000	SOP Platform installation	10	10	0%	23/9/16	8/10/16	24/8/16	7/9/16	SOP Platform installation																				
P075_1010	SOP Segments erection	15	15	0%	8/10/16	29/10/16	7/9/16	29/9/16	SOP Segments erection																				
P075_1020	SOP Completion	35	35	0%	29/10/16	9/12/16	29/9/16	15/11/16	SOP Completion																				
ML11																													
P74 MJ									COLUMN WORKS																				
P074_1130	Bearing Installation - P74	5	5	0%	29/8/16	3/9/16	21/6/16	25/6/16	Bearing Installation - P74																				
SOP AND PORTAL WORKS																													
P074_1000	SOP Preparation & Erection	12	12	0%	3/9/16	22/9/16	28/6/16	14/7/16	SOP Preparation & Erection																				
P074_1010	SOP Completion	18	18	0%	22/9/16	20/10/16	15/7/16	8/8/16	SOP Completion																				
P73									DECK ERECTION WORKS																				
P073_1040	P73 S03-22/22	37	11	70%	25/7/16 A	14/9/16	25/6/16	17/8/16	P73 S03-22/22																				
P073_1120	Stitch 73-72	6	6	0%	14/9/16	23/9/16	18/8/16	25/8/16	Stitch 73-72																				
P72									DECK ERECTION WORKS																				
P072_1120	Stitch 72-71	6	6	0%	17/9/16	26/9/16	18/7/16	25/7/16	Stitch 72-71																				
P71									DECK ERECTION WORKS																				
P071_1110	P71 S03-22/22	58	13	77.5%	24/4/16 A	17/9/16	19/4/16	6/7/16	P71 S03-22/22																				
P70 MJ									DECK ERECTION WORKS																				
P070_1120	P70 S01-06/06 (MJ)	21	21	0%	11/11/16	5/12/16	5/8/16	2/9/16	P70 S01-06/06 (MJ)																				
DECK FINISHING WORKS																													
EXTERNAL PT																													
ML11F_1000	Ext PT install	56	56	0%	12/11/16	19/1/17	6/8/16	26/10/16	Ext PT install																				
ML10																													
P70 MJ									SOP AND PORTAL WORKS																				
P070_1010	SOP Completion	18	16	10%	23/8/16 A	22/9/16	28/6/16	22/7/16	SOP Completion																				
DECK ERECTION WORKS																													
P070_1020	P70 S01-06/06 (MJ)	21	21	0%	11/11/16	5/12/16	5/8/16	2/9/16	P70 S01-06/06 (MJ)																				
P69									TEMPORARY WORKS																				
P069_1120	Remove cofferdem for pier P69	18	18	0%	29/8/16	23/9/16	28/4/16	24/5/16	Remove cofferdem for pier P69																				

█ Actual Work █ Critical Remaining Work █ Remaining Work
◆ Milestone ◆ Milestone ◆ Milestone
 DWP_01g Programme

3MRP DWP_01g 1608

Date	Revision	Checked	Approved
2/9/16	1608 rolling based on DWP01g	Tim	

Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1608 Start	1608 Finish	DWP01g Start	DWP01g Finish	2016																				
									August				September					October				November							
									01	08	15	22	29	05	12	19	26	03	10	17	24	31	07	14	21				
SOP AND PORTAL WORKS																													
P069_1000	SOP Platform installation	10	10	0%	15/10/16	28/10/16	4/8/16	18/8/16	[Gantt bar: 08/08 to 15/08]																				
P069_1010	SOP Segments erection	15	15	0%	28/10/16	15/11/16	18/8/16	8/9/16	[Gantt bar: 08/09 to 15/09]																				
P069_1020	SOP Completion	35	35	0%	15/11/16	28/12/16	8/9/16	29/10/16	[Gantt bar: 08/10 to 15/10]																				
P68																													
SOP AND PORTAL WORKS																													
P068_1020	SOP Platform installation	10	3	75%	12/8/16 A	1/9/16	21/6/16	6/7/16	[Gantt bar: 08/08 to 15/08]																				
P068_1030	SOP Segments erection	10	10	0%	1/9/16	14/9/16	6/7/16	27/7/16	[Gantt bar: 08/08 to 15/08]																				
P068_1040	SOP Completion	26	26	0%	16/9/16	24/10/16	27/7/16	14/9/16	[Gantt bar: 08/08 to 15/08]																				
DECK ERECTION WORKS																													
P068_1050	P68 S01-02/25	15	15	0%	25/10/16	10/11/16	14/9/16	7/10/16	[Gantt bar: 08/10 to 15/10]																				
P068_1060	P68 S03-25/25 (Learning)	43	43	0%	23/11/16	16/1/17	14/10/16	5/12/16	[Gantt bar: 08/10 to 15/10]																				
P67 MJ																													
DECK ERECTION WORKS																													
P067_1110	P67 - P68 S01-06/06 (MJ)	21	21	0%	17/11/16	12/12/16	7/10/16	4/11/16	[Gantt bar: 08/10 to 15/10]																				
WESTERN WATER (ML07 TO ML09)																													
ML9																													
P67 MJ																													
COLUMN WORKS																													
P067_1100	Bearing Installation - P67	5	5	0%	5/10/16	12/10/16	25/7/16	30/7/16	[Gantt bar: 08/10 to 15/10]																				
SOP AND PORTAL WORKS																													
P067_1000	SOP Preparation & Erection	12	12	0%	12/10/16	27/10/16	1/8/16	17/8/16	[Gantt bar: 08/10 to 15/10]																				
P067_1010	SOP Completion	18	18	0%	27/10/16	17/11/16	18/8/16	10/9/16	[Gantt bar: 08/10 to 15/10]																				
DECK ERECTION WORKS																													
P067_1020	P67 - P66 S01-06/10 (MJ)	21	21	0%	17/11/16	12/12/16	7/10/16	4/11/16	[Gantt bar: 08/10 to 15/10]																				
P66 SB																													
DECK ERECTION WORKS																													
P066_1110	Stitch 66-65	3	3	0%	29/8/16*	1/9/16	5/4/16	7/4/16	[Gantt bar: 08/10 to 15/10]																				
P65 SB																													
DECK ERECTION WORKS																													
P065_1100	Stitch 65-64	3	3	0%	2/9/16	5/9/16	8/4/16	11/4/16	[Gantt bar: 08/10 to 15/10]																				
P64																													
DECK ERECTION WORKS																													
P064_1090	Stitch 64-63	3	3	0%	7/9/16	9/9/16	12/4/16	14/4/16	[Gantt bar: 08/10 to 15/10]																				
P63																													
DECK ERECTION WORKS																													
P063_1120	Stitch 63-62	3	3	0%	10/9/16	14/9/16	12/5/16	18/5/16	[Gantt bar: 08/10 to 15/10]																				
P62																													
DECK ERECTION WORKS																													

■ Actual Work
 ■ Critical Remaining Work
 ■ Remaining Work
 ◆ Milestone
 ◆ DWP_01g Milestone
 ■ DWP_01g Programme

3MRP DWP_01g 1608

Date	Revision	Checked	Approved
2/9/16	1608 rolling based on DWP01g	Tim	




Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1608 Start	1608 Finish	DWP01g Start	DWP01g Finish	2016																				
									August				September				October				November								
									01	08	15	22	29	05	12	19	26	03	10	17	24	31	07	14	21				
P062_1120	Stitch 62-61	3	3	0%	21/9/16	24/9/16	19/9/16	22/9/16																					
P61																													
DECK ERECTION WORKS																													
P061_1110	Stitch 61-60	3	3	0%	18/11/16	21/11/16	31/10/16	2/11/16																					
P60 SB (Portal)																													
DECK ERECTION WORKS																													
P060_1080	P60 S01-03/10	30	30	0%	29/8/16	13/10/16	17/6/16	3/9/16																					
P060_1090	P60-P61 S04-10/10 L	28	28	0%	14/10/16	16/11/16	19/9/16	28/10/16																					
P060_1100	P60-P59 S04-10/10 L	28	28	0%	14/10/16	16/11/16	19/9/16	28/10/16																					
P060_1110	P60-P59 S04-10/10 RL	28	28	0%	14/10/16	16/11/16	19/9/16	28/10/16																					
P060_1120	P60-P61 S04-10/10 R	28	28	0%	15/10/16	17/11/16	21/9/16	29/10/16																					
P060_1130	P60-P59 S04-10/10 R	28	28	0%	15/10/16	17/11/16	21/9/16	29/10/16																					
P060_1140	P60-P59 S04-10/10 RR	28	28	0%	15/10/16	17/11/16	21/9/16	29/10/16																					
P59 MJ																													
DECK ERECTION WORKS																													
P059_1190	P59 - P60 S10/10 (MJ)	6	6	0%	18/11/16	24/11/16	31/10/16	5/11/16																					
P059_1200	Stitch 59-60	3	3	0%	25/11/16	28/11/16	7/11/16	9/11/16																					
ML8																													
P59 MJ																													
DECK ERECTION WORKS																													
MAIN DECK																													
P059_1210	Stitch 59-58	3	3	0%	24/9/16	29/9/16	29/9/16	3/10/16																					
P58																													
DECK ERECTION WORKS																													
MAIN DECK																													
P058_1150	Stitch 58-57	3	3	0%	16/9/16	19/9/16	22/7/16	25/7/16																					
P57																													
SOP AND PORTAL WORKS																													
TURNAROUND																													
P057_1030	Prepare works for precast SOP P57N/S (Turnaround Facility) - 2 nos.	11	11	0%	7/11/16	19/11/16	17/11/16	29/11/16																					
P057_1040	Install precast SOP P57N/S (Turnaround Facility) - 2 nos.	3	3	0%	19/11/16	23/11/16	30/11/16	2/12/16																					
P057_1050	Insitu works for SOP P57N/S (Turnaround Facility) - 2 nos.	14	14	0%	23/11/16	9/12/16	3/12/16	19/12/16																					
DECK ERECTION WORKS																													
MAIN DECK																													
P057_1150	Stitch 57-56	3	3	0%	10/9/16	14/9/16	24/6/16	28/6/16																					
P56																													
DECK ERECTION WORKS																													
MAIN DECK																													
P056_1190	Stitch 56-55	3	3	0%	7/9/16	9/9/16	30/5/16	1/6/16																					

- Actual Work
- Critical Remaining Work
- DWP_01g Milestone
- Remaining Work
- Milestone
- DWP_01g Programme

3MRP DWP_01g 1608

Date	Revision	Checked	Approved
2/9/16	1608 rolling based on DWP01g	Tim	

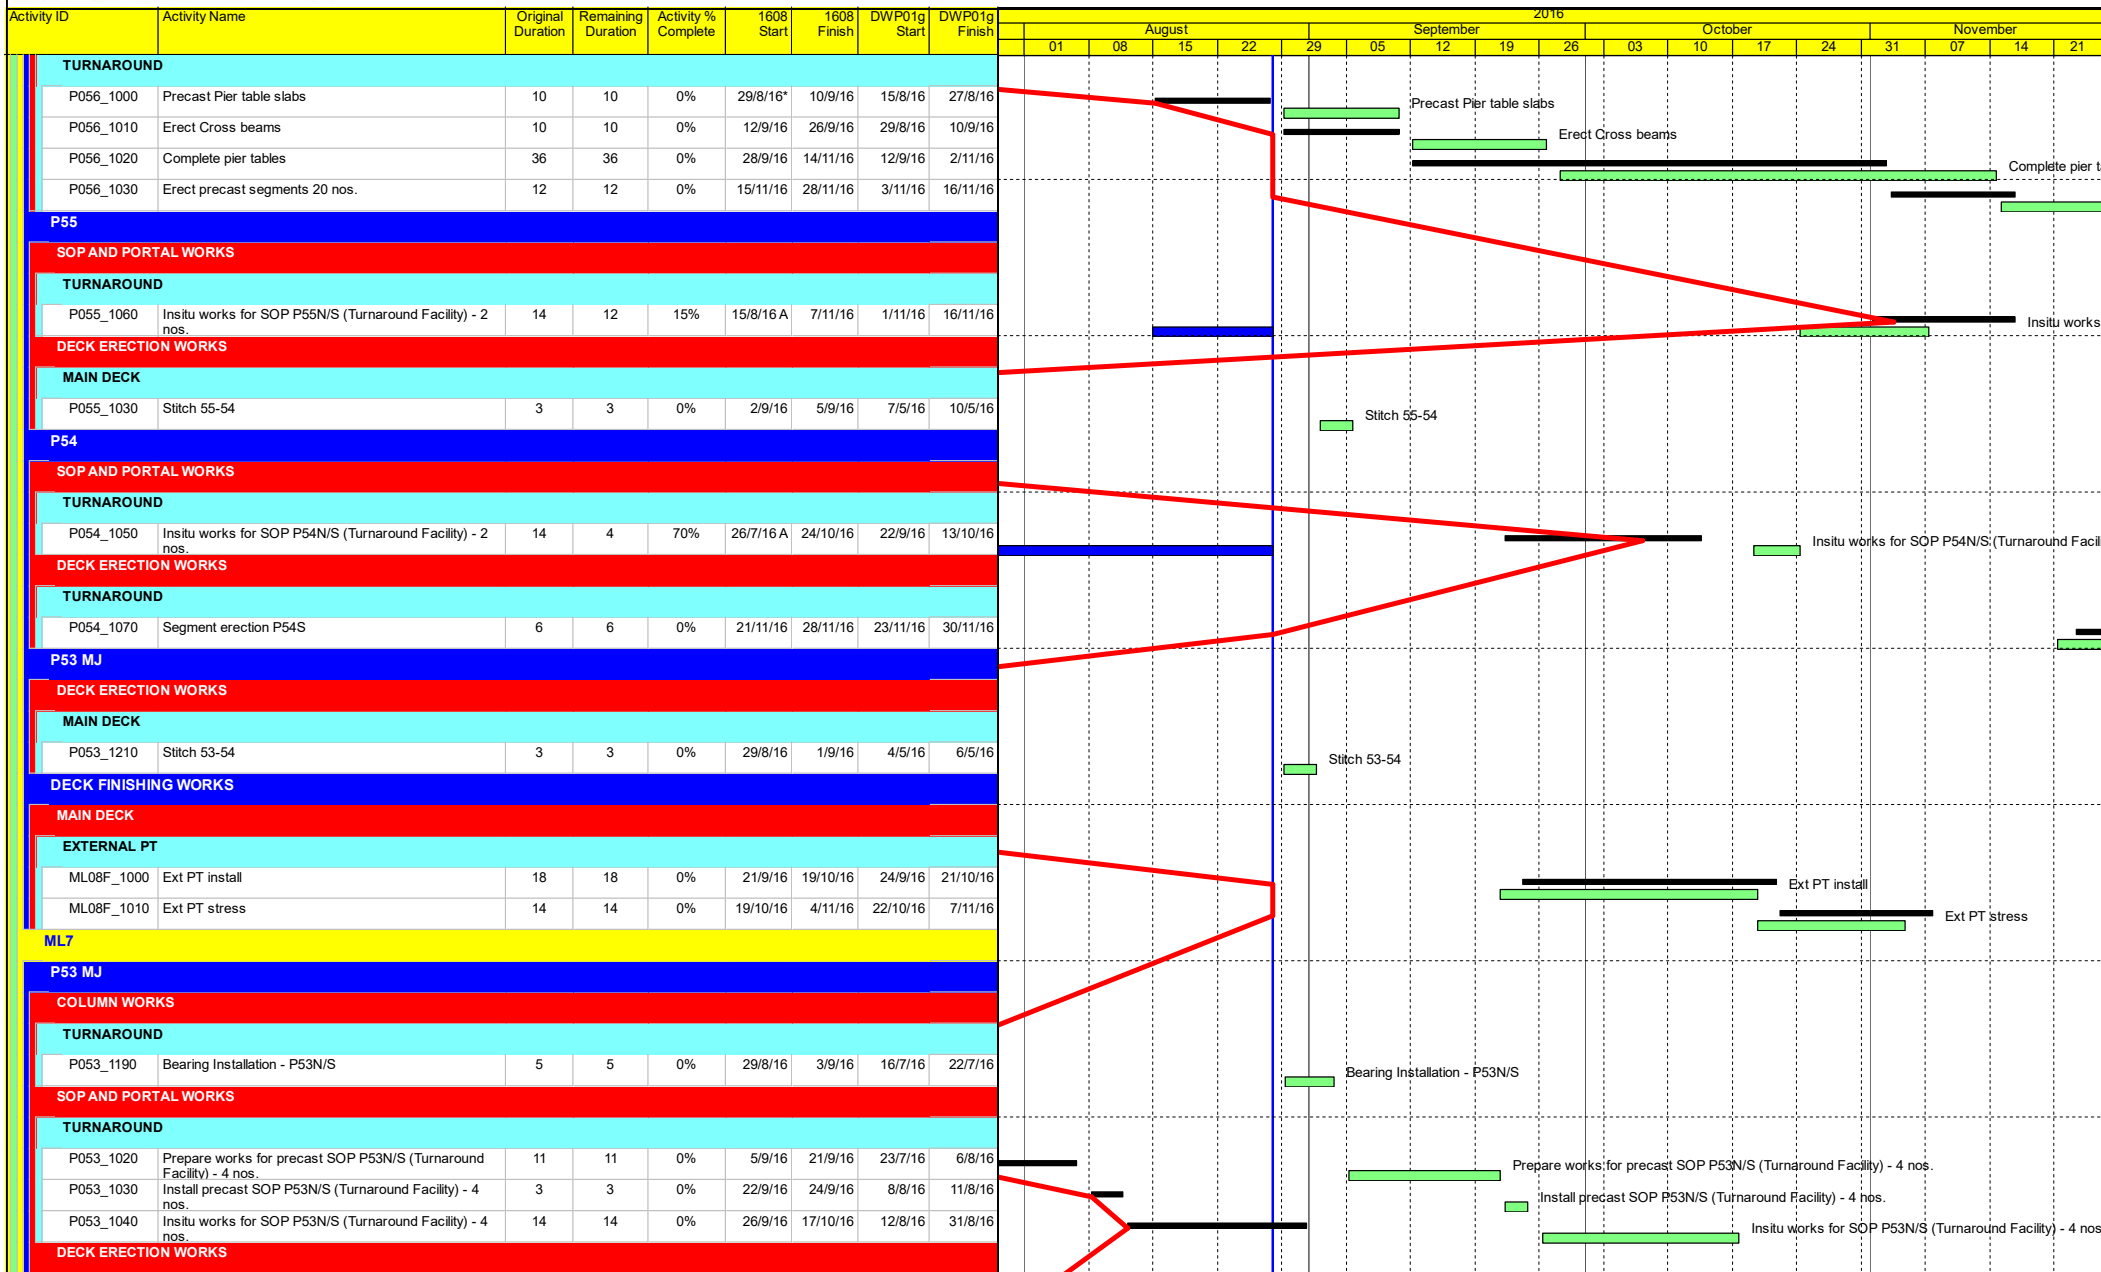

█ Actual Work
 █ Critical Remaining Work
 █ Remaining Work
 ◆ Milestone
 ◆◆ DWP_01g Milestone
 ■ DWP_01g Programme

3MRP DWP_01g 1608

Date	Revision	Checked	Approved
2/9/16	1608 rolling based on DWP01g	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1608 Start	1608 Finish	DWP01g Start	DWP01g Finish	2016																				
									August				September				October				November								
									01	08	15	22	29	05	12	19	26	03	10	17	24	31	07	14	21				
MAIN DECK																													
P053_1070	P53 - P52 S10/10 (MJ) L	3	3	0%	21/9/16	24/9/16	29/7/16	1/8/16	█ P53 - P52 S10/10 (MJ) L																				
P053_1090	P53 - P52 S10/10 (MJ) R	3	3	0%	21/9/16	24/9/16	29/7/16	1/8/16	█ P53 - P52 S10/10 (MJ) R																				
P053_1220	Stitch 53-52	3	3	0%	30/9/16	6/10/16	3/8/16	5/8/16	█ Stitch 53-52																				
TURNAROUND																													
P053_1080	Segment erection P53N	7	7	0%	4/11/16	12/11/16	8/11/16	15/11/16	█ Segment erection P53N																				
P053_1100	Segment erection P53S	7	7	0%	12/11/16	21/11/16	15/11/16	23/11/16	█ Segment erection P53S																				
P52 SB (Portal)																													
DECK ERECTION WORKS																													
P052_1100	P52-P51 S04-10/10 L	28	16	42.9%	24/8/16 A	21/9/16	17/6/16	27/7/16	█ P52:P51 S04-10/10 L																				
P052_1110	P52-P53 S04-10/10 L	28	16	42.9%	24/8/16 A	21/9/16	17/6/16	27/7/16	█ P52:P53 S04-10/10 L																				
P052_1120	P52-P53 S04-10/10 RL	28	20	28.6%	24/8/16 A	26/9/16	17/6/16	27/7/16	█ P52:P53 S04-10/10 RL																				
P052_1130	P52-P51 S04-10/10 R	28	16	42.9%	24/8/16 A	21/9/16	18/6/16	28/7/16	█ P52:P51 S04-10/10 R																				
P052_1140	P52-P53 S04-10/10 R	28	16	42.9%	24/8/16 A	21/9/16	18/6/16	28/7/16	█ P52:P53 S04-10/10 R																				
P052_1150	P52-P53 S04-10/10 R R	28	20	28.6%	24/8/16 A	26/9/16	18/6/16	28/7/16	█ P52:P53 S04-10/10 R R																				
P052_1160	Stitch 52-51	3	3	0%	26/9/16	30/9/16	29/7/16	1/8/16	█ Stitch 52-51																				
P51																													
DECK ERECTION WORKS																													
P051_1100	Stitch 51-50	3	3	0%	10/9/16	14/9/16	16/5/16	18/5/16	█ Stitch 51-50																				
P50																													
DECK ERECTION WORKS																													
P050_1120	Stitch 50-49	3	3	0%	7/9/16	9/9/16	1/4/16	6/4/16	█ Stitch 50-49																				
P49																													
DECK ERECTION WORKS																													
P049_1130	Stitch 49-48	3	3	0%	2/9/16	5/9/16	3/3/16	5/3/16	█ Stitch 49-48																				
P48																													
DECK ERECTION WORKS																													
P048_1120	Stitch 48-47	3	3	0%	29/8/16	1/9/16	29/2/16	2/3/16	█ Stitch 48-47																				
DECK FINISHING WORKS																													
EXTERNAL PT																													
ML07F_1000	Ext PT install	58	39	33.4%	19/1/16 A	25/10/16	2/6/16	22/8/16	█ Ext PT install																				
ML07F_1010	Ext PT stress	20	20	0%	25/10/16	17/11/16	24/8/16	21/9/16	█ Ext PT stress																				
WESTERN WATER (ML04 TO ML06)																													
ML6																													
DECK FINISHING WORKS																													
UTILITY TROUGH & ROAD BARRIER																													
ML06F_1020	Utility trough, road barrier and firemain installation for ML06	50	37	26%	24/8/16 A	22/10/16	18/6/16	27/8/16	█ Utility trough, road barrier and firemain installation for ML06																				
CIVIL PROVISION FOR TCSS																													
ML06F_1060	Install sign gantry GE5	10	10	0%	24/10/16	3/11/16	29/8/16	10/9/16	█ Install sign gantry GE5																				

█ Actual Work
 █ Critical Remaining Work
 ◆ DWP_01g Milestone
 █ Remaining Work
 ◆ Milestone
 █ DWP_01g Programme

3MRP DWP_01g 1608

Date	Revision	Checked	Approved
2/9/16	1608 rolling based on DWP01g	Tim	




Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1608 Start	1608 Finish	DWP01g Start	DWP01g Finish	2016																					
									August				September				October				November									
									01	08	15	22	29	05	12	19	26	03	10	17	24	31	07	14	21					
ML06F_1090	Install pole for vehicle detector VD/30/D	3	3	0%	4/11/16	7/11/16	12/9/16	16/9/16																			16/9/16			
ML06F_1100	Install pole for vehicle detector VD/50/D	3	3	0%	8/11/16	10/11/16	17/9/16	21/9/16																			21/9/16			
ML06F_1130	Install pole for CCTV camera TV/23/A	3	3	0%	11/11/16	14/11/16	22/9/16	24/9/16																			24/9/16			
ML06F_1200	Remain civil provisions for TCSS ML06	50	50	0%	24/10/16	20/12/16	29/8/16	7/11/16																			7/11/16			
E&M AND ROAD FINISHING WORKS																														
M06L_2020	Drainage works for ML06	19	19	0%	24/10/16	14/11/16	29/8/16	24/9/16																			24/9/16			
ML5																														
DECK FINISHING WORKS																														
UTILITY TROUGH & ROAD BARRIER																														
ML05F_1020	Utility trough, road barrier and firemain installation for ML05	50	50	0%	23/9/16	26/11/16	20/7/16	28/9/16																			28/9/16			
ML4																														
DECK FINISHING WORKS																														
EXTERNAL PT																														
ML04F_1010	Ext PT Stressing	14	14	0%	29/8/16	17/9/16	8/8/16	26/8/16																			26/8/16			
UTILITY TROUGH & ROAD BARRIER																														
ML04F_1020	Utility trough, road barrier and firemain installation for ML04	36	36	0%	24/10/16	3/12/16	29/8/16	21/10/16																			21/10/16			
NAVIGATION CHANNEL																														
ML3																														
P16 MJ																														
DECK ERECTION WORKS																														
P016_1180	Stitch 16-17	6	6	0%	29/8/16	5/9/16	8/8/16	15/8/16																			15/8/16			
DECK FINISHING WORKS																														
EXTERNAL PT																														
ML03F_1000	Ext PT install	85	23	72.94%	23/8/16 A	30/9/16	6/5/16	1/9/16																			1/9/16			
ML03F_1010	Ext PT stress	20	20	0%	3/10/16	29/10/16	7/9/16	6/10/16																			6/10/16			
WESTERN WATER (ML01 TO ML02)																														
ML2																														
P16 MJ																														
DECK ERECTION WORKS																														
P016_1190	Stitch 16-15	3	3	0%	14/9/16	19/9/16	2/9/16	5/9/16																			5/9/16			
P15 SB																														
DECK ERECTION WORKS																														
P015_1020	P15 S01-10/10	9	5	40%	26/8/16 A	14/9/16	20/8/16	1/9/16																			1/9/16			
P14																														
DECK ERECTION WORKS																														
P014_1020	P14 S01-10/10	7	7	0%	19/9/16	29/9/16	7/9/16	16/9/16																			16/9/16			
P13																														
SOP AND PORTAL WORKS																														
P013_1010	SOP Completion	13	9	30%	18/7/16 A	10/9/16	31/5/16	16/6/16																			16/6/16			

█ Actual Work
 █ Critical Remaining Work
 █ Remaining Work
 ◆ Milestone
 ◆◆ DWP_01g Milestone
 ■ DWP_01g Programme

3MRP DWP_01g 1608

Page 12 of 15

Date	Revision	Checked	Approved
2/9/16	1608 rolling based on DWP01g	Tim	

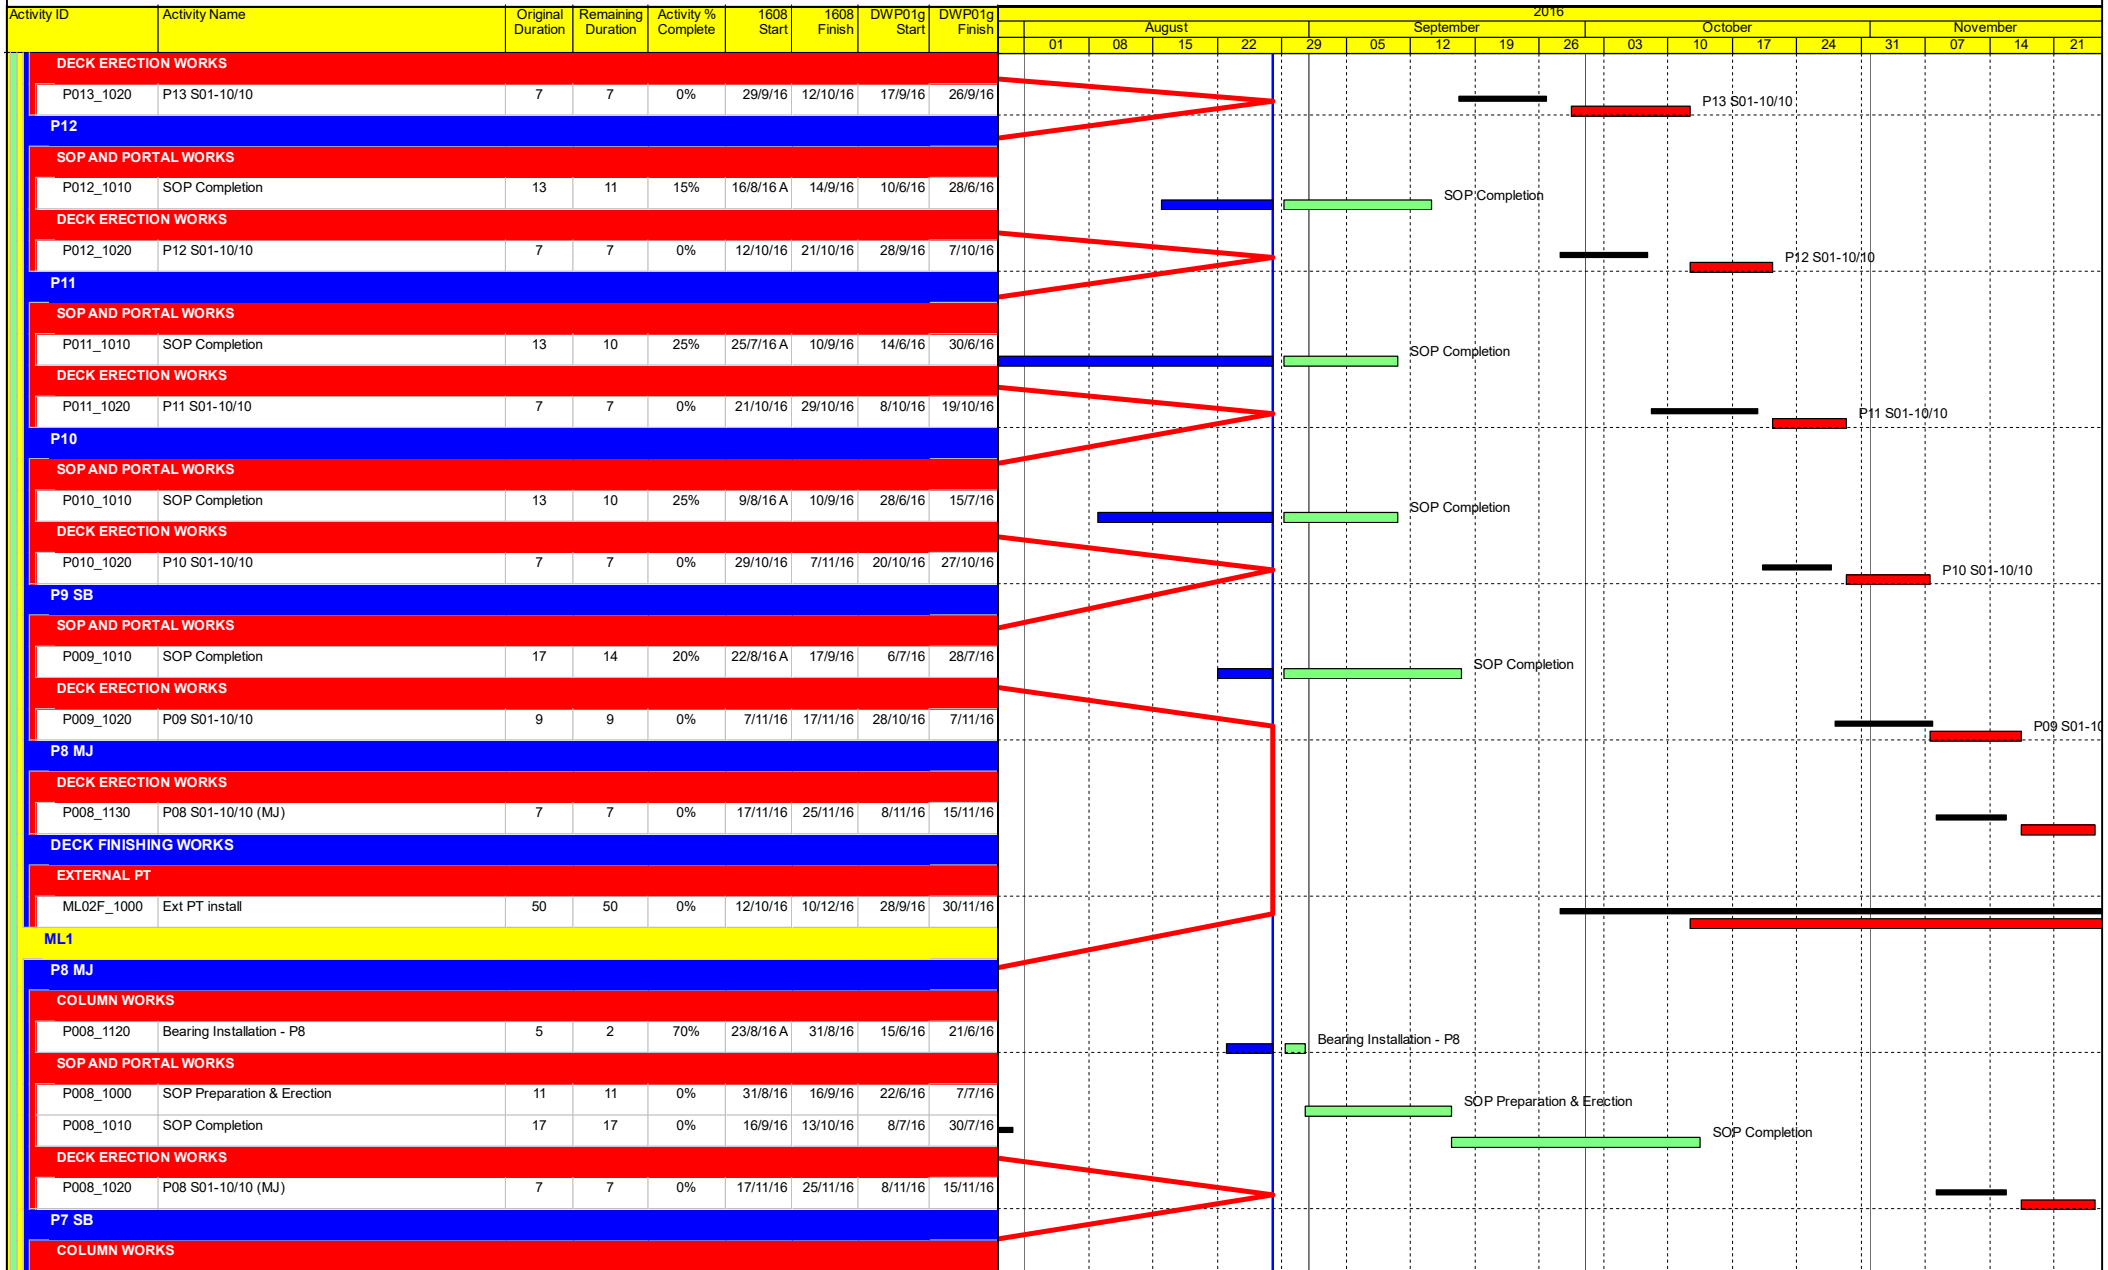

█ Actual Work █ Critical Remaining Work █ Remaining Work ◆ Milestone
◆ Milestone ◆ Milestone ◆ Milestone

3MRP DWP_01g 1608

Date	Revision	Checked	Approved
2/9/16	1608 rolling based on DWP01g	Tim	

Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1608 Start	1608 Finish	DWP01g Start	DWP01g Finish	2016																				
									August				September				October				November								
									01	08	15	22	29	05	12	19	26	03	10	17	24	31	07	14	21				
P007_1110	Prestress works & infill concrete at P7	40	8	80%	14/16 A	8/9/16	11/5/16	6/7/16	[Gantt bars for P7 activities]																				
P007_1120	Bearing Installation - P7	5	5	0%	14/9/16	22/9/16	7/7/16	13/7/16	[Gantt bars for P7 activities]																				
SOP AND PORTAL WORKS																													
P007_1000	SOP Preparation & Erection	11	11	0%	22/9/16*	8/10/16	14/7/16	28/7/16	[Gantt bars for P7 SOP]																				
P007_1010	SOP Completion	17	17	0%	8/10/16	1/11/16	29/7/16	20/8/16	[Gantt bars for P7 SOP]																				
DECK ERECTION WORKS																													
P007_1020	P07 S01-10/10	9	9	0%	25/11/16	6/12/16	16/11/16	25/11/16	[Gantt bars for P7 Deck]																				
P6																													
COLUMN WORKS																													
P006_1130	Prestress works & infill concrete at P6	34	9	75%	24/3/16 A	9/9/16	30/5/16	15/7/16	[Gantt bars for P6 Column]																				
SOP AND PORTAL WORKS																													
P006_1000	SOP Preparation & Erection	8	8	0%	24/9/16	7/10/16	16/7/16	27/7/16	[Gantt bars for P6 SOP]																				
P006_1010	SOP Completion	13	13	0%	7/10/16	26/10/16	28/7/16	13/8/16	[Gantt bars for P6 SOP]																				
P5																													
COLUMN WORKS																													
P005_1130	Prestress works & infill concrete at P5	34	10	70%	7/4/16 A	12/9/16	1/6/16	18/7/16	[Gantt bars for P5 Column]																				
SOP AND PORTAL WORKS																													
P005_1000	SOP Preparation & Erection	8	8	0%	28/9/16	12/10/16	20/7/16	29/7/16	[Gantt bars for P5 SOP]																				
P005_1010	SOP Completion	13	13	0%	12/10/16	28/10/16	30/7/16	17/8/16	[Gantt bars for P5 SOP]																				
P4																													
COLUMN WORKS																													
P004_1130	Prestress works & infill concrete at P4	34	10	70%	13/6/16 A	14/10/16	15/6/16	1/8/16	[Gantt bars for P4 Column]																				
SOP AND PORTAL WORKS																													
P004_1000	SOP Preparation & Erection	8	8	0%	14/10/16	25/10/16	3/8/16	12/8/16	[Gantt bars for P4 SOP]																				
P004_1010	SOP Completion	13	13	0%	25/10/16	9/11/16	13/8/16	31/8/16	[Gantt bars for P4 SOP]																				
P3																													
COLUMN WORKS																													
P003_1100	Prestress works & infill concrete at P3	34	9	75%	26/4/16 A	9/9/16	21/6/16	8/8/16	[Gantt bars for P3 Column]																				
SOP AND PORTAL WORKS																													
P003_1000	SOP Preparation & Erection	8	8	0%	17/10/16	27/10/16	8/8/16	19/8/16	[Gantt bars for P3 SOP]																				
P003_1010	SOP Completion	13	13	0%	27/10/16	11/11/16	19/8/16	7/9/16	[Gantt bars for P3 SOP]																				
P2																													
COLUMN WORKS																													
P002_1100	Prestress works & infill concrete at P2	34	26	25%	11/7/16 A	20/10/16	23/6/16	11/8/16	[Gantt bars for P2 Column]																				
SOP AND PORTAL WORKS																													
P002_1000	SOP Preparation & Erection	8	8	0%	20/10/16	29/10/16	11/8/16	22/8/16	[Gantt bars for P2 SOP]																				
P002_1010	SOP Completion	13	13	0%	29/10/16	14/11/16	22/8/16	9/9/16	[Gantt bars for P2 SOP]																				
P1 SB																													
SOP AND PORTAL WORKS																													

■ Actual Work
 ■ Critical Remaining Work
 ■ Remaining Work
 ◆ Milestone
 ◆◆ DWP_01g Milestone
 ■ DWP_01g Programme

3MRP DWP_01g 1608

Date	Revision	Checked	Approved
2/9/16	1608 rolling based on DWP01g	Tim	



Activity ID	Activity Name	Original Duration	Remaining Duration	Activity % Complete	1608 Start	1608 Finish	DWP01g Start	DWP01g Finish	2016																
									August				September				October				November				
									01	08	15	22	29	05	12	19	26	03	10	17	24	31	07	14	21
P001_1000	SOP Preparation & Erection	11	11	0%	1/11/16	14/11/16	25/8/16	9/9/16																	
P001_1010	SOP Completion	17	17	0%	14/11/16	3/12/16	9/9/16	6/10/16																	
P0 MJ																									
TEMPORARY WORKS																									
P000_1000	Temporary piles installation	24	24	0%	24/10/16	21/11/16	13/10/16	10/11/16																	
P000_1010	Shoring installation	48	48	0%	21/11/16	19/1/17	11/11/16	10/1/17																	

■ Actual Work ■ Critical Remaining Work ◆ DWP_01g Milestone
■ Remaining Work ◆ Milestone ■ DWP_01g Programme

3MRP DWP_01g 1608

Date	Revision	Checked	Approved
2/9/16	1608 rolling based on DWP01g	Tim	

**APPENDIX B
ACTION AND LIMIT LEVELS**

Appendix B - Action and Limit Levels

Table B-1 Action and Limit Levels for 1-Hour TSP

Location	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
AMS1	381	500
AMS4	352	

Table B-2 Action and Limit Levels for 24-Hour TSP

Location	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
AMS1	170	260
AMS4	171	

Table B-3 Action and Limit Levels for Construction Noise

Time Period	Action Level	Limit Level
0700-1900 hrs on normal weekdays	When one documented complaint is received	75 dB(A) *

Noted: If works are to be carried during restricted hours, the conditions stipulated in the construction noise permit issued by the Noise Control Authority have to be followed.

(*) reduce to 70 dB(A) for schools and 65 dB(A) during school examination periods.

Table B-4 Action and Limit Levels for Water Quality

Parameter (unit)	Water Depth	Action Level	Limit Level
Dissolved Oxygen (mg/L) (surface, middle, bottom)	Surface and Middle	<u>5.0</u>	4.2 except 5 for FCZ
	Bottom	<u>4.7</u>	3.6
Turbidity (NTU)	Depth average	<u>27.5</u> and 120% of upstream control station's turbidity at the same tide of the same day	<u>47.0</u> and 130% of turbidity at the upstream control station at the same tide of same day
Suspended Solids (mg/L)	Depth average	<u>23.5</u> and 120% of upstream control station's SS at the same tide of the same day	<u>34.4</u> and 130% of SS at the upstream control station at the same tide of same day and 10mg/L for WSD Seawater Intakes

Note:

- (1) Depth-averaged is calculated by taking the arithmetic means of reading of all three depths
- (2) For DO, non-compliance of the water quality limit occurs when monitoring result is lower than the limit.
- (3) For SS & turbidity non-compliance of the water quality limits occur when monitoring result is higher than the limits.
- (4) All the figures given in the table are used for reference only and the EPD may amend the figures whenever it is considered as necessary.
- (5) The 1%-ile of baseline data for dissolved oxygen (surface and middle) and dissolved oxygen (bottom) are 4.2mg/L and 3.6mg/L respectively.

**APPENDIX C
COPIES OF CALIBRATION
CERTIFICATES**

High-Volume TSP Sampler

5-POINT CALIBRATION DATA SHEET

CINOTECH

File No. MA12014/67/0023

Project No. AMS 1 - Sha Lo Wan Operator: WK
 Date: 25-Jul-16 Next Due Date: 24-Sep-16
 Equipment No.: A-01-67 Serial No. 3218

Ambient Condition			
Temperature, Ta (K)	303	Pressure, Pa (mmHg)	759.5

Orifice Transfer Standard Information					
Serial No.:	2896	Slope, mc	0.0598	Intercept, bc	-0.05079
Last Calibration Date:	4-Mar-16	$mc \times Qstd + bc = [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	3-Mar-17	$Qstd = \{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$			

Calibration of TSP Sampler					
Calibration Point	Orifice			HVS	
	ΔH (orifice), in. of water	$[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$	Qstd (CFM) X-axis	ΔW (HVS), in. of water	$[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$ Y-axis
1	16.8	4.06	68.81	10.8	3.26
2	14.5	3.78	63.99	8.9	2.96
3	10.3	3.18	54.07	6.7	2.57
4	6.9	2.60	44.41	4.6	2.13
5	4.2	2.03	34.83	2.9	1.69

By Linear Regression of Y on X

Slope, mw = 0.0452 Intercept, bw = 0.1162
 Correlation coefficient* = 0.9989

*If Correlation Coefficient < 0.990, check and recalibrate.



Set Point Calculation

From the TSP Field Calibration Curve, take Qstd = 43 CFM
 From the Regression Equation, the "Y" value according to

$$mw \times Qstd + bw = [\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point; $W = (mw \times Qstd + bw)^2 \times (760 / Pa) \times (Ta / 298) =$ 4.31

Remarks: _____

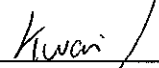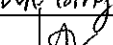Conducted by: Wk Tang Signature:  Date: 25/7/16
 Checked by:  Signature: _____ Date: 25 July 2016

High-Volume TSP Sampler

5-POINT CALIBRATION DATA SHEET

CINOTECH

File No. MA12014/74/0023

Project No. AMS 4 - San Tau Operator: WK
 Date: 25-Jul-16 Next Due Date: 24-Sep-16
 Equipment No.: A-01-74 Serial No. 2202

Ambient Condition			
Temperature, Ta (K)	303.8	Pressure, Pa (mmHg)	758.6

Orifice Transfer Standard Information					
Serial No.:	2896	Slope, mc	0.0598	Intercept, bc	-0.05079
Last Calibration Date:	4-Mar-16	$mc \times Qstd + bc = [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	3-Mar-17	$Qstd = \{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$			

Calibration of TSP Sampler					
Calibration Point	Orifice			HVS	
	ΔH (orifice), in. of water	$[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$	Qstd (CFM) X-axis	ΔW (HVS), in. of water	$[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$ Y-axis
1	15.8	3.93	66.63	10.1	3.14
2	11.9	3.41	57.94	7.6	2.73
3	9.4	3.03	51.59	6.0	2.42
4	5.4	2.30	39.31	3.7	1.90
5	3.3	1.80	30.91	2.2	1.47

By Linear Regression of Y on X
 Slope, mw = 0.0463 Intercept, bw = 0.0515
 Correlation coefficient* = 0.9995
 *If Correlation Coefficient < 0.990, check and recalibrate.

Set Point Calculation

From the TSP Field Calibration Curve, take Qstd = 43 CFM
 From the Regression Equation, the "Y" value according to

$$mw \times Qstd + bw = [\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point; $W = (mw \times Qstd + bw)^2 \times (760 / Pa) \times (Ta / 298) =$ 4.26

Remarks: _____

Conducted by: Wk Tang Signature: _____ Date: 25/7/2016
 Checked by: [Signature] Signature: _____ Date: 25 July 2016



TISCH ENVIRONMENTAL, INC.
 145 SOUTH MIAMI AVE
 VILLAGE OF CLEVELAND, OH
 45002
 513.467.9000
 877.263.7610 TOLL FREE
 513.467.9009 FAX

ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

Date - Mar 04, 2016 Rootmeter S/N 0438320 Ta (K) - 295
 Operator Tisch Orifice I.D. - 2896 Pa (mm) - 755.65

PLATE OR Run #	VOLUME START (m3)	VOLUME STOP (m3)	DIFF VOLUME (m3)	DIFF TIME (min)	METER DIFF Hg (mm)	ORFICE DIFF H2O (in.)
1	NA	NA	1.00	1.4340	3.2	2.00
2	NA	NA	1.00	1.0250	6.4	4.00
3	NA	NA	1.00	0.9150	7.9	5.00
4	NA	NA	1.00	0.8770	8.7	5.50
5	NA	NA	1.00	0.7210	12.7	8.00

DATA TABULATION

Vstd	(x axis) Qstd	(y axis)	Va	(x axis) Qa	(y axis)
1.0001	0.6974	1.4173	0.9957	0.6944	0.8836
0.9959	0.9716	2.0044	0.9915	0.9674	1.2496
0.9938	1.0861	2.2410	0.9894	1.0814	1.3971
0.9928	1.1320	2.3503	0.9885	1.1271	1.4653
0.9875	1.3696	2.8346	0.9831	1.3636	1.7672
Qstd slope (m) =	2.11176		Qa slope (m) =	1.32235	
intercept (b) =	-0.05079		intercept (b) =	-0.03166	
coefficient (r) =	0.99982		coefficient (r) =	0.99982	

y axis = SQRT[H2O(Pa/760) (298/Ta)] y axis = SQRT[H2O(Ta/Pa)]

CALCULATIONS

Vstd = Diff. Vol [(Pa-Diff. Hg)/760] (298/Ta)
 Qstd = Vstd/Time

Va = Diff Vol [(Pa-Diff Hg)/Pa]
 Qa = Va/Time

For subsequent flow rate calculations:

Qstd = 1/m{ [SQRT(H2O(Pa/760) (298/Ta))] - b}
 Qa = 1/m{ [SQRT H2O(Ta/Pa)] - b}



Calibration Certificate

Certificate No. **606763**

Page 1 of 2 Pages

Customer : Dragages - China Harbour - VSL Joint Venture

Address : 3/F., Island Place Tower, 510 King's Road, North Point, H. K.

Order No. : Q62747

Date of receipt : 28-Jul-16

Item Tested

Description : Weather Stations,Vantage Pro2

Manufacturer : Davis

I.D. : --

Model : 6152 CUK

Serial No. : AK130520004

Test Conditions

Date of Test : 1-Aug-16

Supply Voltage : --

Ambient Temperature : (23 ± 3)°C

Relative Humidity : (50 ± 25) %

Test Specifications

Calibration check.

Ref. Document/Procedure : Z04.

Test Results


The results are shown in the attached page(s).

Main Test equipment used:

<u>Equipment No.</u>	<u>Description</u>	<u>Cert. No.</u>	<u>Traceable to</u>
S155	Std. Anemometer	507918	NIM-PRC

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI), or by reference to a natural constant. The test results apply to the above Unit-Under-Test only

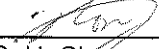Calibrated by : 
C. H. Chan

Approved by : 
Steve Kwan

Date: 1-Aug-16



Calibration Certificate

Certificate No. 606763

Page 2 of 2 Pages

Results :

1. Wind Speed

Applied Value (m/s)	UUT Reading (m/s)
0.0	0.0
2.5	2.2
5.0	4.9
7.5	7.2
10.0	9.8
15.0	14.8
19.0	18.3

Uncertainty : $\pm (0.9 \% + 0.16 \text{ m/s})$

2. Wind Direction

Reference Value	UUT Indication
N (0°)	N (0°)
NE (45°)	NE (45°)
E (90°)	E (90°)
SE (135°)	SE (135°)
S (180°)	S (180°)
SW (225°)	SW (225°)
W (270°)	W (270°)
NW (315°)	NW (315°)

Remark : 1. UUT: Unit-Under-Test

2. Atmospheric Pressure : 1 009 hPa

3. Before the calibration of the Wind Direction function, the Arrow Head was adjusted to the magnetic NORTH direction while the monitor indicated N. The customer is reminded to do the alignment again after installation.

4. The UUT was equipped with ISS Transmitter -- Mfg code: AK130520004.

----- END -----



輝創工程有限公司

Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration

校正證書

Certificate No. : C160050
證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號 : IC15-2931) Date of Receipt / 收件日期 : 28 December 2015

Description / 儀器名稱 : Sound & Vibration Analyser
Manufacturer / 製造商 : BSWA
Model No. / 型號 : BSWA 801
Serial No. / 編號 : 35924
Supplied By / 委託者 : Dragages - China Harbour - VSL Joint Venture
3/F, Island Place Tower, 510 King's Road,
North Point, Hong Kong

TEST CONDITIONS / 測試條件

Temperature / 溫度 : (23 ± 2)°C Relative Humidity / 相對濕度 : (55 ± 20)%
Line Voltage / 電壓 : ---

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 4 January 2016


TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.
The results do not exceed manufacturer's specification.
The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via :

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By : 
測試 : _____
H T Wong
Technical Officer

Certified By : 
核證 : _____
K C Lee
Project Engineer

Date of Issue : 6 January 2016
簽發日期

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室所書面批准。

Sun Creation Engineering Limited - Calibration & Testing Laboratory

c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 - 校正及檢測實驗室

c/o 香港新界屯門興安里一號青山灣機樓四樓

Tel/電話: 2927 2606 Fax/傳真: 2744 8986

E-mail/電郵: callab@suncreation.com

Website/網址: www.suncreation.com

Certificate of Calibration

校正證書

Certificate No. : C160050
證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- Self-calibration using the laboratory acoustic calibrator was performed before the test from 6.1.1.2 to 6.3.2.
- The results presented are the mean of 3 measurements at each calibration point.
- Test equipment :

Equipment ID	Description	Certificate No.
CL280	40 MHz Arbitrary Waveform Generator	C150014
CL281	Multifunction Acoustic Calibrator	DC130171

- Test procedure : MA101N.

- Results :

6.1 Sound Pressure Level

6.1.1 Reference Sound Pressure Level

6.1.1.1 Before Self-calibration

UUT Setting				Applied Value		UUT Reading (dB)
Range	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	
HIGH	SPL	A	Fast	94.00	1	93.6

6.1.1.2 After Self-calibration

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)		
HIGH	SPL	A	Fast	94.00	1	94.0	± 1.1

6.1.2 Linearity

UUT Setting				Applied Value		UUT Reading (dB)
Range	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	
HIGH	SPL	A	Fast	94.00	1	94.0 (Ref.)
				104.00		104.0
				114.00		114.0

IEC 61672 Class 1 Spec. : ± 0.6 dB per 10 dB step and ± 1.1 dB for overall different.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

Certificate of Calibration

校正證書

Certificate No. : C160050

證書編號

6.2 Time Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)		
HIGH	SPL	A	Fast	94.00	1	94.0	Ref. ± 0.3
			Slow			94.0	

6.3 Frequency Weighting

6.3.1 A-Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq.		
HIGH	SPL	A	Fast	94.00	63 Hz	67.8	-26.2 ± 1.5
					125 Hz	77.8	-16.1 ± 1.5
					250 Hz	85.3	-8.6 ± 1.4
					500 Hz	90.7	-3.2 ± 1.4
					1 kHz	94.0	Ref.
					2 kHz	95.2	+1.2 ± 1.6
					4 kHz	95.0	+1.0 ± 1.6
					8 kHz	93.0	-1.1 (+2.1 ; -3.1)
					12.5 kHz	89.7	-4.3 (+3.0 ; -6.0)

6.3.2 C-Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range	Mode	Frequency Weighting	Time Weighting	Level (dB)	Freq.		
HIGH	SPL	C	Fast	94.00	63 Hz	93.2	-0.8 ± 1.5
					125 Hz	93.8	-0.2 ± 1.5
					250 Hz	94.0	0.0 ± 1.4
					500 Hz	94.0	0.0 ± 1.4
					1 kHz	94.0	Ref.
					2 kHz	93.9	-0.2 ± 1.6
					4 kHz	93.3	-0.8 ± 1.6
					8 kHz	91.1	-3.0 (+2.1 ; -3.1)
					12.5 kHz	87.8	-6.2 (+6.0 ; -∞)

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Certificate of Calibration

校正證書

Certificate No. : C160050
證書編號

Remarks : - UUT Microphone S/N : 520978

- Mfr's Spec. : IEC 61672 Class 1

- Uncertainties of Applied Value :

94 dB : 63 Hz - 125 Hz	: ± 0.35 dB
250 Hz - 500 Hz	: ± 0.30 dB
1 kHz	: ± 0.20 dB
2 kHz - 4 kHz	: ± 0.35 dB
8 kHz	: ± 0.45 dB
12.5 kHz	: ± 0.70 dB
104 dB: 1 kHz	: ± 0.10 dB (Ref. 94 dB)
114 dB: 1 kHz	: ± 0.10 dB (Ref. 94 dB)

- The uncertainties are for a confidence probability of not less than 95 %.

Note :

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

Sun Creation Engineering Limited – Calibration & Testing Laboratory

c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 – 校正及檢測實驗室

c/o 香港新界屯門興安里一號青山灣機樓四樓

Tel/電話: 2927 2606 Fax/傳真: 2744 8986 E-mail/電郵: callab@suncreation.com Website/網址: www.suncreation.com



輝創工程有限公司

Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration

校正證書

Certificate No. : C160221

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號 : IC15-2931)

Date of Receipt / 收件日期 : 7 January 2016

Description / 儀器名稱 : Acoustic Calibrator

Manufacturer / 製造商 : Svantek

Model No. / 型號 : SV30A

Serial No. / 編號 : 24803

Supplied By / 委託者 : Dragages - China Harbour - VSL Joint Venture
3/F, Island Place Tower, 510 King's Road,
North Point, Hong Kong

TEST CONDITIONS / 測試條件

Temperature / 溫度 : $(23 \pm 2)^{\circ}\text{C}$

Relative Humidity / 相對濕度 : $(55 \pm 20)\%$

Line Voltage / 電壓 : ---

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 14 January 2016

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via :

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA


Tested By
測試

:


H T Wong
Technical Officer

Certified By
核證

:

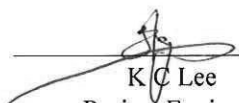
K C Lee
Project Engineer

Date of Issue
簽發日期

:

15 January 2016

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室所書面批准。

Sun Creation Engineering Limited – Calibration & Testing Laboratory

c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 – 校正及檢測實驗室

c/o 香港新界屯門興安里一號青山灣機樓四樓

Tel/電話: 2927 2606

Fax/傳真: 2744 8986

E-mail/電郵: callab@suncreation.com

Website/網址: www.suncreation.com

Certificate of Calibration

校正證書

Certificate No. : C160221

證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.
- Test equipment :

<u>Equipment ID</u>	<u>Description</u>	<u>Certificate No.</u>
CL130	Universal Counter	C153519
CL281	Multifunction Acoustic Calibrator	DC130171
TST150A	Measuring Amplifier	C141558

- Test procedure : MA100N.

- Results :

5.1 Sound Level Accuracy

UUT Nominal Value	Measured Value (dB)	Mfr's Spec. (dB)	Uncertainty of Measured Value (dB)
94 dB, 1 kHz	94.3	± 0.3	± 0.2
114 dB, 1 kHz	114.3		

5.2 Frequency Accuracy

UUT Nominal Value (kHz)	Measured Value (kHz)	Mfr's Spec.	Uncertainty of Measured Value (Hz)
1	0.999 98	1 kHz ± 0.02 %	± 0.01

Remark : - The uncertainties are for a confidence probability of not less than 95 %.

Note :

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

Sun Creation Engineering Limited – Calibration & Testing Laboratory

c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 – 校正及檢測實驗室

c/o 香港新界屯門興安里一號青山灣機樓四樓

Tel/電話: 2927 2606

Fax/傳真: 2744 8986

E-mail/電郵: callab@suncreation.com

Website/網址: www.suncreation.com

TEST REPORT Chemical Analysis of Water Accuracy check of YSI Sondes Environmental Monitoring System

Date of issue: 13-05-2016

Page 1 of 1 pages

Castco LRN: EN0160506-2

Sample details as supplied by customer

Customer : Dragages-China Harbour-VSL Joint Venture

Customer Ref. No. : --

Address: Tung Chung Waterfront Road, adjacent to Tung Chung New Development Pier

Job Title : Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road - Section between HKSAR Boundary and Scenic Hill

Contract No.: HY/2011/09

Laboratory Test Result

Instrument Name: Sonde Environmental Monitoring System

Manufacturer : YSI

Model No. : YSI 6820

Serial No. : 12B100804

Instrument No. : W.03.13

Date of Calibration : 06-05-2016

Date of Next Calibration : 06-08-2016

pH Value Check (pH Probe : Model: 6589, L/N: 14M)

Expected Reading (pH Unit)	Sonde Reading (pH Unit)	Tolerance (pH Unit)	Tolerance Limit (pH Unit)	Method Reference
4.00	4.14	+0.14	± 0.2	APHA 21e, 4500-H ⁺ B
7.02	7.14	+0.12		
10.06	10.00	-0.06		

Turbidity Check (Turbidity Sensor : Model: 6136, S/N: 11J100476)

Expected Reading (NTU)	Sonde Reading (NTU)	Tolerance (%)	Tolerance Limit (%)	Method Reference
4.00	4.1	+2.5	± 10	APHA 21e, 2130B
10.00	9.4	-6.0		
20.00	19.1	-4.5		
50.00	47.4	-5.2		
100.00	96.0	-4.0		

Conductivity Performance Check (Conductivity Sensor : Model: 6560, L/N : 14M100013)

Expected Reading (µS/cm)	Sonde Reading (µS/cm)	Tolerance (%)	Tolerance Limit (%)	Method Reference
1412 at 25 °C	1334 at 25 °C	-5.5	± 10	APHA 21e, 2510B

Salinity Performance Check (Salinity Sensor : Model: 6560, L/N: 14M100013)

Expected Reading (ppt)	Sonde Reading (ppt)	Tolerance (%)	Tolerance Limit (%)	Method Reference
33	31.63	-4.2	± 10	APHA 19e, 2520B

Dissolved Oxygen Check (Dissolved Oxygen Sensor : Model: 6562 , L/N: 07E100029)

DO from Winkler Titration (mg/L)	Sonde Reading (mg/L)	Tolerance (mg/L)	Tolerance Limit (mg/L)	Method Reference
8.80	8.66	-0.14	± 0.20	APHA 21e, 4500-O C&G
4.40	4.45	+0.05		

Water Level Meter Check

Expected Reading (m)	Sonde Reading (m)	Tolerance (m)	Tolerance Limit (m)	Method Reference
1.05	1.03	-0.02	± 0.05	YSI Sondes Procedure Manual

Temperature Check

Expected Reading (°C)	Sonde Reading (°C)	Tolerance (°C)	Tolerance Limit (°C)	Method Reference
24.8	24.73	-0.07	± 2.0	Telarc Technical Guide No.3 1986

Checked by: _____

Au Kwok Kin
Senior Chemist

Certified by: _____

Cheng Chi Fai
Senior Manager

End of Report

TEST REPORT

Chemical Analysis of Water

Accuracy check of YSI Sondes Environmental Monitoring System

Date of issue: 13-05-2016

Page 1 of 1 pages

Castco LRN: EN0160506-1

Sample details as supplied by customer

Customer : Dragages-China Harbour-VSL Joint Venture

Customer Ref. No. : --

Address: Tung Chung Waterfront Road, adjacent to Tung Chung New Development Pier

Job Title : Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road - Section between HKSAR Boundary and Scenic Hill

Contract No.: HY/2011/09

Laboratory Test Result

Instrument Name: Sonde Environmental Monitoring System

Manufacturer : YSI

Instrument No. : W.03.12

Model No. : YSI 6820

Date of Calibration : 06-05-2016

Serial No. : 12B100803

Date of Next Calibration : 06-08-2016

pH Value Check (pH Probe : Model: 6589, L/N: 15B)

Expected Reading (pH Unit)	Sonde Reading (pH Unit)	Tolerance (pH Unit)	Tolerance Limit (pH Unit)	Method Reference
4.00	4.17	+0.17	± 0.2	APHA 21e, 4500-H ⁺ B
7.02	7.15	+0.13		
10.06	10.00	-0.06		

Turbidity Check (Turbidity Sensor : Model: 6136, S/N:13K103053)

Expected Reading (NTU)	Sonde Reading (NTU)	Tolerance (%)	Tolerance Limit (%)	Method Reference
4.00	4.2	+5.0	± 10	APHA 21e, 2130B
10.00	9.6	-4.0		
20.00	19.0	-5.0		
50.00	47.2	-5.6		
100.00	95.2	-4.8		

Conductivity Performance Check (Conductivity Sensor : Model: 6560, L/N: 15B100399)

Expected Reading (µS/cm)	Sonde Reading (µS/cm)	Tolerance (%)	Tolerance Limit (%)	Method Reference
1412 at 25 °C	1335 at 25 °C	-5.4	± 10	APHA 21e, 2510B

Salinity Performance Check (Salinity Sensor : Model: 6560, L/N: 15B100399)

Expected Reading (ppt)	Sonde Reading (ppt)	Tolerance (%)	Tolerance Limit (%)	Method Reference
33	32.02	-3.0	± 10	APHA 19e, 2520B

Dissolved Oxygen Check (Dissolved Oxygen Sensor : Model: 6562, L/N: 15A100700)

DO from Winkler Titration (mg/L)	Sonde Reading (mg/L)	Tolerance (mg/L)	Tolerance Limit (mg/L)	Method Reference
8.80	8.78	-0.02	± 0.20	APHA 21e, 4500-O C&G
4.50	4.54	+0.04		


Water Level Meter Check

Expected Reading (m)	Sonde Reading (m)	Tolerance (m)	Tolerance Limit (m)	Method Reference
1.05	1.04	-0.01	± 0.05	YSI Sondes Procedure Manual

Temperature Check

Expected Reading (°C)	Sonde Reading (°C)	Tolerance (°C)	Tolerance Limit (°C)	Method Reference
24.8	24.62	-0.18	± 2.0	Telarc Technical Guide No.3 1986

Checked by: _____


Au Kwok Kin
Senior Chemist

Certified by: _____


Cheng Chi Fai
Senior Manager

End of Report

TEST REPORT Chemical Analysis of Water Accuracy check of YSI Sondes Environmental Monitoring System

Date of issue: 05-08-2016

Page 1 of 1 page(s)

Castco LRN: EN0160804-16

Sample details as supplied by customer:-

Customer : Dragages-China Harbour-VSL Joint Venture

Customer Ref. No. : --

Address : Tung Chung Waterfront Road, adjacent to Tung Chung New Development Pier

Job Title : Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road - Section between HKSAR Boundary and Scenic Hill

Contract No.: HY/2011/09

Laboratory Test Results:-

Instrument Name: Sonde Environmental Monitoring System

Manufacturer : YSI

Instrument No. : W.03.12

Model No. : YSI 6820

Date of Calibration : 04-08-2016

Serial No. : 12B100803

Date of Next Calibration : 04-11-2016

pH Value Check (pH Probe : Model:6589 , L/N:15B)

Expected Reading (pH Unit)	Sonde Reading (pH Unit)	Tolerance (pH Unit)	Tolerance Limit (pH Unit)	Method Reference
4.00	4.00	0.00	± 0.2	APHA 21e, 4500-H ⁺ B
7.02	6.99	-0.03		
10.06	9.99	-0.07		

Turbidity Check (Turbidity Sensor : Model :6136,S/N:13K103053)

Expected Reading (NTU)	Sonde Reading (NTU)	Tolerance (%)	Tolerance Limit (%)	Method Reference
4.00	4.2	5.0	± 10	APHA 21e, 2130B
10.00	9.4	-6.0		
20.00	19.0	-5.0		
50.00	47.7	-4.6		
100.00	94.8	-5.2		

Conductivity Performance Check (Conductivity Sensor : Model: 6560, L/N : 15B100399)

Expected Reading (µS/cm)	Sonde Reading (µS/cm)	Tolerance (%)	Tolerance Limit (%)	Method Reference
1412 at 25 °C	1298 at 25 °C	-8.1	+ 10	APHA 21e, 2510B

Salinity Performance Check (Salinity Sensor : Model 6560,L/N:15B100399)

Expected Reading (µS/cm)	Sonde Reading (µS/cm)	Tolerance (%)	Tolerance Limit (%)	Method Reference
33	31.66	-4.1	± 10	APHA 19e, 2520B

Dissolved Oxygen Check (Dissolved Oxygen Sensor: Model: 6562 , L/N:15A100007)

DO from Winkler Titration (mg/L)	Sonde Reading (mg/L)	Tolerance (mg/L)	Tolerance Limit (mg/L)	Method Reference
8.70	8.80	0.10	± 0.20	APHA 21e, 4500-O C&G
4.41	4.36	-0.05		


Water Level Meter Check

Expected Reading (m)	Sonde Reading (m)	Tolerance (m)	Tolerance Limit (m)	Method Reference
1.04	1.014	-0.026	± 0.05	YSI Sondes Procedure Manual

Temperature Check

Expected Reading (°C)	Sonde Reading (°C)	Tolerance (°C)	Tolerance Limit (°C)	Method Reference
25.0	24.71	-0.29	± 2.0	Telarc Technical Guide No.3 1986

Checked by :


Au Kwok Kin
Senior Chemist

Certified by :


Cheng Chi Fai
Senior Manager

End of Report

TEST REPORT Chemical Analysis of Water Accuracy check of YSI Sondes Environmental Monitoring System

Date of issue: 05-08-2016

Page 1 of 1 page(s)

Castco LRN: EN0160804-17

Sample details as supplied by customer:-

Customer : Dragages-China Harbour-VSL Joint Venture

Customer Ref. No. : --

Address: Tung Chung Waterfront Road, adjacent to Tung Chung New Development Pier

Job Title : Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road - Section between HKSAR Boundary and Scenic Hill

Contract No.: HY/2011/09

Laboratory Test Results:-

Instrument Name: Sonde Environmental Monitoring System

Manufacturer : YSI

Model No. : YSI 6820

Serial No. : 12B100804

Instrument No. : W.03.13

Date of Calibration : 04-08-2016

Date of Next Calibration : 04-11-2016

pH Value Check (pH Probe : Model:6589 , I/N:14M)

Expected Reading (pH Unit)	Sonde Reading (pH Unit)	Tolerance (pH Unit)	Tolerance Limit (pH Unit)	Method Reference
4.00	4.04	0.04	± 0.2	APHA 21e, 4500-H ⁺ B
7.02	7.05	0.03		
10.06	10.01	-0.05		

Turbidity Check (Turbidity Sensor : Model :6136,S/N:11J100476)

Expected Reading (NTU)	Sonde Reading (NTU)	Tolerance (%)	Tolerance Limit (%)	Method Reference
4.00	4.2	5.0	± 10	APHA 21e, 2130B
10.00	9.8	-2.0		
20.00	19.0	-5.0		
50.00	48.0	-4.0		
100.00	95.8	-4.2		

Conductivity Performance Check (Conductivity Sensor : Model: 6560, L/N : 14M100013)

Expected Reading (µS/cm)	Sonde Reading (µS/cm)	Tolerance (%)	Tolerance Limit (%)	Method Reference
1412 at 25 °C	1330 at 25 °C	-5.8	± 10	APHA 21e, 2510B

Salinity Performance Check (Salinity Sensor : Model: 6560, L/N : 14M100013)

Expected Reading (µS/cm)	Sonde Reading (µS/cm)	Tolerance (%)	Tolerance Limit (%)	Method Reference
33	32.61	-1.2	± 10	APHA 19e, 2520B

Dissolved Oxygen Check (Dissolved Oxygen Sensor: Model: 6562 , L/N:07E100029)

DO from Winkler Titration (mg/L)	Sonde Reading (mg/L)	Tolerance (mg/L)	Tolerance Limit (mg/L)	Method Reference
8.70	8.76	0.06	± 0.20	APHA 21e, 4500-O C&G
4.19	4.28	0.09		


Water Level Meter Check

Expected Reading (m)	Sonde Reading (m)	Tolerance (m)	Tolerance Limit (m)	Method Reference
1.04	1.029	-0.011	± 0.05	YSI Sondes Procedure Manual

Temperature Check

Expected Reading (°C)	Sonde Reading (°C)	Tolerance (°C)	Tolerance Limit (°C)	Method Reference
25.0	24.79	-0.21	± 2.0	Telarc Technical Guide No.3 1986

Checked by :


Au Kwok Kin
Senior Chemist

Certified by :


Cheng Chi Fai
Senior Manager

End of Report

**APPENDIX D
ENVIRONMENTAL MONITORING
SCHEDULES**

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Impact Air Quality and Noise Monitoring Schedule in August 2016**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
	1-Aug	2-Aug	3-Aug	4-Aug	5-Aug	6-Aug
	24 hr TSP 1 hr TSP X 3		Noise		24 hr TSP 1 hr TSP X 3	
7-Aug	8-Aug	9-Aug	10-Aug	11-Aug	12-Aug	13-Aug
				24 hr TSP 1 hr TSP X 3	Noise	
14-Aug	15-Aug	16-Aug	17-Aug	18-Aug	19-Aug	20-Aug
			24 hr TSP 1 hr TSP X 3	Noise		
21-Aug	22-Aug	23-Aug	24-Aug	25-Aug	26-Aug	27-Aug
		24 hr TSP 1 hr TSP X 3	Noise			
28-Aug	29-Aug	30-Aug	31-Aug			
	24 hr TSP 1 hr TSP X 3	Noise				

Air Quality Monitoring Stations

AMS1 - Sha Lo Wan
AMS4 - San Tau

Noise Monitoring Stations

NMS1 - Sha Lo Wan
NMS4 - San Tau

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Tentative Impact Air Quality and Noise Monitoring Schedule in September 2016**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
				1-Sep	2-Sep	3-Sep
					24 hr TSP 1 hr TSP X 3	
4-Sep	5-Sep	6-Sep	7-Sep	8-Sep	9-Sep	10-Sep
				24 hr TSP 1 hr TSP X 3	Noise	
11-Sep	12-Sep	13-Sep	14-Sep	15-Sep	16-Sep	17-Sep
			24 hr TSP 1 hr TSP X 3	Noise		
18-Sep	19-Sep	20-Sep	21-Sep	22-Sep	23-Sep	24-Sep
		24 hr TSP 1 hr TSP X 3	Noise			
25-Sep	26-Sep	27-Sep	28-Sep	29-Sep	30-Sep	
	24 hr TSP 1 hr TSP X 3	Noise			24 hr TSP 1 hr TSP X 3	

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

Air Quality Monitoring Stations

AMS1 - Sha Lo Wan
AMS4 - San Tau

Noise Monitoring Stations

NMS1 - Sha Lo Wan
NMS4 - San Tau

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Impact Water Quality Monitoring Schedule in August 2016**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
1-May	1-Aug	2-Aug	3-Aug	4-Aug	5-Aug	6-Aug
	<u>Water Quality Monitoring</u> Mid-Ebb 11:41 *Mid-Flood 18:43		<u>Water Quality Monitoring</u> Mid-Ebb 13:09 Mid-Flood 19:59		<u>Water Quality Monitoring</u> Mid-Flood 7:56 Mid-Ebb 14:29	
7-Aug	8-Aug	9-Aug	10-Aug	11-Aug	12-Aug	13-Aug
	<u>Water Quality Monitoring</u> Mid-Flood 9:52 Mid-Ebb 16:10		<u>Water Quality Monitoring</u> Mid-Flood 11:34 Mid-Ebb 17:29		<u>Water Quality Monitoring</u> Mid-Ebb 8:10 Mid-Flood 15:20	
14-Aug	15-Aug	16-Aug	17-Aug	18-Aug	19-Aug	20-Aug
	<u>Water Quality Monitoring</u> Mid-Ebb 10:47 Mid-Flood 18:01		<u>Water Quality Monitoring</u> Mid-Ebb 12:06 Mid-Flood 19:03		<u>Water Quality Monitoring</u> Mid-Ebb 13:28 Mid-Flood 20:09	
21-Aug	22-Aug	23-Aug	24-Aug	25-Aug	26-Aug	27-Aug
	<u>Water Quality Monitoring</u> Mid-Flood 9:21 Mid-Ebb 15:34		<u>Water Quality Monitoring</u> Mid-Flood 11:17 Mid-Ebb 17:13		<u>Water Quality Monitoring</u> Mid-Ebb 7:23 Mid-Flood 14:21	
28-Aug	29-Aug	30-Aug	31-Aug			
	<u>Water Quality Monitoring</u> Mid-Ebb 10:41 Mid-Flood 17:47		<u>Water Quality Monitoring</u> Mid-Ebb 12:12 Mid-Flood 18:54			

*Remark: Cancelled due to adverse weather (Strong Wind Signal No. 3)

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Tentative Impact Water Quality Monitoring Schedule in September 2016**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
1-May				1-Sep	2-Sep	3-Sep
					<u>Water Quality Monitoring</u> Mid-Ebb 13:31 Mid-Flood 19:52	
4-Sep	5-Sep	6-Sep	7-Sep	8-Sep	9-Sep	10-Sep
	<u>Water Quality Monitoring</u> Mid-Flood 8:57 Mid-Ebb 15:09		<u>Water Quality Monitoring</u> Mid-Flood 10:15 Mid-Ebb 16:13			<u>Water Quality Monitoring</u> Mid-Ebb 6:46 Mid-Flood 14:50
11-Sep	12-Sep	13-Sep	14-Sep	15-Sep	16-Sep	17-Sep
	<u>Water Quality Monitoring</u> Mid-Ebb 9:17 Mid-Flood 16:55		<u>Water Quality Monitoring</u> Mid-Ebb 10:55 Mid-Flood 17:55			<u>Water Quality Monitoring</u> Mid-Ebb 13:08 Mid-Flood 19:32
18-Sep	19-Sep	20-Sep	21-Sep	22-Sep	23-Sep	24-Sep
	<u>Water Quality Monitoring</u> Mid-Flood 8:28 Mid-Ebb 14:36		<u>Water Quality Monitoring</u> Mid-Flood 10:13 Mid-Ebb 16:08			<u>Water Quality Monitoring</u> Mid-Ebb 6:43 Mid-Flood 14:24
25-Sep	26-Sep	27-Sep	28-Sep	29-Sep	30-Sep	
	<u>Water Quality Monitoring</u> Mid-Ebb 9:25 Mid-Flood 16:44		<u>Water Quality Monitoring</u> Mid-Ebb 11:11 Mid-Flood 17:50		<u>Water Quality Monitoring</u> Mid-Ebb 12:32 Mid-Flood 18:43	

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Construction-Phase Dolphin Monitoring in West Lantau (Line Transect Vessel Survey) in August 2016**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
	1-Aug	2-Aug	3-Aug	4-Aug	5-Aug	6-Aug
7-Aug	8-Aug	9-Aug	10-Aug	11-Aug	12-Aug	13-Aug
		Line Transect Vessel Survey				
14-Aug	15-Aug	16-Aug	17-Aug	18-Aug	19-Aug	20-Aug
		Line Transect Vessel Survey				
21-Aug	22-Aug	23-Aug	24-Aug	25-Aug	26-Aug	27-Aug
28-Aug	29-Aug	30-Aug	31-Aug			

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Tentative Construction-Phase Dolphin Monitoring in West Lantau (Line Transect Vessel Survey) in September 2016**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
				1-Sep	2-Sep	3-Sep
4-Sep	5-Sep	6-Sep	7-Sep	8-Sep	9-Sep	10-Sep
					Line Transect Vessel Survey	
11-Sep	12-Sep	13-Sep	14-Sep	15-Sep	16-Sep	17-Sep
18-Sep	19-Sep	20-Sep	21-Sep	22-Sep	23-Sep	24-Sep
		Line Transect Vessel Survey				
25-Sep	26-Sep	27-Sep	28-Sep	29-Sep	30-Sep	

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

**Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill
Additional Land-based Dolphin Behaviour and Movement Monitoring in August 2016**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
	1-Aug	2-Aug	3-Aug	4-Aug	5-Aug	6-Aug
7-Aug	8-Aug	9-Aug	10-Aug	11-Aug	12-Aug	13-Aug
				Additional Land-based Dolphin Behaviour and Movement Monitoring		
14-Aug	15-Aug	16-Aug	17-Aug	18-Aug	19-Aug	20-Aug
21-Aug	22-Aug	23-Aug	24-Aug	25-Aug	26-Aug	27-Aug
				Additional Land-based Dolphin Behaviour and Movement Monitoring		
28-Aug	29-Aug	30-Aug	31-Aug			

**APPENDIX E
1-HOUR TSP MONITORING RESULTS
AND GRAPHICAL PRESENTATION**

Appendix E - 1-hour TSP Monitoring Results



Location AMS1 - Sha Lo Wan

Sampling Date	Start Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure, Pa (mmHg)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
					Initial	Final		Initial	Final		Initial	Final			
1-Aug-16	9:00	Cloudy	303.1	753.2	2.8049	2.8070	0.0021	298.7	299.7	1.0	1.21	1.21	1.21	72.5	29
1-Aug-16	10:00	Cloudy	303.3	753.0	2.8040	2.8048	0.0008	299.7	300.7	1.0	1.21	1.21	1.21	72.5	11
1-Aug-16	11:00	Cloudy	303.5	752.8	2.8073	2.8135	0.0062	300.7	301.7	1.0	1.21	1.21	1.21	72.5	86
5-Aug-16	13:00	Sunny	303.0	758.7	2.7918	2.7934	0.0016	325.7	326.7	1.0	1.21	1.21	1.21	72.8	22
5-Aug-16	14:00	Sunny	303.2	758.5	2.7835	2.7843	0.0008	326.7	327.7	1.0	1.21	1.21	1.21	72.8	11
5-Aug-16	15:00	Sunny	303.4	758.3	2.7977	2.7986	0.0009	327.7	328.7	1.0	1.21	1.21	1.21	72.8	12
11-Aug-16	9:00	Rainy	300.7	755.7	2.7929	2.7983	0.0054	353.3	354.3	1.0	1.22	1.22	1.22	73.0	74
11-Aug-16	10:00	Rainy	300.9	755.5	2.7975	2.7979	0.0004	354.3	355.3	1.0	1.22	1.22	1.22	72.9	5
11-Aug-16	11:00	Rainy	301.1	755.3	2.7729	2.7732	0.0003	355.3	356.3	1.0	1.22	1.21	1.21	72.9	4
17-Aug-16	13:00	Cloudy	300.5	746.9	2.7766	2.7781	0.0015	380.3	381.3	1.0	1.21	1.21	1.21	72.5	21
17-Aug-16	14:00	Cloudy	300.7	746.7	2.8028	2.8046	0.0018	381.3	382.3	1.0	1.21	1.21	1.21	72.5	25
17-Aug-16	15:00	Cloudy	300.9	746.5	2.7982	2.7995	0.0013	382.3	383.3	1.0	1.21	1.21	1.21	72.5	18
23-Aug-16	9:00	Sunny	303.4	756.3	2.7853	2.7898	0.0045	407.3	408.3	1.0	1.21	1.21	1.21	72.6	62
23-Aug-16	10:00	Sunny	303.6	756.1	2.7788	2.7824	0.0036	408.3	409.3	1.0	1.21	1.21	1.21	72.6	50
23-Aug-16	11:00	Sunny	303.8	755.9	2.7908	2.7947	0.0039	409.3	410.3	1.0	1.21	1.21	1.21	72.6	54
29-Aug-16	9:00	Cloudy	299.8	757.8	2.8167	2.8169	0.0002	457.8	458.8	1.0	1.22	1.22	1.22	73.2	3
29-Aug-16	10:00	Cloudy	300.0	757.7	2.8341	2.8349	0.0008	458.8	459.8	1.0	1.22	1.22	1.22	73.2	11
29-Aug-16	11:00	Cloudy	300.2	757.5	2.8153	2.8160	0.0007	459.8	460.8	1.0	1.22	1.22	1.22	73.1	10
														Min	3
														Max	86
														Average	28

Location AMS4 - San Tau

Sampling Date	Start Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure, Pa (mmHg)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
					Initial	Final		Initial	Final		Initial	Final			
1-Aug-16	13:00	Cloudy	303.2	751.1	2.7658	2.7696	0.0038	7368.4	7369.4	1.0	1.22	1.22	1.22	73.1	52
1-Aug-16	14:00	Cloudy	303.4	750.9	2.8089	2.8180	0.0091	7369.4	7370.4	1.0	1.22	1.22	1.22	73.0	125
1-Aug-16	15:00	Cloudy	303.6	750.7	2.8161	2.8174	0.0013	7370.4	7371.4	1.0	1.22	1.22	1.22	73.0	18
5-Aug-16	9:00	Sunny	302.8	759.5	2.7963	2.7975	0.0012	7395.4	7396.4	1.0	1.23	1.23	1.23	73.5	16
5-Aug-16	10:00	Sunny	303.0	759.3	2.7869	2.7893	0.0024	7396.4	7397.4	1.0	1.23	1.22	1.22	73.5	33
5-Aug-16	11:00	Sunny	303.2	759.1	2.8023	2.8046	0.0023	7397.4	7398.4	1.0	1.22	1.22	1.22	73.5	31
11-Aug-16	14:00	Cloudy	300.7	754.2	2.7652	2.7661	0.0009	7422.6	7423.6	1.0	1.23	1.23	1.23	73.5	12
11-Aug-16	15:00	Cloudy	300.9	754.0	2.7748	2.7752	0.0004	7423.6	7424.6	1.0	1.23	1.22	1.22	73.5	5
11-Aug-16	16:00	Cloudy	301.1	753.8	2.7796	2.7811	0.0015	7424.6	7425.6	1.0	1.22	1.22	1.22	73.5	20
17-Aug-16	8:30	Cloudy	299.0	748.3	2.7863	2.7898	0.0035	7449.6	7450.6	1.0	1.22	1.22	1.22	73.4	48
17-Aug-16	9:30	Cloudy	299.2	748.1	2.7839	2.7880	0.0041	7450.6	7451.6	1.0	1.22	1.22	1.22	73.4	56
17-Aug-16	10:30	Cloudy	299.4	747.9	2.7836	2.7858	0.0022	7451.6	7452.6	1.0	1.22	1.22	1.22	73.4	30
23-Aug-16	13:00	Sunny	305.5	755.7	2.8114	2.8153	0.0039	7476.6	7477.6	1.0	1.22	1.22	1.22	73.0	53
23-Aug-16	14:00	Sunny	305.7	755.5	2.8015	2.8068	0.0053	7477.6	7478.6	1.0	1.22	1.22	1.22	73.0	73
23-Aug-16	15:00	Sunny	305.9	755.3	2.8013	2.8056	0.0043	7478.6	7479.6	1.0	1.22	1.22	1.22	72.9	59
29-Aug-16	13:00	Cloudy	301.7	755.4	2.8277	2.8286	0.0009	7503.6	7504.6	1.0	1.22	1.22	1.22	73.5	12
29-Aug-16	14:00	Cloudy	301.9	755.2	2.8162	2.8175	0.0013	7504.6	7505.6	1.0	1.22	1.22	1.22	73.4	18
29-Aug-16	15:00	Cloudy	302.1	755.0	2.8115	2.8121	0.0006	7505.6	7506.6	1.0	1.22	1.22	1.22	73.4	8
														Min	5
														Max	125
														Average	37

1-hour TSP Concentration Levels

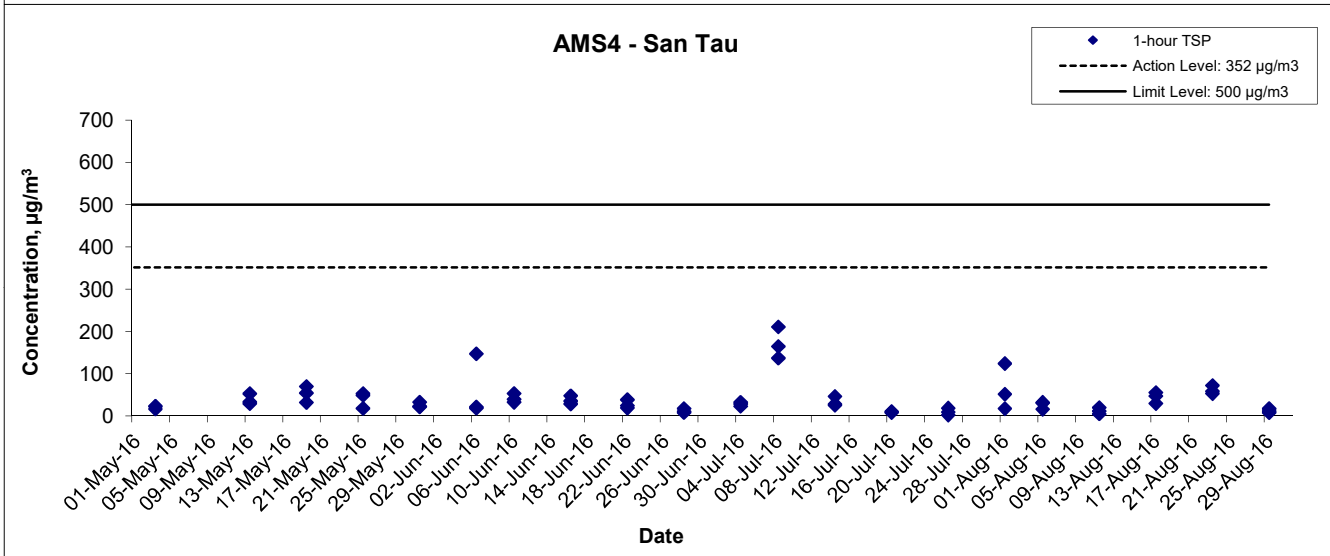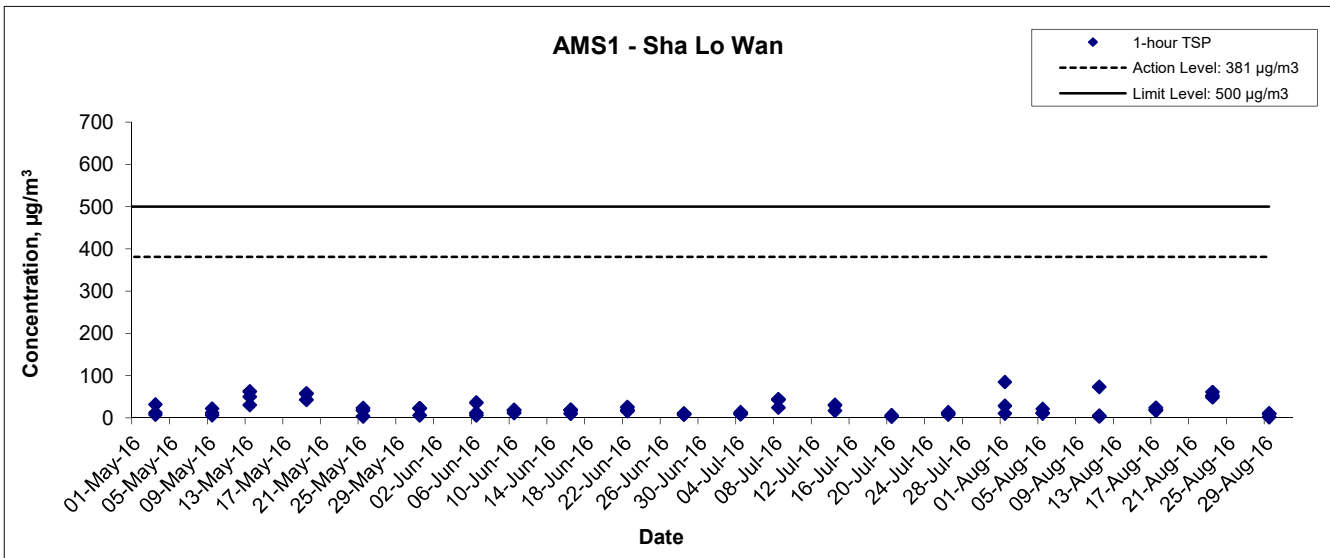

Title Contract No. HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill Graphical Presentation of 1-hour TSP Monitoring Results	Scale N.T.S	Project No. MA12014	
	Date Aug 16	Appendix E	

**APPENDIX F
24-HOUR TSP MONITORING RESULTS
AND GRAPHICAL PRESENTATION**

Appendix F - 24-hour TSP Monitoring Results



Location AMS1 - Sha Lo Wan

Sampling Date	Start Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure, Pa (mmHg)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
					Initial	Final		Initial	Final		Initial	Final			
1-Aug-16	12:00	Cloudy	303.7	752.7	2.7961	2.8112	0.0151	301.7	325.7	24.0	1.21	1.21	1.21	1738.2	9
5-Aug-16	16:00	Sunny	303.6	758.1	2.8149	2.8850	0.0701	328.7	352.7	24.0	1.21	1.21	1.21	1745.2	40
11-Aug-16	12:00	Rainy	301.3	755.1	2.7717	2.7941	0.0224	356.3	380.3	24.0	1.21	1.21	1.21	1748.5	13
17-Aug-16	16:25	Cloudy	301.1	746.3	2.8256	2.8498	0.0242	383.3	407.3	24.0	1.21	1.21	1.21	1738.3	14
23-Aug-16	12:00	Sunny	304.0	755.7	2.7903	2.8630	0.0727	410.3	434.3	24.0	1.21	1.21	1.21	1741.0	42
29-Aug-16	12:00	Cloudy	300.4	757.3	2.8237	2.8839	0.0602	460.8	484.8	24.0	1.22	1.22	1.22	1754.0	34
														Min	9
														Max	42
														Average	25

Location AMS4 - San Tau

Sampling Date	Start Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure, Pa (mmHg)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
					Initial	Final		Initial	Final		Initial	Final			
1-Aug-16	16:00	Cloudy	303.8	750.5	2.7863	2.8580	0.0717	7371.4	7395.4	24.0	1.22	1.22	1.22	1751.0	41
5-Aug-16	12:00	Sunny	303.4	758.9	2.7984	2.8842	0.0858	7398.4	7422.4	24.0	1.22	1.22	1.22	1762.2	49
11-Aug-16	17:00	Cloudy	301.1	753.8	2.7808	2.8698	0.0890	7425.6	7449.6	24.0	1.22	1.22	1.22	1763.0	50
17-Aug-16	11:30	Cloudy	299.6	747.7	2.7862	2.8225	0.0363	7452.6	7476.6	24.0	1.22	1.22	1.22	1760.2	21
23-Aug-16	16:00	Sunny	306.1	755.1	2.8039	2.8868	0.0829	7479.6	7503.6	24.0	1.22	1.21	1.22	1749.7	47
29-Aug-16	16:00	Cloudy	302.3	754.8	2.8165	2.8332	0.0167	7506.6	7530.6	24.0	1.22	1.22	1.22	1760.6	9
														Min	9
														Max	50
														Average	36

24-hour TSP Concentration Levels

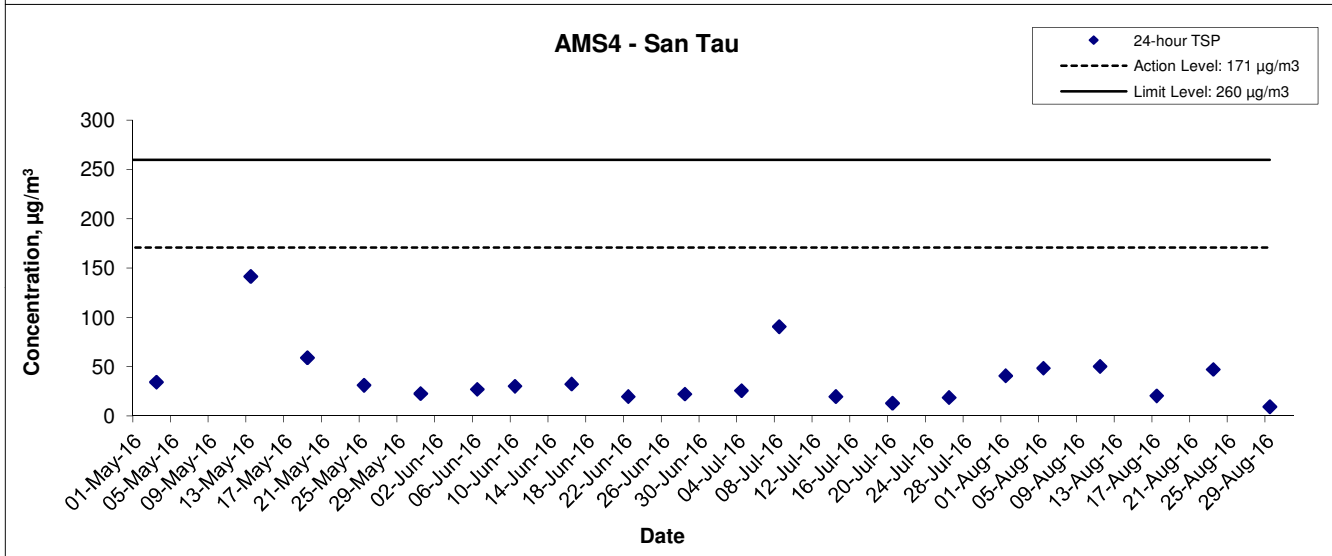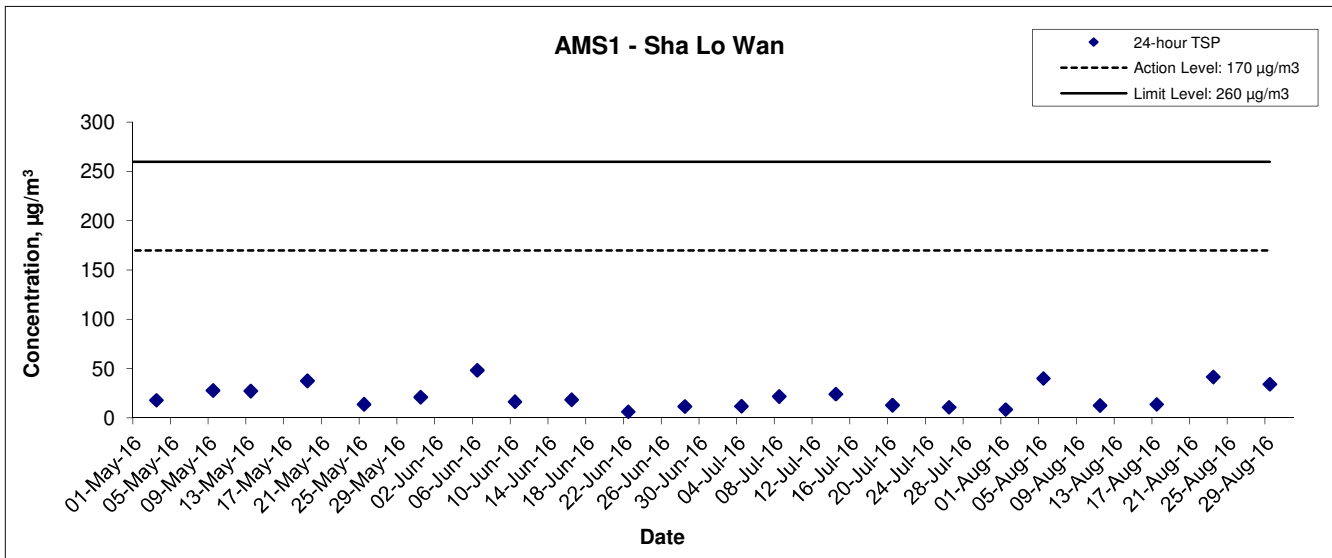

Title Contract No. HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill Graphical Presentation of 24-hour TSP Monitoring Results	Scale N.T.S	Project No. MA12014	CINOTECH
	Date Aug 16	Appendix F	

**APPENDIX G
NOISE MONITORING RESULTS AND
GRAPHICAL PRESENTATION**

Appendix G - Noise Monitoring Results



Location NMS 1 - Sha Lo Wan								
Date	Weather	Time	Unit: dB (A) (5-min)			Average	Baseline Level	Construction Noise Level
			L _{eq}	L ₁₀	L ₉₀	L _{eq}	L _{eq}	L _{eq}
3-Aug-16	Cloudy	14:00	57.2	58.8	55.3	57	66.9	57 Measured ≤ Limit Level
		14:05	57.3	58.6	55.3			
		14:10	56.9	58.9	55.1			
		14:15	57.1	59.7	55.4			
		14:20	57.0	59.2	54.8			
14:25	57.4	59.1	54.9					
12-Aug-16	Cloudy	14:00	58.2	59.7	55.2	58	66.9	58 Measured ≤ Limit Level
		14:05	58.3	59.6	55.4			
		14:10	57.8	59.2	55.1			
		14:15	57.3	58.9	55.2			
		14:20	58.0	59.2	55.3			
14:25	58.2	59.5	55.5					
18-Aug-16	Cloudy	15:55	62.4	64.9	54.9	64	66.9	64 Measured ≤ Limit Level
		16:00	62.1	65.9	56.5			
		16:05	64.7	69.0	55.7			
		16:10	64.7	69.6	56.2			
		16:15	63.7	66.8	55.1			
16:20	65.7	70.3	57.1					
24-Aug-16	Sunny	14:00	62.1	63.4	60.1	62	66.9	62 Measured ≤ Limit Level
		14:05	62.1	62.7	60.4			
		14:10	61.7	62.9	60.5			
		14:15	61.8	62.5	60.8			
		14:20	61.8	63.1	60.4			
14:25	62.3	63.1	60.7					
30-Aug-16	Sunny	13:00	69.1	73.6	50.7	71	66.9	71 Measured ≤ Limit Level
		13:05	69.8	75.1	54.2			
		13:10	70.9	76.1	51.1			
		13:15	71.1	76.1	48.7			
		13:20	72.7	78.6	48.4			
13:25	71.7	77.5	47.8					

Remark: * +3dB(A) Façade correction included

Location NMS 4 - San Tau								
Date	Weather	Time	Unit: dB (A) (5-min)			Average	Baseline Level	Construction Noise Level
			L _{eq}	L ₁₀	L ₉₀	L _{eq}	L _{eq}	L _{eq}
3-Aug-16	Cloudy	16:00	58.1	60.9	57.0	59	56.0	59 Measured ≤ Limit Level
		16:05	58.3	61.2	57.3			
		16:10	58.8	61.4	57.4			
		16:15	58.4	62.0	58.1			
		16:20	58.9	61.7	57.4			
		16:25	58.8	61.5	57.5			
12-Aug-16	Cloudy	17:05	58.1	61.8	57.1	59	56.0	59 Measured ≤ Limit Level
		17:10	58.3	61.7	57.3			
		17:15	58.4	61.3	57.5			
		17:20	58.9	61.5	57.1			
		17:25	58.4	61.5	57.2			
17:30	58.9	61.3	57.5					
18-Aug-16	Cloudy	13:00	55.4	56.3	54.2	57	56.0	57 Measured ≤ Limit Level
		13:05	56.7	58.7	54.2			
		13:10	57.3	59.6	54.0			
		13:15	56.5	58.7	54.1			
		13:20	58.5	61.7	54.1			
13:25	55.9	56.8	54.1					
24-Aug-16	Sunny	9:30	57.4	58.4	55.3	57	56.0	57 Measured ≤ Limit Level
		9:35	57.4	58.1	56.8			
		9:40	58.1	59.2	56.4			
		9:45	56.9	58.3	55.7			
		9:50	56.9	58.4	55.3			
9:55	57.5	58.7	56.1					
30-Aug-16	Sunny	16:00	53.9	55.8	51.6	54	56.0	54 Measured ≤ Limit Level
		16:05	55.1	56.5	51.5			
		16:10	52.3	53.6	48.7			
		16:15	53.3	56.7	52.1			
		16:20	53.5	54.9	50.5			
16:25	54.5	55.8	52.3					

Remark: * +3dB(A) Façade correction included

Noise Levels

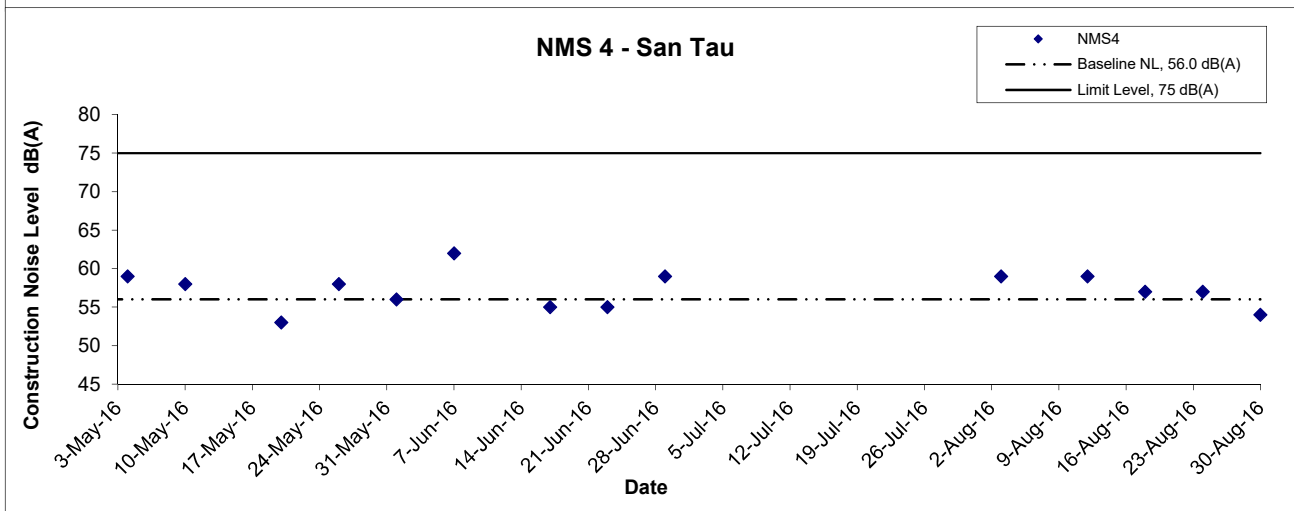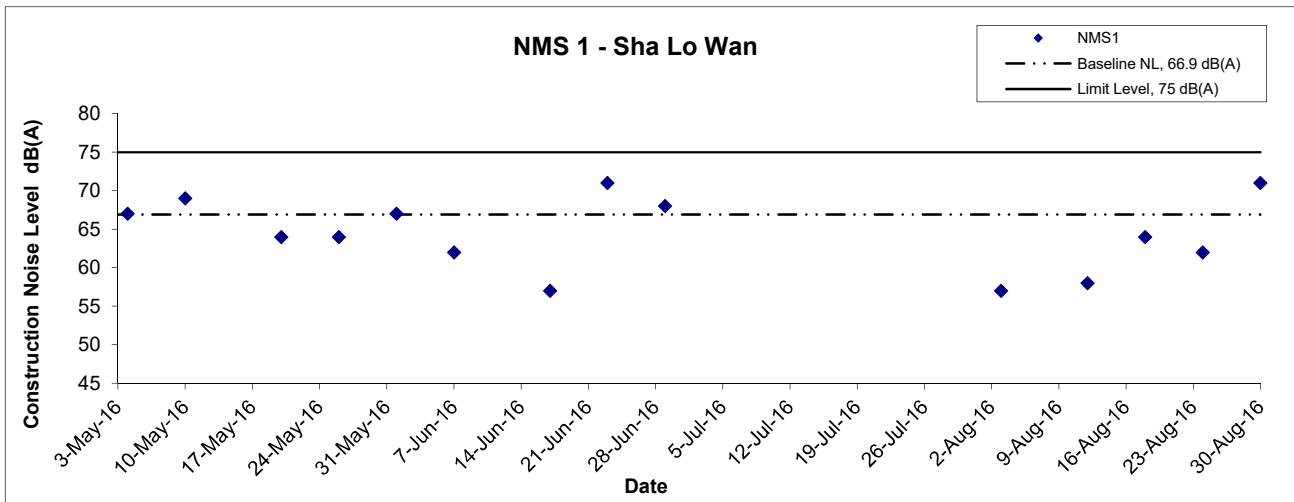

Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill Graphical Presentation of Construction Noise Monitoring Results	Scale	N.T.S	Project No.	MA12014	
	Date	Aug 16	Appendix	G	

**APPENDIX H
WATER QUALITY MONITORING
RESULTS AND GRAPHICAL
PRESENTATION**

Water Quality Monitoring Results at CS1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
1-Aug-16	Cloudy	Moderate	10:59	Surface	1	28.1 28.1	28.1	7.9 7.9	7.9	20.6 20.7	20.7	105.3 104.9	105.1	8.2 8.2	8.2	7.8	4.1 4.1	4.1	4.4	8.3 8.1	8.2	7.8
				Middle	6.5	27.0 27.0	27.0	7.9 7.9	7.9	33.5 33.6	33.6	99.8 99.5	99.7	7.4 7.3	7.4		4.3 4.5	4.4		7.0 8.6	7.8	
				Bottom	12	26.3 26.3	26.3	7.9 7.9	7.9	37.9 37.9	37.9	97.1 96.6	96.9	7.0 7.0	7.0		4.7 4.9	4.8		7.4 7.6	7.5	
3-Aug-16	Rainy	Moderate	12:30	Surface	1	28.0 28.4	28.2	8.0 7.9	8.0	27.5 27.3	27.4	88.7 89.2	89.0	6.0 6.0	6.0	6.2	8.6 8.5	8.6	9.8	8.5 9.5	9.0	9.3
				Middle	6.5	27.2 27.8	27.5	8.1 8.0	8.1	28.4 27.0	27.7	88.3 96.3	92.3	6.0 6.5	6.3		9.7 9.5	9.6		10.0	9.9	
				Bottom	12	27.7 28.1	27.9	8.1 8.0	8.1	27.3 28.0	27.7	88.0 98.4	93.2	6.0 6.6	6.3		11.1 11.2	11.2		10.3 7.7	9.0	
5-Aug-16	Fine	Moderate	14:12	Surface	1	28.0 28.1	28.1	8.0 8.0	8.0	24.7 25.0	24.9	93.5 92.5	93.0	6.4 6.3	6.4	6.4	5.9 5.9	5.9	8.2	4.5 5.0	4.8	4.3
				Middle	5.5	27.9 27.9	27.9	8.0 8.0	8.0	31.2 30.3	30.8	95.1 94.0	94.6	6.3 6.2	6.3		8.1 8.6	8.4		3.3 4.0	3.7	
				Bottom	10	27.7 27.8	27.8	7.9 7.9	7.9	36.8 36.9	36.9	87.1 86.0	86.6	5.6 5.5	5.6		10.3 10.2	10.3		4.6 4.0	4.3	
8-Aug-16	Sunny	Moderate	15:55	Surface	1	28.0 28.0	28.0	7.9 7.9	7.9	29.7 29.7	29.7	115.2 114.5	114.9	7.6 7.6	7.6	7.4	4.5 4.8	4.7	6.4	9.0 6.0	7.5	7.1
				Middle	6	28.2 28.2	28.2	8.0 8.0	8.0	30.5 30.3	30.4	108.4 108.5	108.5	7.1 7.2	7.2		6.3 6.4	6.4		7.3 5.0	6.2	
				Bottom	11	28.3 28.3	28.3	8.1 8.1	8.1	31.8 31.7	31.8	106.3 106.2	106.3	6.9 6.9	6.9		7.9 8.1	8.0		7.9 7.4	7.7	
10-Aug-16	Cloudy	Calm	16:16	Surface	1	27.4 27.6	27.5	7.9 8.1	8.0	27.4 27.8	27.6	87.7 90.2	89.0	6.0 6.1	6.1	6.2	8.1 8.6	8.4	9.7	4.8 4.9	4.9	5.1
				Middle	6.5	27.0 27.6	27.3	7.8 8.0	7.9	27.6 27.6	27.6	93.0 90.9	92.0	6.4 6.1	6.3		9.7 9.3	9.5		6.3 5.5	5.9	
				Bottom	12	27.1 27.0	27.1	8.1 7.9	8.0	27.6 27.7	27.7	92.4 87.9	90.2	6.3 6.0	6.2		11.1 11.2	11.2		4.5 4.7	4.6	
12-Aug-16	Rainy	Moderate	07:49	Surface	1	28.1 28.1	28.1	7.9 7.9	7.9	29.1 29.1	29.1	94.1 93.5	93.8	6.3 6.2	6.3	6.2	5.6 5.3	5.5	6.1	9.5 10.3	9.9	10.8
				Middle	5.5	27.1 26.7	26.9	8.0 8.0	8.0	29.0 28.9	29.0	90.0 90.0	90.0	6.1 6.1	6.1		6.0 6.0	6.0		11.6 9.7	10.7	
				Bottom	10	25.5 25.4	25.5	8.0 8.0	8.0	28.5 28.4	28.5	86.0 86.7	86.4	6.0 6.1	6.1		6.9 6.5	6.7		11.8 11.5	11.7	
15-Aug-16	Rainy	Moderate	10:55	Surface	1	26.6 26.6	26.6	8.0 8.0	8.0	26.7 26.7	26.7	84.7 85.1	84.9	5.9 5.9	5.9	5.9	4.4 4.4	4.4	5.7	7.7 8.2	8.0	8.3
				Middle	5.5	26.0 26.0	26.0	8.0 8.0	8.0	28.8 28.8	28.8	83.5 84.1	83.8	5.8 5.8	5.8		6.0 6.5	6.3		8.0	8.5	
				Bottom	10	25.6 25.6	25.6	7.9 7.9	7.9	30.7 30.8	30.8	79.5 78.8	79.2	5.5 5.4	5.5		6.5 6.0	6.3		8.2 8.5	8.4	
17-Aug-16	Rainy	Rough	12:11	Surface	1	26.9 26.9	26.9	8.0 8.0	8.0	30.9 30.9	30.9	84.4 85.1	84.8	5.7 5.7	5.7	5.8	7.3 6.2	6.8	6.0	11.9 12.8	12.4	13.8
				Middle	6	26.8 26.8	26.8	8.0 8.0	8.0	31.2 31.2	31.2	86.0 85.8	85.9	5.8 5.8	5.8		5.6 5.4	5.5		13.8 16.1	15.0	
				Bottom	11	26.8 26.7	26.8	8.0 8.0	8.0	31.4 31.4	31.4	84.8 83.7	84.3	5.7 5.6	5.7		5.6 5.6	5.6		15.7 12.5	14.1	

Remarks: *DA: Depth-Averaged
 **Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
19-Aug-16	Fine	Moderate	14:00	Surface	1	27.6 27.6	27.6	8.1 8.1	8.1	24.0 24.0	24.0	100.5 101.3	100.9	6.9 7.0	7.0	7.0	8.4 7.3	7.9	7.1	7.8 10.6	9.2	8.6
				Middle	6	27.5 27.5	27.5	8.1 8.1	8.1	24.3 24.3	24.3	102.1 102.0	102.1	7.0 7.0	7.0		6.7 6.5	6.6		10.0 7.4	8.7	
				Bottom	11	27.5 27.4	27.5	8.1 8.1	8.1	24.5 24.5	24.5	101.0 99.9	100.5	7.0 6.9	7.0		6.7 6.7	6.7		6.7 7.2	8.0	
22-Aug-16	Sunny	Calm	14:58	Surface	1	27.6 27.6	27.6	8.0 8.0	8.0	30.8 30.8	30.8	95.9 96.2	96.1	6.4 6.4	6.4	6.5	7.4 7.3	7.4	7.6	6.5 6.6	6.6	7.1
				Middle	6.5	27.6 27.6	27.6	8.0 8.0	8.0	31.1 31.1	31.1	97.3 97.6	97.5	6.5 6.5	6.5		7.3 7.3	7.3		7.7 6.5	7.1	
				Bottom	12	27.6 27.5	27.6	8.0 8.0	8.0	31.2 31.2	31.2	97.6 97.0	97.3	6.5 6.4	6.5		8.2 8.2	8.2		7.1 8.0	7.6	
24-Aug-16	Sunny	Calm	16:54	Surface	1	26.3 26.3	26.3	7.8 7.8	7.8	30.7 30.7	30.7	84.4 84.2	84.3	5.7 5.7	5.7	5.7	6.7 6.3	6.5	7.7	5.3 5.5	5.4	5.8
				Middle	6.5	26.2 26.2	26.2	7.9 7.9	7.9	31.2 31.1	31.2	83.8 83.9	83.9	5.7 5.7	5.7		8.1 8.0	8.1		5.7 6.1	5.9	
				Bottom	12	26.1 26.1	26.1	7.9 7.9	7.9	32.1 32.1	32.1	84.4 84.4	84.4	5.7 5.7	5.7		8.1 8.6	8.4		6.3 5.7	6.0	
26-Aug-16	Cloudy	Moderate	08:17	Surface	1	29.8 29.8	29.8	7.6 7.6	7.6	24.8 24.8	24.8	93.5 94.0	93.8	6.2 6.2	6.2	6.2	3.9 3.9	3.9	5.2	5.7 4.6	5.2	5.3
				Middle	5.5	29.2 29.2	29.2	7.6 7.6	7.6	26.9 26.9	26.9	92.3 92.9	92.6	6.1 6.1	6.1		5.5 6.0	5.8		6.2 5.7	6.0	
				Bottom	10	28.9 28.8	28.9	7.6 7.6	7.6	28.8 28.9	28.9	88.2 87.4	87.8	5.8 5.8	5.8		6.0 5.5	5.8		4.6 5.0	4.8	
29-Aug-16	Cloudy	Moderate	11:15	Surface	1	29.5 29.5	29.5	7.9 7.9	7.9	21.9 21.9	21.9	96.5 95.1	95.8	6.5 6.4	6.5	6.4	4.7 4.8	4.8	4.6	8.1 7.2	7.7	9.8
				Middle	6.5	28.9 29.0	29.0	8.0 8.1	8.1	28.0 27.9	28.0	93.4 93.2	93.3	6.2 6.2	6.2		5.6 4.6	5.1		7.2 8.2	7.7	
				Bottom	12	29.0 29.0	29.0	8.0 8.1	8.1	27.4 27.5	27.5	87.0 86.4	86.7	5.8 5.7	5.8		3.9 4.1	4.0		15.6 12.2	13.9	
31-Aug-16	Cloudy	Rough	12:10	Surface	1	28.2 28.2	28.2	7.9 7.9	7.9	27.4 27.4	27.4	92.5 93.2	92.9	6.2 6.3	6.3	6.3	11.8 10.7	11.3	10.5	8.3 7.0	7.7	7.2
				Middle	6	28.1 28.1	28.1	7.9 7.9	7.9	27.7 27.7	27.7	93.9 94.1	94.0	6.3 6.3	6.3		9.9 10.1	10.0		6.0 5.7	5.9	
				Bottom	11	28.1 28.0	28.1	7.9 7.9	7.9	27.9 27.9	27.9	92.9 91.8	92.4	6.2 6.2	6.2		10.1 10.1	10.1		9.9 6.0	8.0	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
3-Aug-16	Fine	Moderate	18:43	Surface	1	27.2 28.5	27.9	8.0 8.0	8.0	27.9 27.9	27.9	92.9 95.0	94.0	6.3 6.3	6.3	6.3	8.3 8.7	8.5	9.8	11.6 10.5	11.1	9.5		
				Middle	6.5	27.6 27.6	27.6	8.0 8.0	8.0	27.7 27.5	27.6	92.9 90.1	91.5	6.3 6.1	6.2		9.9 9.5			9.7			9.9 9.0	9.5
				Bottom	12	27.6 27.4	27.5	7.9 8.1	8.0	28.4 27.8	28.1	97.2 95.6	96.4	6.5 6.5	6.5		11.2 11.3			11.3			8.3 7.6	8.0
5-Aug-16	Fine	Moderate	08:11	Surface	1	28.2 28.2	28.2	7.9 7.9	7.9	22.5 22.5	22.5	99.2 98.9	99.1	6.8 6.8	6.8	6.6	6.5 6.8	6.7	9.2	2.9 2.3	2.6	3.3		
				Middle	5.5	27.8 27.8	27.8	7.9 7.9	7.9	24.8 25.9	25.4	97.1 91.4	94.3	6.6 6.2	6.4		9.8 9.8			9.8			2.8 4.4	3.6
				Bottom	10	27.5 27.5	27.5	7.8 7.8	7.8	31.5 31.9	31.7	88.5 85.7	87.1	5.9 5.7	5.8		10.9 11.2			11.1			3.4 3.7	3.6
8-Aug-16	Sunny	Moderate	09:18	Surface	1	28.0 28.0	28.0	8.0 8.0	8.0	29.4 29.4	29.4	116.6 115.9	116.3	7.8 7.7	7.8	7.6	5.2 5.0	5.1	7.3	5.4 6.9	6.2	5.8		
				Middle	6	28.2 28.0	28.1	8.2 8.2	8.2	31.0 30.8	30.9	111.2 111.3	111.3	7.3 7.3	7.3		7.2 7.1			7.2			5.8 5.4	5.6
				Bottom	11	28.2 28.2	28.2	8.2 8.3	8.3	31.5 31.7	31.6	106.3 106.9	106.6	7.0 7.0	7.0		9.5 9.6			9.6			5.5 5.5	5.5
10-Aug-16	Rainy	Calm	10:53	Surface	1	27.7 27.8	27.8	8.0 8.0	8.0	26.8 27.3	27.1	87.9 94.5	91.2	6.0 6.4	6.2	6.3	8.4 8.3	8.4	9.6	8.1 7.4	7.8	6.5		
				Middle	6.5	27.6 27.7	27.7	8.0 7.9	8.0	27.3 27.7	27.5	94.9 91.7	93.3	6.4 6.2	6.3		9.5 9.3			9.4			4.8 5.9	5.4
				Bottom	12	27.1 27.6	27.4	8.1 7.9	8.0	27.0 27.5	27.3	89.2 93.8	91.5	6.1 6.3	6.2		10.9 11.1			11.0			4.4 8.3	6.4
12-Aug-16	Rainy	Moderate	15:01	Surface	1	28.5 28.6	28.6	7.9 7.9	7.9	28.5 28.5	28.5	92.9 92.3	92.6	6.2 6.1	6.2	6.2	4.3 4.7	4.5	5.4	12.7 8.6	10.7	10.9		
				Middle	5.5	25.7 25.8	25.8	8.0 8.0	8.0	27.2 27.2	27.2	87.6 87.5	87.6	6.1 6.1	6.1		5.3 5.3			5.3			10.9 13.1	12.0
				Bottom	10	25.1 25.2	25.2	8.0 8.0	8.0	28.0 27.9	28.0	86.4 86.2	86.3	6.1 6.1	6.1		6.1 6.4			6.3			9.1 10.6	9.9
15-Aug-16	Rainy	Moderate	17:21	Surface	1	27.2 27.2	27.2	8.1 8.1	8.1	25.8 25.7	25.8	91.2 90.3	90.8	6.3 6.2	6.3	6.4	3.3 3.6	3.5	4.1	9.8 9.7	9.8	8.7		
				Middle	5.5	26.6 26.5	26.6	8.1 8.1	8.1	28.2 28.2	28.2	92.8 91.7	92.3	6.4 6.3	6.4		4.0 4.8			4.4			7.8 9.0	8.4
				Bottom	10	26.1 26.1	26.1	8.0 8.0	8.0	30.3 30.3	30.3	86.2 87.1	86.7	5.9 6.0	6.0		4.8 3.9			4.4			8.2 7.8	8.0
17-Aug-16	Rainy	Rough	18:01	Surface	1	26.8 26.8	26.8	8.0 8.0	8.0	29.9 29.9	29.9	82.7 83.0	82.9	5.6 5.6	5.6	5.7	5.5 5.4	5.5	5.7	12.1 8.6	10.4	12.1		
				Middle	6.5	26.8 26.8	26.8	8.0 8.0	8.0	30.2 30.1	30.2	84.0 84.3	84.2	5.7 5.7	5.7		5.4 5.4			5.4			9.4 16.0	12.7
				Bottom	12	26.8 26.8	26.8	8.0 8.0	8.0	30.3 30.3	30.3	84.3 83.7	84.0	5.7 5.7	5.7		6.3 6.3			6.3			11.7 14.4	13.1
19-Aug-16	Fine	Moderate	19:03	Surface	1	26.3 26.3	26.3	8.1 8.1	8.1	23.0 23.0	23.0	96.8 97.1	97.0	6.9 6.9	6.9	7.0	6.6 6.5	6.6	6.8	9.9 8.8	9.4	8.0		
				Middle	6.5	26.4 26.4	26.4	8.1 8.1	8.1	23.3 23.3	23.3	98.2 98.4	98.3	6.9 7.0	7.0		6.5 6.5			6.5			7.8 6.0	6.9
				Bottom	12	26.3 26.3	26.3	8.1 8.1	8.1	23.4 23.4	23.4	98.4 97.8	98.1	7.0 6.9	7.0		7.4 7.4			7.4			6.7 8.7	7.7

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
22-Aug-16	Sunny	Calm	09:21	Surface	1	27.6 27.6	27.6	8.1 8.1	8.1	31.8 31.8	31.8	97.7 98.5	98.1	6.5 6.5	6.5	6.6	9.2 8.1	8.7	7.9	5.4 7.8	6.6	7.3	
				Middle	6	27.6 27.6	27.6	8.1 8.1	8.1	32.1 32.1	32.1	99.4 99.2	99.3	6.6 6.5	6.6		7.5 7.3			7.4			8.4 8.5
				Bottom	11	27.5 27.5	27.5	8.1 8.1	8.1	32.3 32.3	32.3	98.2 97.1	97.7	6.5 6.4	6.5		7.5 7.5			7.5			4.7 9.1
24-Aug-16	Sunny	Calm	10:52	Surface	1	26.3 26.3	26.3	7.8 7.8	7.8	30.0 30.0	30.0	84.3 83.4	83.9	5.7 5.7	5.7	5.7	7.2 7.3	7.3	7.7	5.7 6.9	6.3	6.1	
				Middle	6.5	26.2 26.2	26.2	7.9 7.9	7.9	31.7 31.7	31.7	83.9 83.4	83.7	5.7 5.6	5.7		8.0 7.9			8.0			5.4 5.1
				Bottom	12	26.2 26.2	26.2	7.9 7.9	7.9	31.7 31.7	31.7	83.8 83.7	83.8	5.7 5.7	5.7		8.2 7.4			7.8			6.0 7.6
26-Aug-16	Cloudy	Moderate	13:54	Surface	1	30.4 30.4	30.4	7.7 7.7	7.7	23.8 23.8	23.8	111.9 111.0	111.5	7.4 7.3	7.4	7.5	2.8 3.1	3.0	3.6	3.9 4.1	4.0	10.5	
				Middle	5.5	29.8 29.7	29.8	7.7 7.7	7.7	26.2 26.3	26.3	113.6 112.4	113.0	7.5 7.4	7.5		3.5 4.3			3.9			8.7 8.2
				Bottom	10	29.3 29.3	29.3	7.7 7.7	7.7	28.4 28.4	28.4	106.9 107.8	107.4	7.0 7.1	7.1		3.8 3.8			3.8			18.0 20.1
29-Aug-16	Cloudy	Moderate	16:51	Surface	1	29.5 29.5	29.5	7.9 7.9	7.9	22.2 22.1	22.2	90.6 90.1	90.4	6.1 6.1	6.1	6.1	4.1 3.8	4.0	4.9	8.8 9.8	9.3	9.4	
				Middle	6.5	29.4 29.4	29.4	7.9 7.9	7.9	24.4 24.5	24.5	89.8 89.4	89.6	6.0 6.0	6.0		5.1 5.4			5.3			10.6 9.2
				Bottom	12	29.1 29.1	29.1	8.0 8.0	8.0	27.2 27.2	27.2	90.3 90.3	90.3	6.0 6.0	6.0		5.3 5.4			5.4			7.6 10.5
31-Aug-16	Cloudy	Moderate	18:01	Surface	1	28.1 28.1	28.1	7.9 7.9	7.9	26.4 26.4	26.4	90.7 91.0	90.9	6.1 6.1	6.1	6.2	10.0 9.9	10.0	10.2	7.3 9.4	8.4	9.6	
				Middle	6.5	28.1 28.1	28.1	7.9 7.9	7.9	26.6 26.7	26.7	92.4 92.1	92.3	6.2 6.2	6.2		9.9 9.9			9.9			10.8 9.2
				Bottom	12	28.1 28.1	28.1	7.9 7.9	7.9	26.8 26.8	26.8	92.4 91.7	92.1	6.2 6.2	6.2		10.8 10.8			10.8			10.1 10.7

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
1-Aug-16	Cloudy	Moderate	10:12	Surface	1	27.4 28.8	28.1	7.8 7.9	7.9	27.1 32.1	29.6	105.0 93.5	99.3	7.2 6.0	6.6	6.7	4.8 4.9	4.9	7.0	8.3 9.0	8.7	8.3
				Middle	4	27.5 27.9	27.7	7.9 7.8	7.9	27.9 28.0	28.0	95.4 102.6	99.0	6.5 6.9	6.7		7.4 7.5	7.5		8.3 7.6	8.0	
				Bottom	7	27.6 28.2	27.9	7.8 7.9	7.9	31.7 33.3	32.5	106.3 96.6	101.5	7.0 6.3	6.7		8.7 8.5	8.6		7.6 8.7	8.2	
3-Aug-16	Rainy	Moderate	11:59	Surface	1	27.6 27.6	27.6	8.0 8.0	8.0	28.0 28.2	28.1	89.3 88.6	89.0	6.0 6.0	6.0	6.0	7.2 8.0	7.6	10.2	17.0 16.0	16.5	15.3
				Middle	4	27.6 27.6	27.6	8.0 8.0	8.0	28.2 28.2	28.2	88.6 88.3	88.5	6.0 6.0	6.0		10.2 9.9	10.1		14.0 14.7	14.4	
				Bottom	7	27.6 27.6	27.6	8.0 8.1	8.1	28.4 28.6	28.5	90.0 89.6	89.8	6.1 6.0	6.1		12.8 12.7	12.8		16.1 13.7	14.9	
5-Aug-16	Fine	Moderate	13:19	Surface	1	27.9 27.9	27.9	7.9 7.9	7.9	27.3 26.0	26.7	95.8 96.6	96.2	6.5 6.6	6.6	6.5	4.3 4.4	4.4	5.2	3.2 4.2	3.7	4.2
				Middle	4	27.4 27.4	27.4	8.0 8.0	8.0	31.5 29.8	30.7	94.8 94.1	94.5	6.3 6.3	6.3		5.1 4.9	5.0		3.6 4.8	4.2	
				Bottom	7	27.4 27.4	27.4	8.0 8.0	8.0	31.9 31.9	31.9	87.4 87.4	87.4	5.8 5.8	5.8		6.0 6.3	6.2		4.0 5.6	4.8	
8-Aug-16	Sunny	Moderate	15:19	Surface	1	27.9 27.0	27.5	8.1 8.1	8.1	30.2 30.6	30.4	115.5 110.0	112.8	7.7 7.4	7.6	7.4	6.0 4.9	5.5	7.1	5.6 6.6	6.1	5.1
				Middle	3.5	27.9 27.0	27.5	8.1 8.1	8.1	29.9 30.6	30.3	104.7 109.9	107.3	7.0 7.4	7.2		7.4 7.2	7.3		4.6 6.2	5.4	
				Bottom	6	28.0 27.1	27.6	8.1 8.1	8.1	29.8 30.6	30.2	103.8 110.0	106.9	6.9 7.4	7.2		8.4 8.7	8.6		3.6 3.9	3.8	
10-Aug-16	Cloudy	Calm	16:05	Surface	1	28.2 28.2	28.2	8.0 8.0	8.0	26.3 26.3	26.3	102.5 102.6	102.6	6.9 6.9	6.9	6.6	7.0 7.0	7.0	9.4	2.9 3.0	3.0	3.2
				Middle	4	27.2 27.2	27.2	8.1 8.1	8.1	26.0 26.1	26.1	91.5 90.4	91.0	6.3 6.2	6.3		9.2 9.2	9.2		3.3 3.2	3.3	
				Bottom	7	25.3 25.3	25.3	8.1 8.2	8.2	28.6 28.6	28.6	78.8 78.1	78.5	5.5 5.5	5.5		11.9 12.1	12.0		3.8 3.0	3.4	
12-Aug-16	Rainy	Moderate	07:23	Surface	1	27.5 27.5	27.5	8.2 8.2	8.2	27.2 27.4	27.3	98.7 98.2	98.5	6.7 6.7	6.7	6.5	3.2 3.6	3.4	4.8	3.9 3.0	3.5	2.8
				Middle	4	26.2 26.2	26.2	8.1 8.1	8.1	29.8 29.8	29.8	89.2 90.8	90.0	6.1 6.2	6.2		4.0 4.2	4.1		2.7 2.6	2.7	
				Bottom	7	26.1 26.1	26.1	8.0 8.0	8.0	29.8 29.8	29.8	90.2 92.4	91.3	6.2 6.3	6.3		6.7 7.1	6.9		1.8 2.5	2.2	
15-Aug-16	Rainy	Moderate	10:04	Surface	1	26.9 26.9	26.9	7.9 7.9	7.9	27.8 27.7	27.8	87.7 87.2	87.5	6.0 6.0	6.0	6.1	6.5 6.7	6.6	7.4	8.3 10.8	9.6	10.0
				Middle	4	26.6 26.6	26.6	7.9 7.9	7.9	30.0 30.0	30.0	89.4 88.8	89.1	6.1 6.0	6.1		7.0 6.8	6.9		9.5 12.1	10.8	
				Bottom	7	26.6 26.6	26.6	7.9 7.9	7.9	30.1 30.1	30.1	90.3 89.7	90.0	6.1 6.1	6.1		8.7 8.7	8.7		9.0 10.4	9.7	
17-Aug-16	Rainy	Rough	11:17	Surface	1	26.8 26.8	26.8	8.0 8.0	8.0	30.5 30.5	30.5	82.8 81.9	82.4	5.6 5.5	5.6	5.5	6.5 6.3	6.4	7.3	13.9 11.9	12.9	12.5
				Middle	4	26.7 26.7	26.7	8.0 8.0	8.0	30.7 30.7	30.7	80.0 79.5	79.8	5.4 5.4	5.4		7.4 7.5	7.5		12.0 15.2	13.6	
				Bottom	7	26.7 26.7	26.7	8.0 8.0	8.0	30.9 31.0	31.0	76.5 76.0	76.3	5.2 5.1	5.2		8.0 7.9	8.0		10.7 11.3	11.0	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)		Turbidity(NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
19-Aug-16	Fine	Moderate	13:12	Surface	1	27.5 27.6	27.6	8.0 8.0	8.0	18.4 19.1	18.8	82.7 81.9	82.3	5.9 5.8	5.9	6.0	7.9 7.8	7.9	10.1	9.1 8.1	8.6	8.0
				Middle	4	27.4 27.3	27.4	8.0 8.0	8.0	22.2 21.8	22.0	87.6 87.3	87.5	6.1 6.1	6.1		10.3 10.0	10.2		7.4 7.3	7.4	
				Bottom	7	27.2 27.3	27.3	7.9 7.9	7.9	24.6 24.2	24.4	91.9 90.7	91.3	6.4 6.3	6.4		12.3 11.9	12.1		7.1 8.7	7.9	
22-Aug-16	Sunny	Calm	14:18	Surface	1	27.1 27.1	27.1	8.0 8.0	8.0	31.5 31.4	31.5	82.5 81.4	82.0	5.5 5.4	5.5	5.4	4.9 4.8	4.9	5.4	4.6 5.5	5.1	6.2
				Middle	4	27.0 27.0	27.0	8.0 8.0	8.0	31.5 31.6	31.6	79.1 78.2	78.7	5.3 5.2	5.3		4.5 5.0	4.8		7.5 8.0	8.1	
				Bottom	7	26.9 26.9	26.9	8.0 8.0	8.0	31.6 31.6	31.6	76.7 76.3	76.5	5.1 5.1	5.1		6.5 6.7	6.6		6.5 4.1	5.3	
24-Aug-16	Sunny	Calm	16:00	Surface	1	26.3 26.3	26.3	7.9 7.9	7.9	31.3 31.4	31.4	81.0 80.9	81.0	5.5 5.5	5.5	5.5	5.6 6.5	6.1	6.7	8.0 7.2	7.6	7.8
				Middle	4	26.3 26.3	26.3	7.9 7.9	7.9	31.4 31.4	31.4	80.2 80.1	80.2	5.4 5.4	5.4		6.6 8.2	7.4		6.8 8.0	7.4	
				Bottom	7	26.3 26.3	26.3	7.9 7.9	7.9	31.4 31.4	31.4	79.5 79.4	79.5	5.4 5.4	5.4		6.6 6.7	6.7		8.5 8.5	8.5	
26-Aug-16	Cloudy	Moderate	07:12	Surface	1	30.1 30.0	30.1	7.3 7.3	7.3	22.1 22.3	22.2	105.7 104.1	104.9	7.1 7.0	7.1	6.8	6.5 6.2	6.4	6.8	6.2 5.1	5.7	6.5
				Middle	4	29.3 29.3	29.3	7.4 7.4	7.4	24.5 24.8	24.7	97.6 96.7	97.2	6.5 6.5	6.5		5.8 5.5	5.7		5.4 7.6	6.5	
				Bottom	7	27.3 27.3	27.3	7.5 7.4	7.5	29.0 29.1	29.1	79.0 79.9	79.5	5.3 5.4	5.4		8.1 8.3	8.2		5.8 8.9	7.4	
29-Aug-16	Cloudy	Moderate	10:11	Surface	1	29.7 29.7	29.7	7.9 7.8	7.9	20.0 20.1	20.1	92.4 92.6	92.5	6.3 6.3	6.3	6.0	2.4 2.6	2.5	5.1	6.3 6.7	6.5	6.2
				Middle	4	26.5 26.5	26.5	7.8 7.8	7.8	27.6 27.6	27.6	81.9 81.0	81.5	5.6 5.6	5.6		5.8 5.9	5.9		5.5 6.1	5.8	
				Bottom	7	26.4 26.4	26.4	7.8 7.8	7.8	28.9 28.9	28.9	76.8 76.8	76.8	5.3 5.3	5.3		6.6 7.1	6.9		7.0 5.5	6.3	
31-Aug-16	Cloudy	Rough	11:08	Surface	1	28.5 28.5	28.5	7.8 7.8	7.8	24.6 24.6	24.6	91.7 91.2	91.5	6.2 6.2	6.2	6.0	11.9 11.8	11.9	11.1	17.1 16.6	16.9	17.7
				Middle	4	28.2 28.2	28.2	7.7 7.7	7.7	28.0 28.1	28.1	85.4 83.7	84.6	5.7 5.6	5.7		11.4 11.2	11.3		16.6 20.0	18.3	
				Bottom	7	27.9 27.9	27.9	7.5 7.5	7.5	28.5 28.5	28.5	77.6 76.4	77.0	5.2 5.1	5.2		10.1 10.0	10.1		17.9 18.0	18.0	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
3-Aug-16	Fine	Moderate	18:31	Surface	1	27.6 27.7	27.7	8.1 8.1	8.1	26.3 26.8	26.6	97.3 94.5	95.9	6.6 6.4	6.5	6.5	8.1 9.0	8.6	10.2	15.7 12.0	13.9	13.9		
				Middle	4	27.8 27.7	27.8	8.1 8.1	8.1	27.6 27.1	27.4	95.7 94.3	95.0	6.4 6.4	6.4		10.7 10.5			10.6			14.2 14.5	14.4
				Bottom	7	28.1 28.0	28.1	8.1 8.1	8.1	28.8 28.6	28.7	92.5 92.2	92.4	6.2 6.2	6.2		11.0 11.9			11.5			12.9 13.7	13.3
5-Aug-16	Fine	Moderate	06:53	Surface	1	28.2 28.2	28.2	8.1 8.1	8.1	26.9 26.9	26.9	92.1 92.1	92.1	6.2 6.2	6.2	6.1	4.2 3.7	4.0	4.8	5.6 4.8	5.2	5.0		
				Middle	4	27.6 27.6	27.6	8.1 8.1	8.1	29.5 29.5	29.5	89.6 87.8	88.7	6.0 5.9	6.0		4.8 4.5			4.7			3.3 5.2	4.3
				Bottom	7	27.6 27.6	27.6	8.1 8.1	8.1	29.7 29.7	29.7	85.7 85.6	85.7	5.7 5.7	5.7		5.8 5.5			5.7			6.3 4.9	5.6
8-Aug-16	Sunny	Moderate	09:42	Surface	1	27.2 27.2	27.2	8.1 8.1	8.1	30.8 30.8	30.8	118.4 118.4	118.4	7.9 7.9	7.9	8.3	5.9 5.9	5.9	6.6	3.0 3.6	3.3	3.2		
				Middle	3.5	27.2 28.1	27.7	8.1 8.1	8.1	30.8 30.8	30.8	128.1 129.9	129.0	8.6 8.6	8.6		5.9 6.0			6.0			2.5 4.0	3.3
				Bottom	6	27.2 28.1	27.7	8.1 8.1	8.1	30.8 30.8	30.8	102.4 119.9	111.2	6.8 7.9	7.4		7.8 7.9			7.9			3.1 2.9	3.0
10-Aug-16	Rainy	Calm	10:12	Surface	1	28.0 28.0	28.0	7.9 7.9	7.9	26.1 26.6	26.4	101.1 101.7	101.4	6.8 6.9	6.9	6.2	5.6 5.5	5.6	7.6	6.1 6.0	6.1	4.5		
				Middle	4	26.8 26.6	26.7	7.9 7.9	7.9	26.5 27.4	27.0	79.3 78.3	78.8	5.5 5.4	5.5		8.1 8.0			8.1			2.5 5.4	4.0
				Bottom	7	25.9 25.9	25.9	7.9 7.9	7.9	27.7 27.8	27.8	70.5 69.5	70.0	4.9 4.8	4.9		9.1 9.3			9.2			2.9 3.9	3.4
12-Aug-16	Rainy	Moderate	14:13	Surface	1	26.6 26.6	26.6	7.9 7.9	7.9	26.1 26.1	26.1	94.1 93.6	93.9	6.5 6.5	6.5	6.4	6.3 6.4	6.4	7.1	3.5 2.9	3.2	2.7		
				Middle	4	26.0 26.0	26.0	7.9 7.9	7.9	28.3 28.2	28.3	91.3 90.4	90.9	6.3 6.3	6.3		7.3 7.0			7.2			2.7 1.8	2.3
				Bottom	7	25.8 25.8	25.8	8.0 8.1	8.1	30.0 29.9	30.0	93.6 94.4	94.0	6.4 6.5	6.5		7.6 7.5			7.6			2.2 3.2	2.7
15-Aug-16	Rainy	Moderate	16:34	Surface	1	26.7 26.7	26.7	7.9 7.9	7.9	29.4 29.5	29.5	85.1 85.9	85.5	5.8 5.8	5.8	5.9	6.6 6.3	6.5	7.3	8.4 7.1	7.8	8.7		
				Middle	4	26.3 26.3	26.3	7.9 7.9	7.9	30.9 30.9	30.9	87.7 87.3	87.5	5.9 5.9	5.9		5.8 6.7			6.3			8.7 10.6	9.7
				Bottom	7	26.3 26.3	26.3	7.9 7.9	7.9	30.9 30.9	30.9	91.9 91.6	91.8	6.2 6.2	6.2		9.0 9.1			9.1			7.0 10.2	8.6
17-Aug-16	Rainy	Rough	17:36	Surface	1	26.6 26.7	26.7	8.1 8.1	8.1	30.6 30.6	30.6	92.2 91.9	92.1	6.2 6.2	6.2	6.2	5.9 5.8	5.9	7.2	12.3 11.7	12.0	10.8		
				Middle	4	26.2 26.2	26.2	8.1 8.1	8.1	30.7 30.7	30.7	90.8 89.3	90.1	6.2 6.1	6.2		6.4 6.4			6.4			9.7 9.5	9.6
				Bottom	7	26.2 26.2	26.2	8.0 8.1	8.1	30.8 30.8	30.8	84.3 83.5	83.9	5.7 5.7	5.7		9.1 9.6			9.4			9.4 12.4	10.9
19-Aug-16	Fine	Moderate	18:40	Surface	1	26.9 26.9	26.9	8.0 7.9	8.0	22.0 22.2	22.1	81.6 80.9	81.3	5.8 5.7	5.8	5.9	7.1 6.9	7.0	9.1	7.3 7.6	7.5	7.7		
				Middle	4	26.7 26.7	26.7	8.0 8.0	8.0	24.1 24.0	24.1	85.2 83.9	84.6	6.0 5.9	6.0		9.5 9.7			9.6			6.4 8.2	7.3
				Bottom	7	26.5 26.7	26.6	8.0 8.0	8.0	27.4 27.1	27.3	90.0 89.4	89.7	6.2 6.2	6.2		11.0 10.3			10.7			7.4 9.4	8.4

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at CS2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
22-Aug-16	Sunny	Calm	08:22	Surface	1	27.0 27.0	27.0	8.0 8.0	8.0	30.5 30.5	30.5	89.3 88.6	89.0	6.0 6.0	6.0	5.9	3.8 3.6	3.7	4.6	9.3 10.5	9.9	9.9
				Middle	4	27.0 27.0	27.0	8.0 8.0	8.0	30.6 30.7	30.7	86.5 86.2	86.4	5.8 5.8	5.8		3.7 4.0	3.9		12.1 9.0	10.6	
				Bottom	7	26.9 26.9	26.9	8.1 8.0	8.1	30.9 30.9	30.9	83.2 82.7	83.0	5.6 5.6	5.6	6.3 6.1	6.2	9.7 8.5		9.1		
24-Aug-16	Sunny	Calm	09:53	Surface	1	26.2 26.2	26.2	7.9 7.9	7.9	30.2 30.1	30.2	84.7 84.6	84.7	5.8 5.8	5.8	5.8	5.5 5.6	5.6	6.8	4.6 6.9	5.8	6.1
				Middle	4	26.2 26.2	26.2	7.9 7.9	7.9	30.2 30.2	30.2	84.3 84.2	84.3	5.8 5.7	5.8		7.3 6.8	7.1		6.7 6.7	6.7	
				Bottom	7	26.2 26.2	26.2	7.9 7.9	7.9	30.2 30.2	30.2	84.2 84.0	84.1	5.7 5.7	5.7	7.6 7.8	7.7	5.4 6.1		5.8		
26-Aug-16	Cloudy	Moderate	13:24	Surface	1	30.2 30.2	30.2	7.6 7.6	7.6	20.4 20.4	20.4	105.3 106.2	105.8	7.1 7.2	7.2	6.8	6.7 6.4	6.6	7.2	3.7 4.3	4.0	4.3
				Middle	4	29.2 29.2	29.2	7.6 7.6	7.6	22.3 22.3	22.3	93.1 92.5	92.8	6.3 6.3	6.3		4.9 5.0	5.0		5.6 4.3	5.0	
				Bottom	7	27.4 27.4	27.4	7.6 7.6	7.6	27.7 27.7	27.7	79.5 79.1	79.3	5.4 5.4	5.4	9.9 10.0	10.0	3.9 4.0		4.0		
29-Aug-16	Cloudy	Moderate	16:26	Surface	1	28.3 28.3	28.3	8.0 8.0	8.0	23.9 24.1	24.0	92.3 91.9	92.1	6.3 6.3	6.3	6.1	4.2 4.5	4.4	5.3	11.7 12.3	12.0	10.5
				Middle	4	27.3 27.3	27.3	7.8 7.8	7.8	23.6 23.6	23.6	84.8 84.6	84.7	5.9 5.9	5.9		4.4 4.4	4.4		11.3 10.5	10.9	
				Bottom	7	26.8 26.7	26.8	7.8 7.8	7.8	27.6 27.6	27.6	81.0 79.6	80.3	5.6 5.5	5.6	7.3 6.9	7.1	9.0 8.0		8.5		
31-Aug-16	Cloudy	Moderate	17:28	Surface	1	28.5 28.5	28.5	7.9 7.9	7.9	21.4 21.3	21.4	94.9 94.1	94.5	6.5 6.5	6.5	6.0	11.7 12.3	12.0	11.5	18.1 18.4	18.3	17.5
				Middle	4	27.9 27.9	27.9	7.9 7.9	7.9	28.0 27.9	28.0	82.4 80.5	81.5	5.5 5.4	5.5		9.7 9.7	9.7		15.9 19.5	17.7	
				Bottom	7	27.5 27.5	27.5	7.7 7.7	7.7	29.4 29.4	29.4	79.0 77.2	78.1	5.3 5.2	5.3	12.8 12.8	12.8	18.8 14.2		16.5		

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
1-Aug-16	Cloudy	Moderate	11:12	Surface	1	27.7 27.9	27.8	7.7 7.8	7.8	30.4 28.8	29.6	87.5 95.2	91.4	5.8 6.4	6.1	6.6	6.3 5.9	6.1	8.0	8.6 8.8	8.7	8.6		
				Middle	5.5	27.5 27.2	27.4	7.9 7.8	7.9	30.1 28.5	29.3	104.0 105.4	104.7	7.0 7.1	7.1		8.5 8.7			8.6			6.8 9.8	8.3
				Bottom	10	28.2 28.2	28.2	7.8 7.8	7.8	26.9 32.4	29.7	87.5 92.8	90.2	5.9 6.1	6.0		8.8 9.6			9.2			8.7 8.8	8.8
3-Aug-16	Rainy	Moderate	13:08	Surface	1	26.9 26.9	26.9	8.1 8.1	8.1	27.1 27.1	27.1	86.5 85.0	85.8	5.9 5.8	5.9	5.9	8.8 9.1	9.0	10.2	16.2 14.6	15.4	14.7		
				Middle	5	27.1 27.1	27.1	8.1 8.1	8.1	27.7 27.7	27.7	86.1 84.6	85.4	5.9 5.8	5.9		9.4 9.3			9.4			13.8 13.1	13.5
				Bottom	9	27.6 27.6	27.6	8.1 8.1	8.1	28.9 28.9	28.9	83.3 83.5	83.4	5.6 5.6	5.6		12.1 12.4			12.3			14.5 15.6	15.1
5-Aug-16	Fine	Moderate	14:12	Surface	1	27.9 27.9	27.9	8.0 8.0	8.0	26.6 27.9	27.3	98.3 98.5	98.4	6.7 6.6	6.7	6.7	4.7 4.5	4.6	5.6	3.5 5.0	4.3	4.5		
				Middle	5	27.9 27.9	27.9	8.0 8.0	8.0	28.1 28.1	28.1	99.9 100.1	100.0	6.7 6.7	6.7		5.3 5.0			5.2			3.7 5.2	4.5
				Bottom	9	27.5 27.5	27.5	8.1 8.1	8.1	31.2 29.6	30.4	90.2 90.0	90.1	6.0 6.0	6.0		7.2 7.0			7.1			3.9 5.3	4.6
8-Aug-16	Sunny	Moderate	16:19	Surface	1	27.0 28.0	27.5	8.1 8.1	8.1	29.8 30.3	30.1	110.6 107.7	109.2	7.5 7.1	7.3	7.5	4.7 3.8	4.3	6.1	4.2 4.1	4.2	5.1		
				Middle	4.5	28.2 28.1	28.2	8.1 8.1	8.1	30.4 30.3	30.4	113.2 115.7	114.5	7.5 7.6	7.6		6.4 6.2			6.3			4.6 6.0	5.3
				Bottom	8	28.0 28.0	28.0	8.1 8.1	8.1	30.4 30.3	30.4	112.7 115.5	114.1	7.5 7.6	7.6		7.7 7.7			7.7			7.0 4.6	5.8
10-Aug-16	Cloudy	Calm	17:08	Surface	1	27.8 27.7	27.8	8.0 8.0	8.0	24.8 25.7	25.3	96.0 95.7	95.9	6.6 6.5	6.6	6.3	7.0 7.1	7.1	8.8	5.0 2.5	3.8	3.4		
				Middle	4.5	25.5 25.4	25.5	8.0 8.0	8.0	26.9 26.8	26.9	84.1 83.7	83.9	5.9 5.9	5.9		8.3 8.5			8.4			2.7 4.1	3.4
				Bottom	8	24.9 24.9	24.9	8.1 8.1	8.1	29.1 29.1	29.1	82.1 80.8	81.5	5.8 5.7	5.8		10.5 11.2			10.9			2.9 3.3	3.1
12-Aug-16	Rainy	Moderate	08:28	Surface	1	27.5 27.5	27.5	8.0 8.0	8.0	28.4 28.4	28.4	98.7 98.1	98.4	6.7 6.6	6.7	6.7	3.6 4.0	3.8	4.9	3.5 3.0	3.3	3.0		
				Middle	5.5	26.1 26.1	26.1	8.0 8.0	8.0	30.4 30.3	30.4	97.8 96.6	97.2	6.7 6.6	6.7		4.6 5.0			4.8			2.2 2.9	2.6
				Bottom	10	25.9 25.9	25.9	8.0 8.0	8.0	31.5 31.5	31.5	96.3 96.1	96.2	6.6 6.5	6.6		6.4 5.7			6.1			2.8 3.2	3.0
15-Aug-16	Rainy	Moderate	11:08	Surface	1	27.1 27.2	27.2	8.0 8.0	8.0	28.8 28.7	28.8	84.7 83.7	84.2	5.7 5.7	5.7	5.9	5.2 4.8	5.0	7.4	8.4 9.8	9.1	8.6		
				Middle	5	26.7 26.7	26.7	8.0 8.0	8.0	30.3 30.4	30.4	88.0 87.6	87.8	6.0 5.9	6.0		7.7 7.4			7.6			8.7 9.6	9.2
				Bottom	9	26.5 26.5	26.5	8.0 8.0	8.0	31.1 31.2	31.2	88.1 88.1	88.1	6.0 6.0	6.0		9.1 9.8			9.5			8.0 7.1	7.6
17-Aug-16	Rainy	Rough	12:36	Surface	1	27.0 27.0	27.0	8.1 8.1	8.1	31.1 31.1	31.1	91.1 90.3	90.7	6.1 6.1	6.1	6.1	5.8 5.9	5.9	6.8	11.6 10.0	10.8	10.4		
				Middle	5	26.7 26.7	26.7	8.1 8.1	8.1	31.1 31.1	31.1	89.5 88.4	89.0	6.0 6.0	6.0		6.1 6.3			6.2			9.8 10.1	10.0
				Bottom	9	26.6 26.6	26.6	8.1 8.1	8.1	31.4 31.4	31.4	85.4 84.5	85.0	5.7 5.7	5.7		8.0 8.6			8.3			10.5 10.5	10.5

Remarks: *DA: Depth-Averaged
 **Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
19-Aug-16	Fine	Moderate	14:08	Surface	1	27.5 27.5	27.5	8.1 8.1	8.1	20.8 20.6	20.7	90.9 89.7	90.3	6.4 6.3	6.4	6.3	9.0 9.2	9.1	10.7	8.0 8.2	8.1	8.0		
				Middle	5	27.4 27.3	27.4	8.0 8.1	8.1	22.2 22.3	22.3	89.7 87.4	88.6	6.3 6.1	6.2		10.7 11.1			6.8 9.1			8.0	
				Bottom	9	27.2 27.1	27.2	8.1 8.1	8.1	24.4 24.8	24.6	88.9 86.7	87.8	6.2 6.0	6.1		11.8 12.2			7.9 7.7			7.8	
22-Aug-16	Sunny	Calm	15:36	Surface	1	27.1 27.1	27.1	8.0 8.0	8.0	31.5 31.4	31.5	83.6 82.2	82.9	5.6 5.5	5.6	5.5	4.4 4.4	4.4	4.9	5.5 4.8	5.2	5.0		
				Middle	5	27.0 27.0	27.0	8.0 8.0	8.0	31.5 31.6	31.6	80.8 80.2	80.5	5.4 5.4	5.4		4.7 4.3			4.5			4.7 4.7	
				Bottom	9	26.9 26.9	26.9	8.0 8.0	8.0	31.6 31.6	31.6	79.4 79.4	79.4	5.3 5.3	5.3		5.8 5.6			5.7			5.2 4.8	5.0
24-Aug-16	Sunny	Calm	17:11	Surface	1	26.2 26.1	26.2	7.8 7.9	7.9	30.4 30.4	30.4	83.6 83.6	83.6	5.7 5.7	5.7	5.7	4.1 3.7	3.9	5.8	6.4 6.6	6.5	6.9		
				Middle	5.5	26.2 26.2	26.2	7.9 7.9	7.9	30.7 30.7	30.7	83.5 83.3	83.4	5.7 5.7	5.7		5.7 6.2			6.0			7.5 7.5	7.5
				Bottom	10	26.2 26.2	26.2	7.9 7.9	7.9	30.8 30.8	30.8	82.8 82.9	82.9	5.6 5.6	5.6		7.5 7.7			7.6			6.7 6.8	6.8
26-Aug-16	Cloudy	Moderate	08:06	Surface	1	30.5 30.5	30.5	7.7 7.7	7.7	21.7 21.7	21.7	103.8 103.2	103.5	6.9 6.9	6.9	6.7	6.2 5.8	6.0	7.6	6.3 5.2	5.8	6.2		
				Middle	5	27.7 27.6	27.7	7.6 7.6	7.6	30.6 30.8	30.7	97.3 96.4	96.9	6.5 6.4	6.5		7.1 7.5			7.3			5.1 5.7	5.4
				Bottom	9	27.2 27.2	27.2	7.6 7.6	7.6	32.9 32.8	32.9	89.6 89.1	89.4	5.9 5.9	5.9		9.5 9.4			9.5			7.3 7.6	7.5
29-Aug-16	Cloudy	Moderate	11:14	Surface	1	29.0 29.0	29.0	7.8 7.8	7.8	20.8 20.9	20.9	83.8 84.1	84.0	5.7 5.8	5.8	5.7	3.5 3.6	3.6	5.7	5.9 6.1	6.0	6.4		
				Middle	5	26.4 26.4	26.4	7.8 7.8	7.8	28.1 28.1	28.1	79.8 78.4	79.1	5.5 5.4	5.5		5.1 5.1			5.1			6.1 8.7	7.4
				Bottom	9	26.4 26.4	26.4	7.8 7.8	7.8	29.0 29.0	29.0	77.4 76.7	77.1	5.3 5.3	5.3		8.6 8.1			8.4			5.5 5.8	5.7
31-Aug-16	Cloudy	Rough	12:17	Surface	1	28.6 28.6	28.6	7.9 7.9	7.9	24.3 24.3	24.3	92.0 92.5	92.3	6.2 6.3	6.3	5.9	11.8 12.0	11.9	11.5	18.7 14.8	16.8	16.0		
				Middle	5	28.0 28.0	28.0	7.8 7.8	7.8	28.8 28.8	28.8	82.7 81.6	82.2	5.5 5.4	5.5		9.8 9.8			9.8			14.1 18.5	16.3
				Bottom	9	27.6 27.6	27.6	7.7 7.7	7.7	29.5 29.5	29.5	78.5 78.2	78.4	5.3 5.2	5.3		12.7 12.7			12.7			14.6 15.3	15.0

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
3-Aug-16	Fine	Moderate	19:35	Surface	1	27.8 27.8	27.8	8.0 8.0	8.0	27.2 27.2	27.2	97.3 97.3	97.3	6.6 6.6	6.6	6.6	9.0 9.3	9.2	10.5	13.8 16.2	15.0	15.1
				Middle	5	27.9 27.9	27.9	8.0 8.1	8.1	28.0 27.9	28.0	96.9 96.8	96.9	6.5 6.5	6.5		9.4 10.0			9.7		
				Bottom	9	28.2 28.2	28.2	8.1 8.1	8.1	28.8 28.8	28.8	94.4 94.4	94.4	6.3 6.3	6.3	12.2 12.9	12.6	13.5 15.7		14.6		
5-Aug-16	Fine	Moderate	07:57	Surface	1	28.0 28.0	28.0	8.1 8.1	8.1	23.7 23.7	23.7	97.8 99.1	98.5	6.7 6.8	6.8	6.5	5.4 5.3	5.4	6.1	6.3 5.5	5.9	5.9
				Middle	5	27.6 27.6	27.6	8.2 8.2	8.2	28.2 30.0	29.1	91.0 90.8	90.9	6.1 6.1	6.1		5.7 5.7			5.7		
				Bottom	9	27.5 27.5	27.5	8.2 8.2	8.2	30.6 30.6	30.6	83.6 83.7	83.7	5.6 5.6	5.6	7.0 7.1	7.1	5.6 6.2		5.9		
8-Aug-16	Sunny	Moderate	10:41	Surface	1	28.1 27.2	27.7	8.2 8.1	8.2	30.4 30.4	30.4	116.6 113.8	115.2	7.7 7.6	7.7	7.8	4.8 5.3	5.1	6.3	2.8 4.4	3.6	3.5
				Middle	4.5	28.1 27.2	27.7	8.1 8.1	8.1	30.4 30.4	30.4	120.1 113.0	116.6	7.9 7.6	7.8		5.8 6.2			6.0		
				Bottom	8	28.1 27.3	27.7	8.1 8.1	8.1	30.4 30.4	30.4	115.9 111.3	113.6	7.7 7.5	7.6	7.9 7.7	7.8	2.8 2.6		2.7		
10-Aug-16	Rainy	Calm	11:23	Surface	1	27.3 27.4	27.4	7.9 7.9	7.9	27.0 26.7	26.9	97.2 97.1	97.2	6.6 6.6	6.6	6.4	6.3 6.0	6.2	8.6	3.9 4.4	4.2	4.6
				Middle	4.5	26.0 26.1	26.1	8.0 8.0	8.0	26.0 25.8	25.9	87.8 86.6	87.2	6.2 6.1	6.2		8.4 8.3			8.4		
				Bottom	8	25.7 25.7	25.7	8.1 8.1	8.1	27.5 27.5	27.5	83.5 83.2	83.4	5.8 5.8	5.8	11.1 11.3	11.2	4.3 4.1		4.2		
12-Aug-16	Rainy	Moderate	15:14	Surface	1	27.2 27.2	27.2	7.9 7.9	7.9	28.6 28.6	28.6	92.4 93.3	92.9	6.3 6.3	6.3	6.4	4.5 4.6	4.6	5.9	2.3 3.5	2.9	2.9
				Middle	4.5	26.1 26.1	26.1	8.0 8.0	8.0	29.0 29.0	29.0	94.8 93.7	94.3	6.5 6.5	6.5		6.2 6.2			6.2		
				Bottom	8	25.6 25.6	25.6	8.1 8.1	8.1	31.0 31.1	31.1	84.3 83.7	84.0	5.8 5.7	5.8	7.2 6.7	7.0	2.5 2.7		2.6		
15-Aug-16	Rainy	Moderate	17:38	Surface	1	26.9 26.9	26.9	8.0 8.0	8.0	28.8 28.8	28.8	90.0 89.4	89.7	6.1 6.1	6.1	6.2	5.8 5.6	5.7	7.0	7.1 9.7	8.4	7.7
				Middle	5	26.5 26.6	26.6	8.0 8.0	8.0	30.1 30.1	30.1	92.1 91.9	92.0	6.3 6.2	6.3		5.4 5.6			5.5		
				Bottom	9	26.4 26.3	26.4	8.0 8.0	8.0	31.3 31.4	31.4	91.4 92.7	92.1	6.2 6.3	6.3	9.7 9.8	9.8	7.9 7.3		7.6		
17-Aug-16	Rainy	Rough	18:44	Surface	1	26.5 26.4	26.5	8.0 8.0	8.0	30.8 30.8	30.8	84.9 84.0	84.5	5.8 5.7	5.8	5.8	6.0 6.0	6.0	7.8	10.1 15.5	12.8	11.2
				Middle	5	26.3 26.3	26.3	8.0 8.0	8.0	30.9 30.9	30.9	83.6 83.3	83.5	5.7 5.7	5.7		7.4 7.7			7.6		
				Bottom	9	26.3 26.3	26.3	8.0 8.0	8.0	30.9 30.9	30.9	83.0 82.4	82.7	5.6 5.6	5.6	9.4 9.9	9.7	8.9 10.9		9.9		
19-Aug-16	Fine	Moderate	19:35	Surface	1	27.0 26.9	27.0	8.1 8.0	8.1	19.9 20.8	20.4	86.6 86.3	86.5	6.2 6.1	6.2	6.2	9.6 8.7	9.2	10.5	7.2 8.9	8.1	8.0
				Middle	5	26.8 26.8	26.8	8.1 8.1	8.1	23.0 23.1	23.1	86.8 86.5	86.7	6.1 6.1	6.1		10.3 9.8			10.1		
				Bottom	9	26.7 26.6	26.7	8.2 8.2	8.2	27.8 27.8	27.8	85.8 86.2	86.0	5.9 5.9	5.9	12.1 12.5	12.3	7.0 8.3		7.7		

Remarks: *DA: Depth-Averaged
 **Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
22-Aug-16	Sunny	Calm	09:31	Surface	1	27.2 27.2	27.2	8.0 8.0	8.0	31.1 31.1	31.1	95.2 94.0	94.6	6.4 6.3	6.4	6.1	4.3 4.3	4.3	5.4	7.5 7.7	7.6	8.1
				Middle	5	26.9 26.9	26.9	8.0 8.0	8.0	31.1 31.1	31.1	87.1 86.6	86.9	5.8 5.8	5.8		5.0 4.8	4.9		7.9 8.0	8.0	
				Bottom	9	26.9 26.9	26.9	8.0 8.0	8.0	31.3 31.3	31.3	81.9 82.2	82.1	5.5 5.5	5.5	6.7 7.3	7.0	7.7 9.8		8.8		
24-Aug-16	Sunny	Calm	11:12	Surface	1	25.7 25.7	25.7	7.9 7.9	7.9	29.6 29.6	29.6	86.4 86.4	86.4	6.0 6.0	6.0	6.0	4.7 4.9	4.8	7.3	6.6 8.4	7.5	7.1
				Middle	5	25.8 25.8	25.8	7.8 7.9	7.9	29.9 29.9	29.9	86.0 86.0	86.0	5.9 5.9	5.9		6.6 6.7	6.7		6.6 8.2	7.4	
				Bottom	9	25.8 25.8	25.8	7.9 7.9	7.9	30.1 30.1	30.1	85.6 85.4	85.5	5.9 5.9	5.9	10.4 10.5	10.5	5.4 7.2		6.3		
26-Aug-16	Cloudy	Moderate	14:19	Surface	1	29.9 29.8	29.9	7.6 7.6	7.6	20.9 21.0	21.0	113.7 115.7	114.7	7.7 7.8	7.8	7.0	9.3 8.6	9.0	8.8	4.2 3.8	4.0	3.5
				Middle	5	27.7 27.7	27.7	7.6 7.6	7.6	28.9 29.1	29.0	90.4 89.8	90.1	6.1 6.0	6.1		7.5 7.8	7.7		4.2 3.5	3.9	
				Bottom	9	27.0 27.0	27.0	7.7 7.7	7.7	32.7 32.7	32.7	80.7 80.1	80.4	5.4 5.3	5.4	9.9 9.6	9.8	2.6 2.6		2.6		
29-Aug-16	Cloudy	Moderate	17:29	Surface	1	28.3 28.3	28.3	7.9 7.9	7.9	22.3 22.3	22.3	84.0 84.2	84.1	5.8 5.8	5.8	5.8	5.1 5.6	5.4	6.2	7.6 7.2	7.4	8.1
				Middle	5	27.5 27.5	27.5	7.8 7.8	7.8	25.2 25.1	25.2	83.1 82.5	82.8	5.7 5.7	5.7		6.5 6.3	6.4		8.5 8.0	8.3	
				Bottom	9	26.9 26.9	26.9	7.8 7.8	7.8	29.0 28.9	29.0	78.0 76.5	77.3	5.3 5.2	5.3	7.0 6.8	6.9	9.3 7.8		8.6		
31-Aug-16	Cloudy	Moderate	18:36	Surface	1	28.5 28.5	28.5	8.0 8.0	8.0	23.5 23.4	23.5	97.0 95.2	96.1	6.6 6.5	6.6	6.1	11.2 11.6	11.4	11.1	13.5 19.9	16.7	17.4
				Middle	5	28.0 28.0	28.0	7.9 7.9	7.9	28.2 28.2	28.2	82.1 80.3	81.2	5.5 5.4	5.5		10.2 10.2	10.2		17.6 19.8	18.7	
				Bottom	9	27.5 27.5	27.5	7.6 7.6	7.6	29.7 29.7	29.7	82.0 80.8	81.4	5.5 5.4	5.5	11.6 11.5	11.6	17.0 16.8		16.9		

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
1-Aug-16	Cloudy	Moderate	11:22	Surface	1	27.3 27.3	27.3	7.7 7.8	7.8	32.7 32.4	32.6	91.4 105.8	98.6	6.0 7.0	6.5	6.7	7.5 7.7	7.6	8.2	8.5 10.7	9.6	8.7
				Middle	3.5	27.4 28.2	27.8	7.8 7.9	7.9	26.8 26.4	26.6	102.4 99.3	100.9	7.0 6.7	6.9		7.5 7.2	7.4		8.8 6.7	7.8	
				Bottom	6	28.0 27.8	27.9	7.9 7.9	7.9	25.9 26.0	26.0	93.6 100.0	96.8	6.4 6.8	6.6		9.5 9.7	9.6		8.3 9.0	8.7	
3-Aug-16	Rainy	Moderate	13:22	Surface	1	27.0 27.0	27.0	8.1 8.1	8.1	27.2 27.3	27.3	90.3 91.5	90.9	6.2 6.3	6.3	6.3	9.4 9.7	9.6	10.0	13.9 12.9	13.4	14.0
				Middle	3	27.3 27.2	27.3	8.1 8.1	8.1	28.0 27.8	27.9	91.0 91.5	91.3	6.2 6.2	6.2		9.3 9.1	9.2		14.9 13.4	14.2	
				Bottom	5	27.6 27.6	27.6	8.1 8.1	8.1	28.8 28.8	28.8	86.4 89.4	87.9	5.8 6.0	5.9		11.3 11.2	11.3		14.7 14.3	14.5	
5-Aug-16	Fine	Moderate	14:23	Surface	1	28.0 28.0	28.0	8.0 8.0	8.0	26.7 26.7	26.7	89.6 89.8	89.7	6.1 6.1	6.1	6.1	4.4 4.7	4.6	5.1	5.2 5.5	5.4	6.0
				Middle	3	27.7 27.7	27.7	8.0 8.0	8.0	28.4 28.3	28.4	90.0 89.6	89.8	6.0 6.0	6.0		5.3 5.1	5.2		4.9 8.3	6.6	
				Bottom	5	27.7 27.7	27.7	8.0 8.0	8.0	28.8 27.7	28.3	86.2 86.2	86.2	5.8 5.8	5.8		5.8 5.3	5.6		4.8 7.0	5.9	
8-Aug-16	Sunny	Moderate	16:30	Surface	1	28.0 28.1	28.1	8.1 8.1	8.1	30.3 30.2	30.3	114.1 114.8	114.5	7.5 7.6	7.6	7.6	4.6 5.0	4.8	5.6	3.6 6.2	4.9	4.8
				Middle	3	28.1 28.1	28.1	8.1 8.1	8.1	30.3 30.2	30.3	113.9 115.4	114.7	7.5 7.6	7.6		5.1 5.7	5.4		4.4 5.5	5.0	
				Bottom	5	28.1 27.3	27.7	8.1 8.1	8.1	30.2 29.3	29.8	114.7 114.8	114.8	7.6 7.7	7.7		6.4 6.7	6.6		4.2 4.6	4.4	
10-Aug-16	Cloudy	Calm	17:20	Surface	1	28.0 28.0	28.0	8.0 8.0	8.0	25.5 25.4	25.5	98.6 98.7	98.7	6.7 6.7	6.7	6.2	7.0 6.9	7.0	8.9	5.7 4.1	4.9	3.7
				Middle	3	26.2 26.4	26.3	8.0 8.0	8.0	26.3 25.4	25.9	80.2 80.2	80.2	5.6 5.6	5.6		7.5 7.5	7.5		3.4 2.5	3.0	
				Bottom	5	25.5 25.5	25.5	8.0 8.0	8.0	28.1 28.1	28.1	73.8 73.1	73.5	5.2 5.1	5.2		12.2 12.2	12.2		3.1 3.1	3.1	
12-Aug-16	Rainy	Moderate	08:43	Surface	1	26.6 26.6	26.6	8.0 8.0	8.0	28.4 28.2	28.3	88.3 88.2	88.3	6.1 6.0	6.1	6.1	4.9 5.1	5.0	5.9	2.4 2.9	2.7	3.1
				Middle	3	26.3 26.3	26.3	8.0 8.0	8.0	29.7 29.7	29.7	87.2 87.2	87.2	6.0 6.0	6.0		6.8 6.0	6.4		2.8 4.6	3.7	
				Bottom	5	26.2 26.2	26.2	8.1 8.1	8.1	30.0 30.0	30.0	86.7 86.7	86.7	5.9 5.9	5.9		6.3 6.2	6.3		2.2 3.6	2.9	
15-Aug-16	Rainy	Moderate	11:19	Surface	1	26.7 26.7	26.7	7.9 7.9	7.9	28.8 28.8	28.8	82.2 82.2	82.2	5.6 5.6	5.6	5.7	6.3 6.9	6.6	6.8	9.2 10.5	9.9	9.0
				Middle	3	26.6 26.6	26.6	7.9 8.0	8.0	29.4 29.3	29.4	83.6 83.0	83.3	5.7 5.7	5.7		5.1 5.0	5.1		8.6 7.2	7.9	
				Bottom	5	26.6 26.6	26.6	8.0 8.0	8.0	29.5 29.5	29.5	84.5 84.2	84.4	5.8 5.7	5.8		8.5 8.9	8.7		8.5 9.9	9.2	
17-Aug-16	Rainy	Rough	12:52	Surface	1	27.0 26.9	27.0	8.1 8.1	8.1	31.1 31.1	31.1	94.9 94.2	94.6	6.4 6.3	6.4	6.4	7.6 7.7	7.7	8.3	10.7 10.5	10.6	10.8
				Middle	3	26.7 26.7	26.7	8.1 8.1	8.1	31.2 31.2	31.2	94.2 93.9	94.1	6.3 6.3	6.3		7.3 7.1	7.2		11.5 11.9	11.7	
				Bottom	5	26.7 26.7	26.7	8.1 8.1	8.1	31.3 31.3	31.3	93.7 93.3	93.5	6.3 6.3	6.3		9.7 10.0	9.9		10.8 9.3	10.1	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
19-Aug-16	Fine	Moderate	14:22	Surface	1	27.7 27.6	27.7	8.1 8.1	8.1	19.3 19.0	19.2	89.9 90.6	90.3	6.4 6.4	6.4	6.4	9.2 9.5	9.4	10.6	6.4 9.8	8.1	7.9		
				Middle	3	27.4 27.3	27.4	8.1 8.1	8.1	21.3 21.2	21.3	89.4 89.1	89.3	6.3 6.3	6.3		10.4 10.2			10.3			8.2 7.9	8.1
				Bottom	5	27.3 27.2	27.3	8.1 8.0	8.1	23.5 23.3	23.4	87.6 88.4	88.0	6.1 6.2	6.2		12.2 11.9			12.1			6.2 8.6	7.4
22-Aug-16	Sunny	Calm	15:51	Surface	1	27.1 27.1	27.1	8.0 8.0	8.0	31.4 31.4	31.4	83.1 82.2	82.7	5.5 5.5	5.5	5.5	4.4 4.5	4.5	5.2	5.2 6.0	5.6	5.9		
				Middle	3	27.0 27.0	27.0	8.0 8.0	8.0	31.5 31.5	31.5	81.7 81.4	81.6	5.5 5.4	5.5		5.6 5.3			5.5			5.2 5.7	5.5
				Bottom	5	26.9 26.9	26.9	8.0 8.0	8.0	31.6 31.6	31.6	80.9 80.5	80.7	5.4 5.4	5.4		5.9 5.5			5.7			6.2 6.8	6.5
24-Aug-16	Sunny	Calm	17:26	Surface	1	26.3 26.3	26.3	7.8 7.9	7.9	30.1 30.1	30.1	84.7 84.4	84.6	5.8 5.8	5.8	5.8	4.6 4.3	4.5	6.9	5.0 9.4	7.2	6.6		
				Middle	3	26.3 26.3	26.3	7.8 7.9	7.9	30.3 30.3	30.3	84.0 83.9	84.0	5.7 5.7	5.7		6.7 7.8			7.3			7.0 5.3	6.2
				Bottom	5	26.3 26.3	26.3	7.9 7.9	7.9	30.4 30.4	30.4	83.2 83.1	83.2	5.7 5.7	5.7		8.8 8.8			8.8			5.6 7.0	6.3
26-Aug-16	Cloudy	Moderate	08:19	Surface	1	30.7 30.7	30.7	7.6 7.6	7.6	20.3 20.3	20.3	106.6 106.3	106.5	7.1 7.1	7.1	7.5	6.7 6.6	6.7	7.8	4.7 7.4	6.1	5.8		
				Middle	3	29.3 29.3	29.3	7.5 7.5	7.5	20.2 20.3	20.3	114.0 113.7	113.9	7.8 7.8	7.8		6.6 7.1			6.9			6.5 6.9	6.7
				Bottom	5	27.9 27.9	27.9	7.6 7.6	7.6	29.1 29.1	29.1	95.6 94.7	95.2	6.4 6.3	6.4		9.8 9.5			9.7			4.9 4.5	4.7
29-Aug-16	Cloudy	Moderate	11:27	Surface	1	29.0 29.0	29.0	7.9 7.9	7.9	21.3 21.3	21.3	88.6 90.3	89.5	6.1 6.2	6.2	6.1	5.0 5.0	5.0	5.3	5.8 8.2	7.0	7.3		
				Middle	3	27.1 27.1	27.1	7.8 7.8	7.8	24.3 24.3	24.3	87.3 84.8	86.1	6.1 5.9	6.0		4.3 4.4			4.4			6.0 6.3	6.2
				Bottom	5	26.5 26.5	26.5	7.8 7.8	7.8	28.4 28.4	28.4	86.4 83.9	85.2	5.9 5.8	5.9		6.6 6.5			6.6			10.0 7.3	8.7
31-Aug-16	Cloudy	Rough	12:31	Surface	1	28.6 28.6	28.6	7.9 7.9	7.9	19.0 17.7	18.4	92.1 92.5	92.3	6.4 6.5	6.5	6.0	13.6 13.2	13.4	12.8	18.7 17.6	18.2	17.6		
				Middle	3.5	28.1 28.1	28.1	7.8 7.8	7.8	28.8 28.8	28.8	82.6 80.3	81.5	5.5 5.4	5.5		11.4 11.3			11.4			18.3 16.7	17.5
				Bottom	6	27.4 27.4	27.4	7.6 7.6	7.6	29.3 29.3	29.3	77.7 76.8	77.3	5.2 5.2	5.2		13.7 13.7			13.7			18.0 16.0	17.0

Remarks: *DA: Depth-Averaged
 **Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
3-Aug-16	Fine	Moderate	19:48	Surface	1	27.6 27.6	27.6	8.1 8.1	8.1	27.0 27.0	27.0	99.0 96.8	97.9	6.7 6.6	6.7	6.6	8.2 8.3	8.3	9.6	11.7 15.2	13.5	15.3
				Middle	3.5	27.8 27.8	27.8	8.1 8.1	8.1	27.9 28.0	28.0	97.9 95.8	96.9	6.6 6.4	6.5		10.6 10.4	10.5		15.9 15.2	15.6	
				Bottom	6	28.2 28.2	28.2	8.1 8.1	8.1	29.0 28.9	29.0	93.5 92.3	92.9	6.2 6.1	6.2		10.2 10.0	10.1		16.8 16.7	16.8	
5-Aug-16	Fine	Moderate	08:29	Surface	1	28.2 28.2	28.2	8.1 8.1	8.1	26.9 26.9	26.9	98.9 98.9	98.9	6.7 6.7	6.7	6.6	5.9 5.3	5.6	6.1	4.3 4.2	4.3	4.8
				Middle	3.5	27.6 27.6	27.6	8.1 8.1	8.1	29.5 29.5	29.5	96.4 94.6	95.5	6.4 6.3	6.4		6.1 6.0	6.1		5.8 5.5	5.7	
				Bottom	6	27.6 27.6	27.6	8.1 8.1	8.1	29.7 29.7	29.7	82.5 82.4	82.5	5.5 5.5	5.5		6.9 6.4	6.7		4.3 4.6	4.5	
8-Aug-16	Sunny	Moderate	10:52	Surface	1	27.3 27.3	27.3	8.1 8.1	8.1	30.3 30.3	30.3	98.0 102.2	100.1	6.6 6.8	6.7	6.8	3.8 3.8	3.8	5.8	3.1 5.2	4.2	3.7
				Middle	3	27.3 27.3	27.3	8.1 8.1	8.1	30.3 30.3	30.3	98.0 103.8	100.9	6.6 7.0	6.8		6.1 6.0	6.1		1.9 4.8	3.4	
				Bottom	5	27.3 27.3	27.3	8.1 8.1	8.1	30.3 30.3	30.3	102.9 102.9	102.9	6.9 6.9	6.9		7.1 7.8	7.5		5.2 1.8	3.5	
10-Aug-16	Rainy	Calm	11:35	Surface	1	28.3 28.3	28.3	8.0 8.0	8.0	23.7 23.6	23.7	104.1 103.9	104.0	7.1 7.1	7.1	6.6	8.0 7.7	7.9	9.4	3.2 5.1	4.2	4.4
				Middle	3	27.6 27.6	27.6	8.0 8.0	8.0	27.5 27.5	27.5	88.4 86.5	87.5	6.0 5.9	6.0		9.2 9.4	9.3		4.5 5.8	5.2	
				Bottom	5	27.0 27.0	27.0	8.0 8.0	8.0	29.7 29.6	29.7	85.2 85.0	85.1	5.8 5.7	5.8		10.8 11.1	11.0		2.5 4.8	3.7	
12-Aug-16	Rainy	Moderate	15:27	Surface	1	26.8 26.7	26.8	7.9 7.9	7.9	28.6 27.9	28.3	90.0 90.1	90.1	6.1 6.2	6.2	6.2	6.5 6.1	6.3	5.1	2.4 3.2	2.8	2.9
				Middle	3.5	26.3 26.3	26.3	7.9 7.9	7.9	29.4 29.3	29.4	88.6 87.5	88.1	6.1 6.0	6.1		4.1 4.2	4.2		3.7 2.2	3.0	
				Bottom	6	26.2 26.2	26.2	8.0 8.0	8.0	29.5 29.5	29.5	87.8 87.8	87.8	6.0 6.0	6.0		5.1 4.7	4.9		2.6 3.2	2.9	
15-Aug-16	Rainy	Moderate	17:50	Surface	1	26.5 26.5	26.5	7.9 7.9	7.9	28.9 29.0	29.0	86.5 86.2	86.4	5.9 5.9	5.9	6.0	8.9 8.4	8.7	8.1	8.4 8.8	8.6	7.3
				Middle	3.5	26.3 26.3	26.3	7.9 7.9	7.9	29.8 29.8	29.8	87.8 87.2	87.5	6.0 6.0	6.0		7.3 7.3	7.3		5.8 6.4	6.1	
				Bottom	6	26.3 26.3	26.3	7.9 7.9	7.9	29.9 29.9	29.9	88.6 87.0	87.8	6.0 5.9	6.0		8.6 7.8	8.2		7.7 6.4	7.1	
17-Aug-16	Rainy	Rough	18:59	Surface	1	26.4 26.4	26.4	8.0 8.0	8.0	30.8 30.8	30.8	82.7 82.4	82.6	5.6 5.6	5.6	5.6	6.3 6.2	6.3	7.3	9.0 14.2	11.6	11.9
				Middle	3.5	26.3 26.3	26.3	8.0 8.0	8.0	30.9 30.9	30.9	82.7 82.1	82.4	5.6 5.6	5.6		8.1 8.4	8.3		11.4 12.8	12.1	
				Bottom	6	26.2 26.2	26.2	8.0 8.0	8.0	30.9 30.9	30.9	82.1 81.2	81.7	5.6 5.5	5.6		7.4 7.1	7.3		10.4 13.3	11.9	
19-Aug-16	Fine	Moderate	19:46	Surface	1	26.8 26.8	26.8	8.2 8.2	8.2	26.0 25.5	25.8	89.6 88.7	89.2	6.2 6.2	6.2	6.1	9.2 9.0	9.1	10.5	7.4 7.2	7.3	7.9
				Middle	3	26.7 26.8	26.8	8.1 8.2	8.2	27.8 27.7	27.8	87.3 87.5	87.4	6.0 6.0	6.0		10.3 10.3	10.3		9.1 6.8	8.0	
				Bottom	5	26.6 26.7	26.7	8.1 8.2	8.2	29.2 29.0	29.1	85.1 85.1	85.1	5.8 5.8	5.8		12.0 12.2	12.1		7.0 9.5	8.3	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
22-Aug-16	Sunny	Calm	10:07	Surface	1	27.2 27.2	27.2	8.1 8.0	8.1	31.1 31.1	31.1	92.8 91.8	92.3	6.2 6.1	6.2	6.2	2.3 2.5	2.4	4.3	6.6 7.5	7.1	7.6
				Middle	3	26.9 26.9	26.9	8.0 8.0	8.0	31.2 31.2	31.2	91.9 91.6	91.8	6.2 6.1	6.2		5.4 5.3	5.4		8.4 7.5	8.0	
				Bottom	5	26.9 26.9	26.9	8.0 8.0	8.0	31.3 31.3	31.3	91.4 90.9	91.2	6.1 6.1	6.1		5.0 5.2	5.1		7.0 8.4	7.7	
24-Aug-16	Sunny	Calm	11:29	Surface	1	25.6 25.7	25.7	7.9 7.9	7.9	30.2 30.2	30.2	84.9 84.8	84.9	5.9 5.8	5.9	5.9	3.1 3.5	3.3	4.7	6.1 6.3	6.2	6.5
				Middle	3.5	25.6 25.6	25.6	7.9 7.9	7.9	30.3 30.3	30.3	84.5 84.7	84.6	5.8 5.8	5.8		4.0 4.0	4.0		7.4 5.4	6.4	
				Bottom	6	25.6 25.6	25.6	7.9 7.9	7.9	30.3 30.3	30.3	84.5 84.4	84.5	5.8 5.8	5.8		7.2 6.6	6.9		6.0 7.6	6.8	
26-Aug-16	Cloudy	Moderate	14:32	Surface	1	30.2 30.2	30.2	7.7 7.7	7.7	21.1 21.1	21.1	118.0 118.6	118.3	7.9 8.0	8.0	7.5	6.2 5.8	6.0	7.7	4.5 4.9	4.7	3.6
				Middle	3.5	28.8 28.7	28.8	7.6 7.6	7.6	22.6 24.3	23.5	102.6 101.3	102.0	7.0 6.9	7.0		8.3 8.7	8.5		2.4 3.5	3.0	
				Bottom	6	27.6 27.6	27.6	7.6 7.6	7.6	29.7 29.7	29.7	86.6 84.7	85.7	5.8 5.7	5.8		8.9 8.1	8.5		3.4 2.7	3.1	
29-Aug-16	Cloudy	Moderate	17:42	Surface	1	28.2 28.2	28.2	7.9 7.9	7.9	22.6 22.5	22.6	89.8 90.1	90.0	6.2 6.2	6.2	6.0	4.6 4.7	4.7	6.2	8.3 7.2	7.8	7.7
				Middle	3.5	27.5 27.5	27.5	7.9 7.8	7.9	24.7 24.7	24.7	82.7 82.4	82.6	5.7 5.7	5.7		5.1 4.9	5.0		7.9 9.1	8.5	
				Bottom	6	26.9 26.9	26.9	7.8 7.8	7.8	29.2 29.3	29.3	74.6 74.4	74.5	5.1 5.0	5.1		8.8 9.2	9.0		7.6 6.0	6.8	
31-Aug-16	Cloudy	Moderate	18:49	Surface	1	28.5 28.5	28.5	8.1 8.0	8.1	18.4 18.4	18.4	96.2 96.9	96.6	6.7 6.8	6.8	6.5	12.4 12.2	12.3	10.8	15.3 18.4	16.9	16.0
				Middle	3.5	28.1 28.1	28.1	7.9 7.9	7.9	31.1 31.1	31.1	92.3 90.9	91.6	6.1 6.0	6.1		9.3 9.1	9.2		16.0 15.2	15.6	
				Bottom	6	27.5 27.5	27.5	7.8 7.8	7.8	31.8 31.8	31.8	86.1 84.7	85.4	5.7 5.6	5.7		10.9 10.9	10.9		16.5 14.2	15.4	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)		Turbidity(NTU)			Suspended Solids (mg/L)						
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
1-Aug-16	Cloudy	Moderate	10:45	Surface	1	28.4 28.4	28.4	7.9 7.9	7.9	20.8 20.8	20.8	96.3 96.9	96.6	7.4 7.5	7.5	7.5	4.7 4.9	4.8	6.0	6.3 7.3	6.8	7.0			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.5	27.9 27.9	27.9	7.8 7.8	7.8	23.1 23.2	23.2	101.6 101.4	101.5	7.8 7.8	7.8		6.8 7.4	7.1		6.2 8.0	7.1				
3-Aug-16	Rainy	Moderate	12:08	Surface	1	27.3 28.0	27.7	8.2 7.9	8.1	28.0 28.1	28.1	94.6 88.8	91.7	6.4 6.0	6.2	6.2	7.2 7.5	7.4	8.5	11.8 12.8	12.3	10.3			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.4	28.1 27.9	28.0	8.2 8.1	8.2	27.1 28.1	27.6	92.3 97.8	95.1	6.2 6.6	6.4		9.6 9.5	9.6		8.0 8.4	8.2				
5-Aug-16	Fine	Moderate	13:42	Surface	1	28.1 28.1	28.1	8.1 8.1	8.1	27.2 27.1	27.2	85.5 83.2	84.4	5.7 5.6	5.7	5.7	5.0 5.3	5.2	5.4	3.7 4.8	4.3	4.0			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.3	27.7 27.8	27.8	8.0 8.1	8.1	29.4 29.4	29.4	82.4 81.9	82.2	5.5 5.5	5.5		5.4 5.5	5.5		4.2 3.0	3.6				
8-Aug-16	Sunny	Moderate	15:42	Surface	1	27.8 27.8	27.8	8.1 8.1	8.1	30.1 30.1	30.1	115.2 114.1	114.7	7.7 7.6	7.7	7.7	6.0 5.6	5.8	7.0	8.0 10.3	9.2	8.6			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.55	27.9 27.9	27.9	8.2 8.2	8.2	30.8 31.0	30.9	109.6 109.9	109.8	7.2 7.3	7.3		8.2 7.9	8.1		8.1 7.7	7.9				
10-Aug-16	Cloudy	Calm	17:09	Surface	1	27.6 27.0	27.3	8.0 8.0	8.0	27.0 27.3	27.2	93.4 87.3	90.4	6.3 6.0	6.2	6.2	6.9 7.4	7.2	8.4	5.3 5.7	5.5	5.4			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4	27.7 27.6	27.7	7.9 7.9	7.9	27.2 26.9	27.1	90.4 92.3	91.4	6.1 6.3	6.2		9.4 9.5	9.5		5.7 4.8	5.3				
12-Aug-16	Rainy	Moderate	07:34	Surface	1	27.7 27.9	27.8	8.0 7.9	8.0	28.7 29.0	28.9	92.3 92.0	92.2	6.2 6.1	6.2	6.2	6.3 6.3	6.3	7.4	9.8 13.0	11.4	11.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	3.6	27.0 27.4	27.2	7.9 7.9	7.9	28.8 28.5	28.7	89.3 88.7	89.0	6.1 6.0	6.1		8.4 8.5	8.5		10.8 11.1	11.0				
15-Aug-16	Rainy	Moderate	10:35	Surface	1	26.6 26.6	26.6	7.9 7.9	7.9	26.6 26.5	26.6	97.4 97.7	97.6	6.7 6.8	6.8	6.8	4.8 4.8	4.8	5.5	7.4 6.2	6.8	7.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.6	25.8 25.8	25.8	7.9 7.9	7.9	29.5 29.5	29.5	97.1 98.6	97.9	6.7 6.8	6.8		6.0 6.3	6.2		6.7 8.5	7.6				
17-Aug-16	Rainy	Rough	11:49	Surface	1	26.8 26.8	26.8	8.0 8.0	8.0	30.8 30.9	30.9	78.5 80.0	79.3	5.3 5.4	5.4	5.4	6.2 5.7	6.0	5.6	13.5 13.5	13.5	13.5			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4.7	26.9 26.8	26.9	8.1 8.1	8.1	31.1 31.2	31.2	85.7 85.9	85.8	5.8 5.8	5.8		5.1 5.1	5.1		13.0 13.7	13.4				

Remarks: *DA: Depth-Averaged
 **Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)		Turbidity(NTU)			Suspended Solids (mg/L)						
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
19-Aug-16	Fine	Moderate	13:38	Surface	1	27.5 27.5	27.5	8.1 8.1	8.1	24.0 24.0	24.0	94.9 96.3	95.6	6.6 6.7	6.7	6.7	7.3 6.8	7.1	6.7	8.4 8.5	8.5	7.9			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	5	27.6 27.5	27.6	8.1 8.1	8.1	24.3 24.3	24.3	101.9 102.0	102.0	7.0 7.0	7.0		6.2 6.2	6.2		6.2	6.2		6.2	6.2	6.2
22-Aug-16	Sunny	Calm	15:18	Surface	1	27.6 27.6	27.6	8.1 8.1	8.1	30.8 30.8	30.8	95.2 95.6	95.4	6.3 6.4	6.4	6.4	6.9 7.0	7.0	7.3	7.2 6.9	7.1	7.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	5	27.6 27.6	27.6	8.1 8.1	8.1	31.1 31.1	31.1	97.6 97.6	97.6	6.5 6.5	6.5		7.5 7.4	7.5		7.5	7.5		7.5	7.5	7.5
24-Aug-16	Sunny	Calm	17:28	Surface	1	26.3 26.3	26.3	7.8 7.8	7.8	30.1 30.4	30.3	81.5 81.0	81.3	5.6 5.5	5.6	5.6	7.0 7.1	7.1	6.9	5.8 5.3	5.6	5.7			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	5	26.2 26.2	26.2	7.9 7.9	7.9	31.2 31.3	31.3	81.7 81.7	81.7	5.5 5.5	5.5		6.1 7.1	6.6		6.6	6.6		6.6	6.6	6.6
26-Aug-16	Cloudy	Moderate	07:57	Surface	1	29.8 29.8	29.8	7.5 7.5	7.5	24.6 24.6	24.6	106.9 107.2	107.1	7.1 7.1	7.1	7.1	4.3 4.3	4.3	5.0	5.7 5.2	5.5	5.4			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	5	29.1 29.1	29.1	7.5 7.5	7.5	27.6 27.5	27.6	106.5 108.1	107.3	7.0 7.1	7.1		5.5 5.8	5.7		5.7	5.7		5.7	5.7	5.7
29-Aug-16	Cloudy	Moderate	10:55	Surface	1	29.4 29.4	29.4	8.0 8.0	8.0	24.3 24.4	24.4	105.8 103.1	104.5	7.1 6.9	7.0	7.0	6.1 6.2	6.2	5.7	8.1 8.3	8.2	7.5			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	5	29.2 29.2	29.2	8.0 8.0	8.0	25.6 25.7	25.7	97.3 97.6	97.5	6.5 6.5	6.5		5.2 5.2	5.2		5.2	5.2		5.2	5.2	5.2
31-Aug-16	Cloudy	Rough	11:49	Surface	1	28.1 28.1	28.1	7.9 7.9	7.9	27.3 27.4	27.4	86.6 88.1	87.4	5.8 5.9	5.9	5.9	10.7 10.2	10.5	10.1	4.9 7.9	6.4	6.0			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	5	28.1 28.2	28.2	8.0 8.0	8.0	27.7 27.6	27.7	94.0 93.8	93.9	6.3 6.3	6.3		9.6 9.6	9.6		9.6	9.6		9.6	9.6	9.6

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)						
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*				
3-Aug-16	Fine	Moderate	19:36	Surface	1	27.9 27.9	27.9	8.1 8.1	8.1	28.2 27.5	27.9	98.2 93.1	95.7	6.6 6.3	6.5	6.5	7.1 7.5	7.3	8.5	7.4 9.7	8.6	8.5				
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-	-
				Bottom	4.2	28.4 27.1	27.8	8.0 8.2	8.1	28.2 27.7	28.0	94.3 88.4	91.4	6.3 6.0	6.2		6.2	9.6 9.7		9.7	9.4 7.4		8.4			
5-Aug-16	Fine	Moderate	07:36	Surface	1	27.9 27.9	27.9	8.2 8.2	8.2	26.4 26.3	26.4	85.4 84.3	84.9	5.8 5.7	5.8	5.8	5.6 5.5	5.6	5.9	3.5 3.9	3.7	3.5				
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-	-
				Bottom	4.2	27.8 27.8	27.8	8.2 8.2	8.2	27.0 27.6	27.3	87.7 85.8	86.8	5.9 5.8	5.9		5.9	5.9 6.2		6.1	3.4 3.0		3.2			
8-Aug-16	Sunny	Moderate	09:06	Surface	1	27.8 27.8	27.8	8.0 8.0	8.0	30.3 30.3	30.3	114.0 113.8	113.9	7.6 7.6	7.6	7.6	4.7 4.9	4.8	6.6	6.4 7.0	6.7	6.2				
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-	-
				Bottom	4.6	27.9 27.9	27.9	8.0 8.1	8.1	31.0 31.1	31.1	110.2 109.6	109.9	7.3 7.2	7.3		7.3	8.2 8.4		8.3	5.5 5.7		5.6			
10-Aug-16	Rainy	Calm	10:31	Surface	1	27.6 27.2	27.4	8.0 7.9	8.0	27.5 27.6	27.6	90.1 94.0	92.1	6.1 6.4	6.3	6.3	7.0 7.4	7.2	8.4	7.2 8.1	7.7	7.2				
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-	-
				Bottom	4.35	27.1 27.0	27.1	8.0 8.0	8.0	26.9 27.4	27.2	93.0 87.3	90.2	6.4 6.0	6.2		6.2	9.5 9.4		9.5	5.7 7.6		6.7			
12-Aug-16	Rainy	Moderate	14:49	Surface	1	28.1 28.6	28.4	8.0 7.9	8.0	29.4 27.3	28.4	93.0 92.2	92.6	6.2 6.1	6.2	6.2	6.4 6.7	6.6	7.6	10.7 11.6	11.2	11.6				
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-	-
				Bottom	3.6	26.4 28.1	27.3	7.9 7.9	7.9	29.2 28.1	28.7	88.7 88.9	88.8	6.1 5.9	6.0		6.0	8.9 8.0		8.5	11.7 12.0		11.9			
15-Aug-16	Rainy	Moderate	17:41	Surface	1	27.3 27.3	27.3	8.0 8.0	8.0	25.4 25.4	25.4	97.9 98.2	98.1	6.7 6.8	6.8	6.8	3.1 3.4	3.3	4.9	6.6 7.3	7.0	7.3				
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-	-
				Bottom	4.6	26.4 26.4	26.4	8.0 8.0	8.0	28.4 28.4	28.4	93.1 93.4	93.3	6.4 6.4	6.4		6.4	6.3 6.5		6.4	7.2 7.9		7.6			
17-Aug-16	Rainy	Rough	18:21	Surface	1	26.8 26.8	26.8	8.0 8.0	8.0	29.9 29.9	29.9	82.0 82.4	82.2	5.5 5.6	5.6	5.6	5.0 5.1	5.1	5.4	12.1 11.9	12.0	14.4				
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-	-
				Bottom	4.8	26.8 26.8	26.8	8.0 8.0	8.0	30.2 30.2	30.2	84.3 84.3	84.3	5.7 5.7	5.7		5.7	5.6 5.5		5.6	14.5 18.9		16.7			
19-Aug-16	Fine	Moderate	19:23	Surface	1	26.4 26.4	26.4	8.1 8.1	8.1	23.0 23.0	23.0	96.1 96.6	96.4	6.8 6.8	6.8	6.8	6.1 6.2	6.2	6.5	8.7 6.2	7.5	8.0				
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-	-
				Bottom	5	26.3 26.4	26.4	8.1 8.1	8.1	23.3 23.3	23.3	98.4 98.4	98.4	7.0 7.0	7.0		7.0	6.7 6.6		6.7	9.5 7.5		8.5			

Remarks: *DA: Depth-Averaged
 **Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
22-Aug-16	Sunny	Calm	09:00	Surface	1	27.6 27.6	27.6	8.1 8.1	8.1	31.8 31.8	31.8	91.8 93.3	92.6	6.1 6.2	6.2	6.2	8.1 7.6	7.9	7.5	7.0 7.8	7.4	7.1			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	5	27.6 27.6	27.6	8.1 8.1	8.1	32.1 32.1	32.1	99.1 99.3	99.2	6.5 6.5	6.5		6.5	7.0 7.0		7.0	6.5		6.7 6.6	6.7	
24-Aug-16	Sunny	Calm	10:20	Surface	1	26.3 26.3	26.3	7.8 7.8	7.8	30.0 30.0	30.0	84.0 83.1	83.6	5.7 5.7	5.7	5.7	5.5 5.6	5.6	6.0	5.3 5.8	5.6	6.4			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	5	26.3 26.3	26.3	7.8 7.8	7.8	30.1 30.1	30.1	81.8 82.2	82.0	5.6 5.6	5.6		5.6	6.2 6.3		6.3	5.6		5.7 8.7	7.2	
26-Aug-16	Cloudy	Moderate	14:14	Surface	1	30.5 30.5	30.5	7.7 7.7	7.7	23.5 23.4	23.5	118.9 119.2	119.1	7.8 7.9	7.9	7.9	2.6 2.9	2.8	4.4	3.3 2.7	3.0	3.5			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	5	29.7 29.7	29.7	7.7 7.7	7.7	26.5 26.4	26.5	113.9 114.3	114.1	7.5 7.5	7.5		7.5	5.8 6.0		5.9	7.5		3.8 4.2	4.0	
29-Aug-16	Cloudy	Moderate	17:13	Surface	1	29.5 29.5	29.5	7.9 7.9	7.9	24.3 24.3	24.3	94.0 91.9	93.0	6.3 6.1	6.2	6.2	3.8 3.6	3.7	5.2	8.3 7.5	7.9	8.2			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	5	29.4 29.4	29.4	7.9 7.9	7.9	25.1 25.0	25.1	91.6 91.9	91.8	6.1 6.1	6.1		6.1	6.5 6.7		6.6	6.1		9.2 7.5	8.4	
31-Aug-16	Cloudy	Moderate	18:21	Surface	1	28.1 28.1	28.1	7.9 7.9	7.9	26.4 26.4	26.4	90.0 90.4	90.2	6.1 6.1	6.1	6.1	9.5 9.6	9.6	9.9	7.4 11.0	9.2	10.1			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	5	28.1 28.1	28.1	7.9 7.9	7.9	26.7 26.7	26.7	92.4 92.3	92.4	6.2 6.2	6.2		6.2	10.0 10.1		10.1	6.2		11.0 10.9	11.0	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS4 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
1-Aug-16	Cloudy	Moderate	11:33	Surface	1	27.6 28.0	27.8	7.7 7.9	7.8	26.6 26.3	26.5	94.3 102.7	98.5	6.4 7.0	6.7	6.7	7.9 8.3	8.1	9.9	8.4 10.0	9.2	8.5		
				Middle	3.5	28.0 27.9	28.0	7.9 7.9	7.9	30.7 30.2	30.5	96.6 101.4	99.0	6.4 6.7	6.6		10.5 10.4			10.5			8.3 7.6	8.0
				Bottom	6	27.8 27.7	27.8	7.8 7.8	7.8	31.8 33.2	32.5	88.7 102.3	95.5	5.8 6.7	6.3		11.3 10.9			11.1			9.0 7.7	8.4
3-Aug-16	Rainy	Moderate	13:35	Surface	1	26.9 26.9	26.9	8.1 8.1	8.1	27.3 27.4	27.4	91.9 92.2	92.1	6.3 6.3	6.3	6.4	10.3 10.5	10.4	10.8	14.7 11.0	12.9	14.1		
				Middle	3	27.1 27.1	27.1	8.1 8.1	8.1	27.8 27.8	27.8	93.5 93.6	93.6	6.4 6.4	6.4		10.4 10.7			10.6			13.7 15.6	14.7
				Bottom	5	27.7 27.7	27.7	8.1 8.1	8.1	29.0 29.0	29.0	84.3 84.1	84.2	5.7 5.6	5.7		11.7 11.3			11.5			14.9 14.6	14.8
5-Aug-16	Fine	Moderate	14:33	Surface	1	28.1 28.1	28.1	8.0 8.0	8.0	25.4 26.6	26.0	90.8 80.8	85.8	6.2 5.4	5.8	5.8	4.4 4.1	4.3	4.7	3.7 7.9	5.8	5.4		
				Middle	3	27.9 27.9	27.9	8.0 8.0	8.0	28.4 28.3	28.4	85.6 85.7	85.7	5.7 5.7	5.7		5.0 4.7			5.0			4.0 6.6	5.3
				Bottom	5	27.7 27.7	27.7	8.0 8.0	8.0	29.3 29.1	29.2	81.4 80.5	81.0	5.4 5.4	5.4		5.0 4.4			4.7			5.2 4.9	5.1
8-Aug-16	Sunny	Moderate	16:41	Surface	1	27.3 27.1	27.2	8.1 8.1	8.1	29.3 29.8	29.6	111.1 103.8	107.5	7.5 7.0	7.3	7.2	5.1 5.6	5.4	6.2	3.6 3.7	3.7	4.8		
				Middle	3	27.3 27.1	27.2	8.1 8.1	8.1	29.3 29.8	29.6	104.4 102.9	103.7	7.0 6.9	7.0		5.8 5.6			5.7			6.0 6.2	6.1
				Bottom	5	27.3 27.1	27.2	8.1 8.1	8.1	29.3 29.8	29.6	103.4 101.6	102.5	7.0 6.8	6.9		7.8 7.4			7.6			5.2 3.8	4.5
10-Aug-16	Cloudy	Calm	17:30	Surface	1	27.5 27.3	27.4	8.0 8.0	8.0	28.1 29.6	28.9	91.8 91.9	91.9	6.2 6.2	6.2	5.9	8.0 8.0	8.0	9.2	4.9 4.4	4.7	3.3		
				Middle	3	26.1 26.1	26.1	8.0 8.0	8.0	27.2 27.2	27.2	80.7 79.9	80.3	5.6 5.6	5.6		8.6 8.8			8.7			2.4 1.9	2.2
				Bottom	5	25.3 25.3	25.3	8.0 8.0	8.0	29.3 29.3	29.3	74.0 73.1	73.6	5.2 5.1	5.2		10.7 11.2			11.0			3.0 3.2	3.1
12-Aug-16	Rainy	Moderate	08:55	Surface	1	27.6 27.6	27.6	8.0 8.0	8.0	28.2 28.2	28.2	92.5 91.4	92.0	6.2 6.2	6.2	6.3	2.9 2.7	2.8	4.5	2.4 3.3	2.9	3.0		
				Middle	3	26.2 26.2	26.2	8.0 8.0	8.0	29.4 29.5	29.5	92.5 91.9	92.2	6.3 6.3	6.3		4.5 4.8			4.7			3.1 3.6	3.4
				Bottom	5	26.0 26.0	26.0	8.0 8.0	8.0	30.4 30.4	30.4	91.5 91.5	91.5	6.3 6.3	6.3		6.1 6.1			6.1			2.9 2.3	2.6
15-Aug-16	Rainy	Moderate	11:31	Surface	1	26.9 26.9	26.9	7.9 8.0	8.0	26.6 26.7	26.7	85.6 86.4	86.0	5.9 5.9	5.9	6.0	6.6 6.6	6.6	8.0	12.1 9.0	10.6	9.3		
				Middle	3	26.6 26.6	26.6	8.0 8.0	8.0	29.6 30.1	29.9	87.3 88.2	87.8	5.9 6.0	6.0		7.4 7.3			7.4			9.4 7.2	8.3
				Bottom	5	26.5 26.5	26.5	8.0 8.0	8.0	30.4 30.5	30.5	88.3 88.4	88.4	6.0 6.0	6.0		9.8 10.0			9.9			10.5 7.7	9.1
17-Aug-16	Rainy	Rough	13:07	Surface	1	27.0 27.0	27.0	8.1 8.1	8.1	31.1 31.1	31.1	92.7 91.6	92.2	6.2 6.1	6.2	6.0	6.4 6.7	6.6	7.3	11.4 12.6	12.0	11.6		
				Middle	3	26.7 26.7	26.7	8.1 8.1	8.1	31.2 31.2	31.2	84.6 84.0	84.3	5.7 5.7	5.7		7.1 7.0			7.1			11.5 11.1	11.3
				Bottom	5	26.7 26.7	26.7	8.1 8.1	8.1	31.3 31.3	31.3	99.5 99.8	99.7	6.7 6.7	6.7		8.1 8.5			8.3			13.4 9.4	11.4

Remarks: *DA: Depth-Averaged
 **Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS4 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
19-Aug-16	Fine	Moderate	14:32	Surface	1	27.5 27.5	27.5	8.2 8.2	8.2	18.6 18.9	18.8	89.3 90.8	90.1	6.4 6.5	6.5	6.4	10.0 9.4	9.7	11.7	7.5 7.4	7.5	7.4		
				Middle	3	27.4 27.5	27.5	8.2 8.1	8.2	20.6 20.8	20.7	88.2 90.6	89.4	6.2 6.4	6.3		12.3 11.8			12.1			7.4 6.6	7.0
				Bottom	5	27.3 27.2	27.3	8.1 8.0	8.1	23.6 23.5	23.6	87.7 86.6	87.2	6.1 6.0	6.1		13.2 13.1			13.2			7.1 8.5	7.8
22-Aug-16	Sunny	Calm	16:03	Surface	1	27.1 27.1	27.1	8.0 8.0	8.0	31.4 31.4	31.4	80.8 80.5	80.7	5.4 5.4	5.4	5.4	3.9 3.8	3.9	4.9	4.2 5.7	5.0	5.0		
				Middle	3	27.0 27.0	27.0	8.0 8.0	8.0	31.5 31.6	31.6	80.8 80.2	80.5	5.4 5.4	5.4		4.7 5.0			4.9			4.5 4.9	4.7
				Bottom	5	26.9 26.9	26.9	8.0 8.0	8.0	31.6 31.6	31.6	80.2 79.3	79.8	5.4 5.3	5.4		6.0 5.7			5.9			5.8 4.7	5.3
24-Aug-16	Sunny	Calm	17:39	Surface	1	26.7 26.6	26.7	7.8 7.9	7.9	30.6 30.6	30.6	83.7 83.8	83.8	5.7 5.7	5.7	5.7	5.1 4.8	5.0	6.7	5.8 7.1	6.5	6.2		
				Middle	3.5	26.7 26.7	26.7	7.9 7.8	7.9	30.7 30.7	30.7	83.4 83.4	83.4	5.6 5.6	5.6		6.7 7.2			7.0			6.8 5.7	6.3
				Bottom	6	26.7 26.7	26.7	7.8 7.9	7.9	30.8 30.8	30.8	82.9 82.9	82.9	5.6 5.6	5.6		8.6 7.6			8.1			4.4 6.9	5.7
26-Aug-16	Cloudy	Moderate	08:31	Surface	1	30.6 30.6	30.6	7.7 7.7	7.7	22.5 22.5	22.5	94.8 94.7	94.8	6.3 6.3	6.3	6.5	8.9 7.3	8.1	8.7	6.2 4.6	5.4	5.1		
				Middle	3	30.3 30.3	30.3	7.7 7.7	7.7	19.0 19.1	19.1	97.1 97.6	97.4	6.6 6.6	6.6		8.3 8.4			8.4			5.5 4.1	4.8
				Bottom	5	29.9 29.9	29.9	7.8 7.8	7.8	23.7 23.8	23.8	104.5 104.3	104.4	6.9 6.9	6.9		9.9 9.3			9.6			4.9 5.5	5.2
29-Aug-16	Cloudy	Moderate	11:39	Surface	1	29.2 29.3	29.3	7.9 7.8	7.9	20.5 20.3	20.4	87.7 87.1	87.4	6.0 6.0	6.0	6.1	3.0 3.0	3.0	4.8	5.6 8.6	7.1	6.6		
				Middle	3	26.7 26.6	26.7	7.8 7.8	7.8	26.2 26.2	26.2	87.5 87.1	87.3	6.1 6.0	6.1		4.6 5.3			5.0			7.2 6.3	6.8
				Bottom	5	26.5 26.5	26.5	7.8 7.8	7.8	28.5 28.4	28.5	82.0 81.7	81.9	5.6 5.6	5.6		6.3 6.3			6.3			6.2 5.6	5.9
31-Aug-16	Cloudy	Rough	12:42	Surface	1	28.6 28.6	28.6	7.9 7.9	7.9	17.2 17.0	17.1	91.1 90.8	91.0	6.4 6.4	6.4	6.0	12.4 12.4	12.4	12.9	18.3 16.6	17.5	18.0		
				Middle	3	28.1 28.1	28.1	7.8 7.8	7.8	28.9 28.9	28.9	83.0 81.7	82.4	5.5 5.4	5.5		11.7 11.6			11.7			17.5 18.8	18.2
				Bottom	5	27.5 27.5	27.5	7.5 7.5	7.5	29.1 29.1	29.1	76.8 75.0	75.9	5.2 5.0	5.1		14.8 14.6			14.7			17.5 19.0	18.3

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS4 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
3-Aug-16	Fine	Moderate	19:59	Surface	1	28.0 28.0	28.0	8.0 8.1	8.1	27.1 27.3	27.2	97.2 95.7	96.5	6.5 6.4	6.5	6.5	9.9 9.8	9.9	11.2	12.7 12.9	12.8	12.3
				Middle	3.5	28.1 28.1	28.1	8.1 8.1	8.1	28.2 28.3	28.3	97.3 96.2	96.8	6.5 6.4	6.5		11.1 11.0			11.1		
				Bottom	6	28.2 28.2	28.2	8.1 8.1	8.1	28.6 28.6	28.6	96.6 95.8	96.2	6.4 6.4	6.4	12.4 12.7	12.6	14.0 14.7	14.4			
5-Aug-16	Fine	Moderate	08:18	Surface	1	28.0 28.0	28.0	8.1 8.1	8.1	23.4 23.4	23.4	91.8 92.7	92.3	6.3 6.4	6.4	6.2	5.5 5.8	5.7	5.6	5.6 6.0	5.8	5.0
				Middle	3.5	27.7 27.7	27.7	8.1 8.1	8.1	27.9 28.3	28.1	87.5 86.3	86.9	5.9 5.8	5.9		5.8 5.8			5.8		
				Bottom	6	27.5 27.5	27.5	8.1 8.1	8.1	28.4 30.0	29.2	80.9 80.3	80.6	5.5 5.4	5.5	5.3 5.1	5.2	5.9 5.3	5.6			
8-Aug-16	Sunny	Moderate	11:03	Surface	1	27.3 27.4	27.4	8.1 8.1	8.1	30.3 29.7	30.0	117.6 114.3	116.0	7.9 7.7	7.8	7.7	5.2 5.2	5.2	6.7	5.6 3.8	4.7	3.9
				Middle	3	27.3 27.5	27.4	8.1 8.1	8.1	30.2 29.5	29.9	110.1 114.3	112.2	7.4 7.7	7.6		6.9 6.6			6.8		
				Bottom	5	27.4 27.8	27.6	8.1 8.2	8.2	29.8 29.0	29.4	114.3 115.1	114.7	7.7 7.7	7.7	7.9 8.3	8.1	2.5 3.3	2.9			
10-Aug-16	Rainy	Calm	11:47	Surface	1	27.7 27.8	27.8	8.0 8.0	8.0	26.5 26.4	26.5	95.0 94.2	94.6	6.5 6.4	6.5	6.4	6.2 6.1	6.2	8.5	4.2 3.6	3.9	4.0
				Middle	3	26.9 27.0	27.0	8.0 8.1	8.1	28.2 28.0	28.1	90.6 90.8	90.7	6.2 6.2	6.2		8.6 8.7			8.7		
				Bottom	5	25.6 25.6	25.6	8.0 8.0	8.0	29.3 29.4	29.4	82.4 82.2	82.3	5.7 5.7	5.7	10.3 10.7	10.5	3.5 4.1	3.8			
12-Aug-16	Rainy	Moderate	15:37	Surface	1	26.6 26.6	26.6	7.9 7.9	7.9	27.3 27.3	27.3	91.0 91.7	91.4	6.3 6.3	6.3	6.3	5.3 5.3	5.3	6.5	2.4 1.6	2.0	2.8
				Middle	3	26.6 26.4	26.5	8.0 8.0	8.0	28.5 28.6	28.6	91.9 92.0	92.0	6.3 6.3	6.3		7.0 6.3			6.7		
				Bottom	5	25.8 25.8	25.8	8.0 8.0	8.0	31.2 31.1	31.2	90.9 90.8	90.9	6.2 6.2	6.2	7.2 7.5	7.4	2.5 3.5	3.0			
15-Aug-16	Rainy	Moderate	18:01	Surface	1	26.6 26.6	26.6	7.9 7.9	7.9	27.4 27.4	27.4	85.5 85.0	85.3	5.9 5.9	5.9	5.9	8.1 7.3	7.7	8.6	9.6 9.8	9.7	9.9
				Middle	3.5	26.2 26.3	26.3	7.9 7.9	7.9	30.7 30.7	30.7	85.9 86.0	86.0	5.8 5.8	5.8		9.2 8.5			8.9		
				Bottom	6	26.2 26.2	26.2	7.9 7.9	7.9	30.9 30.8	30.9	86.3 86.1	86.2	5.9 5.9	5.9	9.1 9.4	9.3	9.6 9.3	9.5			
17-Aug-16	Rainy	Rough	19:13	Surface	1	26.4 26.4	26.4	8.0 8.0	8.0	30.8 30.8	30.8	85.5 84.0	84.8	5.8 5.7	5.8	5.7	8.4 8.3	8.4	8.7	11.4 12.1	11.8	11.2
				Middle	3.5	26.3 26.3	26.3	8.0 8.0	8.0	30.9 30.9	30.9	82.7 82.1	82.4	5.6 5.6	5.6		8.2 8.8			8.5		
				Bottom	6	26.3 26.3	26.3	8.0 8.0	8.0	30.9 30.9	30.9	81.4 81.3	81.4	5.5 5.5	5.5	9.2 9.1	9.2	10.1 11.3	10.7			
19-Aug-16	Fine	Moderate	19:57	Surface	1	26.9 26.8	26.9	8.2 8.3	8.3	24.5 24.1	24.3	88.2 88.7	88.5	6.1 6.2	6.2	6.1	8.4 8.8	8.6	10.6	9.6 7.0	8.3	8.4
				Middle	3.5	26.9 26.7	26.8	8.2 8.2	8.2	25.6 25.5	25.6	85.4 87.5	86.5	5.9 6.1	6.0		10.2 10.6			10.4		
				Bottom	6	26.5 26.6	26.6	8.2 8.2	8.2	27.4 27.3	27.4	83.2 85.3	84.3	5.7 5.9	5.8	12.6 12.7	12.7	8.5 8.6	8.6			

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at IS4 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
22-Aug-16	Sunny	Calm	09:54	Surface	1	27.4 27.4	27.4	8.1 8.1	8.1	31.0 31.0	31.0	80.4 79.6	80.0	5.4 5.3	5.4	5.7	3.6 3.2	3.4	4.3	11.0 8.7	9.9	8.9
				Middle	3.5	27.0 27.0	27.0	8.1 8.1	8.1	31.1 31.1	31.1	88.5 87.9	88.2	5.9 5.9	5.9		3.9 4.2	4.1		8.1 10.0	9.1	
				Bottom	6	26.9 26.9	26.9	8.1 8.1	8.1	31.3 31.2	31.3	89.9 89.6	89.8	6.0 6.0	6.0		5.6 5.1	5.4		7.1 8.3	7.7	
24-Aug-16	Sunny	Calm	11:44	Surface	1	25.7 25.7	25.7	7.9 7.9	7.9	30.6 30.6	30.6	84.8 84.8	84.8	5.8 5.8	5.8	5.8	3.5 3.9	3.7	5.6	7.5 5.5	6.5	7.4
				Middle	3.5	25.8 25.8	25.8	7.9 7.9	7.9	30.6 30.6	30.6	84.6 84.5	84.6	5.8 5.8	5.8		4.3 4.7	4.5		6.0 5.7	5.9	
				Bottom	6	25.8 25.8	25.8	7.9 7.9	7.9	30.7 30.7	30.7	84.3 84.2	84.3	5.8 5.8	5.8		8.3 8.6	8.5		11.1 8.2	9.7	
26-Aug-16	Cloudy	Moderate	14:43	Surface	1	30.4 30.4	30.4	7.7 7.7	7.7	22.5 22.5	22.5	110.8 110.2	110.5	7.4 7.3	7.4	7.4	8.3 8.1	8.2	9.1	5.4 6.6	6.0	5.9
				Middle	3.5	30.1 30.1	30.1	7.7 7.7	7.7	18.6 18.6	18.6	106.6 106.9	106.8	7.3 7.3	7.3		9.1 9.8	9.5		4.9 6.3	5.6	
				Bottom	6	29.8 29.8	29.8	7.8 7.8	7.8	22.6 22.5	22.6	102.1 102.8	102.5	6.8 6.9	6.9		9.6 9.4	9.5		5.3 6.6	6.0	
29-Aug-16	Cloudy	Moderate	17:55	Surface	1	28.8 28.8	28.8	8.0 8.0	8.0	25.0 25.0	25.0	95.4 95.7	95.6	6.4 6.4	6.4	6.4	5.5 5.5	5.5	5.9	7.8 11.3	9.6	7.0
				Middle	3.5	27.5 27.5	27.5	7.9 7.9	7.9	26.7 26.8	26.8	92.8 92.0	92.4	6.3 6.3	6.3		5.9 6.0	6.0		5.2 5.4	5.3	
				Bottom	6	27.2 27.2	27.2	7.9 7.9	7.9	29.1 29.1	29.1	79.3 79.0	79.2	5.4 5.3	5.4		6.0 6.5	6.3		5.6 6.6	6.1	
31-Aug-16	Cloudy	Moderate	19:01	Surface	1	28.6 28.6	28.6	8.0 8.0	8.0	17.9 17.9	17.9	94.6 94.4	94.5	6.6 6.6	6.6	6.3	12.9 12.6	12.8	12.1	17.6 13.3	15.5	15.1
				Middle	3.5	28.2 28.2	28.2	7.9 7.9	7.9	30.1 30.2	30.2	91.2 88.9	90.1	6.0 5.9	6.0		9.3 9.1	9.2		15.4 12.9	14.2	
				Bottom	6	27.5 27.5	27.5	7.9 7.9	7.9	31.7 31.7	31.7	85.0 83.8	84.4	5.6 5.5	5.6		14.3 14.2	14.3		16.0 15.2	15.6	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)		Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
1-Aug-16	Cloudy	Moderate	11:26	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1	27.9 27.9	27.9	7.8 7.8	7.8	21.2 21.4	21.3	93.2 92.9	93.1	7.2 7.1	7.2	7.2	3.5 3.5	3.5	3.5	7.9 7.9	7.9	7.9	7.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
3-Aug-16	Rainy	Moderate	13:02	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.2	27.4 28.0	27.7	8.1 8.0	8.1	27.5 28.1	27.8	87.6 93.3	90.5	5.9 6.3	6.1	6.1	7.6 7.6	7.6	7.6	9.2 11.6	10.4	10.4	10.4
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
5-Aug-16	Fine	Moderate	13:59	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.1	28.0 28.0	28.0	8.0 8.0	8.0	21.8 22.2	22.0	74.1 73.7	73.9	5.1 5.1	5.1	5.1	5.6 5.2	5.4	5.4	3.8 5.3	4.6	4.6	4.6
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
8-Aug-16	Sunny	Moderate	16:33	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1	28.1 28.1	28.1	8.0 8.0	8.0	29.5 29.7	29.6	116.0 116.7	116.4	7.7 7.7	7.7	7.7	6.0 5.9	6.0	6.0	6.2 5.5	5.9	5.9	5.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
10-Aug-16	Cloudy	Calm	16:05	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.5	26.9 27.4	27.2	7.8 8.0	7.9	26.8 26.9	26.9	90.5 89.5	90.0	6.2 6.1	6.2	6.2	7.5 7.5	7.5	7.5	5.5 7.1	6.3	6.3	6.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
12-Aug-16	Rainy	Moderate	08:16	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.1	28.6 28.8	28.7	8.0 8.0	8.0	28.8 28.7	28.8	95.0 95.8	95.4	6.3 6.3	6.3	6.3	4.9 4.7	4.8	4.8	9.6 12.2	10.9	10.9	10.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
15-Aug-16	Rainy	Moderate	11:26	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.1	26.5 26.5	26.5	7.9 7.9	7.9	26.8 26.8	26.8	96.8 95.3	96.1	6.7 6.6	6.7	6.7	4.6 4.5	4.6	4.6	9.2 8.0	8.6	8.6	8.6
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
17-Aug-16	Rainy	Rough	12:38	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
				Middle	1.4	26.9 26.9	26.9	8.0 8.0	8.0	30.8 30.8	30.8	83.1 83.4	83.3	5.6 5.6	5.6	5.6	6.8 5.8	6.3	6.3	13.0 12.9	13.0	13.0	13.0
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged
 **Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)	Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)		Turbidity(NTU)			Suspended Solids (mg/L)					
					Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
19-Aug-16	Fine	Moderate	14:27	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.4	27.6 27.6	27.6	8.1 8.1	8.1	24.0 23.9	24.0	99.3 99.6	99.5	6.9 6.9	6.9	6.9	7.9 6.9	7.4	7.4	7.4	7.4	8.6	8.6
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
22-Aug-16	Sunny	Calm	14:33	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.2	27.6 27.6	27.6	8.0 8.0	8.0	30.9 30.8	30.9	92.9 94.3	93.6	6.2 6.3	6.3	6.3	7.5 7.4	7.5	7.5	7.5	6.9 8.6	7.8	7.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
24-Aug-16	Sunny	Calm	16:05	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	26.3 26.3	26.3	7.8 7.8	7.8	30.4 30.5	30.5	87.9 86.9	87.4	6.0 5.9	6.0	6.0	7.3 7.5	7.4	7.4	7.4	5.9 7.6	6.8	6.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
26-Aug-16	Cloudy	Moderate	08:48	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	29.8 29.8	29.8	7.6 7.6	7.6	24.9 24.8	24.9	106.2 104.6	105.4	7.0 6.9	7.0	7.0	4.1 4.0	4.1	4.1	4.1	4.4 7.6	6.0	6.0
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
29-Aug-16	Cloudy	Moderate	11:41	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	29.5 29.5	29.5	8.0 8.0	8.0	23.7 23.9	23.8	83.1 82.4	82.8	5.6 5.5	5.6	5.6	2.6 2.7	2.7	2.7	2.7	7.1 8.6	7.9	7.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
31-Aug-16	Cloudy	Rough	12:37	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.3	28.2 28.2	28.2	7.9 7.9	7.9	27.3 27.3	27.3	91.1 91.4	91.3	6.1 6.1	6.1	6.1	11.3 10.3	10.8	10.8	10.8	5.4 7.4	6.4	6.4
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
3-Aug-16	Fine	Moderate	18:32	Surface	-	-	-	-	-	-	-	-	-	-	-	-	6.1	-	-	-	-	-	-	
				Middle	1.4	28.4 27.3	27.9	8.0 8.1	8.1	27.7 27.9	27.8	89.5 91.1	90.3	6.0 6.2	6.1	-	-	-	7.6	7.6	7.6	6.9 7.6	7.3	7.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
5-Aug-16	Fine	Moderate	07:55	Surface	-	-	-	-	-	-	-	-	-	-	-	-	5.4	-	-	-	-	-	-	
				Middle	1.2	28.1 28.0	28.1	8.2 8.2	8.2	28.0 28.2	28.1	80.1 79.6	79.9	5.4 5.3	5.4	-	-	-	5.9	5.9	5.9	2.8 4.2	3.5	3.5
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
8-Aug-16	Sunny	Moderate	09:50	Surface	-	-	-	-	-	-	-	-	-	-	-	-	7.9	-	-	-	-	-	-	
				Middle	1	28.1 28.1	28.1	8.3 8.3	8.3	29.3 29.4	29.4	117.8 118.7	118.3	7.8 7.9	7.9	-	-	-	5.4	5.5	5.5	5.6 7.0	6.3	6.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
10-Aug-16	Rainy	Calm	11:25	Surface	-	-	-	-	-	-	-	-	-	-	-	-	6.3	-	-	-	-	-	-	
				Middle	1.2	27.8 27.2	27.5	7.8 7.9	7.9	26.8 27.4	27.1	93.5 92.1	92.8	6.3 6.3	6.3	-	-	-	7.5	7.5	7.5	6.4 7.7	7.1	7.1
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
12-Aug-16	Rainy	Moderate	15:29	Surface	-	-	-	-	-	-	-	-	-	-	-	-	6.3	-	-	-	-	-	-	
				Middle	1	27.7 27.7	27.7	8.0 8.0	8.0	27.8 27.9	27.9	93.6 94.1	93.9	6.3 6.3	6.3	-	-	-	4.9	4.6	4.6	9.3 12.4	10.9	10.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
15-Aug-16	Rainy	Moderate	16:51	Surface	-	-	-	-	-	-	-	-	-	-	-	-	6.9	-	-	-	-	-	-	
				Middle	1.1	27.1 27.1	27.1	8.1 8.1	8.1	26.1 26.1	26.1	100.2 100.2	100.2	6.9 6.9	6.9	-	-	-	3.4	3.3	3.3	8.1 11.1	9.6	9.6
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
17-Aug-16	Rainy	Rough	17:37	Surface	-	-	-	-	-	-	-	-	-	-	-	-	5.5	-	-	-	-	-	-	
				Middle	1.3	26.8 26.8	26.8	8.0 8.0	8.0	29.9 29.9	29.9	79.7 81.1	80.4	5.4 5.5	5.5	-	-	-	5.6	5.6	5.6	11.6 11.9	11.8	11.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
19-Aug-16	Fine	Moderate	18:39	Surface	-	-	-	-	-	-	-	-	-	-	-	-	6.8	-	-	-	-	-	-	
				Middle	1.2	26.3 26.3	26.3	8.1 8.1	8.1	23.0 23.0	23.0	94.0 95.3	94.7	6.7 6.8	6.8	-	-	-	6.7	6.7	6.7	7.0 9.5	8.3	8.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
22-Aug-16	Sunny	Calm	09:48	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.4	27.6 27.7	27.7	8.1 8.1	8.1	31.8 31.8	31.8	96.4 96.7	96.6	6.4 6.4	6.4	6.4	6.4	6.4	8.7 7.7	8.2	8.2	7.0 7.7	7.4	7.4
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
24-Aug-16	Sunny	Calm	11:32	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	26.3 26.4	26.4	7.8 7.8	7.8	30.0 29.9	30.0	82.2 81.8	82.0	5.6 5.6	5.6	5.6	5.6	7.4 7.0	7.2	7.2	6.9 6.3	6.6	6.6	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
26-Aug-16	Cloudy	Moderate	13:24	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	30.3 30.3	30.3	7.7 7.7	7.7	24.2 24.2	24.2	101.6 101.6	101.6	6.7 6.7	6.7	6.7	6.7	2.9 2.7	2.8	2.8	2.9 3.9	3.4	3.4	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
29-Aug-16	Cloudy	Moderate	16:31	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	29.5 29.5	29.5	7.9 7.9	7.9	22.8 22.7	22.8	91.3 92.3	91.8	6.1 6.2	6.2	6.2	6.2	3.7 4.0	3.9	3.9	6.2 7.9	7.1	7.1	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
31-Aug-16	Cloudy	Moderate	17:37	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.2	28.1 28.1	28.1	7.9 7.9	7.9	26.4 26.4	26.4	87.7 89.1	88.4	5.9 6.0	6.0	6.0	6.0	10.1 10.0	10.1	10.1	9.1 13.7	11.4	11.4	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)	Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)		Turbidity(NTU)			Suspended Solids (mg/L)					
					Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
1-Aug-16	Cloudy	Moderate	10:36	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.8	28.2 28.2	28.2	7.8 7.8	7.8	25.7 25.6	25.7	93.2 92.9	93.1	7.0 7.0	7.0	7.0	7.0	5.9 5.8	5.9	5.9	7.7 7.9	7.8	7.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
3-Aug-16	Rainy	Moderate	11:55	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	28.2 27.5	27.9	8.0 8.2	8.1	27.8 27.7	27.8	91.1 92.1	91.6	6.1 6.2	6.2	6.2	6.2	6.7 6.8	6.8	6.8	10.9 10.7	10.8	10.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
5-Aug-16	Fine	Moderate	13:29	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	28.4 28.1	28.3	8.1 8.1	8.1	28.0 27.8	27.9	79.8 78.0	78.9	5.3 5.2	5.3	5.3	5.3	5.7 5.7	5.7	5.7	3.1 4.9	4.0	4.0
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
8-Aug-16	Sunny	Moderate	15:34	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	28.0 27.9	28.0	8.0 8.1	8.1	29.7 29.7	29.7	116.6 116.0	116.3	7.7 7.7	7.7	7.7	7.7	6.9 6.9	6.9	6.9	11.0 7.3	9.2	9.2
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
10-Aug-16	Cloudy	Calm	17:20	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	27.4 26.8	27.1	7.8 8.0	7.9	27.6 26.8	27.2	93.4 92.8	93.1	6.3 6.4	6.4	6.4	6.4	6.7 6.6	6.7	6.7	4.5 6.7	5.6	5.6
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
12-Aug-16	Rainy	Moderate	07:24	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	27.1 27.5	27.3	8.0 8.0	8.0	28.3 28.6	28.5	96.0 96.0	96.0	6.5 6.5	6.5	6.5	6.5	9.7 9.6	9.7	9.7	9.7 9.1	9.4	9.4
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
15-Aug-16	Rainy	Moderate	10:21	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	27.5 27.5	27.5	8.0 8.0	8.0	26.7 26.7	26.7	90.9 91.6	91.3	6.2 6.2	6.2	6.2	6.2	5.4 5.6	5.5	5.5	8.3 9.4	8.9	8.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
17-Aug-16	Rainy	Rough	11:42	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.8	26.9 26.9	26.9	8.1 8.1	8.1	30.0 30.0	30.0	80.5 81.1	80.8	5.4 5.5	5.5	5.5	5.5	8.3 8.5	8.4	8.4	11.5 14.8	13.2	13.2
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)	Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)		Turbidity(NTU)			Suspended Solids (mg/L)						
					Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
19-Aug-16	Fine	Moderate	13:31	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
				Middle	0.8	27.6 27.6	27.6	8.0 8.0	8.0	23.1 23.1	23.1	96.7 97.3	97.0	6.7 6.7	6.7	6.7	6.7	6.7	9.4 9.6	9.5	9.5	7.9 8.3	8.1	8.1
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
22-Aug-16	Sunny	Calm	15:28	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
				Middle	1.2	27.6 27.6	27.6	8.1 8.1	8.1	31.0 31.0	31.0	91.9 92.1	92.0	6.1 6.1	6.1	6.1	6.1	6.1	7.2 7.2	7.2	7.2	4.9 5.1	5.0	5.0
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
24-Aug-16	Sunny	Calm	17:39	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
				Middle	1.1	26.3 26.3	26.3	7.9 7.9	7.9	29.0 28.9	29.0	78.5 78.7	78.6	5.4 5.4	5.4	5.4	5.4	5.4	7.2 8.1	7.7	7.7	5.6 5.0	5.3	5.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
26-Aug-16	Cloudy	Moderate	07:43	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
				Middle	1	30.8 30.8	30.8	7.6 7.6	7.6	24.7 24.8	24.8	100.1 100.8	100.5	6.5 6.6	6.6	6.6	6.6	4.9 5.1	5.0	5.0	4.8 5.0	4.9	4.9	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
29-Aug-16	Cloudy	Moderate	10:46	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
				Middle	0.8	29.3 29.3	29.3	8.0 7.9	8.0	25.7 25.7	25.7	107.1 106.3	106.7	7.1 7.1	7.1	7.1	7.1	4.9 4.5	4.7	4.7	8.2 13.2	10.7	10.7	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
31-Aug-16	Cloudy	Rough	11:41	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
				Middle	0.8	28.2 28.2	28.2	7.9 7.9	7.9	26.5 26.5	26.5	88.5 89.1	88.8	6.0 6.0	6.0	6.0	6.0	12.8 13.0	12.9	12.9	5.9 6.1	6.0	6.0	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged
 **Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
3-Aug-16	Fine	Moderate	19:47	Surface	-	-	-	-	-	-	-	-	-	-	-	-	6.3	-	-	6.9	-	-	8.2
				Middle	1.1	28.4 27.4	27.9	8.0 8.0	8.0	28.3 27.9	28.1	95.1 92.8	94.0	6.3 6.3	6.3	6.9 6.8	6.9	6.9	6.9	9.1 7.3	8.2	8.2	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
5-Aug-16	Fine	Moderate	07:21	Surface	-	-	-	-	-	-	-	-	-	-	-	-	5.5	-	-	5.5	-	-	2.9
				Middle	1	28.0 28.0	28.0	8.2 8.2	8.2	27.4 27.1	27.3	83.4 80.4	81.9	5.6 5.4	5.5	5.4 5.5	5.5	5.5	5.5	2.6 3.2	2.9	2.9	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
8-Aug-16	Sunny	Moderate	08:58	Surface	-	-	-	-	-	-	-	-	-	-	-	-	7.9	-	-	6.6	-	-	6.2
				Middle	1	28.0 28.0	28.0	8.1 8.1	8.1	30.0 30.1	30.1	118.8 118.9	118.9	7.9 7.9	7.9	6.5 6.6	6.6	6.6	6.6	6.0 6.4	6.2	6.2	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
10-Aug-16	Rainy	Calm	10:18	Surface	-	-	-	-	-	-	-	-	-	-	-	-	6.0	-	-	6.7	-	-	6.7
				Middle	0.9	27.7 27.3	27.5	8.0 8.0	8.0	27.4 27.7	27.6	89.0 87.2	88.1	6.0 5.9	6.0	6.6 6.7	6.7	6.7	6.3 7.1	6.7	6.7		
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
12-Aug-16	Rainy	Moderate	14:42	Surface	-	-	-	-	-	-	-	-	-	-	-	-	6.4	-	-	6.8	-	-	10.2
				Middle	1.1	27.0 26.8	26.9	8.0 8.0	8.0	28.7 28.9	28.8	94.1 93.7	93.9	6.4 6.4	6.4	6.7 6.8	6.8	6.8	8.6 11.8	10.2	10.2		
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
15-Aug-16	Rainy	Moderate	17:55	Surface	-	-	-	-	-	-	-	-	-	-	-	-	5.7	-	-	5.7	-	-	8.9
				Middle	1.1	27.3 27.4	27.4	8.0 8.0	8.0	25.5 25.0	25.3	82.7 83.2	83.0	5.7 5.7	5.7	5.9 5.5	5.7	5.7	7.5 10.2	8.9	8.9		
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
17-Aug-16	Rainy	Rough	18:31	Surface	-	-	-	-	-	-	-	-	-	-	-	-	5.3	-	-	5.3	-	-	9.5
				Middle	1.2	26.8 26.8	26.8	8.0 8.0	8.0	30.1 30.1	30.1	78.7 78.9	78.8	5.3 5.3	5.3	5.3 5.3	5.3	5.3	9.8 9.1	9.5	9.5		
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
19-Aug-16	Fine	Moderate	19:34	Surface	-	-	-	-	-	-	-	-	-	-	-	-	6.6	-	-	6.4	-	-	14.0
				Middle	1.2	26.3 26.3	26.3	8.1 8.1	8.1	23.2 23.2	23.2	93.1 93.2	93.2	6.6 6.6	6.6	6.4 6.4	6.4	6.4	13.3 14.7	14.0	14.0		
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
22-Aug-16	Sunny	Calm	08:52	Surface	-	-	-	-	-	-	-	-	-	-	-	-	6.3	-	-	5.3	-	-	9.3
				Middle	0.8	27.7	27.7	8.0	8.0	30.9	30.9	93.7	94.0	6.2	6.3	-	5.2	5.3	-		7.8	9.3	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-	
24-Aug-16	Sunny	Calm	10:08	Surface	-	-	-	-	-	-	-	-	-	-	-	-	5.7	-	-	6.8	-	-	7.5
				Middle	0.8	26.4	26.4	7.8	7.9	31.4	31.4	84.9	84.7	5.7	5.7	-	6.7	6.8	-		7.2	7.5	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-	
26-Aug-16	Cloudy	Moderate	14:29	Surface	-	-	-	-	-	-	-	-	-	-	-	-	6.8	-	-	5.2	-	-	4.0
				Middle	1.1	30.5	30.6	7.6	7.7	23.5	23.3	103.1	103.4	6.8	6.8	-	5.4	5.2	-		2.7	4.0	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-	
29-Aug-16	Cloudy	Moderate	17:29	Surface	-	-	-	-	-	-	-	-	-	-	-	-	6.2	-	-	2.2	-	-	8.6
				Middle	1	29.5	29.5	7.9	7.9	25.7	25.8	93.0	92.4	6.2	6.2	-	2.0	2.2	-		7.7	8.6	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-	
31-Aug-16	Cloudy	Moderate	18:31	Surface	-	-	-	-	-	-	-	-	-	-	-	-	5.9	-	-	9.8	-	-	9.9
				Middle	1.1	28.1	28.1	7.9	7.9	26.6	26.6	86.8	86.9	5.9	5.9	-	9.8	9.8	-		9.0	9.9	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)	Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)		Turbidity(NTU)			Suspended Solids (mg/L)					
					Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
1-Aug-16	Cloudy	Moderate	10:14	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	28.0 28.1	28.1	7.9 7.9	7.9	24.7 24.7	24.7	93.2 92.9	93.1	7.0 7.0	7.0	7.0	4.4 4.5	4.5	4.5	4.5	7.3 5.0	6.2	6.2
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
3-Aug-16	Rainy	Moderate	11:44	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	27.8 28.3	28.1	8.0 8.1	8.1	27.6 28.1	27.9	95.3 91.9	93.6	6.4 6.1	6.3	6.3	6.4 6.3	6.4	6.4	6.4	9.0 10.0	9.5	9.5
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
5-Aug-16	Fine	Moderate	13:07	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	28.2 28.4	28.3	8.2 8.1	8.2	31.0 31.5	31.3	93.4 94.6	94.0	6.1 6.2	6.2	6.2	8.7 8.2	8.5	8.5	8.5	3.6 3.4	3.5	3.5
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
8-Aug-16	Sunny	Moderate	15:07	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	28.0 28.0	28.0	8.1 8.1	8.1	28.9 28.9	28.9	119.3 119.4	119.4	8.0 8.0	8.0	8.0	5.4 5.5	5.5	5.5	5.5	9.0 8.1	8.6	8.6
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
10-Aug-16	Cloudy	Calm	17:37	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	27.3 27.3	27.3	7.8 8.1	8.0	26.9 26.9	26.9	93.7 89.6	91.7	6.4 6.1	6.3	6.3	6.3 6.1	6.2	6.2	6.2	4.6 5.1	4.9	4.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
12-Aug-16	Rainy	Moderate	07:00	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	27.4 27.5	27.5	8.0 8.1	8.1	28.3 28.5	28.4	94.2 94.4	94.3	6.4 6.4	6.4	6.4	5.3 5.9	5.6	5.6	5.6	10.7 9.5	10.1	10.1
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
15-Aug-16	Rainy	Moderate	10:01	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	26.3 26.2	26.3	7.8 7.8	7.8	27.6 28.0	27.8	83.0 82.7	82.9	5.7 5.7	5.7	5.7	9.0 9.0	9.0	9.0	9.0	7.8 7.9	7.9	7.9
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
17-Aug-16	Rainy	Rough	11:13	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	26.8 26.8	26.8	8.0 8.0	8.0	29.7 29.7	29.7	81.3 80.5	80.9	5.5 5.5	5.5	5.5	3.5 3.5	3.5	3.5	3.5	13.8 14.6	14.2	14.2
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged
 **Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)	Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)		Turbidity(NTU)			Suspended Solids (mg/L)					
					Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
19-Aug-16	Fine	Moderate	13:02	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	27.5 27.5	27.5	7.9 7.9	7.9	22.8 22.8	22.8	97.4 96.6	97.0	6.8 6.7	6.8	6.8	4.6 4.6	4.6	4.6	4.6	7.1 9.9	8.5	8.5
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
22-Aug-16	Sunny	Calm	15:48	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	27.7 27.7	27.7	8.0 8.0	8.0	30.6 30.5	30.6	83.6 84.2	83.9	5.6 5.6	5.6	5.6	5.6 5.6	5.6	5.6	5.6	5.4 6.8	6.1	6.1
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
24-Aug-16	Sunny	Calm	18:09	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	0.9	26.3 26.3	26.3	7.9 7.9	7.9	31.3 31.3	31.3	81.1 80.1	80.6	5.5 5.4	5.5	5.5	4.8 4.8	4.8	4.8	4.8	5.9 6.6	6.3	6.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
26-Aug-16	Cloudy	Moderate	07:23	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	29.6 29.5	29.6	7.5 7.5	7.5	24.8 25.2	25.0	91.3 91.1	91.2	6.1 6.1	6.1	6.1	8.1 8.1	8.1	8.1	8.1	4.9 4.7	4.8	4.8
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
29-Aug-16	Cloudy	Moderate	10:16	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1.1	29.5 29.5	29.5	7.9 7.9	7.9	25.0 25.0	25.0	104.6 103.7	104.2	7.0 6.9	7.0	7.0	5.3 5.3	5.3	5.3	5.3	8.8 11.4	10.1	10.1
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
31-Aug-16	Cloudy	Rough	11:13	Surface	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
				Middle	1	28.1 28.1	28.1	7.8 7.8	7.8	26.2 26.2	26.2	89.4 88.5	89.0	6.0 6.0	6.0	6.0	8.0 8.0	8.0	8.0	8.0	5.1 5.5	5.3	5.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
3-Aug-16	Fine	Moderate	20:01	Surface	-	-	-	-	-	-	-	-	-	-	-	-	6.1	-	-	6.4	-	-	7.5		
				Middle	1	28.0	27.8	8.0	8.0	27.2	27.6	89.6	90.7	6.0	6.1	-	-	-	-	-	6.5	6.4	8.0	7.5	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
5-Aug-16	Fine	Moderate	06:55	Surface	-	-	-	-	-	-	-	-	-	-	-	6.7	-	-	9.2	-	-	4.0			
				Middle	1	28.2	28.2	8.1	8.1	31.0	30.6	100.8	102.2	6.6	6.7	-	-	-	-	-	9.3	9.2	4.3	4.0	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
8-Aug-16	Sunny	Moderate	08:30	Surface	-	-	-	-	-	-	-	-	-	-	-	7.8	-	-	5.1	-	-	6.4			
				Middle	1.1	28.0	28.1	8.2	8.2	28.7	28.7	117.1	117.2	7.8	7.8	-	-	-	-	-	5.0	5.1	5.7	6.4	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
10-Aug-16	Rainy	Calm	10:07	Surface	-	-	-	-	-	-	-	-	-	-	-	6.2	-	-	6.2	-	-	6.8			
				Middle	1	27.1	27.1	8.0	8.0	27.4	27.3	91.3	90.8	6.2	6.2	-	-	-	-	-	6.2	6.1	6.1	7.4	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
12-Aug-16	Rainy	Moderate	14:22	Surface	-	-	-	-	-	-	-	-	-	-	-	6.4	-	-	6.0	-	-	8.3			
				Middle	1	28.2	28.5	8.0	8.0	29.0	29.0	96.0	96.0	6.4	6.4	-	-	-	-	-	6.0	5.9	6.0	8.0	8.3
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
15-Aug-16	Rainy	Moderate	18:16	Surface	-	-	-	-	-	-	-	-	-	-	-	6.4	-	-	4.6	-	-	8.2			
				Middle	0.9	28.0	28.0	8.1	8.1	26.1	26.1	93.3	93.9	6.3	6.4	-	-	-	-	-	4.7	4.4	4.6	8.5	8.2
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
17-Aug-16	Rainy	Rough	18:51	Surface	-	-	-	-	-	-	-	-	-	-	-	6.9	-	-	3.7	-	-	9.1			
				Middle	1	26.9	26.9	8.0	8.0	29.6	29.6	101.8	102.1	6.9	6.9	-	-	-	-	-	3.7	3.7	3.7	9.9	9.1
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
19-Aug-16	Fine	Moderate	19:53	Surface	-	-	-	-	-	-	-	-	-	-	-	6.1	-	-	4.8	-	-	11.2			
				Middle	1	26.4	26.5	8.0	8.0	22.7	22.7	85.3	85.6	6.0	6.1	-	-	-	-	-	4.8	4.8	4.8	13.2	11.2
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
22-Aug-16	Sunny	Calm	08:24	Surface	-	-	-	-	-	-	-	-	-	-	-	-	6.3	-	-	5.4	-	-	7.8
				Middle	1.1	27.5	27.6	7.9	7.9	30.6	30.6	94.5	94.1	6.3	6.3	-	5.4	5.4	-		8.9	7.8	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-	
24-Aug-16	Sunny	Calm	09:53	Surface	-	-	-	-	-	-	-	-	-	-	-	-	5.8	-	-	6.3	-	-	6.7
				Middle	1.1	26.3	26.3	7.8	7.8	29.9	29.9	84.5	84.4	5.8	5.8	-	6.1	6.3	-		6.0	6.7	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-	
26-Aug-16	Cloudy	Moderate	14:49	Surface	-	-	-	-	-	-	-	-	-	-	-	-	8.0	-	-	4.1	-	-	3.3
				Middle	0.8	31.3	31.3	7.8	7.8	24.2	24.2	122.6	123.3	8.0	8.0	-	4.2	4.1	-		3.6	3.3	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-	
29-Aug-16	Cloudy	Moderate	17:55	Surface	-	-	-	-	-	-	-	-	-	-	-	-	6.1	-	-	3.4	-	-	9.4
				Middle	0.9	29.6	29.7	7.9	7.9	25.7	25.7	91.8	91.2	6.1	6.1	-	3.4	3.4	-		10.1	9.4	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-	
31-Aug-16	Cloudy	Moderate	18:51	Surface	-	-	-	-	-	-	-	-	-	-	-	-	6.6	-	-	8.2	-	-	9.0
				Middle	1	28.2	28.2	7.9	7.9	26.1	26.1	96.8	97.1	6.5	6.6	-	8.2	8.2	-		9.6	9.0	
				Bottom	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR6 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
1-Aug-16	Cloudy	Moderate	10:31	Surface	1	27.9 29.0	28.5	7.9 7.8	7.9	31.1 31.3	31.2	96.5 102.3	99.4	6.4 6.6	6.5	6.5	4.0 4.0	4.0	5.4	9.0 9.8	9.4	9.0		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-
				Bottom	4.5	28.3 28.8	28.6	7.8 7.7	7.8	28.6 27.8	28.2	90.1 93.1	91.6	6.0 6.2	6.1	6.1	6.7 6.8	6.8		6.1	6.7 6.8		6.8	8.8 8.1
3-Aug-16	Rainy	Moderate	12:20	Surface	1	27.2 27.3	27.3	8.1 8.1	8.1	26.6 26.8	26.7	85.0 85.6	85.3	5.8 5.8	5.8	5.8	8.2 8.6	8.4	10.1	15.0 15.3	15.2	15.1		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-
				Bottom	4.1	27.6 27.6	27.6	8.1 8.1	8.1	28.7 28.7	28.7	83.2 83.9	83.6	5.6 5.6	5.6	5.6	11.9 11.4	11.7		5.6	11.9 11.4		11.7	14.2 15.6
5-Aug-16	Fine	Moderate	13:34	Surface	1	28.0 28.0	28.0	7.8 7.8	7.8	26.2 26.2	26.2	105.3 105.4	105.4	7.1 7.1	7.1	7.1	4.2 4.3	4.3	5.3	4.8 3.1	4.0	4.8		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-
				Bottom	4	27.7 27.7	27.7	7.9 7.9	7.9	28.0 28.0	28.0	93.6 93.1	93.4	6.3 6.3	6.3	6.3	6.1 6.2	6.2		6.3	6.1 6.2		6.2	4.8 6.1
8-Aug-16	Sunny	Moderate	15:38	Surface	1	27.0 27.1	27.1	8.1 8.1	8.1	30.6 30.6	30.6	114.4 114.6	114.5	7.7 7.7	7.7	7.7	4.3 4.4	4.4	4.8	4.5 4.7	4.6	4.8		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-
				Bottom	4	27.0 27.0	27.0	8.1 8.1	8.1	30.6 30.6	30.6	114.2 114.5	114.4	7.7 7.7	7.7	7.7	5.1 5.0	5.1		7.7	5.1 5.0		5.1	4.8 4.9
10-Aug-16	Cloudy	Calm	16:25	Surface	1	28.5 28.5	28.5	8.0 8.0	8.0	25.2 25.1	25.2	104.9 105.0	105.0	7.1 7.1	7.1	7.1	8.1 8.1	8.1	9.2	3.3 2.8	3.1	2.9		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-
				Bottom	3.2	27.2 27.2	27.2	8.1 8.1	8.1	25.9 25.9	25.9	89.5 89.0	89.3	6.2 6.1	6.2	6.2	10.2 10.2	10.2		6.2	10.2 10.2		10.2	2.3 2.8
12-Aug-16	Rainy	Moderate	07:44	Surface	1	27.5 27.5	27.5	8.0 8.0	8.0	27.3 27.4	27.4	97.9 97.7	97.8	6.6 6.6	6.6	6.6	3.1 2.9	3.0	5.4	2.7 2.7	2.7	3.1		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-
				Bottom	4.5	26.4 26.3	26.4	8.0 8.0	8.0	27.6 28.0	27.8	85.9 86.4	86.2	5.9 6.0	6.0	6.0	7.4 8.0	7.7		6.0	7.4 8.0		7.7	2.7 4.1
15-Aug-16	Rainy	Moderate	10:23	Surface	1	27.0 27.0	27.0	7.9 7.9	7.9	27.4 27.4	27.4	87.7 88.4	88.1	6.0 6.1	6.1	6.1	7.1 7.3	7.2	6.3	9.5 14.6	12.1	11.9		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-
				Bottom	4.1	26.7 26.6	26.7	7.9 7.9	7.9	29.3 29.3	29.3	89.2 89.4	89.3	6.1 6.1	6.1	6.1	5.4 5.4	5.4		6.1	5.4 5.4		5.4	9.8 13.3
17-Aug-16	Rainy	Rough	11:42	Surface	1	26.7 26.7	26.7	8.0 8.0	8.0	30.9 30.9	30.9	95.1 95.3	95.2	6.4 6.4	6.4	6.4	8.1 7.7	7.9	8.6	9.7 10.5	10.1	10.3		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-
				Bottom	4	26.7 26.7	26.7	8.1 8.1	8.1	31.0 31.0	31.0	86.4 83.0	84.7	5.8 5.6	5.7	5.7	9.2 9.1	9.2		5.7	9.2 9.1		9.2	12.1 8.9

Remarks: *DA: Depth-Averaged
 **Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR6 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)		Turbidity(NTU)			Suspended Solids (mg/L)						
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*			
19-Aug-16	Fine	Moderate	13:26	Surface	1	27.6 27.6	27.6	8.0 8.1	8.1	22.5 22.4	22.5	92.2 92.1	92.2	6.4 6.4	6.4	6.4	9.2 9.7	9.5	10.7	7.8 6.9	7.4	7.9			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-
				Bottom	4	27.4 27.5	27.5	8.0 8.0	8.0	24.8 24.7	24.8	89.0 90.0	89.5	6.1 6.2	6.2		11.2 12.3	11.8		7.0 9.6	8.3				
22-Aug-16	Sunny	Calm	14:42	Surface	1	27.4 27.4	27.4	8.1 8.1	8.1	31.3 31.3	31.3	87.4 87.5	87.5	5.8 5.8	5.8	5.8	4.8 4.6	4.7	5.2	6.4 8.4	7.4	7.6			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4	26.9 26.9	26.9	8.0 8.0	8.0	31.3 31.4	31.4	85.9 83.2	84.6	5.8 5.6	5.7		5.7 5.4	5.6		7.3 8.2	7.8				
24-Aug-16	Sunny	Calm	16:24	Surface	1	26.1 26.2	26.2	7.9 7.8	7.9	29.4 29.4	29.4	84.8 84.8	84.8	5.8 5.8	5.8	5.8	4.5 4.4	4.5	5.4	7.9 7.1	7.5	7.9			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4	26.2 26.2	26.2	7.9 7.9	7.9	29.6 29.6	29.6	84.3 84.2	84.3	5.8 5.8	5.8		5.8 6.5	6.2		7.4 9.2	8.3				
26-Aug-16	Cloudy	Moderate	07:28	Surface	1	30.1 30.1	30.1	7.5 7.5	7.5	22.4 22.4	22.4	99.8 98.3	99.1	6.7 6.6	6.7	6.7	4.8 4.9	4.9	6.4	5.9 6.7	6.3	7.0			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4	28.3 28.3	28.3	7.5 7.5	7.5	28.1 28.2	28.2	76.6 76.6	76.6	5.1 5.1	5.1		7.7 8.1	7.9		6.1 9.0	7.6				
29-Aug-16	Cloudy	Moderate	10:31	Surface	1	29.2 29.2	29.2	7.9 7.9	7.9	20.0 20.0	20.0	91.7 91.2	91.5	6.3 6.3	6.3	6.3	2.6 2.7	2.7	4.3	9.8 7.2	8.5	8.8			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4	26.8 26.8	26.8	7.8 7.8	7.8	27.5 27.7	27.6	89.6 89.3	89.5	6.1 6.1	6.1		5.7 5.8	5.8		6.7 11.2	9.0				
31-Aug-16	Cloudy	Rough	11:28	Surface	1	28.5 28.5	28.5	7.8 7.8	7.8	20.3 20.5	20.4	91.3 99.7	95.5	6.3 6.9	6.6	6.6	12.5 12.0	12.3	12.2	19.1 17.8	18.5	17.9			
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	
				Bottom	4	27.8 27.8	27.8	7.6 7.6	7.6	28.8 28.8	28.8	78.3 76.8	77.6	5.2 5.1	5.2		12.1 12.1	12.1		16.2 18.4	17.3				

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR6 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)						
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*				
3-Aug-16	Fine	Moderate	18:48	Surface	1	28.0 28.0	28.0	8.0 8.0	8.0	26.3 26.1	26.2	89.4 90.8	90.1	6.1 6.2	6.2	6.2	9.3 9.0	9.2	10.7	16.8 12.7	14.8	14.4				
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-	-
				Bottom	4.3	28.1 28.1	28.1	8.1 8.1	8.1	28.2 28.1	28.2	90.4 90.5	90.5	6.0 6.1	6.1		6.1	12.1 12.2		12.2	12.2		13.2 14.8	14.0		
5-Aug-16	Fine	Moderate	07:13	Surface	1	28.1 28.1	28.1	8.1 8.1	8.1	23.4 23.5	23.5	96.3 96.3	96.3	6.6 6.6	6.6	6.6	5.2 4.8	5.0	5.6	4.2 4.6	4.4	4.4				
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-	-
				Bottom	4.25	27.8 27.8	27.8	8.2 8.2	8.2	25.5 25.5	25.5	87.0 87.4	87.2	5.9 6.0	6.0		6.0	6.3 6.0		6.2	6.2		3.4 5.1	4.3		
8-Aug-16	Sunny	Moderate	10:00	Surface	1	28.1 28.1	28.1	8.1 8.1	8.1	30.4 30.3	30.4	120.1 119.7	119.9	7.9 7.9	7.9	7.9	5.9 5.9	5.9	7.0	2.9 3.4	3.2	3.6				
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-	-
				Bottom	4.05	28.1 28.1	28.1	8.1 8.1	8.1	30.4 30.4	30.4	120.1 116.9	118.5	7.9 7.7	7.8		7.8	8.0 7.9		8.0	8.0		3.4 4.5	4.0		
10-Aug-16	Rainy	Calm	10:29	Surface	1	28.1 28.1	28.1	7.9 7.9	7.9	25.5 25.4	25.5	101.6 102.3	102.0	6.9 6.9	6.9	6.9	5.4 5.2	5.3	6.7	3.1 3.5	3.3	3.7				
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-	-
				Bottom	3.4	27.3 27.2	27.3	7.9 7.9	7.9	30.5 31.0	30.8	89.8 89.2	89.5	6.0 6.0	6.0		6.0	7.9 8.0		8.0	8.0		3.5 4.7	4.1		
12-Aug-16	Rainy	Moderate	14:33	Surface	1	26.5 26.5	26.5	7.9 7.9	7.9	26.0 26.0	26.0	94.3 94.1	94.2	6.6 6.5	6.6	6.6	6.3 6.2	6.3	6.9	2.4 2.9	2.7	3.4				
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-	-
				Bottom	3.3	26.1 26.1	26.1	7.9 7.9	7.9	27.8 27.9	27.9	84.1 83.4	83.8	5.8 5.8	5.8		5.8	7.4 7.5		7.5	7.5		3.5 4.7	4.1		
15-Aug-16	Rainy	Moderate	16:53	Surface	1	26.7 26.7	26.7	7.9 7.9	7.9	27.6 27.7	27.7	87.4 88.1	87.8	6.0 6.0	6.0	6.0	6.8 7.0	6.9	7.9	12.5 10.0	11.3	9.7				
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-	-
				Bottom	4.3	26.4 26.3	26.4	7.9 7.9	7.9	29.9 30.3	30.1	89.0 90.3	89.7	6.1 6.1	6.1		6.1	8.7 8.8		8.8	8.8		6.1 10.0	8.1		
17-Aug-16	Rainy	Rough	17:57	Surface	1	26.7 26.7	26.7	8.1 8.1	8.1	30.6 30.6	30.6	92.3 92.6	92.5	6.2 6.3	6.3	6.3	6.2 6.0	6.1	6.4	12.9 14.8	13.9	12.5				
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-	-
				Bottom	4.2	26.2 26.2	26.2	8.1 8.1	8.1	30.7 30.7	30.7	90.8 88.1	89.5	6.2 6.0	6.1		6.1	6.5 6.6		6.6	6.6		10.3 11.8	11.1		
19-Aug-16	Fine	Moderate	18:55	Surface	1	26.9 26.8	26.9	8.0 8.0	8.0	24.5 24.4	24.5	90.5 88.7	89.6	6.3 6.2	6.3	6.3	8.4 8.0	8.2	9.6	5.9 6.3	6.1	6.9				
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-		-	-	-	-
				Bottom	4	26.7 26.7	26.7	8.1 8.1	8.1	26.4 26.5	26.5	88.2 88.1	88.2	6.1 6.1	6.1		6.1	11.1 10.7		10.9	10.9		7.2 8.0	7.6		

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SR6 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
22-Aug-16	Sunny	Calm	08:44	Surface	1	26.9	26.9	8.1	8.1	30.8	30.9	92.8	92.9	6.2	6.2	6.2	2.4	2.6	4.1	7.7	8.0	8.5
						26.9		8.1		30.9		93.0		6.2			2.7			8.3		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-	
				Bottom	4	26.9	26.9	8.1	8.1	31.0	31.0	84.1	82.4	5.6	5.5	5.5	5.5	5.5	9.0	9.0	9.0	
						26.9		8.1		31.0		80.7		5.4		5.4		5.4	9.0			
24-Aug-16	Sunny	Calm	10:17	Surface	1	25.7	25.7	7.9	7.9	29.0	29.0	87.3	87.3	6.1	6.1	6.1	4.8	5.0	5.7	6.3	6.1	7.2
						25.7		7.9		29.0		87.2		6.0			5.1			5.9		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-	
				Bottom	4	25.7	25.7	7.9	7.9	29.2	29.2	87.1	86.9	6.0	6.0	6.0	6.4	6.4	6.6	8.3	10.0	
						25.7		7.9		29.1		86.6		6.0		6.3		6.3	10.0			
26-Aug-16	Cloudy	Moderate	13:42	Surface	1	29.8	29.8	7.7	7.7	21.5	21.5	105.2	109.1	7.1	7.4	7.4	7.0	7.1	8.0	4.8	5.4	4.8
						29.8		7.7		21.5		112.9		7.6			7.1			5.9		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-	
				Bottom	4	28.4	28.4	7.6	7.6	30.9	30.9	86.4	82.2	5.7	5.4	5.4	8.9	8.8	5.1	4.1	3.1	
						28.4		7.6		30.9		78.0		5.1		8.7		8.7	3.1			
29-Aug-16	Cloudy	Moderate	16:46	Surface	1	28.5	28.5	7.9	7.9	23.4	23.4	97.4	97.1	6.6	6.6	6.6	4.7	4.8	5.5	9.8	9.6	9.5
						28.5		7.9		23.4		96.8		6.6			4.8			9.4		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-	
				Bottom	4	27.7	27.7	7.9	7.9	22.8	22.8	89.0	89.5	6.2	6.2	6.2	6.1	6.2	7.6	9.3	11.0	
						27.7		7.9		22.8		90.0		6.2		6.3		6.2	11.0			
31-Aug-16	Cloudy	Moderate	17:48	Surface	1	28.4	28.4	8.0	8.0	19.0	19.1	91.2	91.1	6.4	6.4	6.4	13.4	13.3	12.1	15.8	18.0	18.0
						28.4		8.0		19.1		91.0		6.4			13.1			20.1		
				Middle	-	-	-	-	-	-	-	-	-	-	-		-	-		-	-	
				Bottom	4	27.9	27.9	7.9	7.9	27.2	27.2	75.7	75.1	5.1	5.1	5.1	10.9	10.9	17.0	17.9	18.7	
						27.9		7.9		27.2		74.5		5.0		10.9		10.9	18.7			

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SRA - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)		Turbidity(NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
1-Aug-16	Cloudy	Moderate	10:23	Surface	1	28.5 28.5	28.5	7.9 7.9	7.9	25.4 25.4	25.4	92.6 93.1	92.9	6.9 7.0	7.0	7.1	4.0 4.1	4.1	6.3	5.9 8.1	7.0	6.9
				Middle	3.5	28.2 28.2	28.2	7.9 7.9	7.9	26.1 26.1	26.1	95.4 96.1	95.8	7.2 7.2	7.2		6.8 6.8	6.8		5.8 5.9	5.9	
				Bottom	6	27.7 27.7	27.7	7.8 7.8	7.8	28.3 28.2	28.3	87.0 85.6	86.3	6.4 6.3	6.4		8.1 8.0	8.1		7.8 8.0	7.9	
3-Aug-16	Rainy	Moderate	11:49	Surface	1	27.5 27.8	27.7	8.1 8.1	8.1	27.6 27.8	27.7	88.8 95.3	92.1	6.0 6.4	6.2	6.2	7.7 7.7	7.7	9.7	11.4 11.6	11.5	11.4
				Middle	4.5	28.4 27.4	27.9	8.0 8.2	8.1	27.0 28.3	27.7	89.2 91.7	90.5	6.0 6.2	6.1		9.8 10.2	10.0		9.9 11.9	10.9	
				Bottom	8	28.2 27.2	27.7	8.2 8.0	8.1	27.3 27.6	27.5	93.6 94.3	94.0	6.3 6.4	6.4		11.3 11.4	11.4		12.6 10.8	11.7	
5-Aug-16	Fine	Moderate	13:20	Surface	1	28.4 28.5	28.5	8.1 8.2	8.2	28.5 28.7	28.6	99.2 97.7	98.5	6.6 6.5	6.6	6.6	6.0 6.3	6.2	5.9	3.8 3.9	3.9	3.7
				Middle	4.5	28.3 28.3	28.3	8.1 8.1	8.1	30.5 30.4	30.5	96.8 99.2	98.0	6.4 6.5	6.5		5.8 5.8	5.8		5.8 3.2	4.5	
				Bottom	8	28.2 28.2	28.2	8.1 8.1	8.1	31.0 30.9	31.0	83.8 81.2	82.5	5.5 5.3	5.4		5.7 5.5	5.6		3.2 2.4	2.8	
8-Aug-16	Sunny	Moderate	15:16	Surface	1	28.2 28.2	28.2	8.0 8.0	8.0	29.3 29.3	29.3	115.3 113.4	114.4	7.6 7.5	7.6	7.5	5.9 6.1	6.0	6.6	8.3 7.1	7.7	9.2
				Middle	4.5	28.3 28.3	28.3	8.1 8.1	8.1	30.0 29.9	30.0	110.1 108.8	109.5	7.3 7.2	7.3		6.4 6.3	6.4		9.2 8.4	8.8	
				Bottom	8	28.4 28.4	28.4	8.2 8.2	8.2	31.0 31.1	31.1	105.6 105.8	105.7	6.9 6.9	6.9		7.5 7.4	7.5		10.3 11.7	11.0	
10-Aug-16	Cloudy	Calm	17:28	Surface	1	27.0 27.1	27.1	8.0 7.9	8.0	27.5 27.0	27.3	91.2 88.9	90.1	6.2 6.1	6.2	6.2	7.5 7.7	7.6	9.6	4.0 5.2	4.6	4.9
				Middle	4.5	27.5 27.1	27.3	7.9 8.0	8.0	27.2 27.2	27.2	92.7 88.9	90.8	6.3 6.1	6.2		9.9 9.8	9.9		5.5 5.1	5.3	
				Bottom	8	27.7 27.8	27.8	7.9 7.9	7.9	27.0 26.8	26.9	87.3 90.7	89.0	5.9 6.1	6.0		11.1 11.3	11.2		4.7 5.0	4.9	
12-Aug-16	Rainy	Moderate	07:10	Surface	1	27.6 28.0	27.8	8.1 8.1	8.1	28.9 28.8	28.9	90.6 91.5	91.1	6.1 6.1	6.1	6.1	6.9 6.5	6.7	8.3	10.3 14.1	12.2	11.4
				Middle	3	26.9 27.9	27.4	7.9 7.9	7.9	28.5 28.3	28.4	87.6 88.5	88.1	6.0 5.9	6.0		8.6 8.9	8.8		11.7 12.2	12.0	
				Bottom	5	26.4 27.5	27.0	7.9 7.9	7.9	28.4 28.2	28.3	85.3 86.1	85.7	5.9 5.8	5.9		9.8 9.1	9.5		10.5 9.5	10.0	
15-Aug-16	Rainy	Moderate	10:11	Surface	1	27.0 26.9	27.0	7.9 7.9	7.9	26.3 26.3	26.3	86.6 86.8	86.7	6.0 6.0	6.0	6.0	5.7 5.1	5.4	6.5	7.4 8.6	8.0	7.5
				Middle	3.5	26.6 26.6	26.6	7.9 7.9	7.9	26.9 27.0	27.0	86.4 86.1	86.3	6.0 5.9	6.0		6.2 6.4	6.3		7.5 7.7	7.6	
				Bottom	6	26.0 25.9	26.0	7.9 7.9	7.9	28.6 28.6	28.6	84.8 83.6	84.2	5.9 5.8	5.9		7.7 7.9	7.8		7.4 6.5	7.0	
17-Aug-16	Rainy	Rough	11:20	Surface	1	26.7 26.7	26.7	8.0 8.0	8.0	29.7 29.7	29.7	80.1 79.8	80.0	5.4 5.4	5.4	5.4	3.2 3.4	3.3	3.4	13.6 14.9	14.3	13.7
				Middle	3.5	26.7 26.7	26.7	8.0 8.0	8.0	29.7 29.7	29.7	78.1 77.5	77.8	5.3 5.3	5.3		3.3 3.3	3.3		14.3 13.0	13.7	
				Bottom	6	26.6 26.6	26.6	8.0 8.0	8.0	29.8 29.8	29.8	75.4 74.3	74.9	5.1 5.0	5.1		3.5 3.5	3.5		12.3 13.6	13.0	

Remarks: *DA: Depth-Averaged
 **Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SRA - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)		Turbidity(NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
19-Aug-16	Fine	Moderate	13:09	Surface	1	27.4 27.4	27.4	8.0 8.0	8.0	22.8 22.8	22.8	96.2 95.9	96.1	6.7 6.7	6.7	6.7	4.3 4.5	4.4	4.5	7.5 8.2	7.9	8.1
				Middle	3.5	27.4 27.4	27.4	8.0 8.0	8.0	22.9 22.9	22.9	94.3 93.7	94.0	6.6 6.5	6.6		4.4 4.4	4.4		9.5 8.5	9.0	
				Bottom	6	27.3 27.3	27.3	8.0 8.0	8.0	22.9 22.9	22.9	91.7 90.5	91.1	6.4 6.3	6.4		4.6 4.6	4.6		7.6 7.4	7.5	
22-Aug-16	Sunny	Calm	15:36	Surface	1	27.6 27.6	27.6	8.0 8.0	8.0	30.8 30.9	30.9	87.8 88.1	88.0	5.8 5.9	5.9	6.0	5.9 5.8	5.9	6.4	6.8 5.7	6.3	6.4
				Middle	4	27.5 27.5	27.5	8.0 8.0	8.0	30.9 31.0	31.0	90.2 90.6	90.4	6.0 6.0	6.0		6.1 6.2	6.2		6.5 5.9	6.2	
				Bottom	7	27.5 27.5	27.5	8.0 8.0	8.0	31.0 31.0	31.0	91.2 91.3	91.3	6.1 6.1	6.1		7.1 7.2	7.2		6.0 7.2	6.6	
24-Aug-16	Sunny	Calm	17:48	Surface	1	26.3 26.3	26.3	7.8 7.8	7.8	30.8 30.8	30.8	80.9 80.1	80.5	5.5 5.4	5.5	5.5	7.1 7.1	7.1	7.2	6.2 6.6	6.4	6.0
				Middle	4	26.3 26.3	26.3	7.8 7.8	7.8	30.1 30.6	30.4	80.0 79.3	79.7	5.5 5.4	5.5		7.1 7.1	7.1		5.6 5.4	5.5	
				Bottom	7	26.3 26.3	26.3	7.8 7.8	7.8	30.6 30.2	30.4	78.8 79.7	79.3	5.4 5.4	5.4		7.5 7.5	7.5		6.7 5.3	6.0	
26-Aug-16	Cloudy	Moderate	07:33	Surface	1	30.2 30.2	30.2	7.5 7.5	7.5	24.3 24.3	24.3	95.6 95.8	95.7	6.3 6.3	6.3	6.3	4.8 4.2	4.5	5.8	4.3 5.2	4.8	5.0
				Middle	3.5	29.8 29.8	29.8	7.5 7.5	7.5	25.0 25.1	25.1	95.3 95.0	95.2	6.3 6.3	6.3		5.3 5.9	5.6		4.9 5.3	5.1	
				Bottom	6	29.2 29.2	29.2	7.5 7.5	7.5	26.7 26.6	26.7	93.7 92.5	93.1	6.2 6.1	6.2		7.2 7.4	7.3		5.6 4.7	5.2	
29-Aug-16	Cloudy	Moderate	10:31	Surface	1	29.5 29.5	29.5	7.9 7.9	7.9	25.0 25.0	25.0	109.9 108.1	109.0	7.3 7.2	7.3	7.2	4.1 4.4	4.3	5.1	13.7 15.4	14.6	9.9
				Middle	3.5	29.5 29.5	29.5	7.9 7.9	7.9	25.1 25.1	25.1	106.0 106.5	106.3	7.0 7.1	7.1		5.4 5.5	5.5		8.8 7.4	8.1	
				Bottom	6	29.5 29.5	29.5	7.9 7.9	7.9	25.1 25.1	25.1	104.7 105.0	104.9	7.0 7.0	7.0		5.4 5.4	5.4		7.5 6.7	7.1	
31-Aug-16	Cloudy	Rough	11:19	Surface	1	28.0 28.0	28.0	7.8 7.8	7.8	26.2 26.2	26.2	88.1 87.8	88.0	6.0 5.9	6.0	5.9	7.7 7.9	7.8	7.9	6.3 5.0	5.7	5.9
				Middle	3.5	28.0 28.0	28.0	7.8 7.8	7.8	26.2 26.2	26.2	85.5 86.1	85.8	5.8 5.8	5.8		7.8 7.8	7.8		6.2 6.4	6.3	
				Bottom	6	27.9 27.9	27.9	7.8 7.8	7.8	26.3 26.3	26.3	83.4 82.3	82.9	5.7 5.6	5.7		8.0 8.0	8.0		5.6 5.9	5.8	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SRA - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
3-Aug-16	Fine	Moderate	19:51	Surface	1	27.9 28.3	28.1	8.2 8.0	8.1	27.9 27.2	27.6	96.0 95.7	95.9	6.4 6.4	6.4	6.3	7.6 7.9	7.8	9.7	7.2 7.0	7.1	8.0
				Middle	4.5	28.6 28.1	28.4	8.0 8.2	8.1	27.8 27.8	27.8	92.6 93.0	92.8	6.2 6.2	6.2		10.0 10.0	10.0		8.8 8.3	8.6	
				Bottom	8	28.5 28.3	28.4	8.1 8.0	8.1	27.2 27.9	27.6	91.0 95.9	93.5	6.1 6.4	6.3		11.2 11.4	11.3		8.4 8.0	8.2	
5-Aug-16	Fine	Moderate	07:10	Surface	1	27.9 27.9	27.9	8.1 8.1	8.1	28.6 28.6	28.6	101.9 101.9	101.9	6.8 6.8	6.8	6.8	5.3 5.3	5.3	5.6	2.9 4.6	3.8	4.3
				Middle	4.5	27.9 27.8	27.9	8.2 8.1	8.2	29.1 29.6	29.4	101.6 100.6	101.1	6.8 6.7	6.8		5.7 5.7	5.7		3.9 6.2	5.1	
				Bottom	8	27.7 27.7	27.7	8.2 8.2	8.2	30.2 30.5	30.4	87.2 83.9	85.6	5.8 5.6	5.7		5.9 5.6	5.8		4.4 3.4	3.9	
8-Aug-16	Sunny	Moderate	08:40	Surface	1	28.1 28.0	28.1	8.1 8.1	8.1	29.1 29.1	29.1	112.8 113.5	113.2	7.5 7.6	7.6	7.5	6.1 6.4	6.3	7.2	5.0 4.1	4.6	5.5
				Middle	4	28.2 28.1	28.2	8.2 8.2	8.2	29.7 29.8	29.8	108.6 109.6	109.1	7.2 7.3	7.3		7.5 7.4	7.5		5.1 6.0	5.6	
				Bottom	7	28.3 28.3	28.3	8.2 8.2	8.2	30.9 30.8	30.9	105.6 106.5	106.1	6.9 7.0	7.0		7.8 7.8	7.8		5.7 6.7	6.2	
10-Aug-16	Rainy	Calm	10:12	Surface	1	27.1 26.8	27.0	7.9 7.9	7.9	27.4 27.5	27.5	87.2 87.6	87.4	6.0 6.0	6.0	6.1	7.5 7.5	7.5	9.5	5.4 5.3	5.4	6.6
				Middle	4.5	27.7 27.1	27.4	8.0 8.0	8.0	27.7 27.3	27.5	90.9 91.7	91.3	6.1 6.3	6.2		9.7 10.1	9.9		7.2 6.8	7.0	
				Bottom	8	27.5 26.9	27.2	8.1 7.8	8.0	27.8 27.1	27.5	94.6 89.7	92.2	6.4 6.2	6.3		11.1 11.3	11.2		7.7 7.2	7.5	
12-Aug-16	Rainy	Moderate	14:30	Surface	1	27.9 27.9	27.9	8.0 8.0	8.0	28.9 28.9	28.9	92.9 91.2	92.1	6.2 6.1	6.2	6.1	4.9 4.7	4.8	6.7	7.8 10.6	9.2	9.7
				Middle	2.5	27.1 26.6	26.9	7.9 7.9	7.9	29.1 28.9	29.0	88.7 87.8	88.3	6.0 6.0	6.0		6.7 7.0	6.9		10.1 10.1	10.1	
				Bottom	4	25.6 25.3	25.5	7.8 7.8	7.8	28.8 28.6	28.7	85.4 85.6	85.5	5.9 6.0	6.0		8.6 8.1	8.4		9.1 10.4	9.8	
15-Aug-16	Rainy	Moderate	18:05	Surface	1	27.4 27.4	27.4	8.0 8.0	8.0	25.6 25.6	25.6	95.6 95.7	95.7	6.6 6.6	6.6	6.5	5.6 5.4	5.5	7.2	7.7 9.4	8.6	8.5
				Middle	4	26.6 26.7	26.7	8.0 8.0	8.0	27.4 27.1	27.3	92.8 93.4	93.1	6.4 6.4	6.4		6.9 7.0	7.0		8.0 7.7	7.9	
				Bottom	7	26.4 26.4	26.4	8.0 8.0	8.0	28.2 28.2	28.2	90.9 90.8	90.9	6.3 6.2	6.3		9.3 9.1	9.2		9.2 8.5	8.9	
17-Aug-16	Rainy	Rough	18:39	Surface	1	26.8 26.8	26.8	8.0 8.0	8.0	29.9 29.9	29.9	74.7 75.0	74.9	5.1 5.1	5.1	5.2	4.0 3.9	4.0	4.5	14.0 13.4	13.7	13.3
				Middle	4	26.7 26.7	26.7	8.0 8.0	8.0	30.0 30.0	30.0	77.0 77.5	77.3	5.2 5.2	5.2		4.2 4.3	4.3		12.8 12.9	12.9	
				Bottom	7	26.7 26.7	26.7	8.0 8.0	8.0	30.1 30.0	30.1	78.0 78.2	78.1	5.3 5.3	5.3		5.2 5.3	5.3		13.4 13.0	13.2	
19-Aug-16	Fine	Moderate	19:41	Surface	1	26.3 26.3	26.3	8.1 8.1	8.1	23.0 23.1	23.1	89.2 89.5	89.4	6.3 6.3	6.3	6.4	5.1 5.0	5.1	5.6	7.8 9.6	8.7	14.2
				Middle	4	26.3 26.3	26.3	8.1 8.1	8.1	23.1 23.1	23.1	91.4 91.8	91.6	6.5 6.5	6.5		5.3 5.4	5.4		16.6 16.9	16.8	
				Bottom	7	26.2 26.2	26.2	8.1 8.1	8.1	23.2 23.2	23.2	92.4 92.5	92.5	6.6 6.6	6.6		6.3 6.4	6.4		16.1 18.3	17.2	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at SRA - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
22-Aug-16	Sunny	Calm	08:30	Surface	1	27.5 27.5	27.5	7.9 7.9	7.9	30.6 30.6	30.6	93.3 93.0	93.2	6.2 6.2	6.2	6.2	5.1 5.3	5.2	5.3	7.3 9.7	8.5	6.9
				Middle	3.5	27.4 27.4	27.4	7.9 7.9	7.9	30.7 30.7	30.7	91.2 90.6	90.9	6.1 6.0	6.1		5.2 5.2			5.2		
				Bottom	6	27.4 27.4	27.4	7.9 7.9	7.9	30.7 30.7	30.7	88.5 87.3	87.9	5.9 5.8	5.9	5.4 5.4	5.4	5.4 4.8	5.5			
24-Aug-16	Sunny	Calm	09:57	Surface	1	26.3 26.3	26.3	7.8 7.8	7.8	30.0 30.0	30.0	82.9 82.6	82.8	5.7 5.6	5.7	5.7	7.6 7.6	7.6	6.7	7.0 7.0	7.0	6.7
				Middle	3.5	26.3 26.3	26.3	7.8 7.8	7.8	30.0 30.0	30.0	81.1 81.6	81.4	5.5 5.6	5.6		5.7 6.1			5.9		
				Bottom	6	26.3 26.3	26.3	7.8 7.8	7.8	30.1 30.0	30.1	80.7 80.4	80.6	5.5 5.5	5.5	6.5 6.5	6.5	5.5 7.0	6.3			
26-Aug-16	Cloudy	Moderate	14:39	Surface	1	30.6 30.6	30.6	7.6 7.6	7.6	23.6 23.7	23.7	105.0 105.1	105.1	6.9 6.9	6.9	6.9	5.1 4.9	5.0	6.7	4.3 4.0	4.2	3.9
				Middle	4	29.9 30.0	30.0	7.6 7.6	7.6	25.4 25.2	25.3	102.0 102.6	102.3	6.7 6.8	6.8		6.4 6.5			6.5		
				Bottom	7	29.6 29.6	29.6	7.6 7.6	7.6	26.3 26.3	26.3	100.1 100.0	100.1	6.6 6.6	6.6	8.8 8.6	8.7	3.4 2.7	3.1			
29-Aug-16	Cloudy	Moderate	17:41	Surface	1	29.6 29.6	29.6	7.9 7.9	7.9	25.5 25.5	25.5	90.8 89.5	90.2	6.0 5.9	6.0	5.9	3.8 3.1	3.5	3.6	7.8 12.5	10.2	9.8
				Middle	4	29.5 29.5	29.5	7.9 7.9	7.9	25.6 25.5	25.6	88.1 87.6	87.9	5.8 5.8	5.8		3.7 3.6			3.7		
				Bottom	7	29.5 29.5	29.5	7.9 7.9	7.9	25.6 25.6	25.6	85.9 85.9	85.9	5.7 5.7	5.7	3.3 3.7	3.5	8.9 8.4	8.7			
31-Aug-16	Cloudy	Moderate	18:39	Surface	1	28.1 28.1	28.1	7.9 7.9	7.9	26.4 26.4	26.4	82.7 83.0	82.9	5.6 5.6	5.6	5.7	8.5 8.4	8.5	9.0	9.3 9.7	9.5	9.5
				Middle	4	28.0 28.0	28.0	7.9 7.9	7.9	26.5 26.5	26.5	85.5 85.0	85.3	5.8 5.7	5.8		8.8 8.7			8.8		
				Bottom	7	28.0 28.0	28.0	7.9 7.9	7.9	26.6 26.5	26.6	86.1 86.2	86.2	5.8 5.8	5.8	9.7 9.8	9.8	9.7 9.4	9.6			

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)			
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*	
1-Aug-16	Cloudy	Moderate	11:00	Surface	1	27.8 28.7	28.3	7.7 7.8	7.8	26.9 32.2	29.6	104.0 95.1	99.6	7.0 6.2	6.6	6.5	9.5 9.5	9.5	9.0	7.6 8.2	7.9	7.9	
				Middle	5.5	27.6 27.5	27.6	7.7 7.9	7.8	26.3 29.2	27.8	93.3 94.1	93.7	6.4 6.3	6.4		7.5 7.4	7.5		7.2 8.2	7.7		
				Bottom	10	28.0 29.0	28.5	7.8 7.8	7.8	31.1 26.2	28.7	97.1 107.8	102.5	6.4 7.2	6.8		6.8	10.1 9.9		10.0	8.2 8.2		8.2
3-Aug-16	Rainy	Moderate	12:54	Surface	1	27.0 27.0	27.0	8.1 8.1	8.1	26.3 26.3	26.3	85.7 84.4	85.1	5.9 5.8	5.9	5.9	9.6 9.5	9.6	9.9	12.8 13.2	13.0	13.2	
				Middle	5	27.1 27.2	27.2	8.1 8.1	8.1	27.1 27.9	27.5	85.4 84.4	84.9	5.8 5.7	5.8		8.1 8.7	8.4		10.7 13.4	12.1		
				Bottom	9	27.6 27.6	27.6	8.1 8.1	8.1	28.9 28.9	28.9	84.8 83.8	84.3	5.7 5.6	5.7		5.7	11.4 11.7		11.6	14.2 14.6		14.4
5-Aug-16	Fine	Moderate	14:00	Surface	1	27.9 27.9	27.9	8.0 8.0	8.0	27.3 26.0	26.7	100.6 101.3	101.0	6.8 6.9	6.9	6.5	3.6 3.5	3.6	4.5	3.6 5.9	4.8	4.6	
				Middle	5	27.4 27.4	27.4	8.0 8.0	8.0	31.5 29.8	30.7	89.8 89.2	89.5	6.0 6.0	6.0		4.5 4.2	4.4		3.3 5.8	4.6		
				Bottom	9	27.4 27.4	27.4	8.1 8.1	8.1	31.9 31.9	31.9	82.3 82.3	82.3	5.5 5.5	5.5		5.5	5.2 5.9		5.6	4.8 4.0		4.4
8-Aug-16	Sunny	Moderate	16:02	Surface	1	27.1 27.1	27.1	8.1 8.1	8.1	28.8 29.8	29.3	112.5 112.5	112.5	7.6 7.6	7.6	7.7	5.0 4.8	4.9	6.1	4.5 4.2	4.4	4.7	
				Middle	4.5	27.2 27.2	27.2	8.1 8.1	8.1	29.9 29.8	29.9	113.0 114.7	113.9	7.6 7.7	7.7		5.9 5.8	5.9		4.5 5.0	4.8		
				Bottom	8	27.0 27.1	27.1	8.1 8.1	8.1	29.9 28.9	29.4	112.8 113.7	113.3	7.6 7.7	7.7		7.7	7.6 7.2		7.4	5.3 4.4		4.9
10-Aug-16	Cloudy	Calm	16:56	Surface	1	27.5 27.5	27.5	8.0 8.0	8.0	27.7 27.6	27.7	96.5 96.6	96.6	6.5 6.5	6.5	6.3	8.3 8.3	8.3	9.9	6.8 2.9	4.9	4.2	
				Middle	5	25.8 25.8	25.8	8.0 8.0	8.0	27.1 27.1	27.1	86.4 85.5	86.0	6.0 6.0	6.0		8.7 8.6	8.7		3.2 4.4	3.8		
				Bottom	9	25.2 25.2	25.2	8.2 8.2	8.2	28.8 28.5	28.7	81.1 80.0	80.6	5.7 5.6	5.7		5.7	12.6 12.6		12.6	4.0 3.9		4.0
12-Aug-16	Rainy	Moderate	08:15	Surface	1	27.6 27.6	27.6	8.2 8.2	8.2	27.5 27.6	27.6	88.2 88.0	88.1	6.0 6.0	6.0	6.1	4.1 4.5	4.3	5.2	3.0 2.8	2.9	2.8	
				Middle	5.5	26.0 26.0	26.0	8.1 8.1	8.1	31.2 31.1	31.2	89.3 89.0	89.2	6.1 6.1	6.1		4.3 4.0	4.2		2.3 3.0	2.7		
				Bottom	10	26.0 26.0	26.0	8.1 8.1	8.1	31.5 31.5	31.5	87.8 86.6	87.2	6.0 5.9	6.0		6.0	7.3 6.8		7.1	2.4 3.0		2.7
15-Aug-16	Rainy	Moderate	10:55	Surface	1	27.4 27.3	27.4	7.9 7.9	7.9	26.4 26.6	26.5	88.6 87.1	87.9	6.1 6.0	6.1	6.1	4.8 4.3	4.6	6.3	10.3 9.5	9.9	9.6	
				Middle	5	26.6 26.6	26.6	8.0 8.0	8.0	30.6 30.5	30.6	90.6 90.8	90.7	6.1 6.1	6.1		6.1	5.7 6.1		5.9	9.3 10.0		9.7
				Bottom	9	26.5 26.5	26.5	8.0 7.9	8.0	31.0 30.9	31.0	90.7 90.5	90.6	6.1 6.1	6.1		6.1	8.1 8.5		8.3	9.1 9.2		9.2
17-Aug-16	Rainy	Rough	12:18	Surface	1	26.8 26.8	26.8	8.0 8.0	8.0	31.0 31.0	31.0	89.9 88.5	89.2	6.0 6.0	6.0	6.0	8.0 8.1	8.1	8.2	12.8 10.7	11.8	11.7	
				Middle	5	26.7 26.7	26.7	8.0 8.0	8.0	31.2 31.2	31.2	88.9 88.6	88.8	6.0 6.0	6.0		6.0	7.0 6.9		7.0	11.2 11.3		11.3
				Bottom	9	26.6 26.6	26.6	8.1 8.1	8.1	31.5 31.5	31.5	92.1 92.7	92.4	6.2 6.2	6.2		6.2	9.2 9.7		9.5	11.3 12.7		12.0

Remarks: *DA: Depth-Averaged
 **Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST1 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)		Turbidity(NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
19-Aug-16	Fine	Moderate	13:57	Surface	1	27.6 27.6	27.6	8.1 8.1	8.1	21.6 21.6	21.6	92.4 91.7	92.1	6.5 6.4	6.5	6.4	10.3 10.0	10.2	11.8	7.6 7.2	7.4	7.2		
				Middle	5	27.4 27.5	27.5	8.0 8.0	8.0	22.3 23.0	22.7	89.8 90.6	90.2	6.3 6.3	6.3		11.9 12.0			12.0			5.7 8.0	6.9
				Bottom	9	27.2 27.3	27.3	8.0 8.0	8.0	24.6 25.8	25.2	88.2 90.4	89.3	6.1 6.2	6.2		13.1 13.2			13.2			6.9 7.7	7.3
22-Aug-16	Sunny	Calm	15:20	Surface	1	27.3 27.4	27.4	8.0 8.0	8.0	31.2 31.3	31.3	86.1 85.7	85.9	5.7 5.7	5.7	5.7	4.1 4.4	4.3	5.7	5.0 3.3	4.2	4.7		
				Middle	5	26.9 26.9	26.9	8.0 8.0	8.0	31.3 31.3	31.3	84.7 83.2	84.0	5.7 5.6	5.7		5.9 5.9			5.9			4.5 5.7	5.1
				Bottom	9	26.8 26.8	26.8	8.0 8.0	8.0	31.5 31.5	31.5	78.1 77.5	77.8	5.2 5.2	5.2		6.7 7.1			6.9			4.8 4.9	4.9
24-Aug-16	Sunny	Calm	16:56	Surface	1	26.1 26.1	26.1	7.9 7.9	7.9	30.5 30.5	30.5	80.6 80.6	80.6	5.5 5.5	5.5	5.5	6.1 5.9	6.0	7.2	5.9 6.8	6.4	6.4		
				Middle	5	26.0 26.0	26.0	7.9 7.9	7.9	30.6 30.6	30.6	80.3 80.2	80.3	5.5 5.5	5.5		7.6 6.9			7.3			6.0 7.5	6.8
				Bottom	9	26.1 26.1	26.1	7.9 7.9	7.9	30.6 30.7	30.7	79.5 79.4	79.5	5.4 5.4	5.4		8.3 8.0			8.2			6.5 5.6	6.1
26-Aug-16	Cloudy	Moderate	07:52	Surface	1	30.4 30.4	30.4	7.5 7.5	7.5	20.2 20.3	20.3	103.8 104.2	104.0	7.0 7.0	7.0	6.5	7.1 7.3	7.2	8.0	7.4 7.9	7.7	5.9		
				Middle	5	27.6 27.5	27.6	7.5 7.5	7.5	30.9 31.0	31.0	89.9 88.0	89.0	6.0 5.8	5.9		8.0 8.6			8.3			5.0 5.2	5.1
				Bottom	9	27.1 27.1	27.1	7.6 7.6	7.6	33.0 33.0	33.0	80.3 80.0	80.2	5.3 5.3	5.3		8.7 8.4			8.6			4.6 5.4	5.0
29-Aug-16	Cloudy	Moderate	11:01	Surface	1	29.1 29.1	29.1	7.9 7.9	7.9	20.7 20.7	20.7	91.4 92.3	91.9	6.3 6.3	6.3	6.0	4.6 4.6	4.6	5.9	6.2 6.4	6.3	6.4		
				Middle	5	26.4 26.5	26.5	7.8 7.8	7.8	28.0 28.0	28.0	81.3 80.7	81.0	5.6 5.6	5.6		6.3 6.3			6.3			5.7 7.4	6.6
				Bottom	9	26.4 26.4	26.4	7.8 7.8	7.8	28.9 28.9	28.9	77.2 76.8	77.0	5.3 5.3	5.3		6.8 6.7			6.8			5.8 6.8	6.3
31-Aug-16	Cloudy	Rough	12:02	Surface	1	28.4 28.4	28.4	7.8 7.8	7.8	24.8 25.0	24.9	100.3 100.8	100.6	6.8 6.8	6.8	6.3	10.7 10.7	10.7	10.6	16.8 14.5	15.7	16.1		
				Middle	5	28.1 28.1	28.1	7.7 7.7	7.7	28.5 28.5	28.5	86.1 84.6	85.4	5.7 5.6	5.7		9.9 10.1			10.0			14.7 15.6	15.2
				Bottom	9	27.8 27.8	27.8	7.6 7.6	7.6	28.8 28.8	28.8	78.1 76.9	77.5	5.2 5.1	5.2		11.2 11.2			11.2			16.2 18.4	17.3

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
3-Aug-16	Fine	Moderate	19:21	Surface	1	27.9 27.9	27.9	8.1 8.1	8.1	27.7 27.7	27.7	98.7 96.5	97.6	6.6 6.5	6.6	6.6	8.9 9.0	9.0	10.6	15.2 15.1	15.2	14.9		
				Middle	5	27.9 27.9	27.9	8.1 8.1	8.1	27.8 27.8	27.8	98.2 95.9	97.1	6.6 6.4	6.5		10.5 10.2			10.4			16.5 15.4	16.0
				Bottom	9	28.2 28.2	28.2	8.1 8.1	8.1	29.0 29.0	29.0	96.6 94.6	95.6	6.4 6.3	6.4		12.4 12.2			12.3			13.1 14.0	13.6
5-Aug-16	Fine	Moderate	07:43	Surface	1	28.1 28.1	28.1	8.1 8.1	8.1	24.8 23.6	24.2	96.1 96.8	96.5	6.6 6.6	6.6	6.5	4.3 4.8	4.6	6.4	4.9 5.2	5.1	5.7		
				Middle	5	27.7 27.7	27.7	8.1 8.1	8.1	28.3 28.4	28.4	94.2 92.8	93.5	6.3 6.2	6.3		6.7 6.8			6.8			6.9 5.5	6.2
				Bottom	9	27.5 27.5	27.5	8.2 8.2	8.2	30.6 30.6	30.6	87.5 86.3	86.9	5.8 5.7	5.8		7.8 7.6			7.7			5.2 6.5	5.9
8-Aug-16	Sunny	Moderate	10:24	Surface	1	28.1 27.3	27.7	8.1 8.2	8.2	30.8 30.8	30.8	106.6 115.5	111.1	7.0 7.7	7.4	7.4	4.8 4.6	4.7	5.8	2.5 4.5	3.5	3.7		
				Middle	4.5	27.3 27.3	27.3	8.1 8.2	8.2	30.4 30.8	30.6	103.9 115.5	109.7	7.0 7.7	7.4		4.6 4.9			4.8			3.0 4.8	3.9
				Bottom	8	27.3 28.1	27.7	8.1 8.1	8.1	30.2 30.8	30.5	115.3 122.0	118.7	7.7 8.0	7.9		7.6 7.9			7.8			3.2 4.2	3.7
10-Aug-16	Rainy	Calm	11:03	Surface	1	28.1 28.0	28.1	8.0 8.0	8.0	25.9 26.3	26.1	102.2 102.0	102.1	6.9 6.9	6.9	6.2	8.0 8.5	8.3	9.2	4.4 5.8	5.1	5.1		
				Middle	5	25.3 25.3	25.3	8.0 8.0	8.0	29.7 29.8	29.8	77.7 77.0	77.4	5.4 5.4	5.4		8.8 9.4			9.1			3.7 6.7	5.2
				Bottom	9	25.2 25.2	25.2	8.0 8.0	8.0	29.9 29.9	29.9	74.7 73.8	74.3	5.2 5.1	5.2		10.2 10.0			10.1			5.2 4.8	5.0
12-Aug-16	Rainy	Moderate	15:02	Surface	1	26.9 26.9	26.9	7.9 7.9	7.9	28.3 28.3	28.3	92.7 92.6	92.7	6.3 6.3	6.3	6.1	5.4 5.3	5.4	6.3	1.8 3.6	2.7	2.6		
				Middle	5	26.5 26.5	26.5	8.0 8.0	8.0	28.8 28.8	28.8	86.9 86.0	86.5	5.9 5.9	5.9		7.0 7.6			7.3			2.7 2.1	2.4
				Bottom	9	25.7 25.7	25.7	8.1 8.1	8.1	30.0 30.3	30.2	86.2 85.7	86.0	5.9 5.9	5.9		6.4 5.9			6.2			2.9 2.4	2.7
15-Aug-16	Rainy	Moderate	17:26	Surface	1	26.5 26.5	26.5	7.9 8.0	8.0	28.5 28.6	28.6	87.9 87.6	87.8	6.0 6.0	6.0	6.1	4.9 5.7	5.3	6.9	7.9 14.0	11.0	9.4		
				Middle	5	26.3 26.3	26.3	8.0 8.0	8.0	29.9 29.9	29.9	88.5 88.8	88.7	6.0 6.1	6.1		6.6 6.6			6.6			8.4 8.3	8.4
				Bottom	9	26.2 26.2	26.2	8.0 8.0	8.0	30.8 30.8	30.8	88.5 88.6	88.6	6.0 6.0	6.0		8.7 9.1			8.9			8.0 9.6	8.8
17-Aug-16	Rainy	Rough	18:29	Surface	1	26.5 26.5	26.5	8.0 8.0	8.0	30.8 30.8	30.8	88.7 87.3	88.0	6.0 5.9	6.0	5.9	6.1 6.1	6.1	8.0	11.4 13.5	12.5	11.3		
				Middle	5	26.3 26.3	26.3	8.0 8.0	8.0	30.9 30.9	30.9	84.4 83.9	84.2	5.7 5.7	5.7		8.2 8.7			8.5			8.9 11.3	10.1
				Bottom	9	26.2 26.2	26.2	8.0 8.0	8.0	30.9 30.9	30.9	82.2 81.8	82.0	5.6 5.6	5.6		9.3 9.4			9.4			11.0 11.5	11.3
19-Aug-16	Fine	Moderate	19:22	Surface	1	26.9 26.8	26.9	8.0 8.1	8.1	19.9 20.5	20.2	87.2 87.4	87.3	6.2 6.2	6.2	6.2	8.0 8.3	8.2	9.8	3.6 8.8	6.2	7.3		
				Middle	5	26.7 26.8	26.8	8.1 8.1	8.1	23.4 23.1	23.3	86.0 87.2	86.6	6.0 6.1	6.1		9.2 9.3			9.3			6.9 9.1	8.0
				Bottom	9	26.7 26.5	26.6	8.1 8.1	8.1	24.5 24.4	24.5	85.0 85.0	85.0	5.9 6.0	6.0		11.8 12.0			11.9			6.9 8.5	7.7

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST1 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
22-Aug-16	Sunny	Calm	09:16	Surface	1	27.0 27.1	27.1	8.1 8.1	8.1	31.0 30.9	31.0	91.6 90.4	91.0	6.1 6.1	6.1	6.1	4.0 4.4	4.2	5.6	6.4 9.6	8.0	8.6
				Middle	5	26.9 26.9	26.9	8.1 8.1	8.1	31.2 31.2	31.2	90.6 90.3	90.5	6.1 6.1	6.1		5.1 5.3	5.2		7.2 9.7	8.5	
				Bottom	9	26.9 26.8	26.9	8.1 8.1	8.1	31.5 31.5	31.5	93.8 94.4	94.1	6.3 6.3	6.3		7.5 7.4	7.5		9.9 8.4	9.2	
24-Aug-16	Sunny	Calm	10:55	Surface	1	25.6 25.7	25.7	7.9 7.9	7.9	29.3 29.3	29.3	85.2 85.3	85.3	5.9 5.9	5.9	5.9	4.2 4.0	4.1	5.7	5.9 6.4	6.2	6.4
				Middle	5	25.7 25.6	25.7	7.9 7.9	7.9	29.6 29.7	29.7	85.1 84.7	84.9	5.9 5.9	5.9		4.9 5.4	5.2		6.5 6.7	6.6	
				Bottom	9	25.7 25.7	25.7	7.9 7.9	7.9	29.8 29.8	29.8	84.5 84.4	84.5	5.8 5.8	5.8		7.6 8.1	7.9		6.7 6.3	6.5	
26-Aug-16	Cloudy	Moderate	14:08	Surface	1	30.3 30.3	30.3	7.7 7.7	7.7	21.7 21.6	21.7	113.6 113.9	113.8	7.6 7.6	7.6	7.0	6.6 6.0	6.3	7.9	4.3 4.9	4.6	4.2
				Middle	5	27.5 27.5	27.5	7.7 7.7	7.7	30.3 30.3	30.3	96.2 95.2	95.7	6.4 6.4	6.4		9.0 8.9	9.0		3.7 4.3	4.0	
				Bottom	9	27.0 27.0	27.0	7.7 7.7	7.7	32.6 32.5	32.6	89.8 89.0	89.4	6.0 5.9	6.0		8.5 8.4	8.5		3.4 4.6	4.0	
29-Aug-16	Cloudy	Moderate	17:15	Surface	1	28.6 28.6	28.6	8.0 8.0	8.0	25.1 25.1	25.1	91.3 91.7	91.5	6.2 6.2	6.2	6.1	4.8 4.4	4.6	5.5	7.2 7.7	7.5	8.0
				Middle	5	27.7 27.7	27.7	8.0 8.0	8.0	26.5 26.5	26.5	88.4 87.7	88.1	6.0 6.0	6.0		5.2 5.7	5.5		9.3 8.3	8.8	
				Bottom	9	27.3 27.3	27.3	7.9 7.9	7.9	28.9 28.8	28.9	83.3 82.7	83.0	5.6 5.6	5.6		6.2 6.6	6.4		7.3 8.3	7.8	
31-Aug-16	Cloudy	Moderate	18:21	Surface	1	28.5 28.5	28.5	8.1 8.1	8.1	23.3 21.6	22.5	98.2 97.6	97.9	6.7 6.7	6.7	6.4	14.2 14.3	14.3	11.5	18.4 18.3	18.4	17.3
				Middle	5	28.1 28.1	28.1	7.9 7.9	7.9	31.2 31.3	31.3	92.0 91.2	91.6	6.0 6.0	6.0		10.2 9.7	10.0		17.3 14.3	15.8	
				Bottom	9	27.2 27.2	27.2	7.8 7.8	7.8	30.8 30.8	30.8	77.8 75.8	76.8	5.2 5.1	5.2		10.2 10.2	10.2		18.4 17.1	17.8	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
1-Aug-16	Cloudy	Moderate	10:47	Surface	1	28.7 27.1	27.9	7.9 7.7	7.8	25.7 27.7	26.7	100.8 89.0	94.9	6.8 6.1	6.5	6.6	7.4 7.4	7.4	9.0	7.1 10.0	8.6	9.1
				Middle	4.5	28.5 27.5	28.0	7.8 7.8	7.8	32.1 31.6	31.9	109.3 91.2	100.3	7.1 6.0	6.6		8.2 7.9	8.1		7.9 9.6	8.8	
				Bottom	8	27.6 27.3	27.5	7.8 7.9	7.9	31.5 27.0	29.3	96.5 93.4	95.0	6.4 6.4	6.4		11.2 11.8	11.5		10.1 9.8	10.0	
3-Aug-16	Rainy	Moderate	12:38	Surface	1	27.0 27.0	27.0	8.1 8.1	8.1	27.7 27.7	27.7	94.9 95.0	95.0	6.5 6.5	6.5	6.5	7.1 6.9	7.0	9.2	13.3 13.8	13.6	14.4
				Middle	4	27.1 27.1	27.1	8.1 8.1	8.1	27.9 27.9	27.9	95.4 95.7	95.6	6.5 6.5	6.5		7.9 7.9	7.9		14.9 15.2	15.1	
				Bottom	7	27.3 27.3	27.3	8.1 8.1	8.1	28.3 28.3	28.3	96.2 95.4	95.8	6.5 6.5	6.5		12.5 12.6	12.6		14.3 14.7	14.5	
5-Aug-16	Fine	Moderate	13:47	Surface	1	28.0 28.0	28.0	8.0 8.0	8.0	26.6 26.5	26.6	101.9 101.9	101.9	6.9 6.9	6.9	6.5	4.1 4.8	4.5	6.2	5.1 6.1	5.6	5.3
				Middle	4	27.7 27.7	27.7	8.0 8.0	8.0	29.0 27.8	28.4	88.0 88.3	88.2	5.9 6.0	6.0		6.9 6.5	6.7		4.9 6.2	5.6	
				Bottom	7	27.6 27.6	27.6	8.0 8.0	8.0	29.0 28.9	29.0	87.1 87.2	87.2	5.8 5.9	5.9		7.1 7.4	7.3		3.9 5.3	4.6	
8-Aug-16	Sunny	Moderate	15:50	Surface	1	27.1 27.1	27.1	8.1 8.1	8.1	30.6 29.8	30.2	111.3 110.9	111.1	7.5 7.5	7.5	7.5	4.9 5.1	5.0	6.3	4.6 4.9	4.8	4.9
				Middle	3.5	27.0 27.1	27.1	8.1 8.1	8.1	30.6 29.8	30.2	111.0 110.9	111.0	7.5 7.5	7.5		5.5 6.0	5.8		4.1 5.2	4.7	
				Bottom	6	27.2 27.0	27.1	8.1 8.1	8.1	30.6 29.8	30.2	111.7 110.7	111.2	7.5 7.5	7.5		7.8 8.2	8.0		5.6 4.7	5.2	
10-Aug-16	Cloudy	Calm	16:41	Surface	1	28.1 28.1	28.1	8.0 8.0	8.0	26.6 26.6	26.6	105.1 104.5	104.8	7.1 7.0	7.1	6.7	6.9 6.9	6.9	9.8	3.9 2.7	3.3	3.8
				Middle	4	27.3 27.2	27.3	8.1 8.1	8.1	25.9 26.1	26.0	90.2 90.0	90.1	6.2 6.2	6.2		10.2 10.3	10.3		3.0 3.6	3.3	
				Bottom	7	25.2 25.2	25.2	8.2 8.1	8.2	28.6 28.7	28.7	77.2 76.8	77.0	5.4 5.4	5.4		12.0 12.3	12.2		4.3 5.0	4.7	
12-Aug-16	Rainy	Moderate	08:00	Surface	1	27.5 27.5	27.5	8.0 8.0	8.0	27.3 27.4	27.4	97.9 97.8	97.9	6.6 6.6	6.6	6.3	4.4 4.4	4.4	4.8	2.6 3.0	2.8	3.2
				Middle	4	26.4 26.3	26.4	8.0 8.0	8.0	27.6 28.0	27.8	85.9 86.5	86.2	5.9 6.0	6.0		3.7 3.5	3.6		2.3 3.7	3.0	
				Bottom	7	26.1 26.1	26.1	8.0 8.0	8.0	29.8 29.8	29.8	90.2 92.4	91.3	6.2 6.3	6.3		6.5 6.5	6.5		3.7 3.7	3.7	
15-Aug-16	Rainy	Moderate	10:40	Surface	1	26.7 26.8	26.8	8.0 8.0	8.0	28.3 28.3	28.3	88.4 87.8	88.1	6.0 6.0	6.0	6.1	4.5 4.9	4.7	7.2	7.5 8.6	8.1	8.1
				Middle	4	26.6 26.6	26.6	8.0 8.0	8.0	29.8 29.7	29.8	89.9 89.9	89.9	6.1 6.1	6.1		8.1 8.3	8.2		7.9 9.6	8.8	
				Bottom	7	26.6 26.6	26.6	8.0 8.0	8.0	29.7 29.6	29.7	90.2 90.0	90.1	6.1 6.1	6.1		8.8 8.6	8.7		8.8 6.1	7.5	
17-Aug-16	Rainy	Rough	12:01	Surface	1	27.1 27.1	27.1	8.0 8.0	8.0	31.1 31.1	31.1	78.6 78.0	78.3	5.3 5.2	5.3	5.6	7.7 7.6	7.7	7.7	10.1 10.2	10.2	10.1
				Middle	4	26.7 26.7	26.7	8.0 8.0	8.0	31.1 31.1	31.1	86.8 86.3	86.6	5.8 5.8	5.8		8.3 8.6	8.5		11.2 9.9	10.6	
				Bottom	7	26.7 26.7	26.7	8.0 8.0	8.0	31.3 31.3	31.3	88.2 87.9	88.1	5.9 5.9	5.9		7.0 6.7	6.9		7.6 11.4	9.5	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST2 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)		Turbidity(NTU)			Suspended Solids (mg/L)					
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
19-Aug-16	Fine	Moderate	13:41	Surface	1	27.6 27.6	27.6	8.1 8.1	8.1	21.5 21.2	21.4	92.8 91.8	92.3	6.5 6.4	6.5	6.5	10.4 9.6	10.0	11.9	10.0 9.2	9.6	8.0		
				Middle	4	27.5 27.4	27.5	8.0 8.0	8.0	23.3 23.2	23.3	91.6 91.2	91.4	6.4 6.3	6.4		12.2 12.2			12.2			6.7 7.7	7.2
				Bottom	7	27.3 27.3	27.3	8.0 8.0	8.0	25.8 25.6	25.7	86.0 87.5	86.8	5.9 6.0	6.0		14.0 13.2			13.6			6.8 7.6	7.2
22-Aug-16	Sunny	Calm	15:03	Surface	1	27.1 27.1	27.1	8.0 8.0	8.0	31.4 31.4	31.4	83.4 82.0	82.7	5.6 5.5	5.6	5.5	4.1 4.3	4.2	5.0	4.7 5.0	4.9	5.4		
				Middle	4	27.0 27.0	27.0	8.0 8.0	8.0	31.5 31.5	31.5	79.1 78.6	78.9	5.3 5.3	5.3		4.8 5.2			5.0			5.1 5.3	5.2
				Bottom	7	26.9 26.9	26.9	8.0 8.0	8.0	31.6 31.6	31.6	76.9 76.4	76.7	5.1 5.1	5.1		5.9 5.8			5.9			4.6 7.8	6.2
24-Aug-16	Sunny	Calm	16:41	Surface	1	26.0 26.0	26.0	7.8 7.9	7.9	30.8 30.8	30.8	83.5 83.3	83.4	5.7 5.7	5.7	5.7	6.2 6.6	6.4	7.4	6.3 6.0	6.2	6.9		
				Middle	4	26.1 26.0	26.1	7.9 7.9	7.9	30.9 30.9	30.9	83.0 82.8	82.9	5.7 5.6	5.7		6.9 7.3			7.1			6.8 8.4	7.6
				Bottom	7	26.2 26.2	26.2	7.9 7.9	7.9	30.8 30.8	30.8	82.8 82.7	82.8	5.6 5.6	5.6		8.2 9.2			8.7			6.3 7.5	6.9
26-Aug-16	Cloudy	Moderate	07:41	Surface	1	30.4 30.4	30.4	7.5 7.5	7.5	20.4 20.4	20.4	110.6 110.1	110.4	7.4 7.4	7.4	7.1	6.5 6.6	6.6	6.5	6.1 4.2	5.2	5.5		
				Middle	4	29.4 29.4	29.4	7.5 7.5	7.5	22.5 22.5	22.5	100.4 99.5	100.0	6.8 6.7	6.8		5.1 5.1			5.1			4.9 6.6	5.8
				Bottom	7	27.6 27.6	27.6	7.5 7.5	7.5	27.9 27.9	27.9	83.1 82.3	82.7	5.6 5.6	5.6		7.9 7.8			7.9			5.7 5.2	5.5
29-Aug-16	Cloudy	Moderate	10:46	Surface	1	28.7 28.8	28.8	7.9 7.8	7.9	20.9 20.6	20.8	88.9 86.4	87.7	6.1 6.0	6.1	5.9	2.9 2.9	2.9	4.3	4.7 5.6	5.2	5.9		
				Middle	4	26.9 26.9	26.9	7.8 7.8	7.8	24.2 26.2	25.2	81.9 81.8	81.9	5.7 5.6	5.7		3.3 3.6			3.5			5.3 7.8	6.6
				Bottom	7	26.4 26.4	26.4	7.8 7.8	7.8	28.9 28.9	28.9	78.3 77.7	78.0	5.4 5.3	5.4		6.8 6.0			6.4			5.4 6.6	6.0
31-Aug-16	Cloudy	Rough	11:46	Surface	1	28.5 28.5	28.5	7.9 7.9	7.9	23.6 23.9	23.8	96.5 95.9	96.2	6.6 6.5	6.6	6.0	13.0 12.8	12.9	11.3	16.3 15.8	16.1	15.2		
				Middle	4	28.1 28.1	28.1	7.7 7.7	7.7	28.4 28.4	28.4	81.2 81.1	81.2	5.4 5.4	5.4		10.1 10.1			10.1			14.1 18.7	16.4
				Bottom	7	27.8 27.8	27.8	7.6 7.6	7.6	28.8 28.8	28.8	73.6 71.6	72.6	4.9 4.8	4.9		11.0 11.0			11.0			12.0 14.2	13.1

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
3-Aug-16	Fine	Moderate	19:06	Surface	1	27.6 27.6	27.6	8.0 8.0	8.0	25.6 25.6	25.6	93.9 93.1	93.5	6.4 6.4	6.4	6.4	7.1 7.1	7.1	8.6	13.6 14.0	13.8	14.3
				Middle	4	27.8 27.8	27.8	8.1 8.1	8.1	28.0 27.8	27.9	93.0 93.0	93.0	6.3 6.3	6.3		7.4 8.1	7.8		11.8 14.8	13.3	
				Bottom	7	28.1 28.1	28.1	8.1 8.1	8.1	28.9 28.9	28.9	91.6 91.3	91.5	6.1 6.1	6.1		10.5 11.2	10.9		17.7 13.6	15.7	
5-Aug-16	Fine	Moderate	07:29	Surface	1	27.7 27.7	27.7	8.1 8.1	8.1	26.1 26.5	26.3	98.3 96.0	97.2	6.7 6.5	6.6	6.3	3.8 4.0	3.9	4.7	5.8 4.0	4.9	5.7
				Middle	4	27.6 27.6	27.6	8.1 8.1	8.1	29.2 29.0	29.1	88.1 88.0	88.1	5.9 5.9	5.9		4.4 4.4	4.4		5.8 7.8	6.8	
				Bottom	7	27.5 27.6	27.6	8.2 8.2	8.2	29.3 29.2	29.3	81.2 80.7	81.0	5.4 5.4	5.4		5.8 5.9	5.9		4.8 5.8	5.3	
8-Aug-16	Sunny	Moderate	10:12	Surface	1	28.1 27.2	27.7	8.1 8.1	8.1	30.8 30.3	30.6	120.5 117.8	119.2	7.9 7.9	7.9	7.9	4.9 4.8	4.9	5.6	4.5 2.9	3.7	4.0
				Middle	3.5	27.2 27.2	27.2	8.1 8.1	8.1	30.2 30.3	30.3	117.6 117.8	117.7	7.9 7.9	7.9		4.8 5.1	5.0		4.0 5.4	4.7	
				Bottom	6	27.2 28.1	27.7	8.1 8.1	8.1	30.3 30.3	30.3	117.6 107.8	112.7	7.9 7.1	7.5		7.0 6.7	6.9		3.0 4.0	3.5	
10-Aug-16	Rainy	Calm	10:49	Surface	1	27.5 27.5	27.5	7.8 7.8	7.8	27.0 27.0	27.0	94.4 93.6	94.0	6.4 6.4	6.4	6.0	6.2 6.8	6.5	8.2	2.8 4.2	3.5	4.2
				Middle	4	26.3 26.3	26.3	7.8 7.8	7.8	28.7 28.6	28.7	80.1 79.2	79.7	5.5 5.4	5.5		7.9 8.1	8.0		2.7 5.9	4.3	
				Bottom	7	25.8 25.8	25.8	7.9 7.9	7.9	28.1 28.2	28.2	70.1 70.0	70.1	4.9 4.9	4.9		9.8 10.2	10.0		4.6 4.7	4.7	
12-Aug-16	Rainy	Moderate	14:49	Surface	1	27.0 27.0	27.0	7.9 7.9	7.9	25.2 25.2	25.2	94.9 95.4	95.2	6.6 6.6	6.6	6.7	4.1 4.2	4.2	4.0	3.3 3.7	3.5	3.2
				Middle	4	26.8 26.8	26.8	7.9 7.9	7.9	26.2 26.1	26.2	96.7 96.4	96.6	6.7 6.7	6.7		3.9 3.6	3.8		2.7 2.5	2.6	
				Bottom	7	26.0 26.0	26.0	8.0 8.0	8.0	30.0 30.0	30.0	83.6 83.7	83.7	5.7 5.7	5.7		3.9 3.8	3.9		3.0 3.7	3.4	
15-Aug-16	Rainy	Moderate	17:11	Surface	1	26.7 26.7	26.7	7.9 7.9	7.9	27.8 27.9	27.9	90.1 89.9	90.0	6.2 6.2	6.2	6.2	7.3 8.4	7.9	8.6	8.9 7.2	8.1	8.5
				Middle	4	26.4 26.4	26.4	7.9 7.9	7.9	29.7 29.8	29.8	91.1 91.0	91.1	6.2 6.2	6.2		9.3 9.3	9.3		7.9 9.9	8.9	
				Bottom	7	26.2 26.2	26.2	8.0 8.0	8.0	31.3 31.3	31.3	87.4 87.5	87.5	5.9 5.9	5.9		8.5 8.9	8.7		8.2 8.6	8.4	
17-Aug-16	Rainy	Rough	18:14	Surface	1	26.4 26.5	26.5	8.0 8.0	8.0	30.8 30.8	30.8	88.8 87.8	88.3	6.0 5.9	6.0	5.9	6.3 6.2	6.3	7.7	11.6 12.2	11.9	10.7
				Middle	4	26.3 26.3	26.3	8.0 8.0	8.0	30.9 30.9	30.9	84.9 84.5	84.7	5.8 5.7	5.8		8.1 8.4	8.3		9.3 12.4	10.9	
				Bottom	7	26.2 26.2	26.2	8.0 8.0	8.0	30.9 30.9	30.9	83.1 82.6	82.9	5.6 5.6	5.6		8.9 8.1	8.5		8.8 10.0	9.4	
19-Aug-16	Fine	Moderate	19:08	Surface	1	27.0 27.0	27.0	8.1 8.0	8.1	21.0 20.8	20.9	88.2 87.6	87.9	6.3 6.2	6.3	6.2	7.8 8.1	8.0	9.4	5.6 7.1	6.4	7.3
				Middle	4	26.8 26.8	26.8	8.1 8.1	8.1	22.5 22.3	22.4	87.0 86.9	87.0	6.1 6.1	6.1		8.6 11.4	8.5		8.5 8.0	8.3	
				Bottom	7	26.7 26.7	26.7	8.1 8.1	8.1	24.9 24.9	24.9	85.4 84.2	84.8	6.0 5.9	6.0		11.4 11.9	11.7		6.8 7.6	7.2	

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST2 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
22-Aug-16	Sunny	Calm	09:00	Surface	1	27.3 27.2	27.3	8.0 8.0	8.0	31.1 31.1	31.1	92.9 92.0	92.5	6.2 6.1	6.2	6.2	3.3 3.8	3.6	4.9	9.1 10.4	9.8	10.7
				Middle	4	27.0 26.9	27.0	8.0 8.0	8.0	31.1 31.1	31.1	91.2 90.1	90.7	6.1 6.0	6.1		4.6 4.2	4.4		10.5 10.5	10.5	
				Bottom	7	26.9 26.9	26.9	8.0 8.0	8.0	31.3 31.4	31.4	87.0 86.1	86.6	5.8 5.8	5.8	6.6 6.5	6.6	6.6 6.5		6.6	10.9 12.5	
24-Aug-16	Sunny	Calm	10:37	Surface	1	26.3 26.3	26.3	7.9 7.9	7.9	29.8 29.8	29.8	83.2 83.2	83.2	5.7 5.7	5.7	5.7	6.2 6.3	6.3	6.7	5.8 7.0	6.4	6.3
				Middle	4	26.3 26.3	26.3	7.9 7.8	7.9	29.8 29.8	29.8	83.2 83.3	83.3	5.7 5.7	5.7		6.7 6.9	6.8		6.2 6.9	6.6	
				Bottom	7	26.3 26.3	26.3	7.9 7.9	7.9	29.9 29.9	29.9	82.9 82.5	82.7	5.7 5.6	5.7	6.9 6.8	6.9	5.8 5.8		5.8		
26-Aug-16	Cloudy	Moderate	13:55	Surface	1	29.9 29.8	29.9	7.5 7.5	7.5	22.1 22.5	22.3	108.1 108.1	108.1	7.3 7.3	7.3	7.3	6.8 6.7	6.8	7.7	3.3 3.6	3.5	3.3
				Middle	4	28.7 28.7	28.7	7.6 7.6	7.6	26.2 26.2	26.2	107.0 106.4	106.7	7.2 7.1	7.2		6.9 7.1	7.0		3.0 2.9	3.0	
				Bottom	7	27.2 27.2	27.2	7.6 7.6	7.6	28.8 28.8	28.8	81.2 80.5	80.9	5.5 5.4	5.5	9.3 9.3	9.3	3.5 3.0		3.3		
29-Aug-16	Cloudy	Moderate	17:02	Surface	1	28.5 28.5	28.5	8.0 8.0	8.0	23.3 23.3	23.3	97.0 88.2	92.6	6.6 6.0	6.3	6.2	4.2 4.3	4.3	6.9	9.3 8.7	9.0	9.9
				Middle	4	28.1 28.1	28.1	7.9 7.9	7.9	25.2 25.2	25.2	93.3 82.5	87.9	6.3 5.6	6.0		8.7 8.9	8.8		10.3 9.9	10.1	
				Bottom	7	26.6 26.6	26.6	7.8 7.8	7.8	28.5 28.5	28.5	87.3 87.2	87.3	6.0 6.0	6.0	7.2 7.9	7.6	12.1 9.2		10.7		
31-Aug-16	Cloudy	Moderate	18:06	Surface	1	28.5 28.5	28.5	8.0 8.0	8.0	24.6 24.3	24.5	100.1 100.4	100.3	6.8 6.8	6.8	6.4	12.1 11.6	11.9	10.5	15.6 16.8	16.2	16.5
				Middle	4	27.7 27.7	27.7	7.9 7.9	7.9	29.9 30.0	30.0	89.5 88.3	88.9	6.0 5.9	6.0		9.4 9.4	9.4		18.1 16.4	17.3	
				Bottom	7	27.3 27.3	27.3	7.8 7.8	7.8	30.2 30.2	30.2	77.6 77.4	77.5	5.2 5.2	5.2	10.0 10.1	10.1	16.6 15.6		16.1		

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
1-Aug-16	Cloudy	Moderate	11:11	Surface	1	28.2 28.2	28.2	7.9 7.9	7.9	20.2 19.9	20.1	87.9 87.7	87.8	6.7 6.7	6.7	6.5	3.7 4.1	3.9	3.8	8.2 9.9	9.1	8.6
				Middle	6.5	27.1 27.1	27.1	7.9 7.9	7.9	31.7 32.7	32.2	85.5 85.5	85.5	6.2 6.2	6.2		3.9 4.3	4.1		8.9 7.5	8.2	
				Bottom	12	26.5 26.4	26.5	7.8 7.8	7.8	37.0 36.7	36.9	84.8 85.1	85.0	6.1 6.1	6.1		3.3 3.6	3.5		7.7 9.0	8.4	
3-Aug-16	Rainy	Moderate	12:53	Surface	1	28.5 27.5	28.0	8.2 8.0	8.1	28.2 27.9	28.1	90.6 91.3	91.0	6.0 6.2	6.1	6.1	6.4 6.4	6.4	9.7	9.0 10.3	9.7	9.1
				Middle	7	28.1 28.3	28.2	8.1 8.1	8.1	27.5 27.4	27.5	91.6 89.3	90.5	6.1 6.0	6.1		11.3 11.4	11.4		8.5 9.7	9.1	
				Bottom	13	28.2 27.5	27.9	8.0 8.2	8.1	27.3 27.8	27.6	92.8 95.3	94.1	6.2 6.5	6.4		10.1 12.3	11.2		9.8 7.3	8.6	
5-Aug-16	Fine	Moderate	14:27	Surface	1	28.0 27.9	28.0	8.0 8.0	8.0	20.6 21.0	20.8	89.8 89.6	89.7	6.3 6.3	6.3	6.3	6.3 6.0	6.2	8.6	3.4 4.0	3.7	3.5
				Middle	6	27.8 27.7	27.8	8.0 7.9	8.0	24.7 23.8	24.3	91.5 90.0	90.8	6.3 6.2	6.3		9.1 8.9	9.0		3.3 4.7	4.0	
				Bottom	11	27.6 27.6	27.6	8.0 7.9	8.0	35.9 35.7	35.8	85.1 84.9	85.0	5.5 5.5	5.5		10.3 10.6	10.5		2.3 3.1	2.7	
8-Aug-16	Sunny	Moderate	16:13	Surface	1	27.9 27.9	27.9	7.9 7.9	7.9	30.0 30.1	30.1	115.6 114.0	114.8	7.7 7.6	7.7	7.5	5.6 5.4	5.5	7.2	7.1 6.0	6.6	6.5
				Middle	6	28.0 28.0	28.0	7.9 8.0	8.0	30.4 30.5	30.5	108.3 109.1	108.7	7.2 7.2	7.2		7.0 6.9	7.0		6.6 6.4	6.5	
				Bottom	11	28.1 28.1	28.1	8.1 8.2	8.2	31.9 32.1	32.0	108.8 107.5	108.2	7.1 7.0	7.1		9.5 8.8	9.2		6.6 6.1	6.4	
10-Aug-16	Cloudy	Calm	16:41	Surface	1	26.8 27.0	26.9	8.0 8.1	8.1	27.3 27.1	27.2	88.8 93.8	91.3	6.1 6.4	6.3	6.3	6.1 6.4	6.3	9.5	4.8 7.3	6.1	4.9
				Middle	6.5	27.5 27.6	27.6	8.0 8.0	8.0	26.9 26.9	26.9	91.1 89.7	90.4	6.2 6.1	6.2		11.1 11.3	11.2		4.1 3.9	4.0	
				Bottom	12	26.9 27.5	27.2	7.9 8.1	8.0	27.5 26.8	27.2	93.2 91.8	92.5	6.4 6.3	6.4		9.9 12.0	11.0		4.2 5.1	4.7	
12-Aug-16	Rainy	Moderate	08:01	Surface	1	28.0 28.5	28.3	7.9 7.9	7.9	29.1 29.1	29.1	92.5 91.5	92.0	6.2 6.1	6.2	6.2	5.3 5.9	5.6	7.9	8.4 10.9	9.7	11.1
				Middle	5	26.4 26.1	26.3	8.0 8.0	8.0	28.9 28.8	28.9	88.6 89.7	89.2	6.1 6.2	6.2		8.6 8.8	8.7		10.8 12.2	11.5	
				Bottom	9	25.5 25.4	25.5	8.0 8.0	8.0	28.4 28.3	28.4	87.8 86.2	87.0	6.1 6.0	6.1		9.6 9.1	9.4		11.9 12.3	12.1	
15-Aug-16	Rainy	Moderate	11:10	Surface	1	26.7 26.7	26.7	7.9 7.9	7.9	26.4 26.5	26.5	89.0 89.3	89.2	6.2 6.2	6.2	6.3	3.4 3.7	3.6	4.7	8.1 7.4	7.8	7.9
				Middle	5.5	25.9 26.0	26.0	8.0 8.0	8.0	29.1 29.1	29.1	90.2 90.7	90.5	6.2 6.3	6.3		5.5 4.8	5.2		7.7 7.3	7.5	
				Bottom	10	25.5 25.5	25.5	7.9 7.9	7.9	31.2 31.2	31.2	86.4 84.5	85.5	5.9 5.8	5.9		4.8 5.5	5.2		9.0 7.8	8.4	
17-Aug-16	Rainy	Rough	12:27	Surface	1	26.9 26.9	26.9	8.0 8.0	8.0	30.8 30.8	30.8	84.1 84.8	84.5	5.7 5.7	5.7	5.8	4.9 4.8	4.9	5.9	12.8 13.5	13.2	13.8
				Middle	6	26.8 26.8	26.8	8.0 8.0	8.0	31.2 31.2	31.2	85.8 86.2	86.0	5.8 5.8	5.8		5.2 5.3	5.3		13.9 13.3	13.6	
				Bottom	11	26.7 26.7	26.7	8.0 8.0	8.0	31.4 31.4	31.4	83.0 82.5	82.8	5.6 5.5	5.6		7.3 7.5	7.4		13.5 15.6	14.6	

Remarks: *DA: Depth-Averaged
 **Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST3 - Mid-Ebb Tide

Date	Weather Condition	Sea Condition*	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
19-Aug-16	Fine	Moderate	14:16	Surface	1	27.6 27.6	27.6	8.1 8.1	8.1	23.9 24.0	24.0	100.3 101.0	100.7	6.9 7.0	7.0	7.1	6.0 5.9	6.0	7.0	8.8 8.2	8.5	8.3		
				Middle	6	27.5 27.5	27.5	8.1 8.1	8.1	24.3 24.4	24.4	102.0 102.3	102.2	7.0 7.1	7.1		6.3 6.4			6.4			9.1 8.1	8.6
				Bottom	11	27.4 27.4	27.4	8.1 8.1	8.1	24.6 24.5	24.6	99.2 98.8	99.0	6.8 6.8	6.8		8.4 8.6			8.5			8.7 7.1	7.9
22-Aug-16	Sunny	Calm	14:40	Surface	1	27.6 27.6	27.6	8.0 8.0	8.0	30.9 30.8	30.9	95.8 96.2	96.0	6.4 6.4	6.4	6.5	8.0 7.5	7.8	8.1	7.1 7.0	7.1	7.6		
				Middle	6.5	27.6 27.6	27.6	8.0 8.0	8.0	29.5 31.1	30.3	98.1 98.0	98.1	6.6 6.5	6.6		8.7 8.3			8.5			6.8 7.0	6.9
				Bottom	12	27.6 27.6	27.6	8.0 8.0	8.0	31.3 31.2	31.3	97.4 97.0	97.2	6.5 6.4	6.5		8.1 8.1			8.1			9.3 8.4	8.9
24-Aug-16	Sunny	Calm	16:33	Surface	1	26.3 26.3	26.3	7.8 7.8	7.8	30.7 30.7	30.7	85.7 84.9	85.3	5.8 5.8	5.8	5.8	6.9 8.0	7.5	7.6	7.4 7.0	7.2	6.8		
				Middle	7	26.2 26.2	26.2	7.9 7.9	7.9	31.1 31.1	31.1	84.7 84.9	84.8	5.7 5.8	5.8		7.5 7.4			7.5			6.0 6.5	6.3
				Bottom	13	26.1 26.1	26.1	7.9 7.9	7.9	32.0 31.4	31.7	84.6 84.8	84.7	5.7 5.8	5.8		7.5 7.9			7.7			5.8 8.1	7.0
26-Aug-16	Cloudy	Moderate	08:32	Surface	1	29.9 29.9	29.9	7.6 7.6	7.6	24.5 24.5	24.5	98.1 98.4	98.3	6.5 6.5	6.5	6.6	2.9 3.2	3.1	4.2	5.2 5.7	5.5	5.0		
				Middle	5.5	29.2 29.2	29.2	7.6 7.6	7.6	27.2 27.1	27.2	99.4 99.9	99.7	6.6 6.6	6.6		5.0 4.3			4.7			4.7 5.8	5.3
				Bottom	10	28.8 28.7	28.8	7.6 7.6	7.6	29.2 29.3	29.3	95.4 93.4	94.4	6.3 6.1	6.2		4.3 5.0			4.7			4.4 3.7	4.1
29-Aug-16	Cloudy	Moderate	11:31	Surface	1	29.5 29.5	29.5	7.9 7.9	7.9	21.6 21.6	21.6	85.1 85.6	85.4	5.8 5.8	5.8	5.7	2.3 2.5	2.4	3.4	11.7 14.9	13.3	10.1		
				Middle	6.5	29.4 29.3	29.4	8.0 8.0	8.0	25.1 25.3	25.2	84.1 83.9	84.0	5.6 5.6	5.6		2.5 2.5			2.5			8.7 8.6	8.7
				Bottom	12	29.0 28.9	29.0	8.1 8.1	8.1	28.0 28.1	28.1	85.1 85.1	85.1	5.6 5.6	5.6		4.8 5.6			5.2			7.7 8.9	8.3
31-Aug-16	Cloudy	Rough	12:27	Surface	1	28.2 28.2	28.2	7.9 7.9	7.9	27.3 27.3	27.3	92.2 92.9	92.6	6.2 6.2	6.2	6.3	9.4 9.3	9.4	10.4	4.0 11.7	7.9	8.3		
				Middle	6	28.1 28.1	28.1	7.9 7.9	7.9	27.7 27.7	27.7	94.3 93.9	94.1	6.3 6.3	6.3		9.8 9.7			9.8			4.4 10.1	7.3
				Bottom	11	28.0 28.0	28.0	7.9 7.9	7.9	27.9 27.9	27.9	91.1 90.6	90.9	6.1 6.1	6.1		11.8 12.0			11.9			10.4 8.8	9.6

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Water Quality Monitoring Results at ST3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)				
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*		
3-Aug-16	Fine	Moderate	19:08	Surface	1	28.6 27.9	28.3	8.2 8.2	8.2	27.4 28.0	27.7	94.0 91.3	92.7	6.3 6.1	6.2	6.3	6.3 6.5	6.4	9.6	9.1 9.4	9.3	8.6		
				Middle	6.5	27.4 27.1	27.3	8.0 8.0	8.0	27.0 27.5	27.3	90.8 94.0	92.4	6.2 6.4	6.3		11.2 11.5			11.4			8.4 7.0	7.7
				Bottom	12	28.5 28.3	28.4	8.2 7.9	8.1	27.4 27.5	27.5	93.1 89.0	91.1	6.2 6.0	6.1		10.0 12.1			11.1			8.4 9.1	8.8
5-Aug-16	Fine	Moderate	08:28	Surface	1	28.2 28.2	28.2	8.3 8.3	8.3	22.9 23.2	23.1	98.7 97.6	98.2	6.8 6.7	6.8	6.7	6.1 6.2	6.2	8.4	4.0 3.1	3.6	3.3		
				Middle	6	28.0 27.0	27.5	8.1 8.1	8.1	25.1 24.8	25.0	96.8 93.0	94.9	6.6 6.5	6.6		8.9 8.7			8.8			2.9 3.2	3.1
				Bottom	11	26.7 26.7	26.7	7.9 8.0	8.0	31.7 31.9	31.8	86.9 87.0	87.0	5.8 5.8	5.8		10.3 10.1			10.2			3.1 3.0	3.1
8-Aug-16	Sunny	Moderate	09:36	Surface	1	27.9 28.0	28.0	8.1 8.1	8.1	29.6 29.6	29.6	114.5 113.6	114.1	7.6 7.5	7.6	7.5	6.0 6.0	6.0	7.4	5.3 6.6	6.0	6.0		
				Middle	6	28.0 28.0	28.0	8.2 8.2	8.2	30.3 30.4	30.4	109.6 110.8	110.2	7.3 7.3	7.3		6.4 6.5			6.5			5.9 6.5	6.0
				Bottom	11	28.2 28.2	28.2	8.2 8.2	8.2	32.0 32.0	32.0	108.1 106.3	107.2	7.1 6.9	7.0		9.6 9.9			9.8			6.3 6.3	6.1
10-Aug-16	Rainy	Calm	11:16	Surface	1	27.5 27.6	27.6	7.9 7.9	7.9	27.6 27.7	27.7	95.1 89.4	92.3	6.4 6.0	6.2	6.3	6.3 6.3	6.3	9.5	5.8 8.3	7.1	7.5		
				Middle	7	26.8 27.5	27.2	8.0 7.8	7.9	27.4 26.9	27.2	90.3 94.8	92.6	6.2 6.4	6.3		11.1 11.3			11.2			7.5 8.6	8.1
				Bottom	13	27.0 27.7	27.4	8.0 8.1	8.1	27.8 27.6	27.7	93.9 90.4	92.2	6.4 6.1	6.3		9.9 12.1			11.0			6.7 7.6	7.2
12-Aug-16	Rainy	Moderate	15:13	Surface	1	27.9 28.1	28.0	7.9 7.9	7.9	27.4 28.1	27.8	93.6 92.4	93.0	6.3 6.2	6.3	6.2	4.4 5.1	4.8	7.0	9.6 9.4	9.5	9.2		
				Middle	5.5	26.3 25.7	26.0	8.0 8.0	8.0	28.0 28.0	28.0	87.5 88.4	88.0	6.0 6.2	6.1		6.7 7.8			7.3			9.4 9.0	9.2
				Bottom	10	24.9 24.9	24.9	8.0 8.0	8.0	27.0 26.9	27.0	88.3 87.4	87.9	6.3 6.2	6.3		8.5 9.1			8.8			8.6 8.9	8.8
15-Aug-16	Rainy	Moderate	17:05	Surface	1	27.1 27.1	27.1	8.1 8.1	8.1	26.0 26.0	26.0	106.2 105.7	106.0	7.3 7.3	7.3	7.3	3.6 3.9	3.8	4.3	8.2 7.9	8.1	7.3		
				Middle	6	26.5 26.5	26.5	8.1 8.1	8.1	28.2 28.3	28.3	105.5 104.9	105.2	7.2 7.2	7.2		4.6 4.6			4.6			6.7 6.0	6.4
				Bottom	11	26.1 26.1	26.1	8.1 8.0	8.1	30.3 30.3	30.3	100.1 101.5	100.8	6.8 6.9	6.9		4.6 4.6			4.6			7.0 7.6	7.3
17-Aug-16	Rainy	Rough	17:43	Surface	1	26.8 26.8	26.8	8.0 8.0	8.0	29.9 29.9	29.9	82.5 83.0	82.8	5.6 5.6	5.6	5.7	6.1 5.6	5.9	6.2	11.7 9.1	10.4	11.8		
				Middle	6.5	26.9 26.9	26.9	8.0 8.0	8.0	28.6 30.2	29.4	84.9 84.7	84.8	5.8 5.7	5.8		6.8 6.4			6.6			7.4 17.7	12.6
				Bottom	12	26.8 26.8	26.8	8.0 8.0	8.0	30.3 30.3	30.3	84.1 83.7	83.9	5.7 5.7	5.7		6.2 6.2			6.2			12.2 12.8	12.5
19-Aug-16	Fine	Moderate	18:46	Surface	1	26.3 26.3	26.3	8.1 8.1	8.1	23.0 23.0	23.0	96.6 97.1	96.9	6.9 6.9	6.9	7.0	7.2 6.7	7.0	7.3	8.6 9.5	9.1	8.5		
				Middle	6.5	26.4 26.4	26.4	8.1 8.1	8.1	21.7 23.3	22.5	98.8 98.8	98.8	7.1 7.0	7.1		7.9 7.5			7.7			7.8 8.4	8.1
				Bottom	12	26.3 26.3	26.3	8.1 8.1	8.1	23.4 23.4	23.4	98.2 97.9	98.1	6.9 6.9	6.9		7.3 7.3			7.3			7.1 9.2	8.2

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.


Water Quality Monitoring Results at ST3 - Mid-Flood Tide

Date	Weather Condition	Sea Condition**	Sampling Time	Depth (m)		Temperature (°C)		pH		Salinity ppt		DO Saturation (%)		Dissolved Oxygen (mg/L)			Turbidity(NTU)			Suspended Solids (mg/L)		
						Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	DA*	Value	Average	DA*	Value	Average	DA*
22-Aug-16	Sunny	Calm	09:38	Surface	1	27.6 27.6	27.6	8.1 8.1	8.1	31.8 31.8	31.8	97.4 98.2	97.8	6.4 6.5	6.5	6.6	6.8 6.7	6.8	7.8	8.3 8.4	8.4	8.5
				Middle	6	27.6 27.6	27.6	8.1 8.1	8.1	32.1 32.2	32.2	99.2 99.6	99.4	6.5 6.6	6.6		7.1 7.2			7.2		
				Bottom	11	27.5 27.5	27.5	8.1 8.1	8.1	32.4 32.4	32.4	96.3 95.9	96.1	6.4 6.3	6.4	9.2 9.4	9.3	7.4 9.0	8.2			
24-Aug-16	Sunny	Calm	11:16	Surface	1	26.4 26.3	26.4	7.8 7.8	7.8	30.0 30.0	30.0	84.1 83.4	83.8	5.7 5.7	5.7	5.7	5.7 5.7	5.7	7.0	7.0 10.2	8.6	6.8
				Middle	6.5	26.2 26.2	26.2	7.9 7.9	7.9	31.8 31.7	31.8	83.2 83.1	83.2	5.6 5.6	5.6		7.1 7.1			7.1		
				Bottom	12	26.2 26.2	26.2	7.9 7.9	7.9	31.8 31.8	31.8	83.0 83.0	83.0	5.6 5.6	5.6	8.3 8.2	8.3	5.3 6.3	5.8			
26-Aug-16	Cloudy	Moderate	13:39	Surface	1	30.4 30.4	30.4	7.7 7.7	7.7	24.1 24.1	24.1	107.8 107.4	107.6	7.1 7.1	7.1	7.1	3.1 3.4	3.3	3.8	15.3 14.8	15.1	14.3
				Middle	6	29.7 29.7	29.7	7.7 7.7	7.7	26.3 26.3	26.3	107.1 106.5	106.8	7.0 7.0	7.0		4.1 4.1			4.1		
				Bottom	11	29.3 29.3	29.3	7.7 7.7	7.7	28.3 28.4	28.4	101.5 102.9	102.2	6.6 6.7	6.7	4.1 4.1	4.1	14.6 14.6	14.6			
29-Aug-16	Cloudy	Moderate	16:41	Surface	1	29.6 29.6	29.6	7.9 7.9	7.9	21.5 21.5	21.5	92.8 92.7	92.8	6.3 6.3	6.3	6.2	4.0 3.9	4.0	4.9	9.9 10.5	10.2	9.1
				Middle	7	29.2 29.3	29.3	8.0 7.9	8.0	26.0 25.6	25.8	91.6 91.5	91.6	6.1 6.1	6.1		4.0 4.1			4.1		
				Bottom	13	29.0 28.9	29.0	8.0 8.0	8.0	28.1 28.3	28.2	92.3 92.5	92.4	6.1 6.1	6.1	6.7 6.3	6.5	9.5 9.6	9.6			
31-Aug-16	Cloudy	Moderate	17:43	Surface	1	28.1 28.1	28.1	7.9 7.9	7.9	26.4 26.4	26.4	90.5 91.0	90.8	6.1 6.1	6.1	6.2	10.6 10.1	10.4	10.7	7.7 7.9	7.8	9.6
				Middle	6.5	28.2 28.2	28.2	7.9 7.9	7.9	26.7 25.1	25.9	92.7 92.9	92.8	6.2 6.3	6.3		10.9 11.3			11.1		
				Bottom	12	28.1 28.1	28.1	7.9 7.9	7.9	26.8 26.8	26.8	92.1 91.8	92.0	6.2 6.2	6.2	10.7 10.7	10.7	18.2 7.6	12.9			

Remarks: *DA: Depth-Averaged

**Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher.

Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

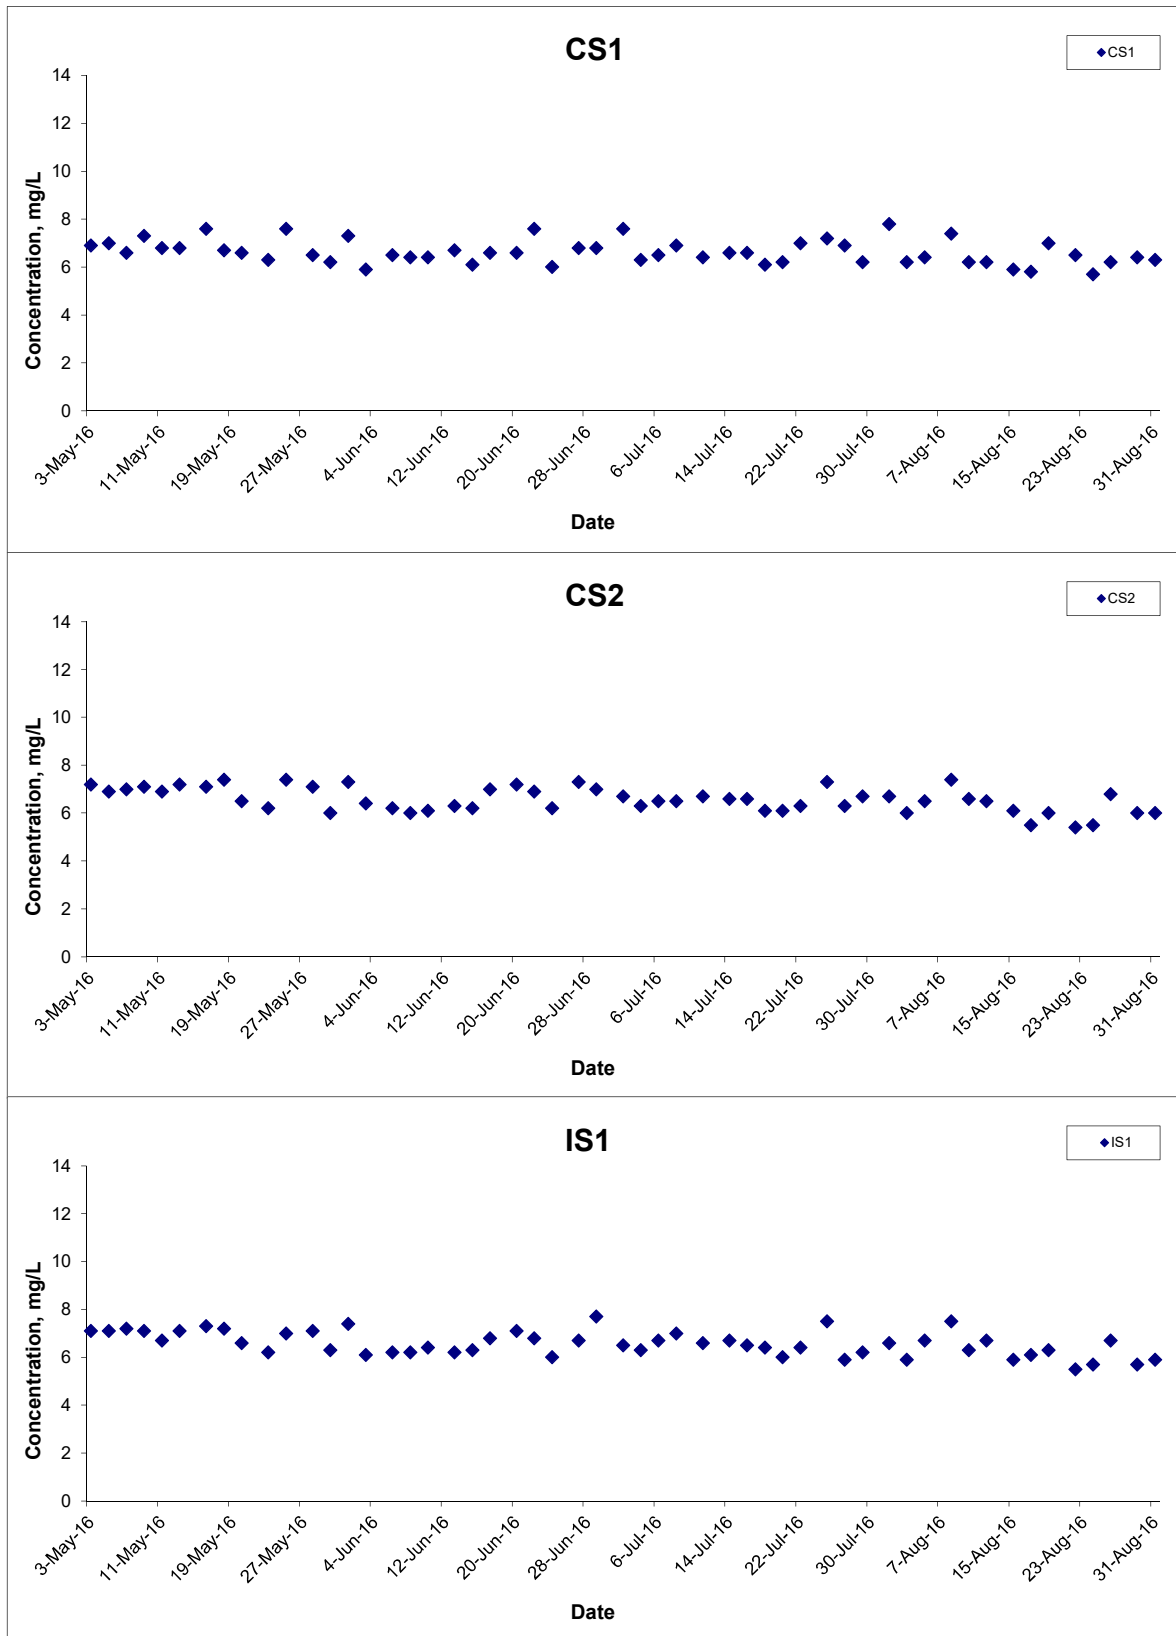


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

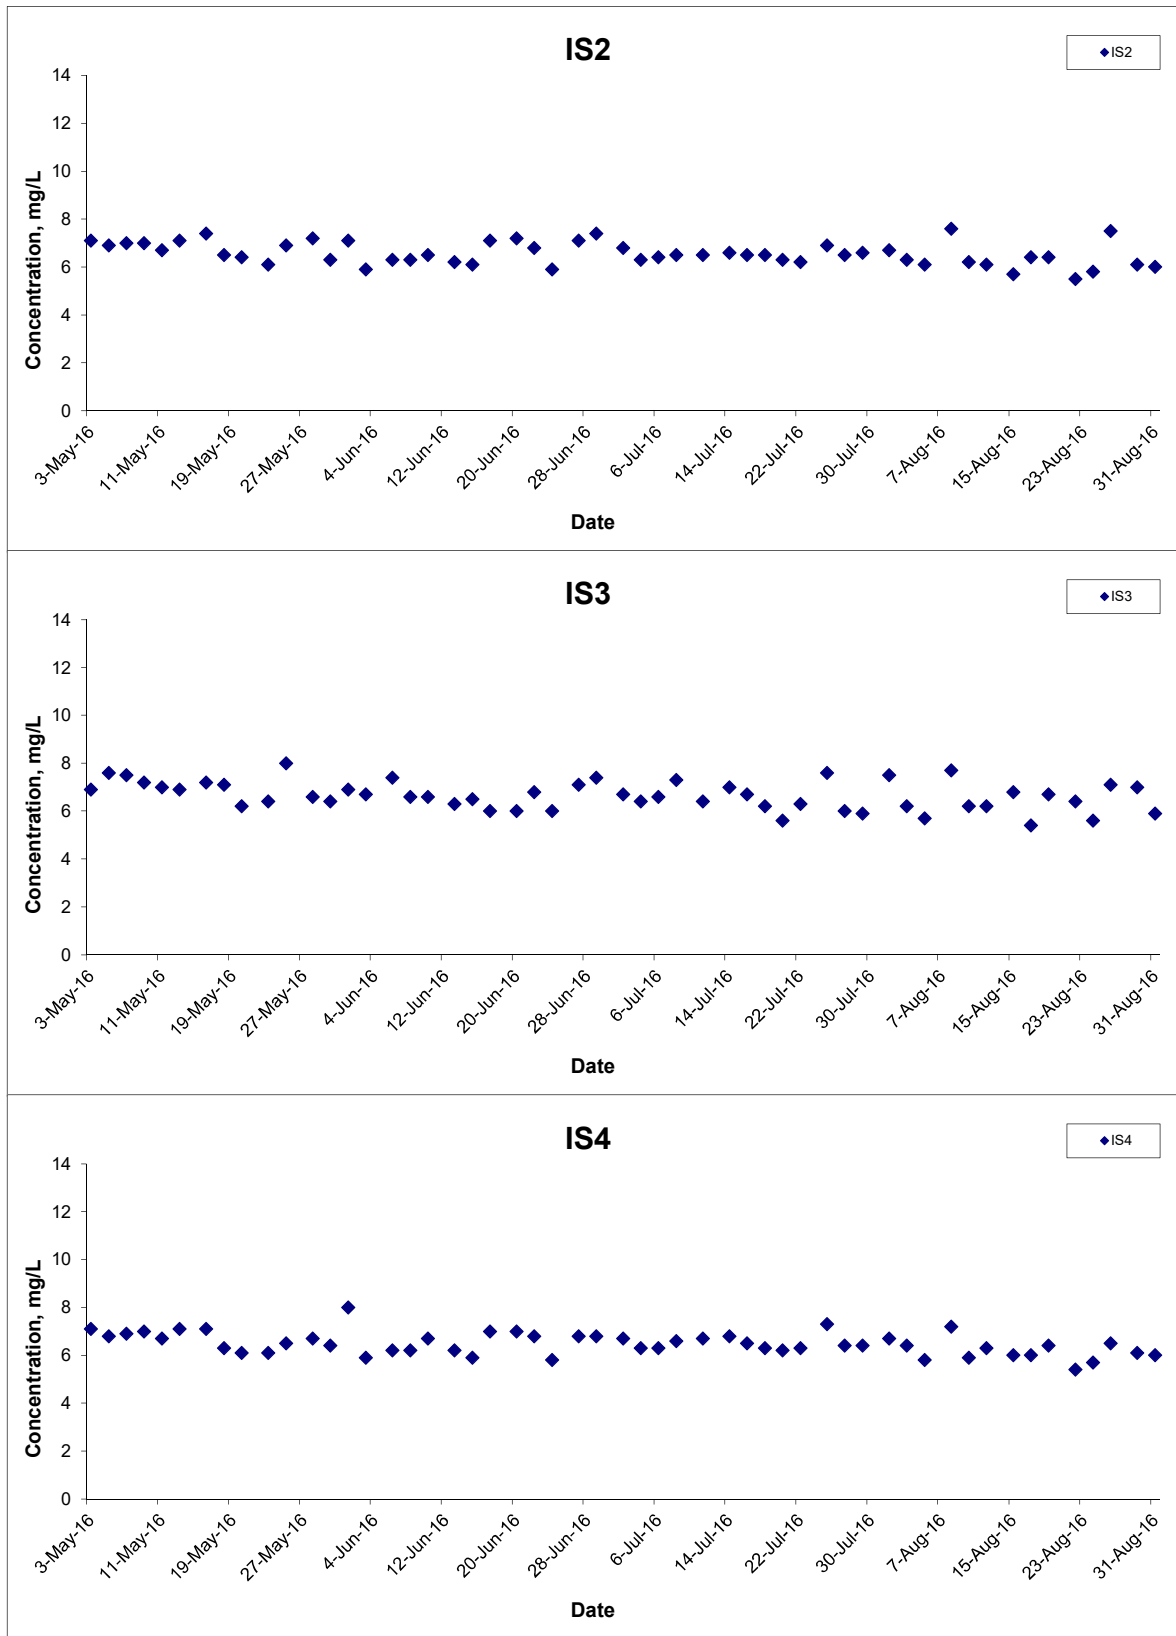


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

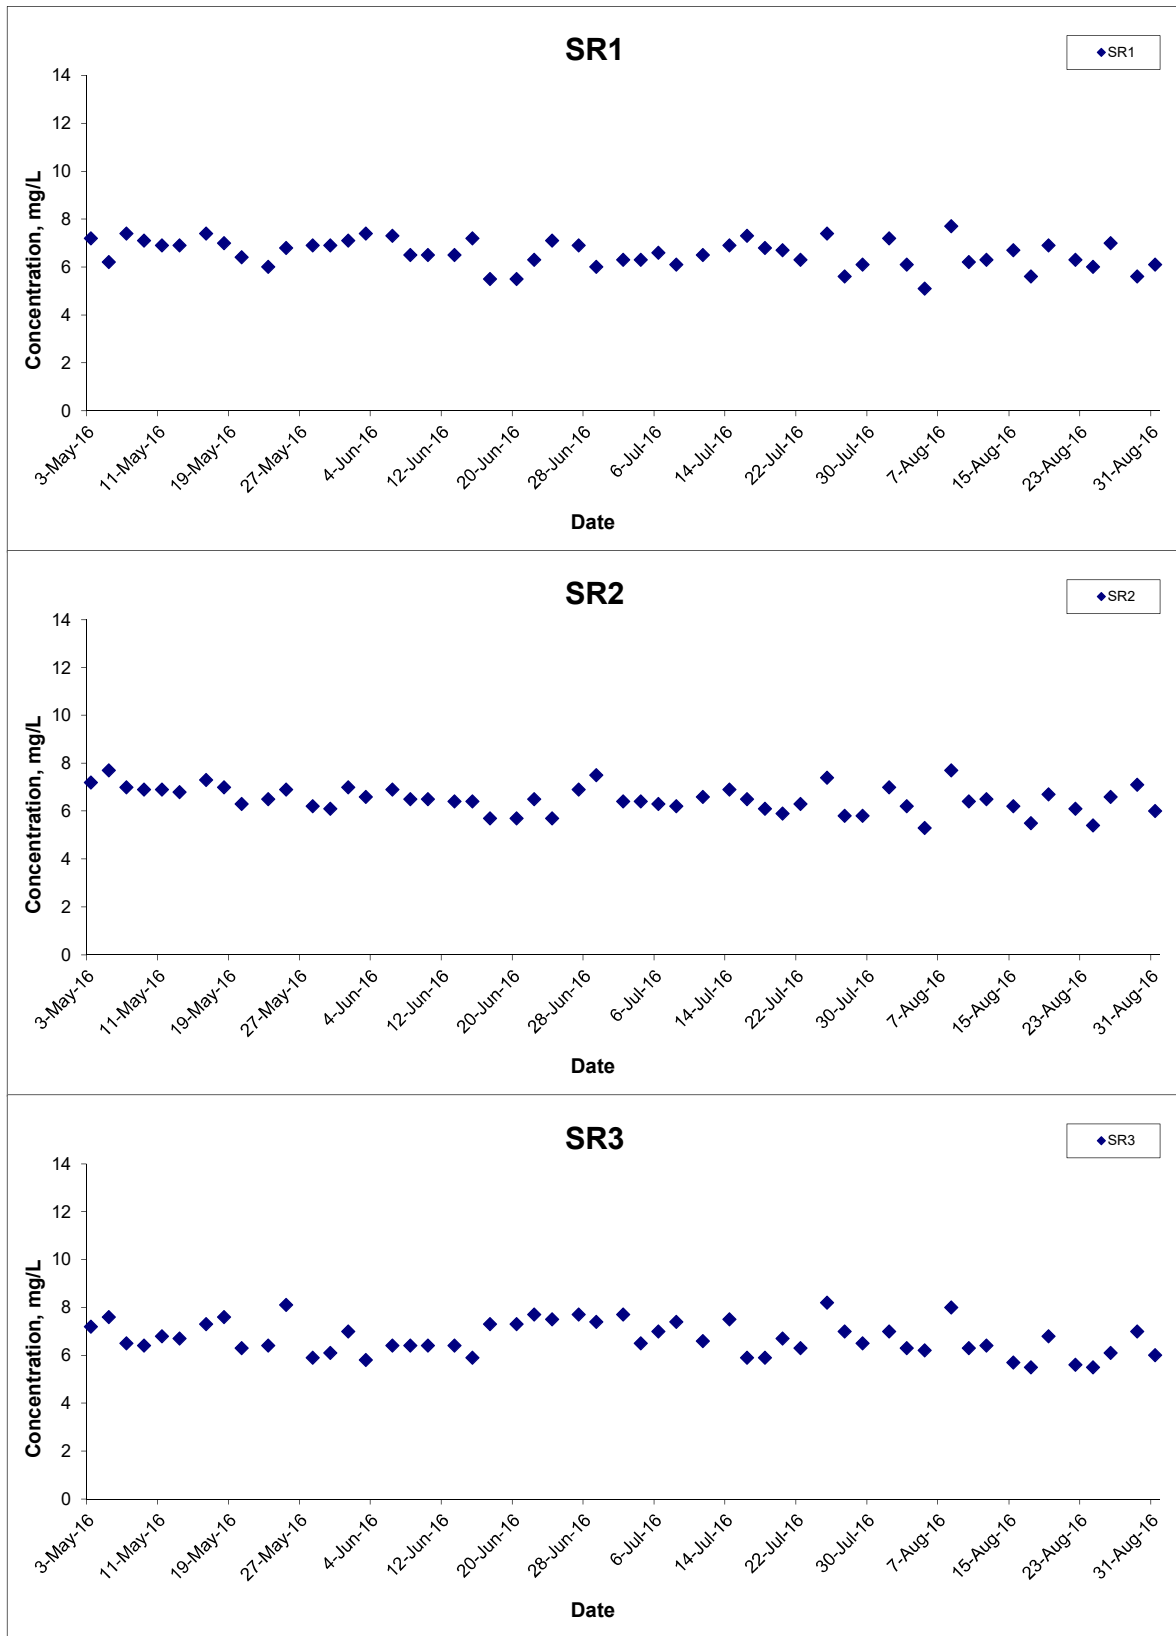


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

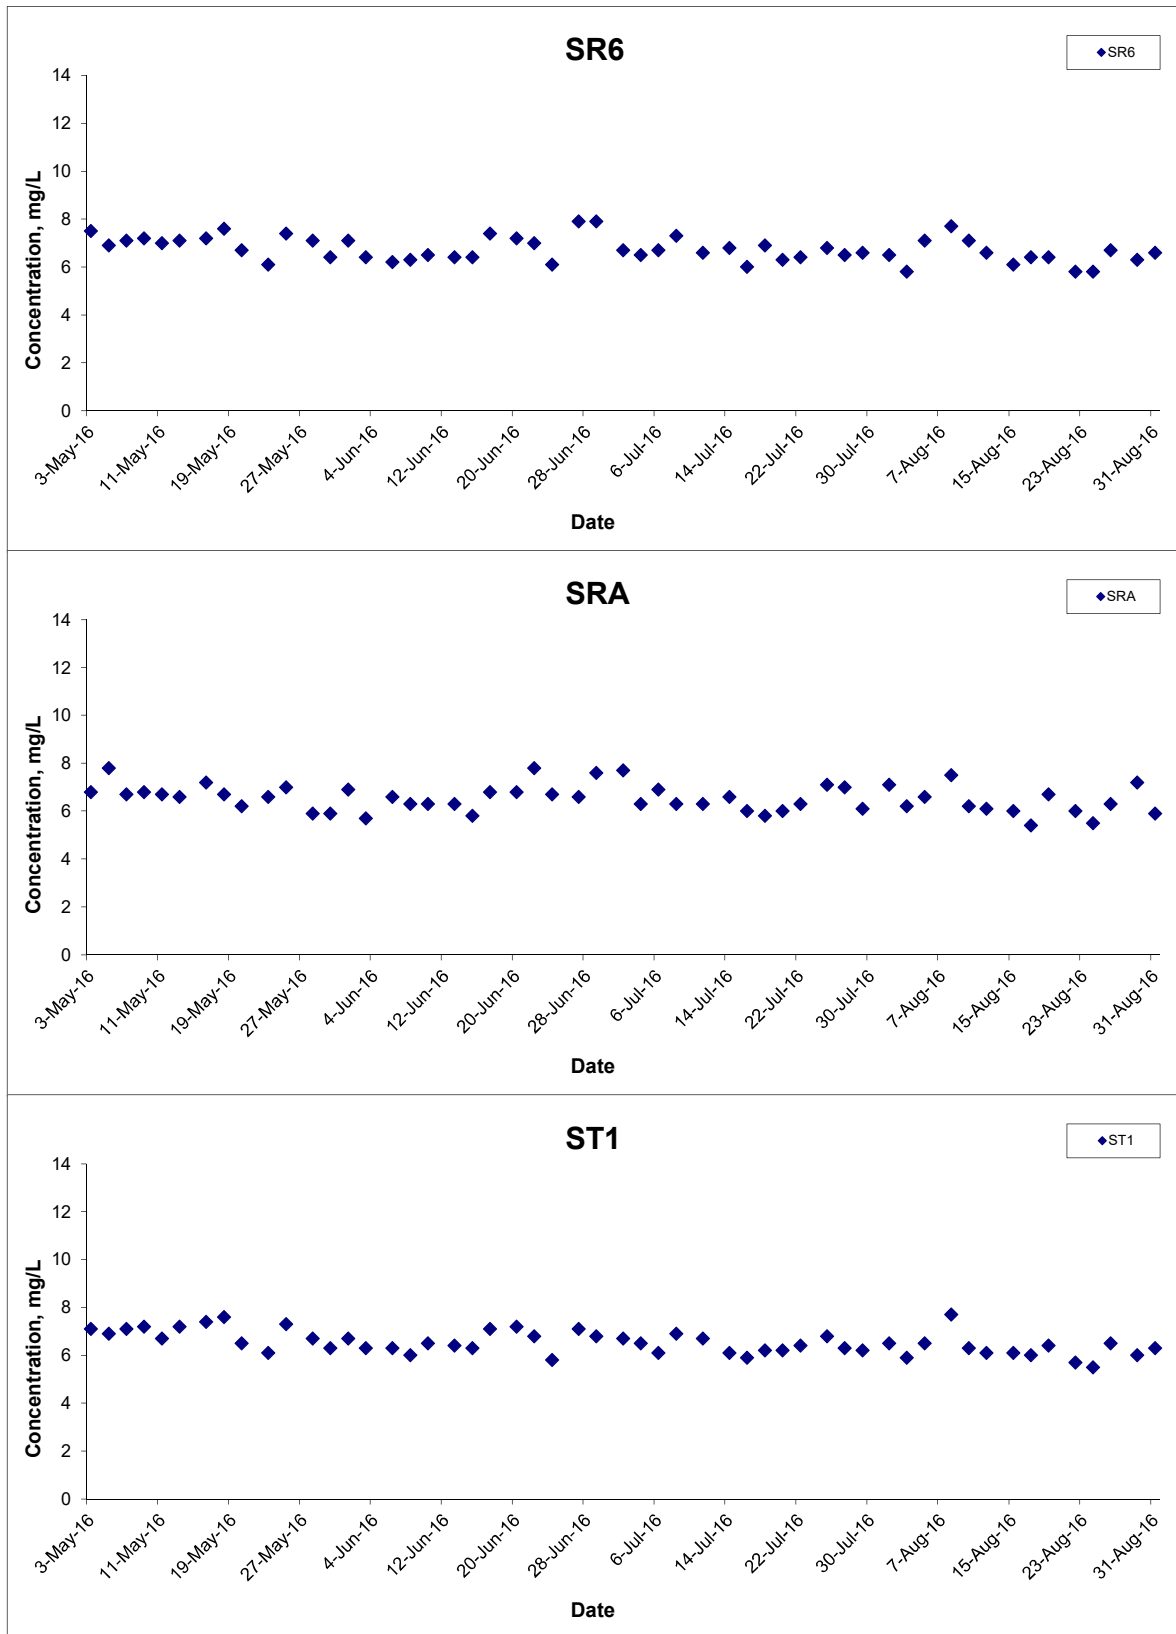


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H




Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

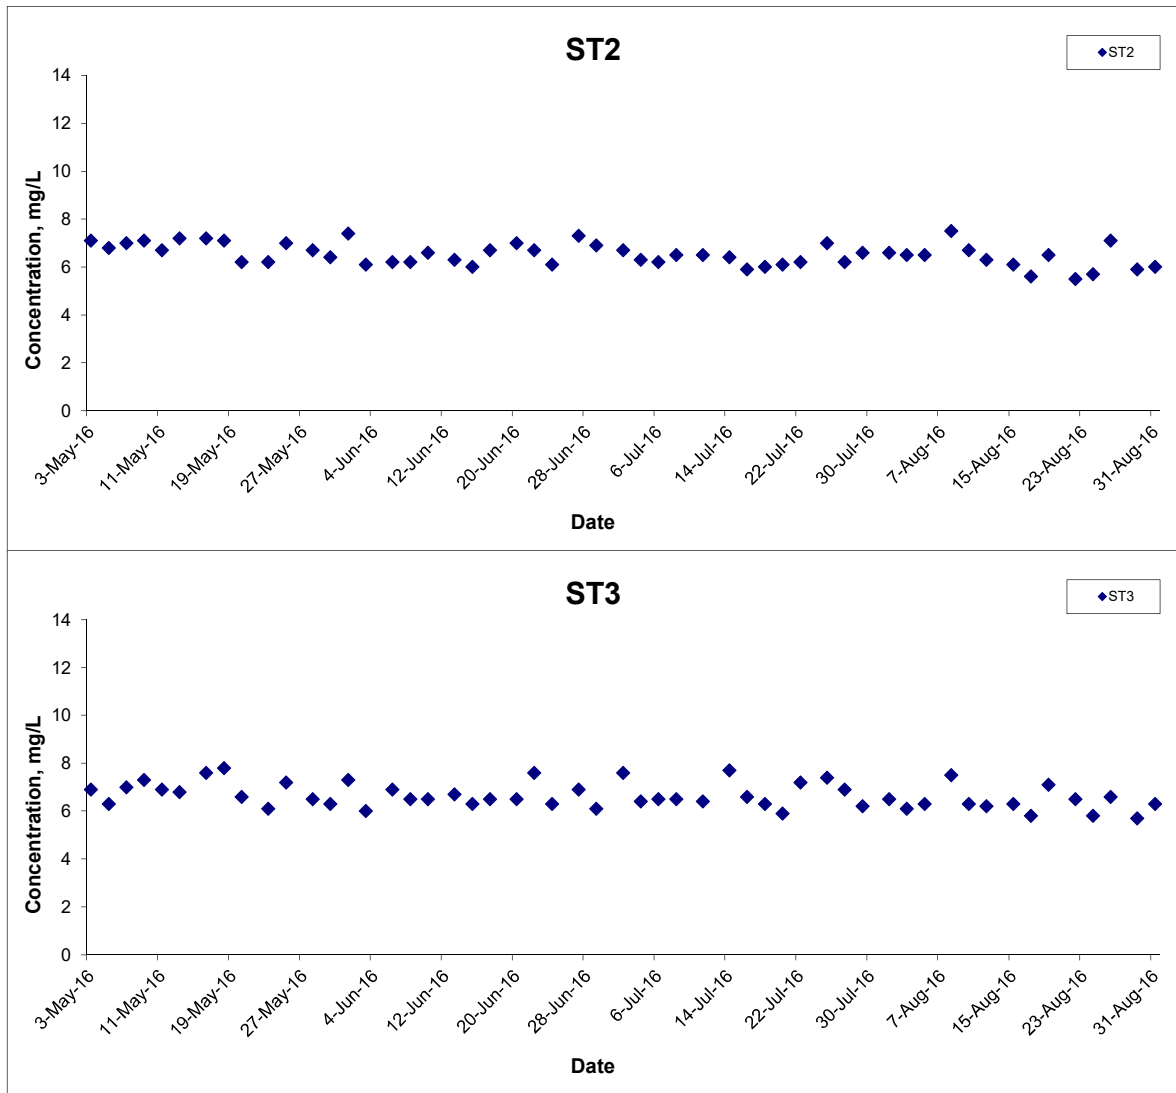

Title	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill	Scale	N.T.S	Project No.	MA12014	CINOTECH
	Graphical Presentation of Water Quality Monitoring Results	Date	Aug 16	Appendix	H	

Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

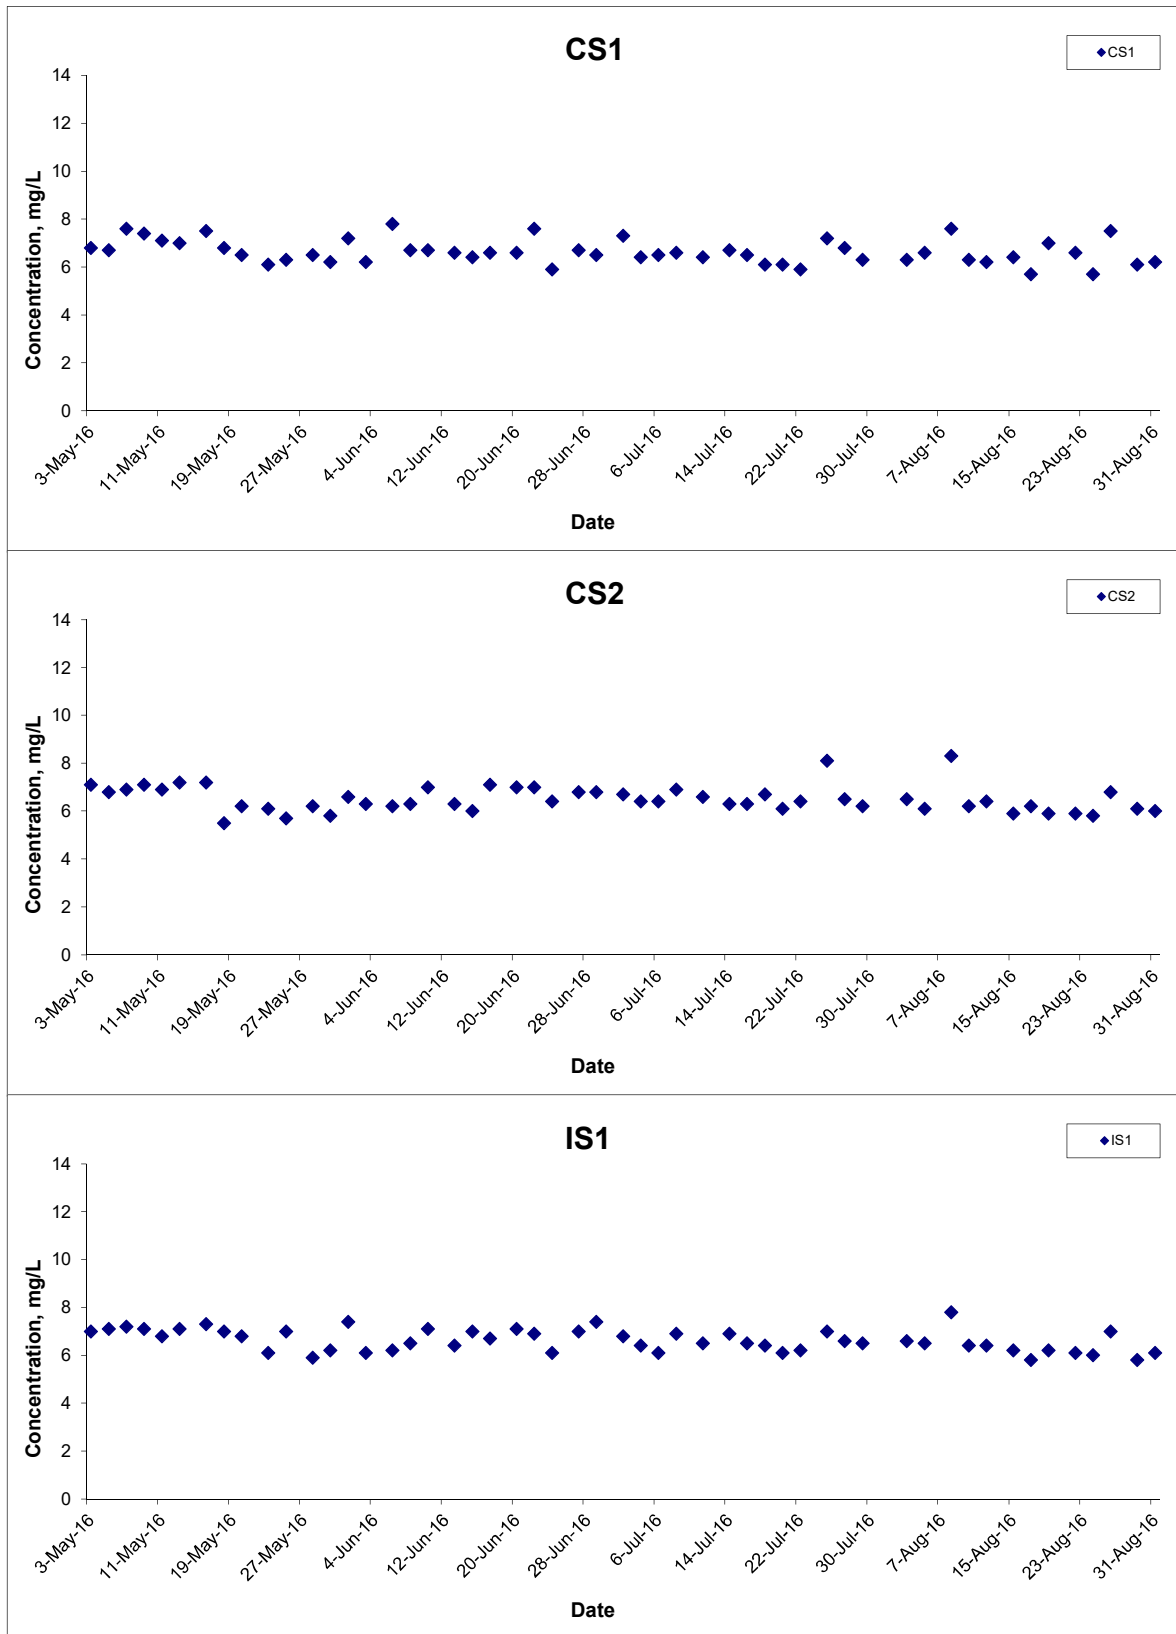


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

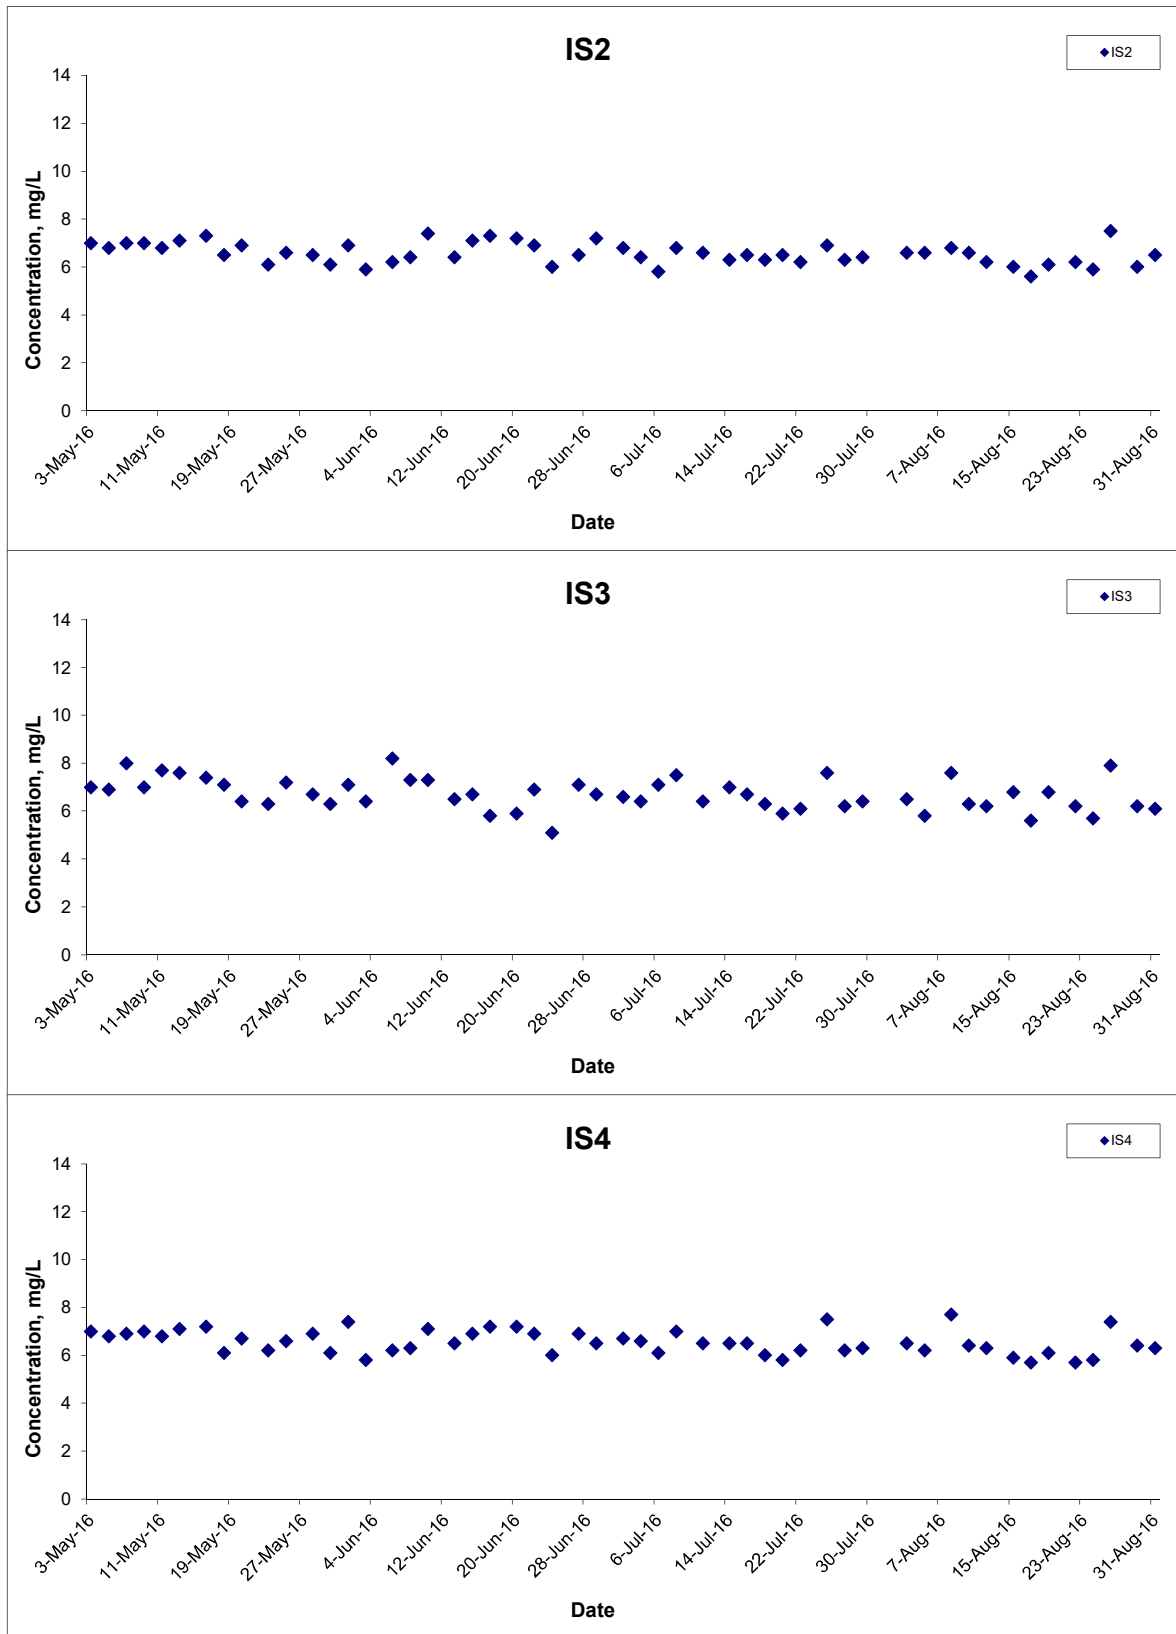


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

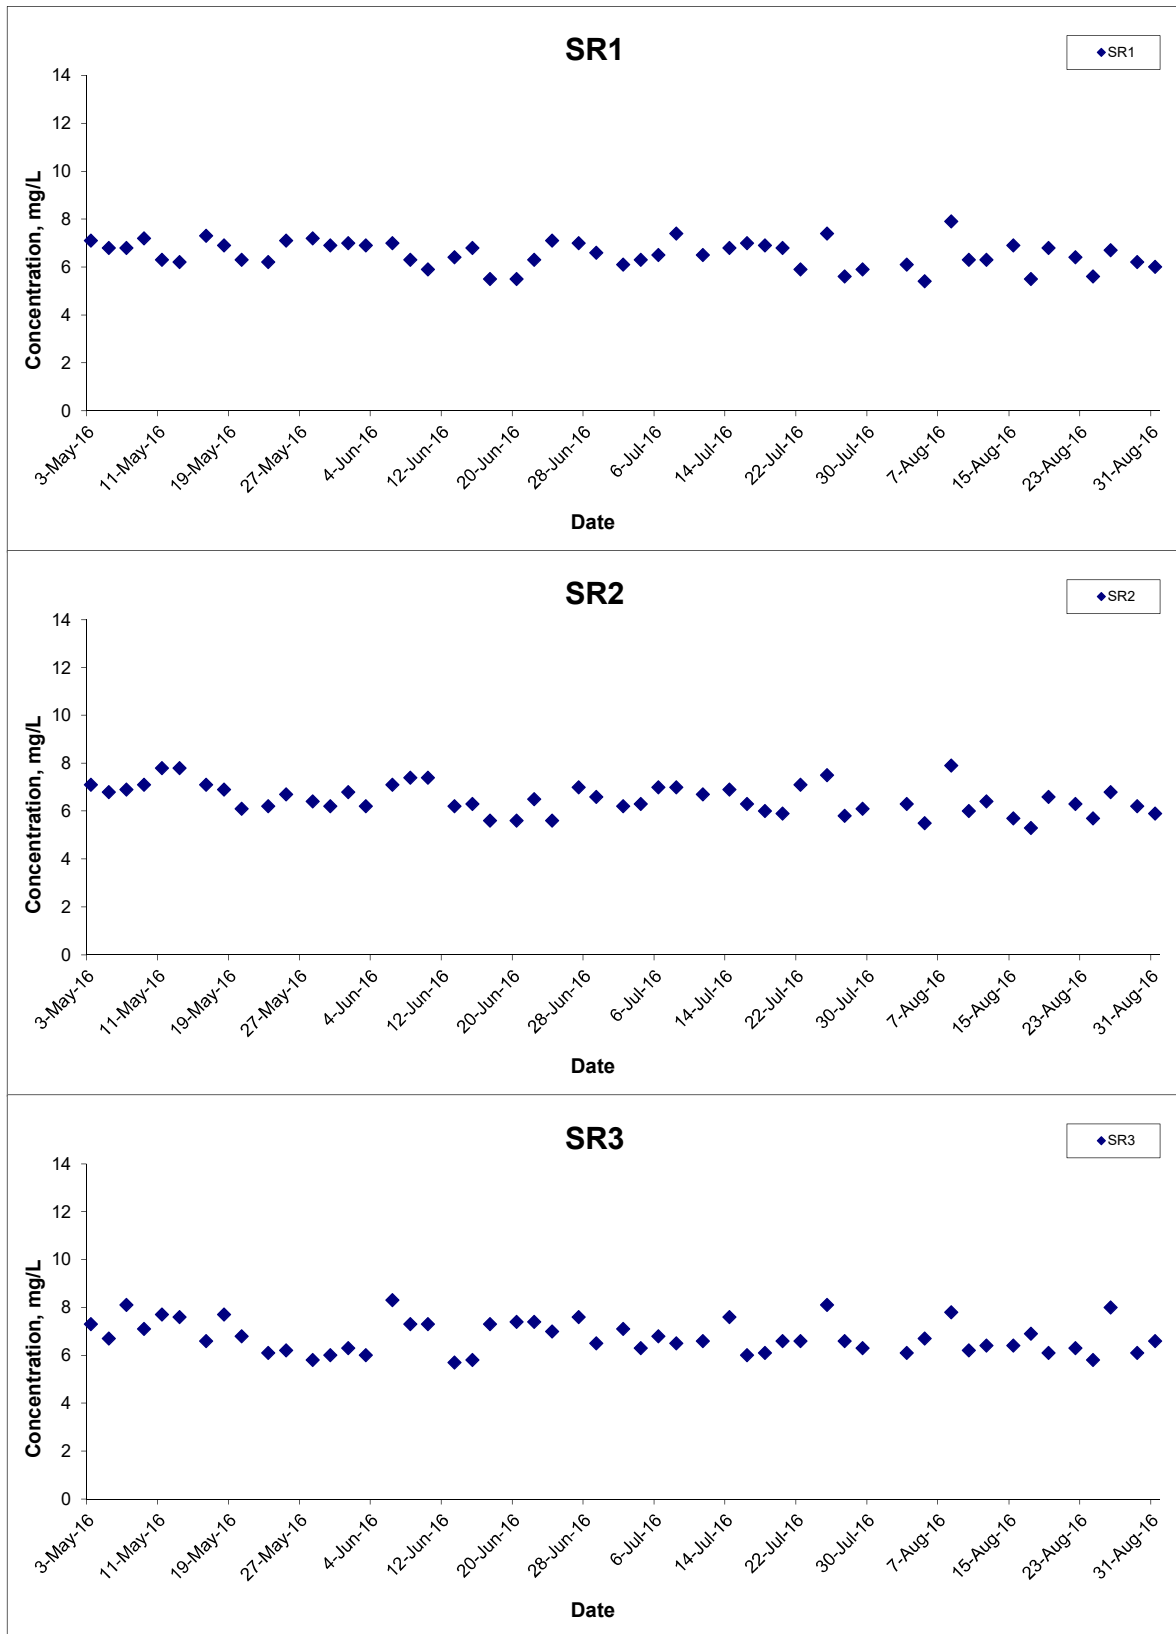


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

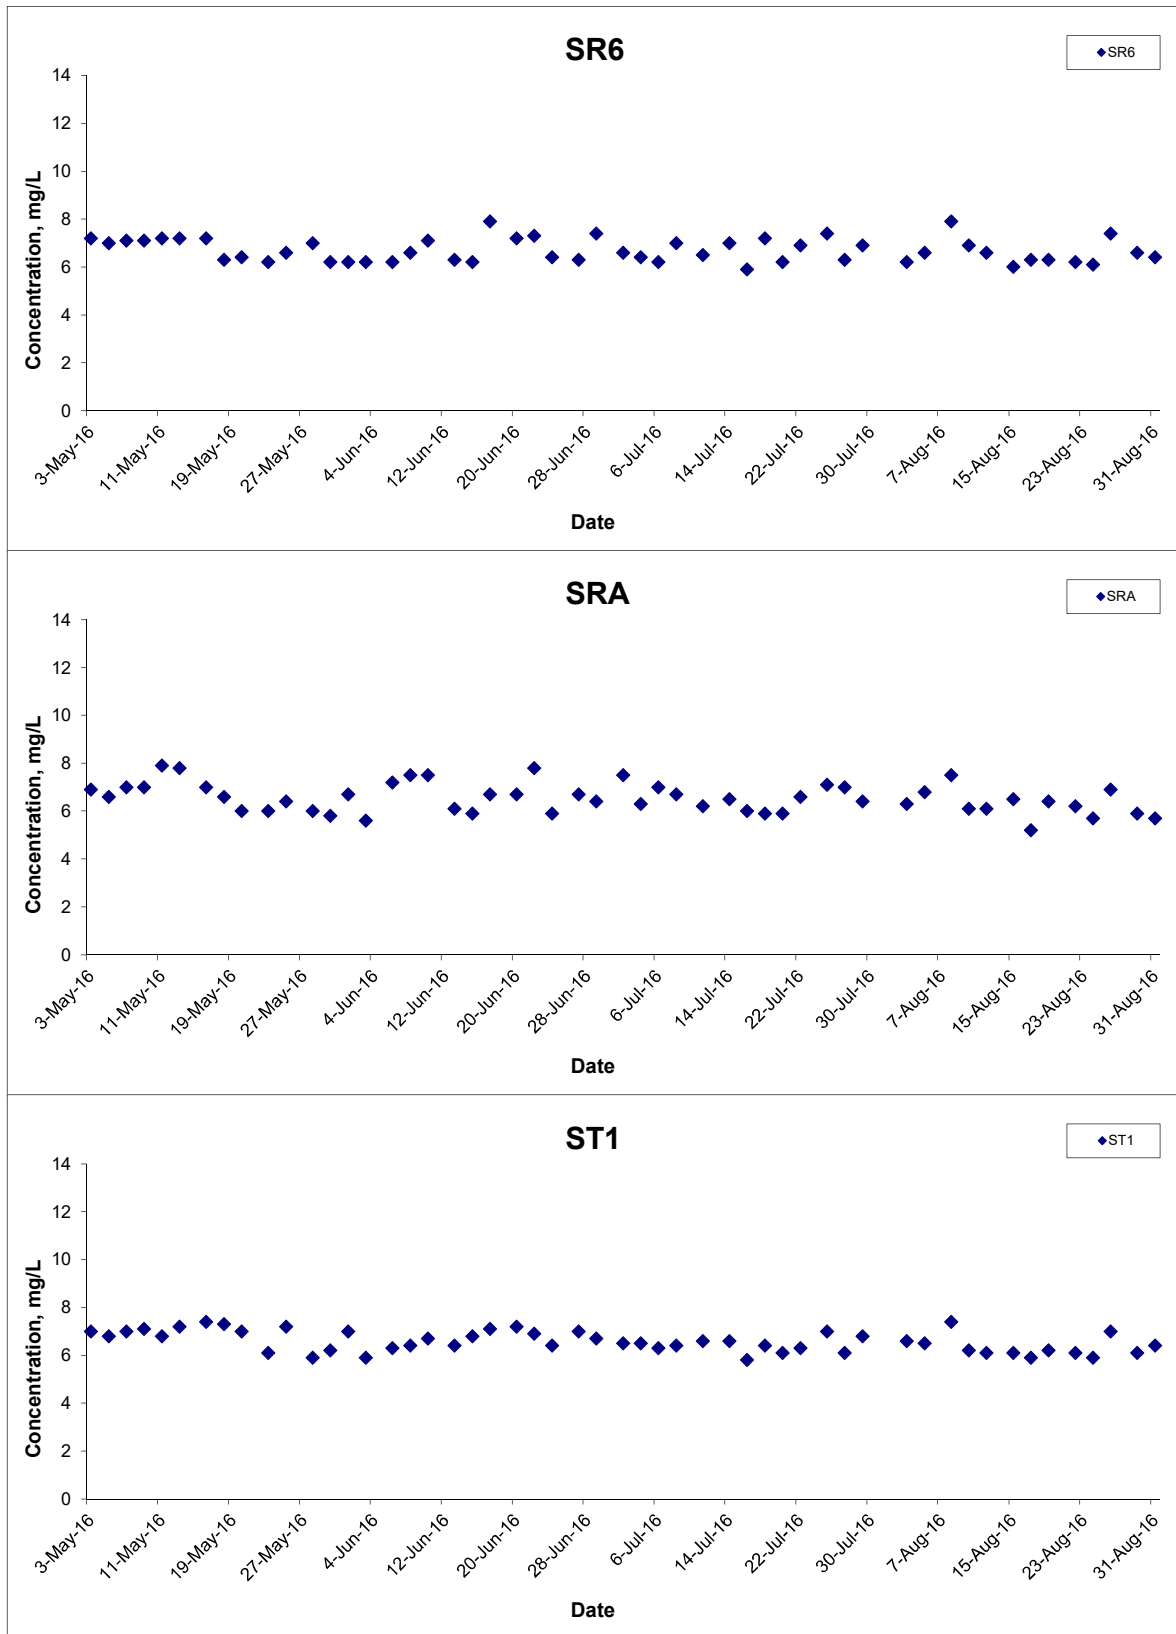


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H




Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

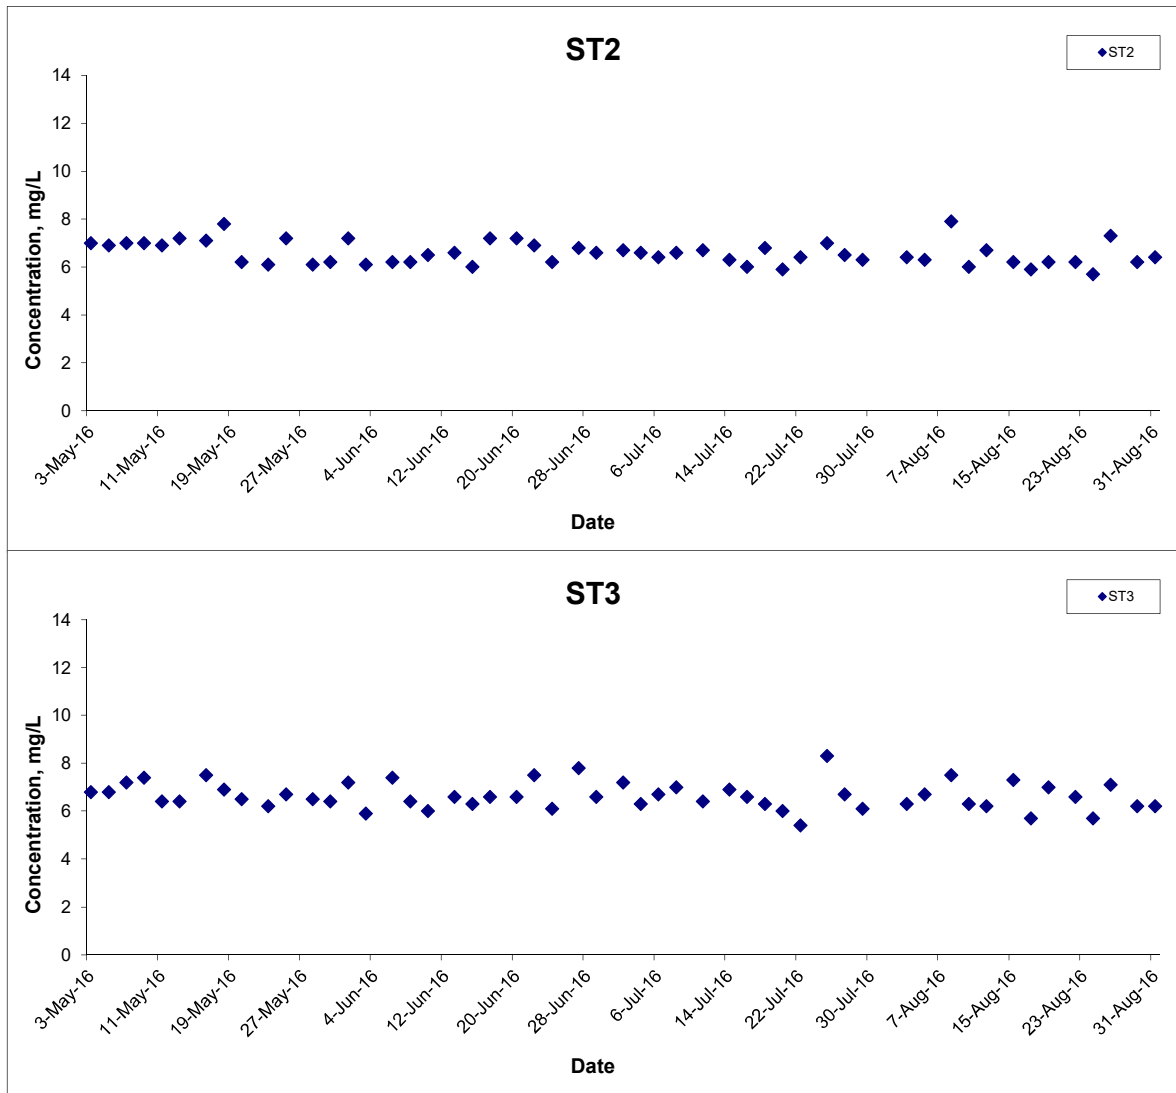

Title	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill	Scale	N.T.S	Project No.	MA12014	CINOTECH
	Graphical Presentation of Water Quality Monitoring Results	Date	Aug 16	Appendix	H	

Dissolved Oxygen (Bottom) at Mid-Ebb Tide

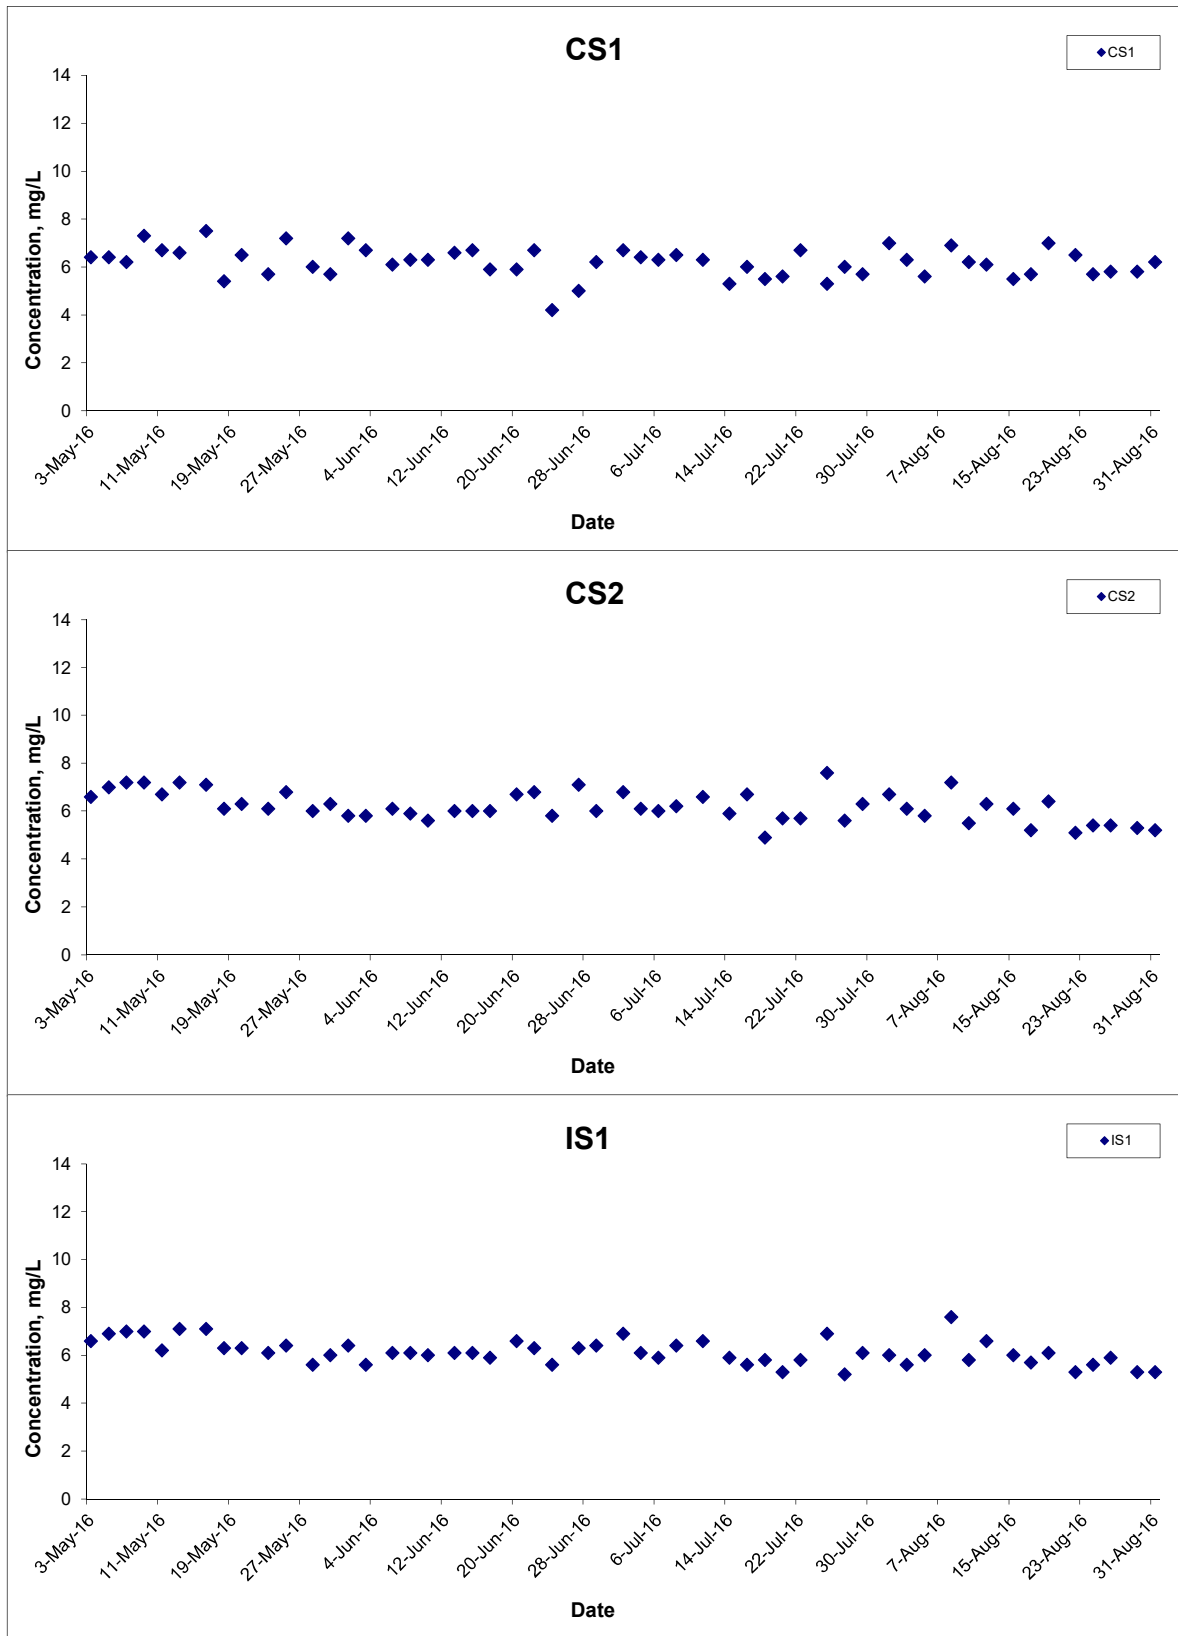


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Ebb Tide

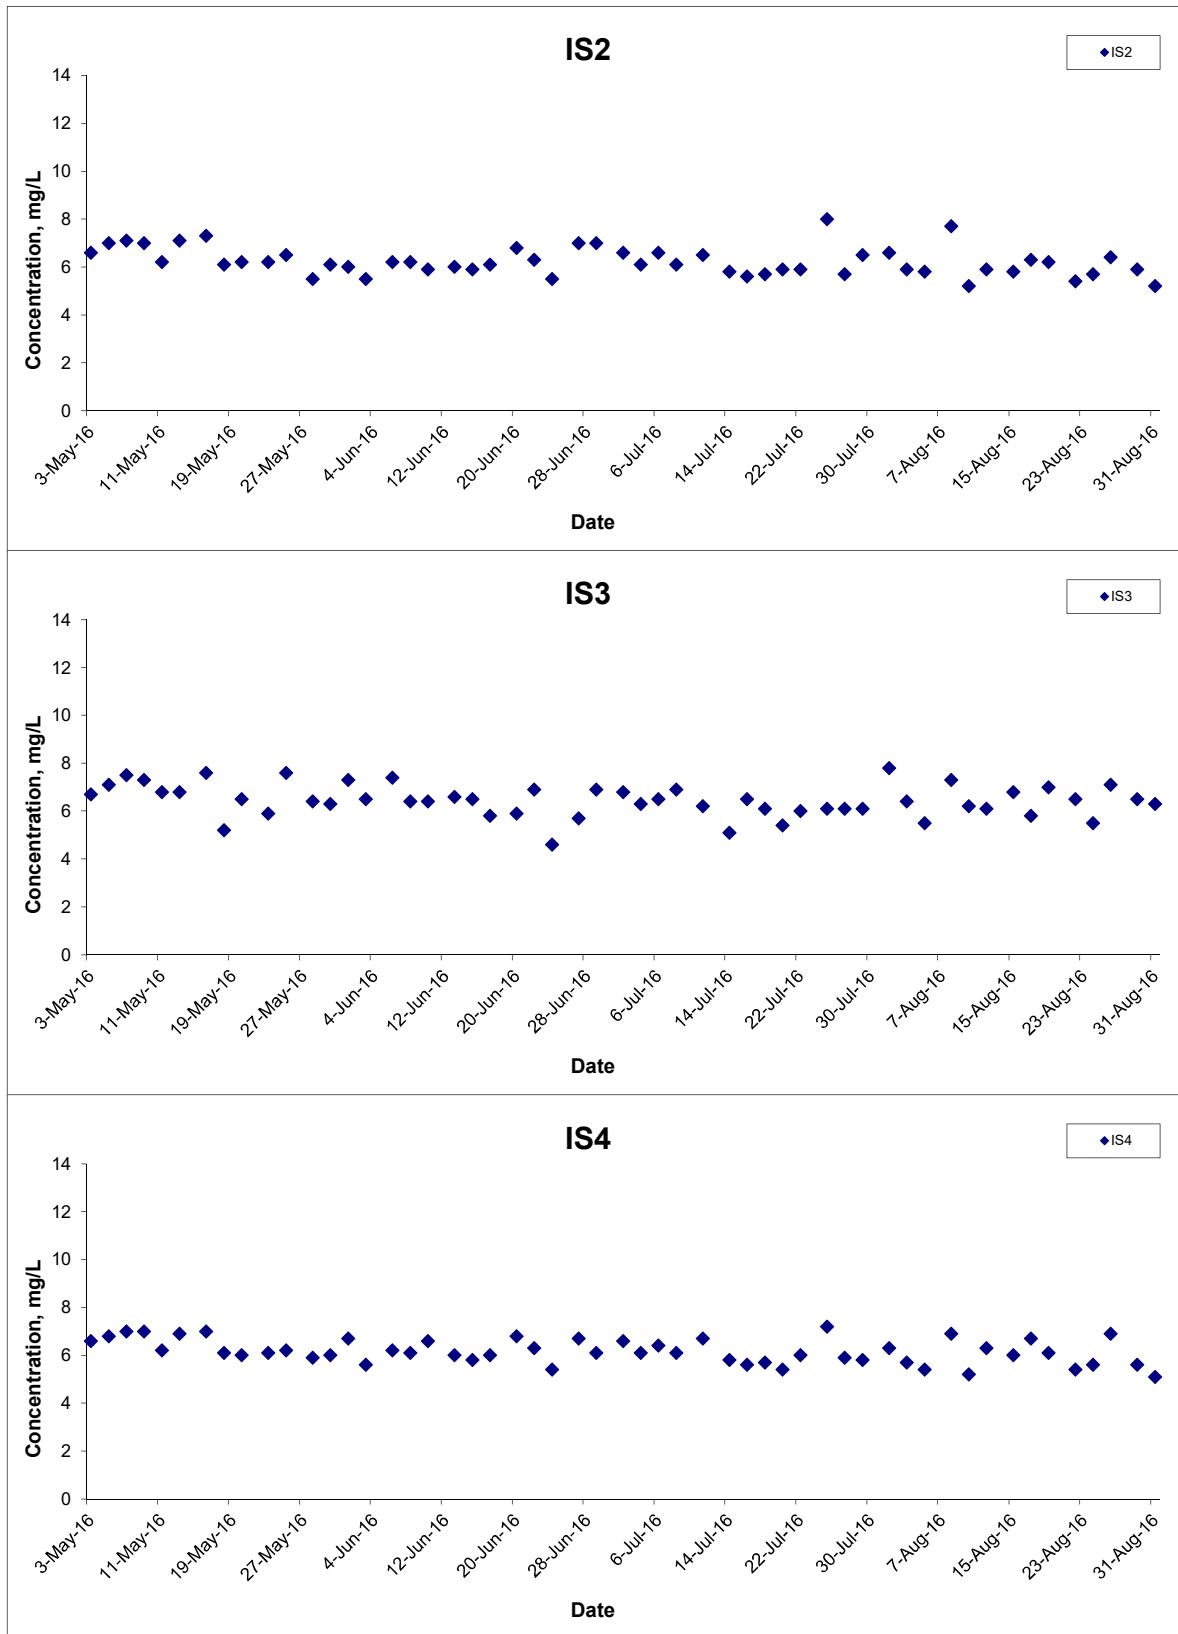


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Ebb Tide

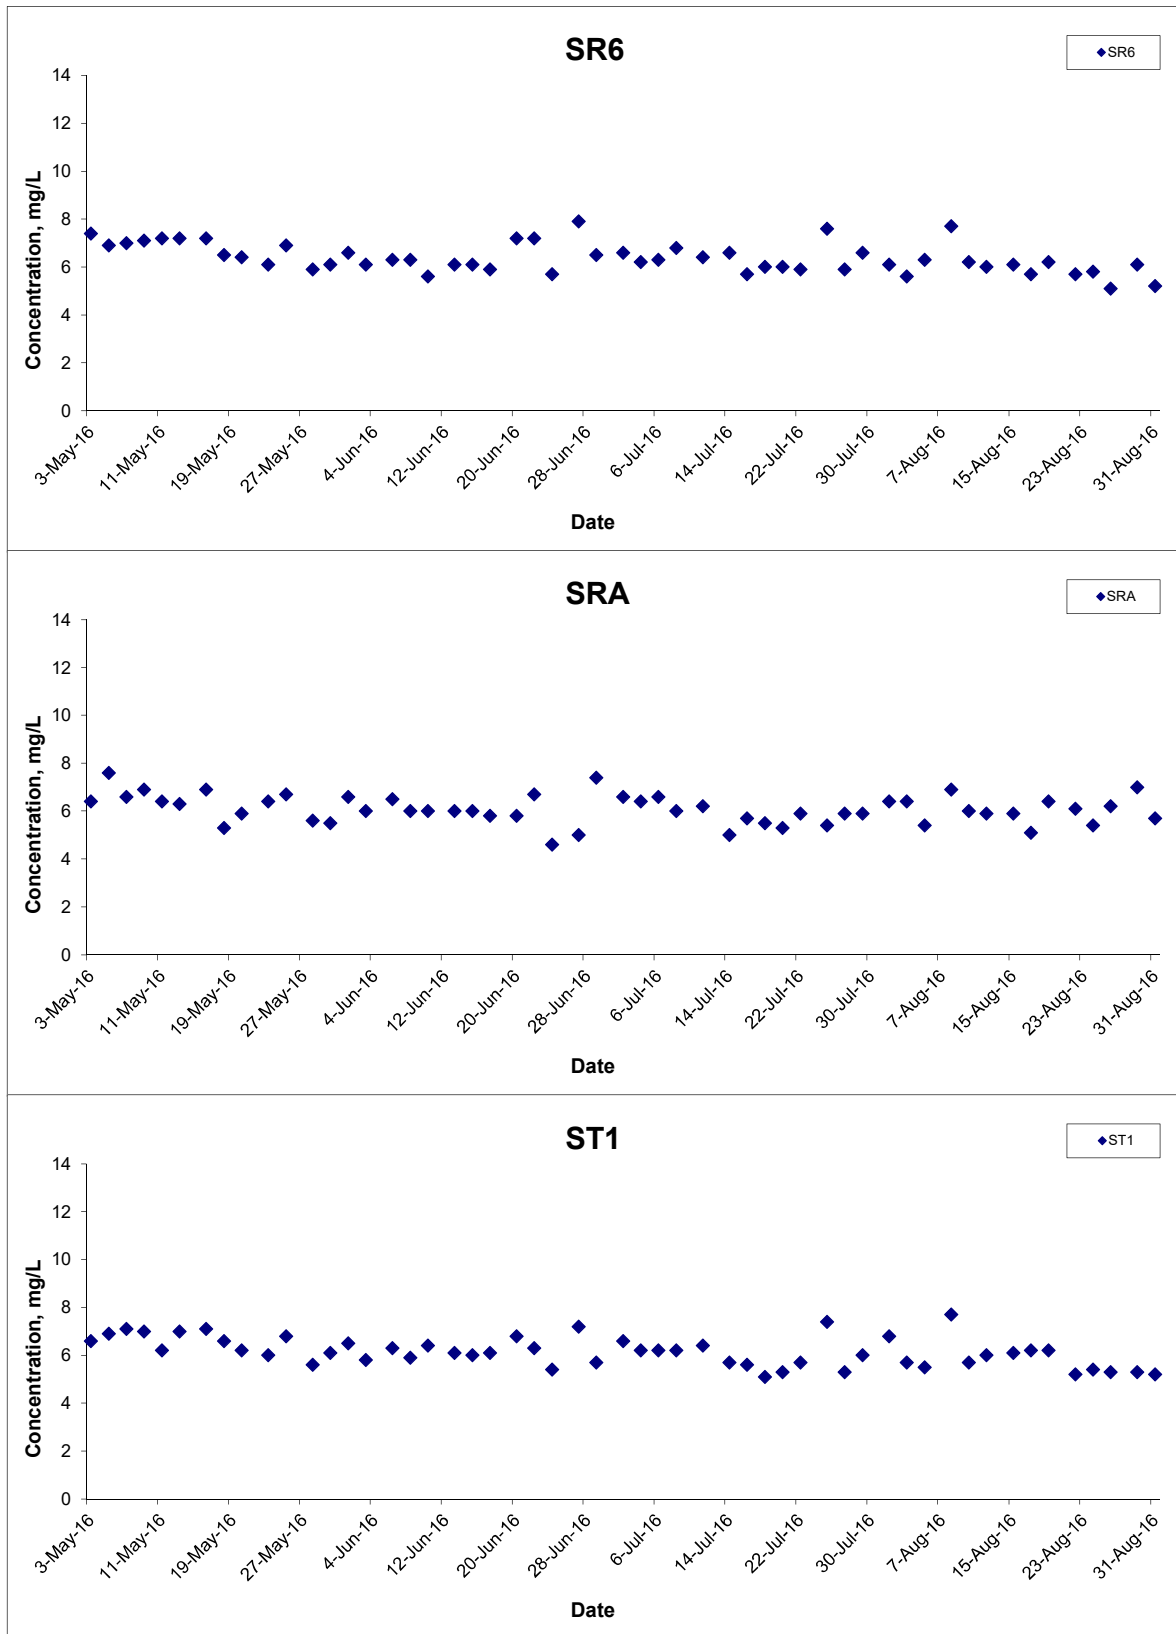


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Ebb Tide

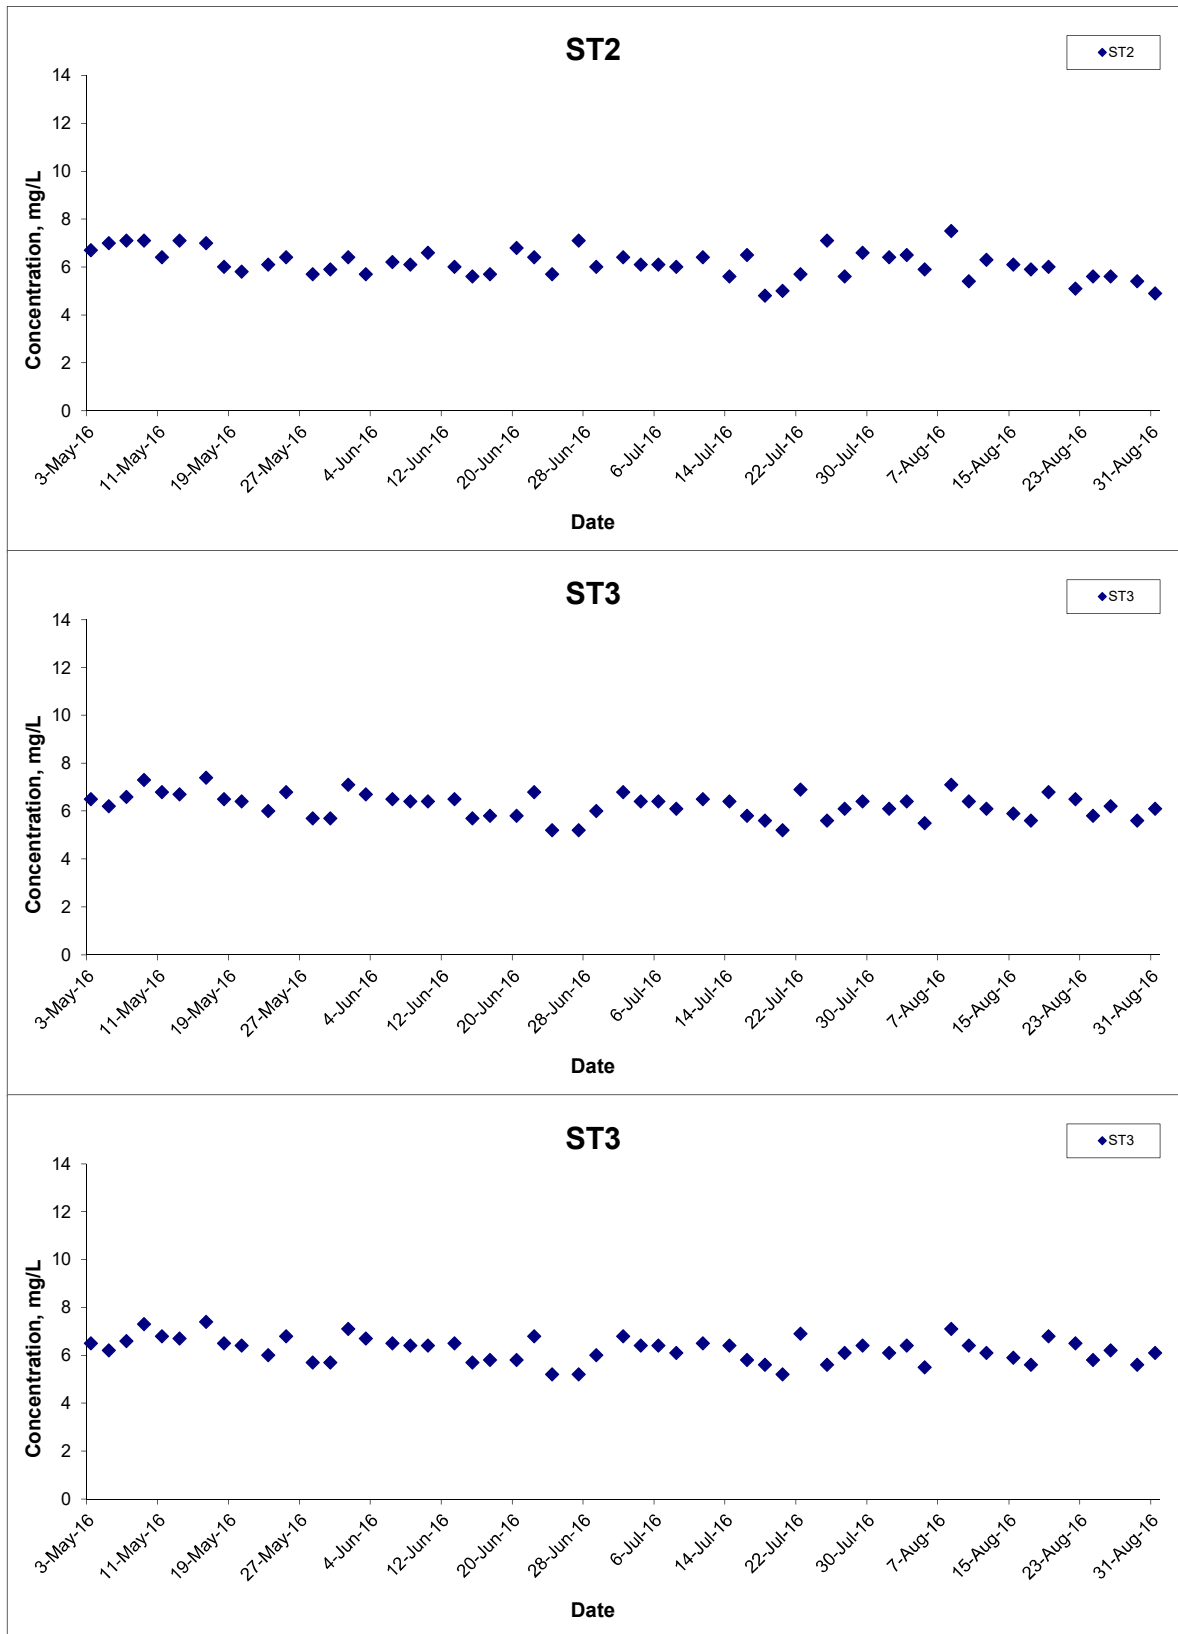


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Flood Tide

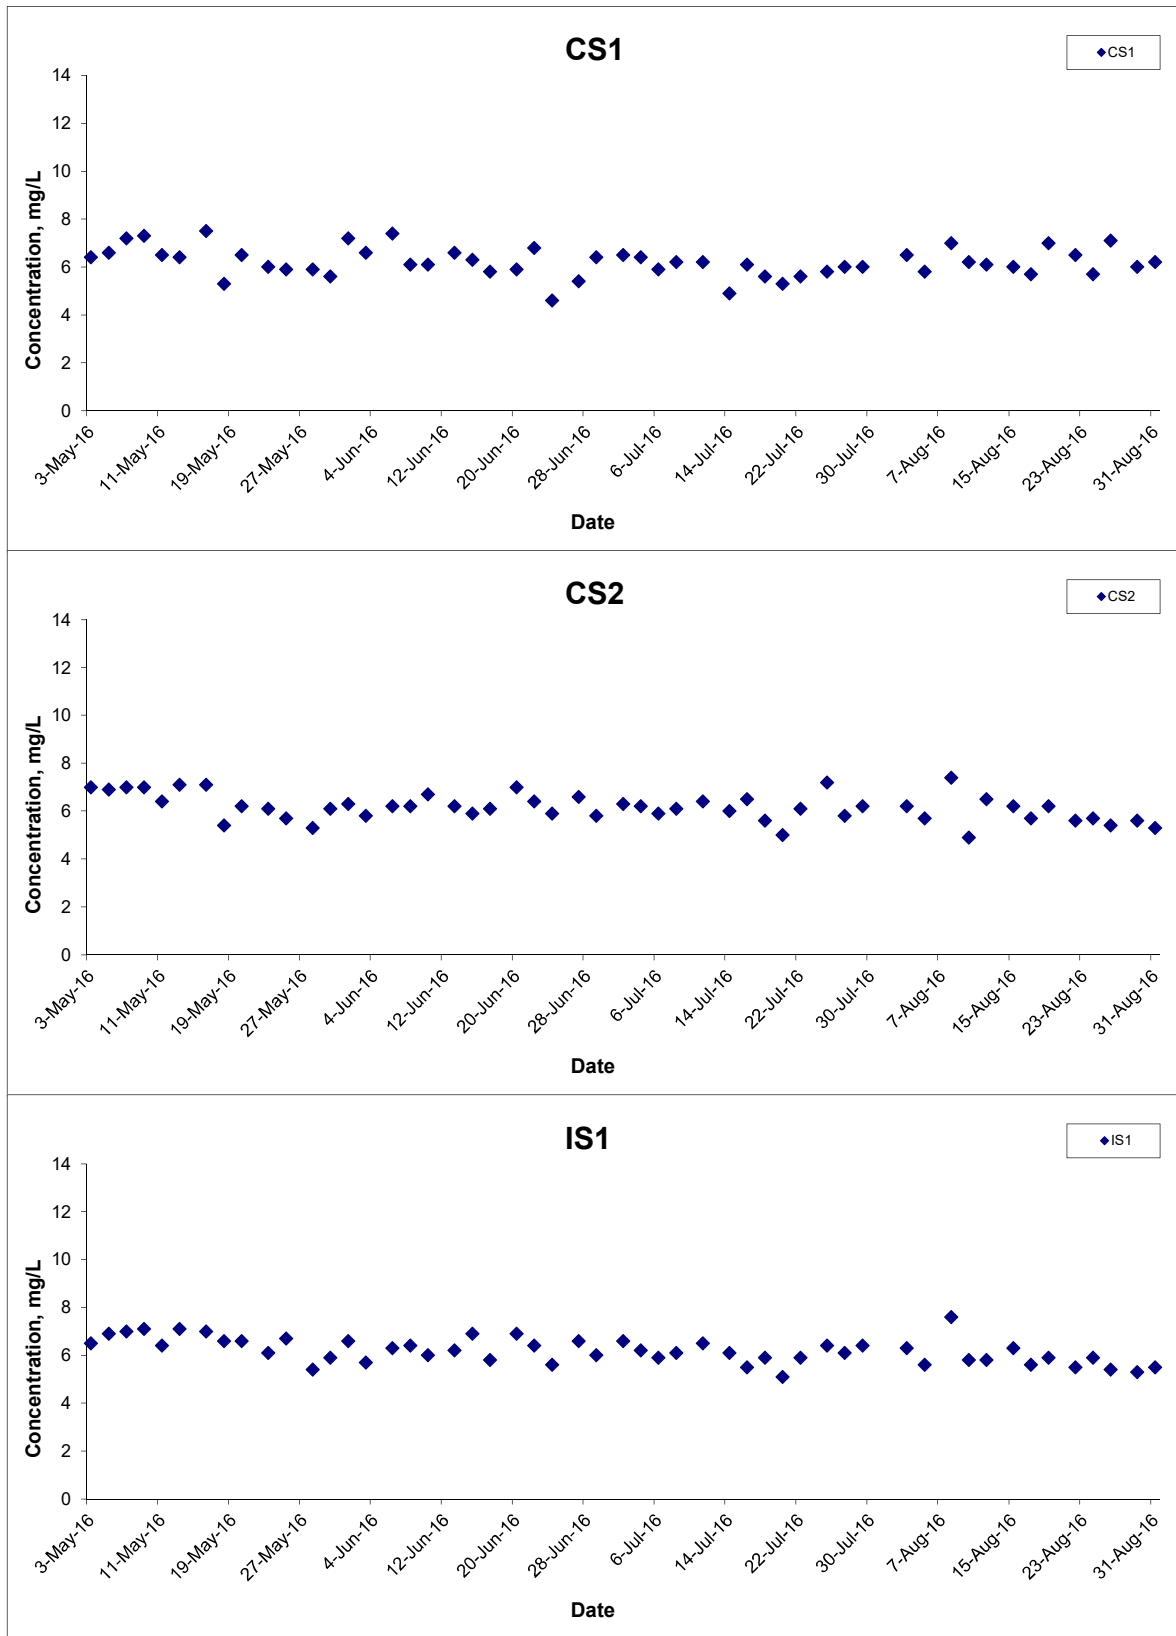


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
Date Aug 16

Project No. MA12014
Appendix H



Dissolved Oxygen (Bottom) at Mid-Flood Tide

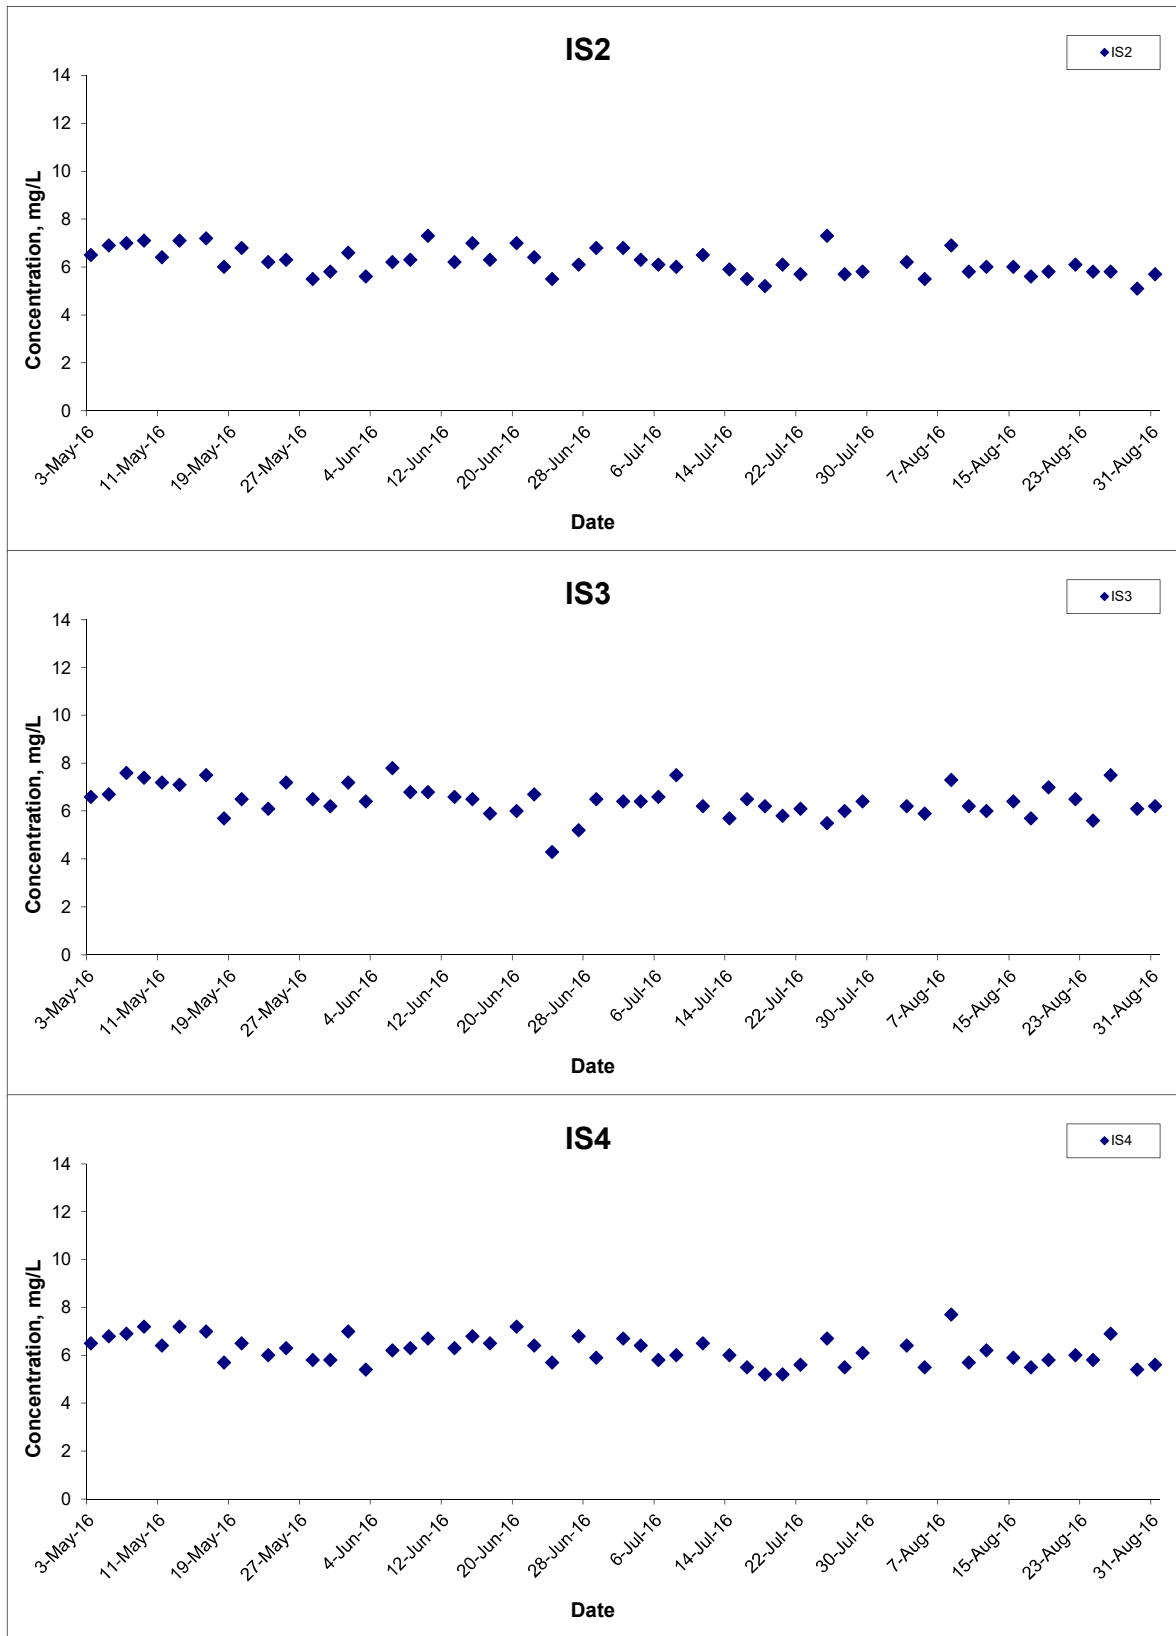


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Dissolved Oxygen (Bottom) at Mid-Flood Tide

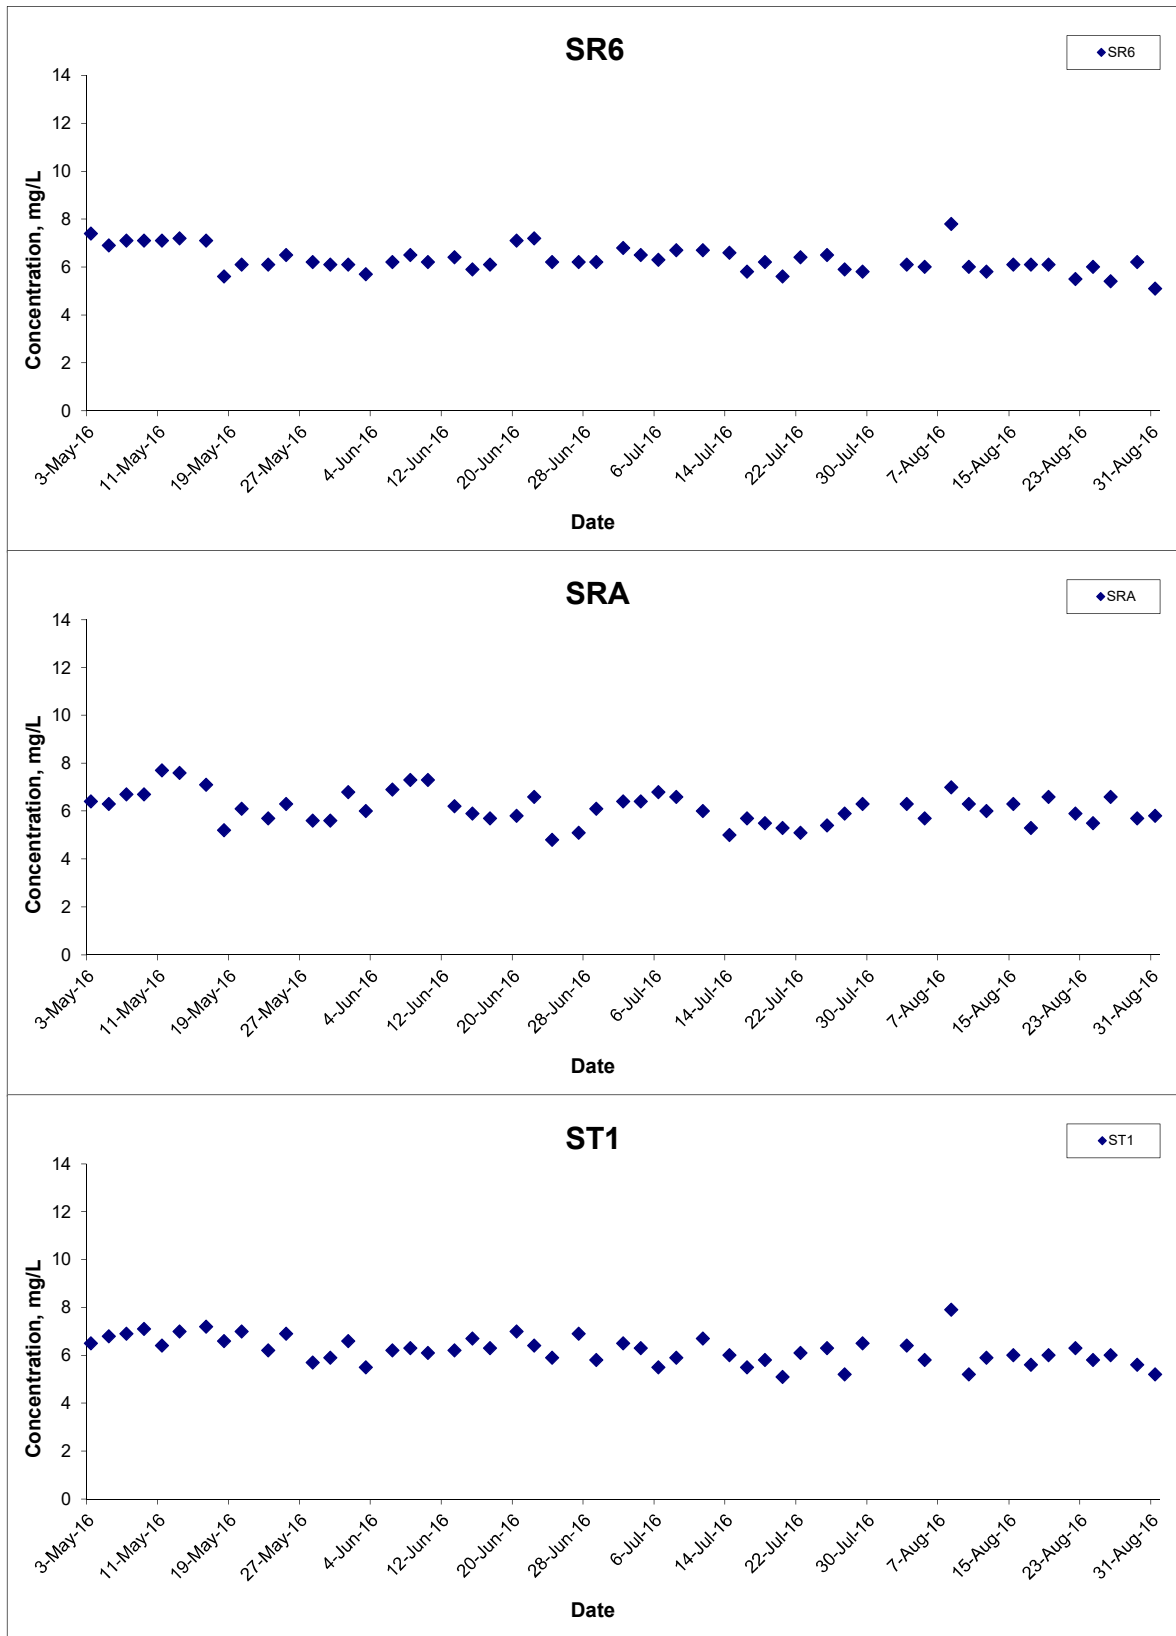


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H




Dissolved Oxygen (Bottom) at Mid-Flood Tide

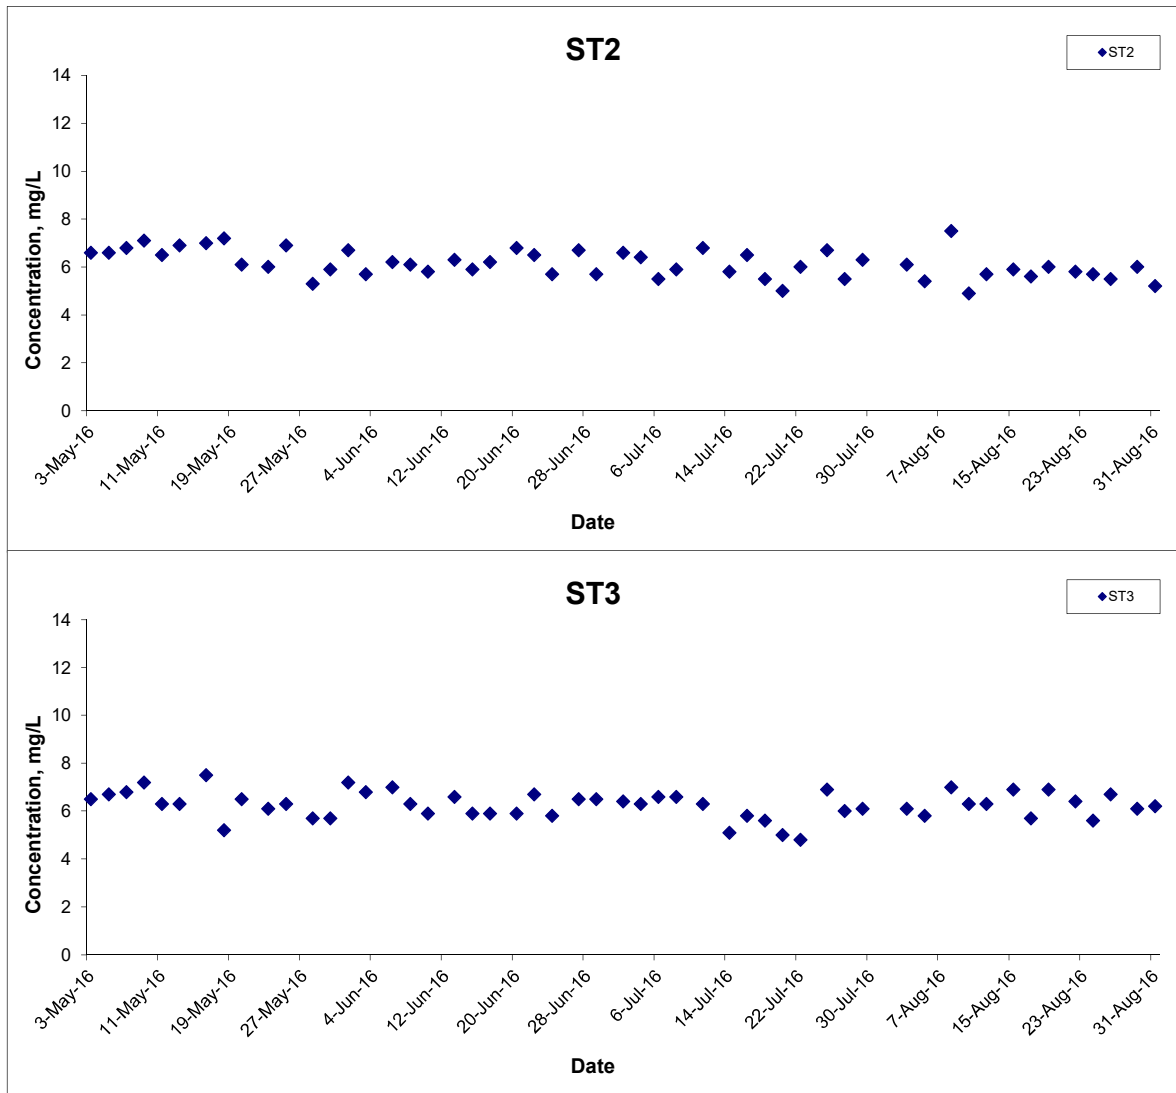

Title	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill	Scale	N.T.S	Project No.	MA12014	CINOTECH
	Graphical Presentation of Water Quality Monitoring Results	Date	Aug 16	Appendix	H	

Turbidity (Depth-averaged) at Mid-Ebb Tide

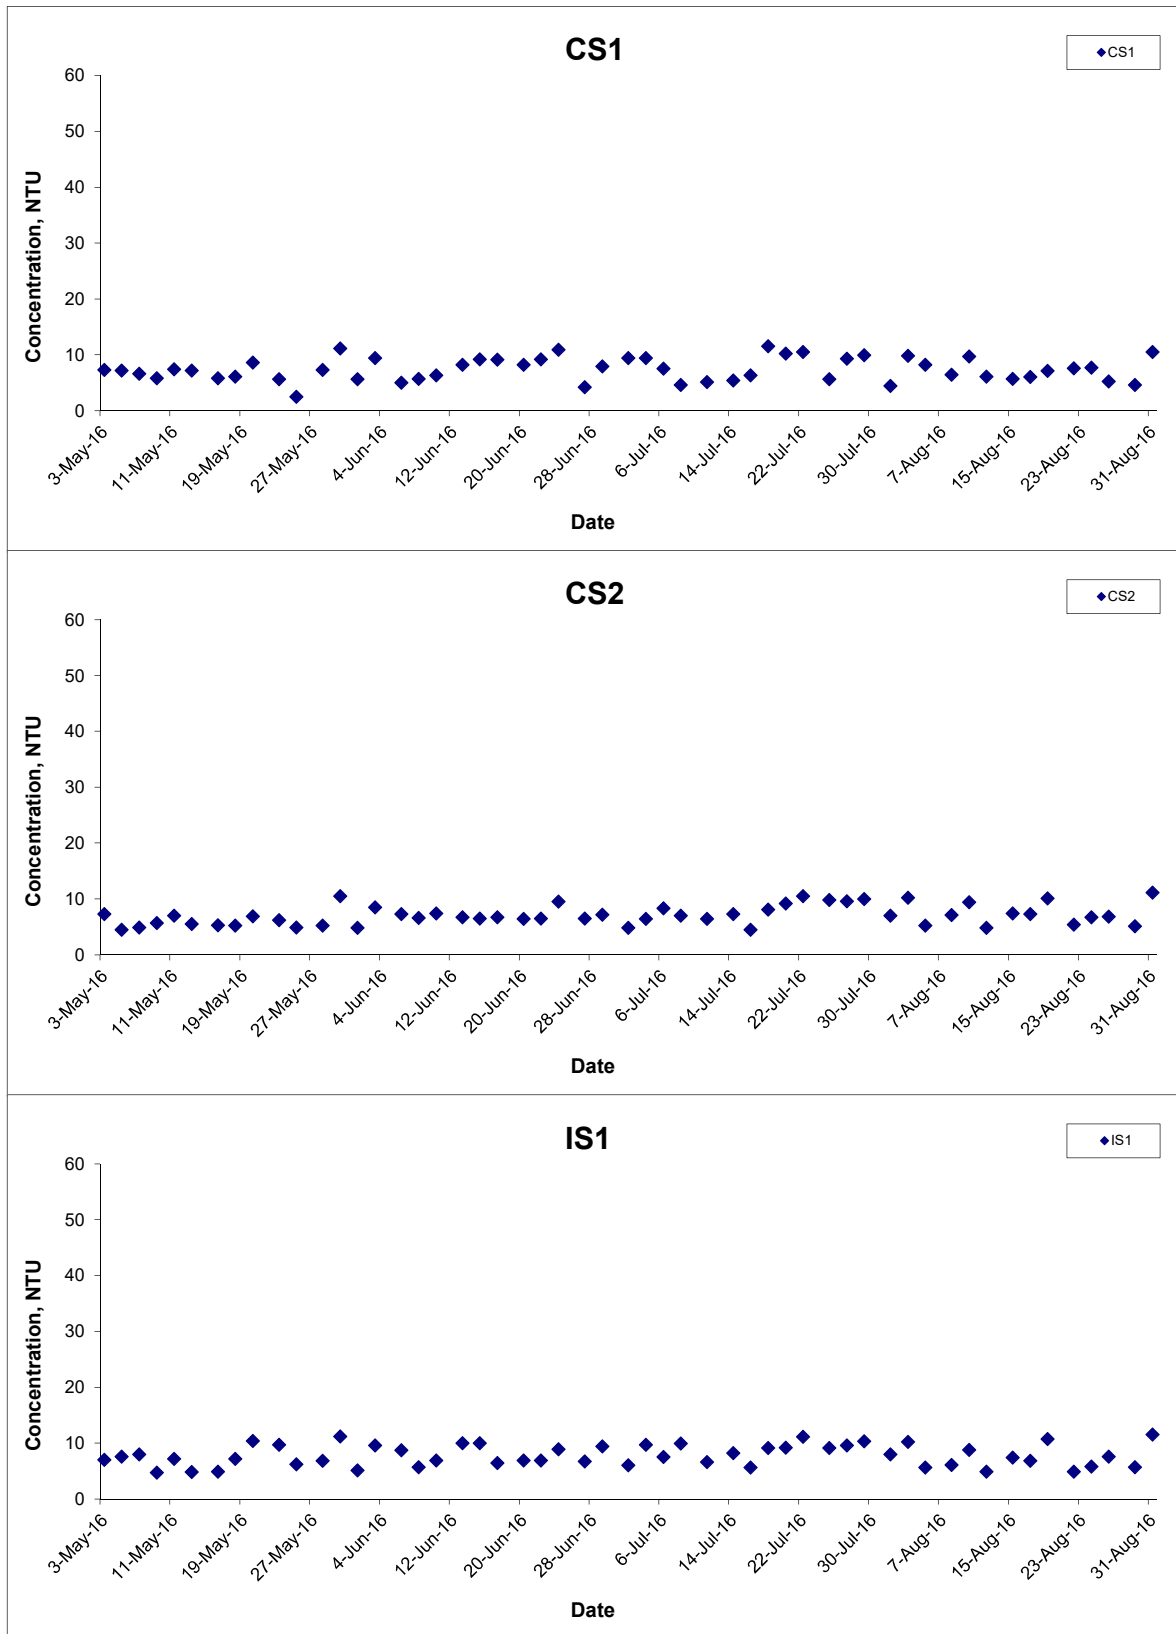


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Ebb Tide

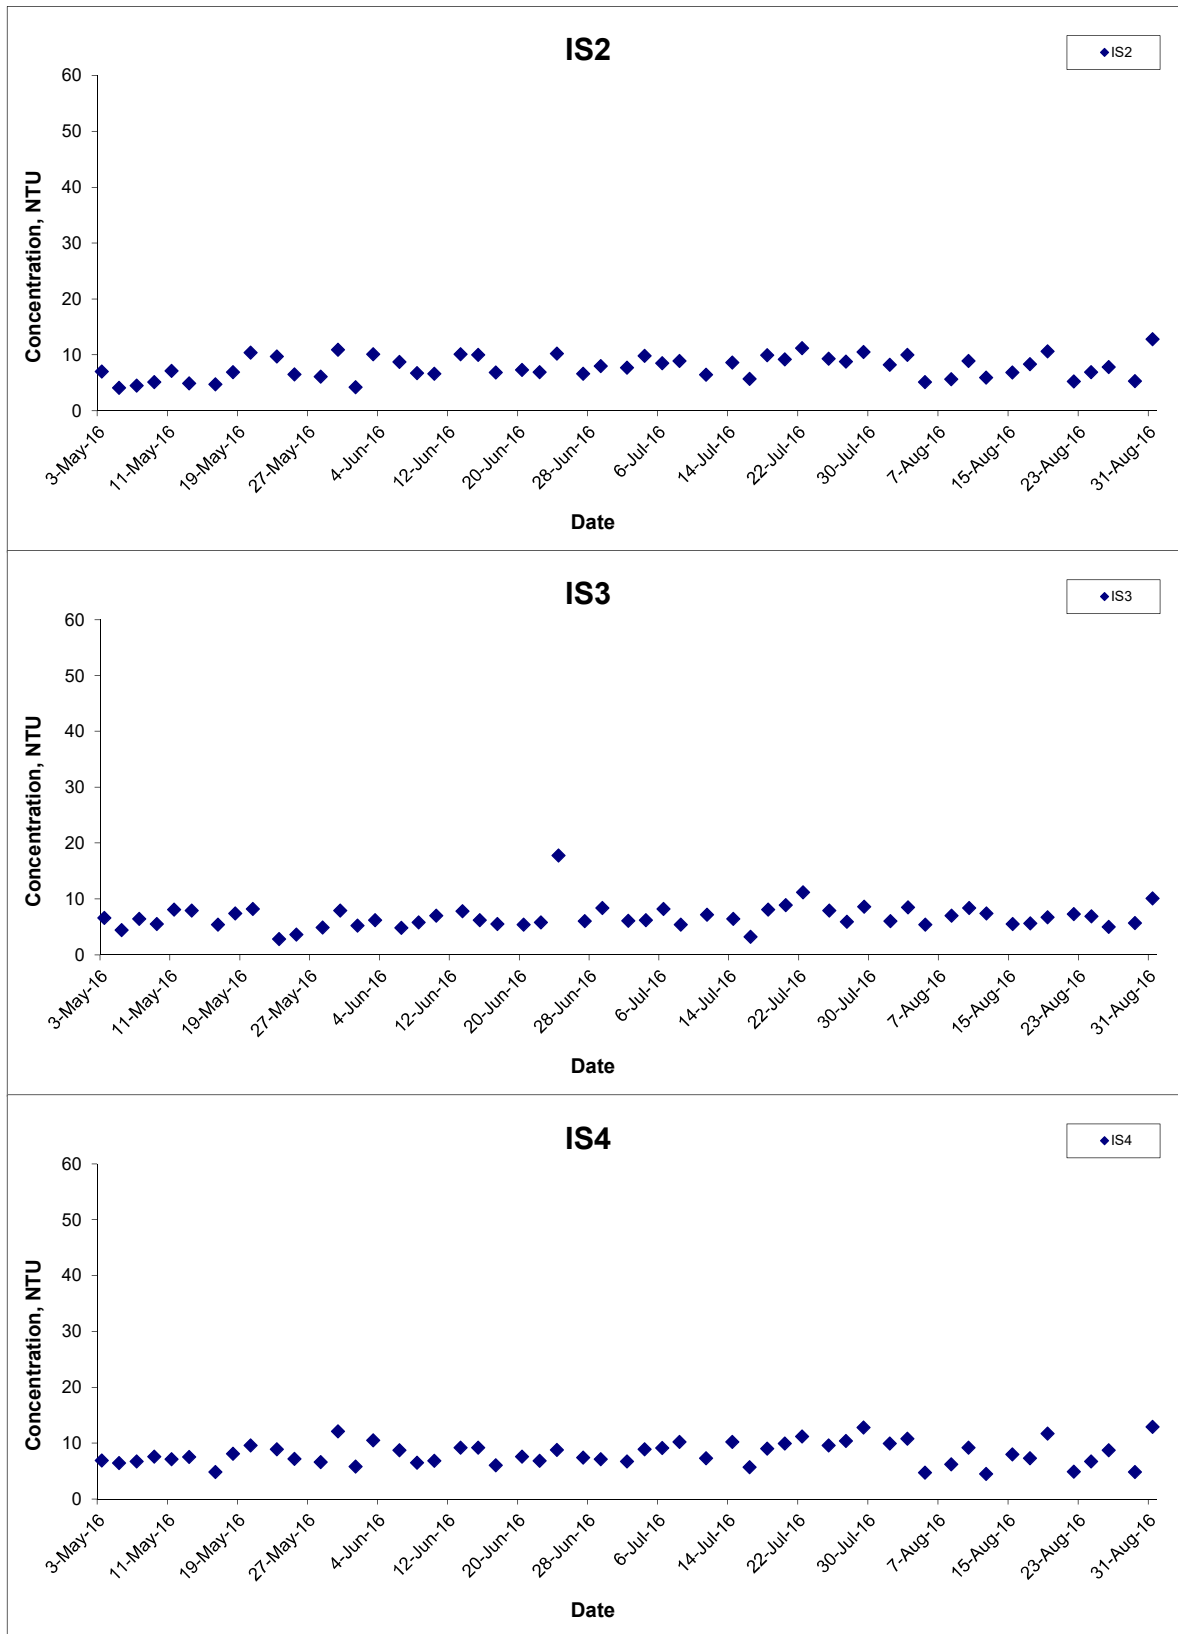


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Ebb Tide

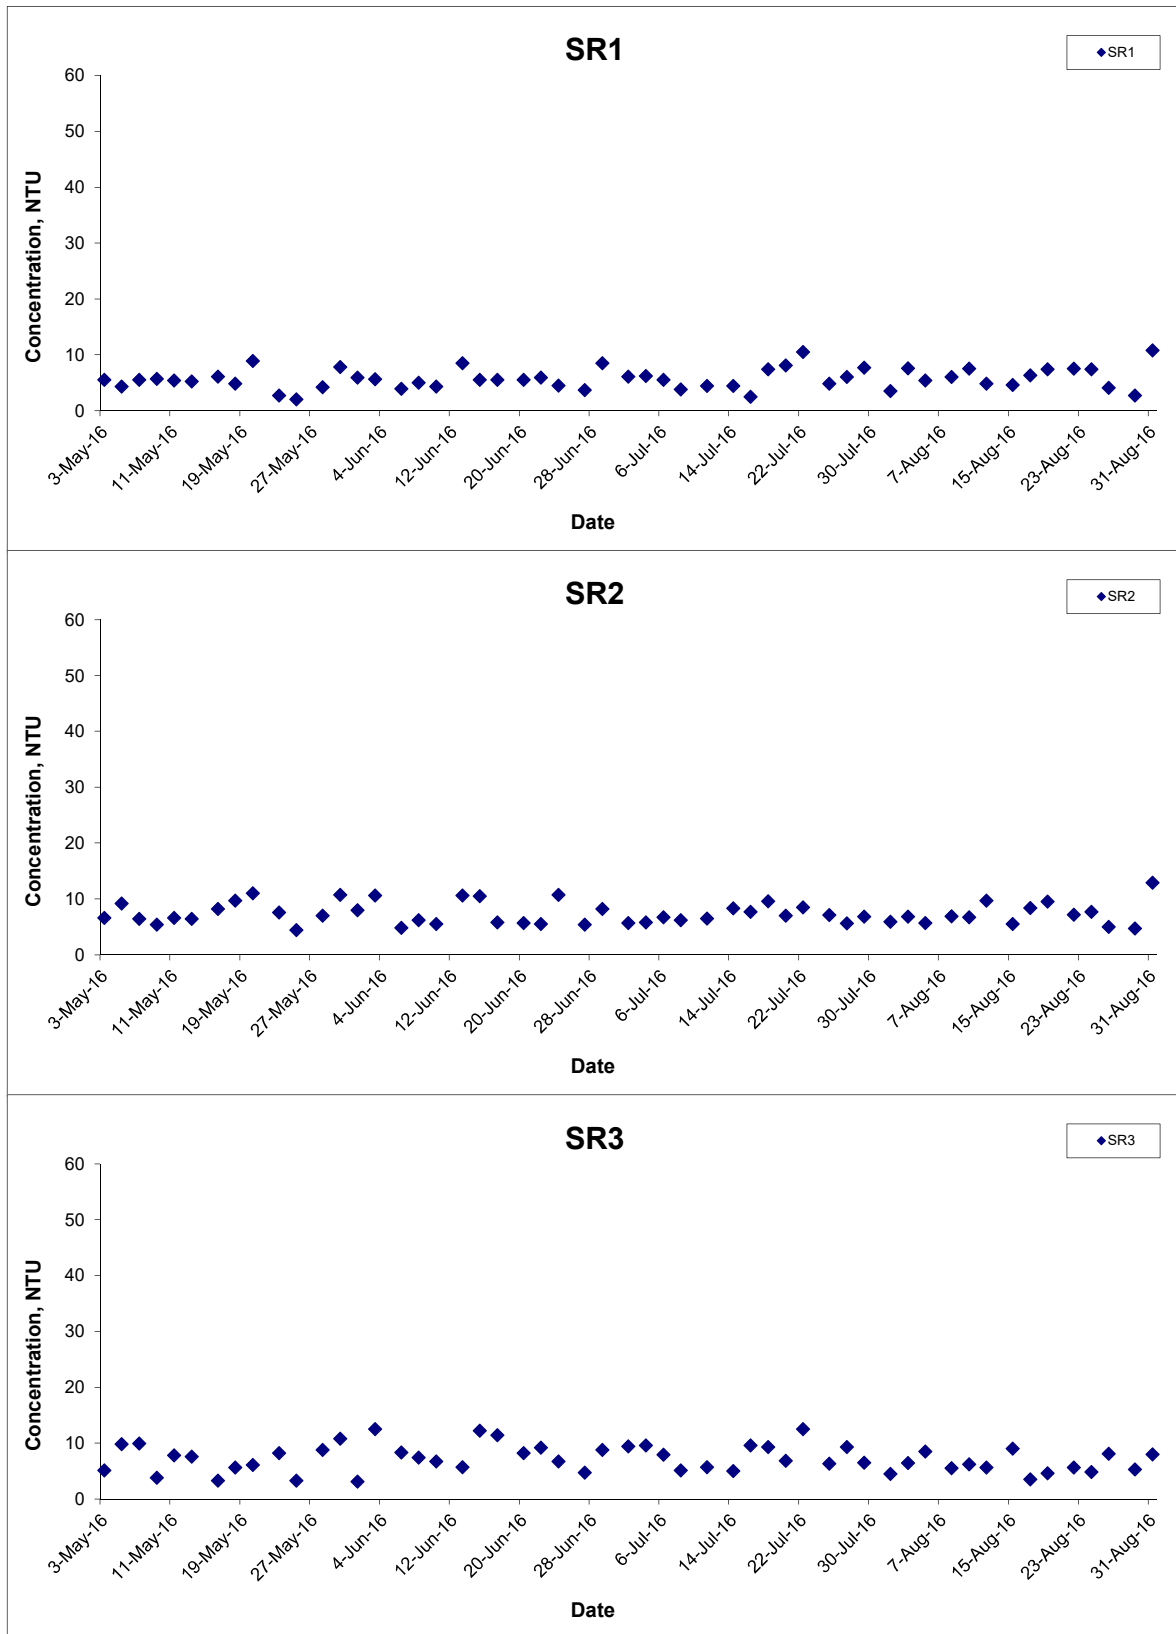


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Ebb Tide

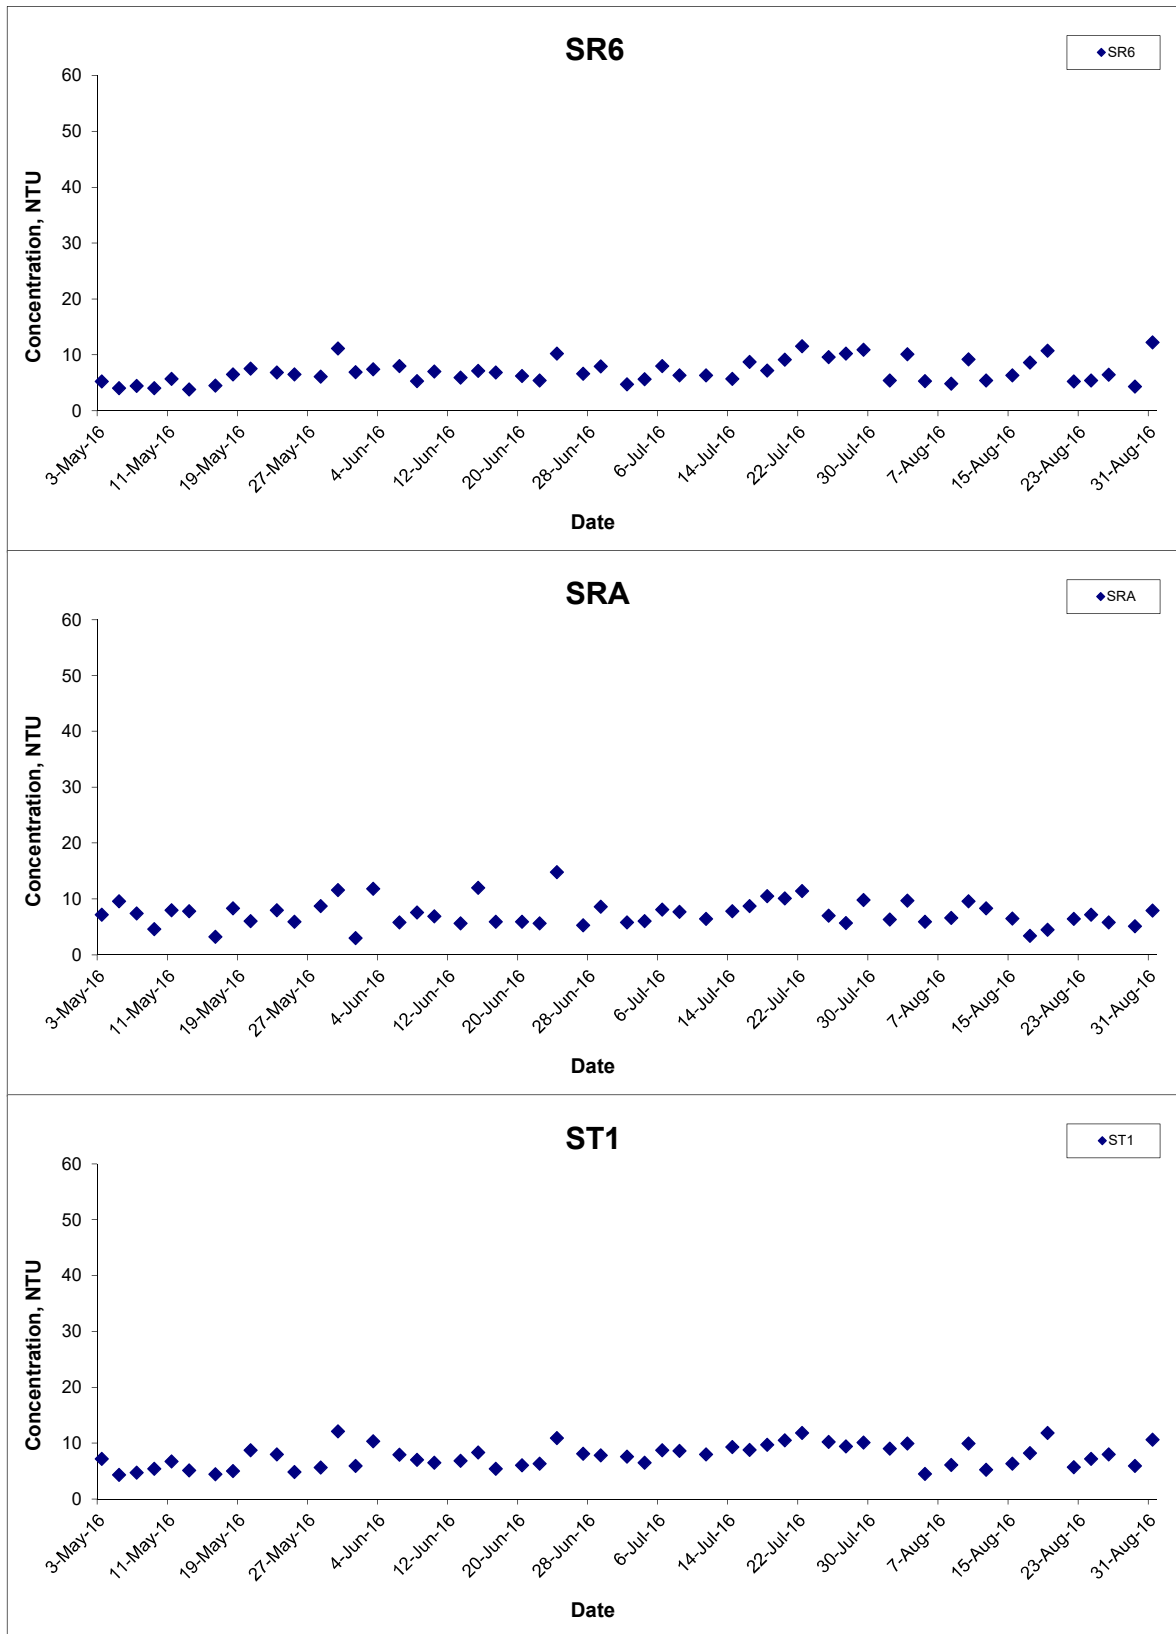


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
Date Aug 16

Project No. MA12014
Appendix H




Turbidity (Depth-averaged) at Mid-Ebb Tide

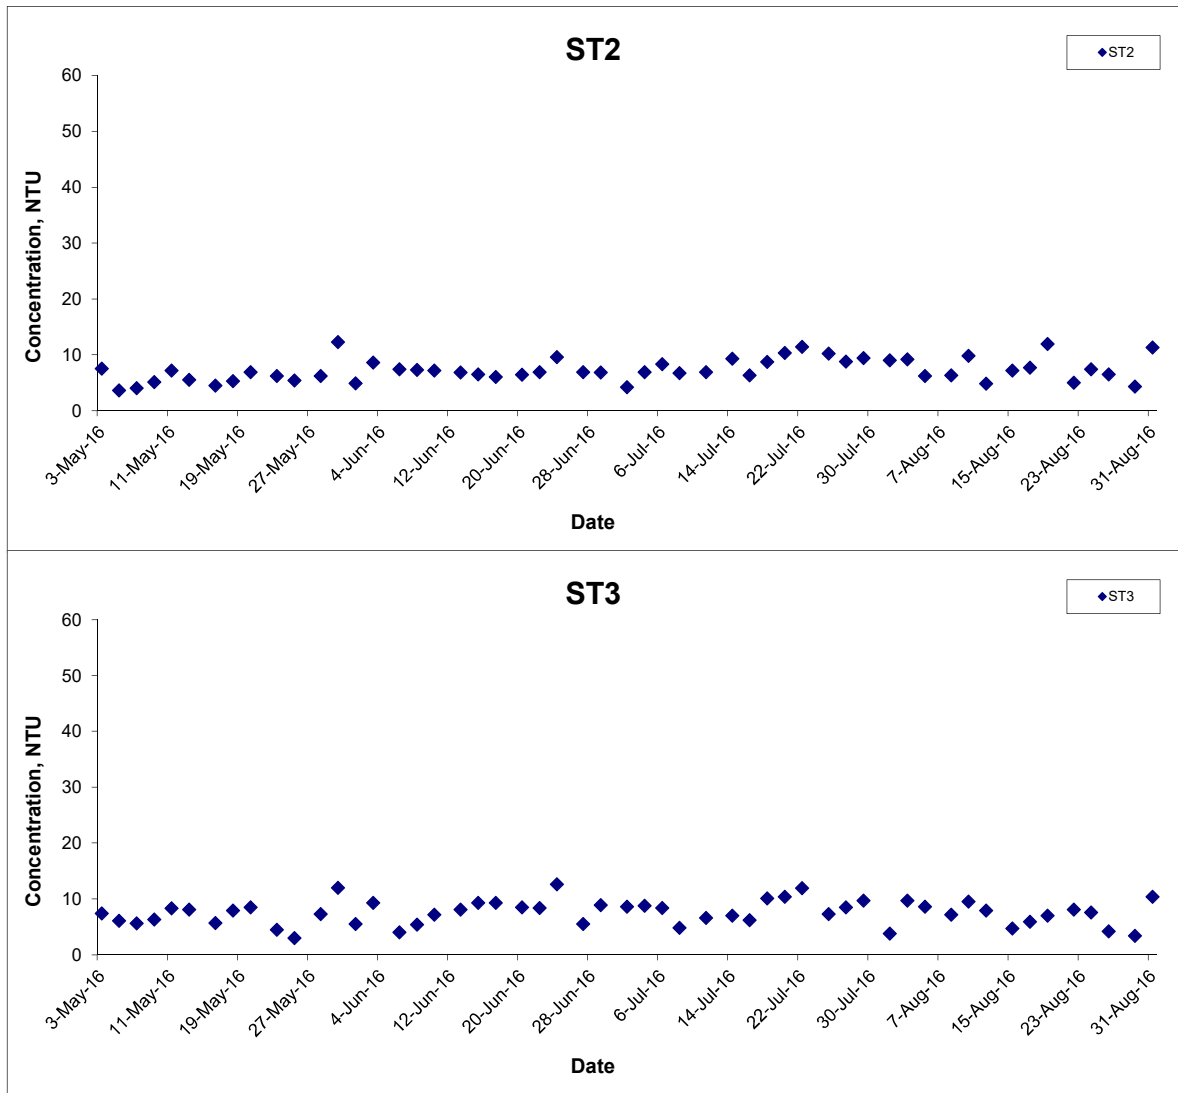

Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill Graphical Presentation of Water Quality Monitoring Results	Scale	N.T.S	Project No. MA12014	CINOTECH
	Date	Aug 16	Appendix H	

Turbidity (Depth-averaged) at Mid-Flood Tide

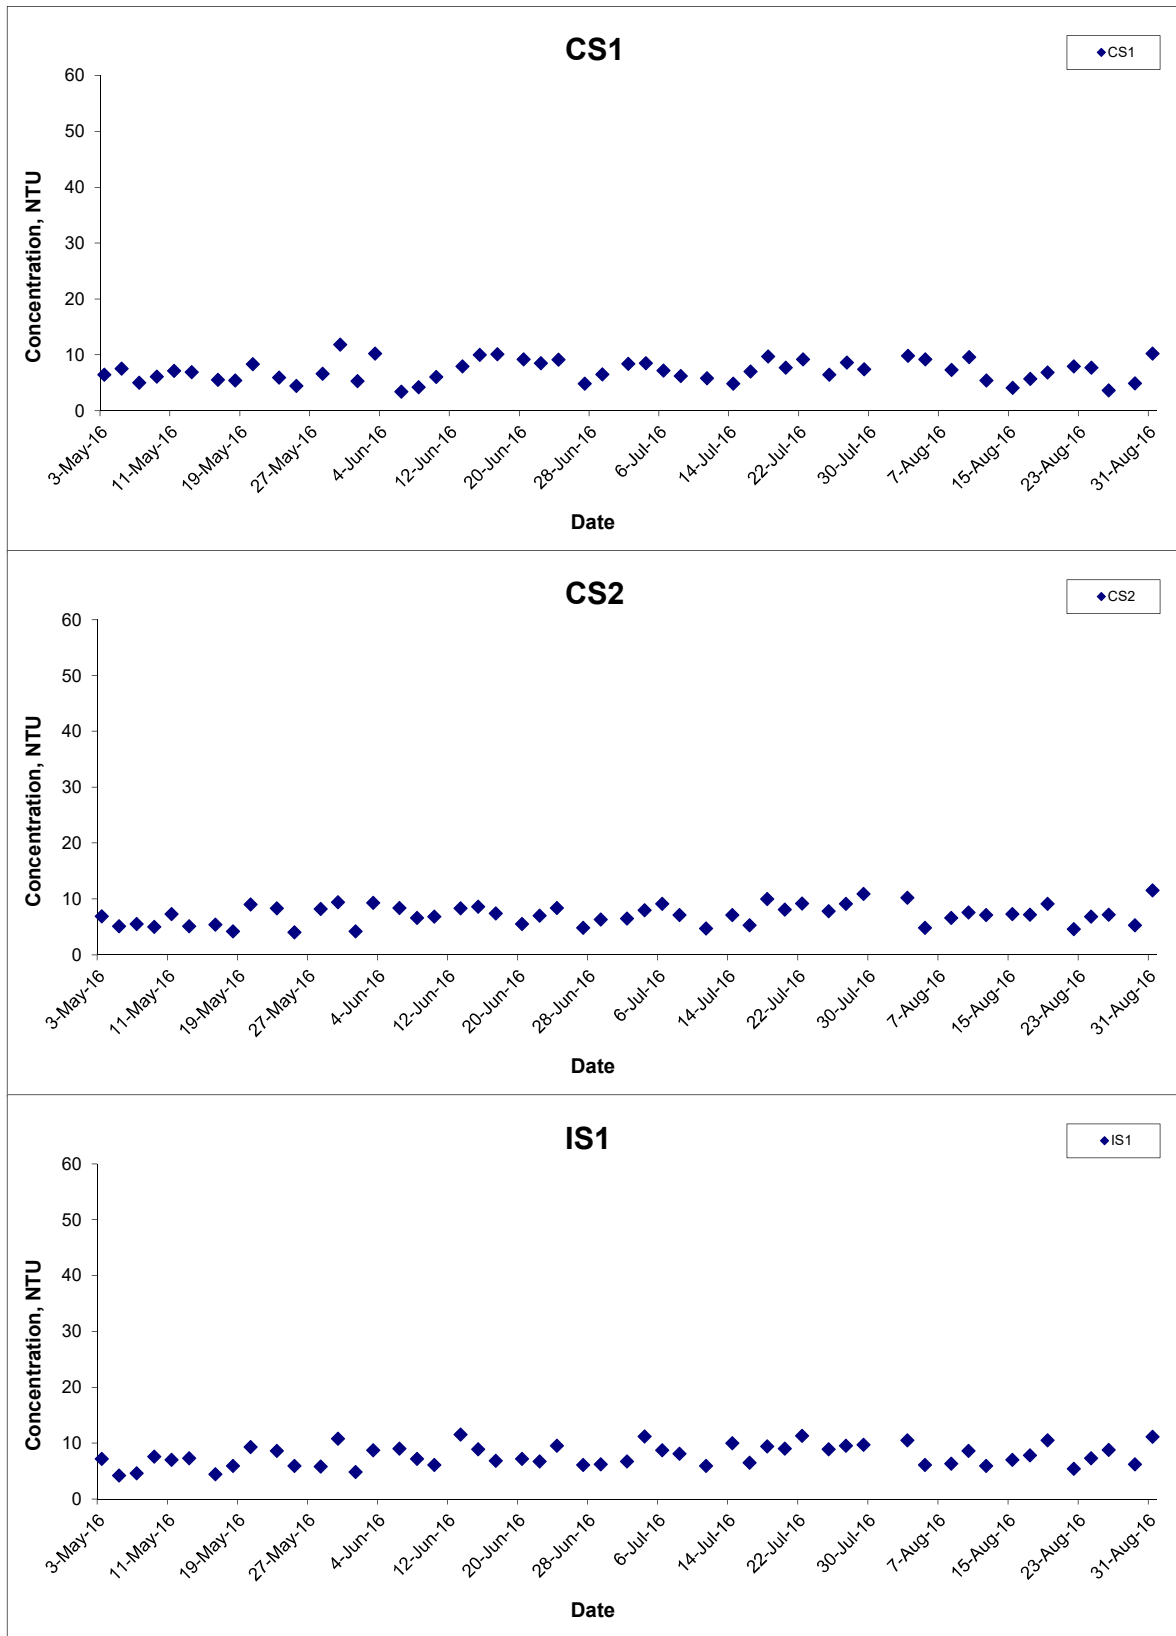


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Flood Tide

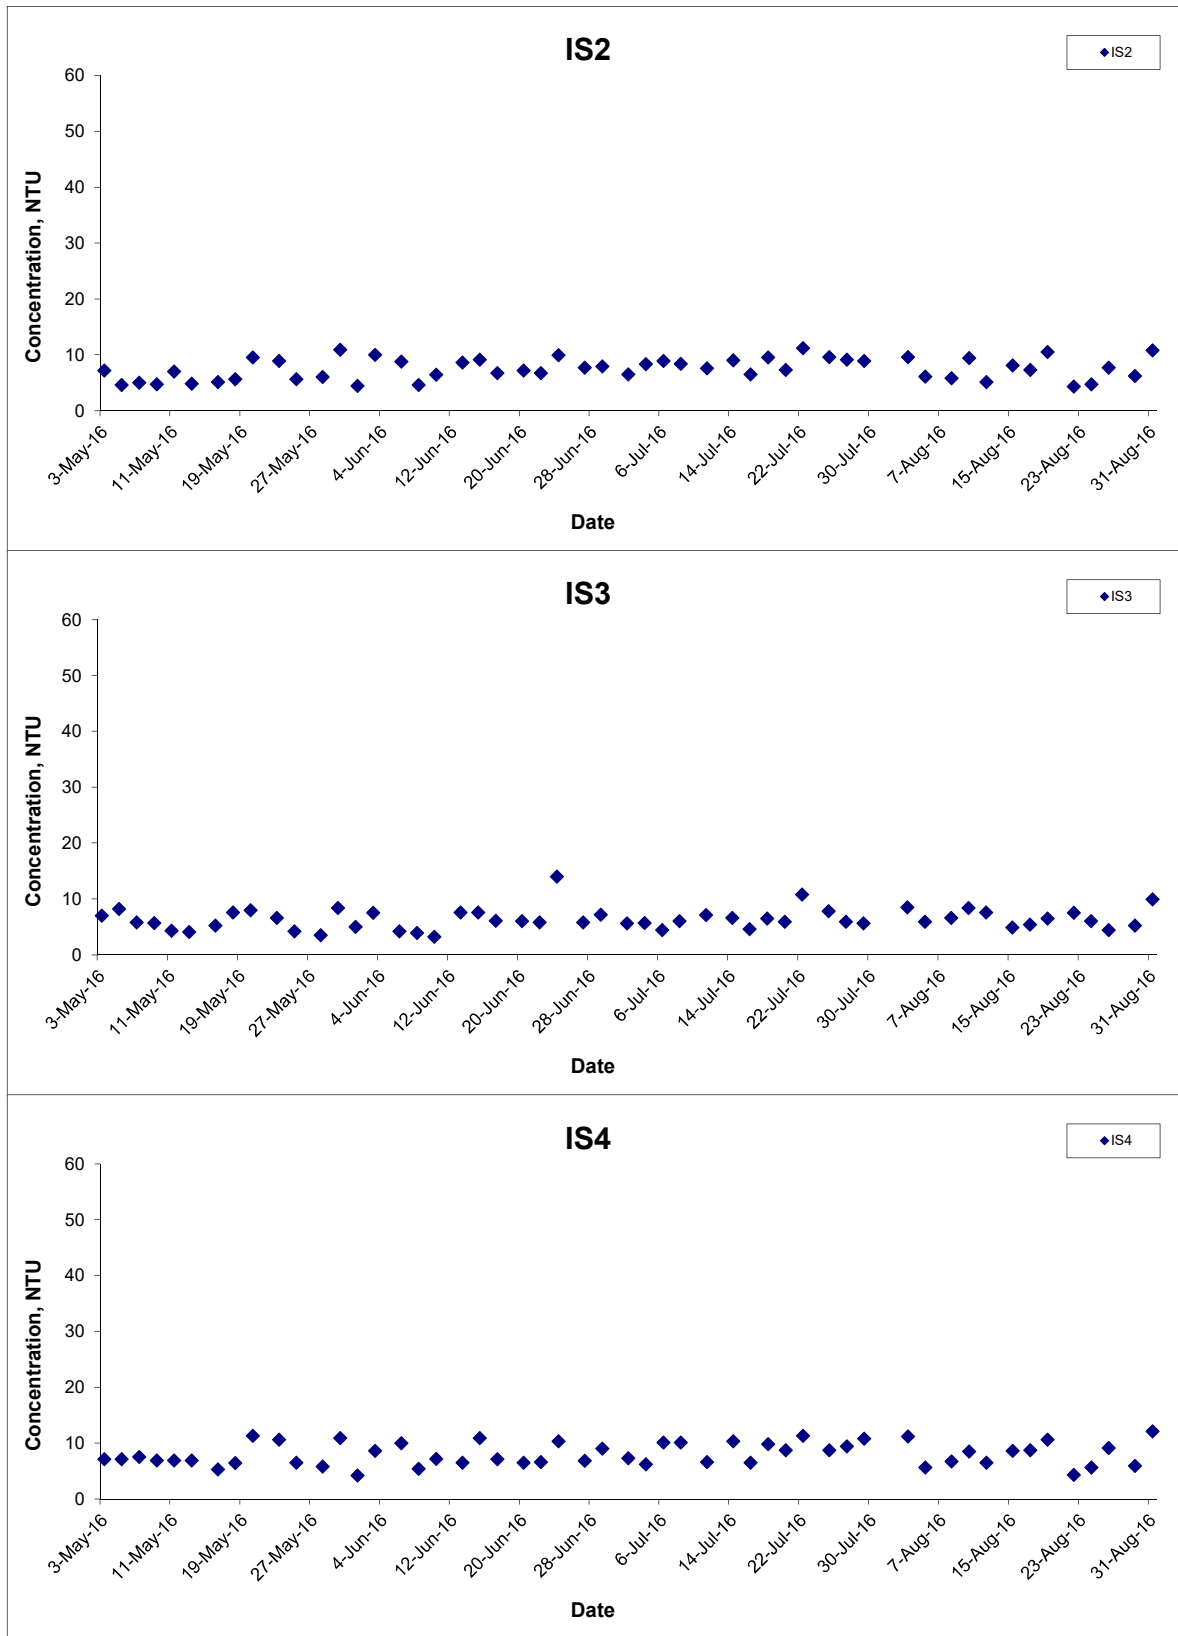


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Flood Tide

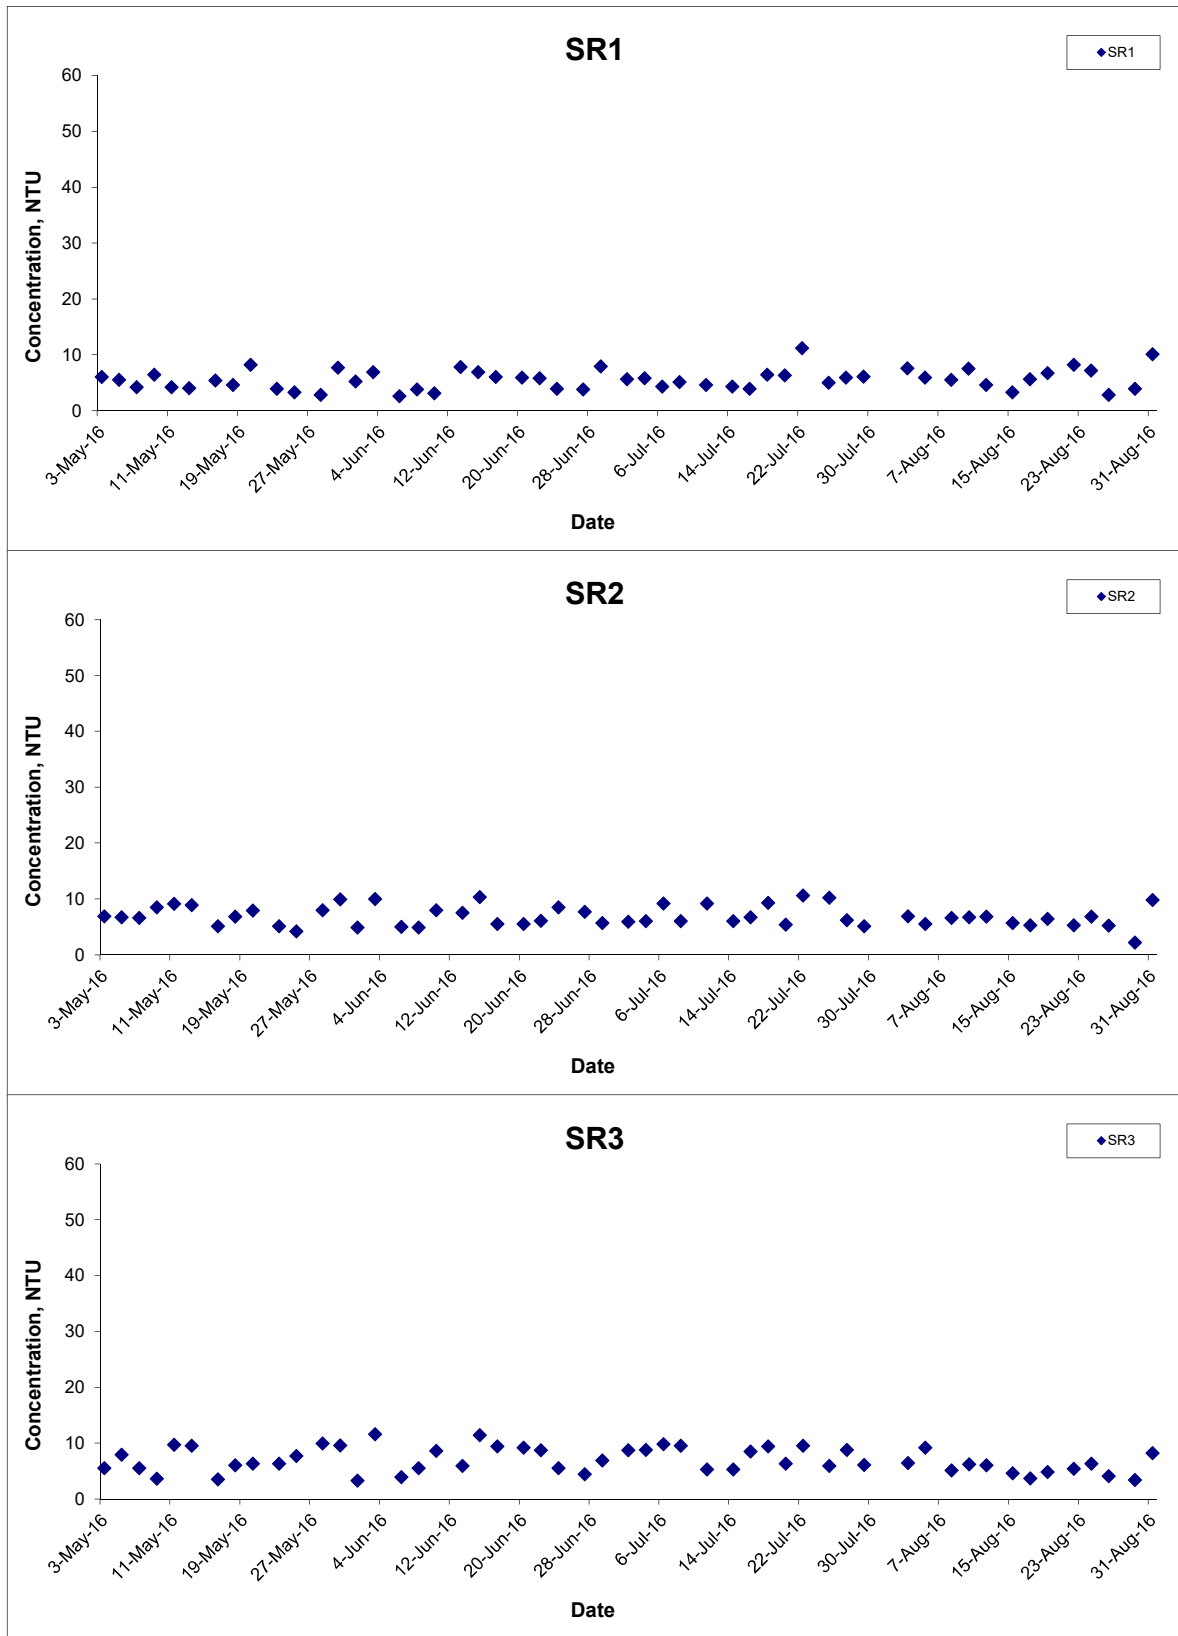


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Turbidity (Depth-averaged) at Mid-Flood Tide

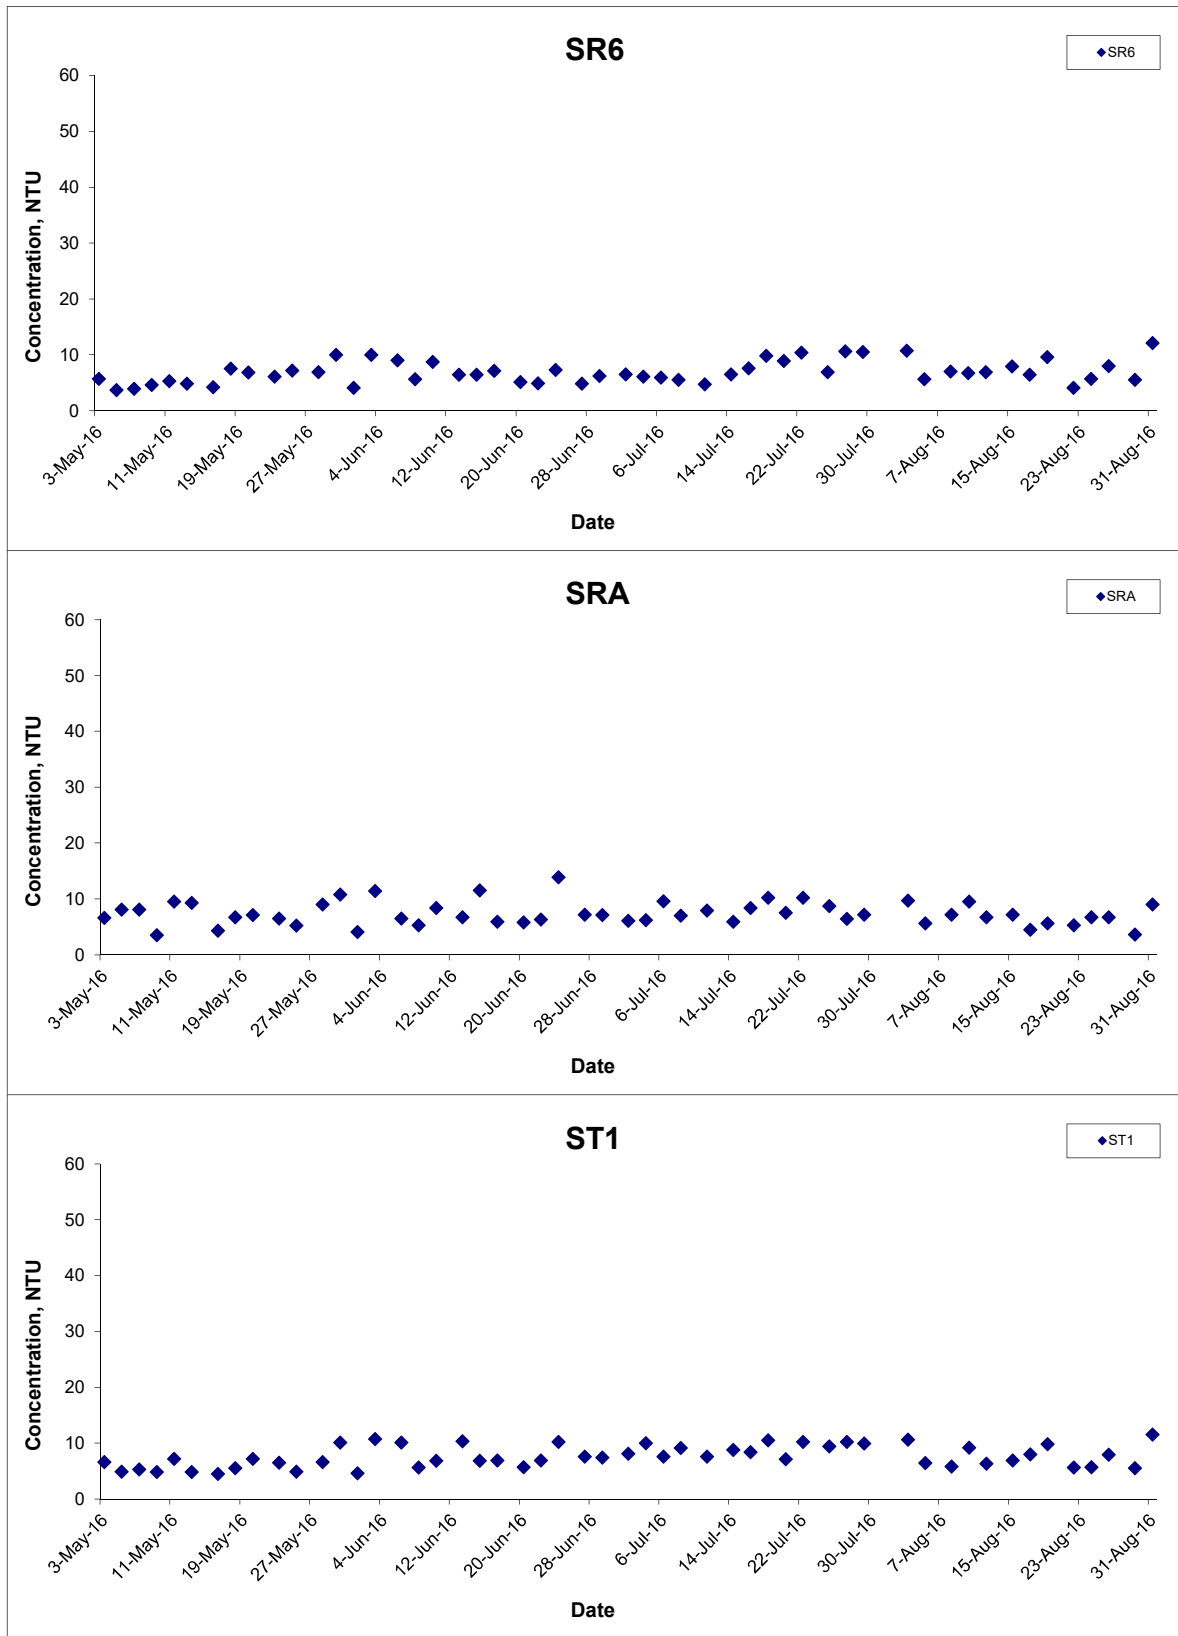


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H




Turbidity (Depth-averaged) at Mid-Flood Tide

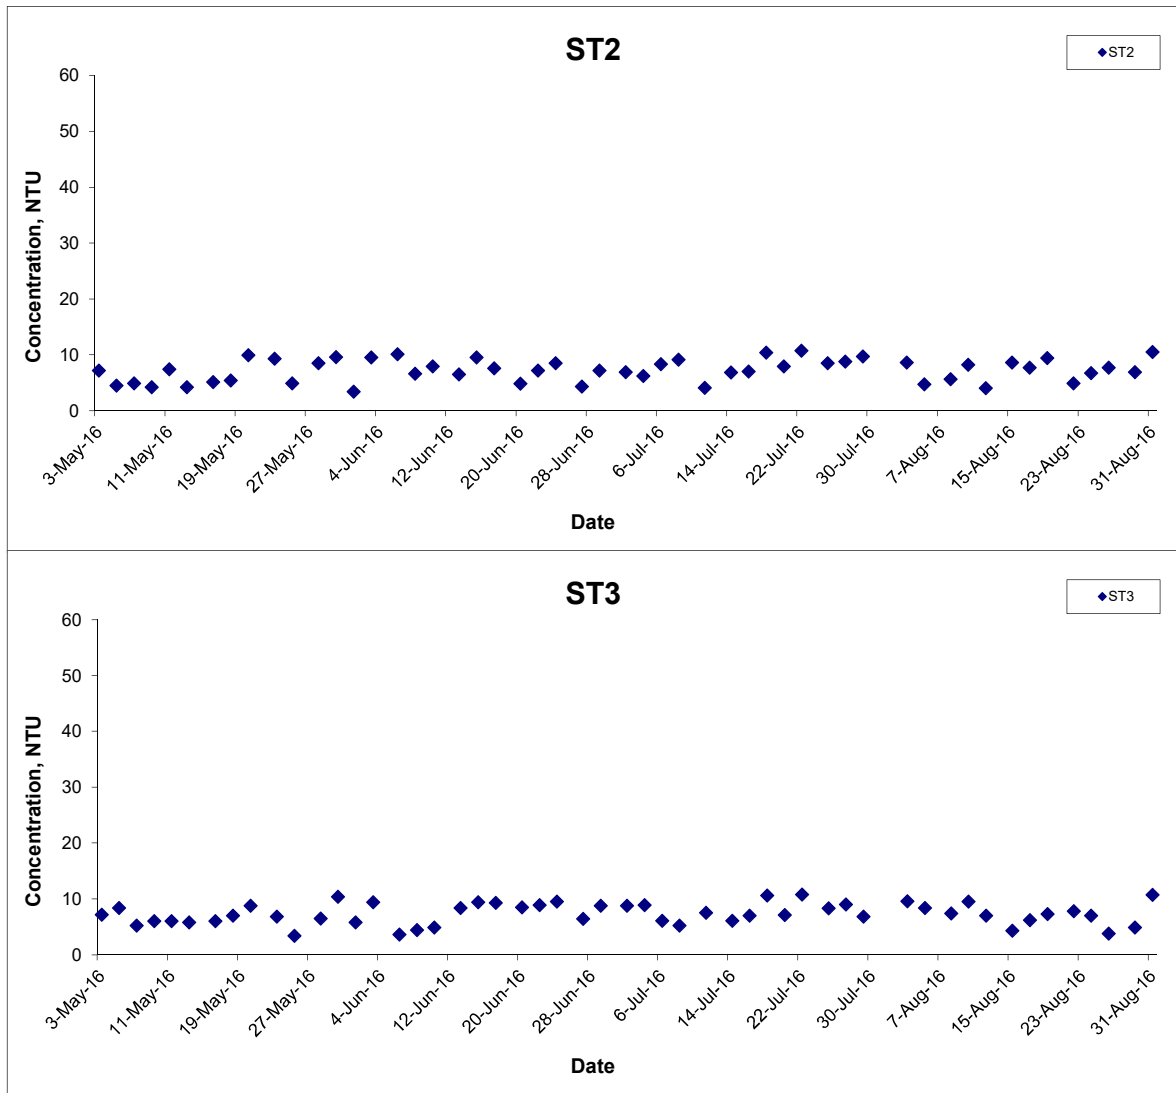

Title	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill	Scale	N.T.S	Project No.	MA12014	CINOTECH
	Graphical Presentation of Water Quality Monitoring Results	Date	Aug 16	Appendix	H	

Suspended Solids (Depth-averaged) at Mid-Ebb Tide

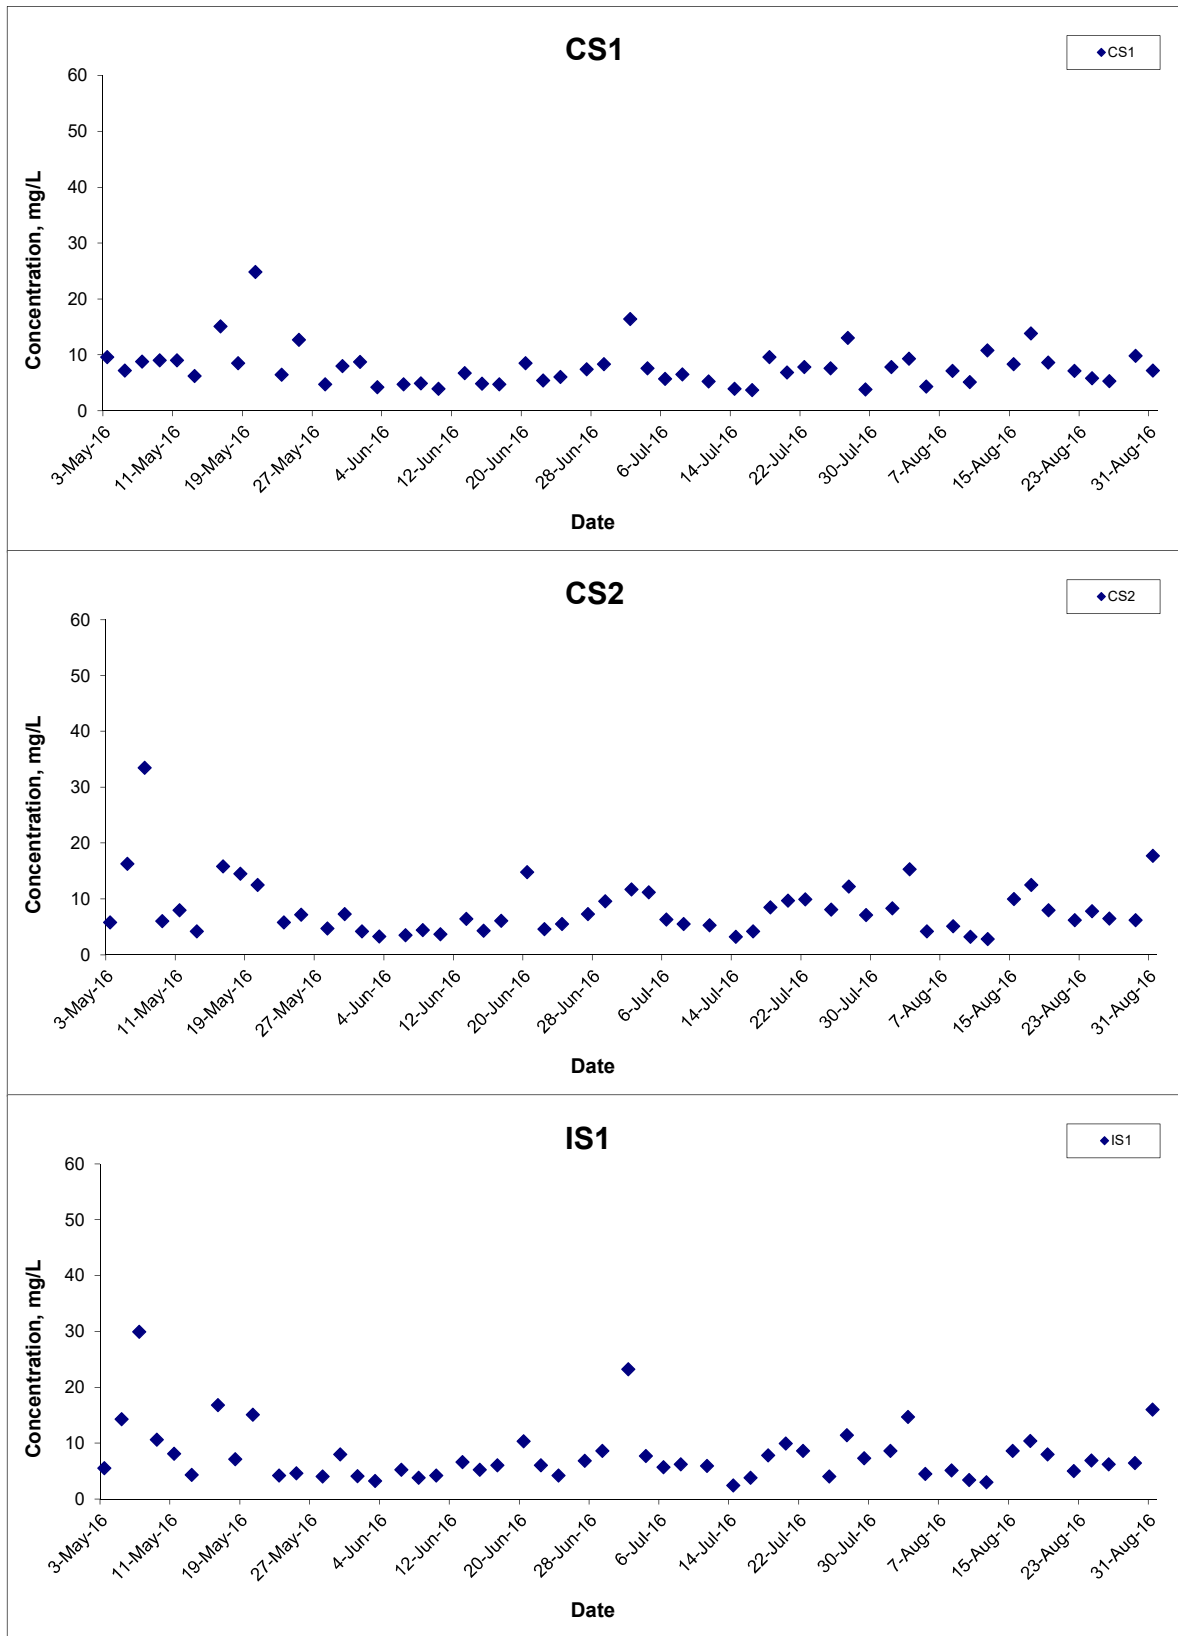


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Ebb Tide

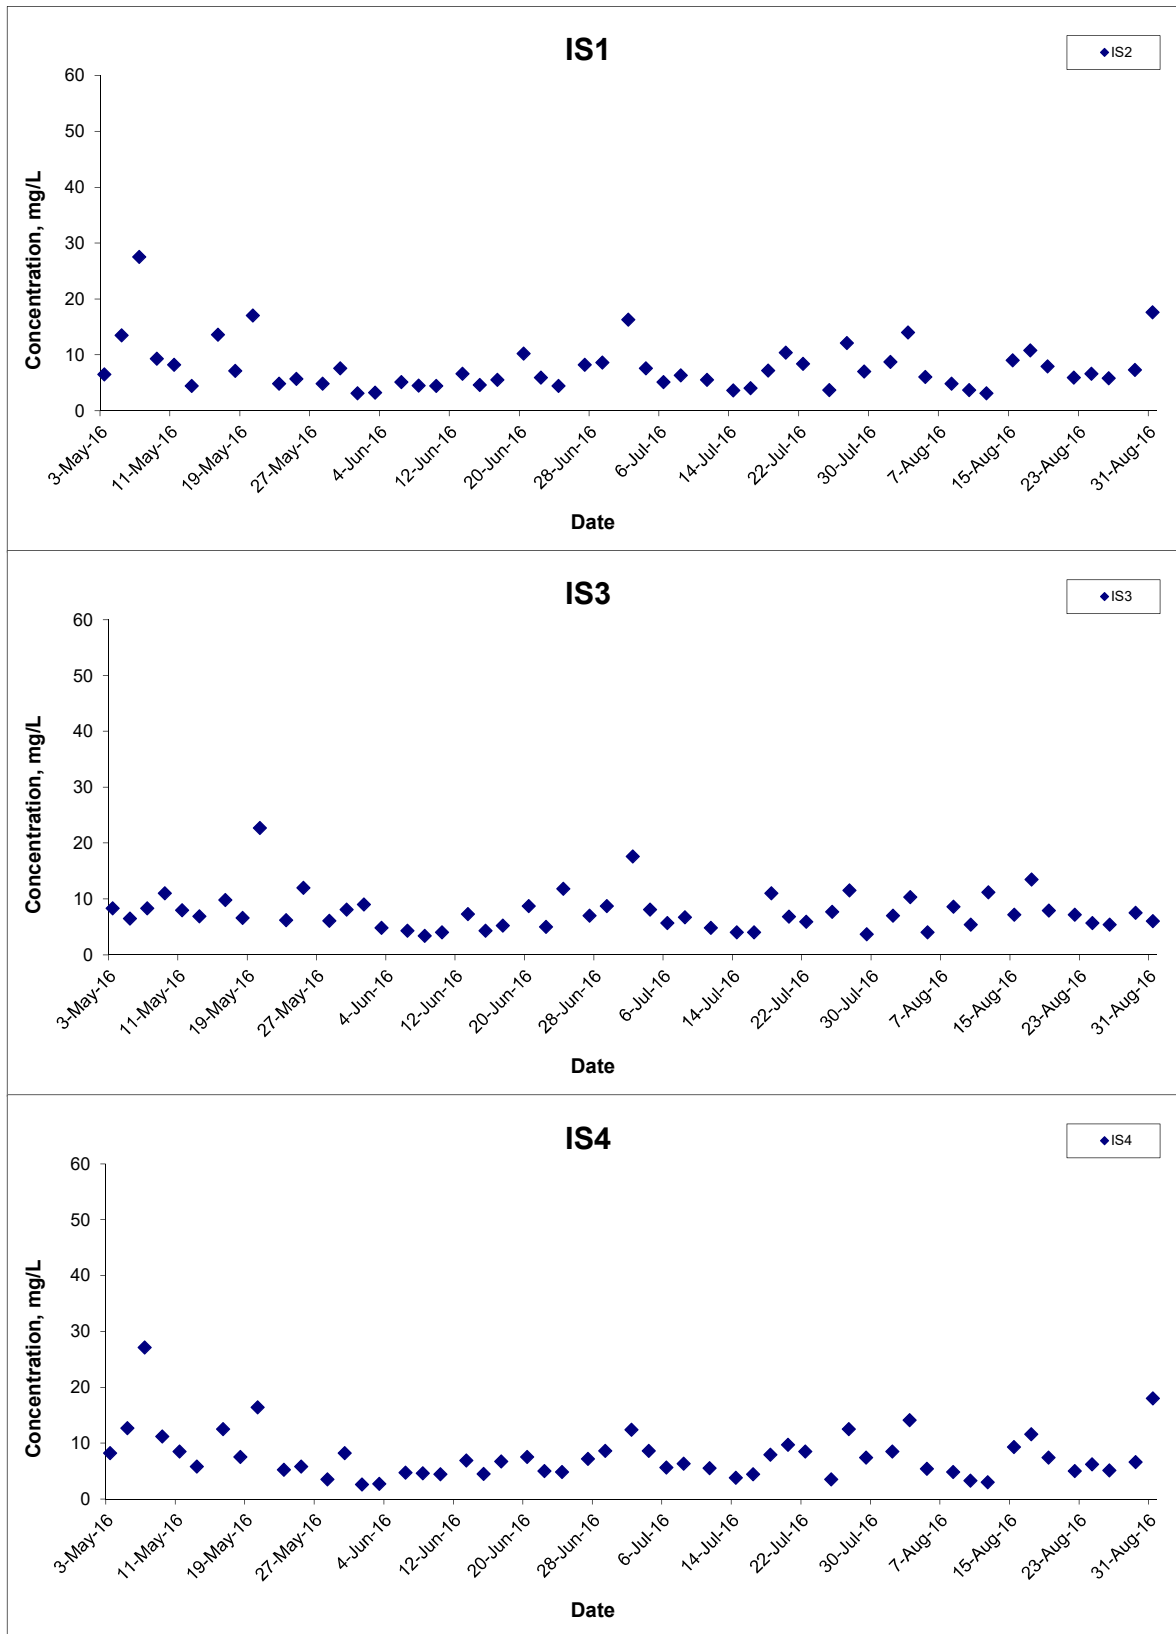


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Ebb Tide

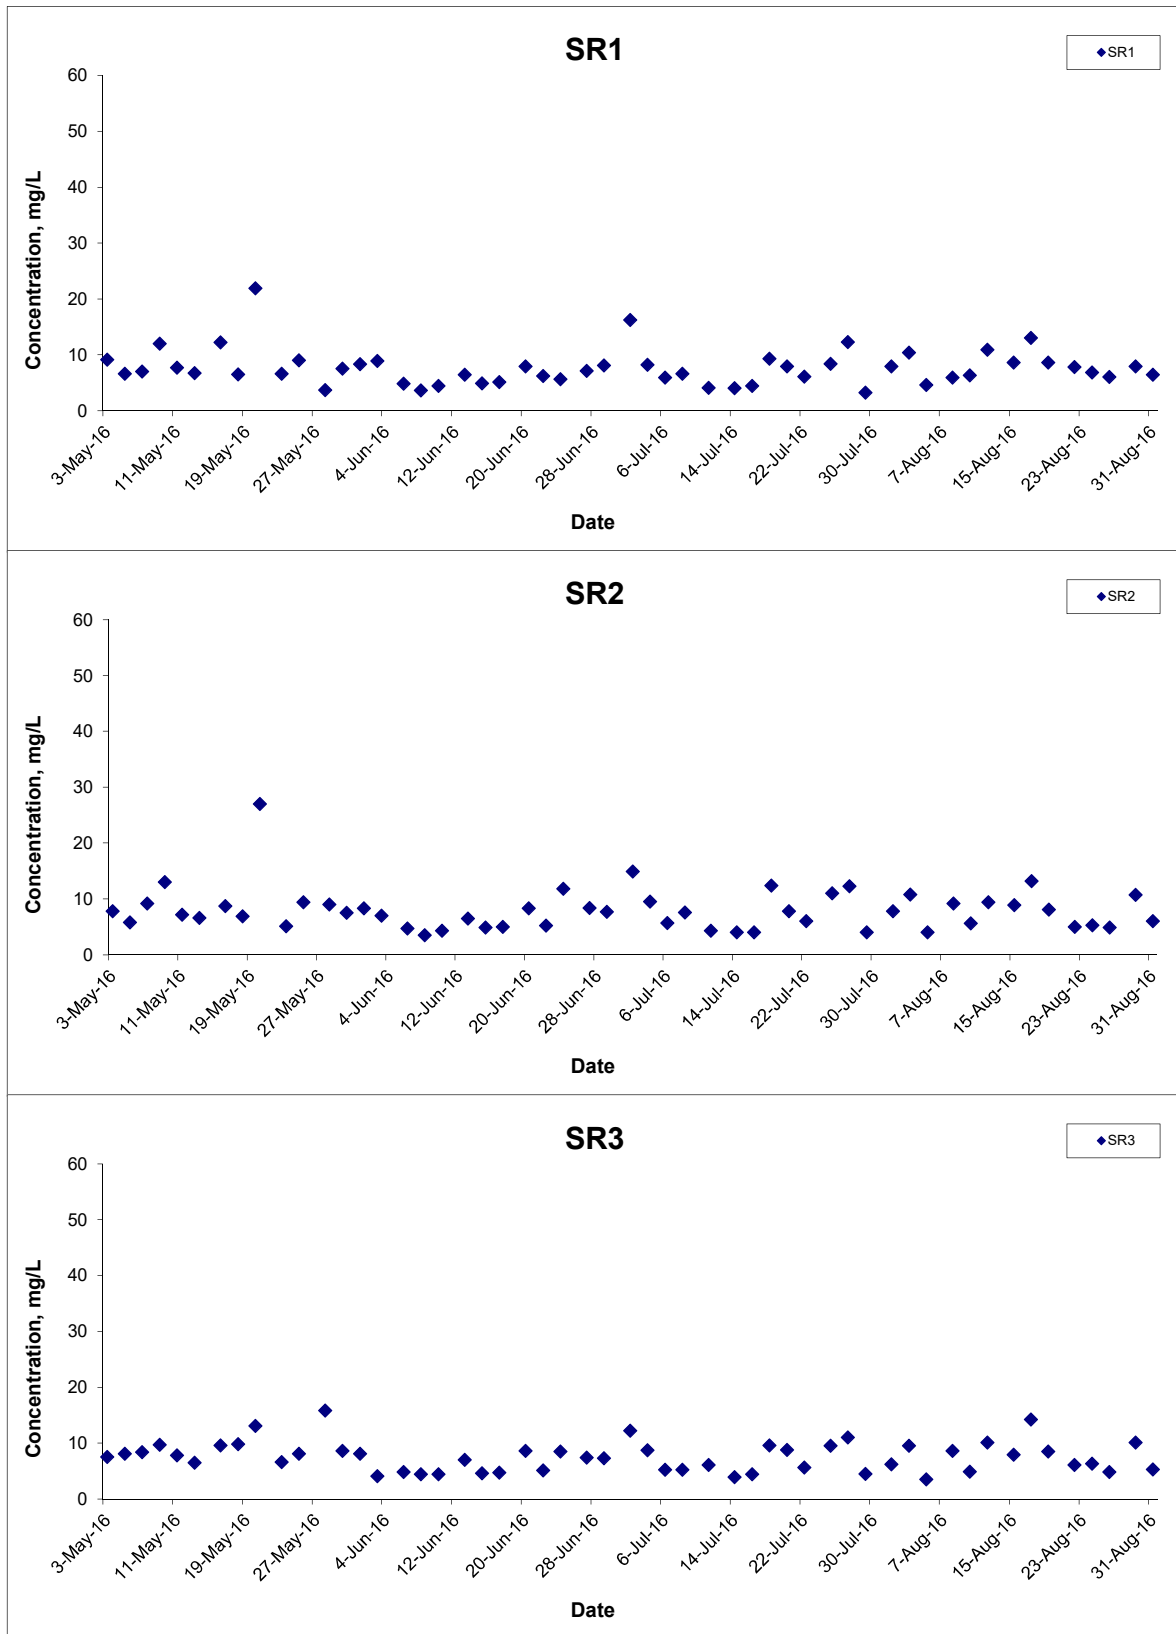


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Ebb Tide

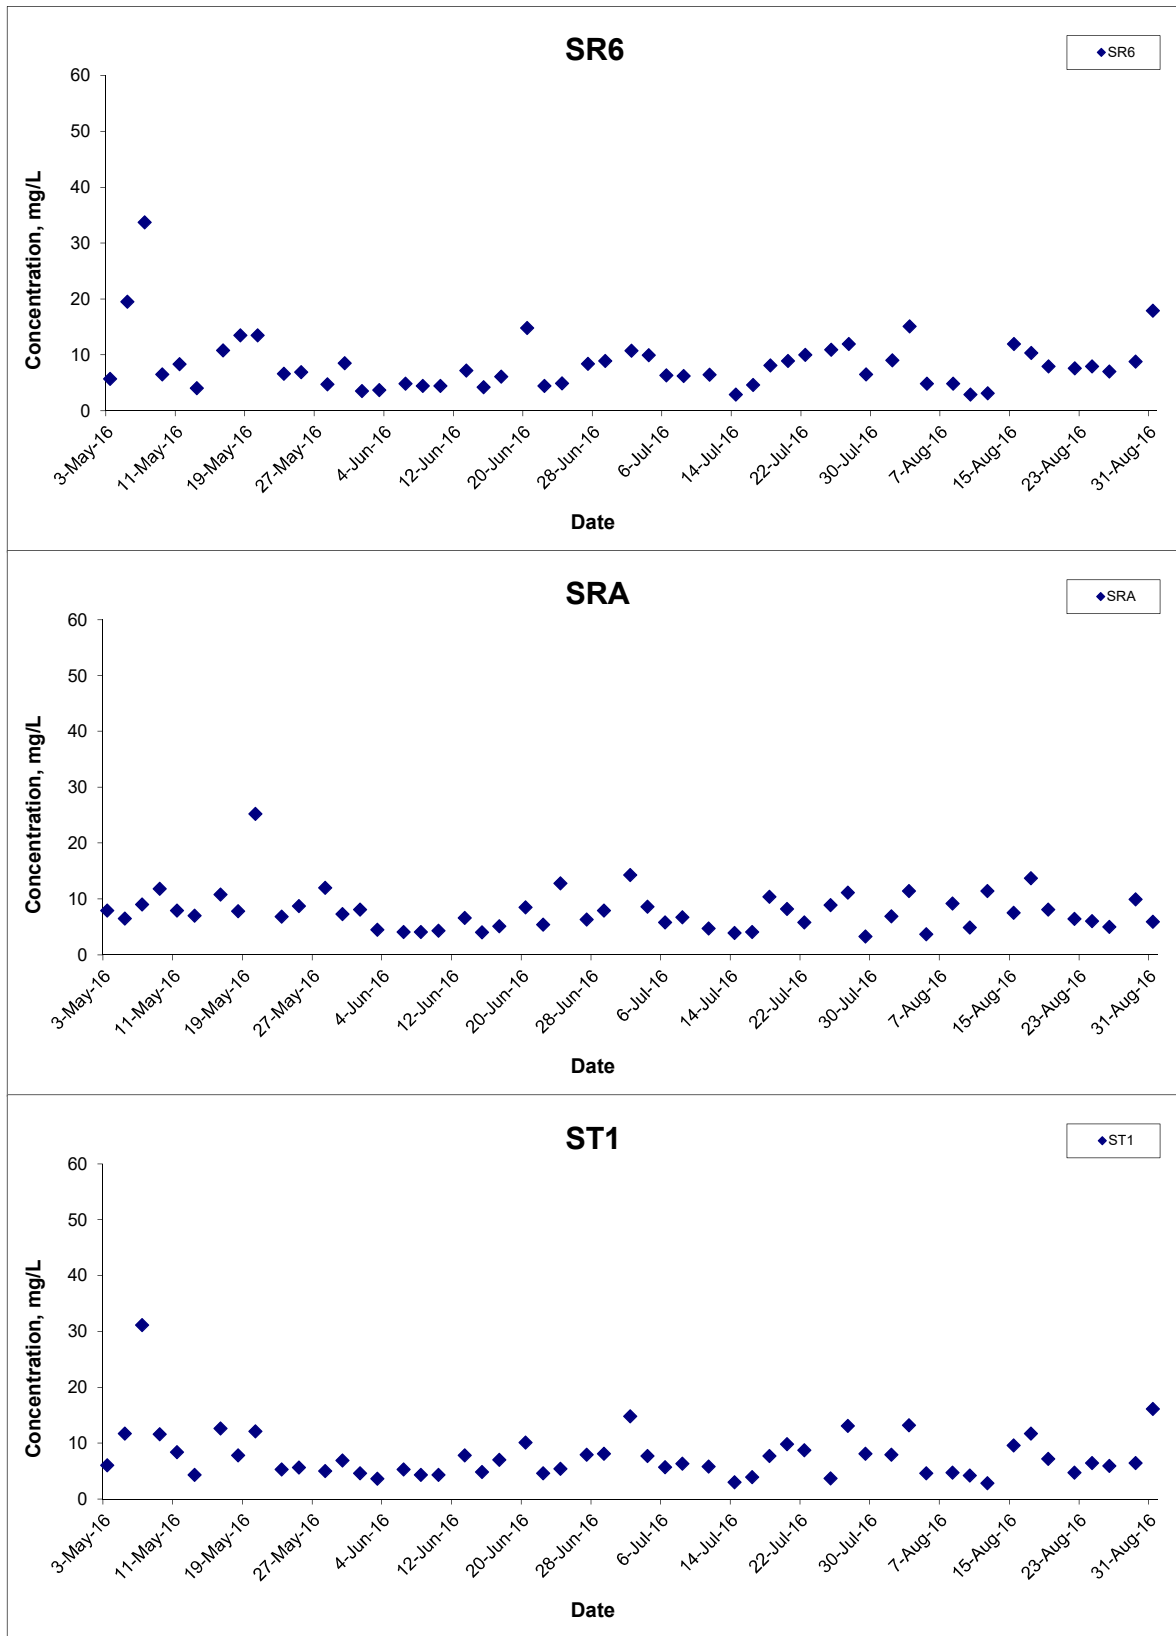


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Ebb Tide

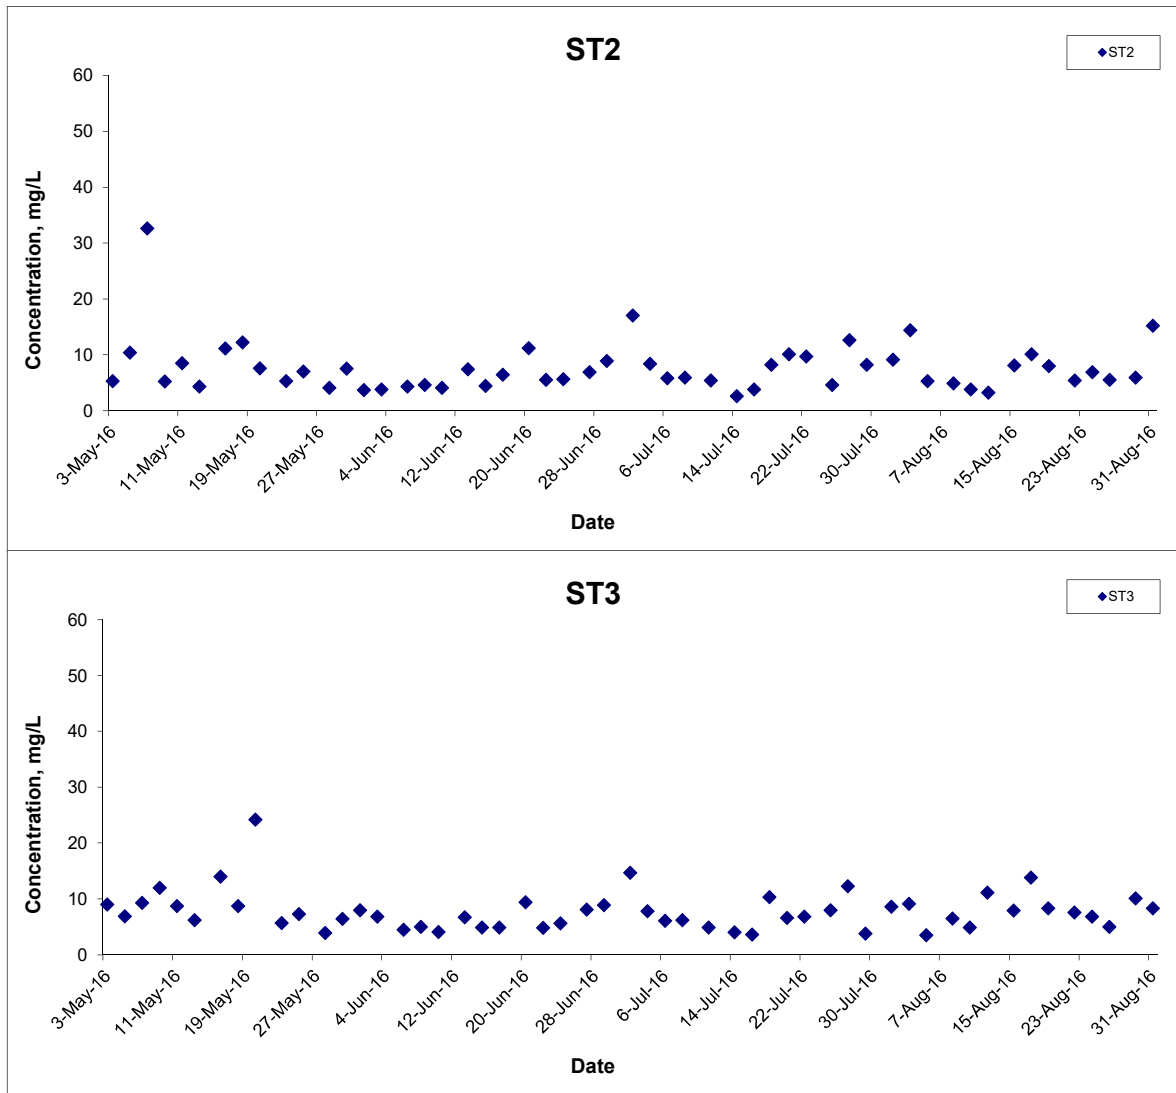


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Flood Tide

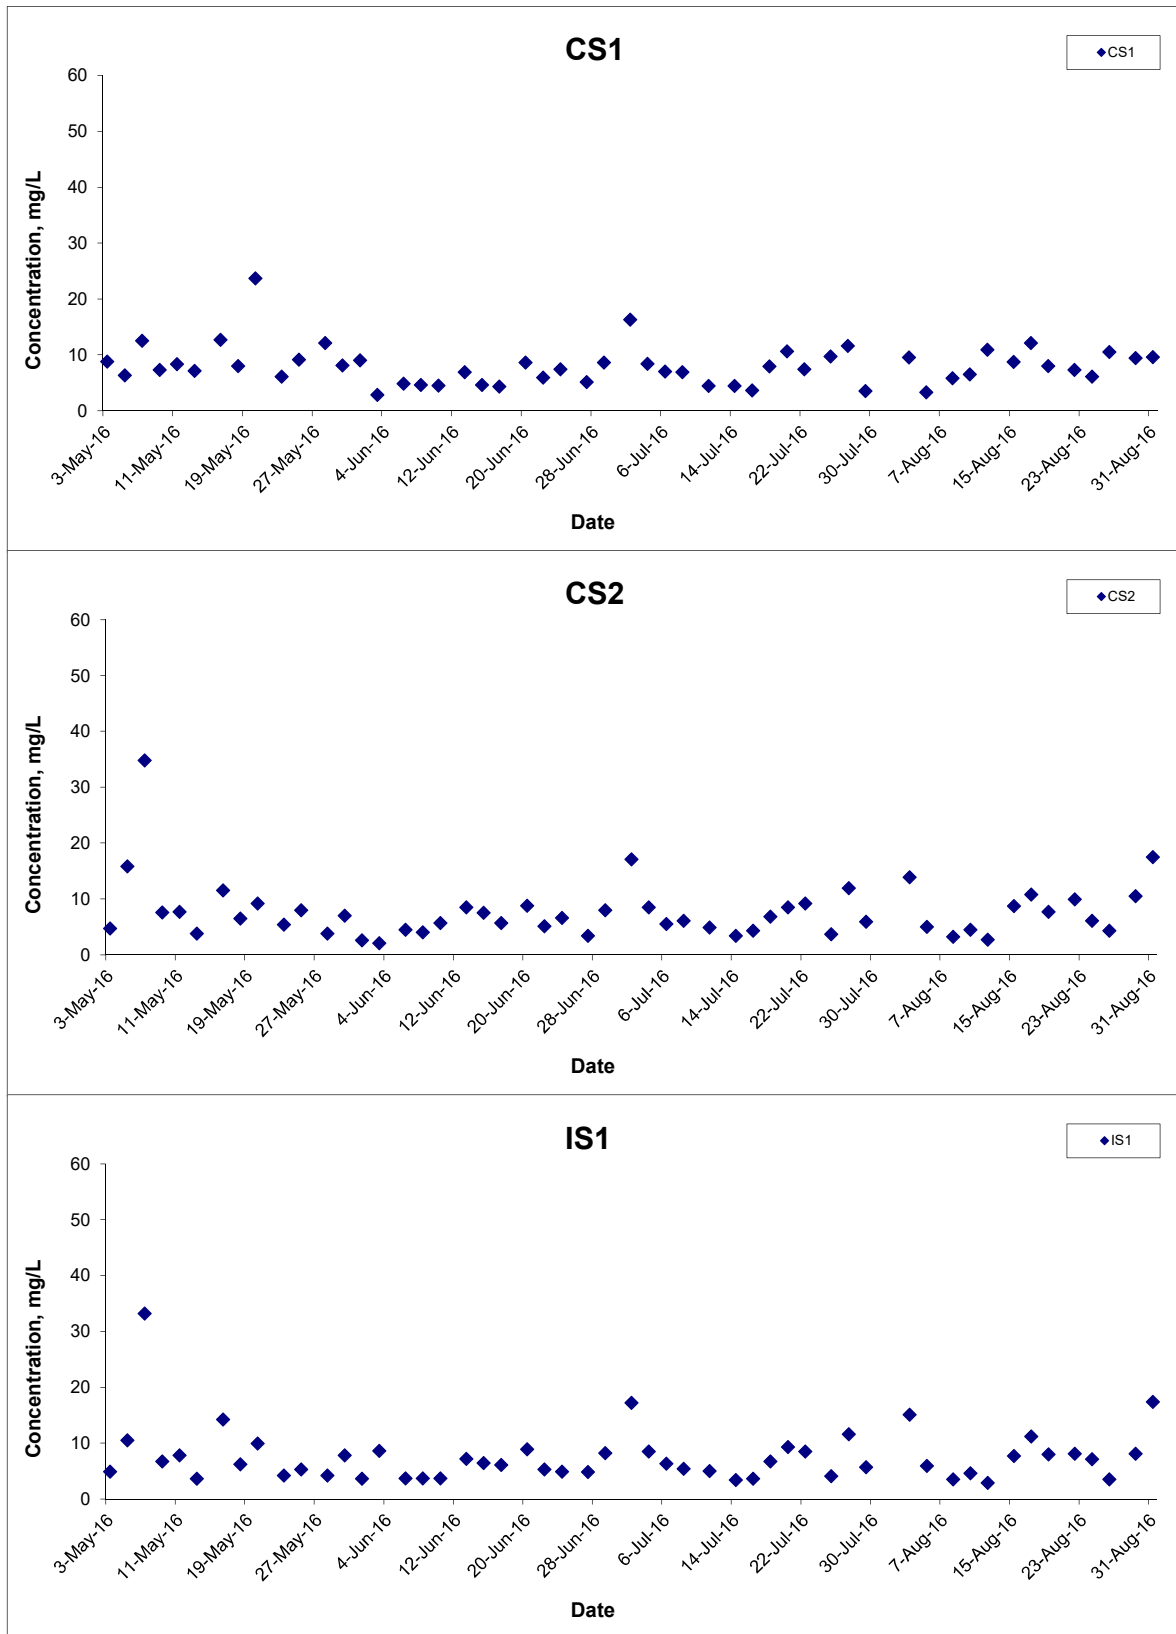


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Flood Tide

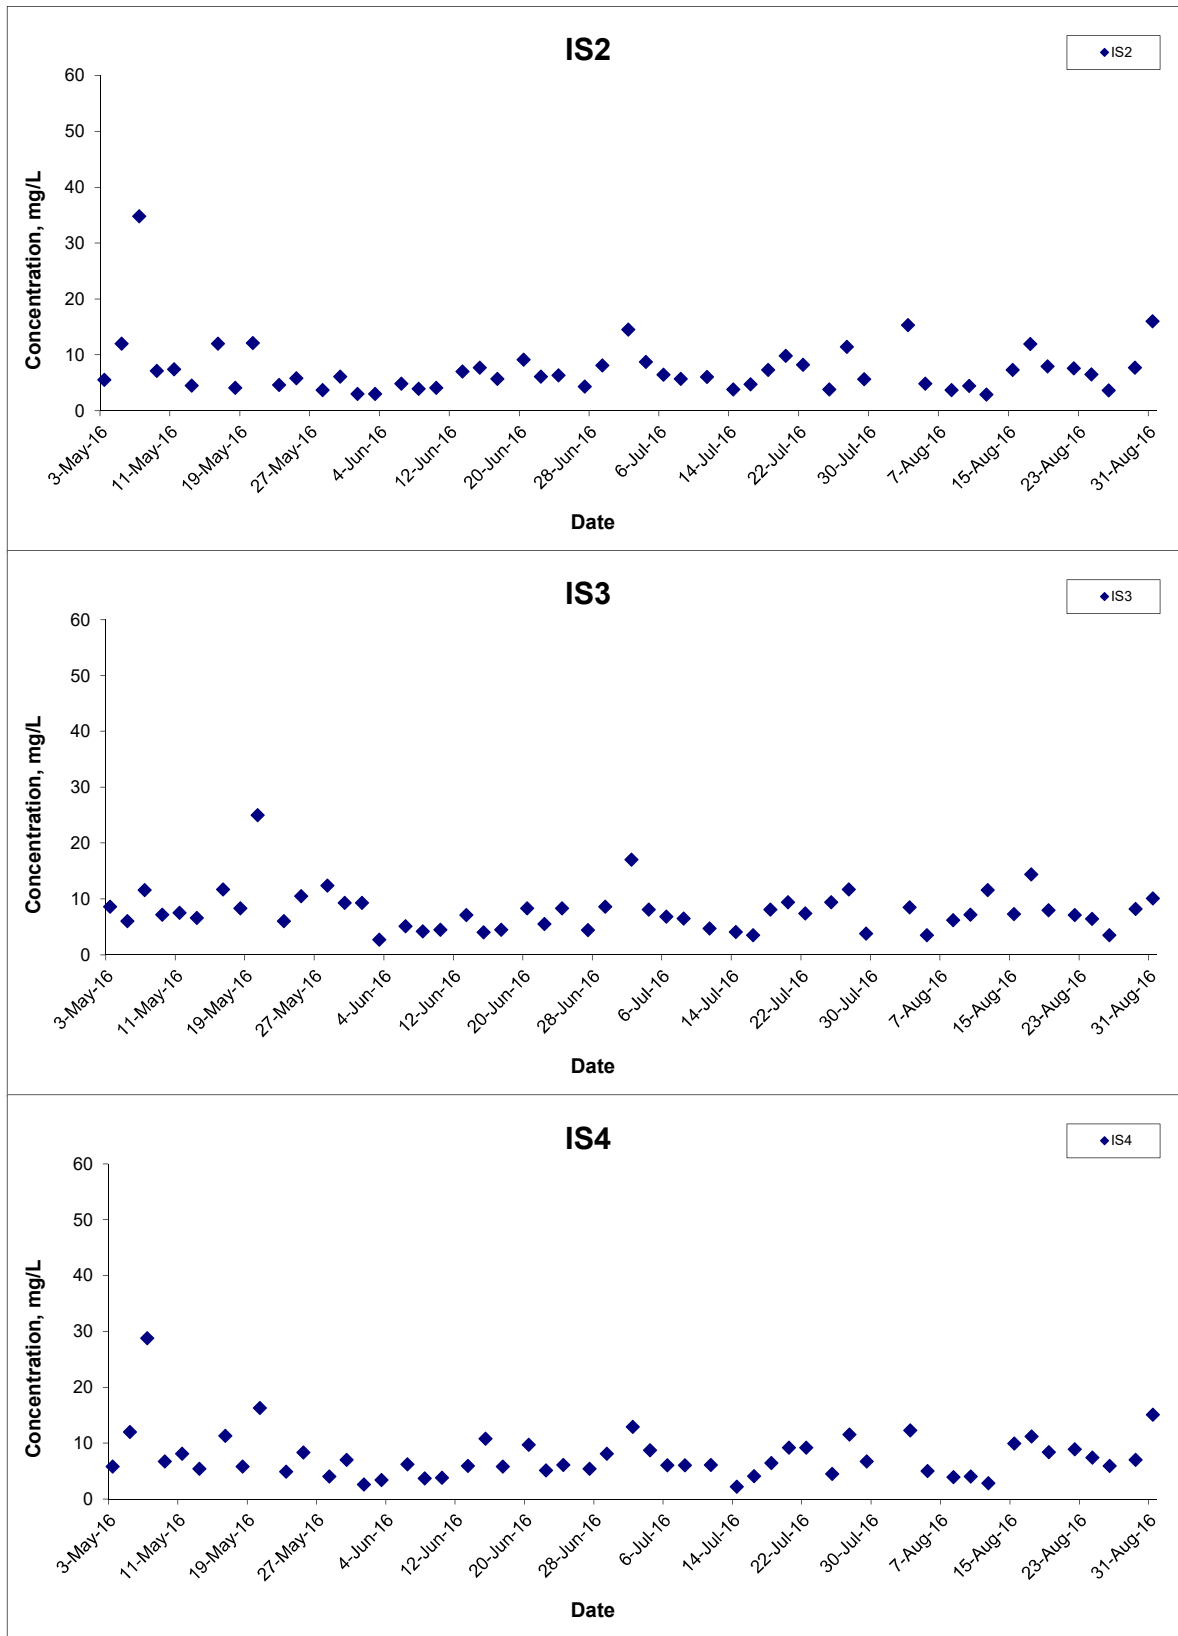


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Flood Tide

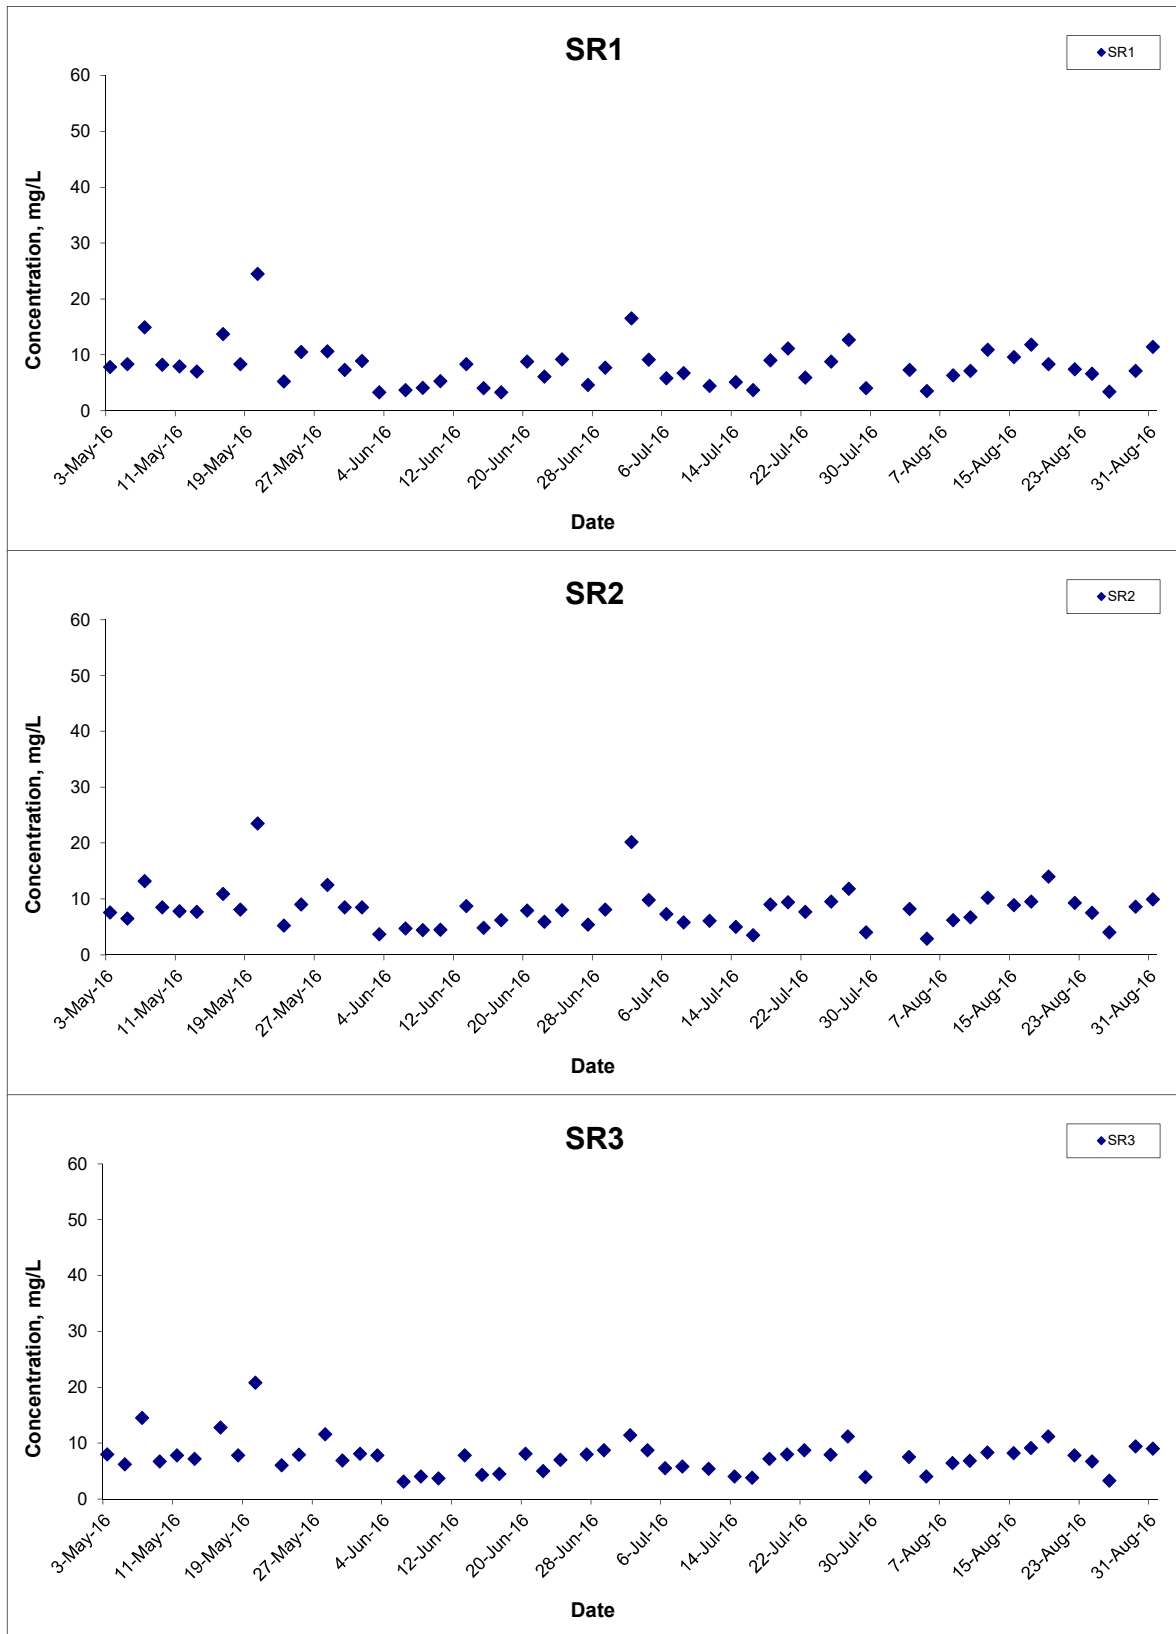


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Flood Tide

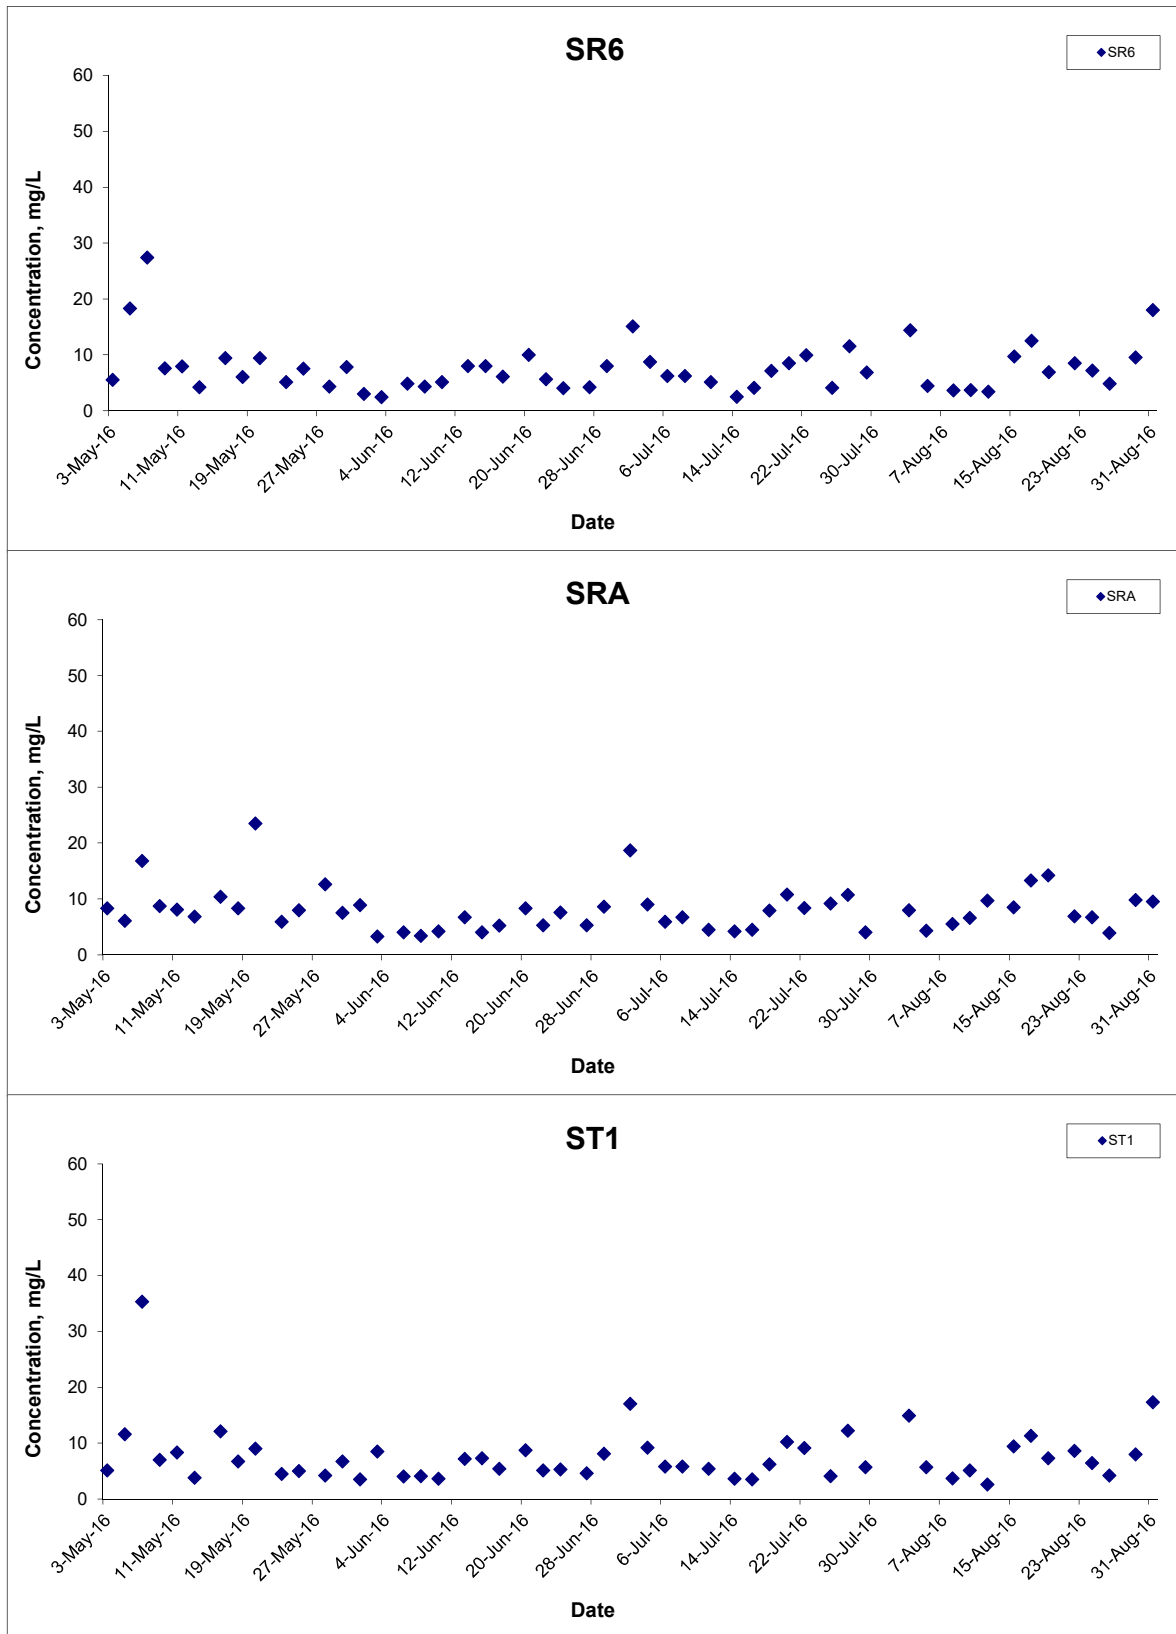


Title Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Link Road-Section between
 HKSAR Boundary and Scenic Hill
 Graphical Presentation of Water Quality Monitoring
 Results

Scale N.T.S
 Date Aug 16

Project No. MA12014
 Appendix H



Suspended Solids (Depth-averaged) at Mid-Flood Tide

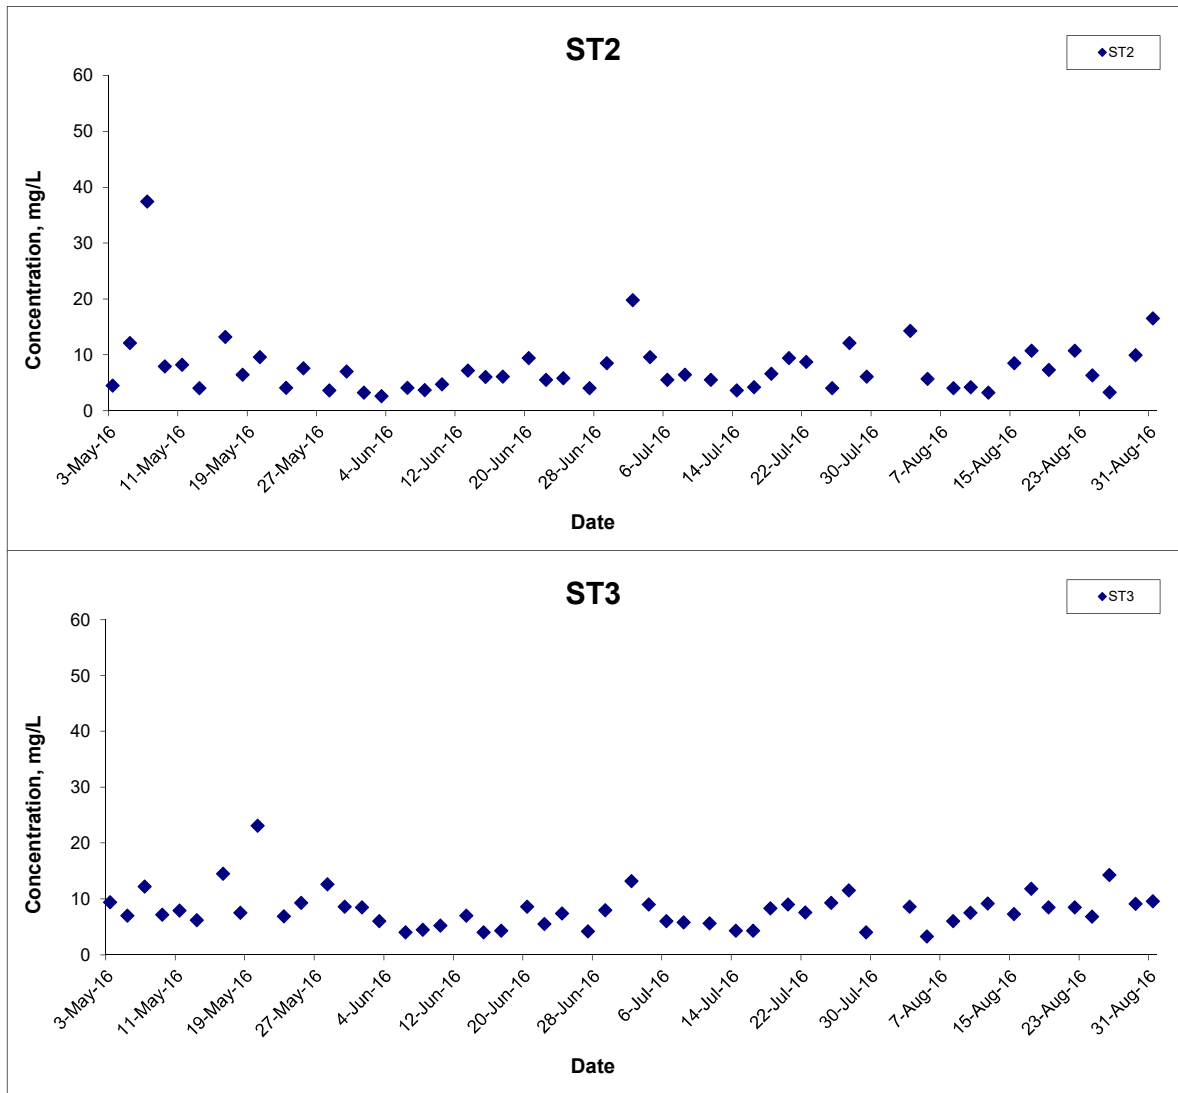

Title	Contract HY/2011/09 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill	Scale	N.T.S	Project No.	MA12014	CINOTECH
	Graphical Presentation of Water Quality Monitoring Results	Date	Aug 16	Appendix	H	

**APPENDIX I
DOLPHIN MONITORING REPORT
(LINE TRANSECT)**

Contract No. HY/2011/09
Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road –
Section between HKSAR Boundary and Scenic Hill Dolphin
Monthly Monitoring

43rd Monthly Progress Report (August 2016)

Submitted by

Samuel K.Y. Hung, Ph.D., Hong Kong Cetacean Research Project

30 August 2016

1. Introduction

- 1.1. The Hong Kong Link Road (HKLR) serves to connect the Hong Kong-Zhuhai-Macao Bridge (HZMB) Main Bridge at the Hong Kong Special Administrative Region (HKSAR) Boundary and the HZMB Hong Kong Boundary Crossing Facilities (HKBCF) located at the northeastern waters of the Hong Kong International Airport.
- 1.2. According to the updated Environmental Monitoring and Audit (EM&A) Manual (for HKLR), monthly line-transect vessel surveys for Chinese White Dolphin should be conducted to cover the West Lantau survey area as in AFCD annual marine mammal monitoring programme.
- 1.3. Since November 2012, Hong Kong Cetacean Research Project (HKCRP) has been commissioned by Dragages – China Harbour – VSL JV to conduct this 34-month dolphin monitoring study in order to collect data on Chinese White Dolphins during the construction phase (i.e. impact period) of the HKLR09 project in West Lantau (WL) survey area, and to analyze the collected survey data to monitor distribution, encounter rate, abundance, activities and occurrence of dolphin calves. Photo-identification will also be collected from individual Chinese White Dolphins to examine their individual range patterns and core area use.
- 1.4. From the monitoring results, any changes in dolphin occurrence within the study area will be examined for possible causes, and appropriate actions and additional mitigation measures will be recommended as necessary.

1.5. This report is the 43rd monthly progress report under the HKLR09 construction phase dolphin monitoring programme, summarizing the results of the survey findings during the month of August 2016.

2. Monitoring Methodology

2.1. Vessel-based Line-transect Survey

2.1.1. According to the requirement of the updated EM&A manual, dolphin monitoring programme should cover all transect lines in WL survey area (see Figure 1) twice per month throughout the entire construction period. The co-ordinates of all transect lines are shown in Table 1.

Table 1. Co-ordinates of transect lines in WL survey area

Line No.		Easting	Northing		Line No.		Easting	Northing
1	Start Point	803750	818500		7	Start Point	800200	810450
1	End Point	803750	815500		7	End Point	801400	810450
2	Start Point	803750	815500		8	Start Point	801300	809450
2	End Point	802940	815500		8	End Point	799750	809450
3	Start Point	802550	814500		9	Start Point	799400	808450
3	End Point	803700	814500		9	End Point	801430	808450
4	Start Point	803120	813600		10	Start Point	801500	807450
4	End Point	801640	813600		10	End Point	799600	807450
5	Start Point	801100	812450		11	Start Point	800300	806500
5	End Point	802900	812450		11	End Point	801750	806500
6	Start Point	802400	811500		12	Start Point	801760	805450
6	End Point	800660	811500		12	End Point	800700	805450

2.1.2. The survey team used standard line-transect methods (Buckland et al. 2001) to conduct the systematic vessel surveys, and followed the same technique of data collection that has been adopted over the last 19 years of marine mammal monitoring surveys in Hong Kong developed by HKCRP (see Hung

2014, 2015). For each monitoring vessel survey, a 15-m inboard vessel with an open upper deck (about 4.5 m above water surface) was used to make observations from the flying bridge area.

- 2.1.3. Two experienced observers (a data recorder and a primary observer) made up the on-effort survey team, and the survey vessel transited different transect lines at a constant speed of 13-15 km per hour. The data recorder searched with unaided eyes and filled out the datasheets, while the primary observer searched for dolphins and porpoises continuously through 7 x 50 *Fujinon* marine binoculars. Both observers searched the sea ahead of the vessel, between 270° and 90° (in relation to the bow, which is defined as 0°). One to two additional experienced observers were available on the boat to work in shift (i.e. rotate every 30 minutes) in order to minimize fatigue of the survey team members. All observers were experienced in small cetacean survey techniques and identifying local cetacean species.
- 2.1.4. During on-effort survey periods, the survey team recorded effort data including time, position (latitude and longitude), weather conditions (Beaufort sea state and visibility), and distance traveled in each series (a continuous period of search effort) with the assistance of a handheld GPS.
- 2.1.5. Data including time, position and vessel speed were also automatically and continuously logged by handheld GPS throughout the entire survey for subsequent review.
- 2.1.6. When dolphins were sighted, the survey team would end the survey effort, and immediately record the initial sighting distance and angle of the dolphin group from the survey vessel, as well as the sighting time and position. Then the research vessel was diverted from its course to approach the animals for species identification, group size estimation, assessment of group composition, and behavioural observations. The perpendicular distance (PSD) of the dolphin group to the transect line was later calculated from the initial sighting distance and angle.
- 2.1.7. Survey effort being conducted along the parallel transect lines that were perpendicular to the coastlines (as indicated in Figure 1) was labeled as “primary” survey effort, while the survey effort being conducted along the connecting lines between parallel lines was labeled as “secondary” survey

effort. According to HKCRP long-term dolphin monitoring data, encounter rates of Chinese white dolphins deduced from effort and sighting data collected along primary and secondary lines were similar in survey areas around Lantau Island. Therefore, primary and secondary survey effort were both presented as on-effort survey effort in this report.

- 2.1.8. Encounter rates of Chinese white dolphins (number of on-effort sightings per 100 km of survey effort) were calculated in WL survey area in relation to the amount of survey effort conducted during each month of monitoring survey. Only data collected under Beaufort 3 or below condition would be used for encounter rate analysis. Dolphin encounter rates were calculated using primary survey effort alone, as well as the combined survey effort from both primary and secondary lines.

2.2. *Photo-identification Work*

- 2.2.1. When a group of Chinese White Dolphins were sighted during the line-transect survey, the survey team would end effort and approach the group slowly from the side and behind to take photographs of them. Every attempt was made to photograph every dolphin in the group, and even photograph both sides of the dolphins, since the colouration and markings on both sides may not be symmetrical.
- 2.2.2. A professional digital camera (*Canon* EOS 7D or 60D model) equipped with long telephoto lenses (100-400 mm zoom) were available on board for researchers to take sharp, close-up photographs of dolphins as they surfaced. The images were shot at the highest available resolution and stored on Compact Flash memory cards for downloading onto a computer.
- 2.2.3. All digital images taken in the field were first examined, and those containing potentially identifiable individuals were sorted out. These photographs would then be examined in greater detail, and were carefully compared to the existing Chinese White Dolphin photo-identification catalogue maintained by HKCRP since 1995.
- 2.2.4. Chinese White Dolphins can be identified by their natural markings, such as nicks, cuts, scars and deformities on their dorsal fin and body, and their unique spotting patterns were also used as secondary identifying features (Jefferson 2000).

- 2.2.5. All photographs of each individual were then compiled and arranged in chronological order, with data including the date and location first identified (initial sighting), re-sightings, associated dolphins, distinctive features, and age classes entered into a computer database.

3. Monitoring Results

3.1. Vessel-based Line-transect Survey

- 3.1.1. During the monitoring month of August 2016, two complete sets of systematic line-transect vessel surveys were conducted on the 9th and 16th, to cover all transect lines in WL survey area twice. The survey routes of each survey day are presented in Figures 2-3.
- 3.1.2. From these surveys, a total of 64.90 km of survey effort was collected, with 100% of the total survey effort being conducted under favourable weather conditions (i.e. Beaufort Sea State 3 or below with good visibility) (Appendix I).
- 3.1.3. Moreover, the total survey effort conducted on primary lines (the horizontal lines perpendicular to the coastlines) was 44.42 km, while the effort on secondary lines (the lines connecting the primary lines) was 20.48 km.
- 3.1.4. During the monitoring surveys conducted in August 2016, nine groups of 26 Chinese White Dolphins were sighted. All except one dolphin sightings were made during on-effort search, while four of the eight on-effort sightings were made on primary lines (Appendix II).
- 3.1.5. None of the dolphin groups was associated with an operating fishing vessel.
- 3.1.6. Distribution of the nine dolphin sightings made during August's surveys is shown in Figure 4. The sightings were evenly distributed from Tai O Peninsula to Fan Lau, with no apparent concentration (Figure 4). As in the past monitoring months, dolphins were rarely sighted in the northern portion of the study area, especially in the area near the HKLR09 alignment (Figure 4).
- 3.1.7. During the August's surveys, encounter rates of Chinese White Dolphins deduced from the survey effort and on-effort sighting data made under favourable conditions (Beaufort 3 or below) are shown in Tables 2 & 3.

Table 2. Dolphin encounter rates (sightings per 100 km of survey effort) per set during August's surveys in West Lantau (WL)

		Encounter rate (STG) (no. of on-effort dolphin sightings per 100 km of survey effort)	Encounter rate (ANI) (no. of dolphins from all on-effort sightings per 100 km of survey effort)
		Primary Lines Only	Primary Lines Only
West	Set 1: August 9 th	4.6	4.6
Lantau	Set 2: August 16 th	13.1	34.9

Table 3. Overall dolphin encounter rates (sightings per 100 km of survey effort) in August's surveys on primary lines only as well as both primary lines and secondary lines in West Lantau (WL)

	Encounter rate (STG) (no. of on-effort dolphin sightings per 100 km of survey effort)		Encounter rate (ANI) (no. of dolphins from all on-effort sightings per 100 km of survey effort)	
	Primary Lines Only	Both Primary and Secondary Lines	Primary Lines Only	Both Primary and Secondary Lines
West Lantau	9.0	12.3	20.3	27.7

3.1.8. The average group size of Chinese White Dolphins was 2.9 individuals per group during August's surveys, which was lower than the averages in previous months of monitoring surveys.

3.1.9. Most dolphin groups were small in size with 1-3 animals, but there were also two medium-sized groups with 5 and 8 animals respectively (Appendix II).

3.2. Photo-identification Work

3.2.1. A total of nine different individual Chinese White Dolphins were identified nine times during August's surveys (Appendices III and IV).

3.2.2. A number of individuals (i.e. NL37, NL123 and NL295) were known to occur primarily in North Lantau waters in the past, but were found in West Lantau waters in the present monitoring month.

3.2.3. Notably, none of these individuals were accompanied by their calves during their re-sightings in this month's monitoring surveys.

3.3. Conclusion

- 3.3.1. During this month of dolphin monitoring, marine construction activities have continued under this contract. However, no adverse impact on Chinese white dolphins was noticeable from general observations.
- 3.3.2. Due to the monthly variation in dolphin occurrence within the study area, it would be more appropriate to draw conclusion on whether any impacts on dolphins have been detected related to the construction activities of this project in the quarterly EM&A report, where comparison on distribution, group size and encounter rates of dolphins between the quarterly impact monitoring period (i.e. June-August 2016) and baseline monitoring period will be made.

4. References

- Buckland, S. T., Anderson, D. R., Burnham, K. P., Laake, J. L., Borchers, D. L., and Thomas, L. 2001. Introduction to distance sampling: estimating abundance of biological populations. Oxford University Press, London.
- Hung, S. K. 2014. Monitoring of marine mammals in Hong Kong waters: final report (2013-14). An unpublished report submitted to the Agriculture, Fisheries and Conservation Department of Hong Kong SAR Government, 181 pp.
- Hung, S. K. 2015. Monitoring of marine mammals in Hong Kong waters: final report (2014-15). An unpublished report submitted to the Agriculture, Fisheries and Conservation Department of Hong Kong SAR Government, 198 pp.
- Jefferson, T. A. 2000. Population biology of the Indo-Pacific hump-backed dolphin in Hong Kong waters. Wildlife Monographs 144:1-65.

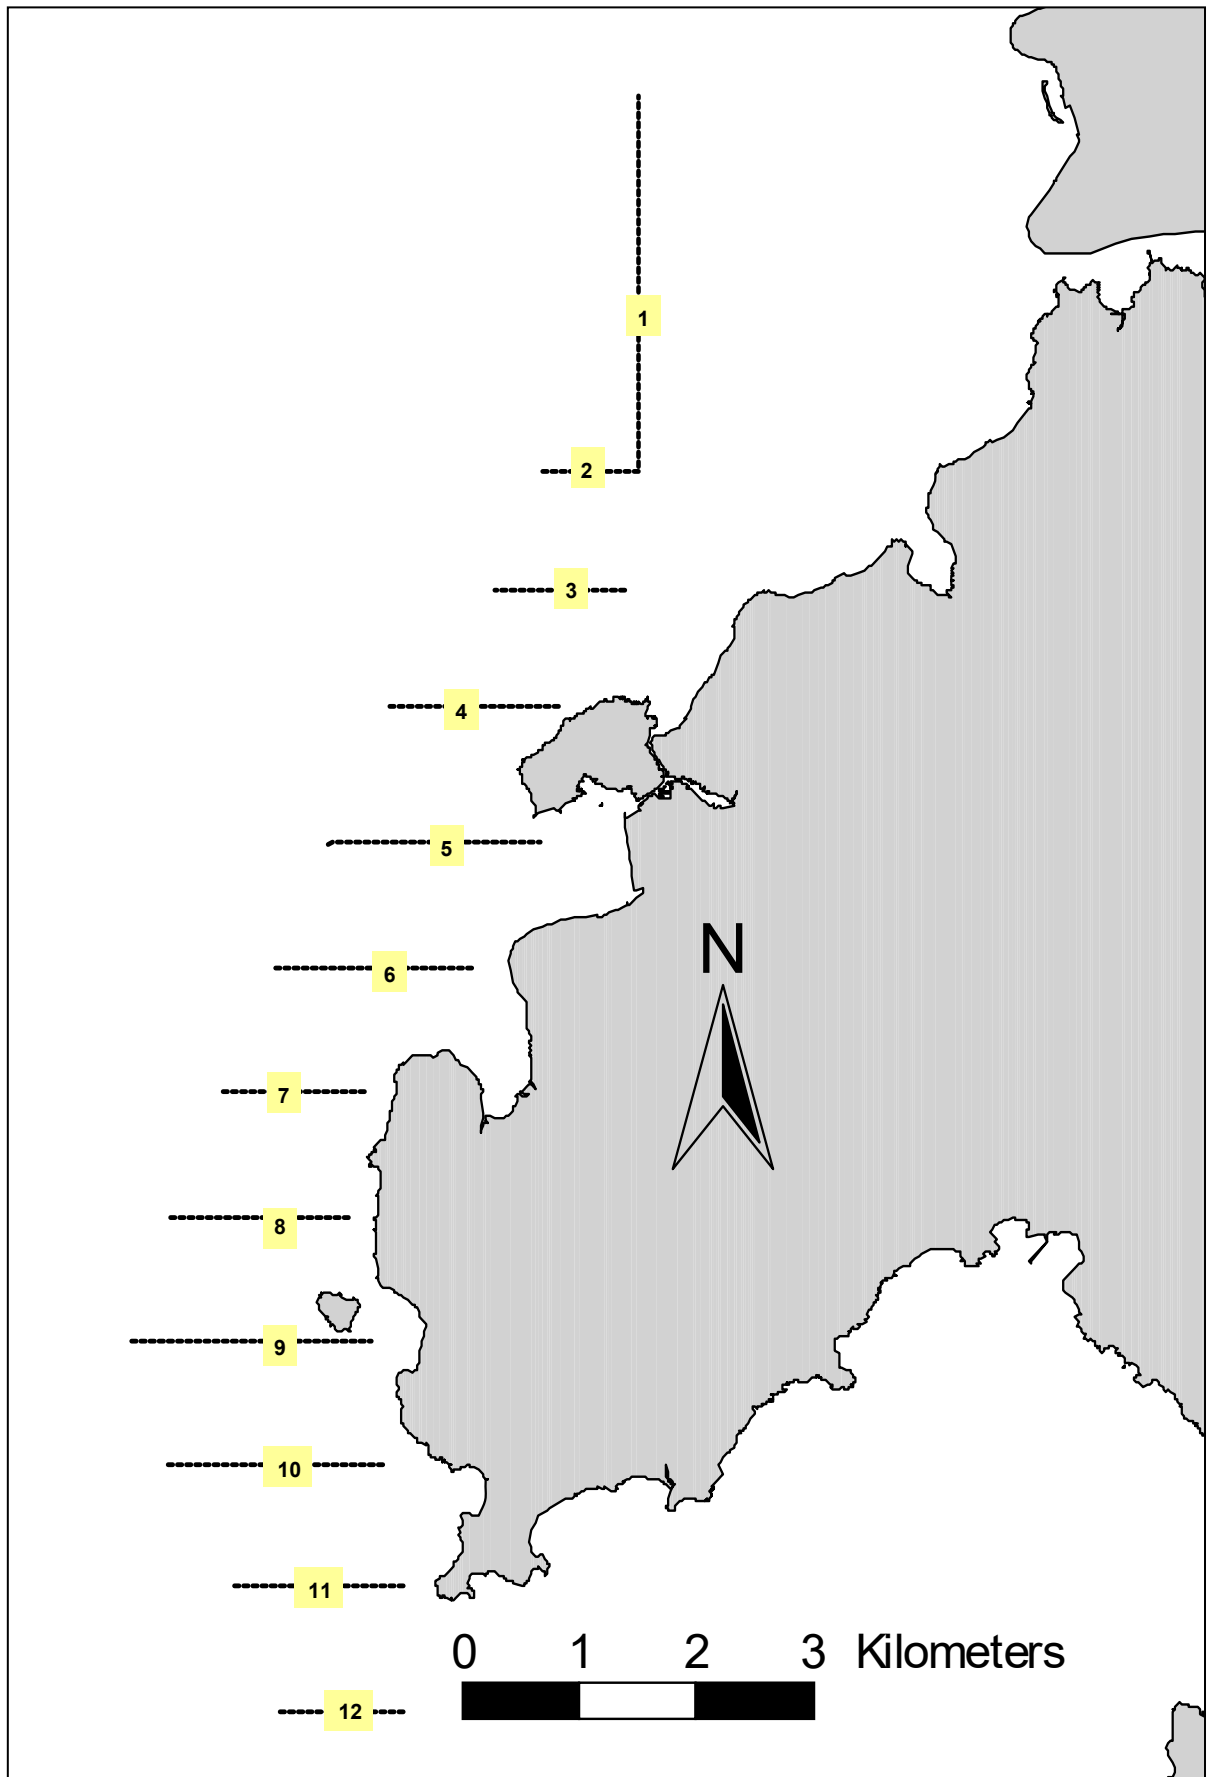


Figure 1. Transect Line Layout in West Lantau Survey Areas

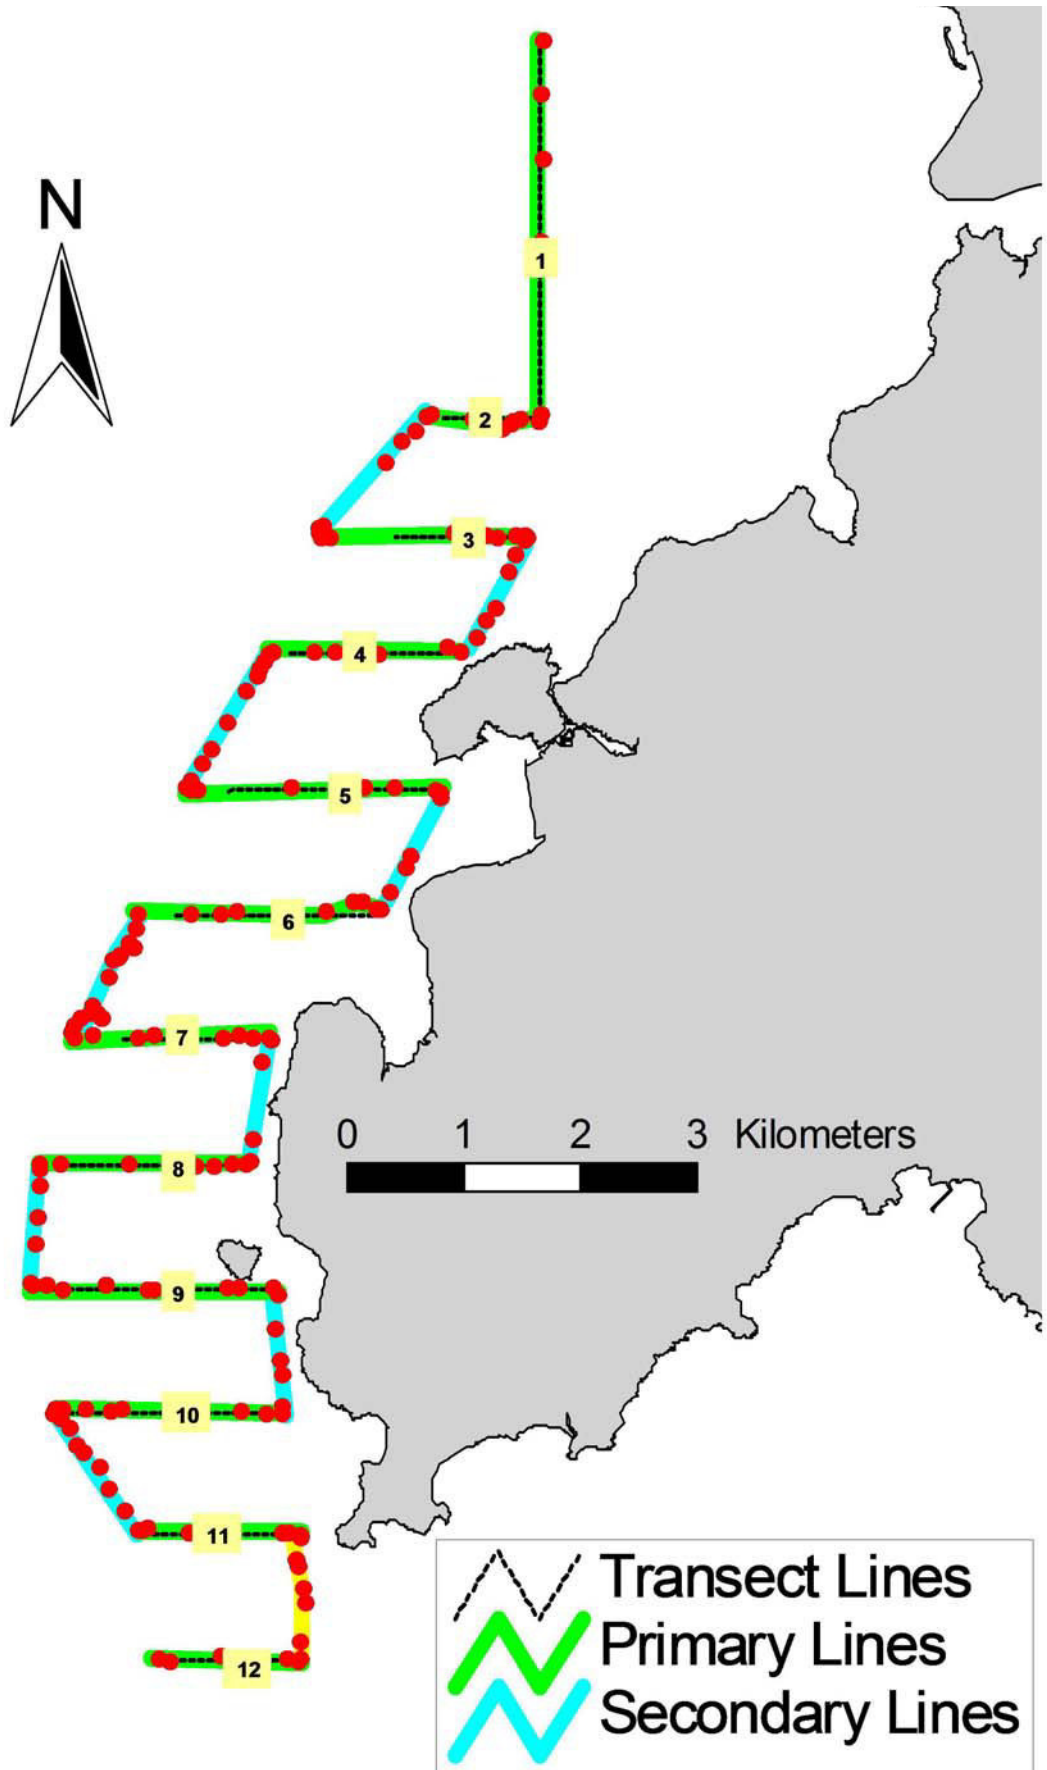


Figure 2. Survey Route on August 9th, 2016 (note: red dots represent the tracked positions of survey boat logged continuously by GPS throughout the course of the survey)

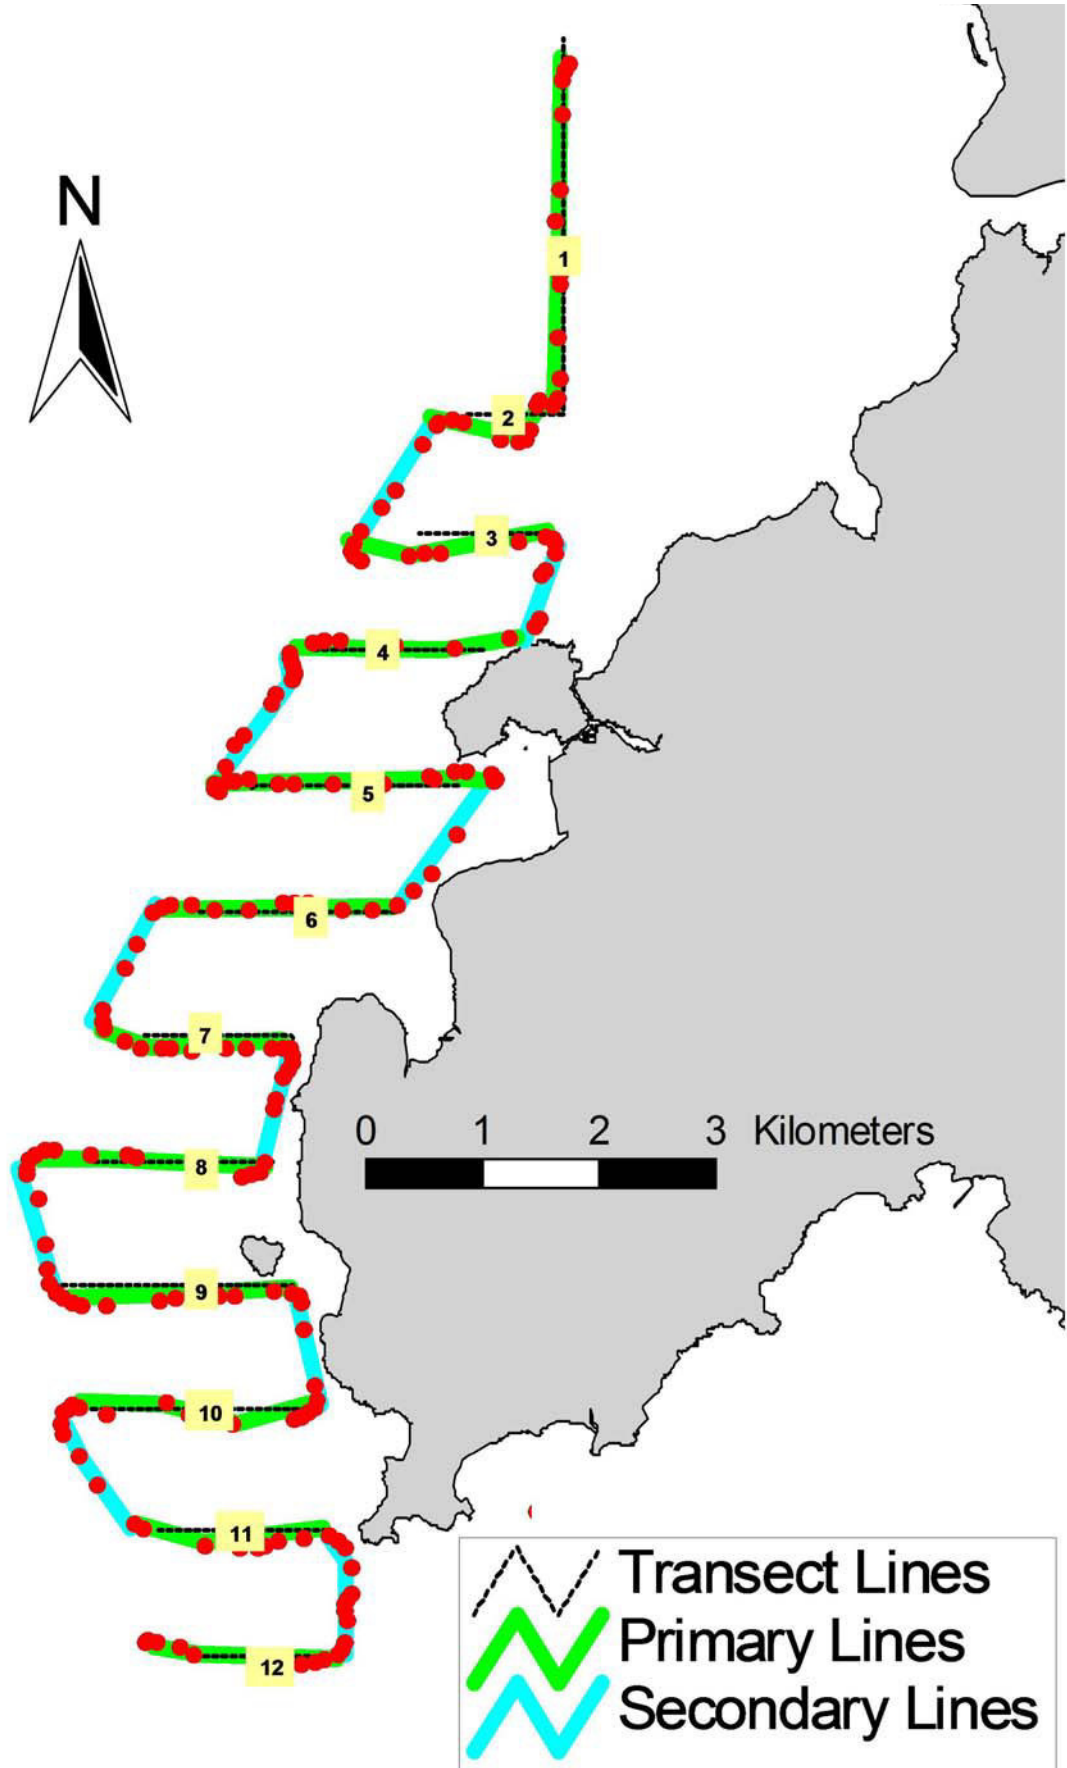


Figure 3. Survey Route on August 16th, 2016 (note: red dots represent the tracked positions of survey boat logged continuously by GPS throughout the course of the survey)

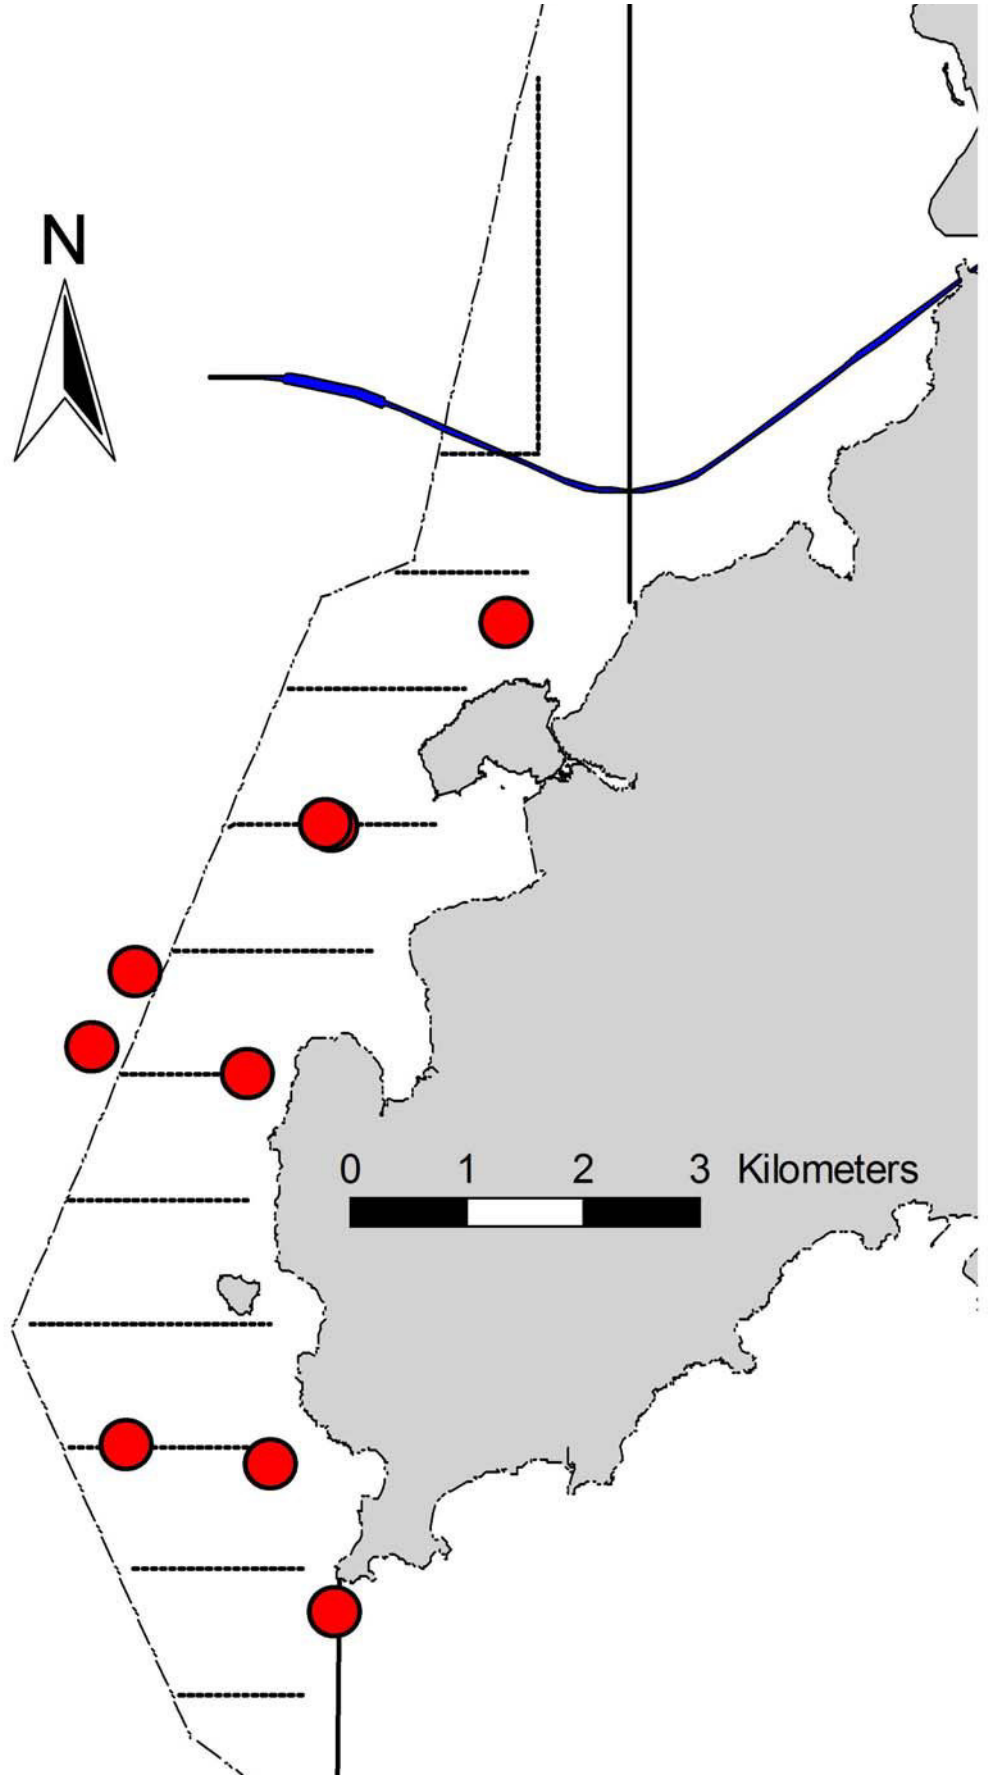


Figure 4. Distribution of Chinese White Dolphin Sighting during August 2016 HKLR09 Monitoring Surveys

Appendix I. HKLR09 Survey Effort Database (August 2016)

(Abbreviations: BEAU = Beaufort Sea State; P = Primary Line Effort; S = Secondary Line Effort)

DATE	AREA	BEAU	EFFORT	SEASON	VESSEL	TYPE	P/S
9-Aug-16	W LANTAU	1	3.12	SUMMER	STANDARD31516	HKLR	P
9-Aug-16	W LANTAU	2	17.31	SUMMER	STANDARD31516	HKLR	P
9-Aug-16	W LANTAU	3	1.10	SUMMER	STANDARD31516	HKLR	P
9-Aug-16	W LANTAU	1	1.09	SUMMER	STANDARD31516	HKLR	S
9-Aug-16	W LANTAU	2	9.52	SUMMER	STANDARD31516	HKLR	S
16-Aug-16	W LANTAU	1	0.62	SUMMER	STANDARD36826	HKLR	P
16-Aug-16	W LANTAU	2	20.78	SUMMER	STANDARD36826	HKLR	P
16-Aug-16	W LANTAU	3	1.49	SUMMER	STANDARD36826	HKLR	P
16-Aug-16	W LANTAU	1	1.35	SUMMER	STANDARD36826	HKLR	S
16-Aug-16	W LANTAU	2	7.20	SUMMER	STANDARD36826	HKLR	S
16-Aug-16	W LANTAU	3	1.32	SUMMER	STANDARD36826	HKLR	S

Appendix II. HKLR09 Chinese White Dolphin Sighting Database (August 2016)

(Abberviations: STG# = Sighting Number; HRD SZ = Dolphin Herd Size; BEAU = Beaufort Sea State; PSD = Perpendicular Distance; ND = Not Determined; BOAT ASSOC. = Fishing Boat Association; P/S: Sighting Made on Primary/Secondary Line)

DATE	STG #	TIME	HRD SZ	AREA	BEAU	PSD	EFFORT	TYPE	NORTHING	EASTING	SEASON	BOAT ASSOC.	P/S
09-Aug-16	1	1048	3	W LANTAU	2	288	ON	HKLR	814088	803463	SUMMER	NONE	S
09-Aug-16	2	1114	8	W LANTAU	2	ND	OFF	HKLR	812452	801975	SUMMER	NONE	
09-Aug-16	3	1141	3	W LANTAU	2	183	ON	HKLR	811282	800292	SUMMER	NONE	S
09-Aug-16	4	1152	1	W LANTAU	2	212	ON	HKLR	810674	799919	SUMMER	NONE	S
09-Aug-16	5	1204	1	W LANTAU	2	233	ON	HKLR	810460	801249	SUMMER	NONE	P
16-Aug-16	1	1101	5	W LANTAU	3	232	ON	HKLR	812474	801923	SUMMER	NONE	P
16-Aug-16	2	1224	2	W LANTAU	2	308	ON	HKLR	807315	801448	SUMMER	NONE	P
16-Aug-16	3	1237	1	W LANTAU	2	454	ON	HKLR	807473	800221	SUMMER	NONE	P
16-Aug-16	4	1257	2	W LANTAU	2	33	ON	HKLR	806118	801992	SUMMER	NONE	S

Appendix III. Individual dolphins identified during HKLR09 monitoring surveys in August 2016

ID#	DATE	STG#	AREA
CH113	16/08/16	4	W LANTAU
NL37	09/08/16	2	W LANTAU
NL123	16/08/16	2	W LANTAU
NL295	09/08/16	2	W LANTAU
NL302	16/08/16	1	W LANTAU
WL46	09/08/16	2	W LANTAU
WL79	09/08/16	1	W LANTAU
WL124	16/08/16	1	W LANTAU
WL216	09/08/16	1	W LANTAU

WL79_20160809_1



WL216_20160809_1



NL37_20160809_2



NL295_20160809_2



WL46_20160809_2



NL302_20160816_1



WL124_20160816_1



NL123_20160816_2



CH113_20160816_4



Appendix IV. Photographs of Identified Individual Dolphins in August 2016 (HKLR09)

APPENDIX J
WIND DATA

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
1-Aug-2016	0:00	2.9	E
1-Aug-2016	1:00	2.9	ENE
1-Aug-2016	2:00	2.6	ENE
1-Aug-2016	3:00	2.8	ENE
1-Aug-2016	4:00	3.2	ENE
1-Aug-2016	5:00	3.8	ENE
1-Aug-2016	6:00	3.5	N
1-Aug-2016	7:00	3.8	NE
1-Aug-2016	8:00	4	NE
1-Aug-2016	9:00	4.6	NE
1-Aug-2016	10:00	4.6	NNE
1-Aug-2016	11:00	4.7	NNE
1-Aug-2016	12:00	4.5	NE
1-Aug-2016	13:00	4.6	NE
1-Aug-2016	14:00	4.4	ENE
1-Aug-2016	15:00	4.6	N
1-Aug-2016	16:00	4.4	ENE
1-Aug-2016	17:00	4.4	NE
1-Aug-2016	18:00	4.4	NE
1-Aug-2016	19:00	3.4	ENE
1-Aug-2016	20:00	3.2	W
1-Aug-2016	21:00	3.4	W
1-Aug-2016	22:00	3.1	SE
1-Aug-2016	23:00	3.2	SE
2-Aug-2016	0:00	3.7	WNW
2-Aug-2016	1:00	4	S
2-Aug-2016	2:00	4.1	NE
2-Aug-2016	3:00	4	E
2-Aug-2016	4:00	4.1	E
2-Aug-2016	5:00	4.3	E
2-Aug-2016	6:00	4.1	NW
2-Aug-2016	7:00	4.4	N
2-Aug-2016	8:00	4.3	NE
2-Aug-2016	9:00	4.4	S
2-Aug-2016	10:00	4.6	NE
2-Aug-2016	11:00	4.8	NNE
2-Aug-2016	12:00	4.8	NE
2-Aug-2016	13:00	4.7	SSE
2-Aug-2016	14:00	4.7	N
2-Aug-2016	15:00	4.6	N
2-Aug-2016	16:00	4.8	ENE
2-Aug-2016	17:00	4.6	NE
2-Aug-2016	18:00	4.4	N
2-Aug-2016	19:00	4.4	WNW
2-Aug-2016	20:00	3.8	NNE
2-Aug-2016	21:00	3.5	NE
2-Aug-2016	22:00	3.5	ENE
2-Aug-2016	23:00	3.7	ENE
3-Aug-2016	0:00	3.5	NE
3-Aug-2016	1:00	4.1	NE
3-Aug-2016	2:00	4.1	ENE
3-Aug-2016	3:00	4.3	ENE
3-Aug-2016	4:00	4.3	N
3-Aug-2016	5:00	4	WNW

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
3-Aug-2016	6:00	3.8	WNW
3-Aug-2016	7:00	4	WNW
3-Aug-2016	8:00	4	NW
3-Aug-2016	9:00	1.9	NNE
3-Aug-2016	10:00	1.9	NNE
3-Aug-2016	11:00	2.1	NNE
3-Aug-2016	12:00	2.5	NNE
3-Aug-2016	13:00	3	NNE
3-Aug-2016	14:00	2.8	NNE
3-Aug-2016	15:00	2.5	N
3-Aug-2016	16:00	2.8	NE
3-Aug-2016	17:00	2.7	N
3-Aug-2016	18:00	2.2	NE
3-Aug-2016	19:00	2.2	N
3-Aug-2016	20:00	1.2	ENE
3-Aug-2016	21:00	1.2	N
3-Aug-2016	22:00	1	N
3-Aug-2016	23:00	1.2	N
4-Aug-2016	0:00	0.7	W
4-Aug-2016	1:00	0.7	W
4-Aug-2016	2:00	0.7	WSW
4-Aug-2016	3:00	1	WSW
4-Aug-2016	4:00	0.7	W
4-Aug-2016	5:00	1	W
4-Aug-2016	6:00	1.2	SSW
4-Aug-2016	7:00	1.5	WSW
4-Aug-2016	8:00	2.5	WSW
4-Aug-2016	9:00	3.1	WNW
4-Aug-2016	10:00	3.7	W
4-Aug-2016	11:00	3.1	W
4-Aug-2016	12:00	3.5	W
4-Aug-2016	13:00	4.1	S
4-Aug-2016	14:00	3.6	SSW
4-Aug-2016	15:00	3.5	SSE
4-Aug-2016	16:00	3	WNW
4-Aug-2016	17:00	3	W
4-Aug-2016	18:00	3	W
4-Aug-2016	19:00	2.4	N
4-Aug-2016	20:00	1.9	NE
4-Aug-2016	21:00	2.2	ENE
4-Aug-2016	22:00	2.1	NNE
4-Aug-2016	23:00	2.1	NNE
5-Aug-2016	0:00	2.2	NE
5-Aug-2016	1:00	2.4	WNW
5-Aug-2016	2:00	2.2	N
5-Aug-2016	3:00	2.7	NNE
5-Aug-2016	4:00	2.2	ENE
5-Aug-2016	5:00	1.8	ENE
5-Aug-2016	6:00	1.8	ENE
5-Aug-2016	7:00	1.9	ENE
5-Aug-2016	8:00	1.9	N
5-Aug-2016	9:00	2.8	ESE
5-Aug-2016	10:00	3.4	ESE
5-Aug-2016	11:00	3.1	SSE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
5-Aug-2016	12:00	4	SSE
5-Aug-2016	13:00	4.5	ENE
5-Aug-2016	14:00	4	ENE
5-Aug-2016	15:00	3.2	SW
5-Aug-2016	16:00	3.2	W
5-Aug-2016	17:00	3.1	SW
5-Aug-2016	18:00	2.1	W
5-Aug-2016	19:00	2.1	ENE
5-Aug-2016	20:00	2.7	N
5-Aug-2016	21:00	2.7	E
5-Aug-2016	22:00	2.8	E
5-Aug-2016	23:00	2.7	SSW
6-Aug-2016	0:00	2.4	SW
6-Aug-2016	1:00	2.7	WSW
6-Aug-2016	2:00	2.1	W
6-Aug-2016	3:00	1.5	WNW
6-Aug-2016	4:00	1.8	WNW
6-Aug-2016	5:00	2.8	W
6-Aug-2016	6:00	2.5	W
6-Aug-2016	7:00	2.1	S
6-Aug-2016	8:00	2.2	W
6-Aug-2016	9:00	2.4	W
6-Aug-2016	10:00	2.5	W
6-Aug-2016	11:00	2.5	WSW
6-Aug-2016	12:00	2.7	SSW
6-Aug-2016	13:00	2.4	SSW
6-Aug-2016	14:00	2.1	SW
6-Aug-2016	15:00	2.1	SSW
6-Aug-2016	16:00	1.6	SSW
6-Aug-2016	17:00	1.3	WSW
6-Aug-2016	18:00	1	SSW
6-Aug-2016	19:00	1	SW
6-Aug-2016	20:00	1.5	SSW
6-Aug-2016	21:00	2.2	SSW
6-Aug-2016	22:00	2.4	SW
6-Aug-2016	23:00	2.2	SW
7-Aug-2016	0:00	2.5	SW
7-Aug-2016	1:00	2.5	SW
7-Aug-2016	2:00	2.1	SW
7-Aug-2016	3:00	1.9	W
7-Aug-2016	4:00	2.1	W
7-Aug-2016	5:00	2.2	W
7-Aug-2016	6:00	1.9	WSW
7-Aug-2016	7:00	1.8	SW
7-Aug-2016	8:00	2.2	SSW
7-Aug-2016	9:00	2.2	SW
7-Aug-2016	10:00	2.1	WSW
7-Aug-2016	11:00	2.1	W
7-Aug-2016	12:00	2.2	W
7-Aug-2016	13:00	2.2	W
7-Aug-2016	14:00	2.5	SSW
7-Aug-2016	15:00	2.7	SW
7-Aug-2016	16:00	2.8	SSW
7-Aug-2016	17:00	2.2	SW

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
7-Aug-2016	18:00	2.5	WSW
7-Aug-2016	19:00	2.4	SSW
7-Aug-2016	20:00	2.1	WNW
7-Aug-2016	21:00	1.9	W
7-Aug-2016	22:00	2.7	W
7-Aug-2016	23:00	2.8	W
8-Aug-2016	0:00	2.7	W
8-Aug-2016	1:00	2.7	NNE
8-Aug-2016	2:00	2.8	ENE
8-Aug-2016	3:00	2.4	NE
8-Aug-2016	4:00	2.8	NE
8-Aug-2016	5:00	3.1	E
8-Aug-2016	6:00	2.4	WNW
8-Aug-2016	7:00	2.1	NE
8-Aug-2016	8:00	1.9	NNE
8-Aug-2016	9:00	2.1	N
8-Aug-2016	10:00	1.9	N
8-Aug-2016	11:00	2.4	N
8-Aug-2016	12:00	2.1	N
8-Aug-2016	13:00	1.8	N
8-Aug-2016	14:00	2.1	W
8-Aug-2016	15:00	2.4	W
8-Aug-2016	16:00	2.5	W
8-Aug-2016	17:00	1.8	W
8-Aug-2016	18:00	0.9	N
8-Aug-2016	19:00	0.6	W
8-Aug-2016	20:00	0.4	WNW
8-Aug-2016	21:00	1	W
8-Aug-2016	22:00	1.3	S
8-Aug-2016	23:00	1	SW
9-Aug-2016	0:00	0.9	SSW
9-Aug-2016	1:00	0.9	W
9-Aug-2016	2:00	1	W
9-Aug-2016	3:00	0.9	W
9-Aug-2016	4:00	1.2	WSW
9-Aug-2016	5:00	1.3	W
9-Aug-2016	6:00	1.3	WNW
9-Aug-2016	7:00	1	W
9-Aug-2016	8:00	1	W
9-Aug-2016	9:00	2.1	W
9-Aug-2016	10:00	2.5	WSW
9-Aug-2016	11:00	2.2	WSW
9-Aug-2016	12:00	2.2	W
9-Aug-2016	13:00	2.7	W
9-Aug-2016	14:00	1.9	W
9-Aug-2016	15:00	1.8	W
9-Aug-2016	16:00	1.9	NNE
9-Aug-2016	17:00	2.4	NNE
9-Aug-2016	18:00	1.5	NW
9-Aug-2016	19:00	0.6	N
9-Aug-2016	20:00	0.1	N
9-Aug-2016	21:00	0.3	ENE
9-Aug-2016	22:00	0.1	NE
9-Aug-2016	23:00	0.1	NE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
10-Aug-2016	0:00	1	ENE
10-Aug-2016	1:00	1.2	WSW
10-Aug-2016	2:00	1	N
10-Aug-2016	3:00	1.3	N
10-Aug-2016	4:00	0.9	WSW
10-Aug-2016	5:00	0.9	SW
10-Aug-2016	6:00	0.7	NE
10-Aug-2016	7:00	0.7	W
10-Aug-2016	8:00	0.9	W
10-Aug-2016	9:00	1.2	SW
10-Aug-2016	10:00	1.8	ENE
10-Aug-2016	11:00	2.7	ENE
10-Aug-2016	12:00	2.7	W
10-Aug-2016	13:00	2.7	S
10-Aug-2016	14:00	2.5	S
10-Aug-2016	15:00	2.2	S
10-Aug-2016	16:00	2.4	SSW
10-Aug-2016	17:00	2.1	W
10-Aug-2016	18:00	1.9	W
10-Aug-2016	19:00	1.3	SW
10-Aug-2016	20:00	1.2	NE
10-Aug-2016	21:00	1.2	NE
10-Aug-2016	22:00	0.9	NE
10-Aug-2016	23:00	1.3	SSW
11-Aug-2016	0:00	2.2	SSW
11-Aug-2016	1:00	2.4	SW
11-Aug-2016	2:00	2.4	WNW
11-Aug-2016	3:00	1.5	SW
11-Aug-2016	4:00	1.3	WSW
11-Aug-2016	5:00	1	W
11-Aug-2016	6:00	1	W
11-Aug-2016	7:00	0.9	SSW
11-Aug-2016	8:00	1.3	SSW
11-Aug-2016	9:00	1.5	W
11-Aug-2016	10:00	1.5	WNW
11-Aug-2016	11:00	1.9	WNW
11-Aug-2016	12:00	1.9	W
11-Aug-2016	13:00	2.4	W
11-Aug-2016	14:00	2.4	SSE
11-Aug-2016	15:00	2.2	S
11-Aug-2016	16:00	1.9	SSW
11-Aug-2016	17:00	1.9	SSW
11-Aug-2016	18:00	1.5	SSW
11-Aug-2016	19:00	1.2	SSE
11-Aug-2016	20:00	1.3	SSE
11-Aug-2016	21:00	1.3	SSE
11-Aug-2016	22:00	1.3	SE
11-Aug-2016	23:00	1.2	E
12-Aug-2016	0:00	1.5	N
12-Aug-2016	1:00	1.5	N
12-Aug-2016	2:00	1.2	N
12-Aug-2016	3:00	1.6	N
12-Aug-2016	4:00	1.6	N
12-Aug-2016	5:00	0.9	SSW

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
12-Aug-2016	6:00	0.6	S
12-Aug-2016	7:00	1.2	SE
12-Aug-2016	8:00	1.3	N
12-Aug-2016	9:00	1.3	WSW
12-Aug-2016	10:00	2.2	N
12-Aug-2016	11:00	2.1	SSE
12-Aug-2016	12:00	2.7	S
12-Aug-2016	13:00	3.1	SSW
12-Aug-2016	14:00	2.4	SSW
12-Aug-2016	15:00	2.5	E
12-Aug-2016	16:00	2.5	NW
12-Aug-2016	17:00	2.1	N
12-Aug-2016	18:00	1.8	SW
12-Aug-2016	19:00	0.9	NE
12-Aug-2016	20:00	0.9	E
12-Aug-2016	21:00	0.9	ENE
12-Aug-2016	22:00	0.7	NNE
12-Aug-2016	23:00	0.7	NNE
13-Aug-2016	0:00	0.7	N
13-Aug-2016	1:00	0.6	N
13-Aug-2016	2:00	0.6	N
13-Aug-2016	3:00	0.7	SW
13-Aug-2016	4:00	0.9	NNE
13-Aug-2016	5:00	0.6	ENE
13-Aug-2016	6:00	0.3	N
13-Aug-2016	7:00	0.6	NNE
13-Aug-2016	8:00	0.7	NNE
13-Aug-2016	9:00	1.2	NE
13-Aug-2016	10:00	1.3	ENE
13-Aug-2016	11:00	1.3	ENE
13-Aug-2016	12:00	1.6	N
13-Aug-2016	13:00	2.2	ENE
13-Aug-2016	14:00	2.4	N
13-Aug-2016	15:00	2.5	N
13-Aug-2016	16:00	2.2	N
13-Aug-2016	17:00	1.9	ENE
13-Aug-2016	18:00	1.5	NE
13-Aug-2016	19:00	1.3	ESE
13-Aug-2016	20:00	1	W
13-Aug-2016	21:00	0.7	SW
13-Aug-2016	22:00	0.9	SW
13-Aug-2016	23:00	1.5	WSW
14-Aug-2016	0:00	1.3	WSW
14-Aug-2016	1:00	1.2	NE
14-Aug-2016	2:00	1	ENE
14-Aug-2016	3:00	1.5	NE
14-Aug-2016	4:00	1.3	N
14-Aug-2016	5:00	1.2	NE
14-Aug-2016	6:00	1.2	NE
14-Aug-2016	7:00	1.3	NE
14-Aug-2016	8:00	1.5	N
14-Aug-2016	9:00	1.8	NE
14-Aug-2016	10:00	1.2	N
14-Aug-2016	11:00	1.3	ENE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
14-Aug-2016	12:00	2.5	ENE
14-Aug-2016	13:00	2.7	S
14-Aug-2016	14:00	2.7	NNE
14-Aug-2016	15:00	2.2	NW
14-Aug-2016	16:00	2.4	SE
14-Aug-2016	17:00	2.1	WNW
14-Aug-2016	18:00	1.9	SW
14-Aug-2016	19:00	1.2	WSW
14-Aug-2016	20:00	1	WSW
14-Aug-2016	21:00	0.6	WSW
14-Aug-2016	22:00	0.9	W
14-Aug-2016	23:00	0.9	WSW
15-Aug-2016	0:00	0.9	WSW
15-Aug-2016	1:00	0.6	W
15-Aug-2016	2:00	0.7	WSW
15-Aug-2016	3:00	0.7	WSW
15-Aug-2016	4:00	0.4	S
15-Aug-2016	5:00	0.1	SSW
15-Aug-2016	6:00	1.5	W
15-Aug-2016	7:00	0.1	W
15-Aug-2016	8:00	0.6	W
15-Aug-2016	9:00	1.3	W
15-Aug-2016	10:00	1.9	W
15-Aug-2016	11:00	1.8	WSW
15-Aug-2016	12:00	1.6	W
15-Aug-2016	13:00	2.1	W
15-Aug-2016	14:00	2.4	W
15-Aug-2016	15:00	1.8	W
15-Aug-2016	16:00	1.8	W
15-Aug-2016	17:00	1.6	WSW
15-Aug-2016	18:00	1.5	SSW
15-Aug-2016	19:00	0.7	SSW
15-Aug-2016	20:00	0.6	SW
15-Aug-2016	21:00	0.3	W
15-Aug-2016	22:00	0.3	WNW
15-Aug-2016	23:00	0.4	W
16-Aug-2016	0:00	0.3	W
16-Aug-2016	1:00	0.4	W
16-Aug-2016	2:00	0.1	SSE
16-Aug-2016	3:00	1.2	ENE
16-Aug-2016	4:00	0.8	W
16-Aug-2016	5:00	0.8	W
16-Aug-2016	6:00	0.9	N
16-Aug-2016	7:00	0.9	N
16-Aug-2016	8:00	0.1	NNE
16-Aug-2016	9:00	0.1	ESE
16-Aug-2016	10:00	0.4	SSE
16-Aug-2016	11:00	0.7	WSW
16-Aug-2016	12:00	1	WSW
16-Aug-2016	13:00	1.6	NW
16-Aug-2016	14:00	2.1	WSW
16-Aug-2016	15:00	2.4	N
16-Aug-2016	16:00	2.1	WSW
16-Aug-2016	17:00	1.8	WSW

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
16-Aug-2016	18:00	0.9	SSW
16-Aug-2016	19:00	0.7	WNW
16-Aug-2016	20:00	0.3	WSW
16-Aug-2016	21:00	0.4	W
16-Aug-2016	22:00	0.1	W
16-Aug-2016	23:00	0.5	WSW
17-Aug-2016	0:00	0.5	W
17-Aug-2016	1:00	0.1	WSW
17-Aug-2016	2:00	0.4	SW
17-Aug-2016	3:00	0.9	WSW
17-Aug-2016	4:00	0.9	WSW
17-Aug-2016	5:00	0.9	SW
17-Aug-2016	6:00	1	SW
17-Aug-2016	7:00	1.2	W
17-Aug-2016	8:00	1	SSW
17-Aug-2016	9:00	0.9	W
17-Aug-2016	10:00	1	W
17-Aug-2016	11:00	1.3	ESE
17-Aug-2016	12:00	1.6	SSW
17-Aug-2016	13:00	1.9	SSW
17-Aug-2016	14:00	1.6	SSW
17-Aug-2016	15:00	1.9	S
17-Aug-2016	16:00	2.2	W
17-Aug-2016	17:00	2.1	W
17-Aug-2016	18:00	1.8	W
17-Aug-2016	19:00	1.3	WNW
17-Aug-2016	20:00	0.6	W
17-Aug-2016	21:00	0.3	W
17-Aug-2016	22:00	0.3	W
17-Aug-2016	23:00	0.3	W
18-Aug-2016	0:00	0.3	WSW
18-Aug-2016	1:00	0.3	W
18-Aug-2016	2:00	0.4	WNW
18-Aug-2016	3:00	0.3	W
18-Aug-2016	4:00	0.4	W
18-Aug-2016	5:00	0.4	W
18-Aug-2016	6:00	0.3	W
18-Aug-2016	7:00	0.3	WNW
18-Aug-2016	8:00	0.3	W
18-Aug-2016	9:00	0.4	W
18-Aug-2016	10:00	2.1	SW
18-Aug-2016	11:00	2.2	W
18-Aug-2016	12:00	2.2	WSW
18-Aug-2016	13:00	2.1	W
18-Aug-2016	14:00	2.2	NNE
18-Aug-2016	15:00	2.2	WSW
18-Aug-2016	16:00	2.2	S
18-Aug-2016	17:00	1.9	S
18-Aug-2016	18:00	1.9	W
18-Aug-2016	19:00	2.5	SW
18-Aug-2016	20:00	1.5	W
18-Aug-2016	21:00	1.8	WNW
18-Aug-2016	22:00	1.5	W
18-Aug-2016	23:00	1	WSW

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
19-Aug-2016	0:00	1.2	W
19-Aug-2016	1:00	1.5	WSW
19-Aug-2016	2:00	1.5	SSW
19-Aug-2016	3:00	1.5	SSW
19-Aug-2016	4:00	2.1	SSW
19-Aug-2016	5:00	1.9	WSW
19-Aug-2016	6:00	2.1	WSW
19-Aug-2016	7:00	1.6	W
19-Aug-2016	8:00	1.5	W
19-Aug-2016	9:00	1.9	W
19-Aug-2016	10:00	1.6	SSE
19-Aug-2016	11:00	2.1	S
19-Aug-2016	12:00	2.7	S
19-Aug-2016	13:00	3	WSW
19-Aug-2016	14:00	2.5	W
19-Aug-2016	15:00	2.4	W
19-Aug-2016	16:00	1.9	W
19-Aug-2016	17:00	1.9	W
19-Aug-2016	18:00	1.9	WSW
19-Aug-2016	19:00	1.8	WSW
19-Aug-2016	20:00	1.6	WSW
19-Aug-2016	21:00	0.9	W
19-Aug-2016	22:00	0.7	W
19-Aug-2016	23:00	0.7	S
20-Aug-2016	0:00	0.7	W
20-Aug-2016	1:00	0.9	WNW
20-Aug-2016	2:00	1.5	W
20-Aug-2016	3:00	1.3	W
20-Aug-2016	4:00	1.3	W
20-Aug-2016	5:00	1.2	W
20-Aug-2016	6:00	1.3	W
20-Aug-2016	7:00	1	W
20-Aug-2016	8:00	1	W
20-Aug-2016	9:00	1.5	W
20-Aug-2016	10:00	1.8	W
20-Aug-2016	11:00	1.6	WNW
20-Aug-2016	12:00	1.8	W
20-Aug-2016	13:00	2.1	WNW
20-Aug-2016	14:00	2.1	W
20-Aug-2016	15:00	2.7	WNW
20-Aug-2016	16:00	2.5	WNW
20-Aug-2016	17:00	2.1	S
20-Aug-2016	18:00	1.3	SSW
20-Aug-2016	19:00	0.9	W
20-Aug-2016	20:00	1.3	WNW
20-Aug-2016	21:00	1.6	SSE
20-Aug-2016	22:00	1.3	W
20-Aug-2016	23:00	1.6	W
21-Aug-2016	0:00	1.9	W
21-Aug-2016	1:00	1.8	W
21-Aug-2016	2:00	1.8	W
21-Aug-2016	3:00	1.6	W
21-Aug-2016	4:00	1.2	W
21-Aug-2016	5:00	1	W

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
21-Aug-2016	6:00	0.7	ENE
21-Aug-2016	7:00	0.4	WSW
21-Aug-2016	8:00	0.3	WSW
21-Aug-2016	9:00	0.3	SW
21-Aug-2016	10:00	0.6	SSW
21-Aug-2016	11:00	1.8	SW
21-Aug-2016	12:00	1.9	SW
21-Aug-2016	13:00	1.9	SW
21-Aug-2016	14:00	1.8	SW
21-Aug-2016	15:00	1.6	SW
21-Aug-2016	16:00	1.9	SW
21-Aug-2016	17:00	1.6	SW
21-Aug-2016	18:00	1.9	WSW
21-Aug-2016	19:00	2.2	SW
21-Aug-2016	20:00	1.2	SW
21-Aug-2016	21:00	1	SW
21-Aug-2016	22:00	0.9	SW
21-Aug-2016	23:00	1.3	W
22-Aug-2016	0:00	1.3	SW
22-Aug-2016	1:00	1.3	SSW
22-Aug-2016	2:00	0.7	SW
22-Aug-2016	3:00	1.5	WSW
22-Aug-2016	4:00	1.8	SW
22-Aug-2016	5:00	1.5	SW
22-Aug-2016	6:00	1	SW
22-Aug-2016	7:00	1.2	WSW
22-Aug-2016	8:00	1.5	WSW
22-Aug-2016	9:00	1.6	SW
22-Aug-2016	10:00	1.9	SW
22-Aug-2016	11:00	2.4	SW
22-Aug-2016	12:00	2.4	SW
22-Aug-2016	13:00	2.1	SSW
22-Aug-2016	14:00	1.8	SW
22-Aug-2016	15:00	1.6	SW
22-Aug-2016	16:00	1.8	SW
22-Aug-2016	17:00	1.9	SW
22-Aug-2016	18:00	1.8	W
22-Aug-2016	19:00	1.9	W
22-Aug-2016	20:00	1.8	W
22-Aug-2016	21:00	2.2	W
22-Aug-2016	22:00	2.5	W
22-Aug-2016	23:00	2.2	WNW
23-Aug-2016	0:00	2.4	W
23-Aug-2016	1:00	2.4	WNW
23-Aug-2016	2:00	2.5	W
23-Aug-2016	3:00	2.5	W
23-Aug-2016	4:00	2.2	W
23-Aug-2016	5:00	2.2	WNW
23-Aug-2016	6:00	1.5	WNW
23-Aug-2016	7:00	1.6	WNW
23-Aug-2016	8:00	2.4	WNW
23-Aug-2016	9:00	2.7	WNW
23-Aug-2016	10:00	2.2	WNW
23-Aug-2016	11:00	1.9	W

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
23-Aug-2016	12:00	2.1	SSW
23-Aug-2016	13:00	1.8	SSW
23-Aug-2016	14:00	1.8	SSW
23-Aug-2016	15:00	2.1	W
23-Aug-2016	16:00	2.1	W
23-Aug-2016	17:00	1.8	W
23-Aug-2016	18:00	1	W
23-Aug-2016	19:00	0.6	WSW
23-Aug-2016	20:00	1.3	W
23-Aug-2016	21:00	1.3	W
23-Aug-2016	22:00	2.2	W
23-Aug-2016	23:00	1.9	WSW
24-Aug-2016	0:00	2.2	SW
24-Aug-2016	1:00	1.8	SW
24-Aug-2016	2:00	2.2	SSW
24-Aug-2016	3:00	2.4	SSW
24-Aug-2016	4:00	2.1	S
24-Aug-2016	5:00	1.6	WSW
24-Aug-2016	6:00	1.6	W
24-Aug-2016	7:00	1.2	WSW
24-Aug-2016	8:00	1.8	WSW
24-Aug-2016	9:00	2.1	NNE
24-Aug-2016	10:00	2.1	NNE
24-Aug-2016	11:00	1.9	NE
24-Aug-2016	12:00	1.5	ENE
24-Aug-2016	13:00	1.6	E
24-Aug-2016	14:00	1.6	ENE
24-Aug-2016	15:00	2.4	NE
24-Aug-2016	16:00	2.5	NNE
24-Aug-2016	17:00	1.9	NNE
24-Aug-2016	18:00	1.5	NNE
24-Aug-2016	19:00	1.5	NNE
24-Aug-2016	20:00	1.8	N
24-Aug-2016	21:00	1.9	NNE
24-Aug-2016	22:00	1.5	NNE
24-Aug-2016	23:00	1.6	NNE
25-Aug-2016	0:00	1.9	NNE
25-Aug-2016	1:00	1.9	N
25-Aug-2016	2:00	1.8	NNE
25-Aug-2016	3:00	1.9	NNE
25-Aug-2016	4:00	1.9	NNE
25-Aug-2016	5:00	1.6	NNE
25-Aug-2016	6:00	1.9	N
25-Aug-2016	7:00	1.2	N
25-Aug-2016	8:00	1	NNE
25-Aug-2016	9:00	1.9	NNE
25-Aug-2016	10:00	2.1	N
25-Aug-2016	11:00	2.5	NNE
25-Aug-2016	12:00	3.1	N
25-Aug-2016	13:00	3	NNE
25-Aug-2016	14:00	2.7	NNE
25-Aug-2016	15:00	2.4	NNE
25-Aug-2016	16:00	2.8	NNE
25-Aug-2016	17:00	2.1	NNE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
25-Aug-2016	18:00	1.8	NNE
25-Aug-2016	19:00	0.9	NNE
25-Aug-2016	20:00	0.9	NNE
25-Aug-2016	21:00	0.7	N
25-Aug-2016	22:00	0.7	N
25-Aug-2016	23:00	1.3	NNE
26-Aug-2016	0:00	2.1	N
26-Aug-2016	1:00	1.6	NNE
26-Aug-2016	2:00	2.2	NNE
26-Aug-2016	3:00	1	NNE
26-Aug-2016	4:00	1.2	NNE
26-Aug-2016	5:00	1.6	NNE
26-Aug-2016	6:00	1.3	ENE
26-Aug-2016	7:00	1.3	NE
26-Aug-2016	8:00	1.6	N
26-Aug-2016	9:00	2.1	N
26-Aug-2016	10:00	3.2	NE
26-Aug-2016	11:00	3.6	NNE
26-Aug-2016	12:00	3.8	NNE
26-Aug-2016	13:00	3.5	NE
26-Aug-2016	14:00	3.1	NE
26-Aug-2016	15:00	2.8	NE
26-Aug-2016	16:00	1.8	ENE
26-Aug-2016	17:00	1.2	ENE
26-Aug-2016	18:00	0.9	NNE
26-Aug-2016	19:00	0.9	NNE
26-Aug-2016	20:00	0.9	N
26-Aug-2016	21:00	1.2	NNE
26-Aug-2016	22:00	1.6	N
26-Aug-2016	23:00	1.5	NNE
27-Aug-2016	0:00	1.9	WNW
27-Aug-2016	1:00	1.9	ENE
27-Aug-2016	2:00	1.8	ENE
27-Aug-2016	3:00	1.9	NNE
27-Aug-2016	4:00	1.6	NE
27-Aug-2016	5:00	1.5	NNE
27-Aug-2016	6:00	1.3	NNE
27-Aug-2016	7:00	1.6	NNE
27-Aug-2016	8:00	2.1	N
27-Aug-2016	9:00	2.4	N
27-Aug-2016	10:00	2.7	N
27-Aug-2016	11:00	3.3	N
27-Aug-2016	12:00	3.5	N
27-Aug-2016	13:00	3.1	S
27-Aug-2016	14:00	3.1	SW
27-Aug-2016	15:00	2.8	S
27-Aug-2016	16:00	2.8	W
27-Aug-2016	17:00	2.2	W
27-Aug-2016	18:00	1.9	W
27-Aug-2016	19:00	1.5	S
27-Aug-2016	20:00	1.3	SSW
27-Aug-2016	21:00	1.5	W
27-Aug-2016	22:00	1.5	N
27-Aug-2016	23:00	1.6	WNW

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
28-Aug-2016	0:00	1	NE
28-Aug-2016	1:00	1.6	NNE
28-Aug-2016	2:00	1.3	NNE
28-Aug-2016	3:00	1.6	ENE
28-Aug-2016	4:00	2.1	ESE
28-Aug-2016	5:00	2.1	WSW
28-Aug-2016	6:00	1.6	WSW
28-Aug-2016	7:00	2.1	W
28-Aug-2016	8:00	2.7	W
28-Aug-2016	9:00	2.5	W
28-Aug-2016	10:00	3.2	W
28-Aug-2016	11:00	3	WSW
28-Aug-2016	12:00	2.2	SSW
28-Aug-2016	13:00	2.7	WSW
28-Aug-2016	14:00	2.5	SSW
28-Aug-2016	15:00	1.9	WSW
28-Aug-2016	16:00	1.9	WSW
28-Aug-2016	17:00	1.6	WSW
28-Aug-2016	18:00	1.2	WSW
28-Aug-2016	19:00	1.2	W
28-Aug-2016	20:00	1.2	WSW
28-Aug-2016	21:00	1.2	WSW
28-Aug-2016	22:00	1.2	WSW
28-Aug-2016	23:00	1.3	NE
29-Aug-2016	0:00	1	NNE
29-Aug-2016	1:00	0.9	NE
29-Aug-2016	2:00	0.9	NNE
29-Aug-2016	3:00	1.2	NE
29-Aug-2016	4:00	1.2	NNE
29-Aug-2016	5:00	1.8	N
29-Aug-2016	6:00	1	N
29-Aug-2016	7:00	1.2	N
29-Aug-2016	8:00	0.9	N
29-Aug-2016	9:00	1.5	NNE
29-Aug-2016	10:00	1.5	N
29-Aug-2016	11:00	2.2	N
29-Aug-2016	12:00	2.5	NNE
29-Aug-2016	13:00	1.9	NNE
29-Aug-2016	14:00	1.6	NE
29-Aug-2016	15:00	1.8	NE
29-Aug-2016	16:00	1.8	N
29-Aug-2016	17:00	1.3	N
29-Aug-2016	18:00	1.2	N
29-Aug-2016	19:00	0.4	NNE
29-Aug-2016	20:00	0.6	NNE
29-Aug-2016	21:00	0.6	NE
29-Aug-2016	22:00	0.6	NNE
29-Aug-2016	23:00	0.6	NNE
30-Aug-2016	0:00	0.7	NNE
30-Aug-2016	1:00	0.9	NNE
30-Aug-2016	2:00	0.7	NNE
30-Aug-2016	3:00	0.4	NNE
30-Aug-2016	4:00	1	N
30-Aug-2016	5:00	1.8	NNE

Appendix J - Wind Data

Date	Time	Wind Speed m/s	Direction
30-Aug-2016	6:00	1.9	N
30-Aug-2016	7:00	3.2	NNE
30-Aug-2016	8:00	3.1	NE
30-Aug-2016	9:00	3.4	NNE
30-Aug-2016	10:00	3.4	N
30-Aug-2016	11:00	3	NE
30-Aug-2016	12:00	2.8	NE
30-Aug-2016	13:00	1.8	NE
30-Aug-2016	14:00	1.2	NE
30-Aug-2016	15:00	1	NE
30-Aug-2016	16:00	0.9	NNE
30-Aug-2016	17:00	1	N
30-Aug-2016	18:00	0.9	NNE
30-Aug-2016	19:00	0.7	N
30-Aug-2016	20:00	1	N
30-Aug-2016	21:00	1.2	NNE
30-Aug-2016	22:00	1	NE
30-Aug-2016	23:00	1	NNE
31-Aug-2016	0:00	1.2	N
31-Aug-2016	1:00	1.2	N
31-Aug-2016	2:00	1	NNE
31-Aug-2016	3:00	0.9	N
31-Aug-2016	4:00	0.7	N
31-Aug-2016	5:00	0.9	N
31-Aug-2016	6:00	1	N
31-Aug-2016	7:00	1.8	N
31-Aug-2016	8:00	2.7	NNE
31-Aug-2016	9:00	3	NE
31-Aug-2016	10:00	3.1	NE
31-Aug-2016	11:00	2.8	NE
31-Aug-2016	12:00	2.2	NE
31-Aug-2016	13:00	2.4	N
31-Aug-2016	14:00	0.4	NE
31-Aug-2016	15:00	0.4	NE
31-Aug-2016	16:00	0.9	NE
31-Aug-2016	17:00	1	NE
31-Aug-2016	18:00	0.9	SSW
31-Aug-2016	19:00	1	W
31-Aug-2016	20:00	0.7	WSW
31-Aug-2016	21:00	0.4	SSW
31-Aug-2016	22:00	0.7	WSW
31-Aug-2016	23:00	0.4	WSW

**APPENDIX K
EVENT ACTION PLANS**

Event / Action Plan for Air Quality

EVENT	ACTION			
	ET	IEC	SO	CONTRACTOR
ACTION LEVEL				
1. Exceedance for one sample	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Inform IEC and SO; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET; 2. Check Contractor's working method. 	<ol style="list-style-type: none"> 1. Notify Contractor. 	<ol style="list-style-type: none"> 1. Rectify any unacceptable practice; 2. Amend working methods if appropriate.
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> 1. Identify source; 2. Inform IEC and SO; 3. Advise the SO on the effectiveness of the proposed remedial measures; 4. Repeat measurements to confirm findings; 5. Increase monitoring frequency to daily; 6. Discuss with IEC and Contractor on remedial actions required; 7. If exceedance continues, arrange meeting with IEC and SO; 8. If exceedance stops, cease additional monitoring. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ET on the effectiveness of the proposed remedial measures; 5. Supervise Implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 	<ol style="list-style-type: none"> 1. Submit proposals for remedial to SO within 3 working days of notification; 2. Implement the agreed proposals; 3. Amend proposal if appropriate.

LIMIT LEVEL

<p>1.Exceedance for one sample</p>	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Inform SO, Contractor and EPD; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily; 5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and SO informed of the results. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the SO on the effectiveness of the proposed remedial measures; 5. Supervise implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Ensure remedial measures properly implemented. 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Amend proposal if appropriate.
<p>2.Exceedance for two or more consecutive samples</p>	<ol style="list-style-type: none"> 1. Notify IEC, SO, Contractor and EPD; 2. Identify source; 3. Repeat measurement to confirm findings; 4. Increase monitoring frequency to daily; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; 6. Arrange meeting with IEC and SO to discuss the remedial actions to 	<ol style="list-style-type: none"> 1. Discuss amongst SO, ET, and Contractor on the potential remedial actions; 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the SO accordingly; 3. Supervise the implementation of remedial 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Ensure remedial measures properly implemented; 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control; 5. Stop the relevant portion of works as determined by the SO until the exceedance is

	<p>be taken;</p> <p>7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and SO informed of the results;</p> <p>8. If exceedance stops, cease additional monitoring.</p>	<p>measures.</p>	<p>5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</p>	<p>abated.</p>
--	--	------------------	--	----------------

Abbreviations: ET – Environmental Team, IEC – Independent Environmental Checker, SO – Supervising Office

Event / Action Plan for Construction Noise

EVENT	ACTION			
	ET	IEC	SO	CONTRACTOR
Action Level	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Notify IEC and Contractor; 3. Report the results of investigation to the IEC, SO and Contractor; 4. Discuss with the Contractor and formulate remedial measures; 5. Increase monitoring frequency to check mitigation effectiveness. 	<ol style="list-style-type: none"> 1. Review the analysed results submitted by the ET; 2. Review the proposed remedial measures by the Contractor and advise the SO accordingly; 3. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Require Contractor to propose remedial measures for the analysed noise problem; 4. Ensure remedial measures are properly implemented 	<ol style="list-style-type: none"> 1. Submit noise mitigation proposals to IEC; 2. Implement noise mitigation proposals.
Limit Level	<ol style="list-style-type: none"> 1. Identify source; 2. Inform IEC, SO, EPD and Contractor; 3. Repeat measurements to confirm findings; 4. Increase monitoring frequency; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; 6. Inform IEC, SO and EPD 	<ol style="list-style-type: none"> 1. Discuss amongst SO, ET, and Contractor on the potential remedial actions; 2. Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the SO accordingly; 3. Supervise the implementation of 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Require Contractor to propose remedial measures for the analysed noise 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control;

EVENT	ACTION			
	ET	IEC	SO	CONTRACTOR
	<p>the causes and actions taken for the exceedances;</p> <p>7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and SO informed of the results;</p> <p>8. If exceedance stops, cease additional monitoring.</p>	<p>remedial measures.</p>	<p>problem;</p> <p>4. Ensure remedial measures properly implemented;</p> <p>5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</p>	<p>5. Stop the relevant portion of works as determined by the SO until the exceedance is abated.</p>

Event and Action Plan for Water Quality

Event	ET Leader	IEC	SO	Contractor
Action level being exceeded by one sampling day	Repeat <i>in situ</i> measurement on next day of exceedance to confirm findings; Identify source(s) of impact; Inform IEC, contractor and SO; Check monitoring data, all plant, equipment and Contractor's working methods.	Check monitoring data submitted by ET and Contractor's working methods.	Confirm receipt of notification of non-compliance in writing; Notify Contractor.	Inform the SO and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Amend working methods if appropriate.
Action level being exceeded by two or more consecutive sampling days	Repeat measurement on next day of exceedance to confirm findings; Identify source(s) of impact; Inform IEC, contractor, SO and EPD; Check monitoring data, all plant, equipment and Contractor's working methods; Ensure mitigation measures are implemented; Increase the monitoring frequency to daily until no exceedance of Action level;	Check monitoring data submitted by ET and Contractor's working method; Discuss with ET and Contractor on possible remedial actions; Review the proposed mitigation measures submitted by Contractor and advise the SO accordingly; Supervise the implementation of mitigation measures.	Discuss with IEC on the proposed mitigation measures; Ensure mitigation measures are properly implemented; Assess the effectiveness of the implemented mitigation measures.	Inform the Supervising Officer and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment and consider changes of working methods; Submit proposal of additional mitigation measures to SO within 3 working days of notification and discuss with ET, IEC and SO; Implement the agreed mitigation measures.
Limit level being exceeded by one sampling day	Repeat measurement on next day of exceedance to confirm findings; Identify source(s) of impact; Inform IEC, contractor, SO and EPD; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC, SO and Contractor;	Check monitoring data submitted by ET and Contractor's working method; Discuss with ET and Contractor on possible remedial actions; Review the proposed mitigation measures submitted by Contractor and advise the SO accordingly.	Confirm receipt of notification of failure in writing; Discuss with IEC, ET and Contractor on the proposed mitigation measures; Request Contractor to review the working methods.	Inform the SO and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment and consider changes of working methods; Submit proposal of mitigation measures to SO within 3 working days of notification and discuss with ET, IEC and SO.

Event	ET Leader	IEC	SO	Contractor
<p>Limit level being exceeded by two or more consecutive sampling days</p>	<p>Repeat measurement on next day of exceedance to confirm findings;</p> <p>Identify source(s) of impact;</p> <p>Inform IEC, contractor, SO and EPD;</p> <p>Check monitoring data, all plant, equipment and Contractor's working methods;</p> <p>Discuss mitigation measures with IEC, SO and Contractor;</p> <p>Ensure mitigation measures are implemented;</p>	<p>Check monitoring data submitted by ET and Contractor's working method;</p> <p>Discuss with ET and Contractor on possible remedial actions;</p> <p>Review the Contractor's mitigation measures whenever necessary to assure their effectiveness and advise the SO accordingly;</p> <p>Supervise the implementation of mitigation measures.</p>	<p>Discuss with IEC, ET and Contractor on the proposed mitigation measures;</p> <p>Request Contractor to critically review the working methods;</p> <p>Make agreement on the mitigation measures to be implemented;</p> <p>Ensure mitigation measures are properly implemented;</p> <p>Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the construction activities until no exceedance of Limit level.</p>	<p>Take immediate action to avoid further exceedance;</p> <p>Submit proposal of mitigation measures to SO within 3 working days of notification and discuss with ET, IEC and SO;</p> <p>Implement the agreed mitigation measures;</p> <p>Resubmit proposals of mitigation measures if problem still not under control;</p> <p>As directed by the Supervising Officer, to slow down or to stop all or part of the construction activities until no exceedance of Limit level.</p>

APPENDIX L
SUMMARY OF EXCEEDANCE

Contract No. HY/2011/09

**Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road –
Section between HKSAR Boundary and Scenic Hill**

Exceedance Report

(A) Exceedance Report for Air Quality

Environmental Monitoring	Parameter	No. of Exceedance		No. of Exceedance related to the Construction Activities of this Contract	
		Action Level	Limit Level	Action Level	Limit Level
Air Quality	1-hr TSP	0	0	0	0
	24-hr TSP	0	0	0	0

**(B) Exceedance Report for Construction Noise
(NIL in the reporting period)**

(C) Exceedance Report for Water Quality

Environmental Monitoring	Parameter	No. of Exceedance		No. of Exceedance related to the Construction Activities of this Contract	
		Action Level	Limit Level	Action Level	Limit Level
Water Quality	Dissolved Oxygen (DO) (Surface & Middle)	0	0	0	0
	Dissolved Oxygen (DO) (Bottom)	0	0	0	0
	Turbidity	0	0	0	0
	Suspended Solids (SS)	0	0	0	0

APPENDIX M
SITE AUDIT SUMMARY

Hong Kong-Zhuhai-Macao Bridge



Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Weekly Site Inspection Record Summary

Inspection Information

Checklist Reference Number	160803
Date	3 August 2016 (Wednesday)
Time	9:30 – 11:45

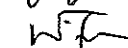


Ref. No.	Non-Compliance	Related Item No.
-	None identified	-
Ref. No.	Remarks/Observations	Related Item No.
	B. Water Quality	
160803-O01	<ul style="list-style-type: none"> Muddy water was observed discharge from site to the gullies during heavy rainstorm at P114. The Contractor was reminded to enhance the water quality mitigation measures (e.g. direct muddy water to appropriate sedimentation facilities, adequate maintenance of drainage, earth bunds or sand bag barriers to protect the gullies) to avoid flooding and untreated site runoff entering the public drainage directly. 	B1, B3i, B4, B6, B11i, B16
160803-R02	<ul style="list-style-type: none"> Clear the floating rubbish within the site curtain after the typhoon at Portion A. 	B21
160803-R03	<ul style="list-style-type: none"> Provide earth bunds or sand bag barrier at the site boundary at P101 to prevent the site runoff discharging to the sea. 	B16
	C. Ecology	
	<ul style="list-style-type: none"> No environmental deficiency was identified during site inspection. 	
	D. Air Quality	
	<ul style="list-style-type: none"> No environmental deficiency was identified during site inspection. 	
	E. Noise	
	<ul style="list-style-type: none"> No environmental deficiency was identified during site inspection. 	
	F. Waste / Chemical Management	
	<ul style="list-style-type: none"> No environmental deficiency was identified during site inspection. 	
	G. Permits/Licences	
	<ul style="list-style-type: none"> No environmental deficiency was identified during site inspection. 	
	H. Others	
	<ul style="list-style-type: none"> Follow-up on previous site audit session (Ref. No. 160726), all environmental deficiencies were improved/rectified by contractor during the site inspection. 	

	Name	Signature	Date
Recorded by	Ivy Tam		3 August 2016
Checked by	Dr. Priscilla Choy		3 August 2016

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Environmental Observations Identified during the Environmental Site Inspection
(3 August 2016)

	<p>Ref No: 160803-O01</p> <p>Impact: Water Quality (B1, B3i, B4, B6, B11i, B16)</p> <p>Details: Muddy water was observed discharge from site to the gullies during heavy rainstorm at P114. The Contractor was reminded to enhance the water quality mitigation measures (e.g. direct muddy water to appropriate sedimentation facilities, adequate maintenance of drainage, earth bunds or sand bag barriers to protect the gullies) to avoid flooding and untreated site runoff entering the public drainage directly.</p>
	<p>Ref No: 160803-R02</p> <p>Impact: Water Quality (B21)</p> <p>Details: Clear the floating rubbish within the site curtain after the typhoon at Portion A.</p>
	<p>Ref No: 160803-R03</p> <p>Impact: Water Quality (B16)</p> <p>Details: Provide earth bunds or sand bag barrier at the site boundary at P101 to prevent the site runoff discharging to the sea.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

**Rectification Actions taken by the Contractor for Environmental Deficiencies
Identified during Previous Audit Session**

	<p>Ref No: 160726-R01</p> <p>Impact: Water Quality (B3i.)</p> <p>Details: Properly collect the concrete wash water for further treatment at P79 to avoid leaking to the sea.</p> <p>Follow Up: Tarpaulin sheet was placed on the platform to avoid the leakage of concrete wash water through the gap at the platform. In addition, the concrete wash water was collected from the platform and temporary stored at the metal container for subsequent treatment and disposal.</p>
--	--

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

	<p>Ref No: 160726-R02</p> <p>Impact: Waste / Chemical Management (F9)</p> <p>Details: To seal the hole / close the valve of the drip tray at P72.</p> <p>Follow Up: The hole and the valve of the drip tray was sealed and closed respectively.</p>
	<p>Ref No: 160726-R03</p> <p>Impact: Air Quality (D26)</p> <p>Details: Properly display the proper label of NRMM for the forklift at P72.</p> <p>Follow Up: A proper NRMM label was displayed at the forklift.</p>

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge



Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Weekly Site Inspection Record Summary

Inspection Information

Checklist Reference Number	160809
Date	9 August 2016 (Tuesday)
Time	9:15 – 11:00 and 13:30 – 15:30

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-
Ref. No.	Remarks/Observations	Related Item No.
	B. Water Quality	
	• No environmental deficiency was identified during site inspection.	
	C. Ecology	
	• No environmental deficiency was identified during site inspection.	
	D. Air Quality	
	• No environmental deficiency was identified during site inspection.	
	E. Noise	
	• No environmental deficiency was identified during site inspection.	
	F. Waste / Chemical Management	
160809-R01	• To maintain a good house-keeping at works area of P77.	F7
160809-R02	• To clear the wastewater properly as chemical waste at the skip at P77.	F2i, 2ii
160809-R03	• To properly repair the drip tray at Portion A.	F9
	G. Permits/Licences	
	• No environmental deficiency was identified during site inspection.	
	H. Others	
	• Follow-up on previous site audit session (Ref. No. 160803), follow up action is required for the item 160803-R02.	

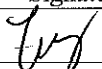	Name	Signature	Date
Recorded by	Ivy Tam		9 August 2016
Checked by	Dr. Priscilla Choy		9 August 2016

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Environmental Observations Identified during the Environmental Site Inspection
(9 August 2016)



Ref No: 160809-R01

Impact:
Waste / Chemical Management (F7)

Details:
To maintain a good house-keeping at works area of P77.



Ref No: 160809-R02

Impact:
Waste / Chemical Management (F2i, 2ii)

Details:
To clear the wastewater properly as chemical waste at the skip at P77.



Ref No: 160809-R03



Impact:
Waste / Chemical Management (F9)

Details:
To properly repair the drip tray at Portion A.

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Rectification Actions taken by the Contractor for Environmental Deficiencies Identified during Previous Audit Session

	<p>Ref No: 160803-O01</p> <p>Impact: Water Quality (B1, B3i, B4, B6, B11i, B16)</p> <p>Details: Muddy water was observed discharge from site to the gullies during heavy rainstorm at P114. The Contractor was reminded to enhance the water quality mitigation measures (e.g. direct muddy water to appropriate sedimentation facilities, adequate maintenance of drainage, earth bunds or sand bag barriers to protect the gullies) to avoid flooding and untreated site runoff entering the public drainage directly.</p> <p>Follow Up: After investigation, the muddy water was generated due to the discharge of surface runoff from deck surface to the site area underneath of bridge deck at P114. Water quality mitigation measures (e.g. erect sand bag bund at the boundary of bridge deck to avoid the surface runoff from washing across the exposed soil surface, properly clear / cover the stockpile of soil etc.) were observed implemented by the Contractor. No further muddy water was observed discharge from site to the gullies and this site area has already handed over to the HKLR03.</p>
	<p>Ref No: 160803-R03</p> <p>Impact: Water Quality (B16)</p> <p>Details: Provide earth bunds or sand bag barrier at the site boundary at P101 to prevent the site runoff discharging to the sea.</p> <p>Follow Up: Sand bag barrier was ready on site to prevent the site runoff discharging to the sea.</p>

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge



Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Weekly Site Inspection Record Summary

Inspection Information

Checklist Reference Number	160816
Date	16 August 2016 (Tuesday)
Time	9:15 – 11:00 and 13:30 – 16:00

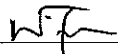


Ref. No.	Non-Compliance	Related Item No.
-	None identified	-
Ref. No.	Remarks/Observations	Related Item No.
	B. Water Quality	
160816-R03	• To repair the damaged silt curtain near P68.	B25
	C. Ecology	
	• No environmental deficiency was identified during site inspection.	
	D. Air Quality	
	• No environmental deficiency was identified during site inspection.	
	E. Noise	
	• No environmental deficiency was identified during site inspection.	
	F. Waste / Chemical Management	
160816-R01	• To properly repair the drip tray near P83 and clear the oil stain.	F8 & F9
160816-R02	• To clear the waste materials floating within the silt curtain near P91.	F4ii
160816-R04	• To clear the accumulated waste material near P68.	F1iii
	G. Permits/Licences	
	• No environmental deficiency was identified during site inspection.	
	H. Others	
	• Follow-up on previous site audit session (Ref. No. 160809), follow up action is required for the item(s) 160809-R03 and 160803-R02.	

	Name	Signature	Date
Recorded by	Ivy Tam		16 August 2016
Checked by	Dr. Priscilla Choy		16 August 2016

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Environmental Observations Identified during the Environmental Site Inspection
(16 August 2016)

	<p>Ref No: 160816-R01</p> <p>Impact: Waste / Chemical Management (F8 & F9)</p> <p>Details: To properly repair the drip tray near P83 and clear the oil stain.</p>
	<p>Ref No: 160816-R02</p> <p>Impact: Waste / Chemical Management (F4ii)</p> <p>Details: To clear the waste materials floating within the silt curtain near P91.</p>
	<p>Ref No: 160816-R03</p> <p>Impact: Water Quality (B25)</p> <p>Details: To repair the damaged silt curtain near P68.</p>

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill



Ref No: 160816-R04

Impact:

Waste / Chemical Management (F1iii)



Details:

To clear the accumulated waste material near P68.

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

**Rectification Actions taken by the Contractor for Environmental Deficiencies
Identified during Previous Audit Session**

	<p>Ref No: 160809-R01</p> <p>Impact: Waste / Chemical Management (F7)</p> <p>Details: To maintain a good house-keeping at works area of P77.</p> <p>Follow Up: Good housekeeping was maintained at the works area of P77.</p>
	<p>Ref No: 160809-R02</p> <p>Impact: Waste / Chemical Management (F2i, 2ii)</p> <p>Details: To clear the wastewater properly as chemical waste at the skip at P77.</p> <p>Follow Up: The wastewater at the skip was cleared properly.</p>

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge



Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Weekly Site Inspection Record Summary

Inspection Information

Checklist Reference Number	160823
Date	23 August 2016 (Tuesday)
Time	9:30 – 12:00


Ref. No.	Non-Compliance	Related Item No.
-	None identified	-
Ref. No.	Remarks/Observations	Related Item No.
	B. Water Quality	
	• No environmental deficiency was identified during site inspection.	
	C. Ecology	
	• No environmental deficiency was identified during site inspection.	
	D. Air Quality	
	• No environmental deficiency was identified during site inspection.	
	E. Noise	
	• No environmental deficiency was identified during site inspection.	
	F. Waste / Chemical Management	
160823-R01	• Clear the accumulated waste materials at the waste skip at P58.	F1i.
160823-R02	• To close the opening of drip tray for the generator at P71.	F9
	G. Permits/Licences	
	• No environmental deficiency was identified during site inspection.	
	H. Others	
	• Follow-up on previous site audit session (Ref. No. 160816), all environmental deficiencies were improved/rectified by contractor during the site inspection.	

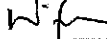	Name	Signature	Date
Recorded by	Ivy Tam		23 August 2016
Checked by	Dr. Priscilla Choy		23 August 2016

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill




Environmental Observations Identified during the Environmental Site Inspection
(23 August 2016)

	<p>Ref No: 160823-R01</p> <p>Impact: Waste / Chemical Management (F1i.)</p> <p>Details: Clear the accumulated waste materials at the waste skip at P58.</p>
	<p>Ref No: 160823-R02</p> <p>Impact: Waste / Chemical Management (F9)</p> <p>Details: To close the opening of drip tray for the generator at P71.</p>

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Rectification Actions taken by the Contractor for Environmental Deficiencies Identified during Previous Audit Session

	<p>Ref No: 160816-R01</p> <p>Impact: Waste / Chemical Management (F8 & F9)</p> <p>Details: To properly repair the drip tray near P83 and clear the oil stain.</p> <p>Follow Up: The worn drip tray was repaired by the worker and the surrounding oil stain was also cleared.</p>
	<p>Ref No: 160816-R02</p> <p>Impact: Waste / Chemical Management (F4ii)</p> <p>Details: To clear the waste materials floating within the silt curtain near P91.</p> <p>Follow Up: The floating waste materials within the silt curtains were cleared.</p>
	<p>Ref No: 160816-R03</p> <p>Impact: Water Quality (B25)</p> <p>Details: To repair the damaged silt curtain near P68.</p> <p>Follow Up: The silt curtain was re-deployed by the worker.</p>

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill



Ref No: 160816-R04

Impact:
Waste / Chemical Management (F1iii)

Details:
To clear the accumulated waste material near P68.

Follow Up:
The accumulated waste material was cleared.

Contract HY/2011/09



Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Weekly Site Inspection Record Summary
Inspection Information

Checklist Reference Number	160830
Date	30 August 2016 (Tuesday)
Time	9:15 – 11:30 and 13:30 – 16:30

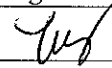


Ref. No.	Non-Compliance	Related Item No.
-	None identified	-
Ref. No.	Remarks/Observations	Related Item No.
	B. Water Quality • No environmental deficiency was identified during site inspection.	
	C. Ecology • No environmental deficiency was identified during site inspection.	
	D. Air Quality • No environmental deficiency was identified during site inspection.	
	E. Noise • No environmental deficiency was identified during site inspection.	
	F. Waste / Chemical Management	
160830-R01	• To provide a drip tray for oil drums and label it properly at P60 and LF3.	F8 & F9
160830-R02	• To properly store the chemical containers or remove it near P60.	F2i
160830-R03	• Chemical material should be properly stored in chemical storage area at Portion C.	F2i
160830-R04	• Waste water should be cleared from waste skip near P83.	F1i & F1iii
	G. Permits/Licences • No environmental deficiency was identified during site inspection.	
	H. Others • Follow-up on previous site audit session (Ref. No. 160823), all environmental deficiencies were improved/rectified by contractor during the site inspection.	

	Name	Signature	Date
Recorded by	Ivy Tam		30 August 2016
Checked by	Dr. Priscilla Choy		30 August 2016

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

Environmental Observations Identified during the Environmental Site Inspection
(30 August 2016)

	<p>Ref No: 160830-R01</p> <p>Impact: Waste / Chemical Management (F8 & F9)</p> <p>Details: To provide a drip tray for oil drums and label it properly at P60 and LF3.</p>
	<p>Ref No: 160830-R02</p> <p>Impact: Waste / Chemical Management (F2i)</p> <p>Details: To properly store the chemical containers or remove it near P60.</p>
	<p>Ref No: 160830-R03</p> <p>Impact: Waste / Chemical Management (F2i)</p> <p>Details: Chemical material should be properly stored in chemical storage area at Portion C.</p>

Contract HY/2011/09

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill



Ref No: 160830-R04

Impact:

Waste / Chemical Management (F1i & F1iii)



Details:

Waste water should be cleared from waste skip near P83.

Hong Kong-Zhuhai-Macao Bridge

Hong Kong Link Road-Section between HKSAR Boundary and Scenic Hill

**Rectification Actions taken by the Contractor for Environmental Deficiencies
Identified during Previous Audit Session**

	<p>Ref No: 160823-R01</p> <p>Impact: Waste / Chemical Management (F1i.)</p> <p>Details: Clear the accumulated waste materials at the waste skip at P58.</p> <p>Follow Up: The accumulated waste materials were cleared properly.</p>
	<p>Ref No: 160823-R02</p> <p>Impact: Waste / Chemical Management (F9)</p> <p>Details: To close the opening of drip tray for the generator at P71.</p> <p>Follow Up: The opening of drip tray was closed by the worker.</p>

**APPENDIX N
UPDATED ENVIRONMENTAL
MITIGATION IMPLEMENTATION
SCHEDULE (EMIS)**

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
Air Quality							
S5.5.6.1	A1	1) The contractor shall follow the procedures and requirements given in the Air Pollution Control (Construction Dust) Regulation	Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.	Contractor	All construction sites	Construction stage	^
S5.5.6.2	A2	2) Proper watering of exposed spoil should be undertaken throughout the construction phase: <ul style="list-style-type: none"> • Any excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading; • Any dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads; • A stockpile of dusty material should not be extend beyond the pedestrian barriers, fencing or traffic cones. • The load of dusty materials on a vehicle leaving a construction site should be covered entirely by impervious sheeting to ensure that the dusty materials do not leak from the vehicle; • Where practicable, vehicle washing facilities with high pressure water jet should be provided at every discernible or designated vehicle exit point. The area where vehicle washing takes place and the road section between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores; 	Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.	Contractor	All construction sites	Construction stage	^ ^ ^ ^
S5.5.6.2	A2	<ul style="list-style-type: none"> • When there are open excavation and reinstatement works, hoarding 	Good construction site	Contractor	All construction	Construction	^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>of not less than 2.4m high should be provided as far as practicable along the site boundary with provision for public crossing. Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period;</p> <ul style="list-style-type: none"> • The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials; • Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical continuously; • Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities so as to maintain the entire surface wet; • Where a scaffolding is erected around the perimeter of a building under construction, effective dust screens, sheeting or netting should be provided to enclose the scaffolding from the ground floor level of the building, or a canopy should be provided from the first floor level up to the highest level of the scaffolding; • Any skip hoist for material transport should be totally enclosed by impervious sheeting; • Every stock of more than 20 bags of cement or dry pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides; 	<p>practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.</p>		sites	stage	<p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">N/A</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
S5.5.6.2	A2	<ul style="list-style-type: none"> Cement or dry PFA delivered in bulk should be stored in a closed silo fitted with an audible high level alarm which is interlocked with the material filling line and no overfilling is allowed; Loading, unloading, transfer, handling or storage of bulk cement or dry PFA should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system; and Exposed earth should be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabiliser within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies. 	Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.	Contractor	All construction sites	Construction stage	N/A N/A
S5.5.6.3	A3	3) The Contractor should undertake proper watering on all exposed spoil (with at least 8 times per day) throughout the construction phase.	Control construction dust	Contractor	All construction sites	Construction stage	^
S5.5.6.4	A5	5) Implement regular dust monitoring under EM&A programme during the construction stage.	Monitor the 24 hr and 1hr TSP levels at the representative dust monitoring stations to ensure compliance with relevant criteria throughout the construction period.	Contractor	Selected representative dust monitoring station	Construction stage	^
S5.5.7.1	A6	The following mitigation measures should be adopted to prevent fugitive dust emissions for concrete batching plant: <ul style="list-style-type: none"> Loading, unloading, handling, transfer or storage of any dusty 	Monitor the 24 hr and 1hr TSP levels at the representative dust	Contractor	Selected representative dust	Construction stage	N/A

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>materials should be carried out in totally enclosed system;</p> <ul style="list-style-type: none"> All dust-laden air or waste gas generated by the process operations should be properly extracted and vented to fabric filtering system to meet the emission limits for TSP; Vents for all silos and cement/pulverised fuel ash (PFA) weighing scale should be fitted with fabric filtering system; The materials which may generate airborne dusty emissions should be wetted by water spray system; All receiving hoppers should be enclosed on three sides up to 3m above unloading point; All conveyor transfer points should be totally enclosed; All access and route roads within the premises should be paved and wetted; and Vehicle cleaning facilities should be provided and used by all concrete trucks before leaving the premises to wash off any dust on the wheels and/or body. 	<p>monitoring stations to ensure compliance with relevant criteria throughout the construction period.</p>		monitoring station		<p>N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p>
S5.5.2.7	A7	<p>The following mitigation measures should be adopted to prevent fugitive dust emissions at barging point:</p> <ul style="list-style-type: none"> All road surface within the barging facilities will be paved; Dust enclosures will be provided for the loading ramp; Vehicles will be required to pass through designated wheels wash facilities; and Continuous water spray at the loading points. 	Control construction dust	Contractor	All construction sites	Construction stage	<p>N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p>
Construction Noise (Air borne)							
S6.4.10	N1	1) Use of good site practices to limit noise emissions by considering the	Control construction airborne	Contractor	All construction	Construction	

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>following:</p> <ul style="list-style-type: none"> • only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme; • machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; • plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs; • silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works; • mobile plant should be sited as far away from NSRs as possible and practicable; • material stockpiles, mobile container site officer and other structures should be effectively utilised, where practicable, to screen noise from on-site construction activities. 	noise by means of good site practices		sites	stage	^ ^ ^ ^ ^
S6.4.11	N2	2) Install temporary hoarding located on the site boundaries between noisy construction activities and NSRs. The conditions of the hoardings shall be properly maintained throughout the construction period.	Reduce the construction noise levels at low-level zone of NSRs through partial screening.	Contractor	All construction sites	Construction stage	^
S6.4.12	N3	3) Install movable noise barriers (typically density @14kg/m ²), acoustic mat or full enclosure close to noisy plants including air compressor, generators, saw.	Screen the noisy plant items to be used at all construction sites	Contractor	For plant items listed in Appendix 6D of the EIA report at all construction sites	Construction stage	^
S6.4.13	N4	4) Select "Quiet plants" which comply with the BS 5228 Part 1 or TM	Reduce the noise levels of	Contractor	For plant items	Construction	^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		standards.	plant items		listed in Appendix 6D of the EIA report at all construction sites	stage	
S6.4.14	N5	5) Sequencing operation of construction plants where practicable.	Operate sequentially within the same work site to reduce the construction airborne noise	Contractor	All construction sites where practicable	Construction stage	^
	N6	6) Implement a noise monitoring under EM&A programme.	Monitor the construction noise levels at the selected representative locations	Contractor	Selected representative noise monitoring station	Construction stage	^
Waste Management (Construction Waste)							
S8.3.8	WM1	<u>Construction and Demolition Material</u> The following mitigation measures should be implemented in handling the waste: <ul style="list-style-type: none"> Maintain temporary stockpiles and reuse excavated fill material for backfilling and reinstatement; Carry out on-site sorting; Make provisions in the Contract documents to allow and promote the use of recycled aggregates where appropriate; Adopt 'Selective Demolition' technique to demolish the existing structures and facilities with a view to recovering broken concrete effectively for recycling purpose, where possible; Implement a trip-ticket system for each works contract to ensure that 	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal	Contractor	All construction sites	Construction stage	^ ^ ^ N/A ^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>the disposal of C&D materials are properly documented and verified; and</p> <ul style="list-style-type: none"> Implement an enhanced Waste Management Plan similar to ETWBTC (Works) No. 19/2005 – “Environmental Management on Construction Sites” to encourage on-site sorting of C&D materials and to minimize their generation during the course of construction. In addition, disposal of the C&D materials onto any sensitive locations such as agricultural lands, etc. should be avoided. The Contractor shall propose the final disposal sites to the Project Proponent and get its approval before implementation 					<p style="text-align: center;">*</p> <p style="text-align: center;">^</p>
S8.3.9 - S8.3.11	WM2	<p><u>C&D Waste</u></p> <ul style="list-style-type: none"> Standard formwork or pre-fabrication should be used as far as practicable in order to minimise the arising of C&D materials. The use of more durable formwork or plastic facing for the construction works should be considered. Use of wooden hoardings should not be used, as in other projects. Metal hoarding should be used to enhance the possibility of recycling. The purchasing of construction materials will be carefully planned in order to avoid over ordering and wastage. The Contractor should recycle as much of the C&D materials as possible on-site. Public fill and C&D waste should be segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal. Where practicable, concrete and masonry can be crushed and used as fill. Steel reinforcement bar can be used by scrap steel mills. Different 	<p>Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal</p>	Contractor	All construction sites	Construction stage	<p style="text-align: center;">^</p> <p style="text-align: center;">^</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>areas of the sites should be considered for such segregation and storage.</p>					
S8.2.12- S8.3.15	WM3	<p><u>Chemical Waste</u></p> <ul style="list-style-type: none"> • Chemical waste that is produced, as defined by Schedule 1 of the Waste Disposal (Chemical Waste) (General) Regulation, should be handled in accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. • Containers used for the storage of chemical wastes should be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed; have a capacity of less than 450 liters unless the specification has been approved by the EPD; and display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the regulation. • The storage area for chemical wastes should be clearly labelled and used solely for the storage of chemical waste; enclosed on at least 3 sides; have an impermeable floor and bunding of sufficient capacity to accommodate 110% of the volume of the largest container or 20 % of the total volume of waste stored in that area, whichever is the greatest; have adequate ventilation; covered to prevent rainfall entering; and arranged so that incompatible materials are adequately separated. • Disposal of chemical waste should be via a licensed waste collector; be to a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Centre which also offers a chemical 	Control the chemical waste and ensure proper storage, handling and disposal.	Contractor	All construction sites	Construction stage	<p>^</p> <p>^</p> <p>^</p> <p>^</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		waste collection service and can supply the necessary storage containers; or be to a reuser of the waste, under approval from the EPD.					
S8.3.16	WM4	<u>Sewage</u> <ul style="list-style-type: none"> • Adequate numbers of portable toilets should be provided for the workers. The portable toilets should be maintained in a state, which will not deter the workers from utilizing these portable toilets. Night soil should be collected by licensed collectors regularly. 	Proper handling of sewage from worker to avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	^
S8.3.17	WM5	<u>General Refuse</u> <ul style="list-style-type: none"> • General refuse generated on-site should be stored in enclosed bins or compaction units separately from construction and chemical wastes. • A reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from construction and chemical wastes, on a daily basis to minimize odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law. • Aluminium cans are often recovered from the waste stream by individual collectors if they are segregated and made easily accessible. Separate labelled bins for their deposit should be provided if feasible. • Office wastes can be reduced through the recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered by the Contractor. In addition, waste separation facilities for paper, aluminum cans, 	Minimize production of the general refuse and avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	^ ^ ^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>plastic bottles etc., should be provided.</p> <ul style="list-style-type: none"> Training should be provided to workers about the concepts of site cleanliness and appropriate waste management procedure, including reduction, reuse and recycling of wastes. 					*
Water Quality (Construction Phase)							
S9.11.1 – S9.11.1.2	W1	<ul style="list-style-type: none"> Mitigation during the marine works to reduce impacts to within acceptable levels have been recommended and will comprise a series of measures that restrict the method and sequencing of dredging/backfilling, as well as protection measures. Details of the measures are provided below and summarised in the Environmental Mitigation Implementation Schedule in EM&A Manual. Export for dredged spoils from NWWCZ avoiding exerting high demand on the disposal facilities in the NWWCZ and, hence, minimise potential cumulative impacts; For the marine viaducts of HKLR, the bored piling will be undertaken within a metal casing; where public fill is proposed for filling below -2.5mPD, the fine content in the public fill will be controlled to 25%; single layer silt curtains will be applied around all works; during the first two months of dredging work for HKLR, the silt-removal efficiency of the silt-curtains shall be verified by examining the results of water quality monitoring points. The water quality monitoring points to be selected for the above shall be those close to the locations of the initial period of dredging work. Details in this regard shall be determined by the ENPO to be established, 	To control construction water quality	Contractor	During seawall dredging and filling	Construction stage	^ ^ N/A ^ N/A

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<ul style="list-style-type: none"> all vessels shall be sized such that adequate clearance is maintained between vessels and the sea bed at all states of the tide to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash; and the works shall not cause foam, oil, grease, litter or other objectionable matter to be present in the water within and adjacent to the works site. 					<p>^</p> <p>^</p>
S9.11.1.3	W2	<p><u>Land Works</u></p> <p>General construction activities on land should also be governed by standard good working practice. Specific measures to be written into the works contracts should include:</p> <ul style="list-style-type: none"> wastewater from temporary site facilities should be controlled to prevent direct discharge to surface or marine waters; sewage effluent and discharges from on-site kitchen facilities shall be directed to Government sewer in accordance with the requirements of the WPCO or collected for disposal offsite. The use of soakaways shall be avoided; storm drainage shall be directed to storm drains via adequately designed sand/silt removal facilities such as sand traps, silt traps and sediment basins. Channels, earth bunds or sand bag barriers should be provided on site to properly direct stormwater to such silt removal facilities. Catchpits and perimeter channels should be constructed in advance of site formation works and earthworks; silt removal facilities, channels and manholes shall be maintained and any deposited silt and grit shall be removed regularly, including 	To control construction water quality	Contractor	During seawall dredging and filling	Construction stage	<p>*</p> <p>N/A</p> <p>*</p> <p>*</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<p>specifically at the onset of and after each rainstorm;</p> <ul style="list-style-type: none"> • temporary access roads should be surfaced with crushed stone or gravel; • rainwater pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities; • measures should be taken to prevent the washout of construction materials, soil, silt or debris into any drainage system; • open stockpiles of construction materials (e.g. aggregates and sand) on site should be covered with tarpaulin or similar fabric during rainstorms; • manholes (including any newly constructed ones) should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris from getting into the drainage system, and to prevent storm run-off from getting into foul sewers; • discharges of surface run-off into foul sewers must always be prevented in order not to unduly overload the foul sewerage system; • all vehicles and plant should be cleaned before they leave the construction site to ensure that no earth, mud or debris is deposited by them on roads. A wheel washing bay should be provided at every site exit; • wheel wash overflow shall be directed to silt removal facilities before being discharged to the storm drain; • the section of construction road between the wheel washing bay and the public road should be surfaced with crushed stone or coarse gravel; 					<p style="text-align: center;">^</p> <p style="text-align: center;">*</p> <p style="text-align: center;">*</p> <p style="text-align: center;">*</p> <p style="text-align: center;">*</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p> <p style="text-align: center;">^</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<ul style="list-style-type: none"> • wastewater generated from concreting, plastering, internal decoration, cleaning work and other similar activities, shall be screened to remove large objects; • vehicle and plant servicing areas, vehicle wash bays and lubrication facilities shall be located under roofed areas. The drainage in these covered areas shall be connected to foul sewers via a petrol interceptor in accordance with the requirements of the WPCO or collected for off site disposal; • the contractors shall prepare an oil / chemical cleanup plan and ensure that leakages or spillages are contained and cleaned up immediately; • waste oil should be collected and stored for recycling or disposal, in accordance with the Waste Disposal Ordinance; • all fuel tanks and chemical storage areas should be provided with locks and be sited on sealed areas. The storage areas should be surrounded by bunds with a capacity equal to 110% of the storage capacity of the largest tank; and • surface run-off from bunded areas should pass through oil/grease traps prior to discharge to the stormwater system. 					<p style="text-align: center;">^</p> <p style="text-align: center;">N/A</p> <p style="text-align: center;">*</p> <p style="text-align: center;">^</p> <p style="text-align: center;">*</p> <p style="text-align: center;">^</p>
S9.14	W3	Implement a water quality monitoring programme	Control water quality	Contractor	At identified monitoring location	During construction period	^
Ecology (Construction Phase)							
S10.7	E1	<ul style="list-style-type: none"> • Good site practices to avoid runoff entering woodland habitats in Scenic Hill 	Avoid potential disturbance on habitat of Romer's Tree	Designer; Contractor	Scenic Hill	During construction	^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<ul style="list-style-type: none"> Reinstate works areas in Scenic Hill Avoid stream modification in Scenic Hill 	Frog in Scenic Hill				N/A ^
S10.7	E2	<ul style="list-style-type: none"> Use closed grab in dredging works. Install silt curtain during the construction. Limit dredging and works fronts. Good site practices Strict enforcement of no marine dumping. Site runoff control Spill response plan 	Minimise marine water quality impacts	Contractor	Seawall,	During construction	^ ^ ^ ^ ^ ^
S10.7	E3	<ul style="list-style-type: none"> Reprovision of replacement Artificial Reefs (of the same volume as the existing ARs inside Marine Exclusion Zone) 	Mitigate water quality impacts on the existing ARs	Project proponent	To be determined	Construction phase or operation phase	N/A
S10.7	E4	Watering to reduce dust generation; prevention of siltation of freshwater habitats; Site runoff should be desilted, to reduce the potential for suspended sediments, organics and other contaminants to enter streams and standing freshwater	Prevent Sedimentation from Land-based works areas	Contractor	Land-based works areas	During construction	^
S10.7	E5	Good site practices, including strictly following the permitted works hours, using quieter machines where practicable, and avoiding excessive lightings during night time	Prevent disturbance to terrestrial fauna and habitats	Contractor	Land-based works areas	During construction	^
S10.7	E6	<ul style="list-style-type: none"> Dolphin Exclusion Zone; Dolphin watching plan 	Minimize temporary marine habitat loss impact to dolphins	Contractor	Marine works	During marine works	^ ^
S10.7	E7	<ul style="list-style-type: none"> Decouple compressors and other equipment on working vessels Avoidance of percussive piling Marine underwater noise monitoring 	Minimise marine noise impacts on dolphins	Contractor	Marine works	During marine works	^ ^ ^

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<ul style="list-style-type: none"> Temporal suspension of drilling bored pile casing in rock during peak dolphin calving season in May and June 					N/A
S10.7	E8	<ul style="list-style-type: none"> Control vessel speed Skipper training. Predefined and regular routes for working vessels; avoid Brothers Islands. 	Minimise marine traffic disturbance on dolphins	Contractor	Marine traffic	During marine works	^ ^ ^
S10.10	E9	<ul style="list-style-type: none"> Dolphin vessel monitoring 	Minimise marine traffic disturbance on dolphins	Contractor	North Lantau and West Lantau	Prior to construction, during construction, and 1 year after operation	^
Fisheries							
S11.7	F1	<ul style="list-style-type: none"> Reprovision of replacement Artificial Reefs(of the same volume as the existing ARs inside Marine Exclusion Zone) 	Mitigate water quality impacts on the existing ARs	Project proponent	To be determined	Construction phase or operation phase	N/A
S11.7	F2	<ul style="list-style-type: none"> Reduce re-suspension of sediments Limit dredging and works fronts. Good site practices Strict enforcement of no marine dumping Spill response plan 	Minimise marine water quality impacts	Contractor	Seawall,	During construction	^ ^ ^ ^ ^
Landscape & Visual (Construction Phase)							
S14.3.3.3	LV2	<p>Mitigate both Landscape and Visual Impacts</p> <ul style="list-style-type: none"> G1. Grass-hydroseed bare soil surface and stock pile areas. 	Minimise visual & landscape impact	Contractor	HKLR	Construction stage	N/A

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
		<ul style="list-style-type: none"> • G2. Add planting strip and automatic irrigation system if appropriate at some portions of bridge or footbridge to screen bridge and traffic. • G3. For HKLR, providing aesthetic design on the viaduct, tunnel portals, at-grade roads (e.g. subtle colour tone and slim form for viaduct, featured form of tunnel portals, roadside planting along at-grade roads and landscape berm on) to beautify the HKLR alignment. • G5. Vegetation reinstatement and upgrading to disturbed areas. • G6. Maximize new tree, shrub and other vegetation planting to compensate tree felled and vegetation removed. • G7. Provide planting area around peripheral of and within HKLR for tree screening buffer effect. • G8. Plant salt tolerant native tree and shrubs etc along the planter strip at affected seawall. • G9. Reserve of loose natural granite rocks for re-use. Provide new coastline to adopt “natural-look” by means of using armour rocks in the form of natural rock materials and planting strip area accommodating screen buffer to enhance “natural-look” of the new coastline (see Figure 14.4.2 for example). 					<p>N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p>
S14.3.3.3	LV3	<p><u>Mitigate Visual Impacts</u></p> <ul style="list-style-type: none"> • V1.Minimize time for construction activities during construction period. • V2.Provide screen hoarding at the portion of the project site / works areas / storage areas near VSRs who have close low-level views to the Project during HKLR construction. 					<p>^</p> <p>^</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to Implement the measures?	Implementation Status
EM&A							
S15.2.2	EM1	An Independent Environmental Checker needs to be employed as per the EM&A Manual.	Control EM&A Performance	Project Proponent	All construction sites	Construction stage	^
S15.5 - S15.6	EM2	1) An Environmental Team needs to be employed as per the EM&A Manual. 2) Prepare a systematic Environmental Management Plan to ensure effective implementation of the mitigation measures. 3) An environmental impact monitoring needs to be implementing by the Environmental Team to ensure all the requirements given in the EM&A Manual are fully complied with.	Perform environmental monitoring & auditing	Contractor	All construction sites	Construction stage	^ ^ ^

Remarks: ^ Compliance of mitigation measure
 * Recommendation was made during site audit but improved/rectified by the contractor
 N/A Not Applicable at this stage as no such site activities were conducted in the reporting month (e.g. concrete batching plan, barging point, seawall dredging and filling, bored piling, landscaping works etc)

**APPENDIX O
WASTE GENERATION IN THE
REPORTING MONTH**



Appendix: C6 Monthly Summary Waste Flow Table

Name of Department: HyD

Contract No.: HY/2011/09

Monthly Summary Waste Flow Table for 2016 (Year)

Month	Actual Quantities of Inert C&D Materials Generated Monthly						Actual Quantities of C&D Wastes Generated Monthly				
	Total Quantity Generated ⁹	Hard Rock and Large Broken Concrete ⁶	Reused in the Contract ⁷	Reused in other Projects ^{5,7,11}	Disposed as Public Fill ⁷	Imported Fill ^{6,7}	Metals ¹⁰	Paper/ cardboard packaging	Plastics ³	Chemical Waste	Others, e.g. general refuse ⁷
	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 kg)	(in '000 kg)	(in '000 kg)	(in '000 m ³)
Jan	1.095	0.000	0.000	0.000	0.283	0.812	0.020	1.145	0.000	0.000	0.241
Feb	0.209	0.000	0.000	0.000	0.209	0.000	0.113	0.811	0.000	4.099	0.241
Mar	0.388	0.000	0.086	0.000	0.302	0.000	0.023	1.201	0.000	1.387	0.260
Apr	2.094	0.000	0.286	1.512	0.297	0.000	0.131	0.818	0.000	0.000	0.208
May	4.436	0.000	0.000	3.982	0.454	0.000	0.078	0.917	0.000	1.586	0.189
Jun	6.100	0.000	0.000	5.777	0.322	0.000	0.025	0.626	0.000	2.973	0.202
Sub-Total	14.323	0.000	0.372	11.270	1.869	0.812	0.390	5.518	0.000	10.045	1.339
Jul	0.431	0.000	0.000	0.122	0.310	0.000	0.062	0.626	0.000	0.991	0.189
Aug	1.366	0.000	1.103	0.000	0.262	0.000	0.111	0.936	0.000	2.775	0.195
Sep											
Oct											
Nov											
Dec											
Total	16.120	0.000	1.475	11.392	2.441	0.812	0.564	7.080	0.000	13.811	1.723



Forecast of Total Quantities of C&D Materials to be Generated from the Contract ⁸										
Total Quantity Generated ⁹	Hard Rock and Large Broken Concrete ⁶	Reused in the Contract ⁷	Reused in other Projects ^{5,7}	Disposed as Public Fill ⁶	Imported Fill ^{6,7}	Metals ¹⁰	Paper/ cardboard packaging	Plastics ³	Chemical Waste	Others, e.g. general refuse ⁷
(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 m ³)	(in '000 kg)	(in '000 kg)	(in '000 kg)	(in '000 m ³)
231.111	0.000	5.000	73.111	100.000	53.000	5.000	40.000	0.000	35.000	20.000

- Notes:
- (1) The performance targets are given in ER Appendix 8J Clause 14 and the EM&A Manual.
 - (2) The waste flow table shall also include C&D materials to be imported for use at the Site.
 - (3) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material.
 - (4) The Contractor shall also submit the latest forecast of the total amount of C&D materials expected to be generated from the Works, together with a breakdown of the nature where the total amount of C&D materials expected to be generated from the Works is equal to or exceeding 50,000 m³. (ER Part 8 Clause 8.8.5 (d) (ii) refers).
 - (5) The materials reused in other Project shall not be treated as waste under the Waste Disposal Ordinance (CAP354).
 - (6) According to the EIA Appendix 8B, the density of rock (bulked) and soil (bulked) are 2.0 tonnes/m³ and 1.8 tonnes/m³ respectively.
 - (7) Assuming the loading quantities of a 30-tonne truck and a 24-tonne truck are 8.0m³ and 6.5m³ respectively.
 - (8) The forecast of C&D materials to be generated from the Contract is sourced from the works program in May 2016.
 - (9) The volume of Total Quantity Generated means the volume of Hard Rock and Large Broken Concrete+Disposed as Public Fill+Imported Fill-Reused in the Contract-Reused in other Projects.
 - (10) The density of metal is 7,850 kg/m³.
 - (11) The C&D materials were delivered to TM-CLKL Project.

**APPENDIX P
COMPLAINT LOG**

Appendix P - Complaint Log

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
Com-2013-04-001	Near Tung Chung New Development Pier	8 April 2013	EPD received the complaint on 8 April 2013. The complainant complained about oil was dumped from various vessels operating for Hong Kong-Zhuhai-Macao Bridge Hong Kong (HZMB HK) Projects near Tung Chung New Development Pier over the past few months.	1) The vessels photos in the complainant's photo are not the working vessels under Contract No. HK/2011/09. 2) No oil dumped from Contract No. HK/2011/09's working vessels was observed according to ET's site inspection conducted on 9 April 2013 at near Tung Chung New Development Ferry Pier. 3) Joint site inspection (DCVJV and ARUP) was conducted on 10 April 2013 and confirmed that Contract No. HY/2011/09's vessels are not involved the complaint case. 4) DCVJV will keep remind their boat crews not discharging contaminated effluent directly into the sea.	Closed
Com-2013-05-001	WA6	2 May 2013	ARUP received the complaint on 2 May 2013. The complainant alleged the noise nuisance was generated from the Works Area WA6 at around 13:00 on 1 May 2013 (Wednesday).	The site diary report was reviewed and confirmed that no works were carried out at WA6 on 1 May 2013. In addition, no noise was heard from WA6 according to the security guard who on duty at WA6 on 1 May 2013. Based on the information provided, the complaint regarding the construction noise at WA6 is not considered justifiable.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
Com-2013-05-002	WA6	18 May 2013	ARUP received the complaint on 18 May 2013. The complainant advised that the noise nuisance due to loading of metal parts at barge near the seawall of Works Area WA6 early morning (around 8:45a.m) on 18 May 2013 (Saturday).	Based on the record of site activities at WA6 on 18 May 2013, 4 metal plates and 2 oxygen-acetylene set were lifted onto a derrick boat “Chiu Kee” by a crane near seawall at WA6 in the morning on that day. Such operation was commenced around 8:40a.m and completed in 10 minutes during the normal construction working hour (0700 – 1900 Monday to Saturday). However, the duration of aforesaid activities is very short and infrequent. Nevertheless, the Contractor was reminded to strengthen their site supervision and provide training for the workers regularly to increase awareness of their environmental responsibilities to minimize the noise impact to the nearby residents and the specific mitigation measures for the complaint including but not limited to:- <ul style="list-style-type: none"> •To place wooden planks or rubber mats on ground for loading and unloading heavy or metal objects; and •To deploy professional personnel to supervise the works. 	Closed
Com-2013-05-003	Near Tung Chung New Development Pier	18 May 2013	EPD received the public complaint on 18 May 2013. This complaint was a follow-up of a previous complaint received by EPD on 8	After receiving the complaint, additional site inspection was conducted at near Tung Chung New Development Pier on 30 May 2013 to investigate whether oil	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
			<p>April 2013 (Com-2013-04-001).</p> <p>The complainant complained again about the oil was dumped from various vessels operating for Hong Kong-Zhuhai-Macao Bridge Hong Kong (HZMB HK) Projects near Tung Chung New Development Pier over the past months.</p>	<p>dumped was due to Contract No. HY/2011/09's vessels. During the site inspection, three working vessels under Contract No.HY/2011/09 was anchored off near Tung Chung New Development Pier. No oil dumped from Contract No. HY/2011/09's vessels were observed and the water around the vessels was clear. The following mitigation measures have been implemented by DCVJV:</p> <ul style="list-style-type: none"> • DCVJV has sent the letter to the shipping agent to remind them to ensure the vessels under Contract No. HY/2011/09 are in good condition and any oil dumped to sea should be avoided to prevent water pollution. • Provide training to the vessel skippers for prevention of pollution from ships. • DCVJV requested vessel skippers to provide engine oil disposal records The vessel skippers assured to us that all waste lubricants were sent to waste collectors regularly and no oil discharge into seawater. 	
Com-2013-07-001	Southeast Quay of Chek Lap Kok near the junction of Chek Lap Kok South Road and Scenic Road	17 July 2013	The complaint was received by EPD on 17 th July 2013. According to the EPD's letter, the complainant was concerned for the noise nuisance generated from the	In response to the complaint, ET conducted two times site inspections at Southeast Quay at Chek Lap Kok between 18:45 and 20:30 hours on 23 July 2013 and 20:30 to 22:30 hours on 30 July 2013.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
			<p>operation of concrete lorry mixers during evening and night-time period at Southeast Quay of Chek Lap Kok.</p>	<p>During the inspections, the Ro-Ro barge was observed anchored off Southeast Quay at Chek Lap Kok but no concrete lorry mixer was observed throughout the inspection.</p> <p>On 23 July 2013, at about 19:35, one tug boat was observed travelling to Southeast Quay, Chek Lap Kok and left at about 19:40.</p> <p>On 30 July 2013, no tug boat and concrete lorry mixers were observed during the inspection.</p> <p>According to the Contractor, there was no concreting works for the pier sites on 23 July 2013 and therefore no loading and unloading operation at Southeast Quay at Chek Lap Kok.</p> <p>Concreting works were performed at Pier 0 on 30 July 2013. As the Contractor anticipated the arrival time of tug boat and flap-top barge at Southeast Quay will exceed 23:00 hours after the concreting works, they decided to arrange the tug boat and flap-top barge with concrete</p>	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<p>lorry mixers anchored off around Pier 66 after 23:00 hours. So, no loading and unloading operation at Southeast Quay at Chek Lap Kok was observed.</p> <p>Further night time site inspection was conducted on 22 August 2013 during the loading and unloading operation at Southeast Quay of Chek Lap Kok, the construction works conducted under Contract No. HY/2011/09 complied with the conditions in the CNP No. GW-RS0895-13.</p>	
Com-2013-11-001	Chek Lap Kok (CLK) South Road	16 November 2013	The complaint was received by project customer services on 16 th November 2013 regarding the dust problem at Chek Lap Kok (CLK) South Road.	<p>After receiving the complaint, ET conducted the site inspection on 19 and 29 November 2013 to check the appropriate environmental protection and pollution control measures which are properly implemented by the Contractor under HY/2011/09 (DCVJV). The observation are summarized as below:-</p> <ul style="list-style-type: none"> • Dust generation works was conducted by the other Contractor at South East Quay • Proper watering of haul road to avoid dust generation during vehicle / plant equipment movement. • Vehicle washing facilities provided 	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<p>at every site exit at CLK South Road and South Perimeter Road.</p> <ul style="list-style-type: none"> No dark smoke was observed emitting from the plant equipments. <p>Based on the information collected, the complaint of dust problem at Check Lap Kok South Road is considered not related to Contract No. HY/2011/09 as dust suppression measures has been properly implemented by the Contractor on site to prevent dust nuisance from the construction activities.</p>	
Com-2014-01-001	Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between HKSAR Boundary and Scenic Hill (Contract No. HY/2011/09)	3 January 2014	The complaint was received by EPD on 3 rd January 2014. According to the EPD’s letter, a resident in Tai O District was concerned for the noise nuisance occasionally arising from the hammering or hitting of metals from Contract No. HY/2011/09.	<p>In response to the complaint, ET conducted an ad hoc night time site inspection at P0, P18 and P19 on 14 January 2014 between around 23:00 and 00:30 hours of 15 January 2014.</p> <p>In accordance with the site activities record and site inspections, the construction works conducted under Contract No. HY/2011/09 complied with the conditions in the CNP No. GW-RS1108-13.</p> <p>Nevertheless, the Contractor was advised to strictly follow the conditions of the permit because any deviation from the</p>	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<p>conditions may lead to cancellation of the permit, subsequent prosecution action and the Authority's refusal to issue further permit.</p> <p>In addition, the following environmental mitigation measures were recommended:</p> <ul style="list-style-type: none"> • Review and adjust the lighting directions of the barge, under safety consideration, to avoid potential visual impacts to residents in vicinities; • To ensure the equipment are maintaining in good operation condition; and • To strengthen site supervision and provide training for the workers regularly to increase awareness of their environmental responsibilities to minimize the noise impact to the nearby residents and the specific mitigation measures. 	
Com-2014-01-002	Hong Kong-Zhuhai-Macao Bridge	16 January 2014	The complaint was received by HyD's PR Team on 16 January 2014 that the complainant advised that the heavy exhaust fume affecting Tung Chung Crescent.	After receiving the complaint, ET conducted the site inspection on 21 January 2014 to check all the plant equipments which were operated for the construction works and air quality	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<p>mitigation measures.</p> <p>Based on the information collected, the complaint of heavy exhausts affecting Tung Chung Crescent is considered not related to Contract No. HY/2011/09 due to the following reason(s):-</p> <ol style="list-style-type: none"> 1) The work sites at Portion C and South East Quay at Portion A under Contract No. HY/2011/09 are approximately 800m from Tung Chung Crescent. Any unpleasant smell of exhaust fume would not be anticipated. 2) No heavy smoke was observed emitting from plants / equipment during the site inspection on 21 January 2014. 3) The vehicles and equipments were switched off while not in use. 4) All plant and equipment were well maintained and in good operating condition. 5) Air quality mitigation measures has been properly implemented by the Contractor on site to prevent dust nuisance from the construction activities. 	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
Com-2014-03-001	Oil Spillage at near Sha Lo Wan	5 March 2014	The complaint was received by EPD on 5 March 2014. The complainant suspected the oil leakage from the works area of Contract No. HY/2011/09 near Sha Lo Wan	Based on ET site inspection, no oil spillage from the works area under Contract No. HY/2011/09 at near Sha Lo Wan was observed. In addition, spill kits are ready on site in order to dealing with spillage cases promptly. Nevertheless, DCVJV was also recommended the mitigation measures as below: <ul style="list-style-type: none"> • Provide training for the workers regularly regarding the mitigation measures on waste / chemical management. • Provide sufficient chemical spillage kit (e.g. oil absorbent) to all vessels and working platform. • Regular check the condition of vessels and plant equipments to ensure no leakage of oil. 	Closed
Com-2014-03-002	Construction Noise in the vicinity of the waters outside Sha Lo Wan	11 March 2014	The complaint was received by EPD on 11 March 2014. According to the EPD’s letter, the complainant was concerned for the mobile crane which operating in the vicinity of the waters outside Sha Lo Wan after 23:00.	In accordance with an ad hoc site inspection on 18 March 2014, no construction works were conducted during the restricted hours. The 1 st investigation report has been submitted to EPD on 21 March 2014 and the 2nd investigation report was submitted to EPD on 26 June 2014. The Contractor was advised to strictly	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<p>follow the conditions of the permit because any deviation from the conditions may lead to cancellation of the permit, subsequent prosecution action and the Authority’s refusal to issue further permit. Nevertheless, the Contractor was reminded to take sufficient noise mitigation measures to minimize the environmental impact on the nearby community:</p> <ul style="list-style-type: none"> · To space out noisy equipment and position it as far away as possible from the sensitive receivers; · To avoid concurrent uses of noisy equipment near the sensitive area; · To ensure the equipment are maintaining in good operation condition; · To turned off any idle equipment on site; and · To enclose the noisy part of the machine by acoustic insulation material if feasible. · To arrange tailor-made training for the Production Team including the management and foremen to explain to them the conditions and requirements listed on the CNP. · To delegate one Engineer for ensuring that all construction activities and PMEs used are in full compliance with the CNP 	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				and legislative requirements.	
Com-2014-04-001	Construction marine works by the company Bauer Hong Kong in Tung Chung	14 April 2014	The complaint was received by Agriculture, Fisheries and Conservation Department (AFCD) on 14 April 2014, the complainant complained that the dead dolphin was found under a platform at construction marine works by the company Bauer Hong Kong in Tung Chung (Macau Bridge Piling Works)	<p>In accordance with the photos showing a date of 27 November 2013 (08:00 – 08:25a.m.) which provided by the complainant, the dolphin was observed has been dead for some time and shows signs of decomposition. It was difficult to determine the cause of death of the deceased dolphin based on the photographs and the dead dolphin was found a few months ago. By examining the photos, it is found that the body was beside a barge, not under a working platform.</p> <p>In addition, the dead dolphin was found in the early morning in which the marine construction works have not been commenced. Therefore, from the above information the dead dolphin is considered to be washed to the work site. However, there is no significant increase of cetacean stranding were found in Hong Kong since the commencement of Contact No. HY/2011/09.</p> <p>In regard to the complaint, the following recommendations were made:</p>	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				<ul style="list-style-type: none"> ➤ In case stranded cetaceans are found, the AFCD shall be contacted immediately and provide the following information to facilitate AFCD’s investigation: <ol style="list-style-type: none"> 1. Name and telephone number; 2. Date and time of discovery; 3. Location (as specific as possible); 4. Status of the stranded animal (i.e. alive, freshly dead, slightly decomposed, rotten, mummified); 5. Type and size of the stranded animal. ➤ To implement Dolphin Exclusion Zone during the installation of bored pile casing located in the waters to the west of Airport. ➤ To implement Dolphin Watching Plan after the bored piling casing is installed. 	
Com-2014-05-001	At the shore of Sha Lo Wan	13 May 2014	The complaint was received by EPD on 13 May 2014. According to the EPD’s email, the complainant was concerned about the sand material that was excavated on the shore of Sha Lo Wan for the construction of Hong Kong -	After receiving the complaint from a Sha Lo Wan’s village resident, the sub-contractor was instructed to stop the sand excavation and leave immediately. In addition, all sands excavated from the shore of Sha Lo Wan were returned back to the original area on 13 May 2014.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
			Zhuhai - Macao Bridge (HZMB) Project on 11 May 2014.	<p>Nevertheless, the Contractor was advised to arrange tailor-made training for Production Team including the management and foremen to explain to them the conditions and requirements listed on the Environmental Permit.</p> <p>In addition, indicative poles and flags are recommended to put within the site boundary to identify the extent of land areas in Sha Lo Wan / Sha Lo Wan (West) Archaeological site.</p>	
Com-2014-05-002	At the shore of Sha Lo Wan	27 May 2014	The complaint was received by EPD on 27 May 2014. According to the EPD's email, the complainant was concerned about the dumping rubbles along the shore area of Sha Lo Wan on 27 May 2014.	<p>The complaint investigation report for the complaint of dumping rubbles along the shore area of Sha Lo Wan was submitted to EPD on 4 June 2014.</p> <p>EPD and AFCD provided their comments on 5 and 9 June 2014 respectively.</p> <p>A meeting among DCVJV, ARUP, IEC, ET, EPD and AFCD was held on 17 June 2014. According to the meeting, further information is required to include in the complaint investigation report and the report was submitted to EPD on 4 March 2015.</p>	Complaint investigation report is under review by EPD

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
Com-2014-05-003	Pier 39 to 50	29 May 2014	ARUP received the complaint on 29 May 2013. The complainant advised that the workers disposed hundreds of kg of waste spoils (concrete and earth) into the sea every day in the existing locations of HZMB site area.	Based on the investigation findings, the waste spoils (concrete and earth) were disposed to HY/2010/02 Project according to approved WMP. The following recommendations were made: <ul style="list-style-type: none"> • To check for any accumulation of waste spoils (concrete and earth) on site. • To cover the wastes skip with waste spoils before removing from site. • To carry out inspection of pier(s) regularly to ensure the frontline staff loads inert materials to approved barge properly. • To clean the waste storage areas regularly and do not cause dust nuisance. 	Closed
Com-2014-08-001	Near Sha Lo Wan	27 August 2014	ARUP received the complaint on 27 August 2013. The complainant was concerned about the dust on the surface of the roro-barge.	Based on the investigation findings, dusty materials at the ro-ro barge at P63 and dust generation when vehicles passing by at the roro-barge at Southeast Quay were observed. The following recommendations were made: <ul style="list-style-type: none"> • To check for any accumulation of dusty materials at roro-barge. • To cover the stockpile of dusty materials before removing from site. • To clean the surface of roro-barge 	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				regularly and do not cause dust and water quality nuisance. <ul style="list-style-type: none"> • To maintain the surface of ro-ro-barge wet especially during the vehicle movements. Water misting is considered an acceptable measure to control dust emissions. • To check and replace the worn sand bags at the surface of ro-ro-barge to prevent the turbid water from entering to the sea when watering the barge surface. 	
Com-2014-11-001	HZMB-HKLR – Section between HKSAR Boundary and Scenic Hill (Contract No. HY/2011/09)	11 November 2014	The complaint was received by EPD on 11 November 2014. According to the EPD’s email, the complaint was received from one of the green groups Sea Shepherd. They complained that the residual concrete had been washed off from the deck surface of a flat-top barge into the sea, and marine littering had been spotted by a worker of HZMB-HKLR – Section between HKSAR Boundary and Scenic Hill (Contract No. HY/2011/09)	Based on the investigation findings, residue concrete or wastewater contaminated with concrete overflowing/spilling into the sea from the ro-ro barge and marine littering were suspected. The following recommendations were made: <ul style="list-style-type: none"> ➤ Properly clear the concrete stains on the three ro-ro barges (e.g. hand-held equipments such as shovel etc). Tarpaulin sheet is also recommended to provide when clearing the concrete stains at the edge of ro-ro barge to prevent these removed materials from getting into the sea. The worker should also pay special care to remove the concrete stains to 	Closed
Com-2014-11-002	HZMB-HKLR – Section between HKSAR Boundary and Scenic Hill	18 November 2014	The complaint was received by EPD on 18 November 2014. According to the EPD’s email, it was alleged that residual concrete		Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
	(Contract No. HY/2011/09)		had been poured out directly from the concrete lorry mixers on a ro-ro barge into the sea during night-time by the workers of HZMB-HKLR – Section between HKSAR Boundary and Scenic Hill (Contract No. HY/2011/09)	minimize the water quality nuisance. <ul style="list-style-type: none"> ➤ Keep cleanliness of the surface of ro-ro-barge and do not cause water quality nuisance. ➤ To check and reinforce the concrete / sand bag bund between baffles erected near the edge of the three ro-ro barges to avoid accidental leakage of wastewater from the deck regularly. ➤ Keep all debris/ aggregate away from the edge of ro-ro barge to prevent them from falling into the sea. ➤ Provide sufficient skips for temporary storage of concrete residue/wastewater. ➤ To check for any accumulation of residual waste concrete at the waste skip on ro-ro-barge. ➤ Provide spare and sufficient sand bags at each ro-ro barges to confine the concerned area in the event of accidental spillage of concrete when discharge the concrete from the concrete lorry mixers to pump truck. ➤ Provide absorptive materials to absorb the wastewater in case of accidental spillage of wastewater 	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				during washing concrete lorry mixers or other equipments. ➤ Assign trained staff to ensure proper management of environmental matters on each of the ro-ro barges in particular the handling of concrete residue/wastewater generated during operation. ➤ Keep record for collection of skip or temporary storage tank for wastewater and excess concrete. ➤ Ensure sufficient garbage bag / rubbish bin are provided at working barge / pier site. ➤ Provide training for the workers regularly regarding the water quality mitigation measures and waste management to increase their awareness of environmental protection.	
Com-2014-11-003	Floating Concrete Batching Plant (FCBP)	28 November 2014	The complaint was received by EPD on 28 November 2014. The complaint was received from one of the green groups Green Lantau Association. They complained about the hauling of the floating concrete batching plant (FCBP) by the tug boat to the site of Contract No. HY/2011/09 from the north-	Based on the information collected, the following conclusions were drawn: 1) It is suspected that the wake following the FCBP was resulted from disturbance to the bottom sediment when it was traveling during the lowest tide on that day. 2) The FCBP was traveling within the	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
			<p>east side had disturbed the seabed causing an increase of turbidity in marine waters at around noon of 15 November 2014.</p>	<p>site area and the maximum number of movement of a floating plant (and therefore tug boat) is two times per day. Average duration of each movement is around 1 hour/day. Therefore, the disturbance to the bottom sediment is considered temporary, localized and infrequent.</p> <p>3) No illegally discharge of wastewater or domestic wastewater to the sea from FCBP.</p> <p>4) Relevant environmental mitigation measures as shown in EP-352/2009/C were properly implemented.</p> <p>5) No deterioration of marine water quality based on the marine water quality monitoring results on 15 November 2014.</p> <p>Nevertheless, DCVJV was also recommended the mitigation measures as below:</p> <ul style="list-style-type: none"> • The vessel skipper should pay special care about the movement of deep draught vessel to avoid seabed disturbance. (e.g. speed restrictions) • In case of sediment plume was found behind vessel, the vessel skipper 	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				should further reduce vessel speed. <ul style="list-style-type: none"> • Minimum clearance of 0.6m should be maintained between vessels and the seabed in all tide conditions, to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash. (Reference: EIA-081/2002 - Construction of Lung Kwu Chau Jetty) 	
Com-2014-12-001	Shores of Po Chue Tam and Shek Tsai Po, Tai O	7 December 2014	The complaint was received from one of the green groups Green Lantau Association. They complained about some waste materials (including a number of grey plastic mats and buoys) suspected in relation to the HZMB works have recently washed up on the shores of Po Chue Tam and Shek Tsai Po, Tai O	The owner of objects found on the shores could not be identified. DCVJV has taken initiative to remove these materials after receiving the complaint. Nevertheless, DCVJV was also recommended the mitigation measures as below: <ul style="list-style-type: none"> • Gather up and remove debris to keep the work site orderly. • Maintain site housekeeping. Designate areas for waste materials and provide containers. • Secure loose or light material that is stored on open floors. • Do not permit rubbish to fall freely from any level of the pier sites. • Provide training for the workers 	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				regularly regarding the water quality mitigation measures and waste management to increase their awareness of environmental protection.	
Com-2014-12-002	Site Office of HZMB-HKLR – Section between HKSAR Boundary and Scenic Hill	2 December 2014	Highways Department (HyD) received a public complaint from a resident of Le Bleu Duex on 2 December 2014. According to the email from ARUP dated 3 December 2014, the complainant advised that the noise nuisance due to the metal parts were dropped onto the ground by people repetitively and loading or unloading a boat at the pier. The complaint was quoted, “A resident living in Le Bleu Duex addressed a complaint to CE of HyD at about 20:04 hrs last night. He complained about the noise nuisance coming from site office since 19:30 hrs last night. Repetitively metal parts had been dropped on the ground by people who seem to	Based on the information collected, the noise generated is considered due to the metal parts were dropped onto the ground at the seashore area near Le Bleu Duex. The metal pipe was unloaded at non-designated area and no powered mechanical equipment was used for unloading works at WA6 during restricted hour. The Contractor was reminded to take sufficient noise mitigation measures to minimize the environmental impact on the nearby community as recommended in the approved EIA report and the specific mitigation measures for the complaint including but not limited to:- <ul style="list-style-type: none"> • To place wooden planks or rubber mats on ground for loading and unloading heavy or metal objects; and • To deploy professional personnel to 	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
			<i>be loading or unloading a boat at the pier. Noise was still going on right now at 20:04.”</i>	supervise the works.	
Com-2014-12-003	Along the shore from Yat Tung to Tai O	24 December 2014	The complainant was concerned about the increase of marine refuse (water bottles and debris) along the shore from Yat Tung to Tai O suspected in relation to the HZMB works.	<p>The owner of marine refuse found on the shores could not be identified. DCVJV has taken initiative to remove these wastes after receiving the complaint. DCVJV will also take the initiative to clear the marine refuse along the shore from Yat Tung to Tai O, if necessary.</p> <p>Nevertheless, DCVJV was also recommended the mitigation measures as below:</p> <ul style="list-style-type: none"> • Gather up and remove debris to keep the work site orderly. • Maintain site housekeeping. Designate areas for waste materials and provide containers. • Secure loose or light material that is stored on open floors. • Do not permit rubbish to fall freely from any level of the pier sites. • Provide training for the workers regularly regarding the water quality mitigation measures and waste management to increase their awareness of environmental 	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				protection.	
Com-2015-06-001	The sea side at WA6 vertical seawall	6 June 2015	A resident living in Le Bleu Duex complained about noise from a barge which unloading materials at about 21:00 hrs last Saturday i.e. 6 June 2015	<p>Based on the information collected, the noise generated is considered due to the unloading of steel casings to the seashore area opposite to the China State Site Office.</p> <p>The person-in-charge of the barge has been reprimanded by the Contractor for causing noise nuisance to resident nearby. In addition, the Contractor had also reminded their subcontractors to avoid unloading of materials during restricted hours (i.e. 19:00 to 07:00 hours on any day and any time on public holidays including Sundays) without Construction Noise Permit (CNP).</p> <p>The Contractor was reminded to obtain Construction Noise Permit (CNP) for PME use in restricted hours.</p> <p>The Contractor was reminded again to take sufficient noise mitigation measures to minimize the environmental impact on the nearby community as recommended in the approved EIA report and the specific mitigation measures for the complaint including but not limited to:-</p> <ul style="list-style-type: none"> • To place wooden planks or rubber 	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/ Mitigation Action	Status
				mats on ground for loading and unloading heavy or metal objects; and <ul style="list-style-type: none"> • To deploy professional personnel to supervise the works. 	

**APPENDIX Q
SUMMARY OF SUCCESSFUL
PROSECUTION**

Appendix Q - Summary of Successful Prosecution

Date of Successful Prosecution	Details of the Successful Prosecution	Status	Follow Up
20 October 2014	The non-compliance of construction noise permit (CNP) numbered GW-RS1217-13 that use of powered mechanical equipment not permitted in the CNP on 15 March 2014 between the hours of 7p.m. and 7a.m. at Pier 72.	The subcontractor was fined.	To ensure the construction works would comply with the CNP during restricted hours, a Permit-to-work system was formulated to control daily operation of the CNPs.