Contract No. SS H504
Design and
Construction of Chai
Wan Government
Complex and Vehicle
Depot

30th Monthly EM&A Report **Yau Lee Construction Co, Ltd**2024-06-06



Document control record

Document prepared by:

Aurecon Hong Kong Limited

Unit 1608, 16/F, Tower B, Manulife Financial Centre,

223 – 231 Wai Yip Street, Kwun Tong, Kowloon

Hong Kong S. A. R.

T +852 3664 6888

F +852 3664 6999

E hongkong@aurecongroup.com

W aurecongroup.com

A person using Aurecon documents or data accepts the risk of:

- Using the documents or data in electronic form without requesting and checking them for accuracy against the original hard copy version.
- b) Using the documents or data for any purpose not agreed to in writing by Aurecon.

Document control					áurecon		
Repo	rt title	30th Monthly EM&A Report	30th Monthly EM&A Report				
Docu	ment ID	MMR	Project nu	Project number P5205			
File path		520574-0000-PLN-NM-00032 [520574-0000-PLN-NM-00032 [0]				
Client		Yau Lee Construction Co, Ltd					
Clien	t contact		Client refe	Client reference			
Rev	Date	Revision details/status	Author	Reviewer	Verifier (if required)	Approver	
0	10 May 2024	Submitted to IEC	Various	K.Chau		FL	
1	10 May 2024	Submitted to IEC	Various	K.Chau		FL	
2	6 June 2024	Update for comments	Various	K.Chau		FL	
Curre	Current revision 2						

Approval					
Reviewer's signature		Approver's signature	Tul		
Name	Keith Chau	Name	Fredrick Leong		
Title	Associate, Environmental	Title	Environmental Team Leader		



Contents

Ex	ecutive Summary	1
1	Introduction	3
2	Project Information	4
	Environmental Monitoring Requirements	
	Implementation Status on Environmental Mitigation Measures	
	Monitoring Results	
	Environmental Site Inspection	
	Environmental Non-conformance	
8	Future Key Issues	.16
	Review of EM&A Data and EIA Predictions	
	Conclusion	

Appendix

Appendix 1	Construction Programme
Appendix 2	Project Organization Chart and Contact Details
Appendix 3	Monitoring Programme for Reporting Period
Appendix 4	Calibration Certificates
Appendix 5	Event and Action Plan
Appendix 6	Implementation Status of Mitigation Measures
Appendix 7	Monitoring Results with Graphical Presentations
Appendix 8	Waste Flow Table
Appendix 9	Joint site inspection record for Reporting Period
Appendix 10	Monitoring Schedule for the Next Month
Appendix 11	Notification of Environmental Quality Limits Exceedance

All rights reserved | The information/data furnished in our document is confidential and competitive information proprietary to Aurecon or its subcontractors, the release of which would harm the competitive position of Aurecon or its sub-contractors/consultants. This information/data shall not be reproduced, stored in a retrieval system, transmitted in any form or by any means, used or disclosed in whole or in part, for any purpose other than to evaluate and adjudicate this document. If Aurecon is shortlisted or a contract is awarded to Aurecon as a result of this solicitation, or in connection with the submission of such information/data, the right (and the extent thereof) to reproduce, store, transmit, use or disclose this information/data must, by agreement, be included in such contract.



Executive Summary

Aurecon Hong Kong Limited (Aurecon) was commissioned by the Yau Lee Construction Co, Ltd (Yau Lee) to undertake the role of Environmental Team (ET) for carrying out the environmental monitoring and audit (EM&A) works for the "Contract No. SS H504 Design and Construction of Chai Wan Government Complex and Vehicle Depot (The Project).

An Environmental Permit (EP) No. EP-505/2015 was issued by the Environmental Protection Department (EPD) on 17 December 2015 for the construction of this project based on the Environmental Impact Assessment (EIA) Report (Register No: AEIAR-191/2015) approved by the EPD. The latest EP No. EP-505/2015/A was subsequently issued by the EPD on 8 November 2019 based on the documents (including an Environmental Review Report (ERR)) for the application of Variation of Environmental Permit.

The construction phase and EM&A programme of the Project commenced on 25 November 2021.

This 30th Monthly EM&A Report presents the EM&A works conducted from 1 April 2024 to 30 April 2024 in accordance with the EM&A Manual.

Summary of Construction Works undertaken during Report Period

The major construction works undertaken during the reporting period include:

-	Superstructure construction
-	Rebar fixing
-	Formwork erection
-	Concreting works
-	Installation of MiC and precast elements

Environmental Monitoring and Audit Progress

A summary of the monitoring activities in this reporting period is listed below:

-	Construction Noise Monitoring during normal weekdays at each monitoring station	4 times
-	Joint Environmental Site Inspection	4 times

Noise

4 sets of 30-minute construction noise measurement were carried out at each monitoring stations during normal weekdays of the reporting period. No exceedance of Action and Limit Levels of construction noise was recorded during the reporting period.

Environmental Site Inspection

Joint environmental site inspections were carried out on 05, 11, 18 and 25 April 2024. The joint environmental site inspection was carried out by the representatives of the Engineer's

Representative (ER), the Contractor, IEC and the ET on 11 April 2024. The Contractor has generally implemented the mitigation measures as recommended.

Environmental Exceedance/Non-conformance/Compliant/Summons and Prosecution

No exceedance of the Action and Limit Levels of construction noise was recorded at designated monitoring stations during the reporting period.

No non-compliance event was recorded during the reporting period.

No environmental complaint and summons/prosecutions was received in this reporting period.

EPD conducted general site inspection on 17 April 2024. No special findings were identified during the inspection.

Future Key Issues

Works to be undertaken in the next month include:

- Superstructure construction
- Rebar fixing
- Formwork erection
- Concreting works
- Installation of Mic and precast elements
- Finishing works and BS installation works

Potential environmental impacts arising from the above construction activities are mainly associated with dust, construction noise, site runoff and waste management.

1 Introduction

1.1.1 Aurecon Hong Kong Limited (Aurecon) was commissioned by the Yau Lee Construction Co, Ltd (Yau Lee) to undertake the role of Environmental Team (ET) for carrying out the environmental monitoring and audit (EM&A) works for the "Contract No. SS H504 Design and Construction of Chai Wan Government Complex and Vehicle Depot (The Project).

1.2 Purpose of this Report

1.2.1 This is the thirtieth EM&A report which summarises the impact monitoring results and audit findings for the EM&A programme during the reporting period from 01 April 2024 to 30 April 2024.

1.3 Structure of the Report

1.3.1 The structure of the report is as follows:

Section 1 - Introduction

- details the background, purpose and structure of the report.

Section 2 - Project Information

 summarises background and scope of the Project, site description, project organization and contact details, construction programme, the construction works undertaken and the status of Environmental Permit(s)/License(s) during the reporting period.

Section 3 - Environmental Monitoring Requirement

- summarises the monitoring parameters, monitoring programmes, monitoring methodologies, monitoring frequency, monitoring locations, Action and Limit Levels, Event/Action Plans.

Section 4 - Implementation Status on Environmental Mitigation Measures

- summarises the implementation of environmental protection measures during the reporting period.

Section 5 - Monitoring Results

- summarises the monitoring results obtained in the reporting period.

Section 6 - Environmental Site Auditing

 summarises the audit findings of the weekly site inspections undertaken within the reporting period.

Section 7 - Environmental Non-conformance

 summarises any monitoring exceedance, environmental complaints and environmental summons within the reporting period.

Section 8 - Future Key Issues

- summarises the impact forecast and monitoring schedule for the next reporting month.

Section 9 - Review of EM&A Data and EIA Predictions

 compares and contrasts the EM&A data in the month with the EIA predictions and annotates with explanation for any discrepancies.

Section 10 - Conclusions

2 Project Information

2.1 Background

- 2.1.1 On 5 October 2015, the Environment Impact Assessment (EIA) for the proposed "Chai Wan Government Complex and Vehicle Depot" (AEIAR-191/2015, hereafter referred to as "the Project") was approved and an Environmental Permit (EP) (EP-505/2015) for the construction of the Project was issued. The latest EP No. EP-505/2015/A was subsequently issued by the EPD on 8 November 2019 based on the documents (including an Environmental Review Report (ERR)) for the application of Variation of Environmental Permit.
- 2.1.2 The construction phase and EM&A programme of the Project commenced on 25 November 2021.

2.2 Site Description

2.2.1 The scope of works of the Project, which is a Designated Project under the EIA Ordinance (EIAO), will construct joint user building comprising the government office, store, laboratory, transport pool and vehicle depot facilities in Chai Wan District. The Site is bounded by NWFB Depot to the north, Sheung On Street to the east, Sheung Mau Street to the south and Sheung Tat Street to the west. A layout plan of the Project is provided in Figure 1-1.

を良排
Lo Shue Pai

Apper

Appe

Figure 1-1 A layout plan of the Project

2.3 Construction Activities

2.3.1 A summary of the major construction activities undertaken in this reporting period is shown in **Table 2.1** and the construction programme is illustrated in **Appendix 1**.

Table 2-1 Major Construction Activities Undertaken in the Reporting Period

	Construction Activities Undertaken				
-	Superstructure construction				
-	Rebar fixing				
-	Formwork erection				
-	Concreting works				
-	Installation of MiC and precast elements				

2.4 Project Organisation

2.4.1 The Project organization chart and contact details are shown in **Appendix 2**.

2.5 Status of Environmental Approval Document

2.5.1 A summary of the relevant valid permits, licences, and/or notifications on environmental protection for this Project since the granting of the EP is presented in **Table 2.2**.

Table 2-2 Summary of the relevant valid permits, license, and/or notification on environmental protection

Permit / Licenses / Notification	Reference	Validity Period	Remark
Environmental Permit (EP)	EP-505/2015/A	Throughout the Contract	Permit granted on 8 November 2019
Notification of Construction Works as required under Air Pollution Control (Construction Dust) Regulation	469716	Throughout the Contract	Approved on 21 July 2021
Registration of Waste Producer under Waste Disposal Ordinance	7041313	Throughout the Contract	Approved on 13 August 2021
Registration as Chemical Waste Producer	5213-163-Y2782-01	Throughout the Contract	Approved on 24 August 2021
Construction Noise Permit	GW-RS0090-24	15 August 2024	Approved on 16 February 2024
Effluent Discharge License under Water Pollution Control Ordinance	WT00038924-2021	30 September 2026	Approved on 9 December 2021

3 Environmental Monitoring Requirements

3.1 Noise Monitoring Locations

3.1.1 The noise monitoring locations in approved EM&A Manual are summarised in **Table 3-1** and shown in **Figure 3-1**.

Table 3-1 Noise Monitoring Station in Approved EM&A Manual

Noise Monitoring ID	Proposed Noise Monitoring Location	Remark
NM1	Ground Floor at Heng Fa Chuen Block 50	-
NM2b	Pedestrian road at Shing Tai Road	*
NM3	Rooftop of THEi Campus	-

Remark: * -

Hong Kong Institute of Vocational Education (Chai Wan) - Academic Block (NM2) is the noise monitoring stations for the construction phase EM&A programme as identified in the approved EM&A Manual for the Project. The access to NM2 and Knight Court (as a VTC Senior Quarters and NSR3 in approved EIA) were denied. A search for alternative noise monitoring locations along Shing Tai Road and Sheung Mau Street was carried out during the site visit on 4 October 2021

Lamp Post no. 47447 at Sheung Mau Street (NM2a), which is located between project site and original noise monitoring location, Hong Kong Institute of Vocational Education (Chai Wan) - Academic Block (NM2), is found suitable and available to be an alternative noise monitoring location for NM2. Also, NM2a, which has a direct line of sight towards project site (where construction works will be carried out and likely to have noise impacts), is located closer to project site than NM2 and thus considered as a representative noise monitoring location. Monitoring position at NM2a is proposed at 2m above ground due to security concerns and minimize the road traffic noise contribution. Noise measurement at NM2a will be considered as free-field and a correction of +3dB(A) would be made to the noise monitoring results. The alternative location of NM2a, were therefore proposed and agreed by the Independent Environmental Checker (IEC).

Due to the adjustment of the location of NM2 to NM2a, the measured noise levels at NM2a would represent the noise levels at NM2.

To respond to the comment raised by EPD on monitoring location of NM2a by email dated 23 May 2022 and site meeting on 6 June 2022, the monitoring location of NM2a was adjusted to the pedestrian road at Shing Tai Road (NM2b) which is located between project site and original noise monitoring location, Hong Kong Institute of Vocational Education (Chai Wan) - Academic Block (NM2). Compared with NM2a, NM2b is far away from the traffic light and therefore should be able to minimise the traffic noise issue. This arrangement was started from 28 June 2022 and has been agreed by the Independent Environmental Checker (IEC). Noise measurement at NM2b will be considered as free-field and a correction of +3dB(A) would be made to the noise monitoring results.

Due to the adjustment of the location of NM2a to NM2b, the measured noise level at NM2b would represent the noise levels at NM2.



Figure 3-1 Location of Noise Monitoring Stations (NM1, NM2b and NM3)

3.2 Monitoring Parameters, Frequency and Duration

- 3.2.1 Weekly construction noise monitoring was conducted in accordance with the requirements stipulated in the EM&A Manual. The monitoring programme for this reporting period is shown in **Appendix 3.**
- 3.2.2 **Table 3-2** summarizes the monitoring parameters, frequency and duration of the impact noise monitoring.

Table 3-2 Noise Monitoring Parameters, Period and Frequency

Time Period	Parameters
Daytime on normal weekdays (0700-1900 hrs)	$L_{eq(30 \; mins)}, L_{10(5 \; mins)}$ and $L_{90(5 \; mins)}$
Evening time on all days (1900-2300 hrs) and Holidays (including Sundays) during daytime and evening (0700-2300 hrs)	$L_{eq(5mins)},L_{10(5mins)}$ and $L_{90(5mins)}$
All days during the night-time (2300-0700 hrs	L _{eq(5 mins)} L _{10(5 mins)} and L _{90(5 mins)}
of the next day)	

3.3 Monitoring Equipment

- Noise measurements were conducted in accordance with the calibration and 3.3.1 measurement procedures as stated in Annex - General Calibration and Measurement Procedures of Technical Memorandum on Noise from Construction Work other than Percussive Piling (GW-TM) issued under the Noise Control Ordinance (NCO) (Cap.400).
- 3.3.2 The sound level meter and calibrator used for the noise measurement, as listed in Table 3-3, complies with IEC 651: 1979 and 804:1985 (Type 1) specification. The calibration certificates of the sound level meter and calibrator are given in Appendix 4.

Table 3-3 **Noise Monitoring Equipment**

Monitoring Station	Monitoring Equipment (Sound Level Meter and Calibrator)
NM1	Sound Level Meter: Rion NL 52(s/n:01010406)
NM2b	Calibrator: Larson Davis Cal 200(s/n: 11334)
NM3	

- 3.3.3 Immediately prior to and following the noise measurements, the accuracy of the measurement equipment was checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Measurements were accepted as the calibration level from before and after the noise measurement agree to within 1.0 d(B).
- 3.3.4 A portable wind speed meter shall be used for measuring wind speeds in m/s.

3.4 Event / Action Plan

Table 3-4 **Action and Limit Levels for Construction Noise Monitoring**

Monitoring	Action Level	Limit Level		
Station		Noise Criteria, Leq _(30mins) , dB(A)	Remark	
NM1		75		
		70		
NM2b	When one documented complaint is received	65 (during examination)	Applicable during 0700 – 1900 hours,	
		70	Monday to Saturday	
NM3		65 (during examination)		
NM3		65 (during examination)		

3.4.1 Should non-compliance of the noise criteria occur, the Event and Action Plan as presented in **Appendix 5** should be followed.

3.5 Mitigation Measures

3.5.1 The mitigation measures in accordance with the EP, EIA and EM&A Manual and their implementation status are presented in **Appendix 6**.

4 Implementation Status on Environmental Mitigation Measures

- 4.1.1 The Contractor has generally implemented environmental mitigation measures and requirements as stated in the EIA Report, the EP and EM&A Manual and the contract documents. The implementation status during the reporting period is summarized in **Appendix 6**.
- 4.1.2 The implemented environmental mitigation measures are listed as follow:
 - I. The timing and sequence of construction activities were carefully arranged.
 - II. QPME were used to reduce the excessive noise impact.
 - III. Good site practices were implemented to reduce noise impact of the site activities. The practices are listed as below:
 - Use only well-maintained and regularly-serviced plant during the works;
 - Turn off or throttle down the plant in intermittent use to a minimum;
 - Orient the plant known to emit noise strongly in one direction to face away from the NSRs:
 - Use silencers, mufflers and enclosures for plant where possible and maintain properly throughout the works;
 - Site fixed plant as far away from NSRs as possible; and
 - Use stockpiles of excavated materials and other structures such as site buildings effectively to screen noise from the works.
 - IV. Movable noise barrier/acoustic sheet barriers as noise shield were adopted as far as practicable following the Construction Noise Management Plan (CNMP).

5 Monitoring Results

5.1 Noise

5.1.1 A total of 4 sets of 30-minute construction noise measurements were carried out at the monitoring stations (NM1, NM2b and NM3) during normal weekdays of the reporting period. The monitoring results together with graphical presentations are presented in **Appendix 7**. The local impacts observed near the monitoring stations were summarized below:

• NM1: Railway noise, traffic noise and Yau Lee Site.

NM2b: Road traffic noise and Yau Lee Site.
NM3: Cargo Handling Area and Yau Lee Site.

- 5.1.2 No exceedance of Action and Limit Levels of construction noise was recorded during the reporting period. Therefore, there was no record of Notification of Environmental Quality Limits Exceedance in the **Appendix 11**.
- 5.1.3 Baseline corrections were made when the measured noise level is higher than both the noise limit level and the baseline level, and it is made by deducting the measured noise levels with their corresponding baseline noise level. The corrected noise level (ie. Construction Noise Level) would solely represent the noise levels of Construction works.
- 5.1.4 The methodology is shown as below:
 - When Measured noise level (Leq 30mins) > Baseline noise level (Leq30),
 Construction noise level is calculated
 - Construction noise level = Measured noise level (Leg 30 mins) Baseline noise level
 - If Measured noise level (Leq 30mins) < Baseline noise level, Corrected noise level = Measured noise level

5.2 Waste Management

Wastes generated from this Project include inert construction and demolition (C&D) materials and non-inert C&D materials. Non-inert C&D materials were made up of general refuse, steels and paper/cardboard packaging materials. Steel materials generated from the Project were also grouped into non-inert C&D materials as the materials were not disposed of with other inert C&D materials. With reference to relevant handling records and trip tickets of this Project, the quantities of different types of waste generated in the reporting period are summarised in **Appendix 8**. The non-inert C&D materials and general refuse generated from the Project were disposed of at the NENT Landfill. A total of 158.5 tonnes of general refuse was generated during the reporting period. The inert C&D materials generated from the Project were disposed of at the Chai Wan Public Fill Barging Point (CW-PFBP) or Fill Bank at Tseung Kwan O Area 137(TKO137FB). A total of 119.11 tonnes of inert waste was generated during the reporting period.

6 Environmental Site Inspection

- 6.1.1 Joint environmental site inspection was conducted in the reporting period on 05, 11, 18 and 25 April 2024. The joint environmental site inspection was carried out by the representatives of the Engineer's Representative (ER), the Contractor, IEC and the ET on 11 April 2024. The joint environmental site inspection record is shown in **Appendix 9**. There was no noncompliance recorded during the site inspections.
- 6.1.2 Major findings and recommendations are summarized as follows:

05 April 2024

- General refuses were identified on the ground without proper disposal. The
 housekeeping shall be improved. The contractor has been recommended to
 provided sufficient rubbish bins with lid and other segregation skip/bins for
 proper disposal of general refuse and segregation of different type of waste.
- Waste oil and other waste were accumulated inside the chemical drip tray. Chemical containers were identified next to the drip tray. The contractor should clear the waste oil and various type of waste accumulated inside the drip tray.
 Other chemical containers identified at the site should be out inside the drip tray.

11 April 2024

 The general waste stored on the floor was observed, and the accumulation of C&A waste was found. The contractor has been recommended to increase the frequency of C&D waste disposal to prevent accumulation and to provide efficient waste skip for waste storage.

18 April 2024

- NRMM label shall be fixed on the forklift. The contractor has been recommended to display the NRMM label on the forklift.
- The general waste shall be collected and stored in the enclosed bin. The contractor has been advised to arrange more frequent site cleanings to keep the site clean and tidy.
- The chemical containers shall be placed on the impervious sheet and stored in the drip tray. The contractor has been reminded to provide impervious sheet and chemical drip tray for placing and storing chemical containers to prevent chemical leakage.

25 April 2024

- The accumulation of general waste and the C&D waste on the floor was observed. The contractor has been recommended to provide more enclosed bins and waste skips for waste collection and storage, as well as increase the frequency of waste disposal to prevent waste accumulation.
- The chemical containers should be placed on the impervious sheet and stored in the drip tray, and oil stain was found in the work area. The contractor has been reminded to provide impervious sheet and chemical drip tray for placing and storing chemical containers to prevent chemical leakage. Also, they should clean up the oil stain immediately and dispose of it as chemical waste.

7 Environmental Non-conformance

7.1 7.1	Summary of Monitoring Exceedance No exceedance of the Action and Limit Levels of construction noise was recorded at monitoring station during the reporting period.
7.2 7.2.1	Summary of Environmental Non-compliance No non-compliance event was recorded during the reporting period.
7.3 7.3.1	Summary of Environmental Complaint No complaint was received during the reporting period.
7.4	Summary of Environmental Summons and Successful Prosecution
7.4.1	No summons and successful prosecution were received during the reporting period.

8 Future Key Issues

8.1 Key Issues for the Coming Month

- 8.1.1 Works to be undertaken for the coming monitoring periods are summarized below:
 - Superstructure construction
 - Rebar fixing
 - Formwork erection
 - Concreting works
 - Installation of MiC and Precast Elements
 - Finishing works and BS installation works
- 8.1.2 Potential environmental impacts arising from the above construction activities are mainly associated with dust, construction noise, site runoff and waste management.

8.2 Monitoring Schedule for the Next Month

8.2.1 The tentative schedule of noise monitoring for the next reporting period is presented in **Appendix 10**.

8.3 Construction Programme for the Next Month

8.3.1 The most updated construction programme for the Project is presented in **Appendix 1**.

9 Review of EM&A Data and EIA Predictions

9.1 Noise

9.1.1 The EIA predicted the construction noise levels during the day-time period. In this reporting period, Superstructure construction, rebar fixing, formwork erection, concreting works were conducted. Hence, a comparison between the measured noise results in this reporting month and predicted EIA noise levels was made. (**Table 9-1**).

Table 9-1 Comparison between the measured noise results and EIA predictions

Monitoring Station	EIA Predicted Construction	Baseline Noise Levels, dB(A)	Noise Monitorin	ing Results, dB(A)	
	Noise Levels, dB(A)		Leq _(30mins) , Average	Range	
NM1	62	65.1	64.1	63-65	
NM2b	69	73.4	71.2	69-72	
NM3	66	69.8	66.8	66-67	

Note: * The measured noise level exceeded the limit noise level of 70 dB for NM2b, but they were lower than the baseline level for NM2b. Therefore, they were not considered as an exceedance of limit level. As such the EAP was not triggered.

9.1.2 The comparison shows that the average of 30-minute construction noise levels recorded at all monitoring stations during the reporting period were higher than the EIA predicted construction noise levels but lower than the baseline noise levels. Recommended mitigation measures in **Section 5.8** of EIA will be implemented throughout the construction period.

9.2 Waste Management

9.2.1 The estimated amount of waste generated in this Project and the accumulated quantities of waste generated up to this reporting month are presented in **Appendix 8**. The amount of construction waste generated are minimal. Recommended mitigation measures in **Section 8.5** of the EIA will be implemented during the construction stage.

9.3 Conclusion of Review

9.3.1 The EIA predictions against the monitoring results since the commencement of construction works have been reviewed. The EIA concluded that the Project would not cause adverse impacts to the environment, and the monitoring results have also indicated the same so far. Mitigation measures recommended in the EP, EIA, EM&A Manual and the contract documents will continue to be implemented throughout the construction phase of the Project.


10 Conclusion

- 10.1.1 For construction noise, no Action and Limit Level exceedance was recorded at the monitoring stations during the reporting period.
- 10.1.2 Environmental site inspection was carried out on 05, 11, 18 and 25 April 2024. Recommendations on remedial actions were given to the Contractors for the deficiencies identified during the site inspections.
- 10.1.3 EPD conducted general site inspection on 17 April 2024. No special findings were identified during the inspection.
- 10.1.4 No notification of summons and prosecution was received during the reporting period.
- 10.1.5 The ET will keep track on the EM&A programme to ensure compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

Appendix 1

					Calendar Complete	Apr		May	Jun	Jul
	0 days	Thu 24/6/21	Thu 24/6/21		Calendar day 100%	M35		M36	M37	M38
	.389.5 days		Thu 8/5/25		Calendar day 0%					
	0 days		Mon 19/7/21		Calendar day 100%					
	0 days	Mon 19/7/21	Mon 19/7/21 3SS		Calendar day 100%		1.1			1
riod (945 days after starting date)	0 days	Mon 19/2/24	Mon 19/2/24 3SS+946 days		Calendar day 0%		<u> </u>			
iod (1023.5 days after starting date)	0 days	Wed 8/5/24	Wed 8/5/24 3SS+1024.5 da	7SS+365 days	Calendar day 0%			8/5		
	0 days	Thu 8/5/25	Thu 8/5/25 6SS+365 days		Calendar day 0%		1 1			-
er than AIP/DDA	416 days	Tue 5/10/21	Thu 24/11/22		Calendar day 100%		1 1			
ronmental Permit to EPD	77 days	Wed 27/10/21	Tue 11/1/22		Calendar day 100%		1.1			
sment (TIA)	90 days	Tue 5/10/21	Sun 2/1/22		Calendar day 100%		1 1			
Impact Assessment (CTIA)	90 days	Tue 5/10/21	Sun 2/1/22		Calendar day 100%		1.1			i
or Transformer Room Layout	129 days	Wed 20/10/21	Fri 25/2/22		Calendar day 100%		1 1			
o Government Departments	-	Tue 16/11/21	Wed 6/4/22		Calendar day 100%		1 1			1
ssessment Process	-	Mon 20/12/21			Calendar day 100%]			i
	-	Mon 23/8/21			Calendar day 81%		7 11			-
d Preparation	-	Wed 15/9/21			Calendar day 100%		1.1			į.
checkpoints (done on 29/10/21)	45 days		Fri 29/10/21		Calendar day 100%		1 1			
ion Works (done on 23/10/21)	30 days				Calendar day 100%		1 1			1
arding	536 days		Thu 21/12/23		Calendar day 100%		1.1			i
Crane reservation	76 days		Wed 18/10/23		Calendar day 100% Calendar day 100%		1 1			
reservation	296 days				-		<u> </u>			i
	1064 days 569 days		Mon 30/9/24 Wed 24/5/23		Calendar day 89% Calendar day 100%		7 11			
ks	675 days		Wed 24/5/23 Mon 30/9/24		Calendar day 100% Calendar day 91%		i i		l	l
neung On Street)	378 days		Tue 16/1/24		Calendar day 100%		ii			
tallation (started on 4/1/2023, done on 18/3/	-		Sat 18/3/23		Calendar day 100% Calendar day 100%		1 1			
truction (pre-requisite for ELSW) (Started or	,		Thu 12/10/23		Calendar day 100%		1.1			1
	uuys	30 0, 3, 23	,,,				1 1		T. T	I I
5, PC6F, PC6G (done on 5/7/2023)	120 days		Wed 5/7/23 66FS+49 days		Calendar day 100%		1 1			1
PC6D, PC6E, PC7D, PC7E (started on	67 days	Mon 7/8/23	Thu 12/10/23 52SS+3 days		Calendar day 100%		1.1			
done on 12/10/2023)	4			days,53FS+3			1 1			
f waling and strut (ELSW)	219 days		Thu 26/10/23		Calendar day 100%		1.1			
arted on 22/3/2023, done on 17/7/2023)	118 days		Mon 17/7/23 72SS+14 days	-	Calendar day 100%		1 1			
arted on 24/7/2023, done on 26/10/2023)	95 days		Thu 26/10/23 73FF+13 days		Calendar day 100%		1 1			
ruction (afte ELSW) (started on 24/7/2023,	158 days	Mon 24///23	Thu 28/12/23 75FS+6 days	/8FS-37 days,80SS+80	Calendar day 100%		i i			i
uction (started on 22/11/2023, done on 22/12	/2 31 days	Wed 22/11/23	Fri 22/12/23 77FS-37 days	. *	Calendar day 100%		1 1			
ng to lift pit and testing (started on 2/1/2024	-		Wed 10/1/24 78FS+10 days		Calendar day 100%		1.1			
/2024)			, ,				1 1			
struction and dismantle ELS strut (done on	97 days	Thu 12/10/23	Tue 16/1/24 77SS+80 days		Calendar day 100%		1 1			1
							1.1			
eung Tat Street)	337 days		Tue 16/1/24		Calendar day 100%		1 1			
tallation (started on 14/2/2023, done on 18/3	,		Sat 18/3/23 66FS+27 days	,	Calendar day 100%		1.1			
(Started on 21/3/2023)	12 days		Sat 1/4/23 82FS+2 days		Calendar day 100%		1 1			
ruction (pre-requisite for ELSW) (started on	61 days	Sat 15/4/23	Wed 14/6/23 83FS+13 days	8555+7 days	Calendar day 100%		1 1			
waling and strut (ELSW) (started on	69 days	Sat 22/4/23	Thu 29/6/23 84SS+7 days	86	Calendar day 100%		1 1			
one on 29/6/2023)			,				1 1			
ruction (afte ELSW) (started on15/7/2023,	85 days	Fri 30/6/23	Fri 22/9/23 85	87FS+2	Calendar day 100%		1.1			i
/2023)				days,89FS+2			1 1			
uction (started on 25/9/2023, done on 2/11/2	,	Mon 25/9/23	Fri 3/11/23 86FS+2 days	88FS+9 days	Calendar day 100%		1 1			
ng to lift pit and testing (started on 13/11/20			Wed 22/11/23 87FS+9 days		Calendar day 100%					
struction and dismantle ELS strut (done on	114 days	Mon 25/9/23	Tue 16/1/24 86FS+2 days		Calendar day 100%		1 1			
WBF)	432 davs	Sat 26/11/22	Wed 31/1/24		Calendar day 100%		1.1			į
tallation (Start on 26/11/2022, Done on 18/03	-				Calendar day 100%		1 1		T. T	I I
	301 days				Calendar day 100%					
arted on 21/3/2023)	75 days		Sat 3/6/23 91FS+2 days		Calendar day 100%		1.1		i	i
clude PC6A & PC7A) (started on 24/10/2023)			Mon 15/1/24 53FS+5 days		Calendar day 100%		1 1			
7A (started on 28/12/2023)	14 days	Tue 2/1/24	Mon 15/1/24 94FF		Calendar day 100%		1.1			1
truction (Started on 21/3/2023)	310 days	Tue 28/3/23	Wed 31/1/24		Calendar day 100%		1 1		T. T	I I
arted 21/3/2023, done on 27/7/2023)	122 days	Tue 28/3/23	Thu 27/7/23 93SS+7 days	52FS+7 days,105	Calendar day 100%		1 1			
clude PC6A, PC6B, PC7A, PC7B & PC8B)	73 days	Tue 24/10/23	Thu 4/1/24 94SS	99FS-8 days	Calendar day 100%		1.1			
24/10/2023, done on 4/1/2024)	25.1	Th 20 // 2 /22	W-121/1/240052 2 1		Calandar day 1000/		1 1			
3, PC7A, PC7B & PC8B (started on 28/12/2023 ./1/2024)	, 35 days	Thu 28/12/23	Wed 31/1/24 98FS-8 days		Calendar day 100%		1.1			1
struction (done on 31/1/2024)	203 days	Thu 13/7/22	Wed 31/1/24 97FS-15 days		Calendar day 100%		1 1		T. T	I I
onnection and builder's work (started on 15/5	,			103SS+35 davs	Calendar day 46%		1 1		l e	I
ide all zones)	400 days		Fri 6/9/24	-	Calendar day 70%					
tion (include all zones)	90 days		Mon 30/9/24 101SS+35 days		Calendar day 45%					
orks	355 days		Fri 9/8/24		Calendar day 58%					
n 21/8/2023)	264 days		Fri 10/5/24 97FS+24 days		•		_		T. T	1 1
2M) (started on 15/3/2024)	75 days		Tue 28/5/24 105FS-63 days		Calendar day 35%				1	1
	37 days		Tue 18/6/24 106FS-16 days		Calendar day 0%		11	9		I I
	-				-		1 1		<u> </u>	
	-		Fri 9/8/24 108FS-4 days				1.1		i	i •
	-				-		1 1			
	-						1.1			1
	-				-		1 1		T. T	
					•		1.1		1	
	246 days	Mon 29/7/24							T. T	
Task		33 days 223 days 57 days 260 days 260 days 246 days	223 days Wed 6/4/22 57 days Mon 10/10/22 260 days Mon 15/7/24 260 days Mon 15/7/24	33 days Mon 8/7/24 Fri 9/8/24 108FS-4 days 223 days Wed 6/4/22 Mon 14/11/22 57 days Mon 10/10/22 Mon 5/12/22 260 days Mon 15/7/24 Mon 31/3/25 260 days Mon 29/7/24 Mon 31/3/25 246 days Mon 29/7/24 Mon 31/3/25	33 days Mon 8/7/24 Fri 9/8/24 108FS-4 days 223 days Wed 6/4/22 Mon 14/11/22 57 days Mon 10/10/22 Mon 5/12/22 260 days Mon 15/7/24 Mon 31/3/25 260 days Mon 15/7/24 Mon 31/3/25 246 days Mon 29/7/24 Mon 31/3/25 124SS+14 days	33 days Mon 8/7/24 Fri 9/8/24 108FS-4 days Calendar day 0% 223 days Wed 6/4/22 Mon 14/11/22 Calendar day 100% 57 days Mon 10/10/22 Mon 5/12/22 Calendar day 100% 260 days Mon 15/7/24 Mon 31/3/25 Calendar day 0% 260 days Mon 15/7/24 Mon 31/3/25 125SS+14 days Calendar day 0% Mon 29/7/24 Mon 31/3/25 124SS+14 days Calendar day 0%	33 days Mon 8/7/24 Fri 9/8/24 108FS-4 days Calendar day 0% 223 days Wed 6/4/22 Mon 14/11/22 Calendar day 100% 57 days Mon 10/10/22 Mon 5/12/22 Calendar day 100% 260 days Mon 15/7/24 Mon 31/3/25 Calendar day 0% 260 days Mon 15/7/24 Mon 31/3/25 125SS+14 days Calendar day 0% 246 days Mon 29/7/24 Mon 31/3/25 124SS+14 days Calendar day 0%	37 days Wed 5/6/24 Thu 11/7/24107FS-14 days 109FS-4 days Calendar day 0% 33 days Mon 8/7/24 Fri 9/8/24108FS-4 days Calendar day 0% 223 days Wed 6/4/22 Mon 14/11/22 Calendar day 100% 57 days Mon 10/10/22 Mon 5/12/22 Calendar day 100% 260 days Mon 15/7/24 Mon 31/3/25 Calendar day 0% 260 days Mon 15/7/24 Mon 31/3/25 125SS+14 days Calendar day 0% 246 days Mon 29/7/24 Mon 31/3/25 125SS+14 days Calendar day 0%	37 days Wed 5/6/24 Thu 11/7/24107FS-14 days 109FS-4 days Calendar day 0% 33 days Mon 8/7/24 Fri 9/8/24108FS-4 days Calendar day 0% 223 days Wed 6/4/22 Mon 14/11/22 Calendar day 100% 57 days Mon 10/10/22 Mon 5/12/22 Calendar day 100% 260 days Mon 15/7/24 Mon 31/3/25 Calendar day 0% 260 days Mon 15/7/24 Mon 31/3/25 125SS+14 days Calendar day 0% 246 days Mon 29/7/24 Mon 31/3/25 125SS+14 days Calendar day 0%	37 days Wed 5/6/24 Thu 11/7/24/107FS-14 days 109FS-4 days Calendar day 0% 33 days Mon 8/7/24 Fri 9/8/24 108FS-4 days Calendar day 0% 223 days Wed 6/4/22 Mon 14/11/22 Calendar day 100% 57 days Mon 10/10/22 Mon 5/12/22 Calendar day 100% 260 days Mon 15/7/24 Mon 31/3/25 Calendar day 0% 260 days Mon 15/7/24 Mon 31/3/25 125SS+14 days Calendar day 0% 246 days Mon 29/7/24 Mon 31/3/25 124SS+14 days Calendar day 0%

Appendix 2

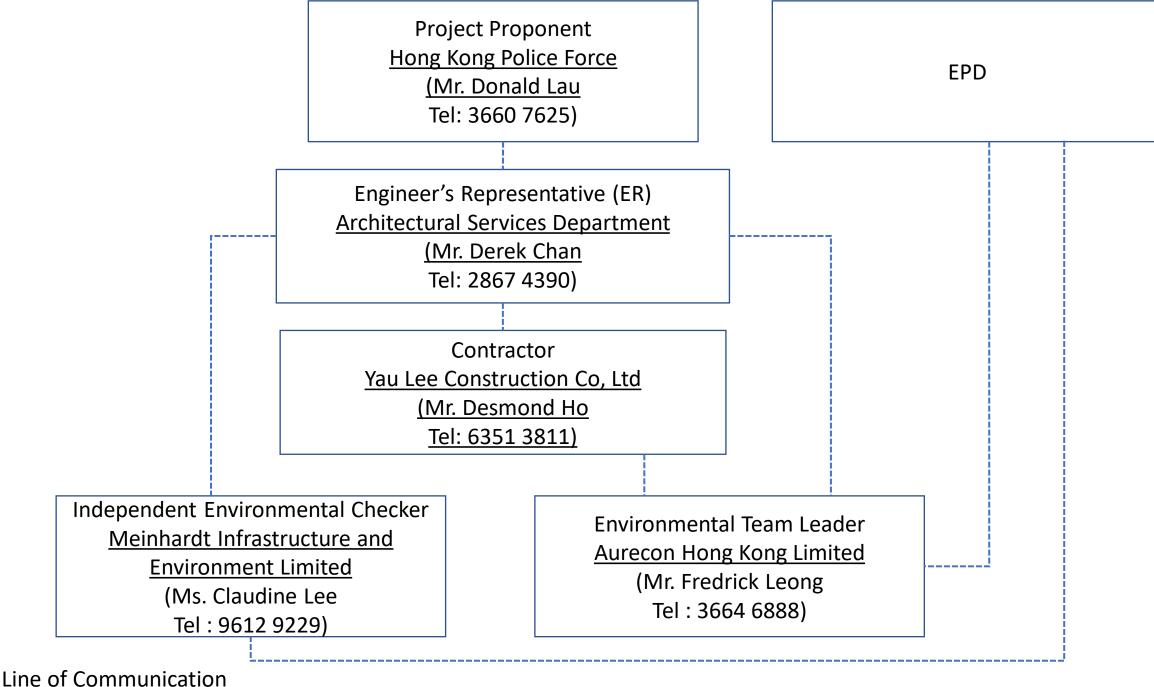

Key: ---- Line of Communication

Appendix 3

2024	Apri	l				
MONDAY	TUESDAY	WEDNESDAY	THURSDAY	FRIDAY	SATURDAY	SUNDAY
01	O2 Noise Monitoring (NM1, NM2b and NM3)	03	04	05	06	07
08	09 Noise Monitoring (NM1, NM2b and NM3)	10	11	12	13	14
15	16 Noise Monitoring (NM1, NM2b and NM3)	17	18	19	20	21
22	23 Noise Monitoring (NM1, NM2b and NM3)	24	25	26	27	28
29	30	01	O2 Noise Monitoring (NM1, NM2b and NM3)	03	04	05
06	07	Notes:				

Appendix 4



Sun Creation Engineering Limited Calibration & Testing Laboratory

Certificate of Calibration

校正證書

Certificate No.:

C237486

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC23-2475)

Date of Receipt / 收件日期: 8 December 2023

Description / 儀器名稱

Sound Level Meter

Manufacturer / 製造商

Rion

Model No. / 型號

NL-52 01010406

Serial No. / 編號 Supplied By / 委託者

Envirotech Services Co.

Room 712, 7/F, My Loft, 9 Hoi Wing Road, Tuen Mun,

New Territories, Hong Kong

TEST CONDITIONS/測試條件

Temperature / 温度 :

 $(23 \pm 2)^{\circ}$ C

Relative Humidity / 相對濕度 :

 $(50 \pm 25)\%$

Line Voltage / 電壓

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期

31 December 2023

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed specified limits.

These limits refer to manufacturer's published tolerances as requested by the customer.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Hottinger Brüel & Kjær Calibration Laboratory, Denmark
- Agilent Technologies / Keysight Technologies
- Fluke Everett Service Center, USA

Tested By 測試

HT Wong

Assistant Engineer

Certified By 核證

Lee

Date of Issue 簽發日期

Website/網址: www.suncreation.com

3 January 2024

Engineer

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

Sun Creation Engineering Limited - Calibration & Testing Laboratory c/o 4/F, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong 輝創工程有限公司 - 校正及檢測實驗所

c/o 香港新界屯門與安里一號四樓

Tel/電話: (852) 2927 2606 Fax/傳真: (852) 2744 8986 E-mail/電郵: callab@suncreation.com



Sun Creation Engineering Limited
Calibration & Testing Laboratory

Certificate of Calibration

校正證書

Certificate No.:

C237486

證書編號

1. The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to warm up for over 10 minutes before the commencement of the test.

2. Self-calibration was performed before the test.

3. The results presented are the mean of 3 measurements at each calibration point.

4. Test equipment:

Equipment ID

Description

Certificate No.

CL280

40 MHz Arbitrary Waveform Generator

C230306

CL281

Multifunction Acoustic Calibrator

CDK2302738

5. Test procedure: MA101N.

6. Results:

6.1 Sound Pressure Level

6.1.1 Reference Sound Pressure Level

	UUT	Setting		Applie	d Value	UUT	IEC 61672
Range	Function	Frequency	Time	Level	Freq.	Reading	Class 1 Limit
(dB)		Weighting	Weighting	(dB)	(kHz)	(dB)	`(dB)
30 - 130	L _A	A	Fast	94.00	1	94.0	± 1.1

6.1.2 Linearity

	UU	T Setting		Applied	d Value	UUT
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)
30 - 130	L_{A}	A	Fast	94.00	1	94.0 (Ref.)
				104.00		104.1
	-			114.00		114.0

IEC 61672 Class 1 Limit : \pm 0.6 dB per 10 dB step and \pm 1.1 dB for overall different.

6.2 Time Weighting

UUT Setting			Applie	d Value	UUT	IEC 61672	
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	Class 1 Limit (dB)
30 - 130	L_A	A	Fast	94.00	1	94.0	Ref.
	**		Slow		2	94.0	± 0.3

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited **Calibration & Testing Laboratory**

Certificate of Calibration

校正證書

Certificate No.:

C237486

證書編號

6.3 Frequency Weighting

A-Weighting 6.3.1

	UUT Setting			Applied Value		UUT	IEC 61672
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq.	Reading (dB)	Class 1 Limit (dB)
30 - 130	L _A	A	Fast	94.00	63 Hz	67.7	-26.2 ± 1.5
					125 Hz	77.8	-16.1 ± 1.5
					250 Hz	85.3	-8.6 ± 1.4
				(500 Hz	90.7	-3.2 ± 1.4
					1 kHz	94.0	Ref.
					2 kHz	95.2	$+1.2\pm1.6$
					4 kHz	95.0	$+1.0 \pm 1.6$
					8 kHz	93.0	-1.1 (+2.1; -3.1)
					16 kHz	86.0	-6.6 (+3.5; -17.0)

C-Weighting 6.3.2

- Herbining	UUT Setting			Appli	ed Value	UUT	IEC 61672
Range	Function	Frequency	Time	Level	Freq.	Reading	Class 1 Limit
(dB)		Weighting	Weighting	(dB)		(dB)	(dB)
30 - 130	$L_{\rm C}$	С	Fast	94.00	63 Hz	93.1	-0.8±1.5
			Annahara majarahan		125 Hz	93.8	-0.2 ± 1.5
					250 Hz	94.0	0.0 ± 1.4
					500 Hz	94.0	0.0 ± 1.4
					1 kHz	94.0	Ref.
				_	2 kHz	93.8	-0.2 ± 1.6
				, —	4 kHz	93.2	-0.8 ± 1.6
			E .		8 kHz	91.1	-3.0 (+2.1; -3.1)
					16 kHz	84.1	-8.5 (+3.5 ; -17.0)

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory. 本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited Calibration & Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.:

C237486

證書編號

Remarks: - UUT Microphone Model No.: UC-59 & S/N: 13748

- Mfr's Limit: IEC 61672 Class 1

- Uncertainties of Applied Value : 94 dB : 63 Hz - 125 Hz : \pm 0.35 dB

104 dB : 1 kHz : \pm 0.10 dB (Ref. 94 dB) 114 dB : 1 kHz : \pm 0.10 dB (Ref. 94 dB)

- The uncertainties are for a confidence probability of not less than 95 %.

Note:

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration & Testing Laboratory

Certificate of Calibration

Certificate No.: C232461

證書編號

校正證書

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC23-0674)

Date of Receipt / 收件日期: 31 March 2023

Description / 儀器名稱

Precision Acoustic Calibrator

Manufacturer/製造商

LARSON DAVIS

Model No./型號

CAL200

Serial No. / 編號

11334

Supplied By / 委託者

Envirotech Services Co.

Room 712, 7/F, My Loft, 9 Hoi Wing Road, Tuen Mun,

New Territories, Hong Kong

TEST CONDITIONS / 測試條件

Temperature / 溫度 :

 $(23 \pm 2)^{\circ}$ C

Relative Humidity / 相對濕度 :

Line Voltage / 電壓 :

TEST SPECIFICATIONS / 測試規範

Calibration check

1 May 2023

TEST RESULTS / 測試結果

DATE OF TEST / 測試日期

The results apply to the particular unit-under-test only.

The results do not exceed specified limits.

These limits refer to manufacturer's published or user's specified tolerances as requested by the customer.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- The Bruel & Kjaer Calibration Laboratory, Denmark
- Agilent Technologies / Keysight Technologies
- Fluke Everett Service Center, USA

Tested By 測試

K C Lee Engineer

Certified By 核證

Date of Issue

2 May 2023

H C Chan Engineer

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory. 本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration & Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.:

C232461

證書編號

1. The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.

2. The results presented are the mean of 3 measurements at each calibration point.

3. Test equipment:

Equipment ID CL130 CL281 TST150A <u>Description</u>
Universal Counter
Multifunction Acoustic Calibrator
Measuring Amplifier

Certificate No. C223647 CDK2302738 C221750

4. Test procedure: MA100N.

5. Results:

5.1 Sound Level Accuracy

UUT Nominal Value	Measured Value	User's Limit	Uncertainty of Measured Value (dB)
94 dB, 1 kHz	93.65	± 0.5	± 0.20
114 dB, 1 kHz	113.60		

5.2 Frequency Accuracy

UUT Nominal Value (kHz)	Measured Value (kHz)	Mfr's Limit	Uncertainty of Measured Value (Hz)
1	1.000	1 kHz ± 1 %	± 1

Remarks: - The user's limit is a customer pre-defined operating tolerance of the UUT, suitable for one's own intended use.

- The uncertainties are for a confidence probability of not less than 95 %.

Note:

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

Appendix 5

Event and Action Plan for Construction Noise Monitoring

	Action					
	ET	IEC	ER	Contractor		
Action Level	 Notify the ER, IEC and Contractor. Carry out investigation. Report the results of investigation to the ER, IEC and Contractor. Discuss with the IEC and Contractor and formulate remedial measures. Increase monitoring frequency to check mitigation effectiveness. 	 Review the investigation results submitted by the ET. Review the proposed remedial measures by the Contractor and advise the ER accordingly. Advise the ER on the effectiveness of the proposed remedial measures. 	 Confirm receipt of notification of failure in writing. Notify the Contractor. Require the Contractor to propose remedial measures. Ensure remedial measures are properly implemented. 	 Submit noise mitigation proposals to the IEC and ER. Implement noise mitigation proposals 		
Limit Level	 Notify the ER, IEC, Contractor and EPD. Identify sources. Repeat measurements to confirm findings. Increase monitoring frequency. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented. Inform the IEC, ER and Contractor the causes and action taken for the exceedances. Assess the effectiveness of the Contractor's remedial action and keep the IEC, EPD and ER informed of the results. If exceedance stops, cease additional monitoring. 	 Discuss amongst the ER, ET and Contractor on the potential remedial action. Review the Contractor's remedial action whenever necessary to assure their effectiveness and advise the ER accordingly. 	notification of failure in writing. 2. Notify the Contractor. 3. Require the Contractor to propose remedial measures.	 Take immediate action to avoid further exceedance. Submit proposals for remedial action to the IEC and ER within 3 working days of notification. Implement the agreed proposals. Submit further proposals if problems still not under control. Stop the relevant portion of works as determined by the ER until the exceedance is abated. 		

Notes

- (1) ET Environmental Team, IEC Independent Environmental Checker;
- (2) Each step of action should be undertaken within 1 working day unless otherwise specified

Appendix 6

Implementation Schedule for Environmental Mitigation Measures (EMIS)

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
Air Qua	1				
4.8.2	2.3.1	Dust suppression measures stipulated in the Air Pollution Control (Construction Dust) Regulation and good site practices:	All work sites	Contractor and sub-contractor(s)	√
		Use of regular watering, to reduce dust emissions from exposed site surfaces and unpaved roads, particularly during dry weather;			
		Use of frequent watering for particularly dusty construction areas close to ASRs;			
		Side enclosure and covering of any aggregate or dusty material storage piles to reduce emissions. Where this is not practicable owing to frequent usage, watering should be applied to aggregate fines;			
		Open temporary stockpiles should be avoided or covered. Prevent placing dusty material storage plies near ASRs;			
		Tarpaulin covering of all dusty vehicle loads transported to, from and between site locations;			
		Establishment and use of vehicle wheel and body washing facilities at the exit points of the site;			
		Imposition of speed controls for vehicles on unpaved site roads. 8 km/hr is the recommended limit;			
		Routing of vehicles and positioning of construction plant should be at the maximum possible distance from ASRs;			
		• Every stock of more than 20 bags of cement or dry pulverised fuel ash (PFA), if applicable, should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3-sides; and			
		Loading, unloading, transfer, handling or storage of large amount of cement or dry PFA should be carried out in a totally enclosed system or facility, and nay vent or exhaust should be fitted with the an effective fabric filter or			

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
		equivalent air pollution control system.			
Noise				l	1
5.8.3	3.4.1 – 3.4.2	 Selection and Optimisation of Construction Processes Carefully arrange the timing and sequencing of the various construction activities according to the actual site work situation; Limit the quantity of PME to be operated concurrently; In the case during school examination, more stringent construction noise criteria should be imposed, the potentially most disruptive construction activities should be avoided, and arranged to be conducted during school holidays as far as practicable; and Preparation of the Construction Noise Management Plan. 	All work sites	Contractor and sub-contractor(s)	√
5.8.4 – 5.8.6	3.4.1 – 3.4.2	Use of QPME and Quiet Working Methods In order to reduce the excessive noise impacts at the NSRs, quieter PME are recommended. Whilst quieter PME are listed, the Contractor may be able to obtain particular models of plant that are quieter than the PMEs given in GW-TM. The associated mitigation measures to the particular PME should be reviewed by the Contractor. The use of plants with SWLs less than those in the GW-TM are summarized in <i>Table 5.14</i> of the EIA report and the proposed mitigated plant inventory for the	All work sites	Contractor and sub-contractor(s)	√

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
		construction works of the proposed Project is detailed in <i>Appendix 5.8</i> .			
5.8.7 – 5.8.8	3.4.1 – 3.4.2	Use of movable noise barriers	All work sites	Contractor and sub-contractor(s)	√
		The use of movable noise barrier for certain PME could further minimize the			
		construction noise impact. In general 5dB(A) reduction for mobile PME and			
		10dB(A) for stationary PME can be achieved provided that the direct line-of site			
		of the PME is blocked. The Contractor shall be responsible for the design of the			
		movable noise barrier with due consideration given to the size of the PME and the			
		requirement of intercepting the line of sight between the NSRs and the PME, as			
		well as ensuring that the barriers should have no openings and gaps.			
5.8.9	3.4.1 –	Good site practices	All work sites	Contractor and	√
	3.4.2	Use of well-maintained and regularly-serviced plant during the works;		sub-contractor(s)	
		Plant operating on intermittent basis should be turned off or throttled down to a minimum;			
		Plant known to emit noise strongly in one direction should be orientated to face away from the NSRs;			
		Silencers, mufflers and enclosures for plant should be used where possible and properly maintained throughout the works;			
		Where possible fixed plants should be sited away from NSRs; and			
		Stockpiles of excavated materials and other structures such as site buildings should be used effectively to screen noise from the works.			

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
Water Q	uality & Se	werage			
6.9.1	4.4.2	In accordance with Professional Persons Environmental Consultative Committee Practice Notes (ProPECC PN) 1/94, potential water quality impact shall be minimised by the implementation of construction phase mitigation measures and general good site practice including the following:	All work sites	Contractor and sub-contractor(s)	√
		• At the establishment of works site, perimeter cut-off drains to direct off-site water around the Site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented. Channels (both temporary and permanent drainage pipes and culverts), earth bunds or sand bag barriers should be provided to divert the stormwater to silt removal facilities.			
		Dikes or embankments for flood protection should be implemented around the boundaries of earthwork areas. Temporary ditches should be provided to facilitate the run-off discharge into an appropriate watercourse, through a silt/sediment trap. Silt/sediment traps should also be incorporated in the permanent drainage channels to enhance deposition rates;			
		• The design of efficient silt removal facilities should be based on the guidelines in Appendix A1 of ProPECC PN 1/94, which states that the retention time for silt/sand traps should be 5 minutes under maximum flow conditions. The sizes may vary depending upon the flow rate, but for a flow rate of 0.1m³/s, a sedimentation basin of 30m³ would be required and for a			

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
		flow rate of 0.5m ³ /s the basin would be 150m ³ . The detailed design of the sand/silt raps should be undertaken by the Contractor prior to the commencement of construction.			√
		• The construction works should be programmed to minimise surface excavation works during rainy seasons (April to September), as possible. All exposed earth areas should be completed and vegetated as soon as possible after completion of the earthwork, or alternatively, within 14 days of the cessation of earthworks where practicable. If excavation of soil cannot be avoided during the rainy season, or at any time of year when rainstorms are likely, exposed slope surfaces should be covered by tarpaulin or other means;			
		• The overall slope of works sites should be kept to a minimum to reduce the erosive potential of surface water flows, and all trafficked areas and access roads should be protected by coarse stone ballast. An additional advantage accruing from the use of crushed stone is the positive traction gained during the prolonged periods of inclement weather and the reduction of surface sheet flows;			
		 All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure their proper and efficient operation at all times particularly following rainstorms. Deposited silts and grits should be removed regularly and disposed of by spreading evenly over stable, vegetated areas; 			
		• Measures should be taken to minimise the ingress of site drainage into excavations. If the excavation of trenches in wet season is inevitable, they should be dug and backfilled in short sections wherever practicable. The water pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities;			
		• All open stockpiles of construction materials (for example, aggregates, sand and fill materials) should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system;			
		• Manholes (including newly constructed ones) should always be adequately covered and temporarily sealed so as to prevent silt, construction materials			

EIA Ref. EM&	ual	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
		 or debris being washed into the drainage system and storm run-off being directed into foul sewers; Precautions to be taken at any time of the year when rainstorms are likely, actions to be taken when a rainstorm is imminent or forecasted and during or after rainstorms, are summarised in Appendix A2 of ProPECC PN 1/94. Particular attention should be paid to the control of silty surface run-off during storm events; All vehicles and plants should be cleaned before leaving the Project site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and sited wheel washing bay should be provided at the exit of Project site where practicable. Wash-water should have sand and silt settled out and removed at least on a weekly basis to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel-washing bay to public roads should be paved with sufficient backfall toward the wheel-washing bay to prevent vehicle tracking of soil and silty water to public roads and drains; Oil interceptors should be provided in the drainage system downstream of any oil/fuel pollution sources. Oil interceptors should be emptied and cleaned regularly to prevent the release of oil and grease into the storm water drainage system after accidental spillage. A bypass should be provided for oil interceptors to prevent flushing during heavy rain. Any drainage channels connecting storm drains via designed sand/silt removal facilities should be disconnected/removed after completion of construction stage to prevent any direct discharge to the stormwater system; The construction solid waste, debris and rubbish on-site should be collected, handled and disposed of properly to avoid causing any water quality impacts. The requirements for solid waste management are detailed in Section 8 of EIA report; and All fuel tanks and storage areas should be provided with locks and sited on sealed areas, within bunds of a c			

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
6.9.3	4.4.3	There is a need to apply to the EPD for a discharge licence for discharge of effluent from the construction site under the WPCO. The discharge quality must meet the requirements as specified in the discharge licence. All the run-off and wastewater generated from the works areas should be treated so that it satisfies all the standards listed in the Technical Memorandum. Minimum distances of 100 m should be maintained between the discharge points of construction site effluent and the existing seawater intakes. In addition, no new effluent discharges in nearby typhoon shelters should be allowed. The beneficial uses of the treated effluent for other on-site activities such as dust suppression, wheel washing and general cleaning etc., would minimise water consumption and reduce the effluent discharge volume.	All work sites	Contractor and sub-contractor(s)	√ ·
6.9.4	4.4.4	Portable chemical toilets and sewage holding tanks are recommended for the handling of the construction sewage generated by the workforce. A licenced contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance.	All work sites	Contractor and sub-contractor(s)	V
6.9.6	4.4.5	Any maintenance facilities should be located on hard standings within a bunded area, and sumps and oil interceptors should be provided. Maintenance of vehicles and equipment involving activities with potential for leakage and spillage should be undertaken within the areas appropriately equipped to control these discharges.	All work sites	Contractor and sub-contractor(s)	√ ·
6.9.7	4.4.6	All sewage arising from the proposed Project should be collected and diverted to the public foul water drainage system via proper connections to minimise water quality impact from the operation of the Project and ensure compliance with Technical Memorandum on Standards for Effluents Discharged into Drainage and Sewerage Systems, Inland and Coastal Waters under the Water Pollution Control Ordinance (WPCO-TM).	The Government Complex and Vehicle Depot	Contractor and sub-contractor(s), HKPF, FEHD, EMSD and GL	V
6.9.8	4.4.7	Run-offs from the covered areas including vehicle washing bays and vehicle examination / maintenance / repair / testing area would be properly treated prior to discharge into the foul water drainage system. The wastewater treatment	The Government Complex and Vehicle Depot	Contractor and sub-contractor(s)	√

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
		facilities for the proposed Project, which comprised of petrol interceptor and sedimentation tank, would be designed using sedimentation process with adequate treatment capacity. Oily waste collected by petrol interceptors is considered and disposed of as chemical waste. The wastewater treatment facilities for the proposed Project will be designed during the detailed design stage and the treated effluent for discharging into the public foul water drainage system should comply with the effluent standards as stated in the WPCO-TM.			
Landsca	pe and Visu	al	l	l	1
7.8.2	5.2.1	Hoardings should be provided with aesthetic treatment and designed to be subtle and camouflaged. It should be compatible with the surrounding landscape and visually "impermeable" to block the view of construction activities from VSRs.	All work sites	Contractor and sub-contractor(s)	V
7.8.3	5.2.1	Temporary landscape treatment, such as the provision of temporary landscape planting around the Site office in ornamental pots and application of green roof for Site office, should be considered during construction phase. Landscape planting in movable planters should also be considered as a temporary greening measure for the Project area (i.e. along Site hoarding). Design of the green roof and the type of species to be used shall be reviewed and confirmed during detailed design stage.	All work sites	Contractor and sub-contractor(s)	N/A

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
7.8.4	5.2.1	Disturbance to existing vegetation should be avoided as far as practicable. Where possible, the construction programme should retain all trees in situ that are not in direct conflict with the development proposals. Subject to the detailed design of the proposed Project, a review shall be carried out before commencement of construction phase to assess the potential conflict of the construction activities with existing roadside trees and the need of corresponding measures. Proper protective fencing should be provided by the Contractor to protect the preserved trees before commencement of any works within the Project site. The protective fencing should be erected along or beyond the perimeter of the tree protection zone of each individual tree.	All work sites	Contractor and sub-contractor(s)	

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
7.8.7	5.2.1	A multi-patch of landscape area should be provided on the roof of the proposed building to soften the impact of the built structure. An area of approximately 2600m² of shrub, which comprises of a mix of native and ornamental species, is proposed to be provided to enhance the aesthetics of views for those viewing the roof. The type of shrub species will be confirmed during detailed design stage. The planting should be commenced during construction stage and be completed before the completion of construction stage to ensure the measure will be implemented on Day 1 of operation stage. Vegetation maintenance should be provided by the Operator.	The Government Complex and Vehicle Depot	Contractor and sub-contractor(s), Operator	N/A
7.8.8 7.8.9	5.2.1	The exterior of the permanent structure of the proposed Project should use non-reflective external finishes in light colour that is visually unobtrusive with surrounding context. Non-reflective paving materials should be considered to reduce potential glare from surface reflectance. The finishing material and colour will be reviewed and confirmed during detailed design stage. Lighting should be efficiently designed so that minimum amount of lighting is required for safety and security. The design may make reference to the Guidelines on Industry Best Practices for External Lighting Installations by Environmental Bureau, EPD and EMSD. The mounting height and direction of exterior lighting fixtures shall be designed and arranged to point away from sensitive receivers where possible. Specification of lighting operation schedule shall be formed by the operator to impose restriction on lighting operation after business hours, such as limiting the operation of lighting except for security lighting only, and in areas with necessary night-time operation where applicable.	The Government Complex and Vehicle Depot	Contractor and sub-contractor(s), Operator	N/A

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
Waste M	lanagement				
8.5.1	6.2.1	 Recommendations for good site practices: The Contractor shall prepare a Waste Management Plan (WMP) in accordance with the requirements set out in the ETWB TCW No. 19/2005, Waste Management on Construction Site, for the Engineer's Representative approval. The WMP shall include monthly and yearly Waste Flow Tables that indicate the amounts of waste generated, recycled and disposed of (including final disposal site); The Contractor's waste management practices and effectiveness shall be audited by the Engineer's Representative on regular basis; The Contractor shall provide training for site staff for the concept of site cleanliness and appropriate waste management procedures, including waste reduction, reuse and recycling; The Contractor shall ensure sufficient waste disposal points and regular collection of waste; The Contractor shall use trucks with covering for the open-box bed and enclosed container shall be used to minimise windblown litter and dust during transportation of waste; The Contractor shall implement regular cleaning and maintenance programme for drainage systems, pumps and oil interceptors; Separation of chemical wastes for special handling and appropriate treatment at a Chemical Waste Treatment Facility (CWTF); Encourage collection of aluminium cans, paper and plastic bottles by providing separate labelled bins to enable these wastes to be segregated from other general refuse generated by the workforce; Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal; Wheel washing facilities shall be used by all trucks leaving the site to prevent transfer of mud onto public roads; 	All works sites	Contractor and Sub-contractors	

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
		 Make provisions in contract documents to allow and promote the use of recycled aggregates where appropriate; No waste shall be burnt on-site; A recording system for the amount of wastes generated, recycled and disposed (including disposal sites) should be proposed; Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste; and Adequate numbers of portable toilets should be provided for on-site workers. Portable toilets should be maintained in reasonable states, which will not deter the workers form utilizing them. Night soil should be regularly collected by licensed collectors. 			√
8.5.1	6.2.1	 C&D Materials / Waste: Use standard formwork or pre-fabrication as far as practicable so as to minimise the C&D Materials arising; Consider the use of more durable formwork or plastic facing for construction works; Avoid the use of wooden hoardings and substitute with metal hoarding to facilitate recycling; Purchase of construction materials should be carefully planned in order to avoid over-ordering and wastage; Establish a trip-ticket system in accordance with DevB TC(W) No. 6/2010 and Waste Disposal (Charges for Disposal of Construction Waste) Regulation in order to monitor the disposal of inert C&D Materials at public fill and the remaining C&D Waste to landfills, and control flytipping; Design foundation works to minimise the amount of excavated material to be generated; Sort construction debris and excavated materials on-site to recover 	All work sites	Contractor and Sub-contractors	

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
		reusable/recyclable portions (i.e. soil, broken concrete, metal, etc.) for backfilling and reinstatement; • Segregate and store different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal; • Specify in design & build contract the use of recycled aggregates where appropriate; • Plan and stock construction materials carefully to minimise the amount of waste to be generated and to avoid unnecessary generation of waste; and • Recommend the use of metal fencing or building panels, which are more durable than wooden panels, for the erection of construction site hoarding.			
8.5.1	6.2.1	 Chemical waste: Chemical waste producers should be registered with the EPD; Chemical waste should be handled in accordance with the "Code of Practice on the Packaging, Handling and Storage of Chemical Wastes" including but not limited to the followings: Good quality containers compatible with the chemical wastes should be used and maintained in good conditions and securely closed, with incompatible chemicals be stored separately. Appropriate labels should be securely attached on each chemical waste container in English and Chinese according to the instructions prescribed in Schedule 2 of the Regulations. A licensed collector to transport and dispose of the chemical wastes should be employed by the Contractor, to either the Chemical Waste Treatment Centre at Tsing Yi, or any other licensed facilities. Waste oils, chemicals or solvents should not be discharged to drain; and Routine cleaning and maintenance programme for drainage systems, sumps 	The Government Complex and Vehicle Depot	Contractor and Sub-contractor; HKPF, FEHD, EMSD and GL	√

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures and oil interceptors during operation.	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
8.5.1	6.2.1	 General refuse: Sufficient dustbins should be provided for storage of waste as required under the Public Cleansing and Prevention of Nuisances By-laws; Sufficient enclosed bins should be provided for general refuse, food and beverage waste to reduce odour, pest and litter impacts; General refuse arising on-site should be stored in enclosed bins or compaction units separately from C&D and chemical wastes; A reliable waste collector should be employed to clear general refuse from the construction site on a daily basis and disposed of to the licensed landfill or refuse transfer station; Office wastes can be reduced by recycling of paper if such volume is sufficiently large to warrant collection. Participation in a local collection scheme by the Contractor should be advocated; and Waste separation facilities for paper, aluminium cans, plastic bottles, etc. should be provided on-site and collected by individual collectors should be encouraged. 	The Government Complex and Vehicle Depot	Contractor and Sub-contractor; HKPF, FEHD, EMSD and GL	√
Hazard t	8.2.1	Recommendations for good site practices in construction phase: • ignition of fire on site should be controlled throughout the construction programme; • any temporary storage of fuel and flammable chemical should be minimised to reduce chance of causing explosion or escalation of fire in the case of emergency event at nearby potentially hazardous sources;	All works area	Contractor and sub-contractors	√

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
		fire extinguisher or other firefighting equipment should be made easily accessible to on-site workers; and			
		establish communication channel and evacuation plan in the case of emergency event at nearby potentially hazardous sources.			

Remark:

- √ Compliance of Mitigation Measures
- <> Compliance of Mitigation but need improvement
- x Non-compliance of Mitigation Measures
- ▲ Non-compliance of Mitigation Measures but rectified by Yau Lee Construction, Co, Ltd

 Δ Deficiency of Mitigation Measures but rectified by Yau Lee Construction, Co, Ltd

N/A Not Applicable in Reporting Period

Appendix 7


Contract No. SS H504 Design and Construction of Chai Wan Government Complex and Vehicle Depot Noise Monitoring Data


Date(yyyy-mm- dd)	Station	Start Time	Wind Speed, m/s	1st set 5m	nins, dB(A)	2nd set 5n	nins, dB(A)	3rd set 5n	nins, dB(A)	4th set 5m	nins, dB(A)	5th set 5m	nins, dB(A)	6th set 5n	nins, dB(A)	Measure Level [Cor Noise Le 30mins	nstruction vel], Leq	Unit	Site Observation	Measure Level [Con Noise Lev	nstruction	Unit	Constructi on Noise Level #	Unit
				Leq:	63.1	Leq:	63.3	Leq:	63.6	Leq:	62.9	Leq:	62.3	Leq:	63.8				Major: Noise from Yau Lee Site					
2024-04-02	NM1*	14:21	0.5	L10:	66.5	L10:	66.2	L10:	67.7	L10:	66.9	L10:	65.1	L10:	67.1	Leq:	63	dB(A)	Other: Railway Noise and Traffic Noise.	Leq:	63.19	dB(A)	N.A.	dB(A)
				L90:	57.6	L90:	58.4	L90:	57.9	L90:	57.4	L90:	57.8	L90:	58.9				·					
2024-04-02	NM2b *	13:44	0.3	Leq: L10:	69.8 74	Leq: L10:	70 73.1	Leq: L10:	71.6	Leq: L10:	71.2 74.6	Leq: L10:	69.3 72.7	Leq: L10:	71.1 74.8	Leg:	71#	dB(A)	Major: Noise from Yau Lee Site	Leg:	70.58	dB(A)	N.A.	dB(A)
2024-04-02	INIVIZO	13.44	0.5	L90:	63	L10.	64.7	L10.	66	L90:	66	L10.	64.3	L90:	63.9	Leq.	/ 1#	UD(A)	Other: Traffic Noise.	Leq.	70.38	ub(A)	IV.A.	ub(A)
				Leg:	67.7	Leq:	66.5	Leq:	66.9	Leq:	65.8	Leq:	66.6	Leg:	65.7			-		1				
2024-04-02	NM3	13:01	0.4	L10:	69.2	L10:	67.7	L10:	68.1	L10:	67.2	L10:	68.2	L10:	67.2	Leg:	67	dB(A)	Major: Noise from Yau Lee Site	Leq:	66.59	dB(A)	N.A.	dB(A)
		20.02	•	L90:	65	L90:	64.3	L90:	64.8	L90:	64	L90:	64.4	L90:	63.8	-54.		<i>4.2()</i>	Other: Noise from Cargo Handling Area.	204.		J. Z. (* 1.)		J. J. (1.1)
				Leq:	63.8	Leq:	64.7	Leq:	62.4	Leq:	63.5	Leq:	63.3	Leq:	65.6									
2024-04-09	NM1*	10:51	0.5	L10:	66.9	L10:	67.9	L10:	65.6	L10:	67	L10:	66.5	L10:	68.2	Leq:	64	dB(A)	Major: Noise from Yau Lee Site	Leq:	64.01	dB(A)	N.A.	dB(A)
				L90:	58.2	L90:	56.8	L90:	56.6	L90:	56.9	L90:	56.9	L90:	55.8	1			Other: Railway Noise and Traffic Noise.					
				Leq:	68.6	Leq:	68.4	Leq:	69.2	Leq:	68.9	Leq:	68.6	Leq:	69.1				Major: Noise from Vau Lee Site					
2024-04-09	NM2b *	11:27	0.4	L10:	71.8	L10:	70.8	L10:	69.5	L10:	72	L10:	71.4	L10:	72.6	Leq:	69	dB(A)	Major: Noise from Yau Lee Site Other: Traffic Noise.	Leq:	68.81	dB(A)	N.A.	dB(A)
				L90:	62.8	L90:	64.8	L90:	57.9	L90:	64.4	L90:	63.5	L90:	62.7				Other. Hame Noise.					
				Leq:	60.1	Leq:	66.4	Leq:	65.6	Leq:	67.2	Leq:	66.3	Leq:	66.3]			Major: Noise from Yau Lee Site					
2024-04-09	NM3	10:11	0.6	L10:	69.9	L10:	67.6	L10:	66.9	L10:	67.7	L10:	67.9	L10:	67.8	Leq:	66	dB(A)	Other: Noise from Cargo Handling Area.	Leq:	65.80	dB(A)	N.A.	dB(A)
				L90:	63.3	L90:	63.6	L90:	63.3	L90:	63.3	L90:	63.9	L90:	64.3				Other. Wolse from eargo namaling Area.					
				Leq:	62.8	Leq:	63.5	Leq:	63.5	Leq:	64	Leq:	62.5	Leq:	64.7				Major: Noise from Yau Lee Site					
2024-04-16	NM1*	11:30	0.4	L10:	66.5	L10:	66.7	L10:	66.4	L10:	67.4	L10:	65.9	L10:	67.6	Leq:	64	dB(A)	Other: Railway Noise and Traffic Noise.	Leq:	63.56	dB(A)	N.A.	dB(A)
				L90:	55.7	L90:	56.9	L90:	58.1	L90:	58.3	L90:	58.1	L90:	60.2									
				Leq:	71.6	Leq:	73	Leq:	72.6	Leq:	72	Leq:	71.5	Leq:	72				Major: Noise from Yau Lee Site					
2024-04-16	NM2b *	10:55	0.3	L10:	75.7	L10:	77.6	L10:	75.1	L10:	74.7	L10:	74.7	L10:	74.6	Leq:	72#	dB(A)	Other: Traffic Noise.	Leq:	72.15	dB(A)	N.A.	dB(A)
				L90:	65.6	L90:	65.5	L90:	65.6	L90:	66.3	L90:	66.3	L90:	67.4					 				
2024.04.46	NIN 42	10:15	0.2	Leq:	66.2	Leq:	65.9	Leq:	65.7	Leq:	65.7	Leq:	67.7	Leq:	67.8		67	-ID/A)	Major: Noise from Yau Lee Site	1	66.60	-ID/A)	N. A	-ID/A)
2024-04-16	NM3	10:15	0.3	L10:	69	L10:	67.6	L10:	67.7	L10:	67.3	L10:	69.7	L10:	69.9	Leq:	67	dB(A)	Other: Noise from Cargo Handling Area.	Leq:	66.60	dB(A)	N.A.	dB(A)
				L90:	63.6 65.3	L90:	63.6 64.4	L90:	63.8 64.6	L90:	64 67	L90:	64.2 65.5	L90:	64.8									
2024-04-23	NM1*	15:09	0.5	Leq:	68.8	Leq: L10:	67.6	Leq: L10:	67.6	Leq: L10:	69.6	Leq: L10:	68.7	Leq: L10:	63.7 67.5	Leq:	65	dB(A)	Major: Noise from Yau Lee Site	Leq:	65.21	dB(A)	49.34	dB(A)
2024-04-23	INIVIT	13.03	0.5	L10: L90:	59.7	L10:	59.3	L10:	58.8	L10:	59.8	L10:	58.9	L90:	56.8	Leq.	03	ub(A)	Other: Railway Noise and Traffic Noise.	Leq.	03.21	ub(A)	43.34	ub(A)
				Leq:	71.1	Leq:	71.6	Leq:	72.9	Leq:	71.7	Leq:	71.1	Leq:	71									
2024-04-23	NM2b *	14:34	0.4	L10:	75.4	LEQ.	75.2	LEQ. L10:	76.8	LEQ. L10:	75.7	LEQ.	75.2	L10:	74.3	Leq:	72#	dB(A)	Major: Noise from Yau Lee Site	Leq:	71.62	dB(A)	N.A.	dB(A)
	20		.	L90:	62	L90:	64.4	L90:	64.3	L90:	63.4	L90:	61.2	L90:	63.4			~5(/·//	Other: Traffic Noise.		, 1,02	~ D(/ \/)		
				Leg:	68.7	Leq:	66.9	Leq:	66.9	Leq:	65.4	Leq:	67.8	Leq:	66.7									
2024-04-23	NM3	13:53	0.7	L10:	69.7	L10:	68	L10:	68	L10:	67.2	L10:	69.4	L10:	68.3	Leq:	67	dB(A)	Major: Noise from Yau Lee Site	Leq:	67.18	dB(A)	N.A.	dB(A)
				L90:	63.6	L90:	64.3	L90:	63.2	L90:	62.6	L90:	62.9	L90:	64	1		v ·/	Other: Noise from Cargo Handling Area.			1	Ī	(* *)

Remark: * A facade correction of +3 dB(A) was applied to the measured noise level.

#On 02, 16 and 23 April 2024, the measured noise levels of NM2b exceeded the limit level of 70dB(A). However, they were lower than the baseline level of 73.4 dB(A). Therefore, they are not considered as an limit level exceedance.



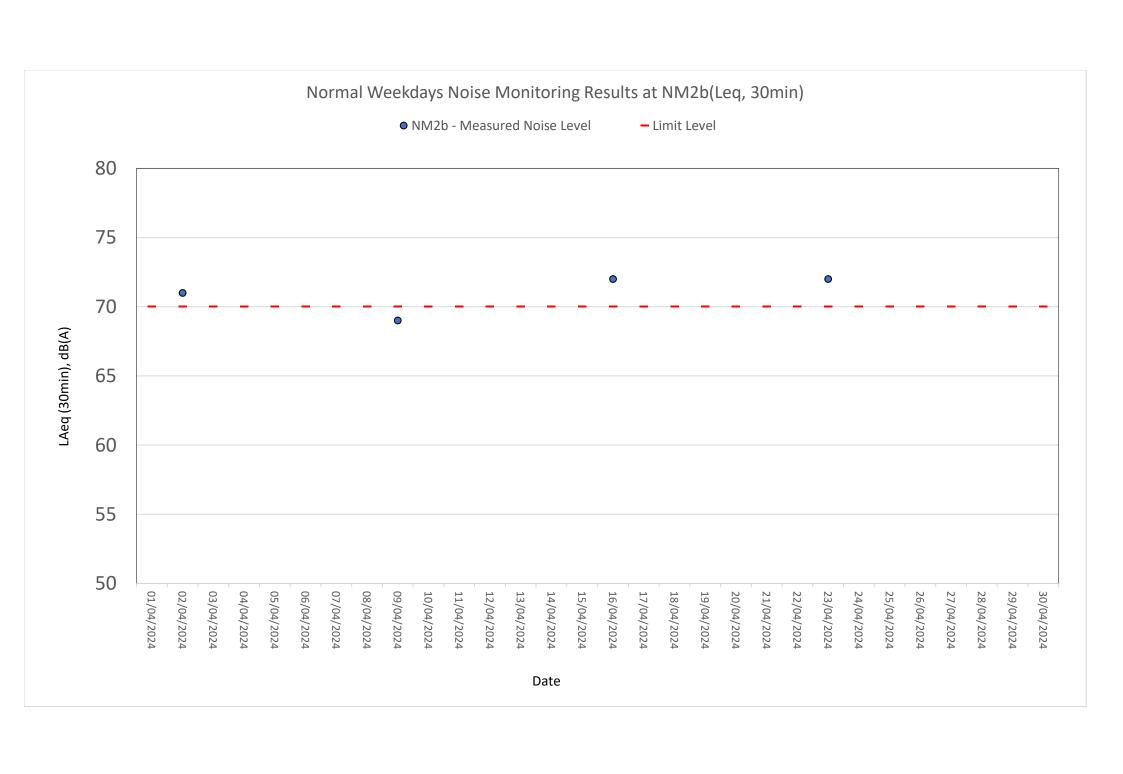

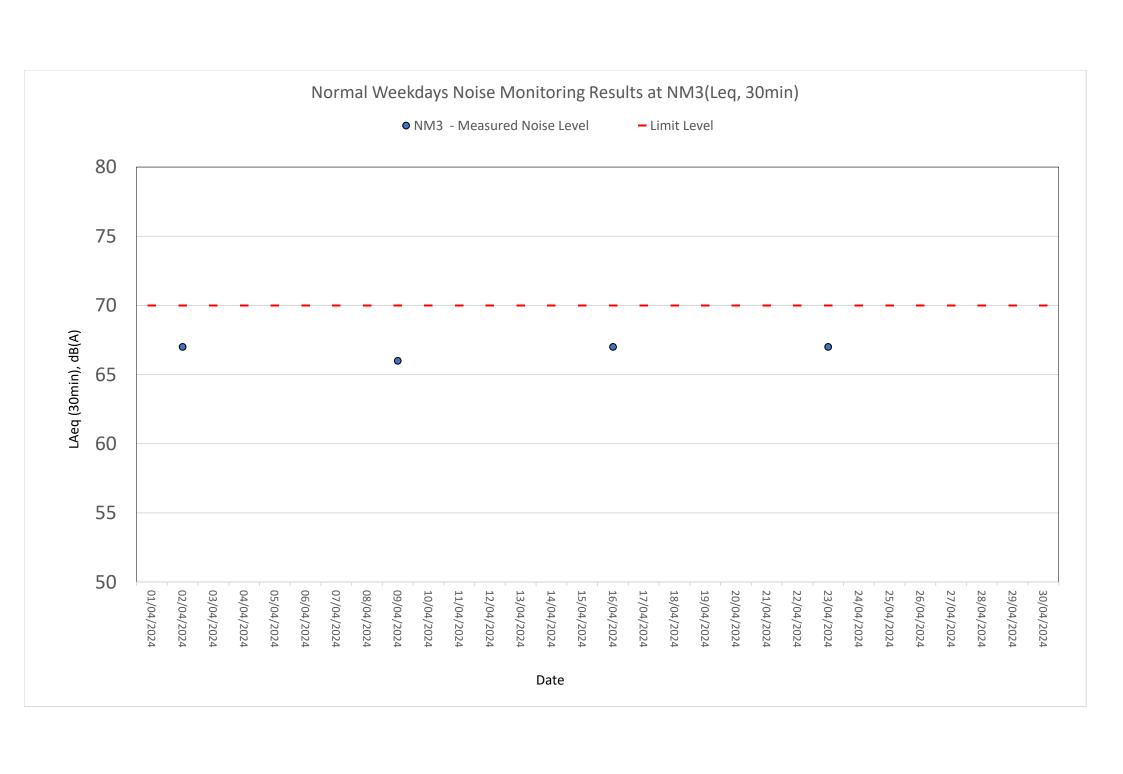

Appendix 8

Waste Flow Table

			Tot	al Quantities o	of C&D Mater	ials to be G	enerated fr	om the Contract			
Month	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in Other Projects	Disposed as Public Fill (Inert waste) ¹	Imported Fill	Metals	Timber	Paper / Cardboard Packaging	Plastics	Chemical Waste	Others, e.g. general refuse (Non- inert waste) ²
WOTH	(in tonne)	(in tonne)	(in tonne)	(in tonne)	(in tonne)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000L)	(in tonne)
Jul-21	0	0	0	0	0	0	0	0	0	0	0
Aug-21	0	0	0	0	0	0	0	0	0	0	0
Sep-21	0	0	0	0	0	0	0	0	0	0	1.28
Oct-21	0	0	0	0	0	0	0	0	0	0	7.67
Nov-21	0	0	0	0	0	0	6.77	0.055	0	0	1.23
Dec-21	0	0	0	811.54	0	0	0	0	0	0	7.84
Jan-22	0	0	0	3270.8	0	0	0	0	0	0	2.5
Feb-22	0	0	0	2886.66	0	0	0	0	0	0	1.31
Mar-22	0	0	0	3793	0	0	0	0	0	0	3.43
Apr-22	0	0	0	3126.84	0	7.420	0	0	0	0	3.58
May-22	0	0	0	2414.91	0	0	0	0	0	0	3.64
Jun-22	0	0	0	4427.27	0	0	0	0	0	0	2.36
Jul-22	0	0	0	6759.07	0	0	0	0	0	1	4.28

Month	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in Other Projects	Disposed as Public Fill (Inert waste) ¹	Imported Fill	Metals	Timber	Paper / Cardboard Packaging	Plastics	Chemical Waste	Others, e.g. general refuse (Non- inert waste) ²
WOITH	(in tonne)	(in tonne)	(in tonne)	(in tonne)	(in tonne)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000L)	(in tonne)
Aug-22	0	0	0	5152.13	0	0	0	0	0	0	1.89
Sep-22	0	0	0	5305.27	0	0	0	0	0	0	8.32
Oct-22	0	0	0	5,120.34	0	0	0	0	0	0	12.84
Nov-22	0	0	0	5733.35	0	0	0	0	0	0	1.75
Dec-22	0	0	0	2063.77	0	0	0	0	0	0	3.02
Jan-23	0	0	0	577.99	0	0	0	0	0	0	17.84
Feb-23	0	0	0	1493.86	0	0	0	0	0	0	45.42
Mar-23	0	0	0	3537.78	0	0	0	0	0	0	9.53
Apr-23	0	0	0	7255.41	0	0	0	0	0	0	7.86
May-23	0	0	0	1788.17	0	0	0	0	0	0	8.7
Jun-23	0	0	0	2005.44	0	0	0	0	0	0	27.29
Jul-23	0	0	0	2950.43	0	0	0	0	0	0.2	19.94
Aug-23	0	0	0	5610.19	0	0	0	0	0	0	26.12
Sep-23	0	0	0	1014.45	0	0	0	0	0	0	26.6
Oct-23	0	0	0	2479.82	0	0	0	0	0	0	31.78

Nov-23	0	0	0	2974.54	0	0	0	0	0	0	135.19
Dec-23	0	0	0	3126.35	0	0	0	0	0	0	59.96
Jan-24	0	0	0	1496.21	0	0	0	0	0	0	54.34
Feb-24	0	0	0	0	0	0	0	0	0	0	37.92
Mar-24	0	0	0	29.22	0	0	0	0	0	0	84.15
Apr-24	0	0	0	119.11	0	0	0	0	0	0	158.5
Total	0	0	0	89,852.99	0	7.420	6.77	0.055	0	1.2	837.8

Note: 1. Inert waste will be disposed to Chai Wan Public Fill Barging Point (CW-PFBP) or Fill Bank at Tseung Kwan O Area 137(TKO137FB).

2. Non-inert waste (General refuse) will be disposed to North East New Territories Landfill (NENT).

Appendix 9

Report No. <u>0122-20240405</u>

Chai Wan Government Complex and Vehicle Depot Environmental Site Inspection Checklist (Rev. 1)

Inspection Date:	5 April 2024	Inspected By:	Daisy Au Yeung
Time:	15:00 – 16:00	Weather Condition:	Cloudy
Participants:	Mr. K.Y Yip (Engineer's Representa	ative); Desmond Ho (Co	ntractor); Daisy Au Yeung (ET)

Α	Permits/Licenses	N/A or Not Observed	Yes	No	Remarks / Photo
A1	Are Environmental Permit, license/ other permit displayed at major site exit and vehicle access?		\boxtimes		EP No.: EP-505/2015/A
A2	Are Construction Noise Permits available for inspection/posted at site entrance.		\boxtimes		CNP No: GW-RS0090-24
A3	Is wastewater discharge licence available for inspection?		\boxtimes		
A4	Are trip tickets for chemical waste and construction waste disposal available for inspection?		\boxtimes		
A5	Are relevant licence/permit for disposal of construction waste or excavated materials available for inspection?		\boxtimes		
В	Air Quality	N/A or Not Observed	Yes	No	Remarks / Photo
B1	Is open burning avoided?		\boxtimes		
B2	Are completed earthworks sealed as soon as practicable?		\boxtimes		
В3	Are plant and equipment well maintained (i. e. without black smoke from powered plant)?		\boxtimes		
B4	Are NRMM labels properly affixed on the PMEs?		\boxtimes		
B5	Any remedial action undertaken?	\boxtimes			N.A.
B6	Observed dust source(s)				
		☐ Wind eros	ion		
			quipment	Movemer	nts
		Loading/	unloading	of materia	als
		Others:			
B7	Are unpaved areas/ designated roads watered regularly to avoid dust generation?		\boxtimes		
B8	Are dusty materials covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading?				
B9	After removal of stockpile, are the remained dusty materials wetted with water and cleared from surface of roads?		\boxtimes		
B10	Is the stockpile of dusty materials avoid to be extend beyond the pedestrian barriers, fencing or traffic cones?		\boxtimes		
B11	Are loaded dump trucks covered by impervious sheeting appropriately before leaving the site?	\boxtimes			N.A.

Chai Wan Government Complex and Vehicle Depot

Report No. <u>0122-20240405</u>

Environmental Site Inspection Checklist (Rev. 1)

B12	Are wheel washing facilities with high pressure		\boxtimes		
	water jet provided at all site exits if practicable?]	
B13	Are all vehicles and plant cleaned before they leave		\boxtimes		
	the construction site?				
B14	Are hoarding ≥ 2.4m tall provided beside roads or		\boxtimes		
	area with public access?				
B15	Is the portion of any road leading only to		\boxtimes		
	construction site (within 30m of a vehicle entrance				
	or exit) kept clear of dusty materials?				
B16	Are surfaces where any pneumatic or power-driven				
	drilling, cutting, polishing or other mechanical		\boxtimes		
	breaking operations takes place sprayed with water				
	or a dust suppression chemical continuously?				
B17	Is the area involved demolition activities sprayed				
	with water or a dust suppression chemical	\boxtimes		Ш	
	immediately prior to, during and immediately after				N.A.
	the activities so as to maintain the entire surface				14.74
	wet?				
B18	Is scaffolding erected around the perimeter of a				
סוס	building under construction?		\boxtimes	Ш	
B19	Are effective dust screens, sheeting or netting]	
פום	provided to enclose the scaffolding from the ground		\boxtimes		
	floor level of the building, or a canopy provided from				
	the first floor level up to the highest level of the				
	scaffolding?				
B20	,				
DZU	Is the skip hoist for materials transport enclosed by	\boxtimes			N.A.
B21	impervious sheeting? Is every stock of more than 20 bags of cement or				
DZ I	dry pulverized fuel ash (PFA) covered entirely by	\boxtimes			
	impervious sheeting or placed in an area sheltered				N.A.
	· · · · · · · · · · · · · · · · · · ·				
DOO	on the top and 3 sides?				
B22	Are the areas of washing facilities and the road		\boxtimes		
	section between the washing facilities and the exit				
	point paved with concrete, bituminous materials or hardcores?				
Daa					
B23	Are cement or dry PFA delivered in bulk stored in a		\boxtimes		
	closed silo fitted with an audible high-level alarm				
	which is interlocked with the material filling line and				
D0.4	no overfilling is allowed?				
B24	Are the activities of loading, unloading, transfer,		\boxtimes		
	handing or storage of bulk cement or dry PFA				
DOF	carried out in a totally enclosed system or facility?				
B25	Is any vent or exhaust fitted with an effective fabric	\boxtimes			N.A.
Doo	filter or equipment air pollution control system?				
B26	Is the exposed earth properly treated by		\boxtimes		
	compaction, turfing, hydroseeding, vegetation				
	planting or sealing with latex, vinyl, bitumen,				
	shotcrete or other suitable surface stabiliser within				
	six months after last construction activity on the				
	construction site or part of the construction site				
D.C.	where the exposed earth lies?				
B27	Are the worksites wetted with water regularly?		\boxtimes		
B28	Is generation of dust avoided during loading or				
520	unloading?		\boxtimes		
B29	Are all trucks loaded to a level within the side and				
	tail boards?		\boxtimes		
	*	i	i		İ

Contract No. SS H504 Design and Construction of Chai Wan Government Complex and Vehicle Depot

Report No. _0122-20240405_

Depot Environmental Site Inspection Checklist (Rev. 1)

B31 Are designated roads paved? Are site vehicle movements confined to designated roads? Remarks / P	noto
C Noise N/A or Not Observed Served regularly? Call Is well-maintained plant operated on-site and plant served regularly? Call Are vehicles and equipment switched off or throttled down while not in use? Call Is the noise directed away from nearby NSRs? Call Are the silencers or mufflers properly fitted on construction equipment and maintained regularly? Are mobile and/or noisy plant sited as far away from NSRs as possible and practicable and orientated so that the noise is directed away from nearby NSRs? Call Are material stockpiles, mobile container officer and other structures utilised to screen noisy activates? Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs? Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs?	noto
C Noise No Remarks / P	noto
C Noise No Remarks / P	noto
served regularly? Are vehicles and equipment switched off or throttled down while not in use? C3 Is the noise directed away from nearby NSRs? C4 Are the silencers or mufflers properly fitted on construction equipment and maintained regularly? Are mobile and/or noisy plant sited as far away from NSRs as possible and practicable and orientated so that the noise is directed away from nearby NSRs? C5 Are material stockpiles, mobile container officer and other structures utilised to screen noisy activates? Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs? Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs?	
down while not in use? C3 Is the noise directed away from nearby NSRs? C4 Are the silencers or mufflers properly fitted on construction equipment and maintained regularly? Are mobile and/or noisy plant sited as far away from NSRs as possible and practicable and orientated so that the noise is directed away from nearby NSRs? C6 Are material stockpiles, mobile container officer and other structures utilised to screen noisy activates? Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs? Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs?	
C4 Are the silencers or mufflers properly fitted on construction equipment and maintained regularly? Are mobile and/or noisy plant sited as far away from NSRs as possible and practicable and orientated so that the noise is directed away from nearby NSRs? C6 Are material stockpiles, mobile container officer and other structures utilised to screen noisy activates? Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs? Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs?	
C5 NSRs as possible and practicable and orientated so that the noise is directed away from nearby NSRs? C6 Are material stockpiles, mobile container officer and other structures utilised to screen noisy activates? Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs? Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs?	
C5 NSRs as possible and practicable and orientated so that the noise is directed away from nearby NSRs? C6 Are material stockpiles, mobile container officer and other structures utilised to screen noisy activates? Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs? Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs? C9 Is the sequencing operation of construction plants	
other structures utilised to screen noisy activates? Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs? Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs?	
C7 boundaries between noisy construction activities and NSRs? Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs?	
acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs?	
Is the sequencing operation of construction plants	
C10 Is the hoarding maintained properly?	
C11 Do air compressors have valid noise labels?	
C12 Are compressor operated with doors closed?	
C13 QPME used with valid noise labels?	
C14 Major noise source(s)	
☐ Traffic	
Construction activities inside of site	
Construction activities outside of site	
Others:	

D	Water Quality	N/A or Not Observed	Yes	No	Remarks / Photo
Const	ruction Activities				
D1	Are catchpits and perimeter channels constructed in advance of site formation works and earthworks?		\boxtimes		
D2	Is wastewater from temporary site facilities controlled to prevent direct discharge to surface or marine water?		\boxtimes		
D3	Is minimise surface excavation works during rainy seasons (April to September), as possible?		\boxtimes		
D4	Is the storm drainage directed to storm drains via adequately designed sand/ silt removal facilities e.g. sand traps, silt?		\boxtimes		
D5	Are channels, earth bunds or sandbag barriers provided on site to properly direct stormwater to such silt removal facilities?		\boxtimes		
D6	Are the silt removal facilities, channels and manholes maintained regularly?		\boxtimes		
D7	Are the temporary access roads surfaced with crushed stone or gravel?		\boxtimes		
D8	Is the deposited silt and grit removed regularly?		\boxtimes		
D9	Is rainwater pumped out from trenches discharged into storm drains via silt system?		\boxtimes		
D10	Are measures taken to prevent the washout of construction materials, soil, silt or debris into any drainage system?		\boxtimes		
D11	Are open stockpiles of construction materials e.g. aggregates and sand on site covered with tarpaulin or similar fabric during rainstorms?		\boxtimes		
D12	Are manholes adequately covered and temporarily sealed so as to prevent silt, construction materials or debris from getting into the drainage?		\boxtimes		
D13	Are the discharges of surface run-off into foul sewer always prevented?		\boxtimes		
D14	Is a wheel washing bay provided at every site exit?		\boxtimes		
D15	Is the wheel wash overflow directed to silt removal facilities before being discharged to the storm drain?		\boxtimes		
D16	Is the section of construction road between the wheel washing bay and the public road surfaced with crushed stone or coarse gravel?		\boxtimes		
D17	Is wastewater generated from concreting, plastering, internal decoration, cleaning work and other similar activities screened to remove large objects?	\boxtimes			N.A.
D18	Are the vehicle and plant serving areas, vehicle wash bays and lubrication facilities located under roofed areas?		\boxtimes		
D19	Is leakage or spillages contained and cleaned up		\boxtimes		

 \times

D20

immediately?

storm water system?

Does the surface runoff from bunded areas pass

through oil/grease traps prior to discharge to the

N.A.

Report No. <u>0122-20240405</u>

Environmental Site Inspection Checklist (Rev. 1)

Chai	Wan	Covernment	Complex	and	Vehicle Depot	
Chai	wan	Government	Complex	anu	venicle Depot	

D21	Are site drainage systems provided over the entire project site with sediment control facilities?		\boxtimes		
D22	Are sedimentation tanks or package treatment systems provided to treat the large amount of sediment-laden wastewater generated from wheel washing, site runoff and construction works?		\boxtimes		
D23	Is the generated wastewater with high concentrations of SS collected to the sedimentation tanks or package treatment systems for proper treatment prior to disposal?		\boxtimes		
D24	Is the treated wastewater reused for vehicle washing, dust suppression and general cleaning?		\boxtimes		
D25	Is the sewage generated from toilets collected using a temporary storage system?		\boxtimes		
D26	Is there any sediment plume observed in nearby watercourses?			\boxtimes	
D27	Are slit-grease traps deployed to prevent a direct input of road surface runoff to the marine waters?	\boxtimes			N.A.
E	Waste / Chemical Management	N/A or Not Observed	Yes	No	Remarks / Photo
Genera	l Waste				
E1	Is the general waste generated on-site stored in enclosed bins or compaction units separately from the construction and chemical wastes?			\boxtimes	Refer to Observation 1
E2	Is the general waste collected properly by using the waste separation facilities for paper, aluminium cans, plastic bottles etc.?		\boxtimes		
E3	Does accumulation of waste avoid?		\boxtimes		
E4	Is waste disposed regularly?		\boxtimes		
Constr	uction Waste				
E5	Are the temporary stockpiles maintained regularly?		\boxtimes		
E6	Is the excavated fill material reused for backfilling and reinstatement?		\boxtimes		
E7	Are the C&D materials sorted and recycled onsite?		\boxtimes		
E8	Is there any contract documents provided to allow and promote the use of recycled aggregates where appropriate?	\boxtimes			Not Observed.
E9	Is the disposal of C&D materials avoided onto any sensitive locations e.g. agricultural lands etc.?	\boxtimes			N.A.
E10	Are the public fill and C&D waste segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal?		\boxtimes		
E11	Is the durable formwork or plastic facing for construction works used?	\boxtimes			N.A.
E12	Do the wooden hoardings avoid to be used?		\boxtimes		
E13	Is metal hoarding used to enhance the possibility of recycling?		\boxtimes		
E14	Is the segregation and storage of C&D wastes undertaken in designated area?		\boxtimes		

Chai Wan Government Complex and Vehicle Depot

Report No. _0122-20240405__ Environmental Site Inspection Checklist (Rev. 1)

E15	Are waste storage area properly cleaned and do not cause windblown litter and dust nuisance?			\boxtimes	Refer to Observation 1
E16	Do the excavated materials appear contaminated?			\boxtimes	
E17	If suspected contaminated, appropriate procedures followed?	\boxtimes			N.A.
Chemi	cal / Fuel Storage Area				
E18	Are the fuel tanks and chemical storage areas provided with locks and sited on sealed areas?		\boxtimes		
E19	Are the storage area enclosed 3 sides by walls/ fence of ≥2m tall and bounded with adequate bund capacity (>110% of largest container) or do the storage area allow storage of 20% of total volume of waste?				
E20	Are the storage areas labelled and separated (if needed)?		\boxtimes		
E21	Do the storage areas have adequate ventilation and be covered to prevent rainfall entering?		\boxtimes		
E22	Are the containers used for the storage of chemical wastes suitable for the substance that are holding, resist to corrosion, maintained in a good condition, and securely closed?		\boxtimes		
E23	If no specification has been approved by EPD, are container with <450L capacity provided for storage of chemicals waste?		\boxtimes		
Chemi	cal Waste / Waste Oil				
E24	Is chemical waste or waste oil stored and labelled in English and Chinese properly in designated area?		\boxtimes		
E25	Are chemicals and waste oil recycled or disposed properly?			\boxtimes	Refer to Observation 2
E26	Is waste oil collected and stored for recycling or disposal?		\boxtimes		
Record	<u>ds</u>				
E27	Is a licensed waste haulier used for waste collection?		\boxtimes		
E28	Are the records of quantities of wastes generated, recycled, and disposed properly kept?		\boxtimes		
E29	For the demolition material/ waste, is the number of loads for each day recorded as appropriate?	\boxtimes			N.A.
	· · · · · · · · · · · · · · · · · · ·				

Chai Wan Government Complex and Vehicle Depot Environmental Site Inspection Checklist (Rev. 1)

F	Landscape and Visual Impacts	N/A or Not Observed	Yes	No	Remarks / Photo		
F1	Is the work site confined within site boundaries?		\boxtimes				
F2	Is damage to surrounding areas avoided?		\boxtimes				
F3	Is the hoardings with aesthetic treatment provided and designed to be subtle and camouflaged?		\boxtimes				
F4	Is the temporary landscape treatment provided (such as the provision of temporary landscape planting around the Site office in ornamental pots and application of green roof for Site office)?						
F5	Are the protective fencing erected along or beyond the perimeter of the tree protection zone of each individual tree?	\boxtimes			To be implemented before demolition of hoarding		
G	Environmental Complaint	N/A or Not Observed	Yes	No	Remarks / Photo		
G1	Number of Environmental Complaint received from 11/11/2021 to 05/04/2024			\boxtimes			
Н	General Housekeeping	N/A or Not Observed	Yes	No	Remarks / Photo		
H1	Are potential stagnant pools cleared and mosquito breeding prevented?		\boxtimes				
H2	Are the defined boundaries of working areas identified to prevent loss of vegetation		\boxtimes				
I	Others	N/A or Not Observed	Yes	No	Remarks / Photo		
I1	Are the portable toilets maintained in a state, which will not deter the workers from utilizing these portable toilets?		\boxtimes				

Follow up action for previous Site Inspection:

- 21 March 2024 Observation
 - 1. NRMM label was displayed on the forklift. (Photo F1)
 - 2. The general waste and C&D waste were removed. (Photo F2-3)
 - The accumulation of C&D waste was disposed. (Photo F4)

28 March 2024 Observation

The C&D waste was removed and properly disposed. (Photo F5)





Photo 1

Photo 2





Photo 3

Photo 4



Photo 5

Observation(s):

- 1. General refuses are identified on the ground without proper disposal. (Photo 1)
- 2. Waste oil and other waste are accumulated inside the chemical drip tray. Chemical containers are identified next to the drip tray. (Photo 2 and 3)





Photo 1

Photo 2



Photo 3

Corrective Actions – Mitigation Measures Implemented or Proposed (if any):

- 1. The housekeeping shall be improved. The contractor has been recommended to provide sufficient rubbish bins with lid and other segregation skips/bins for proper disposal of general refuse and segregation of different type of waste.
- 2. The contractor should clear the waste oil and various type of wastes accumulated inside the drip tray. Other chemical containers identified at the site should be put inside the drip tray.

	Environmental Team Representative:	IEC's Representative:	Contractor's Representative:	Engineer's Representative
Signature:	D	1		1
Name:	Daisy Au Yeung	/	Desmond Ho	K.Y. YIP (SUPD/ACW) for SUPD/COW
Date:	5 April 2024	1	5 April 2024	5 April 2024

Chai Wan Government Complex and Vehicle Depot

Report No. _0123-20240411__ Environmental Site Inspection Checklist (Rev. 1)

Inspection Date:	11 April 2024	Inspected By:	Joan Lo
Time:	14:15 – 15:15	Weather Condition:	Sunny
Participants:	Mr. K.Y Yip (Engineer's Represer (IEC); Joan Lo (ET)	ntative); Desmond Ho (Contractor); Yohana David Jr. Gbadago

		1			
Α	Permits/Licenses	N/A or Not Observed	Yes	No	Remarks / Photo
A1	Are Environmental Permit, license/ other permit displayed at major site exit and vehicle access?		\boxtimes		EP No.: EP-505/2015/A
A2	Are Construction Noise Permits available for inspection/posted at site entrance.		\boxtimes		CNP No: GW-RS0090-24
A3	Is wastewater discharge licence available for inspection?		\boxtimes		OW NOODS 21
A4	Are trip tickets for chemical waste and construction waste disposal available for inspection?		\boxtimes		
A5	Are relevant licence/permit for disposal of construction waste or excavated materials available for inspection?		\boxtimes		
				l	
В	Air Quality	N/A or Not Observed	Yes	No	Remarks / Photo
B1	Is open burning avoided?		\boxtimes		
B2	Are completed earthworks sealed as soon as practicable?		\boxtimes		
B3	Are plant and equipment well maintained (i. e. without black smoke from powered plant)?		\boxtimes		
B4	Are NRMM labels properly affixed on the PMEs?		\boxtimes		
B5	Any remedial action undertaken?	\boxtimes			N.A.
В6	Observed dust source(s)				
		☐ Wind eros	ion		
		⊠ Vehicle/ E	quipment	Movemer	nts
		Loading/	unloading	of materia	als
		Others:			
B7	Are unpaved areas/ designated roads watered regularly to avoid dust generation?		\boxtimes		
B8	Are dusty materials covered entirely by impervious sheeting or sprayed with water to maintain the		\boxtimes		
	entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the				
B9	excavation or unloading? After removal of stockpile, are the remained dusty				
53	materials wetted with water and cleared from surface of roads?				
B10	Is the stockpile of dusty materials avoid to be extend beyond the pedestrian barriers, fencing or traffic cones?		\boxtimes		
B11	Are loaded dump trucks covered by impervious	\boxtimes			N.A.

Contract No. SS H504 Design and Construction of Chai Wan Government Complex and Vehicle Depot

Report No. _0123-20240411__

	sheeting appropriately before leaving the site?			
B12	Are wheel washing facilities with high pressure		\boxtimes	
	water jet provided at all site exits if practicable?			
B13	Are all vehicles and plant cleaned before they leave		\boxtimes	
	the construction site?			
B14	Are hoarding ≥ 2.4m tall provided beside roads or		\boxtimes	
	area with public access?			
B15	Is the portion of any road leading only to		\boxtimes	
	construction site (within 30m of a vehicle entrance			
	or exit) kept clear of dusty materials?			
B16	Are surfaces where any pneumatic or power-driven		\boxtimes	
	drilling, cutting, polishing or other mechanical			
	breaking operations takes place sprayed with water			
	or a dust suppression chemical continuously?			
B17	Is the area involved demolition activities sprayed	\boxtimes		
	with water or a dust suppression chemical			
	immediately prior to, during and immediately after			N.A.
	the activities so as to maintain the entire surface			
	wet?			
B18	Is scaffolding erected around the perimeter of a		\boxtimes	
	building under construction?			
B19	Are effective dust screens, sheeting or netting		\boxtimes	
	provided to enclose the scaffolding from the ground			
	floor level of the building, or a canopy provided from			
	the first floor level up to the highest level of the			
	scaffolding?			
B20	Is the skip hoist for materials transport enclosed by	\boxtimes		NI A
	impervious sheeting?			N.A.
B21	Is every stock of more than 20 bags of cement or	M		
B21	Is every stock of more than 20 bags of cement or dry pulverized fuel ash (PFA) covered entirely by	\boxtimes		NI A
B21	· · · · · · · · · · · · · · · · · · ·	\boxtimes		N.A.
B21	dry pulverized fuel ash (PFA) covered entirely by	\boxtimes		N.A.
B21 B22	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered			N.A.
	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides?			N.A.
	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit			N.A.
	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road			N.A.
	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores?			N.A.
B22	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or			N.A.
B22	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a			N.A.
B22	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm			N.A.
B22	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm which is interlocked with the material filling line and		\boxtimes	N.A.
B22 B23	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm which is interlocked with the material filling line and no overfilling is allowed?			N.A.
B22 B23	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm which is interlocked with the material filling line and no overfilling is allowed? Are the activities of loading, unloading, transfer,		\boxtimes	N.A.
B22 B23	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm which is interlocked with the material filling line and no overfilling is allowed? Are the activities of loading, unloading, transfer, handing or storage of bulk cement or dry PFA		\boxtimes	
B22 B23	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm which is interlocked with the material filling line and no overfilling is allowed? Are the activities of loading, unloading, transfer, handing or storage of bulk cement or dry PFA carried out in a totally enclosed system or facility? Is any vent or exhaust fitted with an effective fabric		\boxtimes	N.A.
B22 B23 B24 B25	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm which is interlocked with the material filling line and no overfilling is allowed? Are the activities of loading, unloading, transfer, handing or storage of bulk cement or dry PFA carried out in a totally enclosed system or facility? Is any vent or exhaust fitted with an effective fabric filter or equipment air pollution control system?			
B22 B23	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm which is interlocked with the material filling line and no overfilling is allowed? Are the activities of loading, unloading, transfer, handing or storage of bulk cement or dry PFA carried out in a totally enclosed system or facility? Is any vent or exhaust fitted with an effective fabric filter or equipment air pollution control system?		\boxtimes	
B22 B23 B24 B25	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm which is interlocked with the material filling line and no overfilling is allowed? Are the activities of loading, unloading, transfer, handing or storage of bulk cement or dry PFA carried out in a totally enclosed system or facility? Is any vent or exhaust fitted with an effective fabric filter or equipment air pollution control system?			
B22 B23 B24 B25	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm which is interlocked with the material filling line and no overfilling is allowed? Are the activities of loading, unloading, transfer, handing or storage of bulk cement or dry PFA carried out in a totally enclosed system or facility? Is any vent or exhaust fitted with an effective fabric filter or equipment air pollution control system? Is the exposed earth properly treated by compaction, turfing, hydroseeding, vegetation			
B22 B23 B24 B25	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm which is interlocked with the material filling line and no overfilling is allowed? Are the activities of loading, unloading, transfer, handing or storage of bulk cement or dry PFA carried out in a totally enclosed system or facility? Is any vent or exhaust fitted with an effective fabric filter or equipment air pollution control system? Is the exposed earth properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen,			
B22 B23 B24 B25	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm which is interlocked with the material filling line and no overfilling is allowed? Are the activities of loading, unloading, transfer, handing or storage of bulk cement or dry PFA carried out in a totally enclosed system or facility? Is any vent or exhaust fitted with an effective fabric filter or equipment air pollution control system? Is the exposed earth properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabiliser within			
B22 B23 B24 B25	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm which is interlocked with the material filling line and no overfilling is allowed? Are the activities of loading, unloading, transfer, handing or storage of bulk cement or dry PFA carried out in a totally enclosed system or facility? Is any vent or exhaust fitted with an effective fabric filter or equipment air pollution control system? Is the exposed earth properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabiliser within six months after last construction activity on the			
B22 B23 B24 B25	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm which is interlocked with the material filling line and no overfilling is allowed? Are the activities of loading, unloading, transfer, handing or storage of bulk cement or dry PFA carried out in a totally enclosed system or facility? Is any vent or exhaust fitted with an effective fabric filter or equipment air pollution control system? Is the exposed earth properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabiliser within six months after last construction activity on the construction site or part of the construction site			
B22 B23 B24 B25 B26	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm which is interlocked with the material filling line and no overfilling is allowed? Are the activities of loading, unloading, transfer, handing or storage of bulk cement or dry PFA carried out in a totally enclosed system or facility? Is any vent or exhaust fitted with an effective fabric filter or equipment air pollution control system? Is the exposed earth properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabiliser within six months after last construction activity on the construction site or part of the construction site where the exposed earth lies? Are the worksites wetted with water regularly?			
B22 B23 B24 B25 B26	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides? Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores? Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm which is interlocked with the material filling line and no overfilling is allowed? Are the activities of loading, unloading, transfer, handing or storage of bulk cement or dry PFA carried out in a totally enclosed system or facility? Is any vent or exhaust fitted with an effective fabric filter or equipment air pollution control system? Is the exposed earth properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabiliser within six months after last construction activity on the construction site or part of the construction site where the exposed earth lies?			

Report No. <u>0123-20240411</u>

Chai Wan Government Complex and Vehicle Depot Environmental Site Inspection Checklist (Rev. 1)

B29	Are all trucks loaded to a level within the side and tail boards?		\boxtimes		
B30	Are appropriate speed limit sign displayed?		\boxtimes		
B31	Are designated roads paved?		\boxtimes		
B32	Are site vehicle movements confined to designated roads?		\boxtimes		
С	Noise	N/A or Not Observed	Yes	No	Remarks / Photo
C1	Is well-maintained plant operated on-site and plant served regularly?		\boxtimes		
C2	Are vehicles and equipment switched off or throttled down while not in use?		\boxtimes		
C3	Is the noise directed away from nearby NSRs?		\boxtimes		
C4	Are the silencers or mufflers properly fitted on construction equipment and maintained regularly?		\boxtimes		
C5	Are mobile and/or noisy plant sited as far away from NSRs as possible and practicable and orientated so that the noise is directed away from nearby NSRs?		\boxtimes		
C6	Are material stockpiles, mobile container officer and other structures utilised to screen noisy activates?	\boxtimes			N.A.
C7	Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs?		\boxtimes		
C8	Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs?		\boxtimes		
C9	Is the sequencing operation of construction plants where practicable?		\boxtimes		
C10	Is the hoarding maintained properly?		\boxtimes		
C11	Do air compressors have valid noise labels?		\boxtimes		
C12	Are compressor operated with doors closed?		\boxtimes		
C13	QPME used with valid noise labels?		\boxtimes		
C14	Major noise source(s)				
		Traffic			
		⊠ Construct	ion activiti	es inside	of site
		Construct	ion activiti	es outside	e of site
		Others:_			<u> </u>

D	Water Quality	N/A or Not Observed	Yes	No	Remarks / Photo
Constr	uction Activities				
D1	Are catchpits and perimeter channels constructed in advance of site formation works and earthworks?		\boxtimes		
D2	Is wastewater from temporary site facilities controlled to prevent direct discharge to surface or marine water?		\boxtimes		
D3	Is minimise surface excavation works during rainy seasons (April to September), as possible?		\boxtimes		
D4	Is the storm drainage directed to storm drains via adequately designed sand/ silt removal facilities e.g. sand traps, silt?		\boxtimes		
D5	Are channels, earth bunds or sandbag barriers provided on site to properly direct stormwater to such silt removal facilities?		\boxtimes		
D6	Are the silt removal facilities, channels and manholes maintained regularly?		\boxtimes		
D7	Are the temporary access roads surfaced with crushed stone or gravel?		\boxtimes		
D8	Is the deposited silt and grit removed regularly?		\boxtimes		
D9	Is rainwater pumped out from trenches discharged into storm drains via silt system?		\boxtimes		
D10	Are measures taken to prevent the washout of construction materials, soil, silt or debris into any drainage system?		\boxtimes		
D11	Are open stockpiles of construction materials e.g. aggregates and sand on site covered with tarpaulin or similar fabric during rainstorms?		\boxtimes		
D12	Are manholes adequately covered and temporarily sealed so as to prevent silt, construction materials or debris from getting into the drainage?		\boxtimes		
D13	Are the discharges of surface run-off into foul sewer always prevented?		\boxtimes		
D14	Is a wheel washing bay provided at every site exit?		\boxtimes		
D15	Is the wheel wash overflow directed to silt removal facilities before being discharged to the storm drain?		\boxtimes		
D16	Is the section of construction road between the wheel washing bay and the public road surfaced with crushed stone or coarse gravel?		\boxtimes		
D17	Is wastewater generated from concreting, plastering, internal decoration, cleaning work and other similar activities screened to remove large objects?	\boxtimes			N.A.
D18	Are the vehicle and plant serving areas, vehicle wash bays and lubrication facilities located under roofed areas?		\boxtimes		
D19	Is leakage or spillages contained and cleaned up immediately?		\boxtimes		
D20	Does the surface runoff from bunded areas pass through oil/grease traps prior to discharge to the storm water system?	\boxtimes			N.A.

Chai Wan Government Complex and Vehicle Depot

Report No. _0123-20240411__ Environmental Site Inspection Checklist (Rev. 1)

D21	Are site drainage systems provided over the entire		\boxtimes		
	project site with sediment control facilities?		2 3		
	Are sedimentation tanks or package treatment				
	systems provided to treat the large amount of		\boxtimes		
	sediment-laden wastewater generated from wheel				
D22	washing, site runoff and construction works?				
	Is the generated wastewater with high				
D23	concentrations of SS collected to the		\boxtimes		
D23	sedimentation tanks or package treatment systems				
	for proper treatment prior to disposal?				
D24	Is the treated wastewater reused for vehicle		\boxtimes		
D2 4	washing, dust suppression and general cleaning?				
D25	Is the sewage generated from toilets collected		\boxtimes		
D23	using a temporary storage system?				
D26	Is there any sediment plume observed in nearby			\boxtimes	
D20	watercourses?				
D27	Are slit-grease traps deployed to prevent a direct	∇			N.A.
וצע	input of road surface runoff to the marine waters?				IN.A.

E	Waste / Chemical Management	N/A or Not Observed	Yes	No	Remarks / Photo
Gener	al Waste				
E1	Is the general waste generated on-site stored in enclosed bins or compaction units separately from the construction and chemical wastes?			\boxtimes	Refer to Observation 1
E2	Is the general waste collected properly by using the waste separation facilities for paper, aluminium cans, plastic bottles etc.?		\boxtimes		
E3	Does accumulation of waste avoid?			\boxtimes	Refer to Observation 1
E4	Is waste disposed regularly?		\boxtimes		
Const	ruction Waste				
E5	Are the temporary stockpiles maintained regularly?		\boxtimes		
E6	Is the excavated fill material reused for backfilling and reinstatement?		\boxtimes		
E7	Are the C&D materials sorted and recycled onsite?		\boxtimes		
E8	Is there any contract documents provided to allow and promote the use of recycled aggregates where appropriate?	\boxtimes			Not Observed.
E9	Is the disposal of C&D materials avoided onto any sensitive locations e.g. agricultural lands etc.?	\boxtimes			N.A.
E10	Are the public fill and C&D waste segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal?		\boxtimes		
E11	Is the durable formwork or plastic facing for construction works used?	\boxtimes			N.A.
E12	Do the wooden hoardings avoid to be used?		\boxtimes		
E13	Is metal hoarding used to enhance the possibility of recycling?		\boxtimes		
E14	Is the segregation and storage of C&D wastes undertaken in designated area?		\boxtimes		

Chai Wan Government Complex and Vehicle Depot

Report No. <u>0123-20240411</u>

E15	Are waste storage area properly cleaned and do not cause windblown litter and dust nuisance?			\boxtimes	Refer to Observation 1
E16	Do the excavated materials appear contaminated?			\boxtimes	
E17	If suspected contaminated, appropriate procedures followed?	\boxtimes			N.A.
Chemi	cal / Fuel Storage Area				
E18	Are the fuel tanks and chemical storage areas provided with locks and sited on sealed areas?		\boxtimes		
E19	Are the storage area enclosed 3 sides by walls/ fence of ≥2m tall and bounded with adequate bund capacity (>110% of largest container) or do the storage area allow storage of 20% of total volume of waste?				
E20	Are the storage areas labelled and separated (if needed)?		\boxtimes		
E21	Do the storage areas have adequate ventilation and be covered to prevent rainfall entering?		\boxtimes		
E22	Are the containers used for the storage of chemical wastes suitable for the substance that are holding, resist to corrosion, maintained in a good condition, and securely closed?		\boxtimes		
E23	If no specification has been approved by EPD, are container with <450L capacity provided for storage of chemicals waste?		\boxtimes		
Chemi	cal Waste / Waste Oil				
E24	Is chemical waste or waste oil stored and labelled in English and Chinese properly in designated area?		\boxtimes		
E25	Are chemicals and waste oil recycled or disposed properly?		\boxtimes		
E26	Is waste oil collected and stored for recycling or disposal?		\boxtimes		
Record	<u>ls</u>				
E27	Is a licensed waste haulier used for waste collection?		\boxtimes		
E28	Are the records of quantities of wastes generated, recycled, and disposed properly kept?		\boxtimes		
E29	For the demolition material/ waste, is the number of loads for each day recorded as appropriate?	\boxtimes			N.A.

Report No. <u>0123-20240411</u>

Chai Wan Government Complex and Vehicle Depot Environmental Site Inspection Checklist (Rev. 1)

F	Landscape and Visual Impacts	N/A or Not Observed	Yes	No	Remarks / Photo
F1	Is the work site confined within site boundaries?		\boxtimes		
F2	Is damage to surrounding areas avoided?		\boxtimes		
F3	Is the hoardings with aesthetic treatment provided and designed to be subtle and camouflaged?		\boxtimes		
F4	· ·				
F5	Are the protective fencing erected along or beyond the perimeter of the tree protection zone of each individual tree?	\boxtimes			To be implemented before demolition of hoarding
G	Environmental Complaint	N/A or Not Observed	Yes	No	Remarks / Photo
G1	Number of Environmental Complaint received from 11/11/2021 to 11/04/2024			\boxtimes	
Н	General Housekeeping	N/A or Not Observed	Yes	No	Remarks / Photo
H1	Are potential stagnant pools cleared and mosquito breeding prevented?		\boxtimes		
H2	Are the defined boundaries of working areas identified to prevent loss of vegetation		\boxtimes		
I	Others	N/A or Not Observed	Yes	No	Remarks / Photo
I1	Are the portable toilets maintained in a state, which will not deter the workers from utilizing these portable toilets?		\boxtimes		

Chai Wan Government Complex and Vehicle Depot

Follow up action for previous Site Inspection:

Waiting for contactor's input

Observation(s):

1. The general waste stored on the floor is observed, and the accumulation of C&D waste is found. (Photo 1-2)





Photo 1

Photo 2

Corrective Actions – Mitigation Measures Implemented or Proposed (if any):

1. The contractor has been recommended to increase the frequency of C&D waste disposal to prevent accumulation and to provide efficient waste skips for waste storage.

	Environmental Team Representative:	IEC's Representative:	Contractor's Representative:	Engineer's Representative
Signature:	4	21		
Name:	Joan Lo	Yohana David Jr. Gbadago	Desmond Ho	K.Y. YIP (SUPD/ACW) for SUPD/COW
Date:	11 April 2024	11 April 2024	11 April 2024	11 April 2024

Inspection Date:	18 April 2024	Inspected By:	Joan Lo			
Time:	15:00 – 16:00	Weather Condition:	Cloudy			
Participants:	Mr. K.H Wong (Engineer's Representative); Desmond Ho (Contractor); Joan Lo (ET)					

Α	Permits/Licenses	N/A or Not Observed	Yes	No	Remarks / Photo
A1	Are Environmental Permit, license/ other permit displayed at major site exit and vehicle access?		\boxtimes		EP No.: EP-505/2015/A
A2	Are Construction Noise Permits available for inspection/posted at site entrance.		\boxtimes		CNP No: GW-RS0090-24
А3	Is wastewater discharge licence available for inspection?		\boxtimes		
A4	Are trip tickets for chemical waste and construction waste disposal available for inspection?		\boxtimes		
A5	Are relevant licence/permit for disposal of construction waste or excavated materials available for inspection?		\boxtimes		
В	Air Quality	N/A or Not Observed	Yes	No	Remarks / Photo
B1	Is open burning avoided?		\boxtimes		
B2	Are completed earthworks sealed as soon as practicable?		\boxtimes		
ВЗ	Are plant and equipment well maintained (i. e. without black smoke from powered plant)?		\boxtimes		
B4	Are NRMM labels properly affixed on the PMEs?			\boxtimes	Refer to Observation 1
B5	Any remedial action undertaken?	\boxtimes			N.A.
B6	Observed dust source(s)				
		☐ Wind eros	ion		
			quipment	Moveme	nts
		Loading/	unloading	of materi	als
		Others:			
B7	Are unpaved areas/ designated roads watered regularly to avoid dust generation?		\boxtimes		
B8	Are dusty materials covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading?				
B9	After removal of stockpile, are the remained dusty materials wetted with water and cleared from surface of roads?		\boxtimes		
B10	Is the stockpile of dusty materials avoid to be extend beyond the pedestrian barriers, fencing or traffic cones?		\boxtimes		
B11	Are loaded dump trucks covered by impervious sheeting appropriately before leaving the site?	\boxtimes			N.A.

B12	Are wheel washing facilities with high pressure water jet provided at all site exits if practicable?		\boxtimes		
B13	Are all vehicles and plant cleaned before they leave	П	\boxtimes	П	
	the construction site?				
B14	Are hoarding ≥ 2.4m tall provided beside roads or		\boxtimes		
B15	area with public access? Is the portion of any road leading only to				
סום	construction site (within 30m of a vehicle entrance		\boxtimes		
	or exit) kept clear of dusty materials?				
B16	Are surfaces where any pneumatic or power-driven		\boxtimes		
	drilling, cutting, polishing or other mechanical			Ш	
	breaking operations takes place sprayed with water				
	or a dust suppression chemical continuously?				
B17	Is the area involved demolition activities sprayed	\boxtimes			
	with water or a dust suppression chemical	_			
	immediately prior to, during and immediately after				N.A.
	the activities so as to maintain the entire surface				
B18	wet?		-		
DIO	Is scaffolding erected around the perimeter of a building under construction?		\boxtimes		
B19	Are effective dust screens, sheeting or netting				
DIS	provided to enclose the scaffolding from the ground		\boxtimes		
	floor level of the building, or a canopy provided from				
	the first floor level up to the highest level of the				
	scaffolding?				
B20	Is the skip hoist for materials transport enclosed by	\boxtimes			N.A.
	impervious sheeting?				IN.A.
B21	Is every stock of more than 20 bags of cement or	\boxtimes			
	dry pulverized fuel ash (PFA) covered entirely by				N.A.
	impervious sheeting or placed in an area sheltered				
DOO	on the top and 3 sides?				
B22	Are the areas of washing facilities and the road section between the washing facilities and the exit		\boxtimes		
	point paved with concrete, bituminous materials or				
	hardcores?				
B23	Are cement or dry PFA delivered in bulk stored in a				
	closed silo fitted with an audible high-level alarm		\boxtimes	Ш	
	which is interlocked with the material filling line and				
	no overfilling is allowed?				
B24	Are the activities of loading, unloading, transfer,		\boxtimes		
	handing or storage of bulk cement or dry PFA	_			
D05	carried out in a totally enclosed system or facility?				
B25	Is any vent or exhaust fitted with an effective fabric	\boxtimes			N.A.
B26	filter or equipment air pollution control system? Is the exposed earth properly treated by				
D20	compaction, turfing, hydroseeding, vegetation		\boxtimes		
	planting or sealing with latex, vinyl, bitumen,				
	shotcrete or other suitable surface stabiliser within				
	six months after last construction activity on the				
	construction site or part of the construction site				
	where the exposed earth lies?				
B27	Are the worksites wetted with water regularly?		\boxtimes		
B28	Is generation of dust avoided during loading or				
520	unloading?		\boxtimes		
B29	Are all trucks loaded to a level within the side and tail boards?		\boxtimes		

Contract No. SS H504 Design and Construction of Chai Wan Government Complex and Vehicle Depot

Report No. <u>0124-20240418</u>

B30	Are appropriate speed limit sign displayed?		\boxtimes		
B31	Are designated roads paved?		\boxtimes		
B32	Are site vehicle movements confined to designated roads?		\boxtimes		
С	Noise	N/A or Not Observed	Yes	No	Remarks / Photo
C1	Is well-maintained plant operated on-site and plant served regularly?		\boxtimes		
C2	Are vehicles and equipment switched off or throttled down while not in use?		\boxtimes		
C3	Is the noise directed away from nearby NSRs?		\boxtimes		
C4	Are the silencers or mufflers properly fitted on construction equipment and maintained regularly?		\boxtimes		
C5	Are mobile and/or noisy plant sited as far away from NSRs as possible and practicable and orientated so that the noise is directed away from nearby NSRs?		\boxtimes		
C6	Are material stockpiles, mobile container officer and other structures utilised to screen noisy activates?	\boxtimes			N.A.
C7	Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs?		\boxtimes		
C8	Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs?		\boxtimes		
C9	Is the sequencing operation of construction plants where practicable?		\boxtimes		
C10	Is the hoarding maintained properly?		\boxtimes		
C11	Do air compressors have valid noise labels?		\boxtimes		
C12	Are compressor operated with doors closed?		\boxtimes		
C13	QPME used with valid noise labels?		\boxtimes		
C14	Major noise source(s)				
		☐ Traffic			
		⊠ Construct	ion activiti	es inside	of site
		Construct	ion activiti	es outsid	e of site
		Others:			

D	Water Quality	N/A or Not Observed	Yes	No	Remarks / Photo			
Construction Activities								
D1	Are catchpits and perimeter channels constructed in advance of site formation works and earthworks?		\boxtimes					
D2	Is wastewater from temporary site facilities controlled to prevent direct discharge to surface or marine water?		\boxtimes					
D3	Is minimise surface excavation works during rainy seasons (April to September), as possible?		\boxtimes					
D4	Is the storm drainage directed to storm drains via adequately designed sand/ silt removal facilities e.g. sand traps, silt?		\boxtimes					
D5	Are channels, earth bunds or sandbag barriers provided on site to properly direct stormwater to such silt removal facilities?		\boxtimes					
D6	Are the silt removal facilities, channels and manholes maintained regularly?		\boxtimes					
D7	Are the temporary access roads surfaced with crushed stone or gravel?		\boxtimes					
D8	Is the deposited silt and grit removed regularly?		\boxtimes					
D9	Is rainwater pumped out from trenches discharged into storm drains via silt system?		\boxtimes					
D10	Are measures taken to prevent the washout of construction materials, soil, silt or debris into any drainage system?		\boxtimes					
D11	Are open stockpiles of construction materials e.g. aggregates and sand on site covered with tarpaulin or similar fabric during rainstorms?		\boxtimes					
D12	Are manholes adequately covered and temporarily sealed so as to prevent silt, construction materials or debris from getting into the drainage?		\boxtimes					
D13	Are the discharges of surface run-off into foul sewer always prevented?		\boxtimes					
D14	Is a wheel washing bay provided at every site exit?		\boxtimes					
D15	Is the wheel wash overflow directed to silt removal facilities before being discharged to the storm drain?		\boxtimes					
D16	Is the section of construction road between the wheel washing bay and the public road surfaced with crushed stone or coarse gravel?		\boxtimes					
D17	Is wastewater generated from concreting, plastering, internal decoration, cleaning work and other similar activities screened to remove large objects?	\boxtimes			N.A.			
D18	Are the vehicle and plant serving areas, vehicle wash bays and lubrication facilities located under roofed areas?		\boxtimes					
D19	Is leakage or spillages contained and cleaned up immediately?		\boxtimes					
D20	Does the surface runoff from bunded areas pass through oil/grease traps prior to discharge to the storm water system?	\boxtimes			N.A.			

D21	Are site drainage systems provided over the entire project site with sediment control facilities?		\boxtimes		
	Are sedimentation tanks or package treatment				
	systems provided to treat the large amount of		\boxtimes		
	sediment-laden wastewater generated from wheel				
D22	washing, site runoff and construction works?				
	Is the generated wastewater with high				
D23	concentrations of SS collected to the		\boxtimes		
	sedimentation tanks or package treatment systems				
	for proper treatment prior to disposal?				
D24	Is the treated wastewater reused for vehicle		\boxtimes		
	washing, dust suppression and general cleaning?				
D25	Is the sewage generated from toilets collected		\boxtimes		
	using a temporary storage system?				
D26	Is there any sediment plume observed in nearby watercourses?			\boxtimes	
	Are slit-grease traps deployed to prevent a direct				
D27	input of road surface runoff to the marine waters?	\boxtimes	Ш	Ш	N.A.
	•			l	l
		N/A or Not			
E	Waste / Chemical Management	Observed	Yes	No	Remarks / Photo
Genera	al Waste				
	Is the general waste generated on-site stored in			\boxtimes	
E1	enclosed bins or compaction units separately from				Refer to Observation 2
	the construction and chemical wastes?				
	Is the general waste collected properly by using			\boxtimes	
E2	the waste separation facilities for paper, aluminium				Refer to Observation 2
	cans, plastic bottles etc.?				
E3	Does accumulation of waste avoid?		\boxtimes		
E4	Is waste disposed regularly?		\boxtimes		
Constr	uction Waste				
E5	Are the temporary stockpiles maintained regularly?		\boxtimes		
E6	Is the excavated fill material reused for backfilling		\boxtimes		
E7	and reinstatement? Are the C&D materials sorted and recycled on-				
Li	site?		\boxtimes		
E8	Is there any contract documents provided to allow	\boxtimes			
	and promote the use of recycled aggregates where	_			Not Observed.
F 0	appropriate?				
E9	Is the disposal of C&D materials avoided onto any sensitive locations e.g. agricultural lands etc.?	\boxtimes			N.A.
E10	Are the public fill and C&D waste segregated and		\boxtimes		
	stored in different containers or skips to enhance	_	_		
	reuse or recycling of materials and their proper				
= 4.4	disposal?				
E11	Is the durable formwork or plastic facing for construction works used?	\boxtimes			N.A.
E12	Do the wooden hoardings avoid to be used?				
	-		\boxtimes		
E13	Is metal hoarding used to enhance the possibility of recycling?		\boxtimes		
E14	Is the segregation and storage of C&D wastes undertaken in designated area?		\boxtimes		

Report No. <u>0124-20240418</u>

Chai Wan Government Complex and Vehicle Depot Environmental Site Inspection Checklist (Rev. 1)

		I			1
E15	Are waste storage area properly cleaned and do not cause windblown litter and dust nuisance?		\boxtimes		
E16	Do the excavated materials appear contaminated?			\boxtimes	
E17	If suspected contaminated, appropriate procedures followed?	\boxtimes			N.A.
Chemic	cal / Fuel Storage Area				
E18	Are the fuel tanks and chemical storage areas	П	\boxtimes		
	provided with locks and sited on sealed areas?				
E19	Are the storage area enclosed 3 sides by walls/		\boxtimes		
	fence of ≥2m tall and bounded with adequate bund			Ш	
	capacity (>110% of largest container) or do the				
	storage area allow storage of 20% of total volume				
	of waste?				
E20	Are the storage areas labelled and separated (if		\boxtimes		
	needed)?			Ш	
E21	Do the storage areas have adequate ventilation				
	and be covered to prevent rainfall entering?		\boxtimes		
E22	Are the containers used for the storage of chemical				
	wastes suitable for the substance that are holding,		\boxtimes		
	resist to corrosion, maintained in a good condition,				
	and securely closed?				
E23	If no specification has been approved by EPD, are				
LZS	container with <450L capacity provided for storage		\boxtimes		
	of chemicals waste?				
	cal Waste / Waste Oil				
E24	Is chemical waste or waste oil stored and labelled		\boxtimes		
	in English and Chinese properly in designated				
	area?				
E25	Are chemicals and waste oil recycled or disposed		\boxtimes		
	properly?				
E26	Is waste oil collected and stored for recycling or			\boxtimes	Defer to Observation 2
	disposal?				Refer to Observation 3
Record	<u>ls</u>				
E27	Is a licensed waste haulier used for waste		\square		
	collection?		\boxtimes		
E28	Are the records of quantities of wastes generated,				
	recycled, and disposed properly kept?		\boxtimes		
E29	For the demolition material/ waste, is the number				
	of loads for each day recorded as appropriate?	\boxtimes			N.A.
	cc.cc. bacif day foodface do appropriato.				

F	Landscape and Visual Impacts	N/A or Not Observed	Yes	No	Remarks / Photo
F1	Is the work site confined within site boundaries?		\boxtimes		
F2	Is damage to surrounding areas avoided?		\boxtimes		
F3	Is the hoardings with aesthetic treatment provided and designed to be subtle and camouflaged?		\boxtimes		
F4	Is the temporary landscape treatment provided (such as the provision of temporary landscape planting around the Site office in ornamental pots and application of green roof for Site office)?				
F5	Are the protective fencing erected along or beyond the perimeter of the tree protection zone of each individual tree?	\boxtimes			To be implemented before demolition of hoarding
G	Environmental Complaint	N/A or Not Observed	Yes	No	Remarks / Photo
G1	Number of Environmental Complaint received from 11/11/2021 to 18/04/2024			\boxtimes	
Н	General Housekeeping	N/A or Not Observed	Yes	No	Remarks / Photo
H1	Are potential stagnant pools cleared and mosquito breeding prevented?		\boxtimes		
H2	Are the defined boundaries of working areas identified to prevent loss of vegetation		\boxtimes		
ı	Others	N/A or Not Observed	Yes	No	Remarks / Photo
I1	Are the portable toilets maintained in a state, which will not deter the workers from utilizing these portable toilets?				

Follow up action for previous Site Inspection:

5 April 2024 Observation

- 1. The general waste on the floor was cleaned, and the enclosed bin and collection point were provided for waste collection. (Photo F1-2)
- 2. The accumulation of waste oil and other waste in the chemical drip tray were cleaned. The chemical container was removed. (Photo F3-4)

11 April 2024 Observation

1. The waste storage area was designed, and waste disposal was arranged daily. General waste and C&D waste were disposed of regularly. (Photo F5-6)





Photo F1



Photo F2



Photo F3

Photo F4





Photo F5 Photo F6

Observation(s):

- 1. NRMM label shall be fixed on the forklift. (Photo 1)
- 2. The general waste shall be collected and stored in the enclosed bin. (Photo 2)
- 3. The chemical containers should be placed on the impervious sheet and stored in the drip tray. (Photo 3)





Photo 1

Photo 2



Photo 3

Corrective Actions - Mitigation Measures Implemented or Proposed (if any):

- 1. The contractor has been recommended to display the NRMM label on the forklift.
- 2. The contractor has been advised to arrange more frequent site cleanings to keep the site clean and tidy.
- 3. The contractor has been reminded to provide impervious sheet and chemical drip tray for placing and storing chemical containers to prevent chemical leakage.

	Environmental Team Representative:	IEC's Representative:	Contractor's Representative:	Engineer's Representative
Signature:	4	/	2	1
Name:	Joan Lo	/	Desmond Ho	K.Y. YIP (SUPD/ACW) for SUPD/COW
Date:	18 April 2024	/	18 April 2024	18 April 2024

Report No. _0125-20240425___

Chai Wan Government Complex and Vehicle Depot Environmental Site Inspection Checklist (Rev. 1)

Inspection Date: 25 April 2024 Inspec		Inspected By:		Joan Lo			
Time:		10:00 – 11:00	Weather Condition	:		Cloudy	
Partic	ipants:	Mr. K.H Wong (Engineer's Represer	ntative); Desmond H	Ho (Contra	ctor); Joa	n Lo (ET)	
Α	Permits/Lic	enses	N/A or Not Observed	Yes	No	Remarks / Photo	
A1		mental Permit, license/ other permit major site exit and vehicle access?		\boxtimes		EP No.: EP-505/2015/A	
A2		ction Noise Permits available for osted at site entrance.		\boxtimes		CNP No: GW-RS0090-24	
A3	Is wastewat inspection?	er discharge licence available for		\boxtimes			
A4		ets for chemical waste and constructio sal available for inspection?	n 🗆	\boxtimes			
A5			ole 🗆	\boxtimes			
В	Air Quality		N/A or Not Observed	Yes	No	Remarks / Photo	
B1	Is open burr	ning avoided?		\boxtimes			
B2	Are complet practicable?	ed earthworks sealed as soon as		\boxtimes			
В3		d equipment well maintained (i. e. k smoke from powered plant)?		\boxtimes			
B4		abels properly affixed on the PMEs?		\boxtimes			
B5	Any remedia	al action undertaken?				N.A.	
B6	Observed de	ust source(s)	1				
			☐ Wind eros	sion			
				quipment	Moveme	nts	
			☐ Loading/	Loading/ unloading of materials			
			Others:	Others:			
B7	-	d areas/ designated roads watered avoid dust generation?		\boxtimes			
B8	-	aterials covered entirely by impervious sprayed with water to maintain the	s 🗆	\boxtimes			

Chai Wan Government Complex and Vehicle Depot

Environmental Site Inspection Checklist (Rev. 1)

Report No. <u>0125-20240425</u>

B12	Are wheel washing facilities with high pressure water jet provided at all site exits if practicable?		\boxtimes		
B13	Are all vehicles and plant cleaned before they leave				
	the construction site?		\boxtimes	Ш	
B14	Are hoarding ≥ 2.4m tall provided beside roads or		\boxtimes		
	area with public access?				
B15	Is the portion of any road leading only to		\boxtimes		
	construction site (within 30m of a vehicle entrance			Ш	
	or exit) kept clear of dusty materials?				
B16	Are surfaces where any pneumatic or power-driven		\boxtimes		
	drilling, cutting, polishing or other mechanical				
	breaking operations takes place sprayed with water				
	or a dust suppression chemical continuously?				
B17	Is the area involved demolition activities sprayed	\boxtimes			
	with water or a dust suppression chemical				
	immediately prior to, during and immediately after				N.A.
	the activities so as to maintain the entire surface				
	wet?				
B18	Is scaffolding erected around the perimeter of a		\boxtimes		
D40	building under construction?	_			
B19	Are effective dust screens, sheeting or netting provided to enclose the scaffolding from the ground		\boxtimes		
	floor level of the building, or a canopy provided from				
	the first floor level up to the highest level of the				
	scaffolding?				
B20	Is the skip hoist for materials transport enclosed by				
D20	impervious sheeting?	\boxtimes			N.A.
B21	Is every stock of more than 20 bags of cement or				
	dry pulverized fuel ash (PFA) covered entirely by	\boxtimes		Ш	
	impervious sheeting or placed in an area sheltered				N.A.
	on the top and 3 sides?				
B22	Are the areas of washing facilities and the road		\boxtimes		
	section between the washing facilities and the exit			Ш	
	point paved with concrete, bituminous materials or				
	hardcores?				
B23	Are cement or dry PFA delivered in bulk stored in a		\boxtimes		
	closed silo fitted with an audible high-level alarm	Ш.	2 3		
	which is interlocked with the material filling line and				
	no overfilling is allowed?				
B24	Are the activities of loading, unloading, transfer,		\boxtimes		
	handing or storage of bulk cement or dry PFA				
Doc	carried out in a totally enclosed system or facility?				
B25	Is any vent or exhaust fitted with an effective fabric	\boxtimes			N.A.
B26	filter or equipment air pollution control system? Is the exposed earth properly treated by				
D20	compaction, turfing, hydroseeding, vegetation		\boxtimes		
	planting or sealing with latex, vinyl, bitumen,				
	shotcrete or other suitable surface stabiliser within				
	six months after last construction activity on the				
	construction site or part of the construction site				
	where the exposed earth lies?				
B27	Are the worksites wetted with water regularly?				
			\boxtimes		
B28	Is generation of dust avoided during loading or		\boxtimes		
	unloading?				
B29	Are all trucks loaded to a level within the side and		\boxtimes		
1	tail boards?		Ī		

Contract No. SS H504 Design and Construction of Chai Wan Government Complex and Vehicle Depot

Report No. <u>0125-20240425</u>

B30	Are appropriate speed limit sign displayed?		\boxtimes		
B31	Are designated roads paved?		\boxtimes		
B32	Are site vehicle movements confined to designated roads?		\boxtimes		
С	Noise	N/A or Not Observed	Yes	No	Remarks / Photo
C1	Is well-maintained plant operated on-site and plant served regularly?		\boxtimes		
C2	Are vehicles and equipment switched off or throttled down while not in use?		\boxtimes		
C3	Is the noise directed away from nearby NSRs?		\boxtimes		
C4	Are the silencers or mufflers properly fitted on construction equipment and maintained regularly?		\boxtimes		
C5	Are mobile and/or noisy plant sited as far away from NSRs as possible and practicable and orientated so that the noise is directed away from nearby NSRs?		\boxtimes		
C6	Are material stockpiles, mobile container officer and other structures utilised to screen noisy activates?	\boxtimes			N.A.
C7	Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs?		\boxtimes		
C8	Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs?		\boxtimes		
C9	Is the sequencing operation of construction plants where practicable?		\boxtimes		
C10	Is the hoarding maintained properly?		\boxtimes		
C11	Do air compressors have valid noise labels?		\boxtimes		
C12	Are compressor operated with doors closed?		\boxtimes		
C13	QPME used with valid noise labels?		\boxtimes		
C14	Major noise source(s)				
		Traffic			
	Construction activities inside of site				
		Construct	ion activiti	es outsid	e of site
		Others:			

D	Water Quality	N/A or Not Observed	Yes	No	Remarks / Photo			
Construction Activities								
D1	Are catchpits and perimeter channels constructed in advance of site formation works and earthworks?		\boxtimes					
D2	Is wastewater from temporary site facilities controlled to prevent direct discharge to surface or marine water?		\boxtimes					
D3	Is minimise surface excavation works during rainy seasons (April to September), as possible?		\boxtimes					
D4	Is the storm drainage directed to storm drains via adequately designed sand/ silt removal facilities e.g. sand traps, silt?		\boxtimes					
D5	Are channels, earth bunds or sandbag barriers provided on site to properly direct stormwater to such silt removal facilities?		\boxtimes					
D6	Are the silt removal facilities, channels and manholes maintained regularly?		\boxtimes					
D7	Are the temporary access roads surfaced with crushed stone or gravel?		\boxtimes					
D8	Is the deposited silt and grit removed regularly?		\boxtimes					
D9	Is rainwater pumped out from trenches discharged into storm drains via silt system?		\boxtimes					
D10	Are measures taken to prevent the washout of construction materials, soil, silt or debris into any drainage system?		\boxtimes					
D11	Are open stockpiles of construction materials e.g. aggregates and sand on site covered with tarpaulin or similar fabric during rainstorms?		\boxtimes					
D12	Are manholes adequately covered and temporarily sealed so as to prevent silt, construction materials or debris from getting into the drainage?		\boxtimes					
D13	Are the discharges of surface run-off into foul sewer always prevented?		\boxtimes					
D14	Is a wheel washing bay provided at every site exit?		\boxtimes					
D15	Is the wheel wash overflow directed to silt removal facilities before being discharged to the storm drain?		\boxtimes					
D16	Is the section of construction road between the wheel washing bay and the public road surfaced with crushed stone or coarse gravel?		\boxtimes					
D17	Is wastewater generated from concreting, plastering, internal decoration, cleaning work and other similar activities screened to remove large objects?	\boxtimes			N.A.			
D18	Are the vehicle and plant serving areas, vehicle wash bays and lubrication facilities located under roofed areas?		\boxtimes					
D19	Is leakage or spillages contained and cleaned up immediately?		\boxtimes					
D20	Does the surface runoff from bunded areas pass through oil/grease traps prior to discharge to the storm water system?	\boxtimes			N.A.			

Chai Wan Government Complex and Vehicle Depot

Report No. <u>0125-20240425</u>

		,			
D21	Are site drainage systems provided over the entire project site with sediment control facilities?		\boxtimes		
	Are sedimentation tanks or package treatment				
	systems provided to treat the large amount of	_		_	
	sediment-laden wastewater generated from wheel		\boxtimes		
D22	washing, site runoff and construction works?				
	Is the generated wastewater with high				
	concentrations of SS collected to the				
D23	sedimentation tanks or package treatment systems		\boxtimes		
	for proper treatment prior to disposal?				
D24	Is the treated wastewater reused for vehicle		\boxtimes		
	washing, dust suppression and general cleaning?				
D25	Is the sewage generated from toilets collected		\boxtimes		
	using a temporary storage system?				
D26	Is there any sediment plume observed in nearby			\boxtimes	
D20	watercourses?				
D07	Are slit-grease traps deployed to prevent a direct	\square			NI A
D27	input of road surface runoff to the marine waters?	\boxtimes		Ш	N.A.
	•				
E	Waste / Chemical Management	N/A or Not	Yes	No	Remarks / Photo
	-	Observed			
Genera	al Waste				
	Is the general waste generated on-site stored in			\boxtimes	
E1	enclosed bins or compaction units separately from				Refer to Observation 1
	the construction and chemical wastes?				
	Is the general waste collected properly by using				
E2	the waste separation facilities for paper, aluminium	Ш	\boxtimes	Ш	
	cans, plastic bottles etc.?				
_	·				
E3	Does accumulation of waste avoid?				Refer to Observation 1
E4	Is waste disposed regularly?		\boxtimes		
Constr	uction Waste				
E5					
	Are the temporary stockpiles maintained regularly?		\boxtimes		
E6	Is the excavated fill material reused for backfilling		\boxtimes		
	and reinstatement?				
E7	Are the C&D materials sorted and recycled on-		\boxtimes		
	site?				
E8	Is there any contract documents provided to allow	\boxtimes			
	and promote the use of recycled aggregates where				Not Observed.
	appropriate?				
E9	Is the disposal of C&D materials avoided onto any				
	sensitive locations e.g. agricultural lands etc.?	\boxtimes		Ш	N.A.
E10					
	Are the public fill and C&D waste segregated and				
	Are the public fill and C&D waste segregated and stored in different containers or skips to enhance			\boxtimes	
	stored in different containers or skips to enhance			\boxtimes	Refer to Observation 1
210	stored in different containers or skips to enhance reuse or recycling of materials and their proper				Refer to Observation 1
	stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal?				Refer to Observation 1
E11	stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal? Is the durable formwork or plastic facing for				Refer to Observation 1 N.A.
E11	stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal? Is the durable formwork or plastic facing for construction works used?				
	stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal? Is the durable formwork or plastic facing for				
E11	stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal? Is the durable formwork or plastic facing for construction works used? Do the wooden hoardings avoid to be used?				
E11 E12 E13	stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal? Is the durable formwork or plastic facing for construction works used? Do the wooden hoardings avoid to be used? Is metal hoarding used to enhance the possibility of recycling?				
E11	stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal? Is the durable formwork or plastic facing for construction works used? Do the wooden hoardings avoid to be used? Is metal hoarding used to enhance the possibility				

Chai Wan Government Complex and Vehicle Depot

Report No. <u>0125-20240425</u>

E15	Are waste storage area properly cleaned and do not cause windblown litter and dust nuisance?		\boxtimes		
E16	Do the excavated materials appear contaminated?			\boxtimes	
E17	If suspected contaminated, appropriate procedures followed?	\boxtimes			N.A.
Chemi	cal / Fuel Storage Area				
E18	Are the fuel tanks and chemical storage areas provided with locks and sited on sealed areas?		\boxtimes		
E19	Are the storage area enclosed 3 sides by walls/ fence of ≥2m tall and bounded with adequate bund capacity (>110% of largest container) or do the storage area allow storage of 20% of total volume of waste?				
E20	Are the storage areas labelled and separated (if needed)?		\boxtimes		
E21	Do the storage areas have adequate ventilation and be covered to prevent rainfall entering?		\boxtimes		
E22	Are the containers used for the storage of chemical wastes suitable for the substance that are holding, resist to corrosion, maintained in a good condition, and securely closed?		\boxtimes		
E23	If no specification has been approved by EPD, are container with <450L capacity provided for storage of chemicals waste?		\boxtimes		
Chemi	cal Waste / Waste Oil				
E24	Is chemical waste or waste oil stored and labelled in English and Chinese properly in designated area?		\boxtimes		
E25	Are chemicals and waste oil recycled or disposed properly?		\boxtimes		
E26	Is waste oil collected and stored for recycling or disposal?			\boxtimes	Refer to Observation 2
Record	<u>ls</u>				
E27	Is a licensed waste haulier used for waste collection?		\boxtimes		
E28	Are the records of quantities of wastes generated, recycled, and disposed properly kept?		\boxtimes		
E29	For the demolition material/ waste, is the number of loads for each day recorded as appropriate?	\boxtimes			N.A.
	-				

Chai Wan Government Complex and Vehicle Depot Environmental Site Inspection Checklist (Rev. 1)

F	Landscape and Visual Impacts	N/A or Not Observed	Yes	No	Remarks / Photo
F1	Is the work site confined within site boundaries?		\boxtimes		
F2	Is damage to surrounding areas avoided?		\boxtimes		
F3	Is the hoardings with aesthetic treatment provided and designed to be subtle and camouflaged?		\boxtimes		
F4	Is the temporary landscape treatment provided (such as the provision of temporary landscape planting around the Site office in ornamental pots and application of green roof for Site office)?				
F5	Are the protective fencing erected along or beyond the perimeter of the tree protection zone of each individual tree?	\boxtimes			To be implemented before demolition of hoarding
G	Environmental Complaint	N/A or Not Observed	Yes	No	Remarks / Photo
		Observed			
G1	Number of Environmental Complaint received from 11/11/2021 to 25/04/2024			\boxtimes	
G1	·				
G1 H	·	N/A or Not Observed	Yes	No	Remarks / Photo
	from 11/11/2021 to 25/04/2024	N/A or Not	Yes		Remarks / Photo
Н	General Housekeeping Are potential stagnant pools cleared and mosquito	N/A or Not			Remarks / Photo
H	General Housekeeping Are potential stagnant pools cleared and mosquito breeding prevented? Are the defined boundaries of working areas	N/A or Not	\boxtimes		Remarks / Photo
H	General Housekeeping Are potential stagnant pools cleared and mosquito breeding prevented? Are the defined boundaries of working areas	N/A or Not	\boxtimes		Remarks / Photo Remarks / Photo

Follow up action for previous Site Inspection:

Waiting for Contractor' Input

Observation(s):

- 1. The accumulation of general waste and the C&D waste on the floor is observed. (Photo 1-3)
- 2. The chemical containers should be placed on the impervious sheet and stored in the drip tray, and oil stain is found in the work area. (Photo 4-5)





Photo 2

Photo 1








Photo 5

Corrective Actions – Mitigation Measures Implemented or Proposed (if any):

- 1. The contractor has been recommended to provide more enclosed bins and waste skips for waste collection and storage, as well as increase the frequency of waste disposal to prevent waste accumulation.
- The contractor has been reminded to provide impervious sheet and chemical drip tray for placing and storing chemical containers to prevent chemical leakage. Also, they should clean up the oil stain immediately and dispose of it as chemical waste.

	Environmental Team Representative:	IEC's Representative:	Contractor's Representative:	Engineer's Representative
Signature:	4	/	7)1.	1
Name:	Joan Lo	/	Desmond Ho	K.Y. YIP (SUPD/ACW) for SUPD/COW
Date:	25 April 2024	1	25 April 2024	25 April 2024

Appendix 10

2024	May					
MONDAY 29	TUESDAY 30	WEDNESDAY 01	THURSDAY 02 Noise Monitoring (NM1, NM2b and NM3)	FRIDAY 03	SATURDAY 04	SUNDAY 05
06	07 Noise Monitoring (NM1, NM2b and NM3)	08	09	10	11	12
13	14 Noise Monitoring (NM1, NM2b and NM3)	15	16	17	18	19
20	21 Noise Monitoring (NM1, NM2b and NM3)	22	23	24	25	26
27	28 Noise Monitoring (NM1, NM2b and NM3)	29	30	31	01	02
03	04	Notes:				

Appendix 11

There was no Notification of Environmental Quality Limits Exceedance in the reporting month.

Prepared by:

Aurecon Hong Kong Limited
Unit 1608, 16/F, Tower B, Manulife Financial Centre,
223 – 231 Wai Yip Street, Kwun Tong,

Kowloon Hong Kong S. A. R.

T: +852 3664 6888 F: +852 3664 6999

E: hongkong@aurecongroup.com



